documentation

ROHDE&SCHWARZ

MP MASTER
MA34434

Digitized by the Internet Archive
in 2025

https://archive.org/details/manualsplus_07031

Operating Manual

Measuring Receiver

R&S® FSMR 3
1166.3311.03

R&S® FSMR 26
1166.3311.26

R&S® FSMR 50
1166.3311.50

Volume 1
This Operating Manual consists of 2 volumes

Printed in the Federal
Republic of Germany

ROHDE&SCHWARZ
Test and Measurement Division

R&S® is a registered trademark of Rohde & Schwarz GmbH & Co. KG
Trade names are trademarks of the owners

Tabbed Divider Overview

Volume 1

Data Sheet

Safety Instructions
Certificate of Quality
EU Certificate of Conformity
List of R&S Representatives

Manuals for Measuring Receiver FSMR

Tabbed Divider

1	Chapter 1:	Putting into Operation
2	Chapter 2:	Getting Started (follow)
3	Chapter 3:	Operation
4	Chapter 4:	Functional Description
10	Chapter 10:	Index

Volume 2

Data Sheet

Safety Instructions

Manuals for Measuring Receiver FSMR

Tabbed Divider

5	Chapter 5:	Remote Control – Basics
6	Chapter 6:	Remote Control – Commands
7	Chapter 7:	Remote Control – Program Examples
8	Chapter 8:	Maintenance and Hardware Interfaces
9	Chapter 9:	Error Messages
10	Chapter 10:	Index

Product brochure

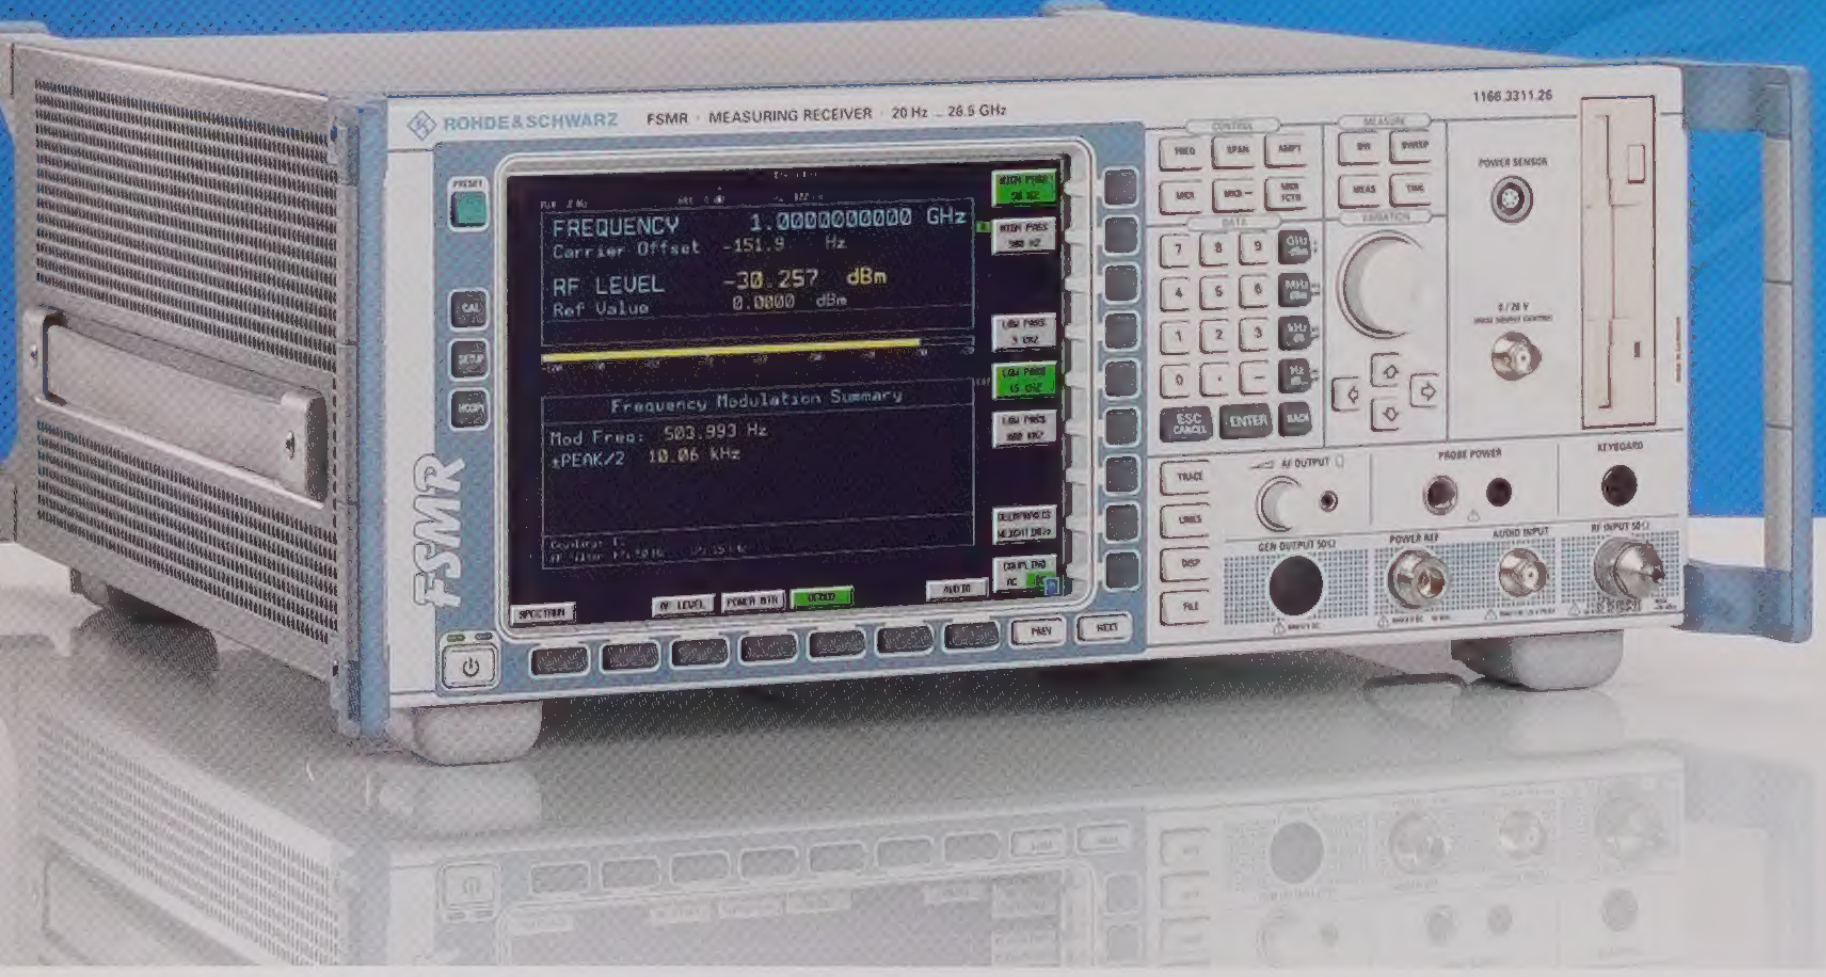
ROHDE&SCHWARZ FSMR · MEASURING RECEIVER · 20 Hz ... 26.5 GHz
FSMR
FREQUENCY 1.0000000000 GHz
RF LEVEL -30.257 dBm
Frequency Modulation Summary

Versi
01.
Novemb
20

Measuring Receiver R&S®FSMR

All-in-one solution for the calibration of signal generators and attenuators

- Frequency range from 20 Hz to 3/26.5/50 GHz
- High level linearity of 0.005 dB deviation per 10 dB for the precise calibration of level and attenuation
- Wide level measurement range: +30 dBm to –130 dBm
- Direct connection of power sensors for accurate power measurements
- Measurement of modulation depth, frequency deviation and phase deviation with <1 % measurement uncertainty
- Audio analysis with automatic measurement of modulation frequency, THD and SINAD
- Display of audio signals and demodulated signals in frequency and time domain
- Audio input for calibration of modulation generators
- Fast RF frequency counter with 0.01 Hz resolution
- Control of all functions incl. power meter from front panel or via IEC/IEEE bus or LAN
- Full-featured spectrum analyzer

ROHDE&SCHWARZ

R&S®FSMR – all-in-one solution for signal generator calibration

The Measuring Receiver R&S®FSMR has been specially designed to handle the measurement tasks involved in the calibration of signal generators and fixed or adjustable attenuators.

The R&S®FSMR combines the functionality of several instruments in one:

- Highly accurate level calibrator
- Modulation analyzer
- Audio analyzer with THD and SINAD measurement functionality
- Power meter for connection of R&S®NRP power sensors
- High-performance spectrum analyzer

In particular, the R&S®FSMR features characteristics that are important in calibration labs:

- Very high level stability versus time and temperature
- Easy control of all functions
- Parameters traceable to national standards; documented calibration procedure for R&S®FSMR
- 50 MHz reference source for adjustment of power sensors (not required for R&S®NRP power sensors)
- Separate audio input
- Remote control of all functions via IEC/IEEE bus

The R&S®FSMR is thus capable of calibrating all vital parameters of a signal generator:

- Output level accuracy down to –130 dBm
- Carrier frequency accuracy
- Setting accuracy of modulation depth and modulation deviation
- Modulation frequency response
- Modulation frequency
- Modulation distortion
- Spurious modulation, weighted and unweighted

The R&S®FSMR family

R&S®FSMR 3	20 Hz to 3.6 GHz
R&S®FSMR 26	20 Hz to 26.5 GHz
R&S®FSMR 50	20 Hz to 50 GHz

Plus, the R&S®FSMR offers full spectrum analyzer functionality, e.g. for measuring harmonics or phase noise. The base unit does not provide for image frequency rejection in the range above 3.6 GHz, since the YIG filters normally used for this would impair level linearity. The optional YIG preselection filter makes the R&S®FSMR a full-featured spectrum analyzer also in the microwave range. The tracking YIG filter can be switched off for accurate level calibration.

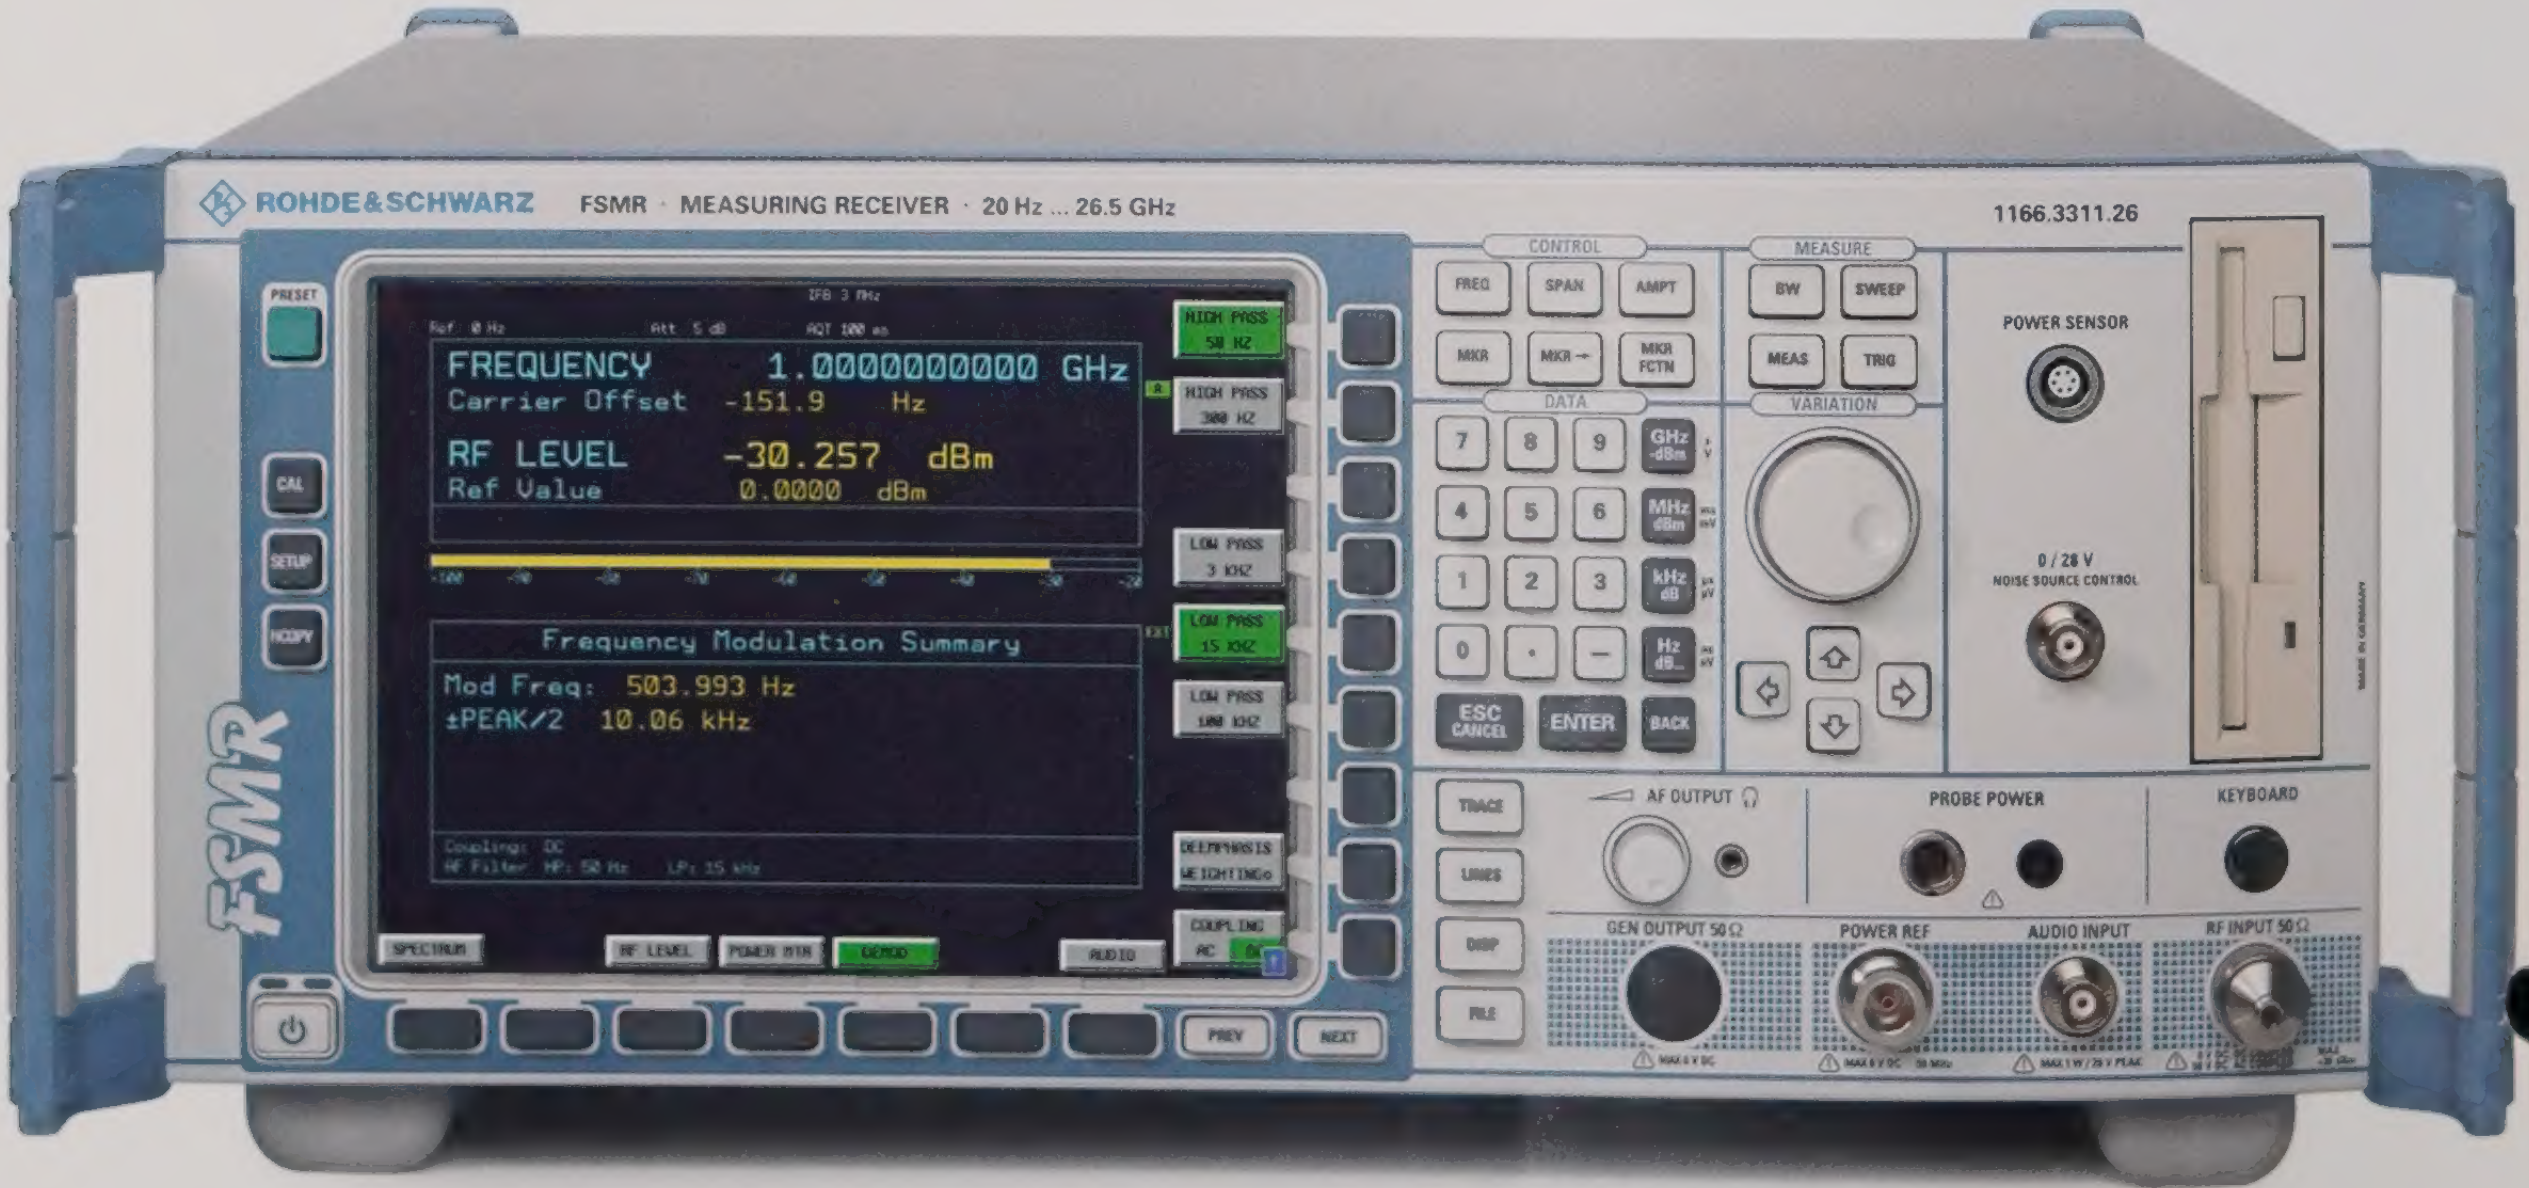

Condensed data

	R&S®FSMR 3	R&S®FSMR 26	R&S®FSMR 50
Frequency range	100 kHz to 3.6 GHz	100 kHz to 26.5 GHz	100 kHz to 50 GHz
Reference frequency	aging: 1×10^{-7}/year, optionally 2×10^{-8}/year		
Relative level, linearity	0.015 dB + 0.005 dB per 10 dB		
AM modulation measurements			
Modulation depth	0 % to 100 %		
Measurement uncertainty	1 % of reading, 50 Hz to 50 kHz; 0.4 % of reading, 90 Hz to 150 Hz, in a range of 5 % to 99 %		
Modulation frequency	50 Hz to 100 kHz		
Inherent distortion	0.3 %		
FM modulation measurements			
Frequency deviation	max. 500 kHz		
Measurement uncertainty	1 % of reading, 50 Hz to 100 kHz		
Modulation frequency	50 Hz to 200 kHz		
Inherent distortion	0.1 %		
φM modulation measurements			
Phase deviation	max. 10 000 rad		
Measurement uncertainty	1 % of reading, 50 Hz to 100 kHz		
Modulation frequency	50 Hz to 100 kHz		
Inherent distortion	0.1 %		
Audio measurements			
Frequency range	DC, 20 Hz to 1 MHz		
Level ranges	0.4 V, 4 V		
Measurement uncertainty	1 % of reading, 20 Hz to 100 kHz		
Spectrum analyzer			
Frequency range	20 Hz to 3.6 GHz	20 Hz to 26.5 GHz	20 Hz to 50 GHz
Resolution bandwidths	10 Hz to 50 MHz; FFT filters: 1 Hz to 30 kHz; channel filters; EMI bandwidths		
Video bandwidth	1 Hz to 10 MHz		
Displayed average noise level (RBW 10 Hz)			
1 GHz	typ. –148 dBm	typ. –146 dBm	typ. –146 dBm
26 GHz	–	typ. –141 dB	typ. –143 dBm
50 GHz	–	–	typ. –121 dBm
Trace detectors	max peak, min peak, auto peak, sample, RMS, average, quasi-peak		
Phase noise	typ. –123 dBc (1 Hz) at 10 kHz from carrier		
Sweep time			
Span >10 Hz	2.5 ms to 16 000 s		
Span 0 Hz (zero span)	1 µs to 16 000 s		
Image frequency rejection			
f < 3.6 GHz	typ. 110 dB		
f > 3.6 GHz	–	0 dB	
f > 3.6 GHz, with option R&S®FSMR-B2	–	typ. 100 dB	

Level calibration – precise, repeatable and easy to handle

Linearity and level stability

The linearity of the R&S®FSMR is almost exclusively determined by its high-quality A/D converter and the limits of traceability of calibration. Modules and components on which drift (YIG filter) or nonlinear level response (crystal filter) may occur are switched off during level calibration. As a result, the R&S®FSMR features linearity values equal to or even better than those of the present industry standard.

High tolerance with respect to frequency drift and residual FM

The R&S®FSMR measures the signal level within the selectable measurement bandwidth. For signals within the measurement bandwidth, level measurement is not affected by frequency drift, frequency deviation or residual FM. Featuring a large, selectable measurement bandwidth from 100 Hz to 10 MHz, the R&S®FSMR is insensitive to frequency offset or residual FM of the generator to be calibrated. Very small levels are measured using the "narrow" detector, which determines the signal power within the measurement bandwidth with FFT at a reduced noise bandwidth. This yields an improved signal-to-noise ratio without increasing the effect of frequency offset or residual FM.

Supported power meters

The absolute power and the reference power are measured with high accuracy by a power meter. The power meter can be connected to the generator output or operated in parallel with the analyzer input via a power splitter. The R&S®FSMR automatically corrects the power splitter's frequency response and insertion loss based on an internally stored correction table.

Type designation	Sensor type	Frequency range
R&S®NRP-Z11	200 mW diode sensor	0.01 GHz to 8 GHz
R&S®NRP-Z21	200 mW diode sensor	0.01 GHz to 18 GHz
R&S®NRP-Z22	2 W diode sensor	0.01 GHz to 18 GHz
R&S®NRP-Z23	15 W diode sensor	0.01 GHz to 18 GHz
R&S®NRP-Z24	30 W diode sensor	0.01 GHz to 18 GHz
R&S®NRP-Z51	100 mW thermal sensor	0 Hz to 18 GHz
R&S®NRP-Z55	100 mW thermal sensor	0 Hz to 40 GHz

Power sensors from Rohde & Schwarz suitable for use with the R&S®FSMR.

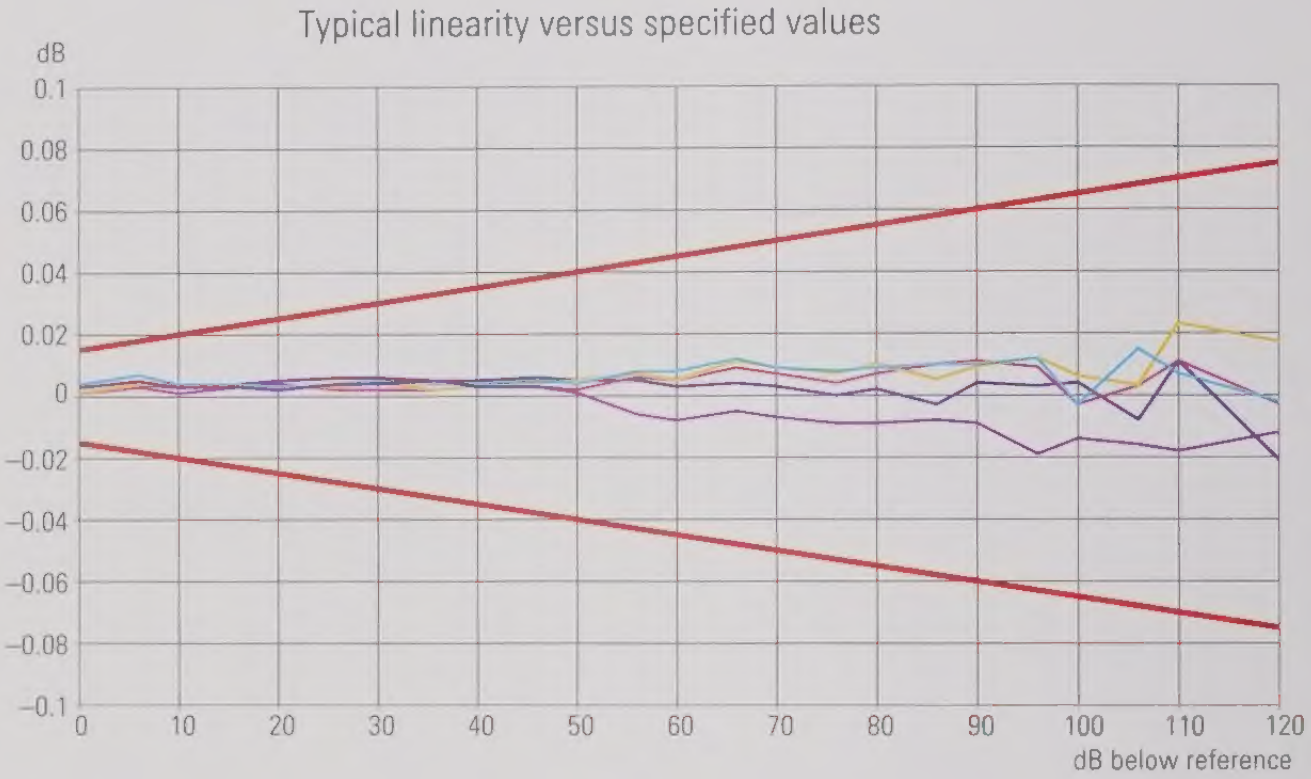

Typical linearity values.

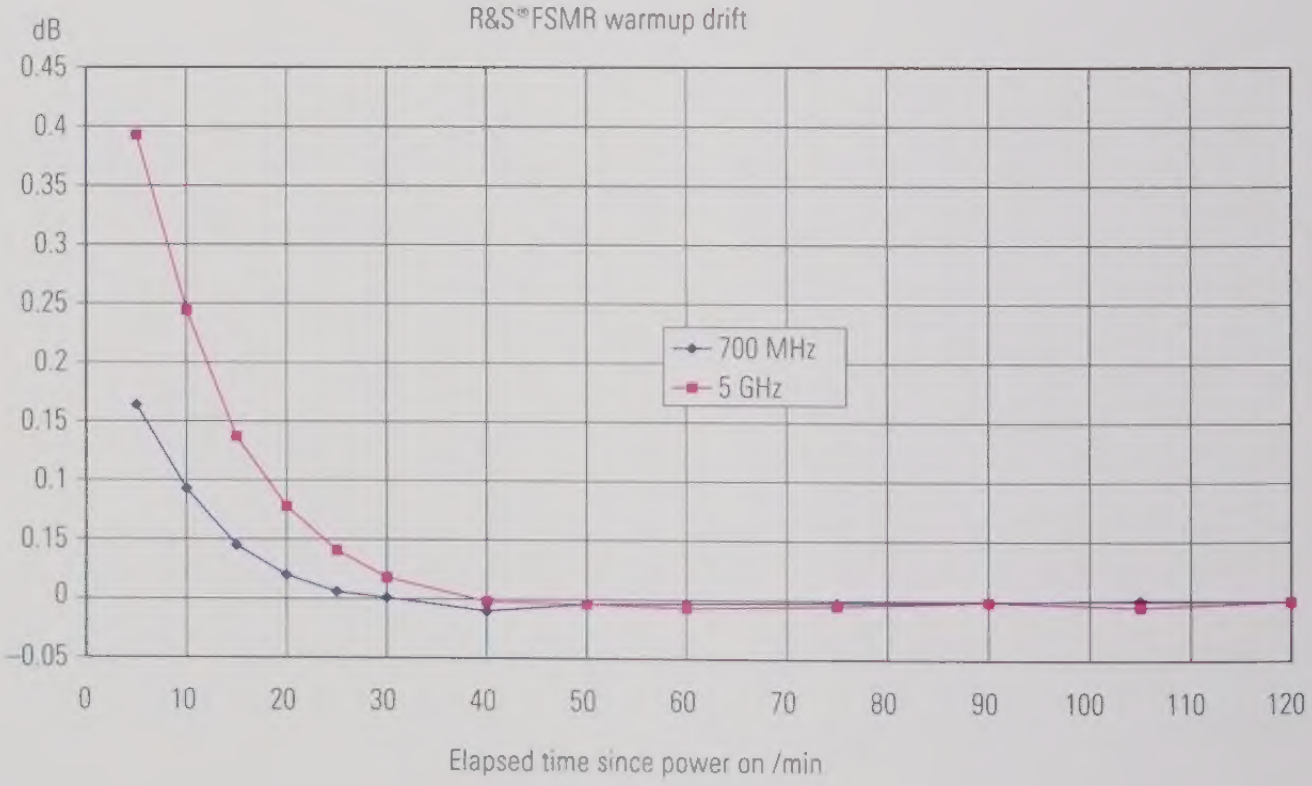

After warmup, the R&S®FSMR offers excellent level stability. This allows measurements to be performed with high accuracy over extended periods of time, for example during manual calibration.

The following power meters of other makes are supported in addition:

- ◆ ML2438A
- ◆ 438A
- ◆ 437B
- ◆ E4417A

The R&S®FSMR controls the power meter via its second IEC/IEEE bus connector. The power meter is operated from the R&S®FSMR front panel. This means that operation is just as easy for power meters of other makes as it is for power meters from Rohde & Schwarz. Remote control via the IEC/IEEE bus is still only via the R&S®FSMR. Calibration labs can thus continue to use their existing power meters.

Easy operation for level calibration over a wide level range

To perform measurements over the full level range of conventional RF generators, e.g. from –130 dBm to +10 dBm, it is necessary to switch the R&S®FSMR's built-in RF attenuator or the IF gain as required. The R&S®FSMR eliminates any level errors that may occur as a result of range switching by calibrating the adjacent range prior to switchover. The user can thus benefit from the instrument's high linearity of 0.015 dB + 0.005 dB deviation per 10 dB across the complete level range. Level calibration is carried out in just a few steps. The complete setup, including the power meter connected to the measuring receiver, is operated via the R&S®FSMR front panel.

The procedure is as follows:

- ◆ Step 1: Set the measurement frequency. The R&S®FSMR measurement range is then automatically set to the level of the incoming signal (AUTORANGE function).
- ◆ Step 2: Perform a reference measurement with the power meter by means of CAL ABS POWER. The R&S®FSMR is now ready for level calibration, which is indicated by the CAL field turning green.
- ◆ Step 3: Reduce the level of the device to be calibrated in the required steps and verify the level. If the test signal is outside the usable measurement range of the R&S®FSMR, a prompt is issued to calibrate the adjacent range.
- ◆ Step 4: Calibrate the adjacent range with the RECAL key. The R&S®FSMR automatically switches the measurement range

Step 1

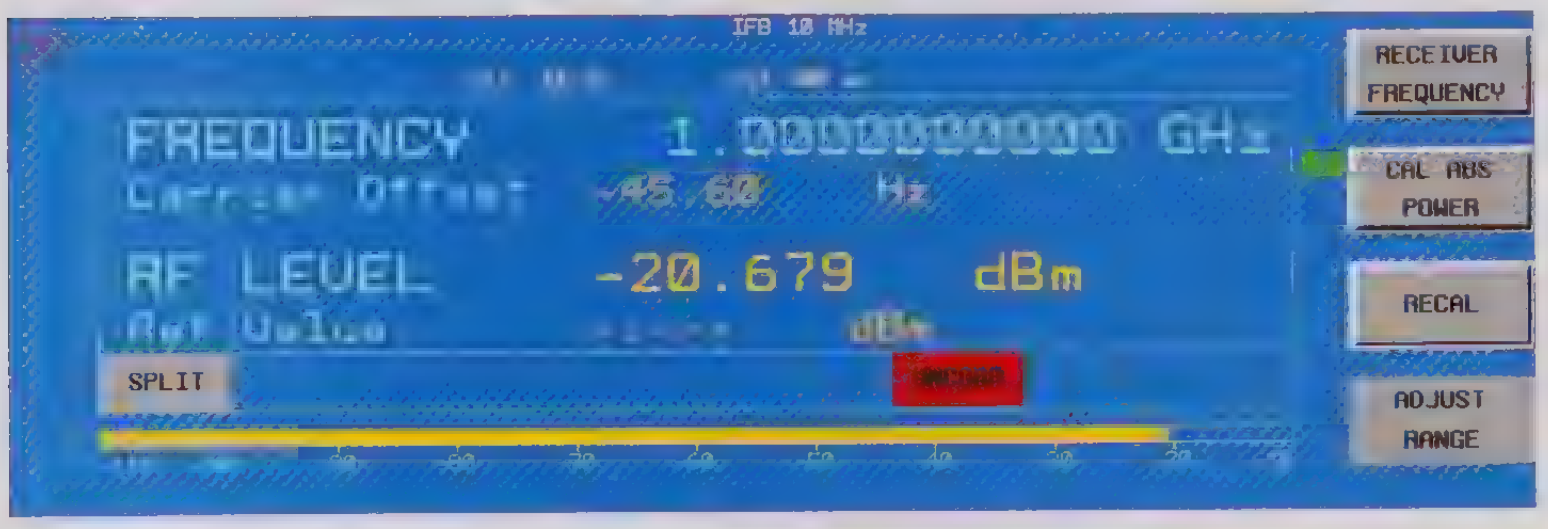
FREQUENCY 1.0000000000 GHz
Carrier Offset -45.60 Hz
RF LEVEL -20.679 dBm

Step 2

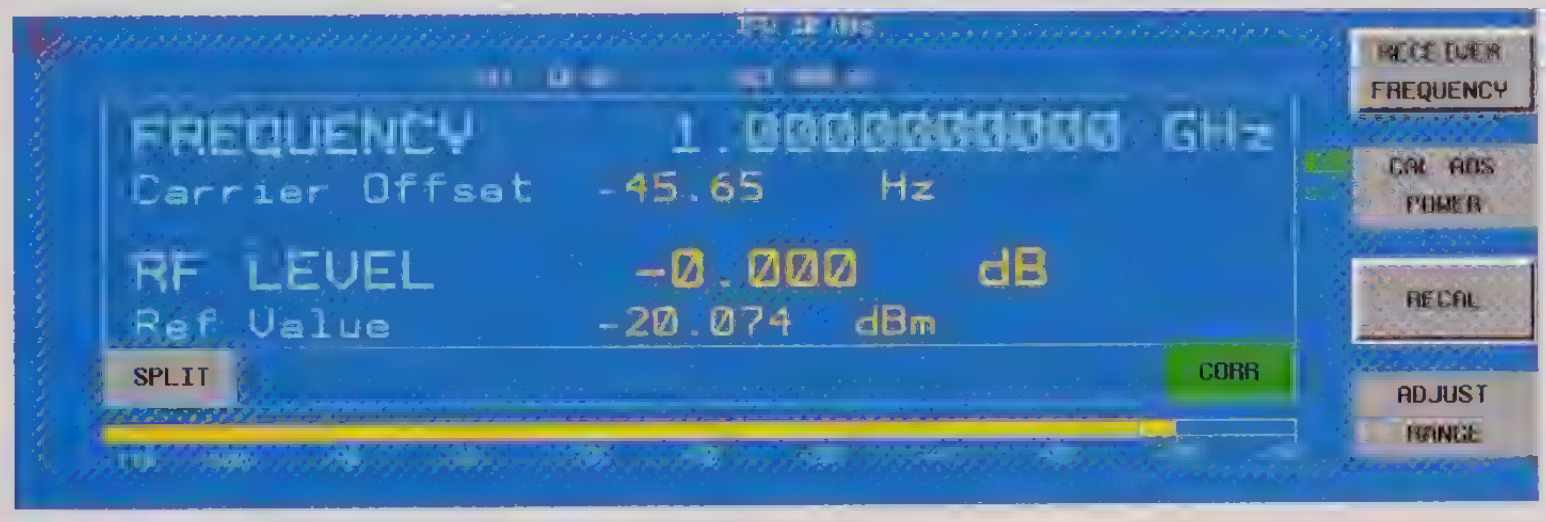
FREQUENCY 1.0000000000 GHz
Carrier Offset -45.65 Hz
RF LEVEL -0.000 dB
Ref Value -20.074 dBm

Step 3

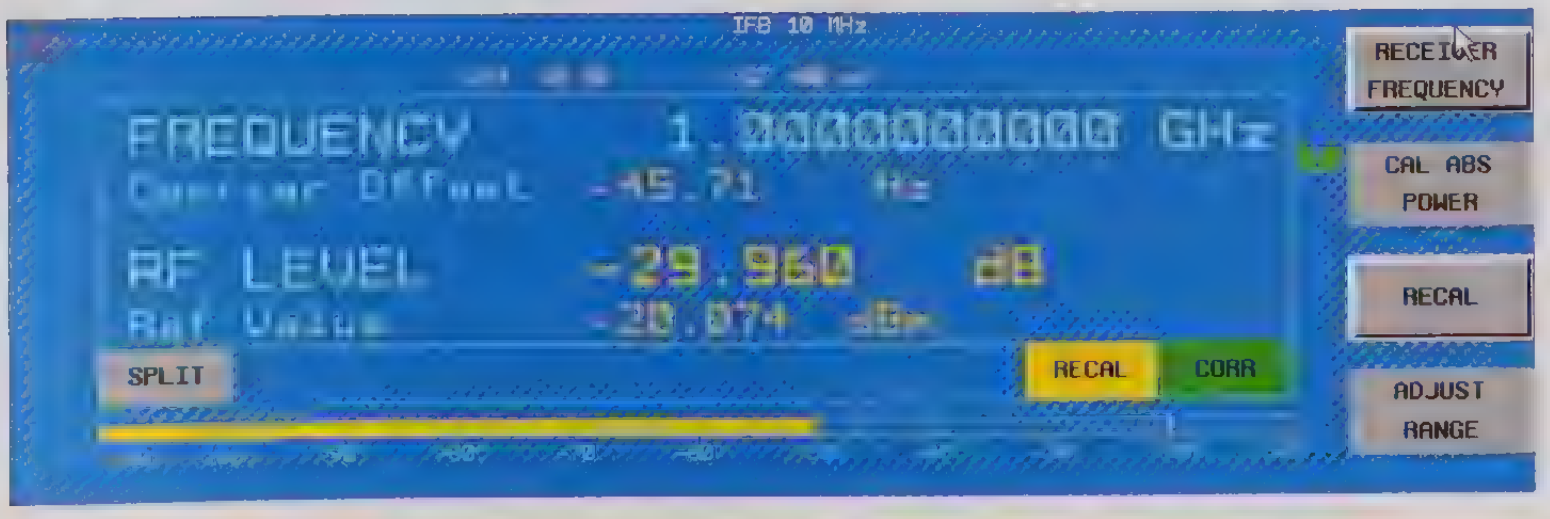
FREQUENCY 1.0000000000 GHz
Carrier Offset -45.71 Hz
RF LEVEL -29.960 dB
Ref Value -20.074 dBm

Step 4

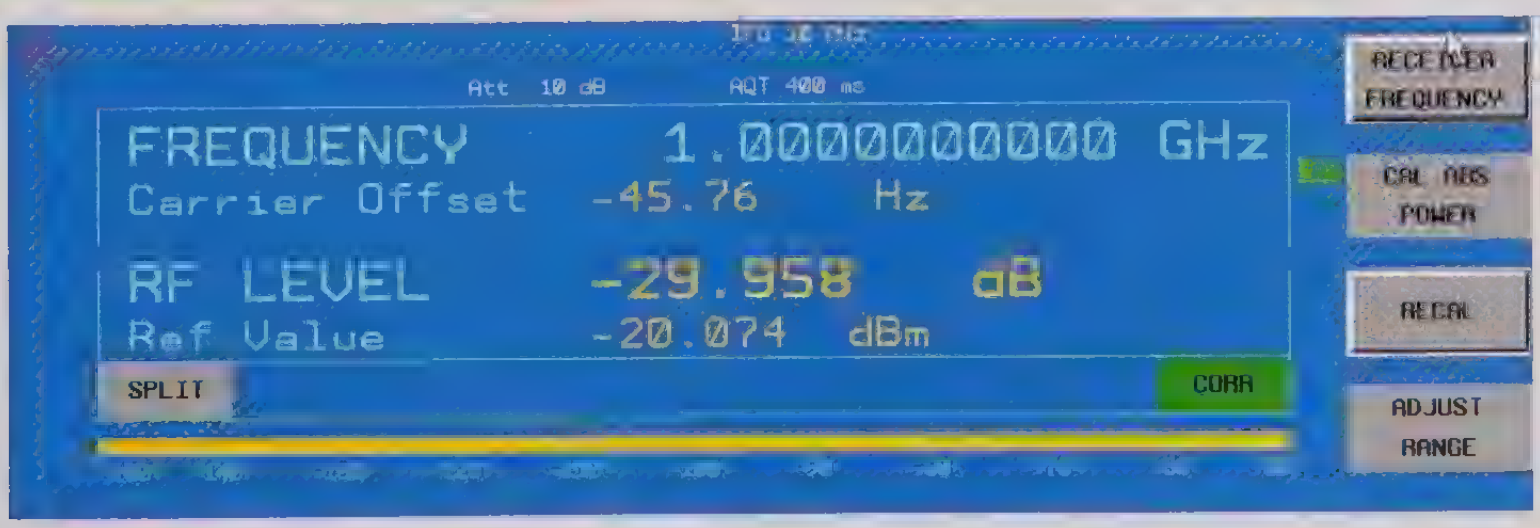
Att 10 dB
AQT 400 ms
FREQUENCY 1.0000000000 GHz
Carrier Offset -45.76 Hz
RF LEVEL -29.958 dB
Ref Value -20.074 dBm

Modulation and audio analysis made easy

The R&S®FSMR features a complete, integrated modulation and audio analyzer for the AM, FM and φM analog modulation modes. Audio parameters are measured either on the demodulated signal or on the signal applied to the audio input. This means that no extra instrument is required for calibrating modulation settings and the modulation generator.

Various audio filters, weighting filters, deemphases and detectors are available for audio analysis. This makes it easy to perform residual FM measurements, for example.

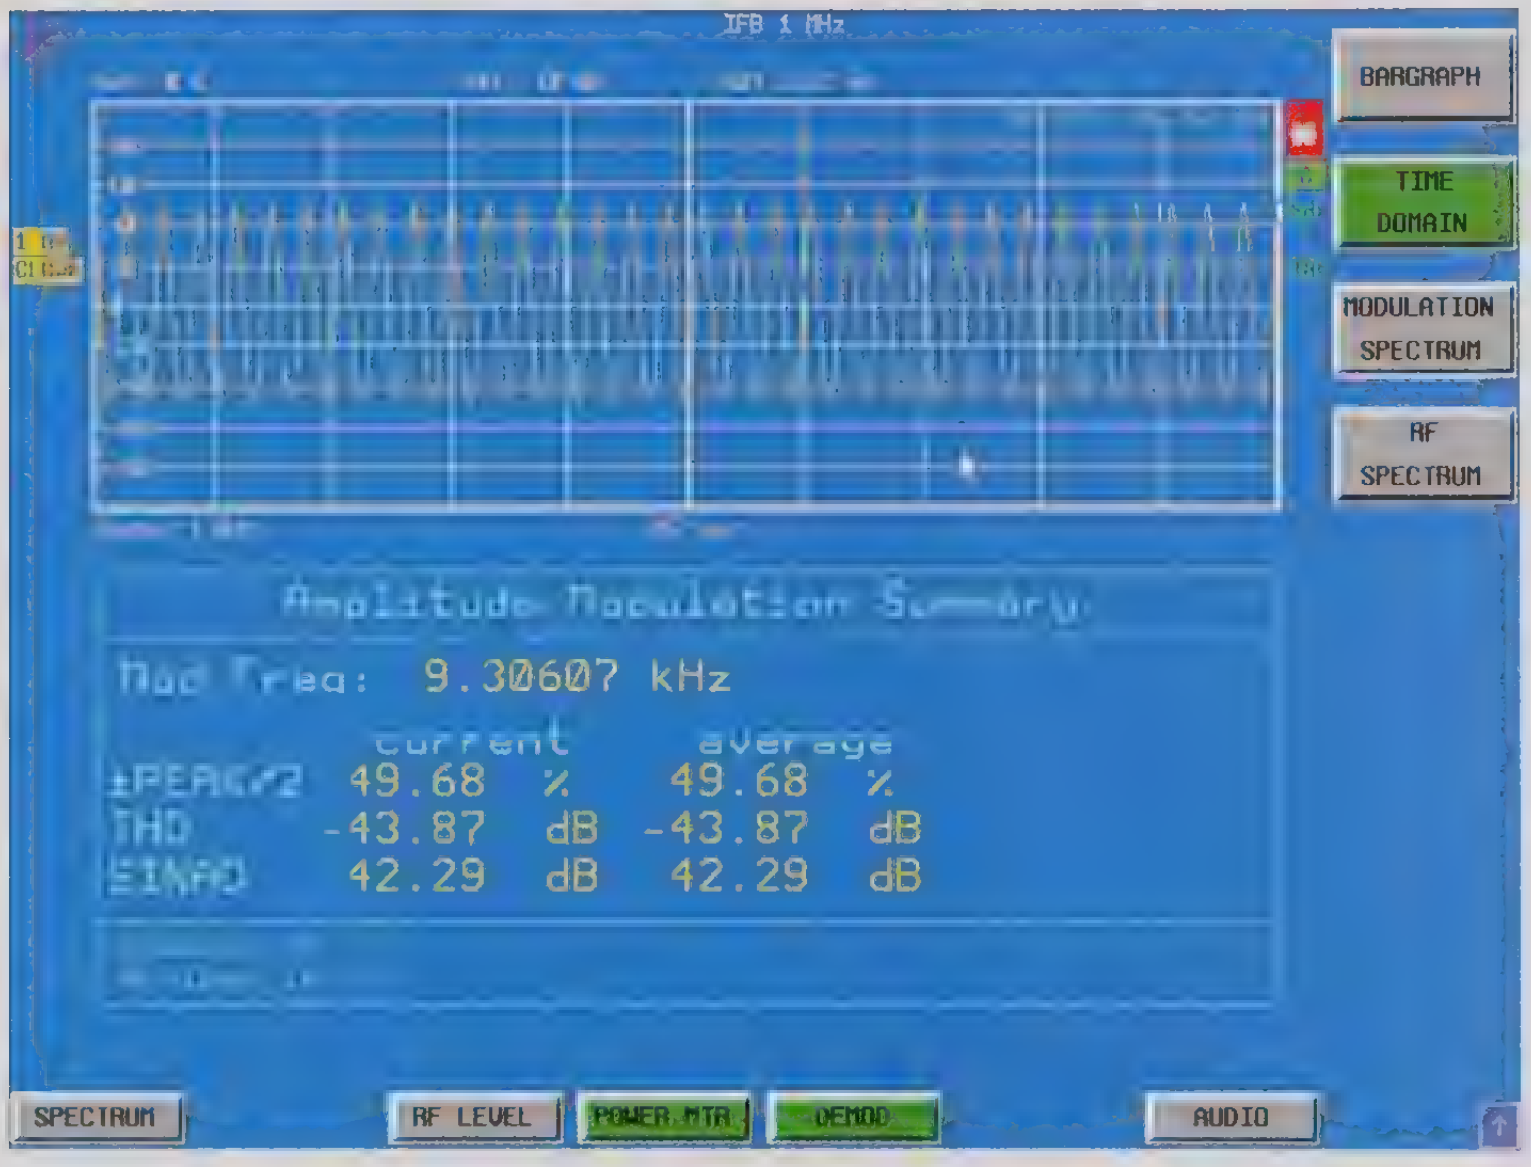

```
Amplitude Modulation Summary
Mod Freq:  9.30607 kHz
           current       average
±PEAK/2   49.68   %    49.68   %
THD      -43.87   dB  -43.87   dB
SINAD     42.29   dB   42.29   dB
```

Measurement of modulation depth of an amplitude-modulated signal: The R&S®FSMR measures the modulation depth and modulation frequency, and optionally also indicates the averaged modulation values. The demodulated audio signal is displayed in the time domain.

The R&S®FSMR not only displays the demodulated or the audio signal in the time domain, but also as an RF spectrum generated by means of an FFT, with harmonics and any spurious modulation such as hum displayed selectively. For THD and SINAD measurements, the instrument is automatically tuned to the fundamental. The THD function selectively measures all harmonics within the FFT spectrum. The SINAD function in addition weights noise and nonharmonic spurious.

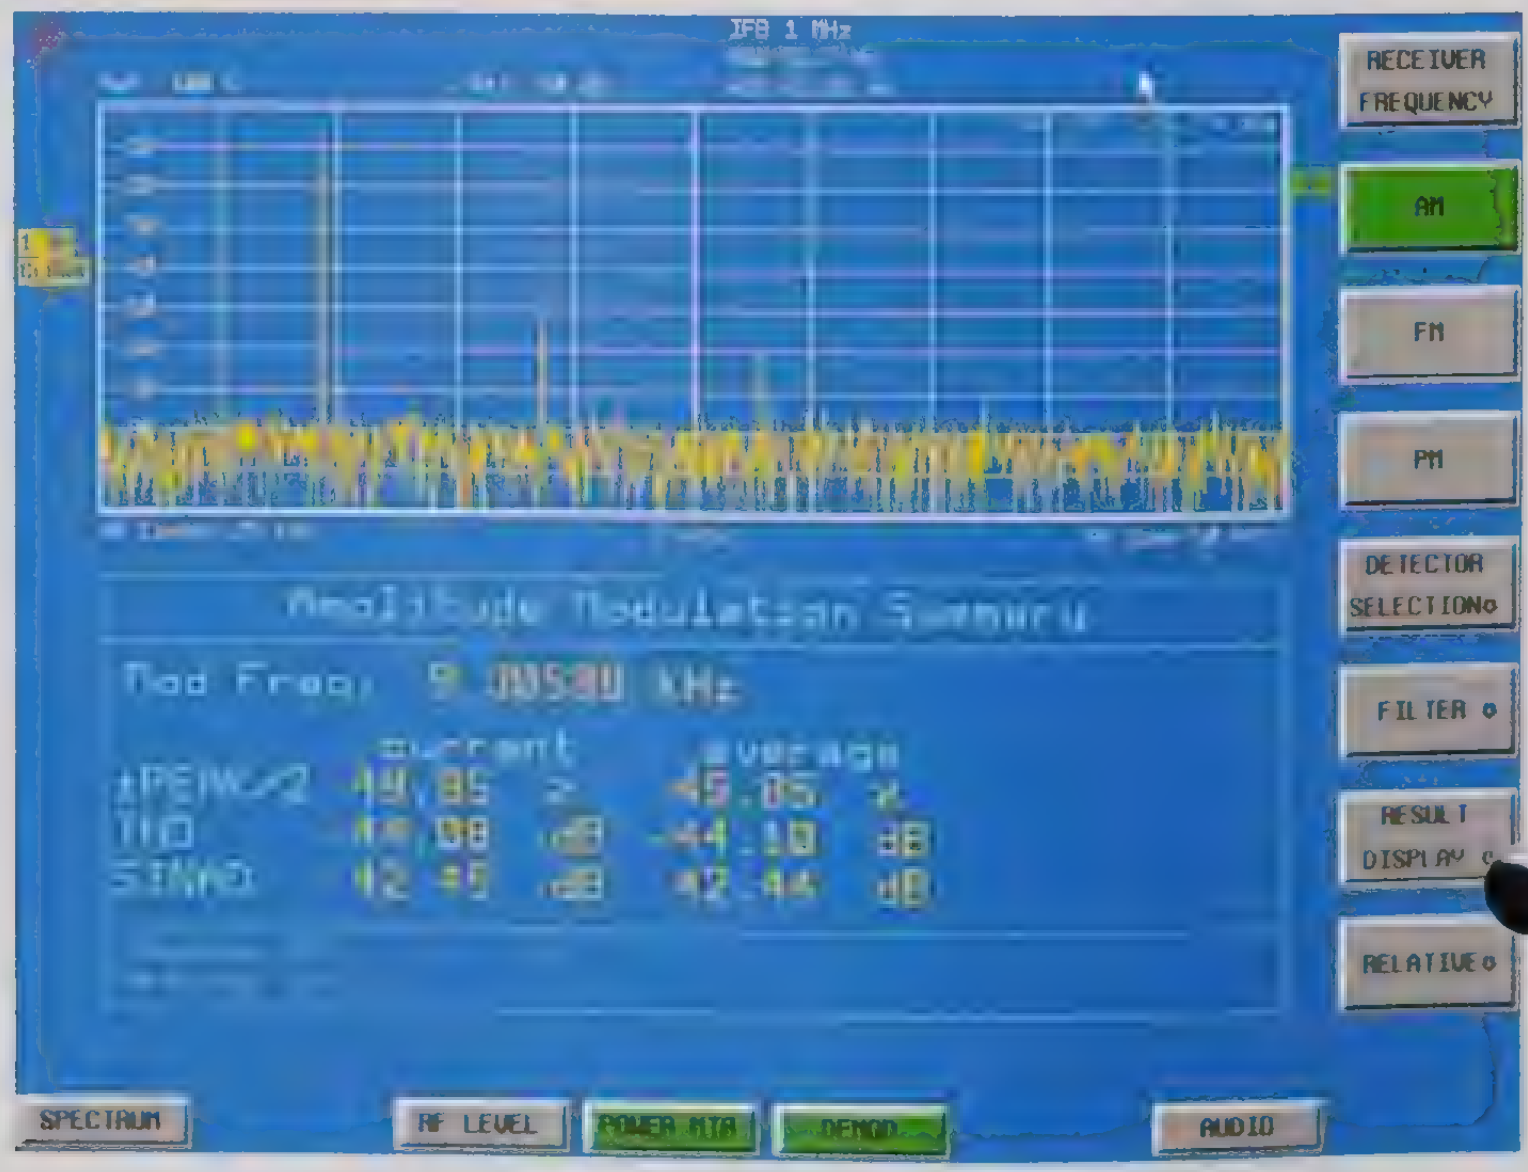

Recommended configurations

Frequency range	20 Hz to 3.6 GHz	20 Hz to 26.5 GHz	20 Hz to 50 GHz
Base unit	R&S®FSMR 3	R&S®FSMR 26	R&S®FSMR 50
Power sensor	R&S®NRP-Z11, 0.01 GHz to 8 GHz	R&S®NRP-Z55, DC to 40 GHz	R&S®NRP-Z55, DC to 40 GHz
Other options	–	YIG Preselection R&S®FSMR-B2	YIG Preselection R&S®FSMR-B2

Ordering information

Order designation	Type	Order No.	Remarks
Measuring Receiver 20 Hz to 3.6 GHz	R&S®FSMR 3	1166.3311.03	
Measuring Receiver 20 Hz to 26.5 GHz	R&S®FSMR 26	1166.3311.26	
Measuring Receiver 20 Hz to 50 GHz	R&S®FSMR 50	1166.3311.50	
Options			
YIG Preselection 3.6 GHz to 26 GHz for R&S®FSMR 26	R&S®FSMR-B2	1157.1903.26	Not for retrofit
YIG Preselection with 20 dB Preamplifier, 3.6 GHz to 26 GHz for R&S®FSMR 26	R&S®FSMR-B223	1157.1955.26	Not for retrofit, excludes R&S®FSMR-B23 and R&S®FSMR-B2
YIG Preselection 3.6 GHz to 50 GHz for R&S®FSMR 50	R&S®FSMR-B2	1157.1903.50	Not for retrofit
Low-Aging OXCO	R&S®FSU-B4	1144.9000.02	
Tracking Generator 100 kHz to 3.6 GHz	R&S®FSU-B9	1142.8994.02	
Attenuator for Tracking Generator	R&S®FSU-B12	1142.9349.02	
Removable Hard Disk	R&S®FSMR-B18	1145.0242.06	Not for retrofit
Second Hard Disk for R&S®FSMR B18	R&S®FSMR-B19	1145.0394.06	R&S®FSMR-B18 required
RF Preamplifier 3.6 GHz to 26 GHz for R&S®FSMR 26	R&S®FSMR-B23	1157.0907.05	Not for retrofit, R&S®FSU-B25 required, for R&S®FSMR 26 only, excludes R&S®FSMR-B223
20 dB RF Preamplifer and Electronic Attenuator, 100 kHz to 3.6 GHz	R&S®FSU-B25	1144.9298.02	
Software options			
Phase Noise Measurement Software	R&S®FS-K4	1108.0088.02	

For specifications, see PD 07582319.22
and www.rohde-schwarz.com
(search term: FSMR)

Certified Quality System
ISO 9001
DQS REG. NO 1954 QM

Certified Environmental System
ISO 14001
DQS REG. NO 1954 UM

ROHDE&SCHWARZ

www.rohde-schwarz.com
Europe: Tel. +49 1805 12 4242, e-mail: customersupport@rsv.rohde-schwarz.com · USA: Tel. +1 410-910-7988, e-mail: customersupport@rsa.rohde-schwarz.com
Asia: Tel. +65 68463710, e-mail: customer-service@rssg.rohde-schwarz.com

[illegible] Printed in Germany [illegible]
PD 0758.2319.12 R&S®FSMR Version 01.00 November 2004 Data without tolerance limits is not binding Subject to change

Safety Instructions

This unit has been designed and tested in accordance with the EC Certificate of Conformity and has left the manufacturer's plant in a condition fully complying with safety standards.

To maintain this condition and to ensure safe operation, the user must observe all instructions and warnings given in this operating manual.

Safety-related symbols used on equipment and documentation from R&S:

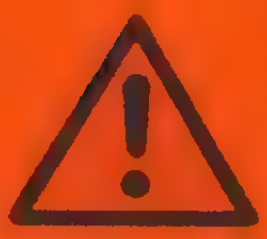	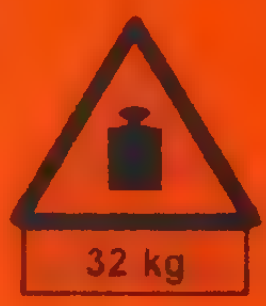						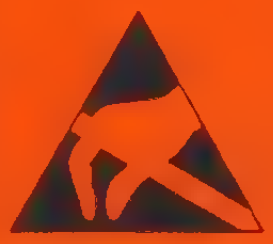
Observe operating instructions	Weight indication for units >18 kg	PE terminal	Ground terminal	Danger! Shock hazard	Warning! Hot surfaces	Ground	Attention! Electrostatic sensitive devices require special care

1. The unit may be used only in the operating conditions and positions specified by the manufacturer. Unless otherwise agreed, the following applies to R&S products:

   IP degree of protection 2X, pollution severity 2 overvoltage category 2, only for indoor use, altitude max. 2000 m.

   The unit may be operated only from supply networks fused with max. 16 A.

   Unless specified otherwise in the data sheet, a tolerance of ±10% shall apply to the nominal voltage and of ±5% to the nominal frequency.

2. For measurements in circuits with voltages V_{rms} > 30 V, suitable measures should be taken to avoid any hazards.

   (using, for example, appropriate measuring equipment, fusing, current limiting, electrical separation, insulation).

3. If the unit is to be permanently wired, the PE terminal of the unit must first be connected to the PE conductor on site before any other connections are made. Installation and cabling of the unit to be performed only by qualified technical personnel.

4. For permanently installed units without built-in fuses, circuit breakers or similar protective devices, the supply circuit must be fused such as to provide suitable protection for the users and equipment.

5. Prior to switching on the unit, it must be ensured that the nominal voltage set on the unit matches the nominal voltage of the AC supply network.

   If a different voltage is to be set, the power fuse of the unit may have to be changed accordingly.

6. Units of protection class I with disconnectible AC supply cable and appliance connector may be operated only from a power socket with earthing contact and with the PE conductor connected.

7. It is not permissible to interrupt the PE conductor intentionally, neither in the incoming cable nor on the unit itself as this may cause the unit to become electrically hazardous.

   Any extension lines or multiple socket outlets used must be checked for compliance with relevant safety standards at regular intervals.

8. If the unit has no power switch for disconnection from the AC supply, the plug of the connecting cable is regarded as the disconnecting device. In such cases it must be ensured that the power plug is easily reachable and accessible at all times (length of connecting cable approx. 2 m). Functional or electronic switches are not suitable for providing disconnection from the AC supply.

   If units without power switches are integrated in racks or systems, a disconnecting device must be provided at system level.

9. Applicable local or national safety regulations and rules for the prevention of accidents must be observed in all work performed.

   Prior to performing any work on the unit or opening the unit, the latter must be disconnected from the supply network.

   Any adjustments, replacements of parts, maintenance or repair may be carried out only by authorized R&S technical personnel.

   Only original parts may be used for replacing parts relevant to safety (eg power switches, power transformers, fuses). A safety test must be performed after each replacement of parts relevant to safety.

   (visual inspection, PE conductor test, insulation-resistance, leakage-current measurement, functional test).

continued overleaf

10. Ensure that the connections with information technology equipment comply with IEC950 / EN60950.
11. Lithium batteries must not be exposed to high temperatures or fire.

    Keep batteries away from children.

    If the battery is replaced improperly, there is danger of explosion. Only replace the battery by R&S type (see spare part list).

    Lithium batteries are suitable for environmentally-friendly disposal or specialized recycling. Dispose them into appropriate containers, only.

    Do not short-circuit the battery.
12. Equipment returned or sent in for repair must be packed in the original packing or in packing with electrostatic and mechanical protection.
13. Electrostatics via the connectors may damage the equipment. For the safe handling and operation of the equipment, appropriate measures against electrostatics should be implemented.
14. The outside of the instrument is suitably cleaned using a soft, lint-free dustcloth. Never use solvents such as thinners, acetone and similar things, as they may damage the front panel labeling or plastic parts.
15. Any additional safety instructions given in this manual are also to be observed.

Certified Quality System
ISO 9001
DQS REG. NO 1954 QM

Certified Environmental System
ISO 14001
DQS REG. NO 1954 UM

Qualitätszertifikat

Sehr geehrter Kunde,

Sie haben sich für den Kauf eines Rohde & Schwarz-Produktes entschieden. Hiermit erhalten Sie ein nach modernsten Fertigungsmethoden hergestelltes Produkt. Es wurde nach den Regeln unseres Qualitätsmanagementsystems entwickelt, gefertigt und geprüft. Das Rohde & Schwarz-Qualitätsmanagementsystem ist u.a. nach ISO 9001 und ISO 14001 zertifiziert.

Certificate of quality

Dear Customer,

You have decided to buy a Rohde & Schwarz product. You are thus assured of receiving a product that is manufactured using the most modern methods available. This product was developed, manufactured and tested in compliance with our quality management system standards. The Rohde & Schwarz quality management system is certified according to standards such as ISO 9001 and ISO 14001.

Certificat de qualité

Cher client,

Vous avez choisi d'acheter un produit Rohde & Schwarz. Vous disposez donc d'un produit fabriqué d'après les méthodes les plus avancées. Le développement, la fabrication et les tests respectent nos normes de gestion qualité. Le système de gestion qualité de Rohde & Schwarz a été homologué, entre autres, conformément aux normes ISO 9001 et ISO 14001.

ROHDE&SCHWARZ

ROHDE&SCHWARZ
EC Certificate of Conformity

CE

Certificate No.: 2004-57

This is to certify that:

Equipment type	Stock No.	Designation
FSMR3	1166.3311.03	Measuring Receiver
FSMR26	1166.3311.26	
FSMR50	1166.3311.50	
FSMR-B2	1157.1903.26/.50	YIG-Preselector
FSMR-B18	1145.0242.06	Removable Harddisc
FSMR-B19	1145.0394.06	Second Harddisc
FSMR-B23	1157.0907.05	Preamplifier
FSMR-B223	1157.1955.26	YIG-Preselector
FSU-B4	1144.9000.02	OCXO 10 MHz
FSU-B9	1142.8994.02	Tracking Generator
FSU-B12	1142.9349.02	Output Attenuator
FSU-B25	1044.9298.02	Electronic Attenuator

complies with the provisions of the Directive of the Council of the European Union on the approximation of the laws of the Member States

- relating to electrical equipment for use within defined voltage limits (73/23/EEC revised by 93/68/EEC)

- relating to electromagnetic compatibility (89/336/EEC revised by 91/263/EEC, 92/31/EEC, 93/68/EEC)

Conformity is proven by compliance with the following standards:

EN61010-1 : 2001-12
EN55011 : 1998 + A1 : 1999
EN61326 : 1997 + A1 : 1998 + A2 : 2001

For the assessment of electromagnetic compatibility, the limits of radio interference for Class B equipment as well as the immunity to interference for operation in industry have been used as a basis.

Affixing the EC conformity mark as from 2004

ROHDE & SCHWARZ GmbH & Co. KG
Mühldorfstr. 15, D-81671 München

Munich, 2005-07-13

Central Quality Management MF-QZ / Radde

FIRMENSITZ/HEADQUARTERS

	(Tel) Phone (Fax) Fax E-mail
Rohde & Schwarz GmbH & Co. KG Mühldorfstraße 15 · D-81671 München Postfach 80 14 69 · D-81614 München	(Tel) +49 (89) 41 29-0 (Fax) +49 89 4129-121 64 info@rohde-schwarz.com

WERKE/PLANTS

Rohde & Schwarz Messgerätebau GmbH Riedbachstraße 58 · D-87700 Memmingen Postfach 1652 · D-87686 Memmingen	(Tel) +49 (8331) 108-0 (Fax) +49 (8331) 108-11 24 info.rsdmb@rohde-schwarz.com
Rohde & Schwarz GmbH & Co. KG Werk Teisnach Kaikenrieder Straße 27 · D-94244 Teisnach Postfach 1149 · D-94240 Teisnach	(Tel) +49 (9923) 857-0 (Fax) +49 (9923) 857-11 74 info.rsdts@rohde-schwarz.com
Rohde & Schwarz GmbH & Co. KG Dienstleistungszentrum Köln Graf-Zeppelin-Straße 18 · D-51147 Köln Postfach 98 02 60 · D-51130 Koln	(Tel) +49 (2203) 49-0 (Fax) +49 (2203) 49 51-229 info.rsdc@rohde-schwarz.com·service.rsdc@rohde-schwarz.com

TOCHTERUNTERNEHMEN/SUBSIDIARIES

Rohde & Schwarz Vertriebs-GmbH Mühldorfstraße 15 · D-81671 München Postfach 80 14 69 · D-81614 München	(Tel) +49 (89) 41 29-137 74 (Fax) +49 (89) 41 29-137 77 customersupport@rohde-schwarz.com
Rohde & Schwarz International GmbH Mühldorfstraße 15 · D-81671 München Postfach 80 14 60 · D-81614 München	(Tel) +49 (89) 41 29-129 84 (Fax) +49 (89) 41 29-120 50 info.rusis@rohde-schwarz.com
Rohde & Schwarz Engineering and Sales GmbH Mühldorfstraße 15 · D-81671 München Postfach 80 14 29 · D-81614 München	(Tel) +49 (89) 41 29-137 11 (Fax) +49 (89) 41 29-137 23 info.rse@rohde-schwarz.com
R&S BICK Mobilfunk GmbH Fritz-Hahne-Str. 7 · D-31848 Bad Münder Postfach 2062 · D-31844 Bad Münder	(Tel) +49 (5042) 998-0 (Fax) +49 (5042) 998-105 info.rsbick@rohde-schwarz.com
Rohde & Schwarz FTK GmbH Wendenschlossstraße 168, Haus 28 D-12557 Berlin	(Tel) +49 (30) 658 91-122 (Fax) +49 (30) 655 50-221 info.ftk@rohde-schwarz.com
Rohde & Schwarz SIT GmbH Agastraße 3 D-12489 Berlin	(Tel) +49 (30) 658 84-0 (Fax) +49 (30) 658 84-183 info.sit@rohde-schwarz.com
R&S Systems GmbH Graf-Zeppelin-Straße 18 D-51147 Köln Postfach 98 02 60 D-51130 Köln	(Tel) +49 (2203) 49-5 23 25 (Fax) +49 (2203) 49-5 23 36 info.rssys@rohde-schwarz.com

ADRESSEN WELTWEIT/ADDRESSES WORLDWIDE

Albania	siehe/see Austria	
Algeria	Rohde & Schwarz Bureau d'Alger 5B Place de Laperrine 16035 Hydra-Alger	(Tel) +213 (21) 48 20 18 (Fax) +213 (21) 69 46 08
Antilles (Neth.)	siehe / see Mexico	
Argentina	Precision Electronica S.R.L. Av. Pde Julio A. Roca 710 - 6° Piso 1067 Buenos Aires	(Tel) +541 (14) 331 10 67 (Fax) +541 (14) 334 51 11 alberto.lombardi@prec-elec.com.ar
Australia	Rohde & Schwarz (Australia) Pty. Ltd. Sales Support Unit 6 2-8 South Street Rydalmere, N.S.W. 2116	(Tel) +61 (2) 88 45 41 00 (Fax) +61 (2) 96 38 39 88 sales@rsaus.rohde-schwarz.com
Austria	Rohde & Schwarz-Österreich Ges.m.b.H. Am Europlatz 3 Gebaude B 1120 Wien	(Tel) +43 (1) 602 61 41-0 (Fax) +43 (1) 602 61 41-14 rs-austria@rsoe.rohde-schwarz.com
Azerbaijan	Rohde & Schwarz Azerbaijan Liaison Office Baku ISR Plaza, 5th floor 340 Nizami Str. 370000 Baku	(Tel) +994 (12) 93 31 38 (Fax) +994 (12) 93 03 14 rs-azerbaijan@rsd.rohde-schwarz.com
Bangladesh	BIL Consortium Ltd. Corporate Office House-33, Road-4, Block-F Banani, Dhaka-1213	(Tel) +880 (2) 881 06 53 (Fax) +880 (2) 882 82 91
Barbados	siehe / see Mexico	
Belarus	siehe/see Ukraine	
Belgium	Rohde & Schwarz Belgium N.V. Excelsiorlaan 31 Bus 1 1930 Zaventem	(Tel) +32 (2) 721 50 02 (Fax) +32 (2) 725 09 36 info@rsb.rohde-schwarz.com
Belize	siehe / see Mexico	
Bermuda	siehe/see Mexico	
Bosnia-Herzegovina	siehe/see Slovenia	
Brazil	Rohde & Schwarz Do Brasil Ltda. Av. Alfredo Egidio de Souza Aranha n° 177, 1° andar - Santo Amaro 04726-170 Sao Paulo - SP	(Tel) +55 (11) 56 44 86 11 (general) +55 (11) 56 44 86 25 (sales) (Fax) +55 (11) 56 44 86 36 sales-brazil@rsdb.rohde-schwarz.com
Brunei	George Keen Lee Equipment Pte Ltd. #11-01 BP Tower 396 Alexandra Road Singapore 119954	(Tel) +656 276 06 26 (Fax) +656 276 06 29 gkleqpt@singnet.com.sg
Bulgaria	Rohde & Schwarz Representation Office Bulgaria 39, Fridtjof Nansen Blvd. 1000 Sofia	(Tel) +359 (2) 96 343 34 (Fax) +359 (2) 963 21 97 rs-bulgaria@rsbg.rohde-schwarz
Canada	Rohde & Schwarz Canada Inc. 555 March Rd. Kanata, Ontario K2K 2M5	(Tel) +1 (613) 592 80 00 (Fax) +1 (613) 592 80 09 sales@rscanada.ca
Chile	Dymeq Ltda. Av. Larrain 6666 Santiago	(Tel) +56 (2) 339 20 00 (Fax) +56 (2) 339 20 10 dymeq@dymeq.com
China	Rohde & Schwarz China Ltd. Representative Office Beijing 6F, Parkview Center 2 Jiangtai Road Chao Yang District Beijing 100016	(Tel) +86 (10) 64 31 28 28 (Fax) +86 (10) 64 37 98 88 info.rschina@rsbp.rohde-schwarz.com
	Rohde & Schwarz China Ltd. Representative Office Shanghai Room 807-809, Central Plaza 227 Huangpi North Road Shanghai 200003	(Tel) +86 (21) 63 75 00 18 (Fax) +86 (21) 63 75 91 70 May.Zhu@rsbp.rohde-schwarz.com
	Rohde & Schwarz China Ltd. Representative Office Guangzhou Room 2903, Metro Plaza 183 Tian He North Road Guangzhou 510075	(Tel) +86 (20) 87 55 47 58 (Fax) +86 (20) 87 55 47 59 Winnie.Lin@rsbp.rohde-schwarz.com

China	Rohde & Schwarz China Ltd. Representative Office Chengdu Unit G, 28/F, First City Plaza 308 Shuncheng Avenue Chengdu 610017	(Tel) +86 (28) 86 52 76 06 (Fax) +86 (28) 86 52 76 10 sophia.chen@rsbp.rohde-schwarz.com
	Rohde & Schwarz China Ltd. Representative Office Xian Room 603, Jin Xin International No. 99 Heping Road Xian 710001	(Tel) +86 (29) 87 41 53 77 (Fax) +86 (29) 87 20 65 00 sherry.yu@rsbp.rohde-schwarz.com
	Rohde & Schwarz China Ltd. Representative Office Shenzhen Room 1901, Central Business Building No. 88 Fuhua Yilu Futian District Shenzhen 518026	(Tel) +86 (755) 82 03 11 98 (Fax) +86 (755) 82 03 30 70 essica.lia@rsbp.rohde-schwarz.com
Costa Rica	siehe / see Mexico	
Croatia	siehe/see Slovenia	
Cuba	siehe / see Mexico	
Cyprus	Hinis Telecast Ltd. Agiou Thoma 18 Kiti Larnaca 7550	(Tel) +357 (24) 42 51 78 (Fax) +357 (24) 42 46 21 hinis@logos.cy.net
Czech Republic	Rohde & Schwarz Praha, s.r.o. Hadovka Office Park Evropská 2590/33c 16000 Praha 6	(Tel) +420 (2) 24 31 12 32 (Fax) +420 (2) 24 31 70 43 office@rscz.rohde-schwarz.com
Denmark	Rohde & Schwarz Danmark A/S Ejby Industrivej 40 2600 Glostrup	(Tel) +45 (43) 43 66 99 (Fax) +45 (43) 43 77 44 rsdk@rsdk.rohde-schwarz.com
Egypt	U.A.S. Universal Advanced Systems 31 Manshiet El-Bakry Street Heliopolis 11341 Cairo	(Tel) +20 (2) 455 67 44 (Fax) +20 (2) 256 17 40 an_uas@link.net
El Salvador	siehe/see Mexico	
Estonia	Rohde & Schwarz Danmark A/S Estonian Branch Office Narva mnt. 13 10151 Tallinn	(Tel) +372 (6) 14 31 23 (Fax) +372 (6) 14 31 21 estonia@rsdk.rohde-schwarz.com
Finland	Rohde & Schwarz Finland Oy Taivaltie 5 01610 Vantaa	(Tel) +358 (207) 60 04 00 (Fax) +358 (207) 60 04 17 info@rsfin.rohde-schwarz.com
France	Rohde & Schwarz France Immeuble "Le Newton" 9-11, rue Jeanne Braconnier 92366 Meudon La Forêt Cédex	(Tel) +33 (0) 141 36 10 00 (Fax) +33 (0) 141 36 11 11 contact@rsf.rohde-schwarz.com
	Niederlassung/Subsidiary Rennes 37 Rue du Bignon Bâtiment A 35510 Cesson Sévigné	(Tel) +33 (2) 99 51 97 00 (Fax) +33 (2) 99 51 98 77
Germany	Zweigniederlassungen der Rohde & Schwarz Vertriebs-GmbH/Branch offices of Rohde & Schwarz Vertriebs-GmbH	
	Zweigniederlassung Nord, Geschäftsstelle Berlin Ernst-Reuter-Platz 10 · D-10587 Berlin Postfach 100620 · D-10566 Berlin	(Tel) +49 (30) 34 79 48-0 (Fax) +49 (30) 34 79 48 48 info.rsv@rohde-schwarz.com
Germany	Zweigniederlassung Büro Bonn Josef-Wirmer-Straße 1-3 · D-53123 Bonn Postfach 140264 · D-53057 Bonn	(Tel) +49 (228) 918 90-0 (Fax) +49 (228) 25 50 87 info.rsv@rohde-schwarz.com
	Zweigniederlassung Nord, Geschäftsstelle Hamburg Vierenkamp 6 · D-22423 Hamburg	(Tel) +49 (40) 38 61 83 - 00 (Fax) +49 (40) 38 61 83 - 20 info.rsv@rohde-schwarz.com
	Zweigniederlassung Mitte, Geschäftsstelle Köln Niederkasseler Straße 33 · D-51147 Köln Postfach 900 149 · D-51111 Köln	(Tel) +49 (2203) 807-0 (Fax) +49 (2203) 807-650 info.rsv@rohde-schwarz.com
	Zweigniederlassung Süd, Geschäftsstelle München Mühldorfstraße 15 · D-81671 München Postfach 80 14 69 · D-81614 München	(Tel) +49 (89) 41 86 95-0 (Fax) +49 (89) 40 47 64 info.rsv@rohde-schwarz.com
	Zweigniederlassung Süd, Geschäftsstelle Nürnberg Donaustraße 36 D-90451 Nürnberg	(Tel) +49 (911) 642 03-0 (Fax) +49 (911) 642 03-33 info.rsv@rohde-schwarz.com
	Zweigniederlassung Mitte, Geschäftsstelle Neu-Isenburg Siemensstraße 20 · D-63263 Neu-Isenburg Postfach 16 51 · D-63236 Neu-Isenburg	(Tel) +49 (6102) 20 07-0 (Fax) +49 (6102) 20 07 12 info.rsv@rohde-schwarz.com
Ghana	Kop Engineering Ltd. P.O. Box 11012 3rd Floor Akai House, Osu Accra North	(Tel) +233 (21) 77 89 13 (Fax) +233 (21) 701 06 20 joblink@ghana.com
Greece	Mercury S.A. 6, Loukianou Str. 10675 Athens	(Tel) +302 (10) 722 92 13 (Fax) +302 (10) 721 51 98 mercury@hol.gr
Guatemala	siehe/see Mexico	
Guiana	siehe / see Mexico	
Haiti	siehe / see Mexico	
Honduras	siehe/see Mexico	
Hong Kong	Electronic Scientific Engineering 9/F North Somerset House Taikoo Place 979 King's Road, Quarry Bay Hong Kong	(Tel) +852 (25) 07 03 33 (Fax) +852 (25) 07 09 25 stephenchau@ese.com.hk
Hungary	Rohde & Schwarz Budapesti Iroda Váci út 169 1138 Budapest	(Tel) +36 (1) 412 44 60 (Fax) +36 (1) 412 44 61 rs-hungary@rshu.rohde-schwarz.com
Iceland	siehe/see Denmark	
India	Rohde & Schwarz India Pvt. Ltd. 244, Okhla Industrial Estate Phase - III New Delhi 110 020	(Tel) +91 (11) 26 32 63 81 (Fax) +91 (11) 26 32 63 73 sales@rsindia.rohde-schwarz.com
	Rohde & Schwarz India Pvt. Ltd. Bangalore Office No. 24, Service Road, Domlur 2nd Stage Extension Bangalore - 560 071	(Tel) +91 (80) 535 23 62 (Fax) +91 (80) 535 03 61 rsindiab@rsnl.net
	Rohde & Schwarz India Pvt. Ltd. Hyderabad Office 302 & 303, Millennium Centre 6-3-1099/1100, Somajiguda Hyderabad - 500 016	(Tel) +91 (40) 23 32 24 16 (Fax) +91 (40) 23 32 27 32 rsindiah@nd2.dot.net.in

India

Rohde & Schwarz India Pvt. Ltd.
Mumbai Office
B-603, Remi Bizcourt, Shah Industrial Estate, Off Veera Desai Road
Andheri West
Mumbai - 400 058
(Tel) +91 (22) 26 30 18 10
(Fax) +91 (22) 26 73 20 81
rsindiam@rsnl.net

Indonesia

PT Rohde & Schwarz Indonesia
Graha Paramita 5th Floor
Jln. Denpasar Raya Blok D-2
Jakarta 12940
(Tel) +62 (21) 252 36 08
(Fax) +62 (21) 252 36 07
sales@rsbj.rohde-schwarz.com·services@rsbj.rohde-schwarz.com

Iran

Rohde & Schwarz Iran
Liaison Office Tehran
Groundfloor No. 1, 14th Street
Khaled Eslamboli (Vozara) Ave.
15117 Tehran
(Tel) +98 (21) 872 42 96
(Fax) +98 (21) 871 90 12
alfred.korff@rsd.rohde-schwarz.com

Ireland

siehe/see United Kingdom

Israel

Eastronics Ltd.
Measurement Products
11 Rozanis St.
P.O.Box 39300
Tel Aviv 61392
(Tel) +972 (3) 645 87 77
(Fax) +972 (3) 645 86 66
david_hasky@easx.co.il

J.M. Moss (Engineering) Ltd.
Communications Products
9 Oded Street
P.O.Box 967
52109 Ramat Gan
(Tel) +972 (3) 631 20 57
(Fax) +972 (3) 631 40 58
jmmoss@zahav.net.il

Italy

Rohde & Schwarz Italia S.p.a.
Centro Direzionale Lombardo
Via Roma 108
20060 Cassina de Pecchi (MI)
(Tel) +39 (02) 95 70 41
(Fax) +39 (02) 95 30 27 72
rsi.info@rsi.rohde-schwarz.com

Rohde & Schwarz Italia S.p.a.
Via Tiburtina 1182
00156 Roma
(Tel) +39 (06) 41 59 81
(Fax) +39 (06) 41 59 82 70
rsi.info@rsi.rohde-schwarz.com

Jamaica

siehe / see Mexico

Japan

Rohde & Schwarz Japan K.K.
Tokyo Office
711 Bldg., Room 501 (5th floor)
7-11-18 Nishi-Shinjuku
Shinjuku-ku
Tokyo 160-00023
(Tel) +81 (3) 59 25 12 88
(Fax) +81 (3) 59 25 12 90
scj.support@rsjp.rohde-schwarz.com

Rohde & Schwarz Japan K.K.
Shin-Yokohama Office
KM Daiichi Bldg., 8F
2-13-13 Kouhoku-ku
Yokohama-shi
Kanagawa 222-0033
(Tel) +81 (4) 54 77 35 70

Rohde & Schwarz Japan K.K.
Osaka Office
TEK Dai 2 Bldg., 8F
1-13-20 Esaka-shi
Suita-shi
Osaka-fu 564-0063
(Tel) +81 (6) 63 10 96 51

Jordan

Jordan Crown Engineering & Trading Co.
Jabal Amman, Second Circle
Youssef Ezzideen Street
P.O.Box 830414
Amman, 11183
(Tel) +962 (6) 462 17 29
(Fax) +962 (6) 465 96 72
jocrown@go.com.jo

Kazakhstan

Rohde & Schwarz Kazakhstan
Representative Office Almaty
Pl. Respubliki 15
480013 Almaty
(Tel) +7 (32) 72 67 23 54
(Fax) +7 (32) 72 67 23 46
rs-kazakhstan@rsd-rohde-schwarz.com

Kenya

Excel Enterprises Ltd
Dunga Road
P.O.Box 42 788
Nairobi
(Tel) +254 (2) 55 80 88
(Fax) +254 (2) 54 46 79

Korea

Rohde & Schwarz Korea Ltd.
83-29 Nonhyun-Dong, Kangnam-Ku
Seoul 135-010
(Tel) +82 (2) 34 85 19 00
(Fax) +82 (2) 547 43 00
sales@rskor.rohde-schwarz.com·service@rskor.rohde-schwarz.com

Kuwait

Group Five Trading & Contracting Co.
Mezzanine Floor
Al-Bana Towers
Ahmad Al Jaber Street
Sharq
(Tel) +965 (244) 91 72/73/74
(Fax) +965 (244) 95 28
jk_agarwal@yahoo.com

Latvia

Rohde & Schwarz Danmark A/S
Latvian Branch Office
Merkela iela 21-301
1050 Riga
(Tel) +371 (7) 50 23 55
(Fax) +371 (7) 50 23 60
latvia@rsdk.rohde-schwarz.com

Lebanon

Rohde & Schwarz
Liaison Office Riyadh
P.O.Box 361
Riyadh 11411
(Tel) +966 (1) 465 64 28 Ext. 303
(Fax) +966 (1) 465 64 28 Ext. 229
chris.porzky@rsd.rohde-schwarz.com

Netcom
P.O.Box 55199
Op. Ex-Presidential Palace
Horch Tabet
Beirut
(Tel) +961 (1) 48 69 99
(Fax) +961 (1) 49 05 11
tohme.sayar@netcomm.tv

Liechtenstein

siehe/see Switzerland

Lithuania

Rohde & Schwarz Danmark A/S
Lithuanian Branch Office
Lukiskiu 5-228
2600 Vilnius
(Tel) +370 (5) 239 50 10
(Fax) +370 (5) 239 50 11
lithuania@rsdk.rohde-schwarz.com

Luxembourg

siehe/see Belgium

Macedonia

NETRA
Sarski odred 7
1000 Skopje
(Tel) +389 (2) 329 82 30
(Fax) +389 (2) 317 74 88
netra@netra.com.sk

Malaysia

Rohde & Schwarz Malaysia Sdn Bhd
Suite 10.04, Level 10, Wisma E&C
No. 2 Lorong Dungun Kiri
Damansara Heights
50490 Kuala-Lumpur
(Tel) +60 (3) 20 94 00 33
(Fax) +60 (3) 20 94 24 33
sales.malaysia@rohde-schwarz.com

Malta

Tektraco International Technology Ltd.
121, B'Kara Road
San Gwann SGN 08
(Tel) +356 (21) 37 43 00 or 37 80 88
(Fax) +356 (21) 37 66 67
sales@tektraco.com

Mexico

Rohde & Schwarz de Mexico
S. de R.L. de C.V.
German Centre Oficina 4-2-2
Av. Santa Fé 170
Col. Lomas de Santa Fé
01210 Mexico D.F.
(Tel) +52 (55) 85 03 99 13
(Fax) +52 (55) 85 03 99 16
latinoamerica@rsd.rohde-schwarz.com

Moldava

siehe/see Austria

Nepal

ICTC Pvt. Ltd.
Hattisar, Post Box No. 660
Kathmandu
(Tel) +977 (1) 443 48 95
(Fax) +977 (1) 443 49 37
ictc@mos.com.np

Netherlands
Rohde & Schwarz Nederland B.V.
Perkinsbaan 1
3439 ND Nieuwegein
(Tel) +31 (30) 600 17 00
(Fax) +31 (30) 600 17 99
info@rsn.rohde-schwarz.com

New Zealand
Nichecom
1 Lincoln Ave.
Tawa, Wellington
(Tel) +64 (4) 232 32 33
(Fax) +64 (4) 232 32 30
rob@nichecom.co.nz

Nicaragua
siehe/see Mexico

Nigeria
Ferrostaal Abuja
Plot 3323, Barada Close
P.O.Box 8513, Wuse
Off Amazon Street
Maitama, Abuja
(Tel) +234 (9) 413 52 51
(Fax) +234 (9) 413 52 50
fsabuja@rosecom.net

Norway
Rohde & Schwarz Norge AS
Enebakkveien 302 B
1188 Oslo
(Tel) +47 (23) 38 66 00
(Fax) +47 (23) 38 66 01
firmapost@rsnor.rohde-schwarz.com

Oman
Mustafa Sultan Science & Industry Co.LLC.
Test & Measurement Products
Way No. 3503
Building No. 241
Postal Code 112
Al Khuwair, Muscat
(Tel) +968 63 60 00
(Fax) +968 60 70 66
m-aziz@mustafasultan.com

Pakistan
Siemens Pakistan
23, West Jinnah Avenue
Islamabad
(Tel) +92 (51) 227 22 00
(Fax) +92 (51) 227 54 98
reza.bokhary@siemens.com.pk

Panama
siehe/see Mexico

Papua New Guinea
siehe/see Australia

Paraguay
siehe/see Argentina

Philippines
Rohde & Schwarz (Philippines) Inc.
Unit 2301, PBCom Tower
6795, Ayala Ave. cor. Herrera St.
Makati City
(Tel) +63 (2) 753 14 44
(Fax) +63 (2) 753 14 56

Poland
Rohde & Schwarz SP.z o.o.
Przedstawicielstwo w Polsce
ul. Stawki 2, Pietro 28
00-193 Warszawa
(Tel) +48 (22) 860 64 94
(Fax) +48 (22) 860 64 99
rs-poland@rspl.rohde-schwarz.com

Portugal
Rohde & Schwarz Portugal, Lda.
Alameda Antonio Sergio
7-R/C - Sala A
2795-023 Linda-a-Velha
(Tel) +351 (21) 415 57 00
(Fax) +351 (21) 415 57 10
info@rspt.rohde-schwarz.com

Republic Dominican
siehe/see Mexico

Romania
Rohde & Schwarz
Representation Office Bucharest
89 Eroii Sanitari Bldv., sector 5
050472 Bucuresti
(Tel) +40 (21) 411 20 13
(Fax) +40 (21) 410 68 46
rs-romania@rsro.rohde-schwarz.com

Russian Federation
Rohde & Schwarz International GmbH
119180, Yakimanskaya nab., 2
Moscow
(Tel) +7 (095) 745 88 50 to 53
(Fax) +7 (095) 745 88 54
rs-russia@rsru.rohde-schwarz.com

Saudi Arabia
Rohde & Schwarz International GmbH -
Liaison Office Riyadh
c/o Haji Abdullah Alireza Co. Ltd.
P O.Box 361
Riyadh 11411
(Tel) +966 (1) 293 2035
(Fax) +966 (1) 466 1657
chris.porzky@rsd.rohde-schwarz.com

Saudi Arabia
Gentec
Haji Abdullah Alireza & Co. Ltd.
P.O.Box 43054
Riyadh
(Tel) +966 (1) 293 20 35
(Fax) +966 (1) 466 16 57
akanbar@gentec.com.sa

Serbia-Montenegro
Rohde & Schwarz
Representative Office Belgrade
Tose Jovanovica 7
11030 Beograd
(Tel) +381 (11) 305 50 25
(Fax) +381 (11) 305 50 24
rs-scg@rscs.rohde-schwarz.com

Singapore
Rohde & Schwarz Regional Headquarters
Singapore Pte. Ltd.
1 Kaki Bukit View
#05-01/02 Techview
Singapore 415 941
(Tel) +65 68 46 18 72
(Fax) +65 68 46 12 52

Rohde & Schwarz Systems &
Communications Asia Pte Ltd
Service
1 Kaki Bukit View
#04-01/07 Techview
Singapore 415 941
(Tel) +65 68 46 37 10
(Fax) +65 68 46 00 29
info@rssg.rohde-schwarz.com

Slovak Republic
Specialne systemy a software, a.s.
Svrcia ul. 3
841 04 Bratislava 4
(Tel) +421 (2) 65 42 24 88
(Fax) +421 (2) 65 42 07 68
3s@special.sk

Slovenia
Rohde & Schwarz
Representative Office Ljubljana
Tbilisijska 89
1000 Ljubljana
(Tel) +386 (1) 423 46 51
(Fax) +386 (1) 423 46 11
rs-slovenia@rssi.rohde-schwarz.com

South Africa
Protea Data Systems (Pty.) Ltd.
Communications and Measurement Division
Private Bag X19
Bramley 2018
(Tel) +27 (11) 719 57 00
(Fax) +27 (11) 786 58 91
unicm@protea.co.za

Protea Data Systems (Pty.) Ltd.
Cape Town Branch
Unit G9, Centurion Business Park
Bosmandam Road
Milnerton
Cape Town, 7441
(Tel) +27 (21) 555 36 32
(Fax) +27 (21) 555 42 67
unicm@protea.co.za

Spain
Rohde & Schwarz Espana S.A.
Salcedo, 11
28034 Madrid
(Tel) +34 (91) 334 10 70
(Fax) +34 (91) 729 05 06
rses@rses.rohde-schwarz.com

Rohde & Schwarz Espana S.A.
Av. Princep d'Astúries, 66
08012 Barcelona
(Tel) +34 (93) 415 15 68
(Fax) +34 (93) 237 49 95
bcn@rses.rohde-schwarz.com

Sri Lanka
Dynatel Communications (PTE) Ltd.
451/A Kandy Road
Kelaniya
(Tel) +94 (112) 90 80 01
(Fax) +94 (112) 91 04 69 69
dynatel@dynanet.lk

Sudan
SolarMan Co. Ltd.
P.O.Box 11 545
North of Fraouq Cementry 6/7/9 Bldg. 16
Karthoum
(Tel) +249 (183) 47 31 08
(Fax) +249 (183) 47 31 38
solarman29@hotmail.com

Sweden
Rohde & Schwarz Sverige AB
Flygfaltsgatan 15
128 30 Skarpnäck
(Tel) +46 (8) 605 19 00
(Fax) +46 (8) 605 19 80
info@rss.rohde-schwarz.com

Switzerland
Roschi Rohde & Schwarz AG
Muhlestr. 7
3063 Ittigen
(Tel) +41 (31) 922 15 22
(Fax) +41 (31) 921 81 01
support@roschi.rohde-schwarz.com

Syria
Electro Scientific Office
Baghdad Street
Dawara Clinical Lab. Bldg
P O Box 8162
Damascus
(Tel) +963 (11) 231 59 74
(Fax) +963 (11) 231 88 75
memo@hamshointl.com

Taiwan
Rohde & Schwarz Taiwan (Pvt.) Ltd.
Floor 14, No. 13, Sec. 2, Pei-Tou Road
Taipei 112
(Tel) +886 (2) 28 93 10 88
(Fax) +886 (2) 28 91 72 60
celine.tu@rstw.rohde-schwarz.com

Tanzania
SSTL Group
P.O. Box 7512
Dunga Street Plot 343/345
Dar Es Salaam
(Tel) +255 (22) 276 00 37
(Fax) +255 (22) 276 02 93
sstl@ud.co.tz

Thailand
Rohde & Schwarz International Thailand
2nd floor Gems Tower
Bangrak, Suriyawong
Bangkok 10600
(Tel) +66 (2) 200 07 29
(Fax) +66 (2) 267 00 79

Schmidt Electronics (Thailand) Ltd.
Messtechnik
202 Le Concorede Tower, 23rd Fl.
Ratchadaphisek Rd.
Huay kwang
Bangkok 10320
(Tel) +66 (2) 69 41 47 05
(Fax) +66 (2) 69 41 476
salestm@schmidtelectronics.com

TPP Operation Co. Ltd.
Kommunikationstechnik
41/5 Mooban Tarinee
Boromrajchonnee Road
Talingchan
Bangkok 10170
(Tel) +66 (2) 880 93 47
(Fax) +66 (2) 880 93 47

Trinidad &Tobago
siehe/see Mexico
(Tel)
(Fax)

Tunisia
Teletek
71, Rue Alain Savary
Residence Alain Savary (C64)
Cité el Khadra
1003 Tunis
(Tel) +216 (71) 77 33 88
(Fax) +216 (71) 77 05 53
teletek@gnet.tn

Turkey
Rohde & Schwarz International GmbH
Liaison Office Istanbul
Bagdat Cad. 191/3, Arda Apt. B-Blok
81030 Selamicesme-Istanbul
(Tel) +90 (216) 385 19 17
(Fax) +90 (216) 385 19 18
nadir.guerelman@rsd.rohde-schwarz.com

Ukraine
Rohde & Schwarz
Representative Office Kiev
4, Patris Loumoumba ul.
01042 Kiev
(Tel) +38 (044) 268 60 55
(Fax) +38 (044) 268 83 64
rsbkiev@public.ua.net

United Arab Emirates
Rohde & Schwarz International GmbH
Liaison Office Middle East
Vertrieb
P.O. Box 31156
Abu Dhabi
(Tel) +971 (2) 6335 670
(Fax) +971 (2) 6335 671
Dario Barisoni@rsd.rohde-schwarz.com

Rohde & Schwarz Bick Mobile
Communication
P.O.Box 17466
JAFZ, PPU ZG-07
Dubai
(Tel) +971 (4) 883 71 35
(Fax) +971 (4) 883 71 36

Rohde & Schwarz Emirates L.L.C.
ESNAAD Premisses at Mussafah, P.O.Box 31156
Abu Dhabi
(Tel) +971 (2) 55 49 411
(Fax) +971 (2) 55 49 433
rsuaeam@emirates.net.ae

United Kingdom
Rohde & Schwarz UK Ltd.
Ancells Business Park
Fleet
Hampshire GU51 2UZ
(Tel) +44 (1252) 81 88 88 (sales) +44 (1252) 81 88 18 (service)
(Fax) +44 (1252) 81 14 47
sales@rsuk.rohde-schwarz.com

United Kingdom
Rohde & Schwarz UK Ltd.
3000 Manchester Business Park
Aviator Way
Manchester M22 5TG
(Tel) +44 (870) 735 16 42
(Fax) +44 (1252) 81 14 77
sales@rsuk.rohde-schwarz.com

Uruguay
Aeromarine S.A.
Cerro Largo 1497
11200 Montevideo
(Tel) +598 (2) 400 39 62
(Fax) +598 (2) 401 85 97
cs@aeromarine.com.uy

USA
Rohde & Schwarz, Inc.
Eastern Regional Office (US Headquarters)
8661A Robert Fulton Drive
Columbia, MD 21046-2265
(Tel) +1 (410) 910 78 00
(Fax) +1 (410) 910 78 01
info@rsa.rohde-schwarz.com

Rohde & Schwarz, Inc.
Central Regional Office / Systems & EMI Products
8080 Tristar Drive
Suite 120
Irving, TX 75063
(Tel) +1 (469) 713 53 00
(Fax) +1 (469) 713 53 01
info@rsa.rohde-schwarz.com

Rohde & Schwarz, Inc.
R&D and Application Support
8905 SW Nimbus Ave
Suite 240
Beaverton, OR 97008
(Tel) +1 (503) 403 47 00
(Fax) +1 (503) 403 47 01
info@rsa.rohde-schwarz.com

Rohde & Schwarz, Inc.
Western Regional Office
7700 Irvine Center Drive
Suite 100
Irvine, CA 92618
(Tel) +1 (949) 885 70 00
(Fax) +1 (949) 885 70 01
info@rsa.rohde-schwarz.com

Rohde & Schwarz, Inc.
Service & Calibration Center
8661A Robert Fulton Drive
Columbia, MD 21046-2265
(Tel) +1 (410) 910 50 02
(Fax) +1 (410) 910 79 31
service.rsa@rsa.rohde-schwarz.com

Vietnam
Rohde & Schwarz Representative Office Vietnam
Unit 807, 8/F, Schmidt Tower
239 Xuan Thuy Road
Cau Giay District
Hanoi
(Tel) +84 (4) 834 20 46

West Indies
siehe/see Mexico

Contents of Manuals for Measuring Receiver R&S FSMR

Operating Manual R&S FSMR

The operating manual describes the following models and options of Measuring Receiver R&S FSMR:

- R&S FSMR3 20 Hz to 3.6 GHz
- R&S FSMR26 20 Hz to 26.5 GHz

- Option R&S FSU-B9 tracking generator
- Option R&S FSMR-B18 removable hard drive

This operating manual contains information about the technical data of the instrument, the setup functions and about how to put the instrument into operation. It informs about the operating concept and controls as well as about the operation of the R&S FSMR via the menus and via remote control. Typical measurement tasks for the R&S FSMR are explained using the functions offered by the menus and a selection of program examples.

Additionally the operating manual includes information about maintenance of the instrument and about error detection listing the error messages which may be output by the instrument. It is subdivided into 9 chapters:

The data sheet	informs about guaranteed specifications and characteristics of the instrument.
Chapter 1	describes the control elements and connectors on the front and rear panel as well as all procedures required for putting the R&S FSMR into operation and integration into a test system.
Chapter 2	gives an introduction to typical measurement tasks of the R&S FSMR which are explained step by step.
Chapter 3	describes the operating principles, the structure of the graphical interface and offers a menu overview.
Chapter 4	forms a reference for manual control of the FSP and contains a detailed description of all instrument functions and their application. The chapter also lists the remote control command corresponding to each instrument function.
Chapter 5	describes the basics for programming the R&S FSMR, command processing and the status reporting system.
Chapter 6	lists all the remote-control commands defined for the instrument. At the end of the chapter a alphabetical list of commands and a table of softkeys with command assignment is given.
Chapter 7	contains program examples for a number of typical applications of the R&S FSMR.
Chapter 8	describes preventive maintenance and the characteristics of the instrument's interfaces.
Chapter 8	gives a list of error messages that the R&S FSMR may generate.
Chapter 9	contains a list of error messages.
Chapter 10	contains an index for the operating manual.

Service Manual - Instrument

The service manual - instrument informs on how to check compliance with rated specifications, on instrument function, repair, troubleshooting and fault elimination. It contains all information required for the maintenance of R&S FSMR by exchanging modules.

Contents - Chapter 1 " Preparing for Operation "

1 Preparing for Operation 1.1

Description of Front and Rear Panel Views 1.1

Front View 1.1

Rear View 1.11

Getting Started with the Instrument 1.16

Preparing the Instrument for Operation 1.16

Setting Up the Instrument 1.16

Standalone Operation 1.16

Safety Instruction for Instruments with Tiltable Feet 1.17

Rackmounting 1.17

EMC Safety Precautions 1.18

Connecting the Instrument to the AC Supply 1.18

Switching the Instrument On/Off 1.18

Switching On the Instrument 1.19

Startup Menu and Booting 1.19

Switching Off the R&S FSMR 1.19

Operating the R&S FSMR with the Removable Hard Disk Option R&S FSMR-B18 ... 1.19

Power-Save Mode 1.20

Recalling the Most Recent Instrument Settings 1.20

Function Test 1.20

Windows XP 1.21

Connecting an External Keyboard 1.22

Connecting a Mouse 1.23

Connecting an External Monitor 1.24

Connecting a Printer 1.25

Selecting a Printer 1.25

Installation of Plug&Play Printers 1.28

Installation of Non-Plug&Play Printers 1.28

Local Printer 1.30

Configuring a Network Printer 1.34

Connection of USB Devices 1.36

Installing Windows XP Software 1.38

Authorized Windows XP Software for the Instrument 1.38

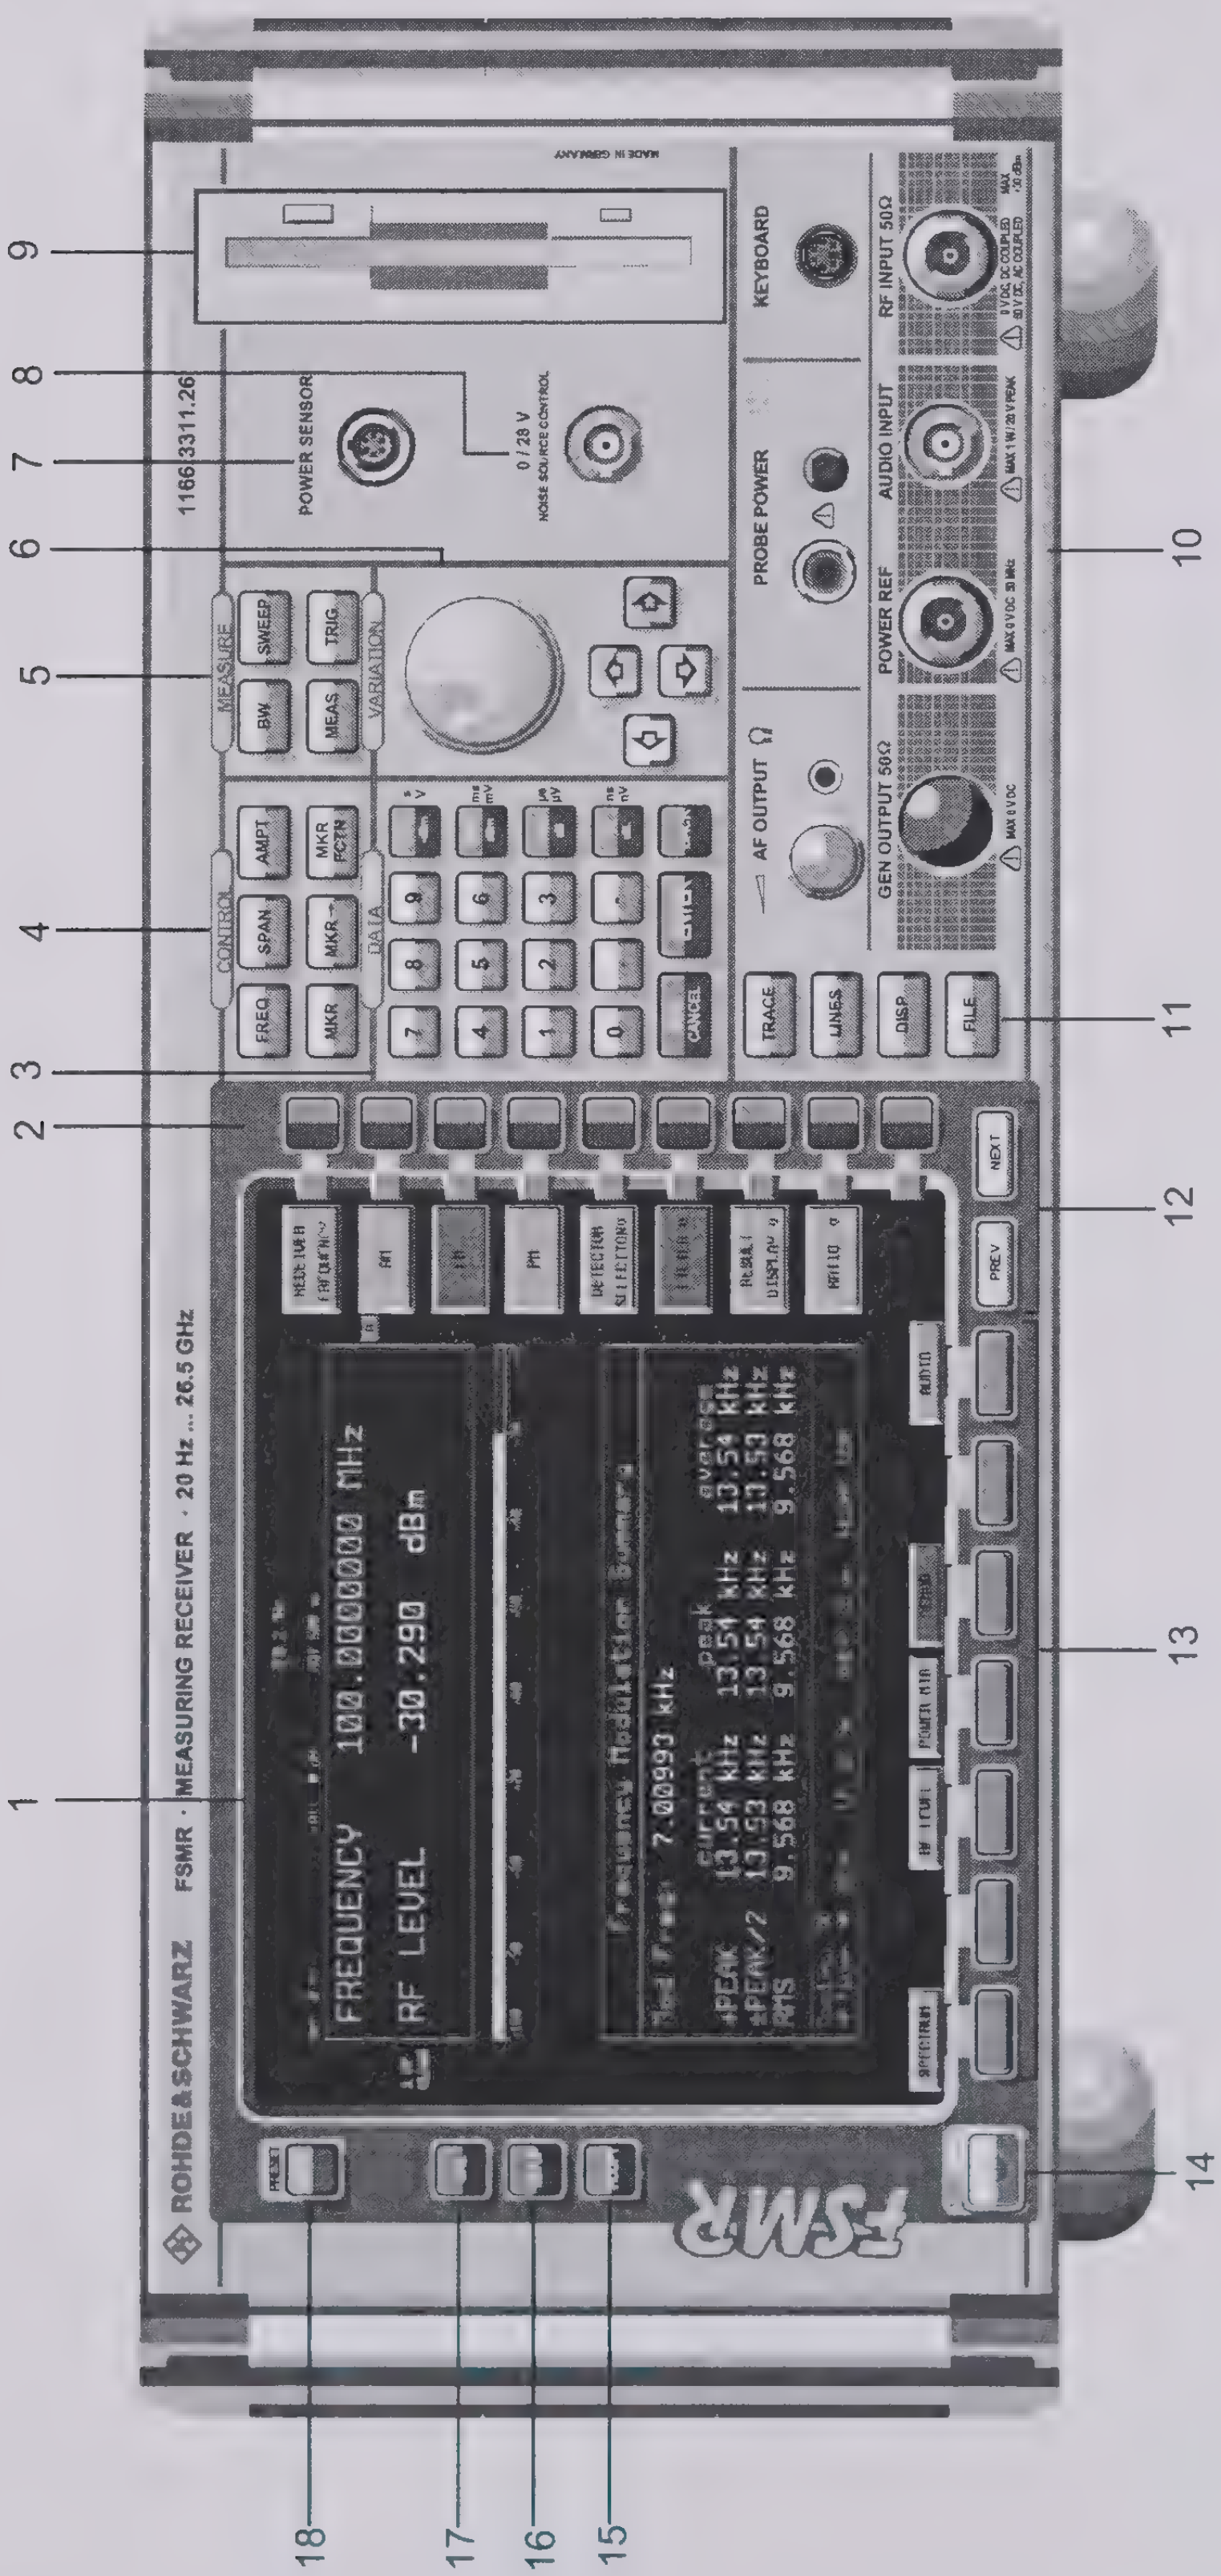

Fig. 1-1 Front View

1 Preparing for Operation

Chapter 1 describes the controls and connectors of the Spectrum Analyzer FSP by means of the front and rear view. Then follows all the information that is necessary to put the instrument into operation and connect it to the AC supply and to external devices.

A more detailed description of the hardware connectors and interfaces can be found in chapter 8. Chapter 2 provides an introduction into the operation of the FSP by means of typical examples of configuration and measurement; for the description of the concept for manual operation and an overview of menus refer to chapter 3.

For a systematic explanation of all menus, functions and parameters and background information refer to the reference part in chapter 4.

For remote control of the FSP refer to the general description of the SCPI commands, the instrument model, the status reporting system, and command description in chapter 5 and 6.

Description of Front and Rear Panel Views

Front View

1

Display Screen — see Chapter 3

2

Softkeys — see Chapter 3

3

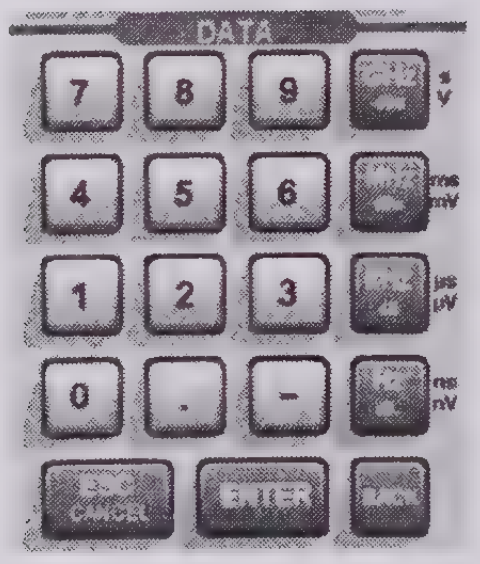

Keypad for data input — see Chapter 3

0...9	input numbers
.	input decimal point
–	change sign
ESC CANCEL	– close input field (for uncompleted or already closed inputs, the original entry is kept) – erase the current entry in input field (beginning of an input) – close message window (status, error and warning messages)
ENTER	close the data input.
BACK	– erase last character input for uncompleted input – restore previous input (undo)

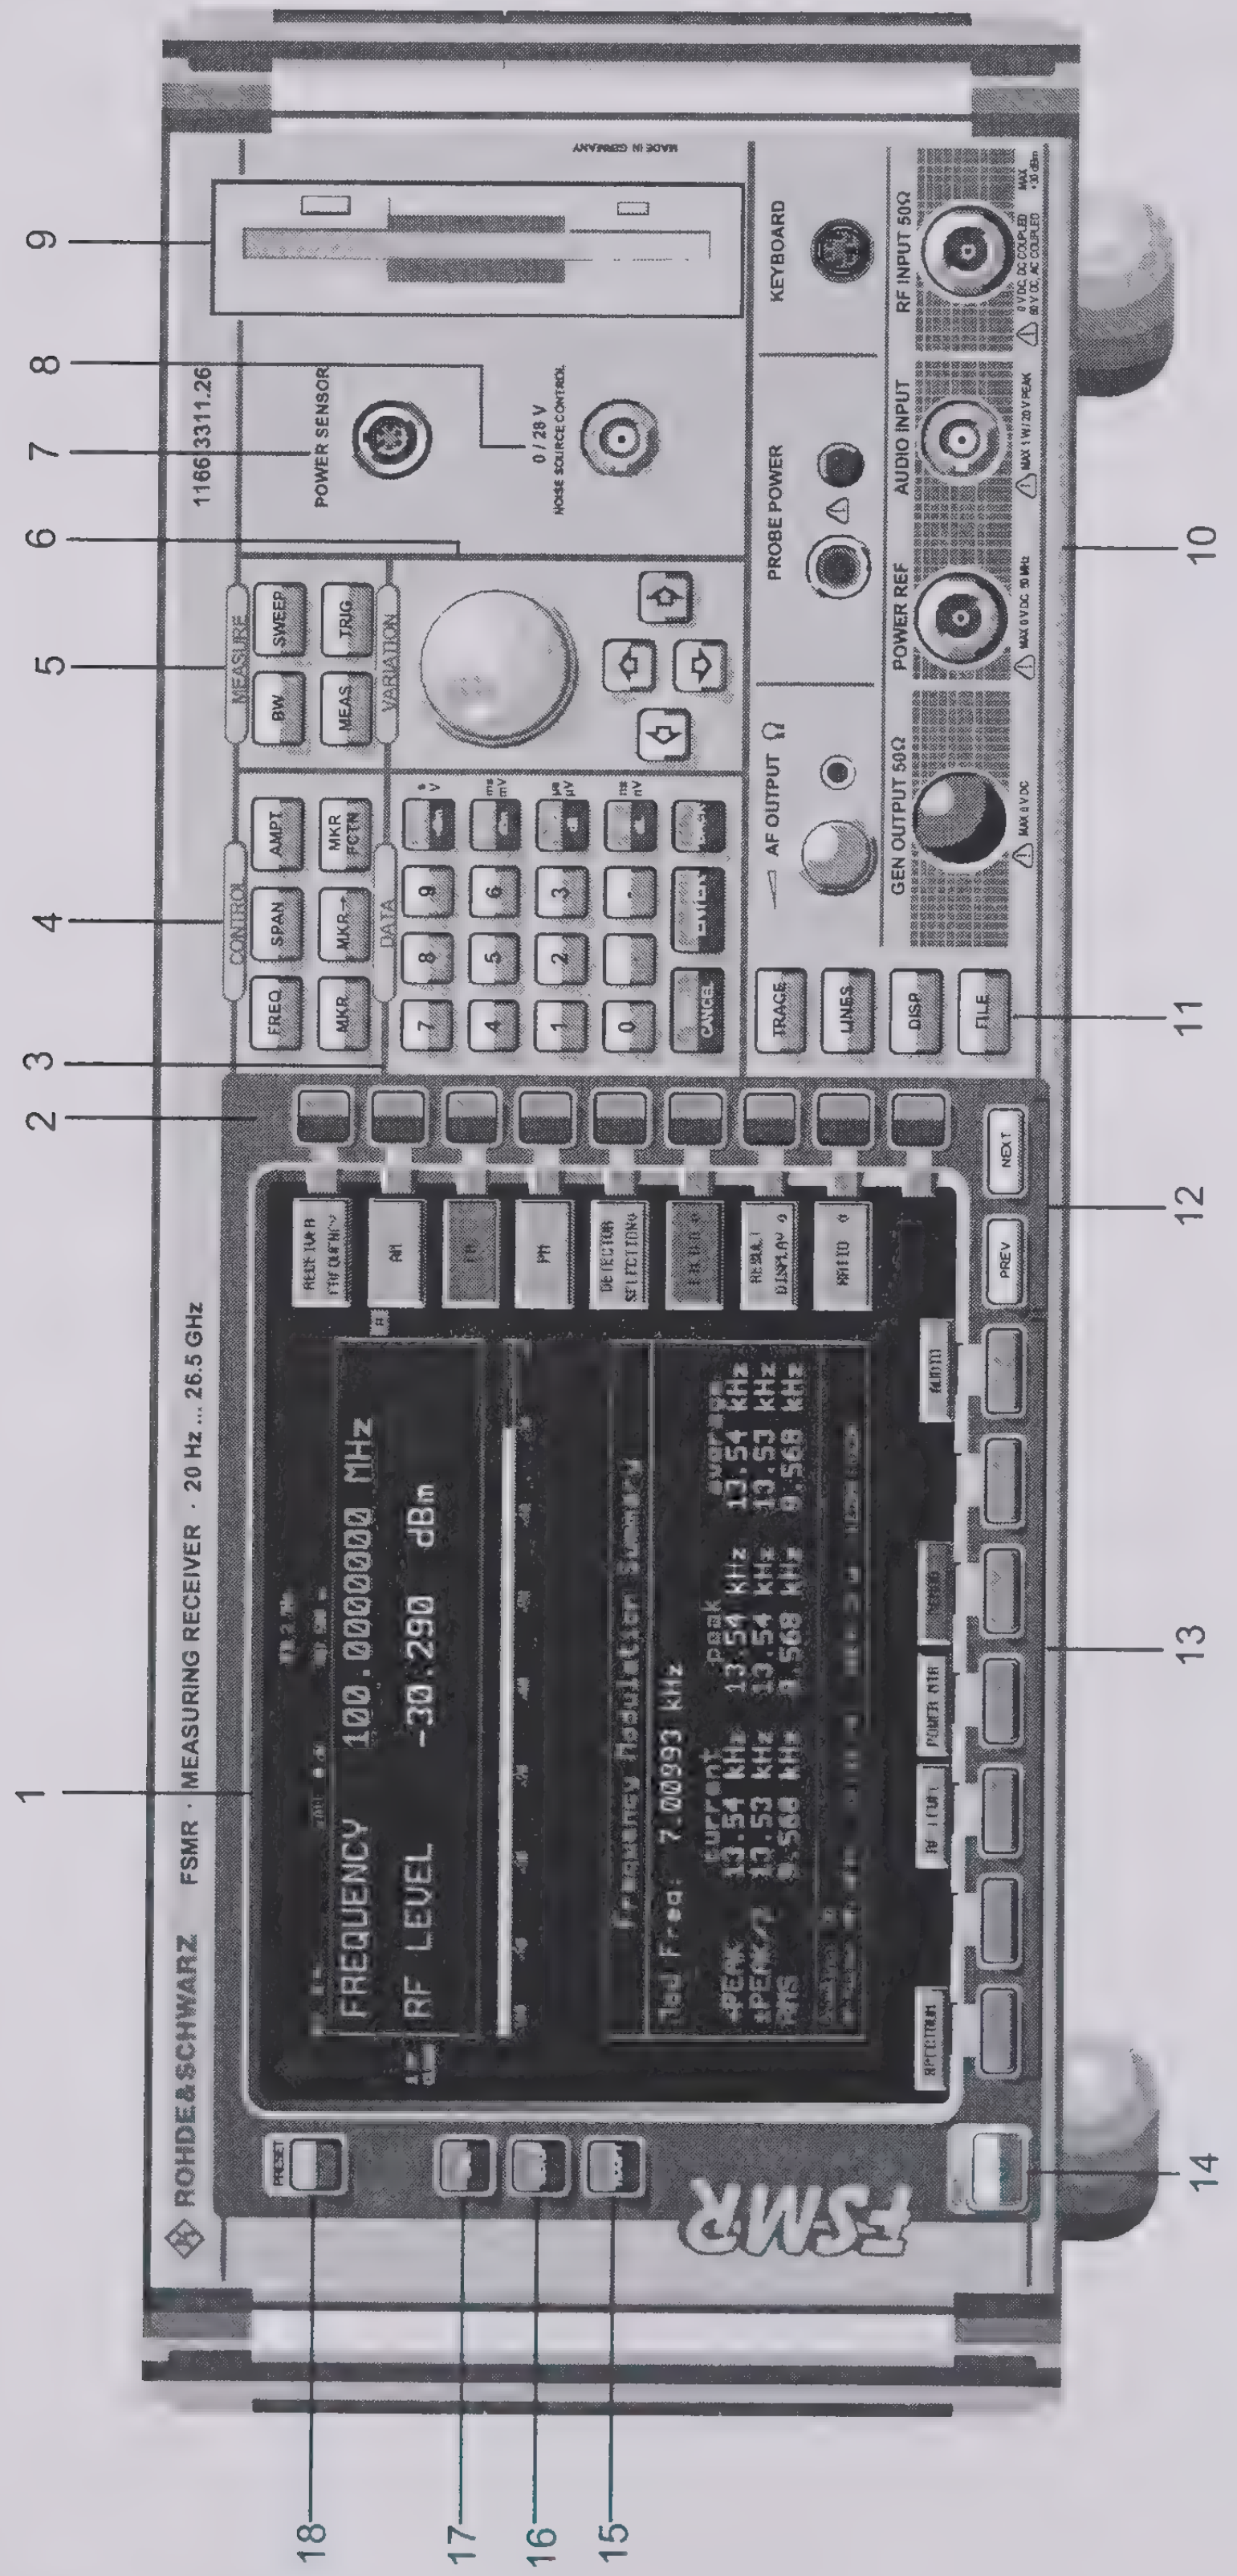

Fig. 1-1 Front View

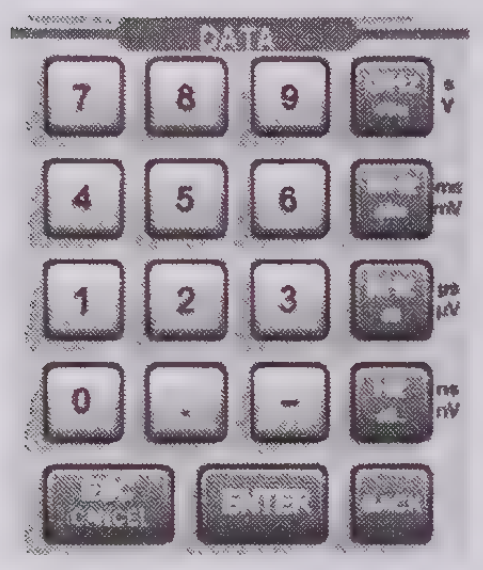

Keypad for data input

GHz s -dBm V	The units keys close the data input and define the multiplication factor for each basic unit.
MHz ms dBm mV	For dimension-less or alphanumeric inputs, the units keys have weight 1.
kHz µs dB µV	They behave, in this case, like the ENTER key.
Hz ns dB.. nV	

see Chapter 3

4

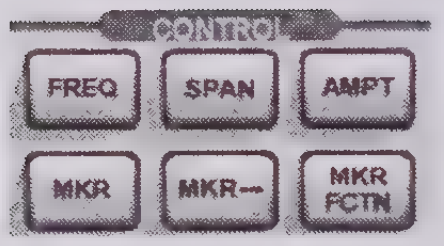

FREQ	Set frequency axis
SPAN	Set span
AMPT	Set level indication and configure RF input.
MKR	Select and set standard marker and delta marker functions.
MKR->	Change instrument settings via markers
MKR FCTN	Select further marker and delta marker functions

see Chapter 4

5

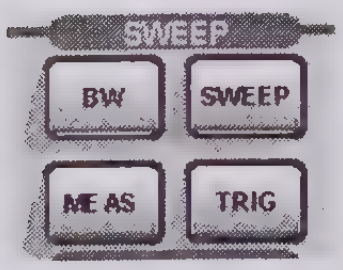

BW	– Set resolution bandwidth, video bandwidth and sweep time, – Set coupling of these parameters
SWEEP	Select sweep
MEAS	Select and set power measurements
TRIG	Set trigger sources

see Chapter 4

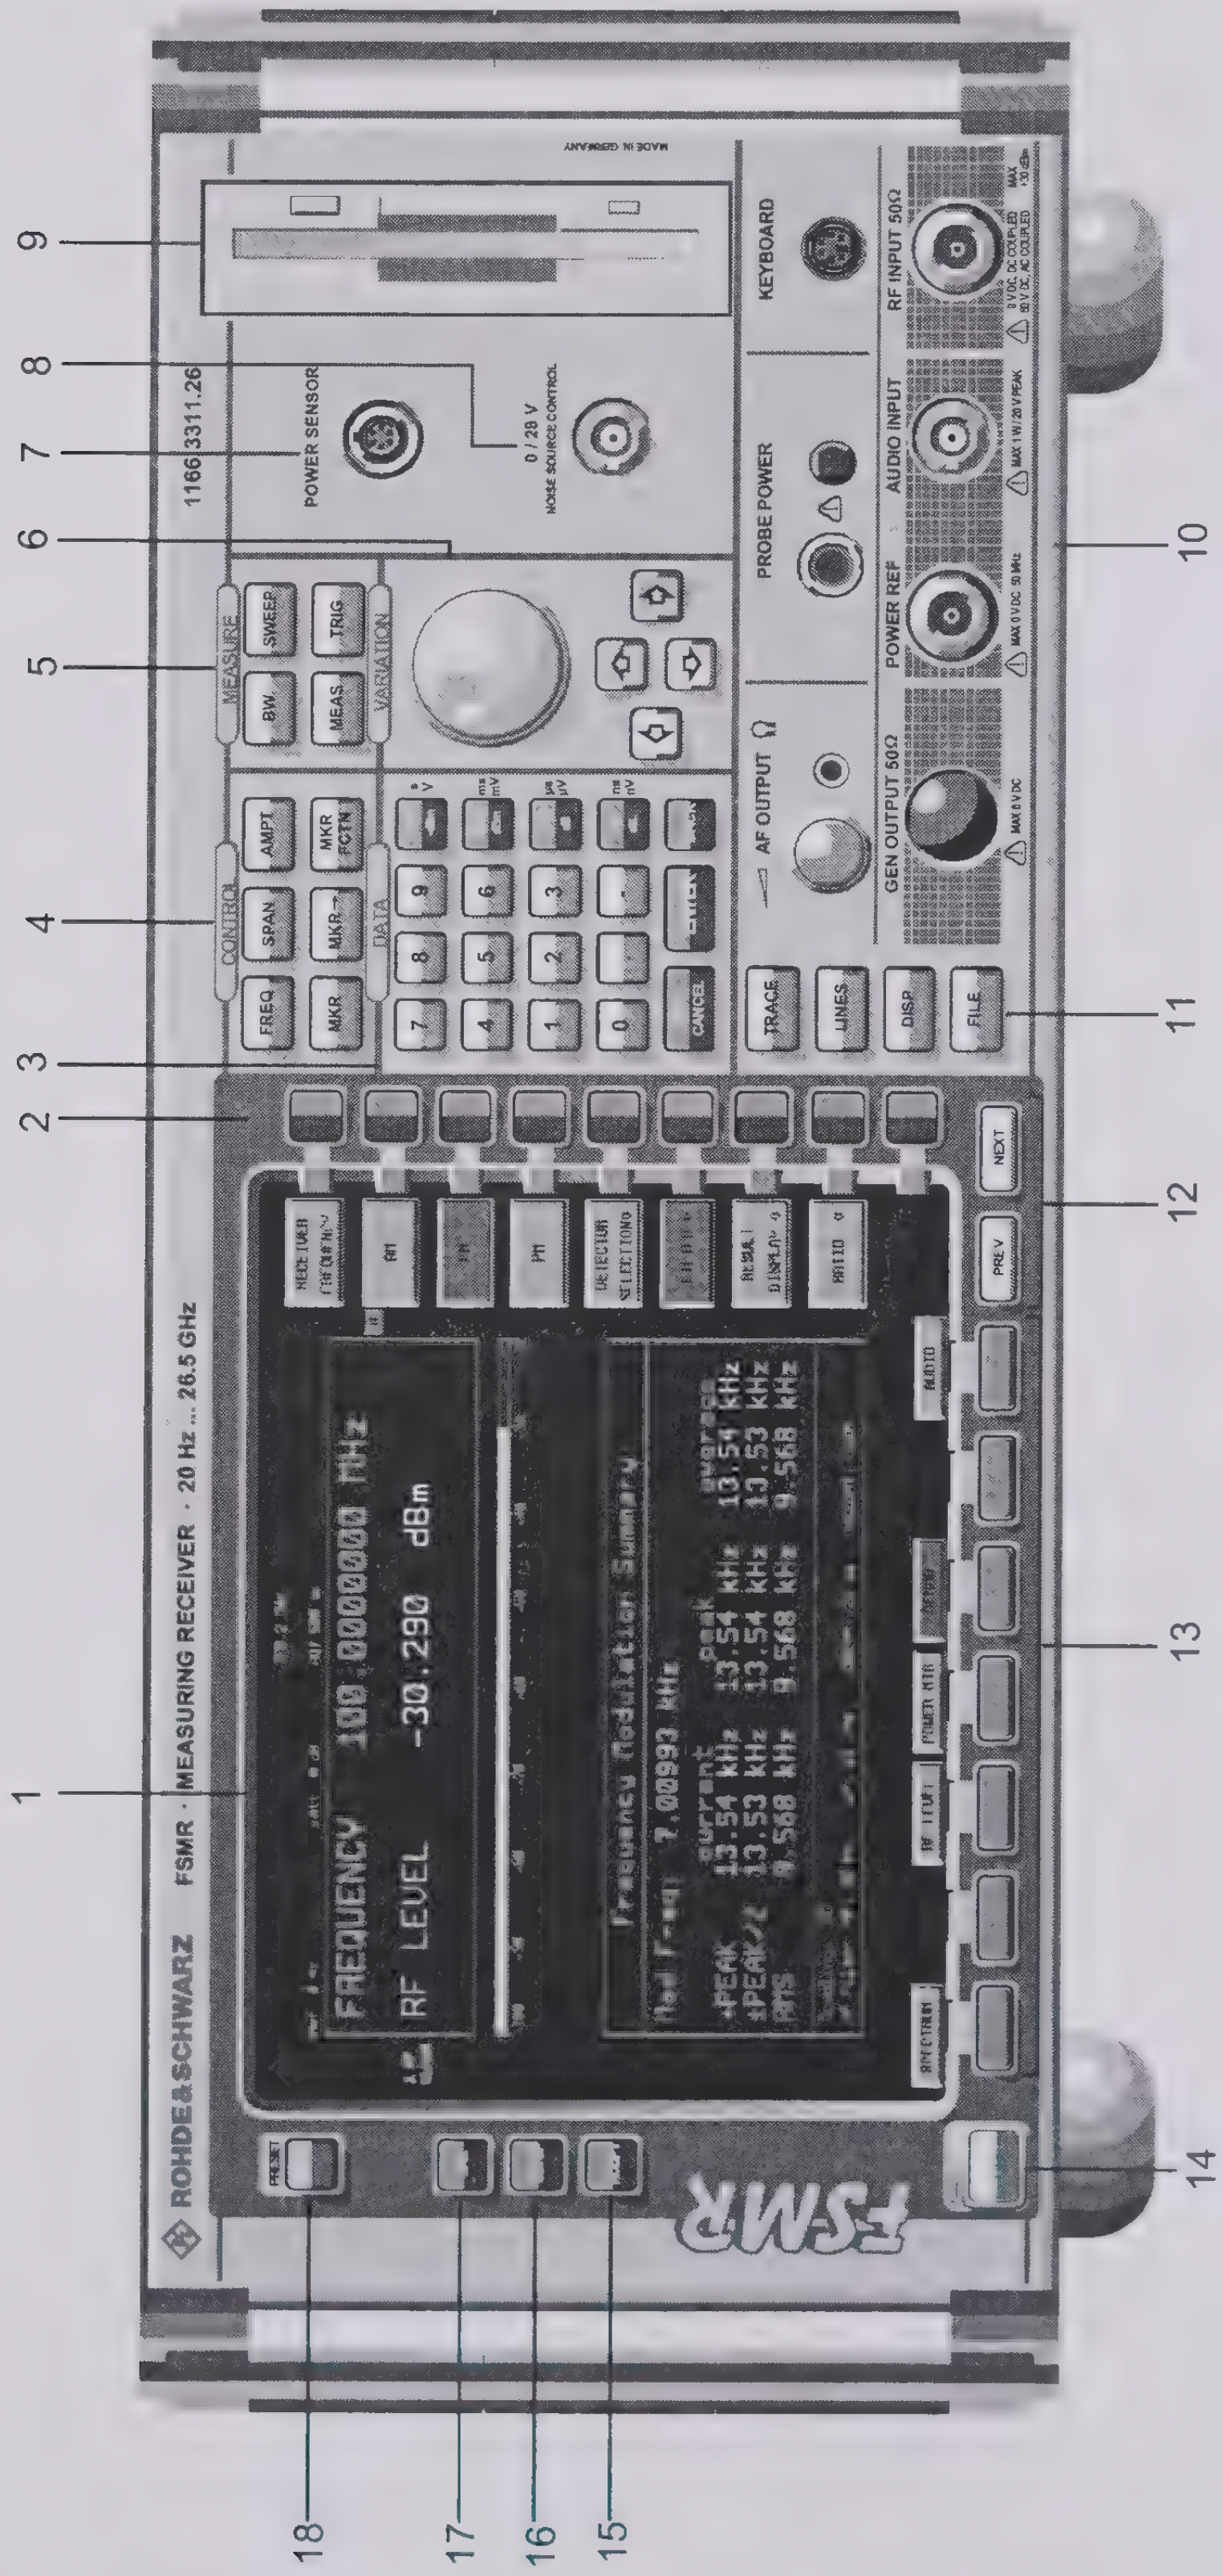

Fig. 1-1 Front View

6

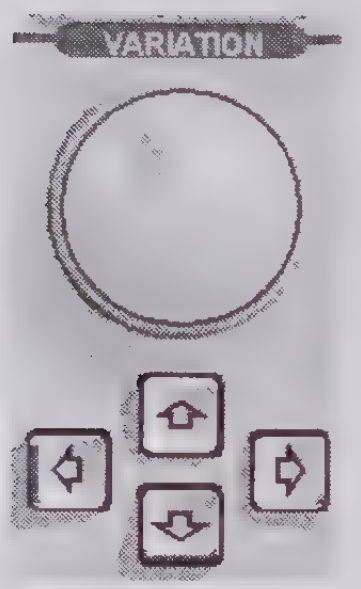

Key group for entering data and for cursor movement

see Chapter 3

Cursor keys
- Move the cursor within the input fields and tables.
- Vary the input value.
- Define the direction of movement for the roll-key.

Roll-key
- Vary input values.
- Move markers and limits.
- Select letters in the help line editor.
- Move cursor in the tables
- Close data input (ENTER)

7

Output connector for an external noise source

8

Connector for the power sensors NRP-Zx

s. Kap. 3

9

3 1/2" diskette drive; 1.44 MByte

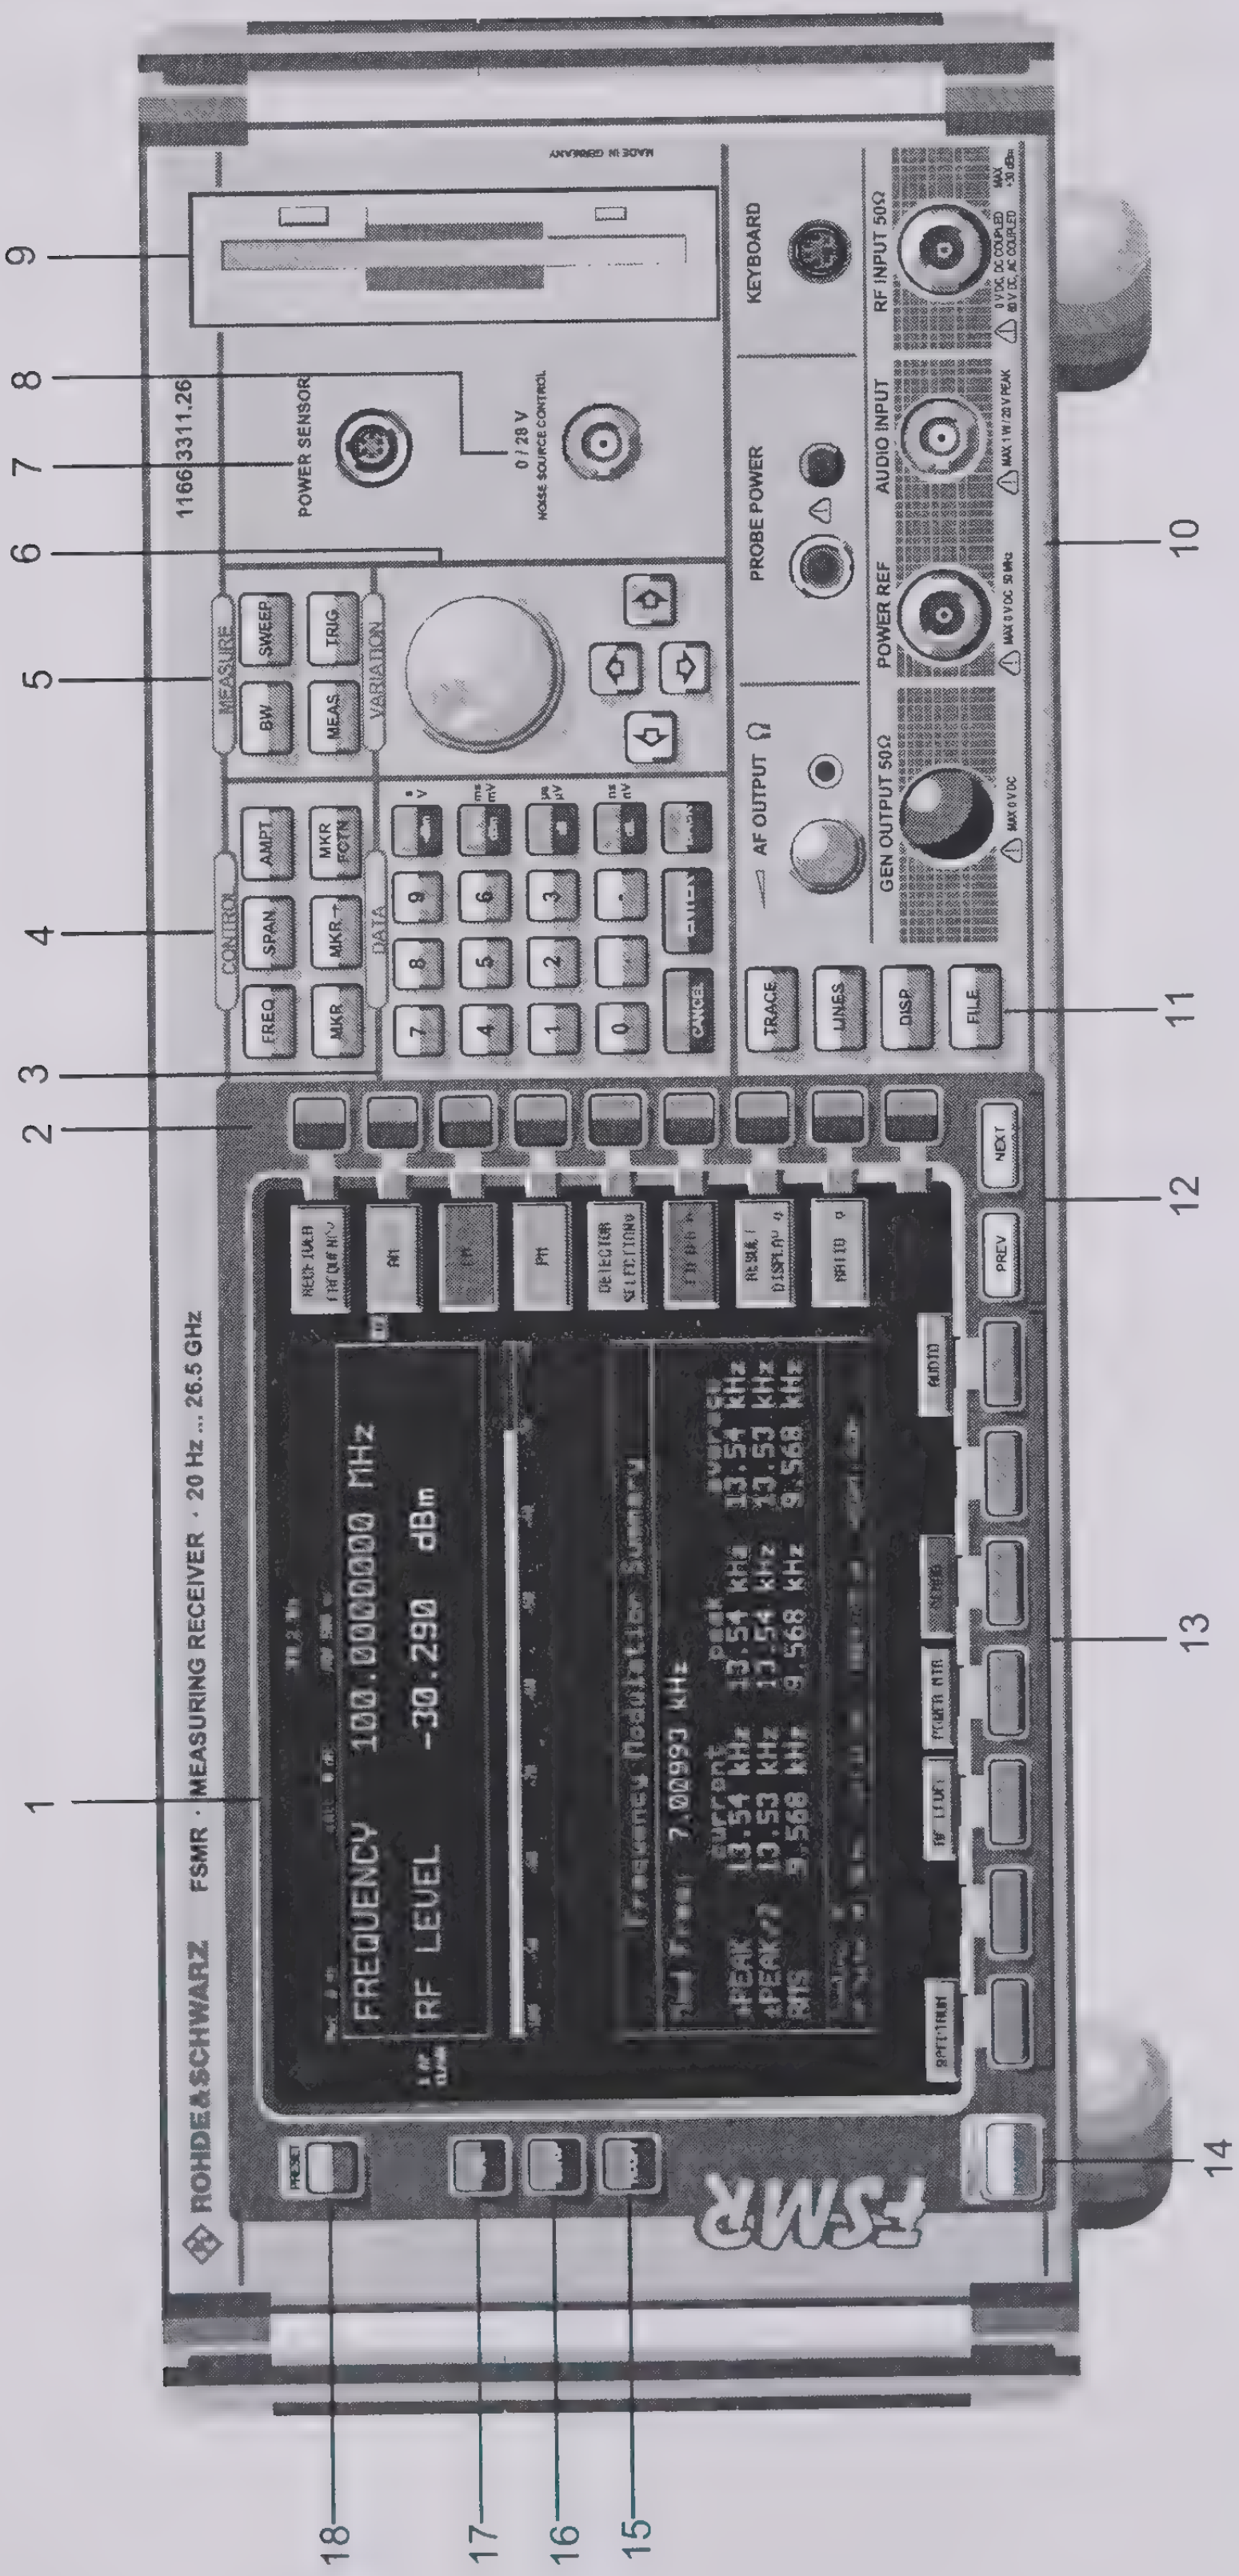

Fig. 1-1 Front View

10

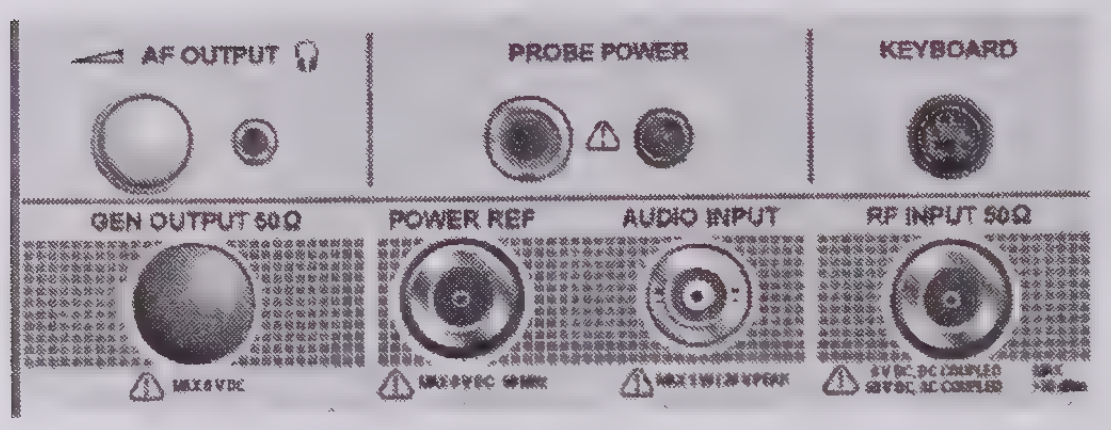

AF OUTPUT		s. Chapter 8
◢	Volume control	
🎧	Head phone connector	
PROBE POWER	Power supply and coded socket (+15 V/ -12 V) for accessories	
KEYBOARD	Connector for an external keyboard	
RF INPUT	RF input **_Caution:_** *The maximum DC voltage is 50 V, the maximum power is 1 W (≙ 30 dBm) at ≥ 10 dB attenuation.*	see Chapter 8
AUDIO INPUT	Audio input with 50 Ω or 1 MΩ input impedance **_Caution:_** *The input can handle a maximum power of 1 W or a peak voltage of 20 V.*	
POWER REF	Referenzquelle 50 MHz, 1mW **_Caution:_** *The maximum DC voltage is 0.*	

11

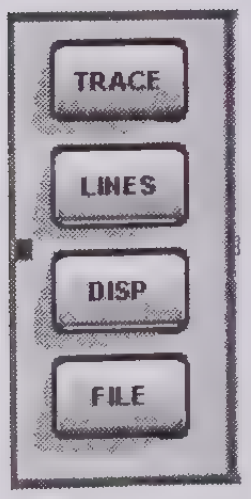

TRACE	Select and activate traces and detectors	see Chapter 4
LINES	Set limit lines	
DISP	Configure display	
FILE	– Save and recall instrument data – Configuration of memory media and data	

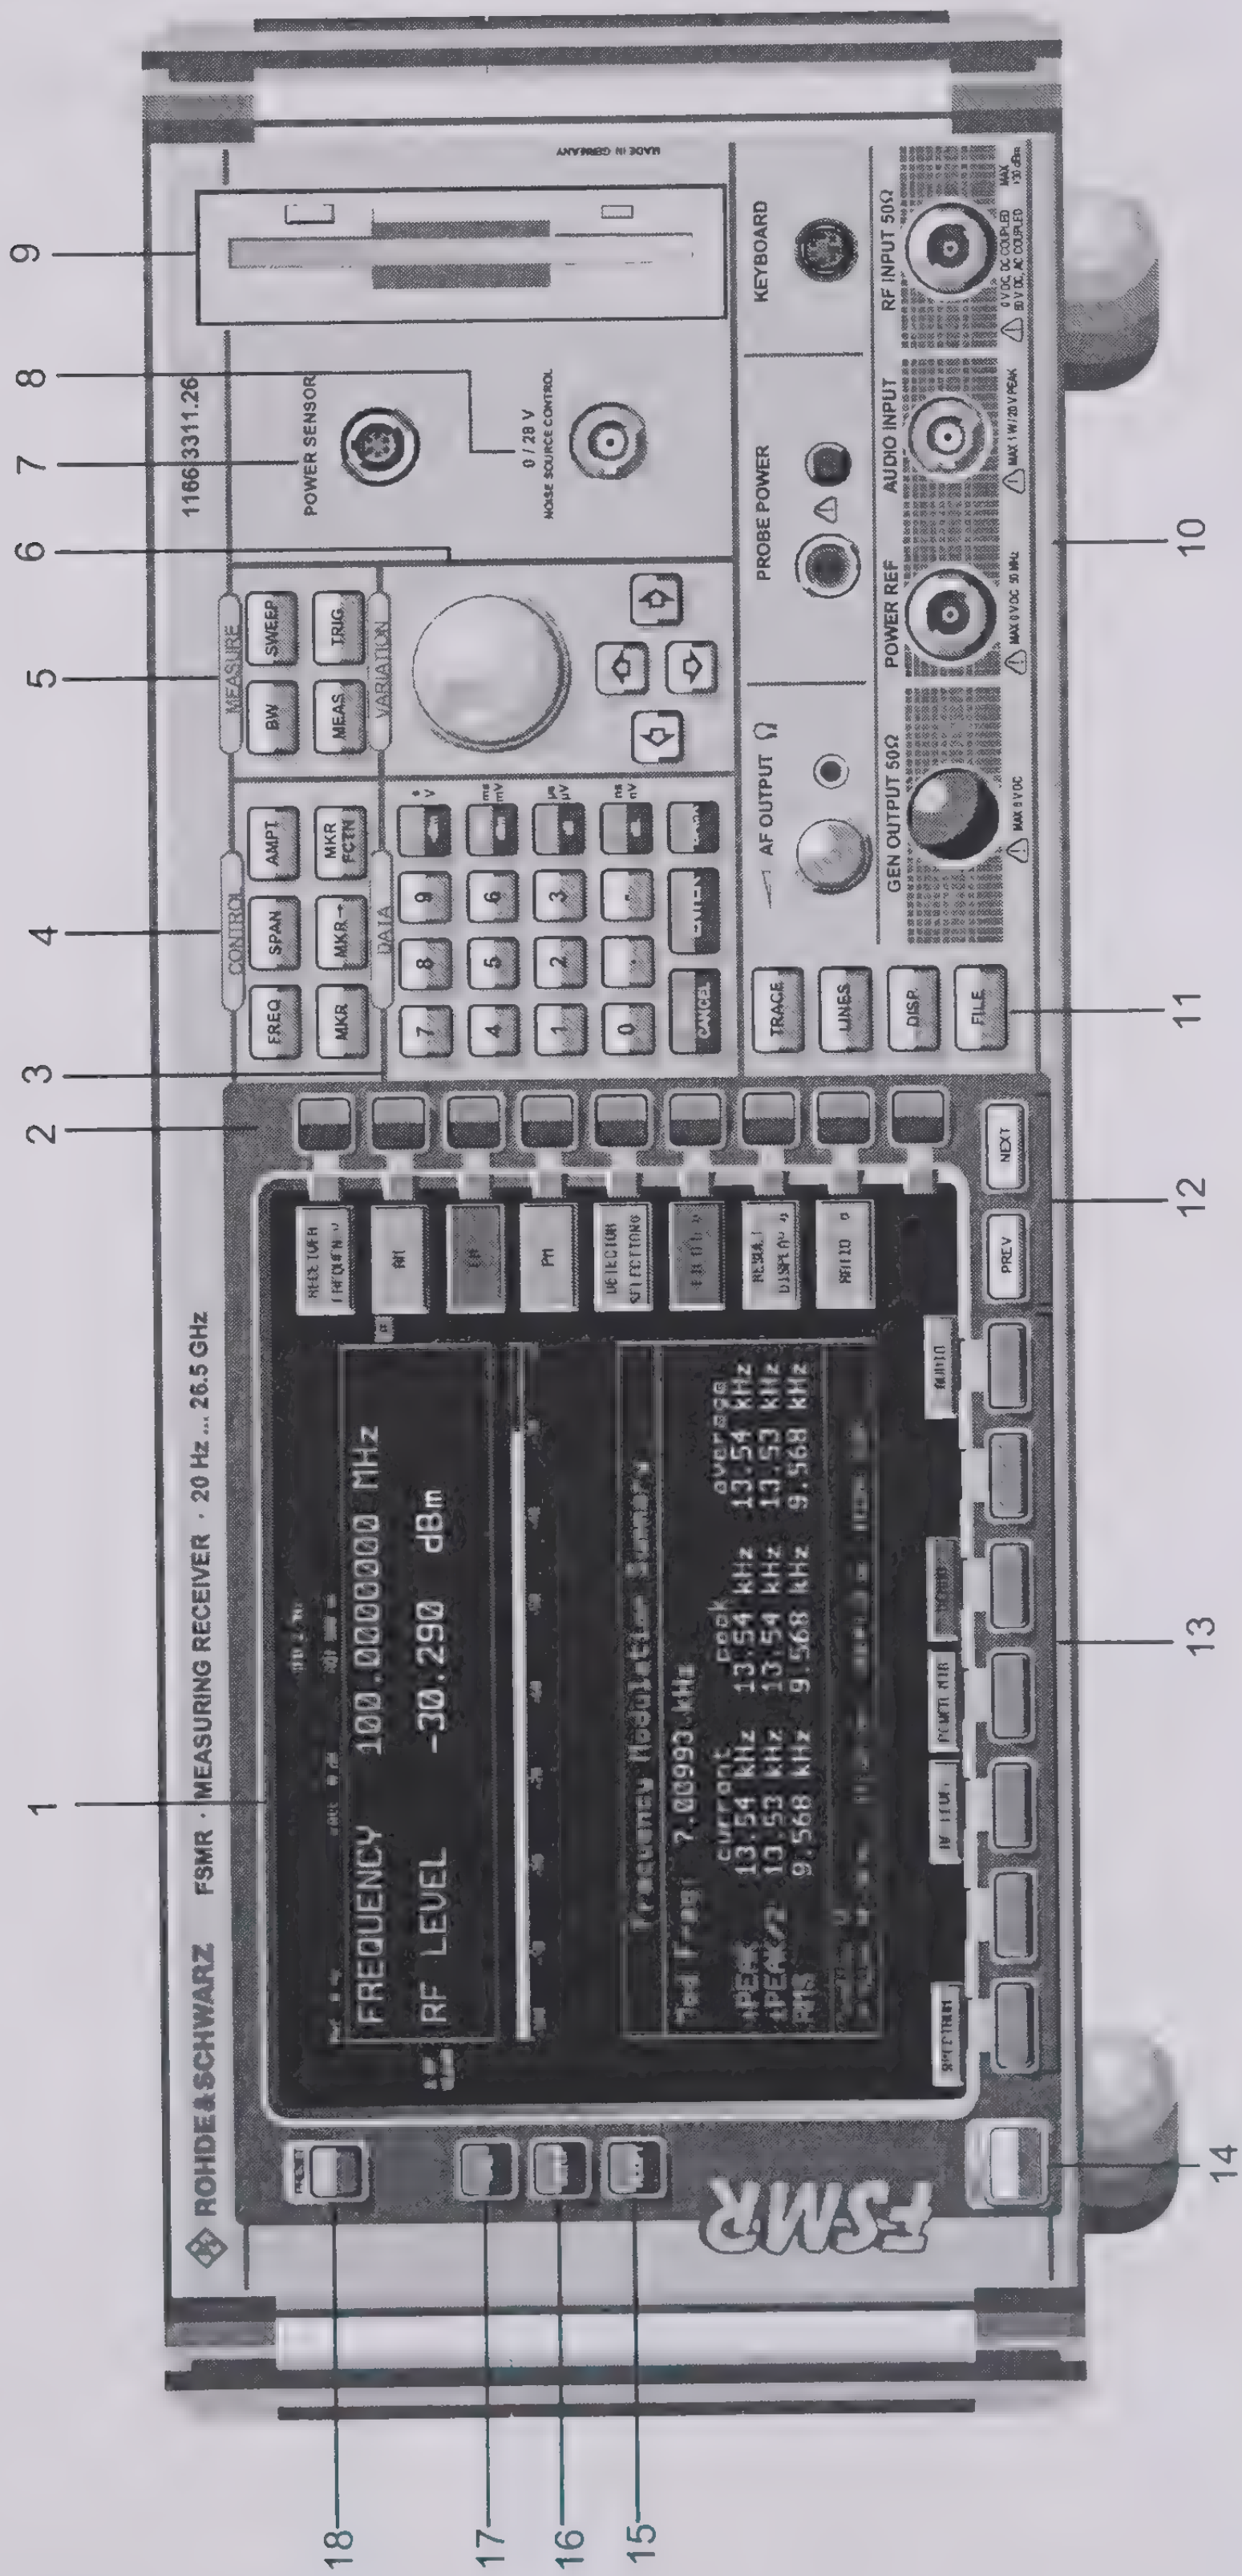

Fig. 1-1 Front View

12

Menu-change keys

NEXT Change to side menu

PREV Call main menu

see Chapter 3

13

Hotkeys

see Chapter 3

14

ON/STANDBY switch

see Chapter 1

15



Configure and start a print job

see Chapters 1 and 4

16



Define general configuration

see Chapter 4

17

Record correction data

see Chapter 4

18

Call default settings

see Chapter 4

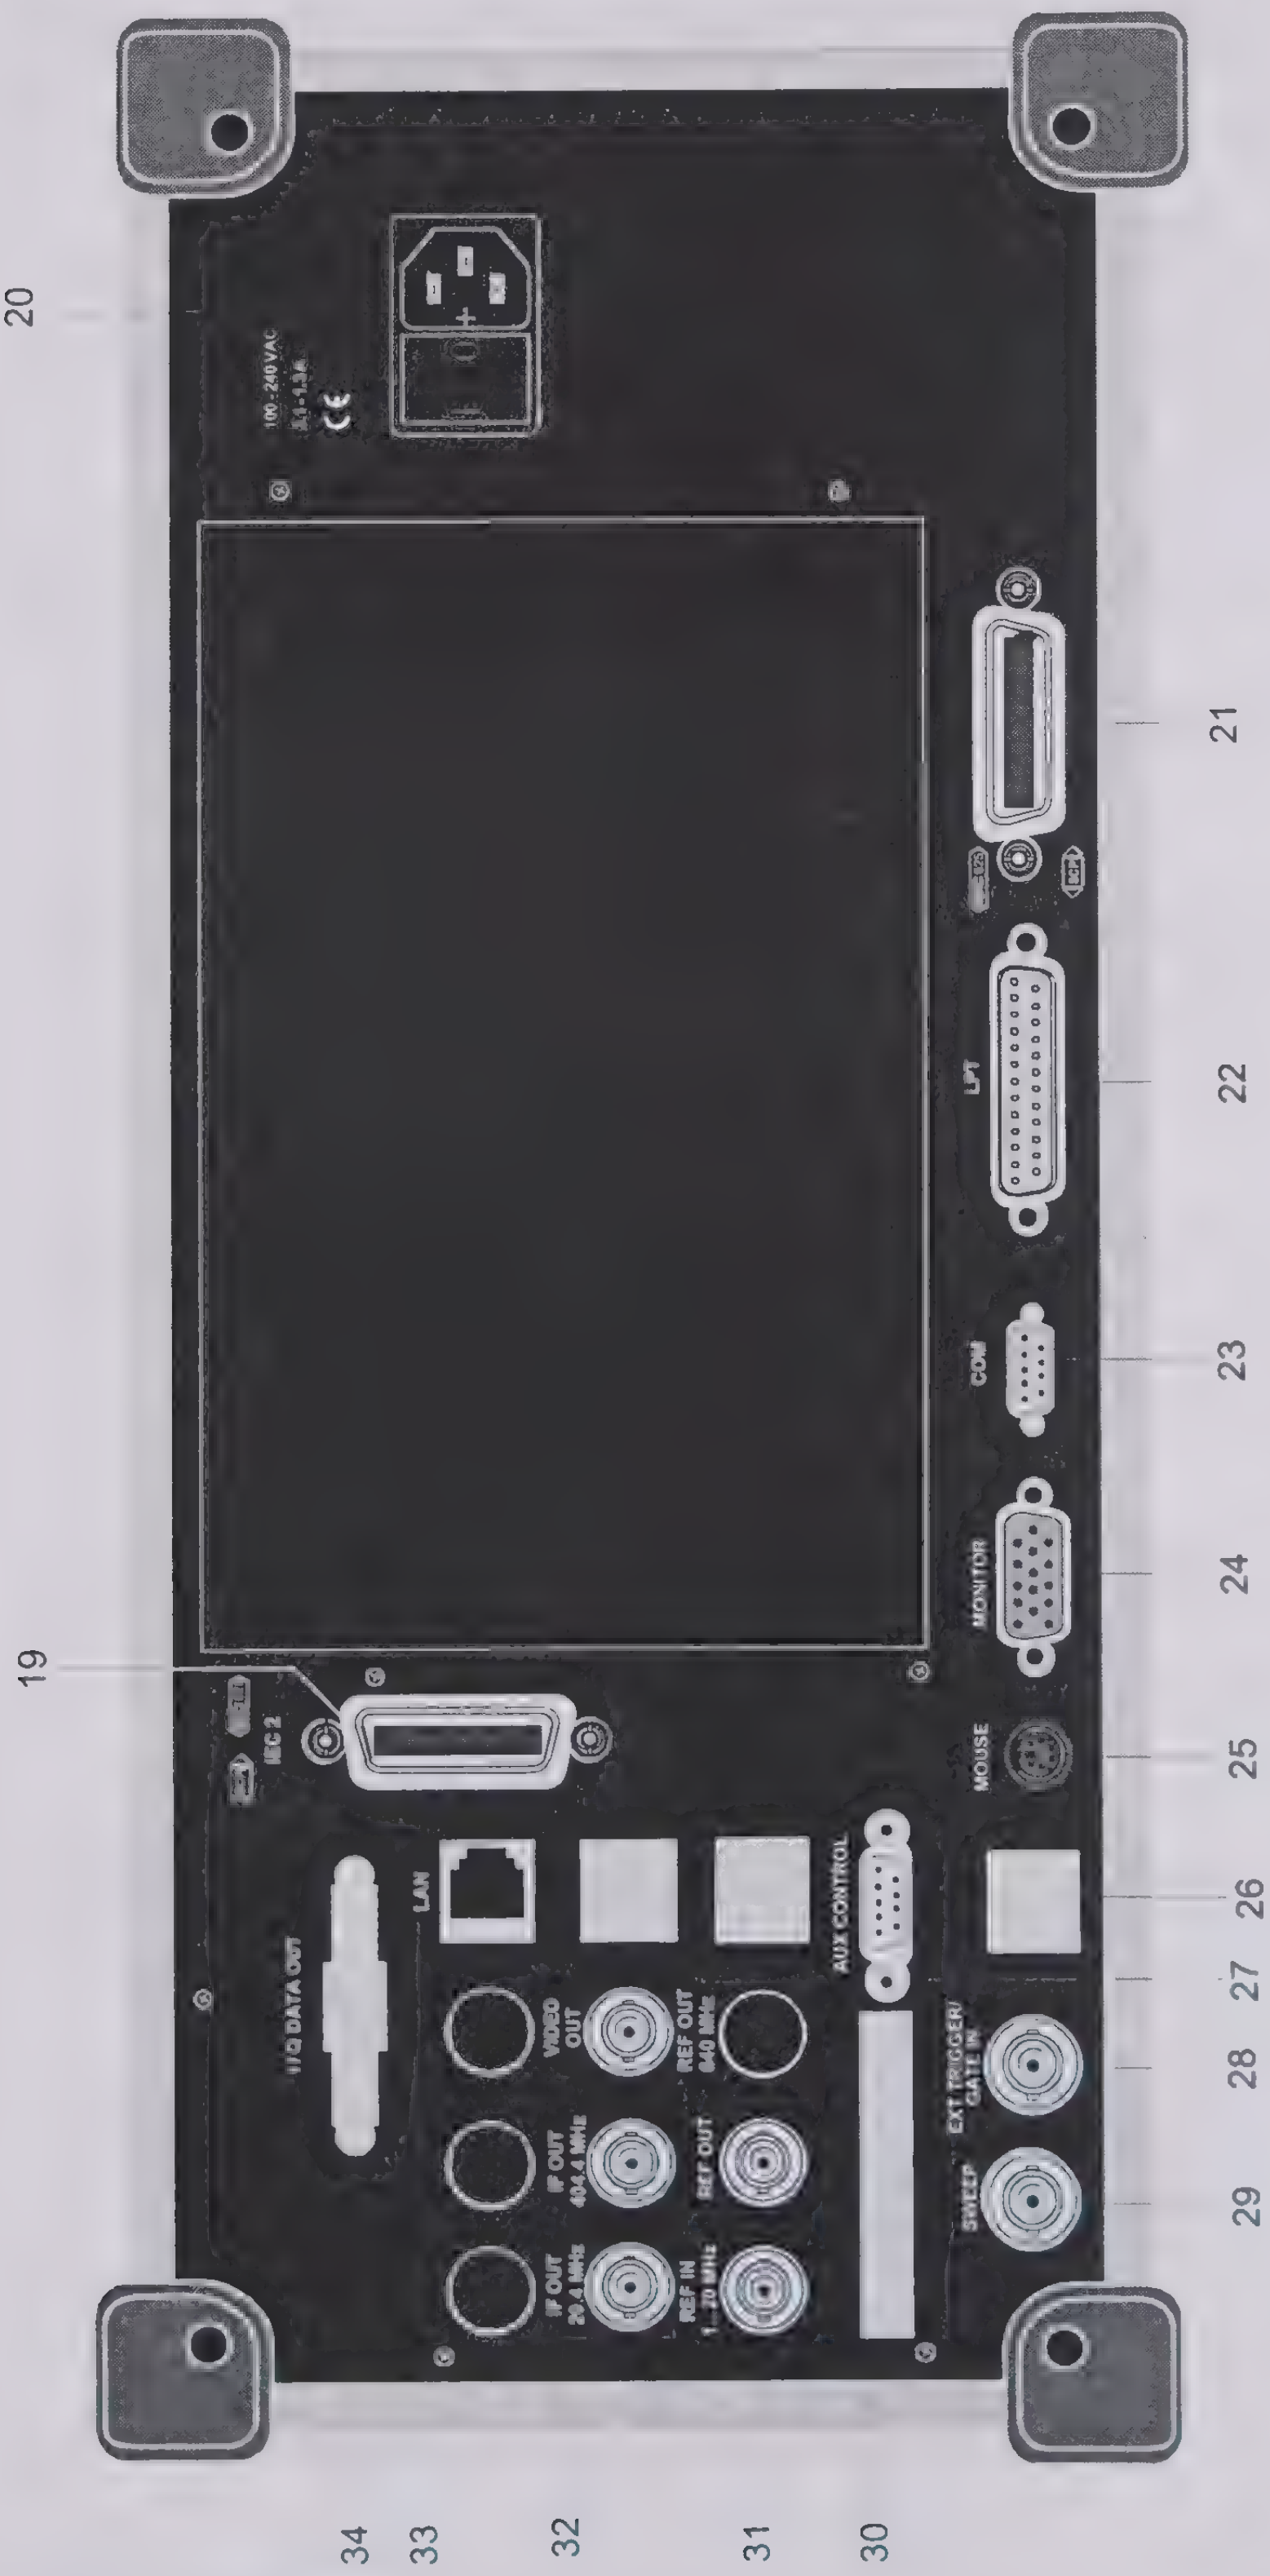

Fig. 1-2 Rear View

Rear View

19

2nd IEC/IEEE bus-connector | see Chapter 8

20

Power switch and AC power connector | see Chapter 1

21

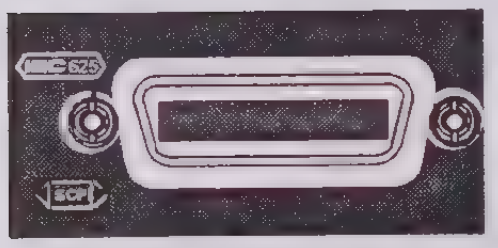

IEC/IEEE bus-connector | see Chapter 8

22

Parallel interface connector
(printer connector) | see Chapter 8

23

Connector for a serial interface
(9-pin socket; COM) | see Chapter 8

24

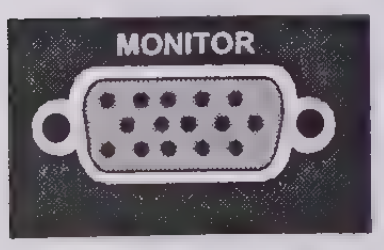

Connector for an external monitor | see Chapter 8

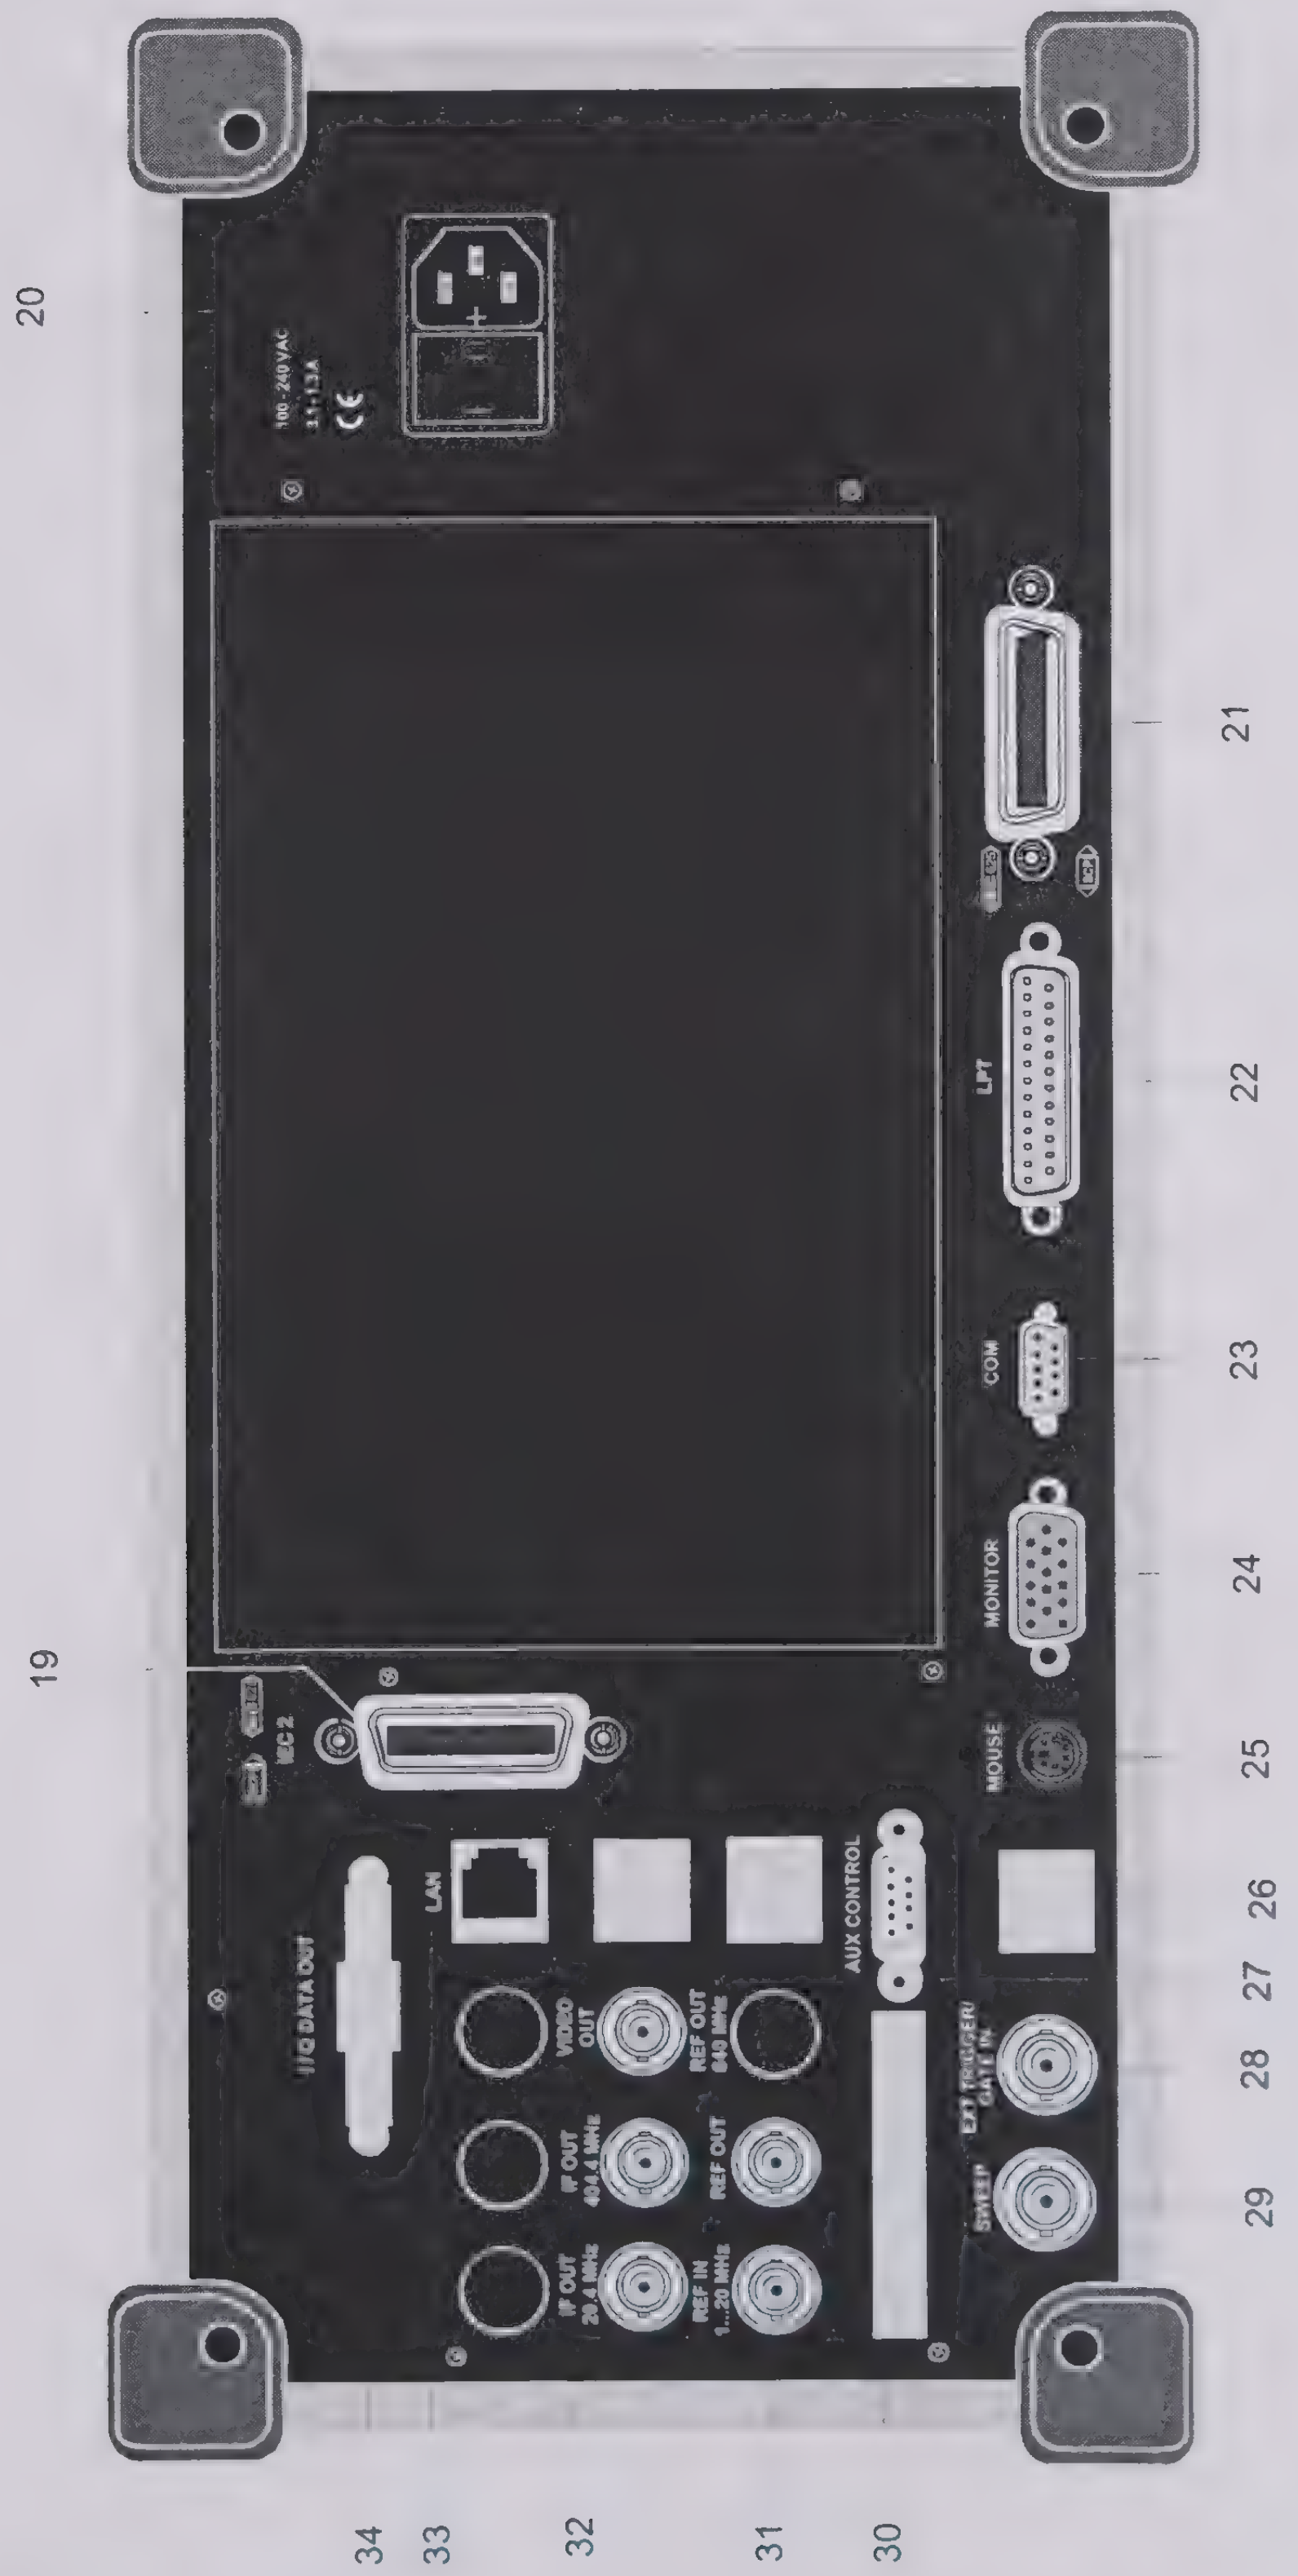

Fig. 1-2 Rear View

25



Connector for a PS/2 mouse

see Chapter 8

26

Connector for USB

see Chapter 8

27

Connector to control an external generator ((only with option FSP-B10)

28

Input connector for an external trigger or an external gate signal

see Chapter 8

29

Output connector

During a sweep sawtoth voltage is output which is proportional to frequency

s. Kap. 8

30

Reserved for options

31

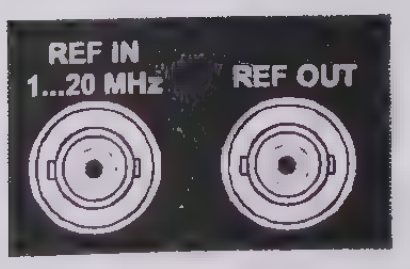

REF IN	Input connector for an external reference (1 to 20 MHz)
REF OUT	Output connector for an internal reference (10 MHz)

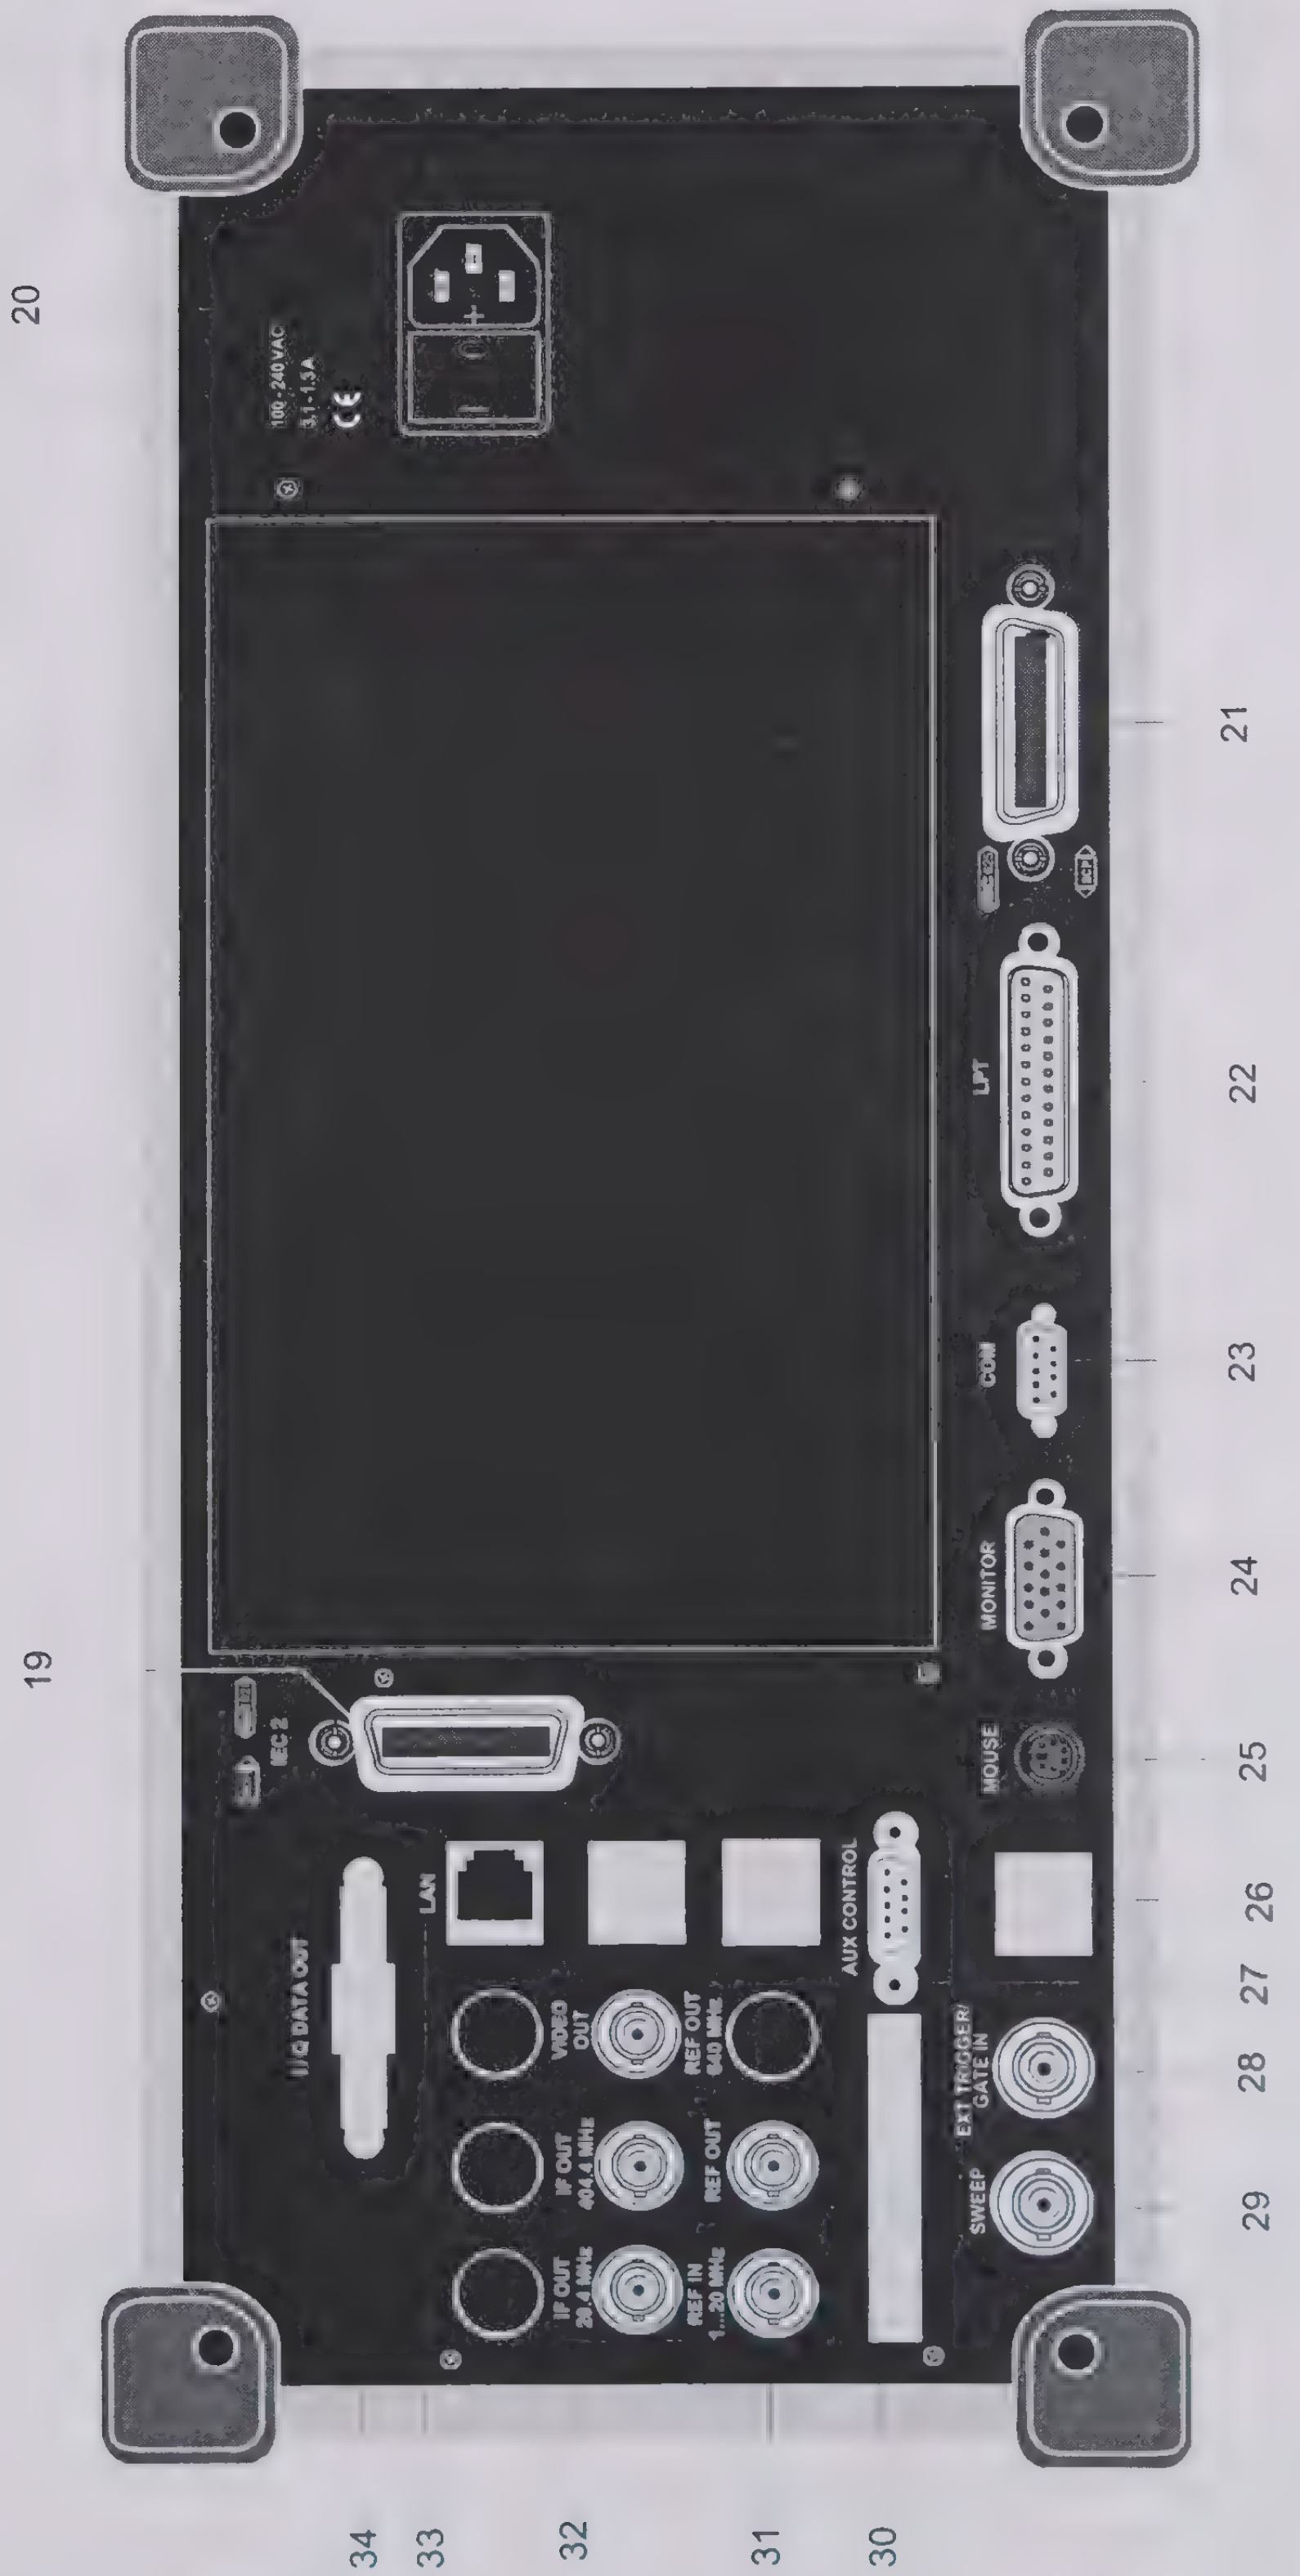

Fig. 1-2 Rear View

32

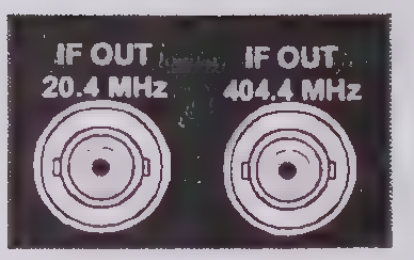

IF 20.4 MHz OUT	Output connector for 20.4 MHz IF	see Chapter 8
IF 404.4 MHz OUT	Output connector for 404.4 MHz IF	

33

LAN-Interface

34

Reserved for options

Getting Started with the Instrument

The following section describes how to activate the instrument and how to connect external devices such as printer and monitor.

Chapter 2 explains the operation of the instrument using simple measurement examples.

Important:

Prior to switching on the instrument, make sure that the following conditions are fulfilled:

- *The instrument cover is in place and tightly screwed on*
- *Fan openings are not obstructed*
- *Signal levels at the inputs are within specified limits*
- *Signal outputs are connected correctly and not overloaded.*

Any non-compliance may cause damage to the instrument .

Preparing the Instrument for Operation

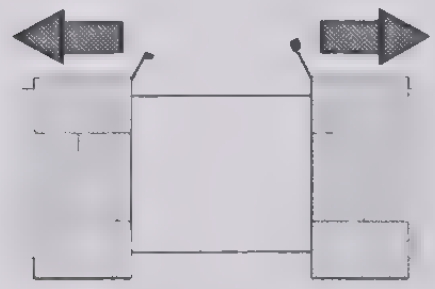

remove protective caps

- ➢ Take the instrument out of the packaging and check whether the items listed in the packing list and in the lists of accessories are all included.
- ➢ Remove the two protective covers from the front and rear of the R&S FSMR and carefully check the instrument for damage.
- ➢ Should the instrument be damaged, immediately notify the carrier and keep the box and packing material.
- ➢ For further transport or shipment of the R&S FSMR, the original packing should be used. It is recommended to keep at least the two protective covers of the front and rear panels in order to prevent damage to the controls and connectors.

Setting Up the Instrument

Standalone Operation

The instrument is designed for use under general laboratory conditions. The ambient conditions required at the site of operation are as follows:

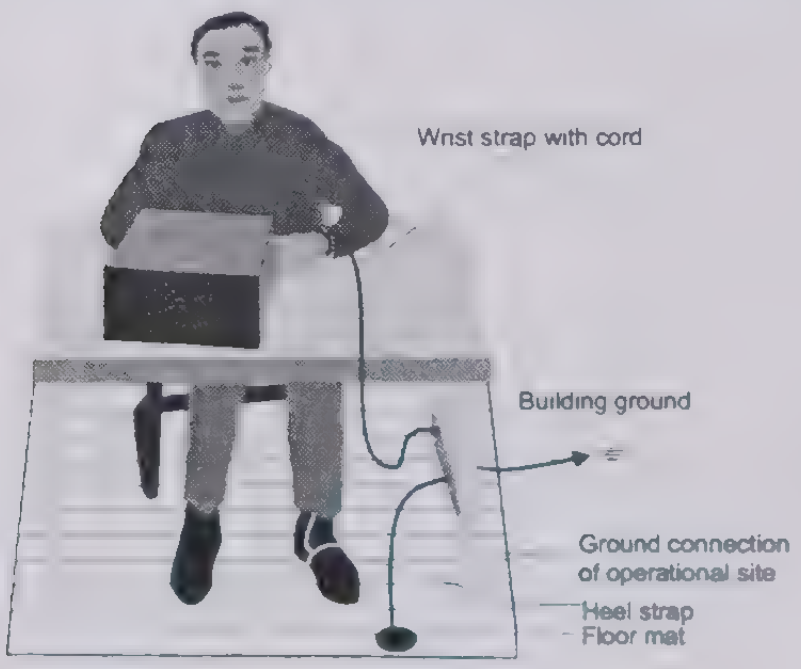

- The ambient temperature must be in the range specified in the data sheet.
- All fan openings must be unobstructed and the air flow at the rear panel and at the side-panel perforations must be unimpeded. The distance to the wall should be at least 10 cm.
- The mounting surface should be flat.
- To avoid damage of electronic components of the DUT due to electrostatic discharge on manual touch, protective measures against electrostatic discharge are recommended.

Safety Instruction for Instruments with Tiltable Feet

Warning

The feet must be fully folded in or out. Only in this way can the stability of the instrument be guaranteed and reliable operation be ensured. With the feet out, the total load for the feet must not exceed 500 N (own weight and additional units put onto the instrument). These units must be secured against slipping (e.g. by locking the feet of the unit at the top side of the enclosure).

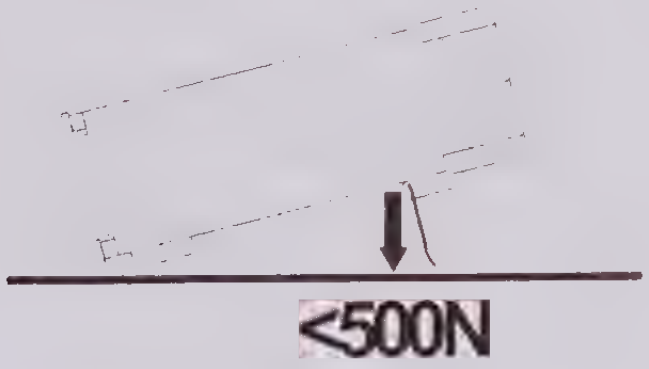

When shifting the instrument with the feet out, the feet might collapse and fold in. To avoid injuries, the instrument must therefore not be shifted with the feet out.



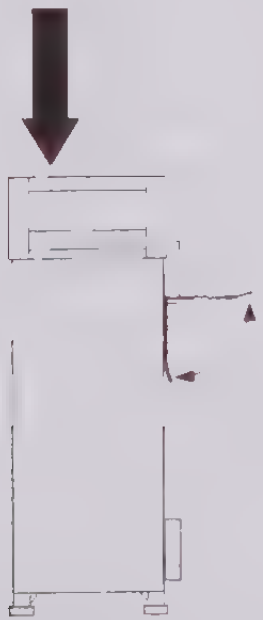

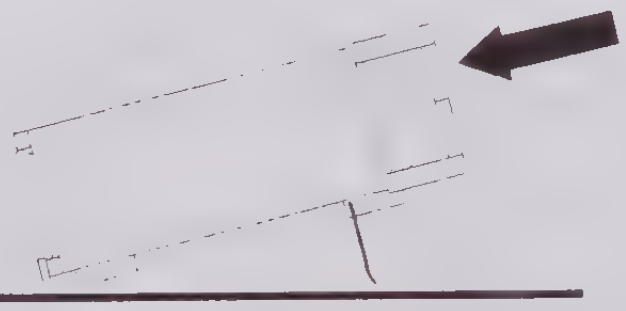

The instrument can be operated in any position.

Rackmounting

Important:

For rack installation, ensure that the air flow at the side-panel perforations and the air exhaust at the rear panel are not obstructed.

The instrument may be installed in a 19" rack by using a rack adapter kit (Order No. see data sheet). The installation instructions are part of the adapter kit.

EMC Safety Precautions

In order to avoid electromagnetic interference (EMI), the instrument may be operated only with all covers closed. Only adequately shielded signal and control cables may be used (see recommended accessories).

Connecting the Instrument to the AC Supply

The R&S FSMR is equipped with an AC voltage selection feature and will automatically adapt itself to the applied AC voltage (range: 100 to 240 V AC, 40 to 400 Hz). External voltage selection or adaptation of the fuses are not necessary. The AC power connector is located on the rear panel (see below).



Power connector

- ➢ Connect the instrument to the AC power source using the AC power cable delivered with the instrument.

As the instrument is designed according to the regulations for safety class EN61010, it must be connected to a power outlet with earthing contact.

Switching the Instrument On/Off

Caution:

Do not power down during booting. *Such a switch-off may lead to corruption of the hard disk files.*

AC power switch on the rear panel

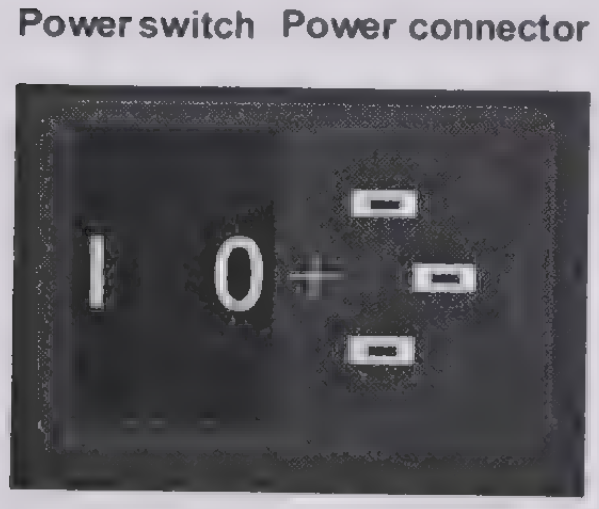

Power switch

Position I = ON

In the I position, the instrument is in standby mode or in operation, depending on the position of the ON/STANDBY key at the front of the instrument.

Note: *The AC power switch may remain ON continuously. Switching to OFF is only required when the instrument must be completely removed from the AC power source.*

Position O = OFF

The 0 position implies an all-pole disconnection of the instrument from the AC power source.

ON/STANDBY switch on the front panel

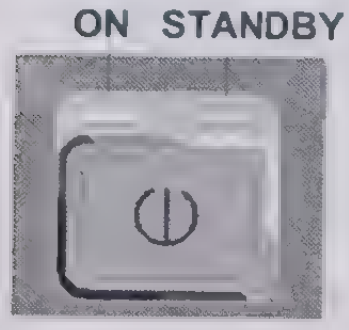

Caution:

In standby mode, the AC power voltage is present within the instrument

Standby switch

The ON/STANDBY switch activates two different operating modes indicated by coloured LEDs:

Operation ON - ON/STANDBY is depressed

The green LED (ON) is illuminated. The instrument is ready for operation. All modules within the instrument are supplied with power.

STANDBY - ON/STANDBY switch is not pressed.

The yellow LED (STANDBY) is illuminated. Only the power supply is supplied with power and the quartz oven is maintained at normal operating temperature.

Switching On the Instrument

- In order to switch on the R&S FSMR, set the power switch on the rear panel to position I.
- Set the R&S FSMR to operating mode by pressing the *ON/STANDBY* key on the front panel. The green LED must be illuminated.

Startup Menu and Booting

After switching on the instrument, a message indicating the installed BIOS version (e.g. Analyzer BIOS Rev. 1.2) appears on the screen for a few seconds.

Subsequently Windows XP is booted first and after that the instrument firmware will boot. As soon as the boot process is finished the instrument will start measuring. The settings used will be the one that was active when the instrument was previously switched off, provided no other device configuration than *FACTORY* had been selected with *STARTUP RECALL* in the *FILE* menu.

Switching Off the R&S FSMR

- Switch the ON/STANDBY key on the front panel to standby mode by pressing it once.

  The R&S FSMR will write the current instrument settings to disk before performing a Windows XP shutdown. At the end of the shutdown procedure the power supply will be switched to STANDBY mode.

  The yellow LED must be illuminated.

Only when removing the R&S FSMR completely from the AC power source:

- Set the power switch at the rear panel to position 0.

Operating the R&S FSMR with the Removable Hard Disk Option R&S FSMR-B18

The R&S FSMR-B18 option allows the instrument to be operated with differently configured hard disks. Additional hard disks are therefore available as option FSU-B19.

Caution!
Switch off the instrument before you remove and exchange the hard disk. Exchanging the hard disk during operation can produce severe data errors.

Power-Save Mode

Display:

The R&S FSMR offers the possibility of switching on a power-save mode for the screen display. The backlighting will be switched off if no entry is made on the front panel (key, softkey or hotkey as well as spinwheel) during the selected response time.

In order to switch on the power-save mode:

1. Call the *DISPLAY - CONFIG DISPLAY* submenu to configure the screen display:
   - ➢ Press *DISP* key
   - ➢ Press *CONFIG DISPLAY* softkey

2. Activate the save mode
   - ➢ Press *DISPLAY PWR SAVE* softkey.
     The softkey is highlighted in colour, thus indicating that the power-save mode is on. At the same time the data entry for the delay time is opened.

3. Define the delay time
   - ➢ Enter the required response time in minutes and confirm the entry using the *ENTER* key.
     The screen will be blanked out after the selected time period has elapsed.

Hard disk:

A power-save mode is preset for the built-in hard disk which is automatically closed down 15 minutes after the last access.

Recalling the Most Recent Instrument Settings

The R&S FSMR stores its current instrument settings onto the hard disk every time it is switched off via the ON/STANDBY key. After each power-on, the R&S FSMR is reloaded with the operational parameters which were active just prior to the last power-off (STANDBY or AC power OFF) or were set with STARTUP RECALL (see Chapter 4 "Saving and Recalling Data Sets").

Note: *Storing the current instrument settings is not possible if the instrument is switched off using the POWER ON switch at the rear panel or when unplugging the mains cord. After power-on the instrument settings stored previously on the hard disk will be loaded in this case.*

Function Test

After turning on the AC power, the R&S FSMR will display the following message on the display screen:

```
Rohde & Schwarz GmbH & Co. KG
Analyzer BIOS          Vx.y
```

After appearance of the above message, a selftest of the controller hardware is performed. Subsequently, the Windows XP controller boots and the measurement screen will appear.

The system self-alignment is activated via *CAL* key, *CAL TOTAL* softkey. The individual results of the self-alignment (PASSED / FAILED) can be displayed in the *CAL* menu (*CAL RESULTS).*
With the aid of the built-in selftest functions (*SETUP* key, *SERVICE, SELFTEST* soft keys), the functional integrity of the instrument can be verified and/or defective modules can be localized.

Windows XP

Caution:

The drivers and programs used under Windows XP are adapted to the measuring instrument. In order to prevent the instrument functions from damage, the settings should only be modified as described below.
Existing software may only be modified using update software released by Rohde & Schwarz.
Additionally only programs authorized by Rohde & Schwarz for use on the R&S FSMR may be run on the instrument.

Do not power down during booting. *Such a switch-off may lead to corruption of the hard disk files.*

The instrument runs under the operating system Windows XP Embedded. The computer can be used to install and configure device drivers that were authorized by Rohde & Schwarz. Any further use of the computer function is only allowed under the conditions described in this operating manual.

Login

Windows XP requires a login process, during which the user is asked for identification by entering his name and password. As a factory default the instrument is configured for *Auto Login*, i.e. the login is performed automatically and in the background. The user name used for this is "instrument" and the password is also "instrument" (in small letters).

Administrator level

The XP user account used for the autologin function has administrator access rights.

Windows XP Service Packs

The Windows XP Embedded system installed on the instrument includes Service Pack 1 for XP Embedded.

Any service pack not approved by Rohde & Schwarz must not be installed since malfunctions may occur. These malfunctions could impair measurements that are correctly performed on the instrument and necessitate a repair.

The user is especially warned against using Service Packs of Windows XP Home or of the Professional Edition, since these Service Packs are not compatible with Windows XP Embedded.

Calling the Windows XP start menu

The Windows XP start menu is called using the key combination <CTRL> <ESC>. It is possible to access the required submenus from the start menu by means of the mouse or the cursor keys. In order to return to the measurement screen the button "R&S Analyzer Interface" in the Windows XP task bar can be used.

Connecting an External Keyboard

Caution:
Connect the keyboard only when the instrument is switched off (STANDBY). Otherwise, proper functioning cannot be ensured due to interactions with the firmware.

The R&S FSMR allows an external PC keyboard to be connected to the 6-pin PS/2 connector labelled KEYBOARD on the front panel or to the USB interface on the rear panel.

The keyboard makes it easier to enter comments, file names, etc, when measurements are performed.

If the keyboard is to be connected to the PS/2 connector, the PSP-Z2 keyboard (Order No. 1091.4100.02, English) is recommended. This keyboard includes not only the PC keyboard but also a trackball for controlling the mouse.

Keyboards and mouse devices in line with the USB standard 1.1 are suitable for connection to the USB interface.

The keyboard (except for PSP-Z2, see above) will automatically be recognized after connection. The US keyboard assignment is the default setting. Special settings such as refresh rate can be performed in the Windows XP menu START - SETTINGS - CONTROL PANEL - KEYBOARD.

Chapter 8 contains the interface description for the connectors.

Connecting a Mouse

To make Windows XP operation easier, the R&S FSMR allows a mouse to be connected to the PS/2 mouse interface or to the USB interface on the rear panel.



Microsoft and Logitech mouse types are supported.

Note. *The recommended keyboard PSP-Z2 is equipped with a trackball for mouse control. Connecting an additional mouse will cause interface conflicts and lead to malfunctions of the instrument.*

After connection the mouse is automatically recognized. Special settings such as mouse cursor speed etc, can be performed in the Windows XP menu START - SETTINGS - CONTROL PANEL - MOUSE. Chapter 8 contains the interface description for the connectors.

Connecting an External Monitor

Caution:
The monitor may only be connected when the instrument is switched off (STANDBY). Otherwise, the monitor may be damaged.

Do not modify the screen driver (display type) and display configuration since this will severely affect instrument operation.

The instrument is equipped with a rear-panel MONITOR connector for the connection of an external monitor.

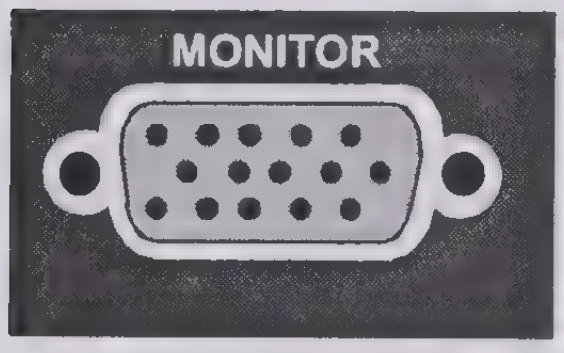

After connecting the external monitor the instrument needs to be rebooted in order to recognize the monitor. After that the measurement screen is displayed on both the external monitor and the instrument. Further settings are not necessary.

Connecting a Printer

A printer can be connected while the instrument is running.
The R&S FSMR allows two different printer configurations for printing a hardcopy to be created plus switchover between these two configurations. The *DEVICES* table in the *HCOPY* menu shows the available selection of installed printers (see section 4.4 "Documentation of Measurement Results").

The interfaces for connecting printers are on the rear panel:





Chapter 8 contains the interface description for the connectors.

Selecting a Printer

Before a hardcopy can be printed, the printer has to be selected from the *"HCOPY"* menu.
In the following example, an HP DeskJet 660C printer that was preinstalled for LPT1 is selected as *DEVICE2* for hardcopies of the screen content.

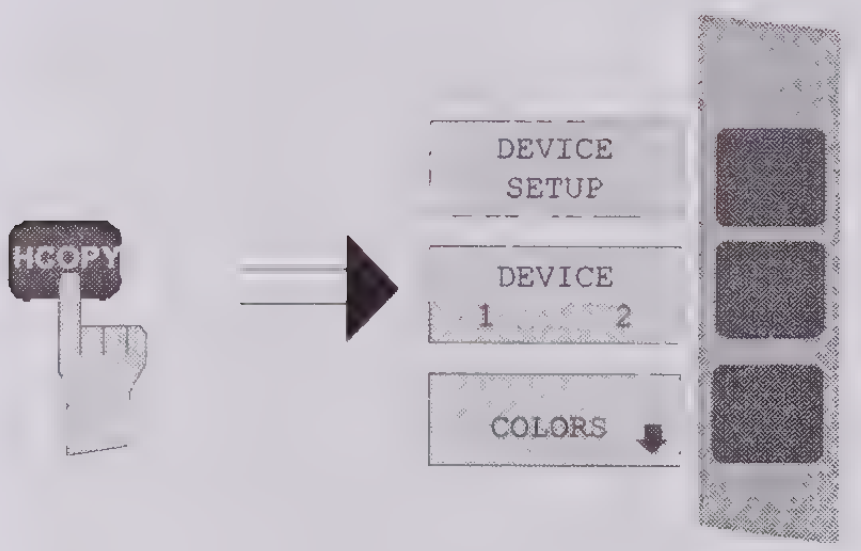

- ➢ Press the *HCOPY* key.

  The *HCOPY* menu will open.

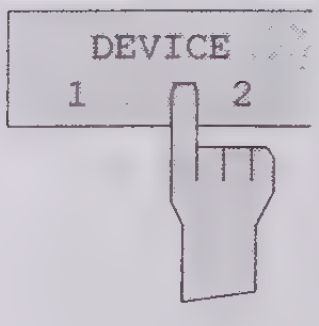

- ➢ Press the *DEVICE 1/2* softkey.

  Device 2 will become the active output unit.

Note:
If the printer is to be operated as device 1, this step can be omitted.



- Press the *DEVICE SETUP* softkey.

  The *HARDCOPY SETUP* table opens and displays the selection of output formats. The current selection *"Clipboard"* is highlighted and marked with a dot in the option button.

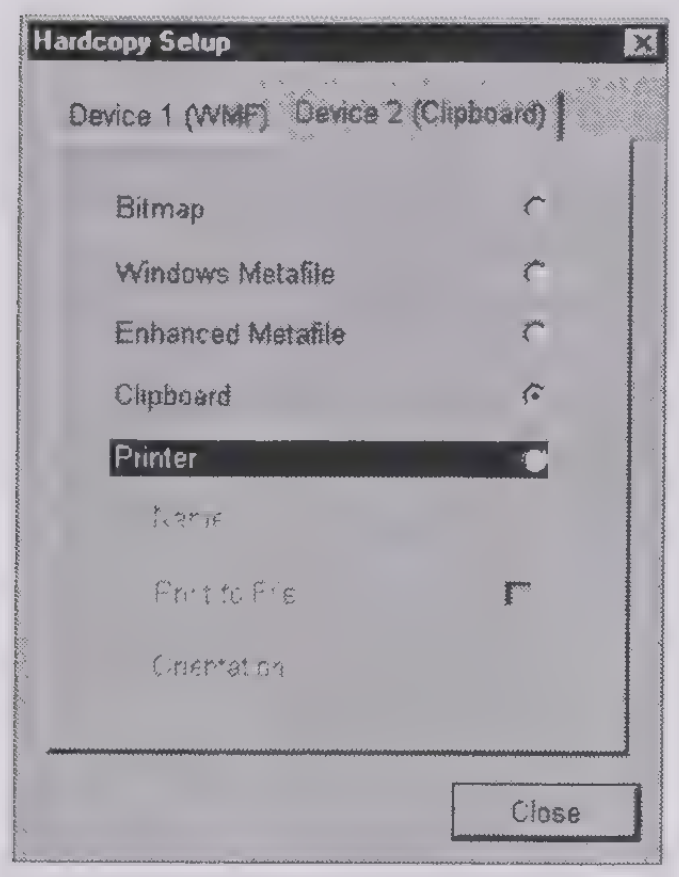

- Use the cursor key ⇩ to move the selection bar to *"Printer"* and press *ENTER*.

  Windows for selecting a printer (Name), printing to file (Print to File) and selecting printout orientation (Orientation) are displayed.

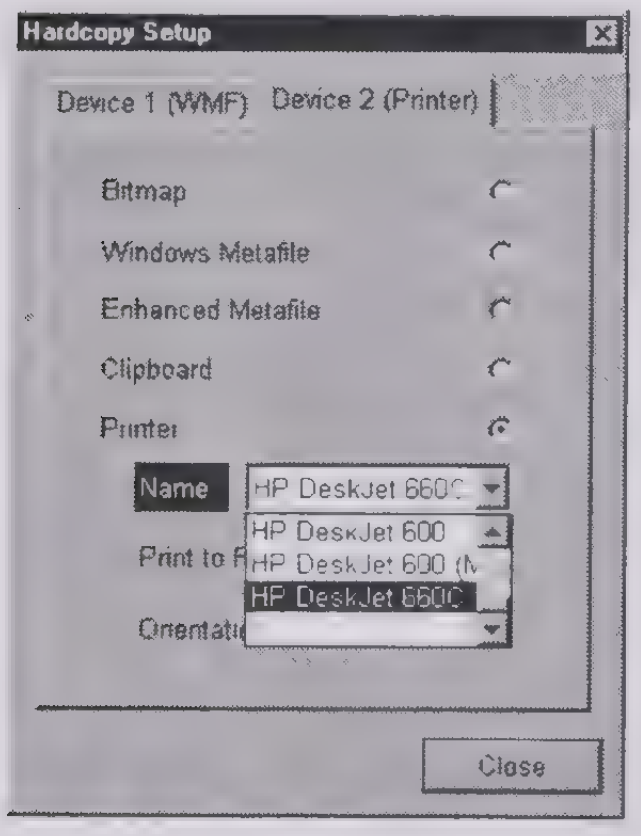

- Use the cursor key ⇩ to set the selection bar to *"Name"* and press *ENTER* .

  The list of available printer types appears.

- Use the cursor key ⇩ / ⇧ or the spinwheel to move the selection bar to the "HP DeskJet 660C" printer and press *ENTER*.

  The list closes and the selected printer appears in the "Name" field.

Note:

If the desired printer is not available in the selection list, its driver must first be installed.
For further information, see sections "Installation of Plug&Play Printers", "Installation of Non-Plug&Play Printers" and "Installation of Network Printers".

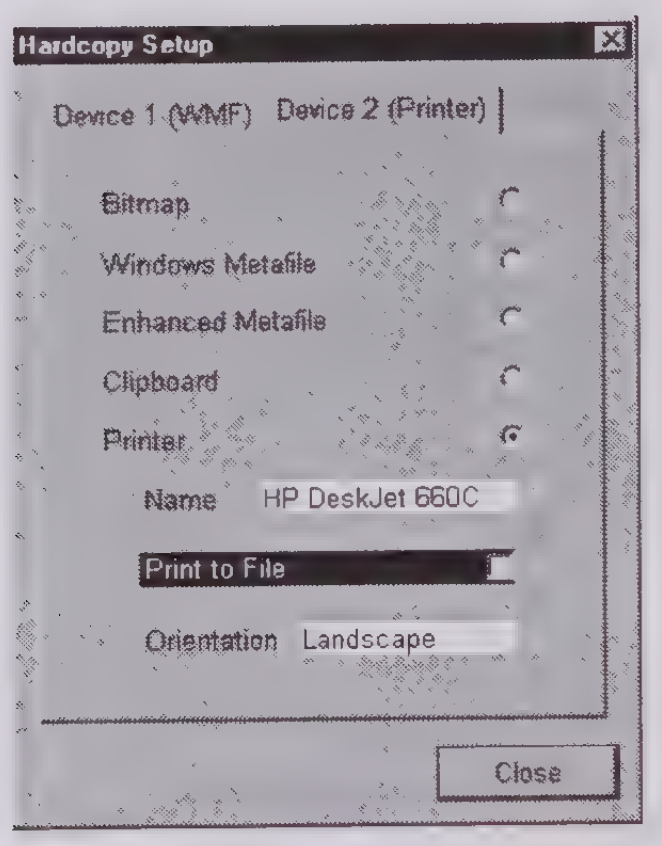

Name HP DeskJet 660C

Print to File

Orientation Landscape

- ➢ Press the cursor key ⇩ or turn the spinwheel until the *"Close"* button is reached.

Further settings can still be made:

"Print to File" redirects printing to a file. In this case, the system prompts you for a file name when printing is started.

- ➢ The selection is activated by pressing *ENTER* or the spinwheel.

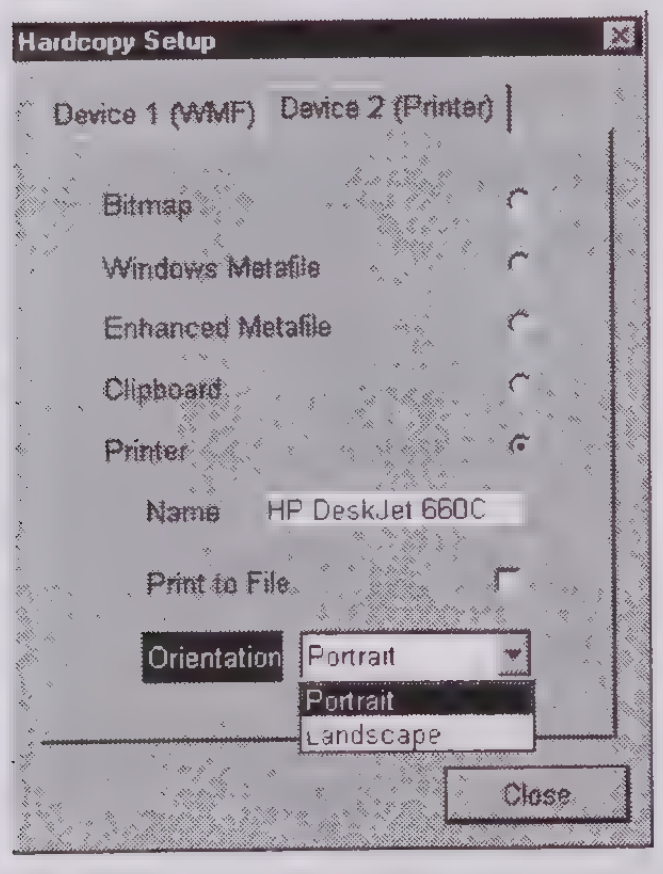

Name HP DeskJet 660C

Print to File

Orientation Portrait

Portrait

Landscape

"Orientation" is used to switch between portrait and landscape format.

- ➢ To change the selection, open the list by pressing *ENTER* and select the desired orientation with the cursor key ⇩ / ⇧. To close the list, press *ENTER* again.

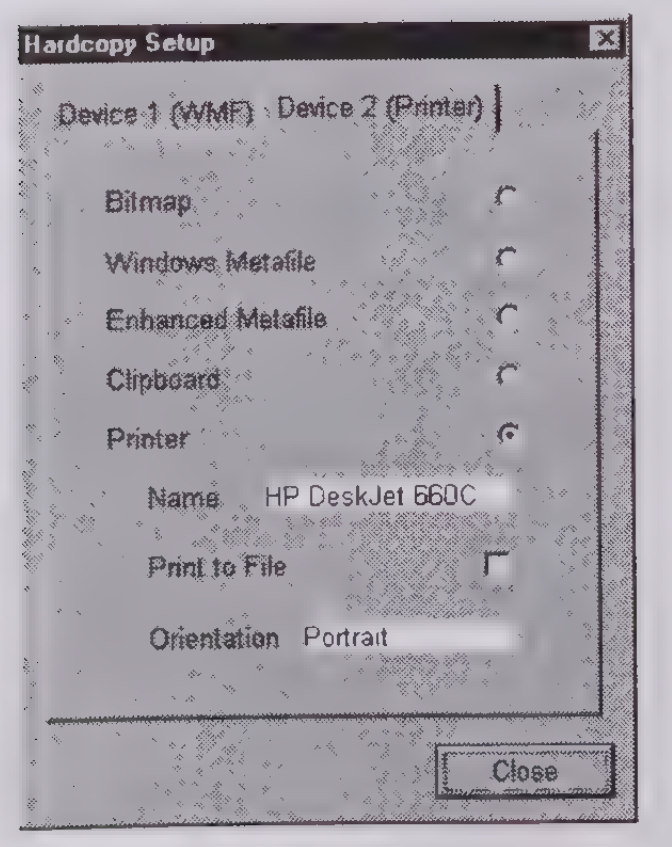

Name HP DeskJet 660C

Print to File

Orientation Portrait

The *"Close"* button is used to complete the setup.

- ➢ Press *ENTER* as soon as the *"Close"* button is available.

The dialog closes. Printing will now be performed according to the selected settings.

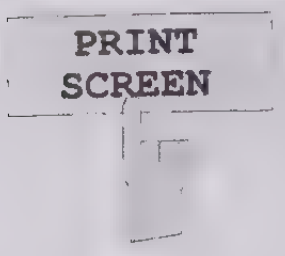

Start printing

- ➢ Press the *PRINT SCREEN softkey*.

A hardcopy of the screen contents will be printed.

The factory setting for DEVICE 2 is “Clipboard”. In this case, the printout will be copied to the Windows XP clipboard which is supported by most Windows applications. The contents of the clipboard can be pasted directly into a document via EDIT – PASTE.

Table 1-1 Factory settings for *DEVICE 1* and *DEVICE 2* in the *HCOPY* menu shows the factory settings for the two output devices.

Table 1-1 Factory settings for *DEVICE 1* and *DEVICE 2* in the *HCOPY* menu

Setting	**Selection in configuration table**	**Setting for *DEVICE 1***	**Setting for *DEVICE 2***
Output device	DEVICE	WINDOWS METAFILE	CLIPBOARD
Output	PRINT TO FILE	YES	---
Orientation	ORIENTATION	---	---

Installation of Plug&Play Printers

The installation of Plug&Play printers under Windows XP is quite simple:
After the printer is connected and switched on, Windows XP automatically recognizes it and installs its driver, provided the driver is included in the XP installation.
If the XP printer driver is not found, Windows XP prompts you to enter the path for the corresponding installation files. In addition to pre-installed drivers, a number of other printer drivers can be found in directory D:\I386.

Note: *When installing new printer drivers, you will be prompted to indicate the path of the new driver. This path may be on a disk in drive A. Alternatively, the driver can be loaded via a memory stick or USB CD-ROM drive (see section “Connection of USB Devices”).*

Installation of Non-Plug&Play Printers

Note: *The dialogs below can be controlled either from the front panel or via the mouse and keyboard (see sections “Connecting a Mouse” and “Connecting a Keyboard”). Mouse and PC keyboard are absolutely essential for configuring network printers.*

A new printer is installed with the *INSTALL PRINTER* softkey in the *HCOPY* menu.

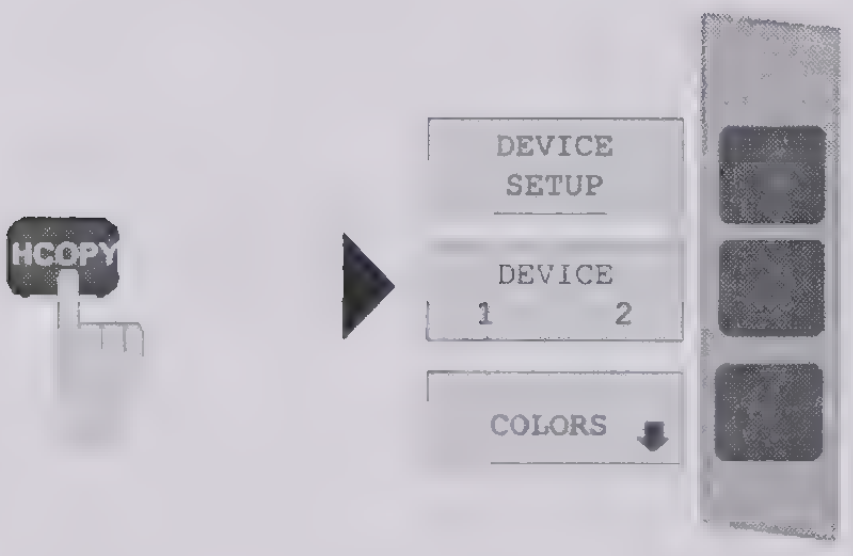

- ➢ Press the *HCOPY* key.

  The *HCOPY* menu will open.

- ➢ Press the NEXT key to open the side menu.

- ➢ Press *INSTALL PRINTER* to open the *Printers and Faxes* dialog window.

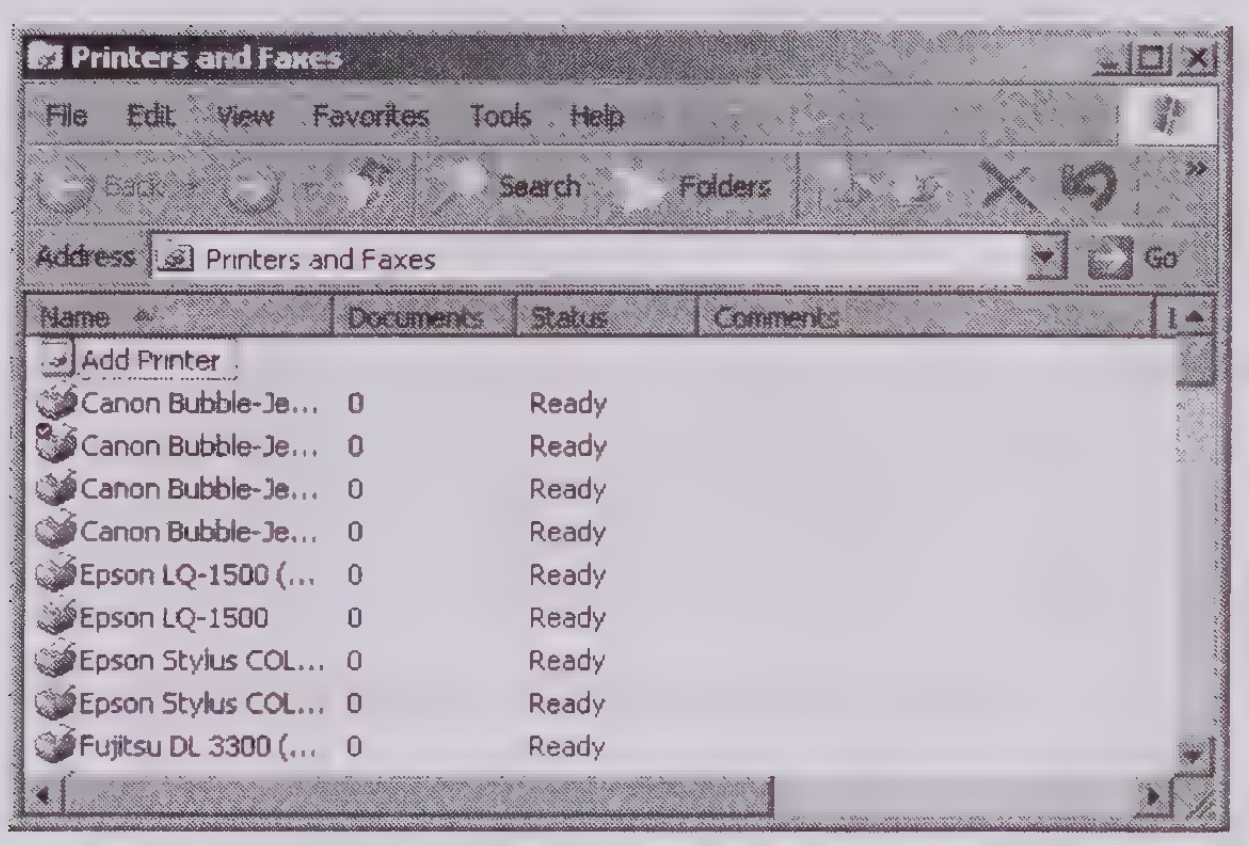
Printers and Faxes
File Edit View Favorites Tools Help
Back Search Folders
Address Printers and Faxes Go

Name	Documents	Status	Comments
Add Printer			
Canon Bubble-Je...	0	Ready	
Canon Bubble-Je...	0	Ready	
Canon Bubble-Je...	0	Ready	
Canon Bubble-Je...	0	Ready	
Epson LQ-1500 (...	0	Ready	
Epson LQ-1500	0	Ready	
Epson Stylus COL...	0	Ready	
Epson Stylus COL...	0	Ready	
Fujitsu DL 3300 (...	0	Ready	

- ➢ Select *Add Printer* in the list using the spinwheel.
- ➢ Highlight the selected item with *CURSOR RIGHT* and press *ENTER* or the spinwheel to confirm the selection.

The *Add Printer Wizard* is displayed.

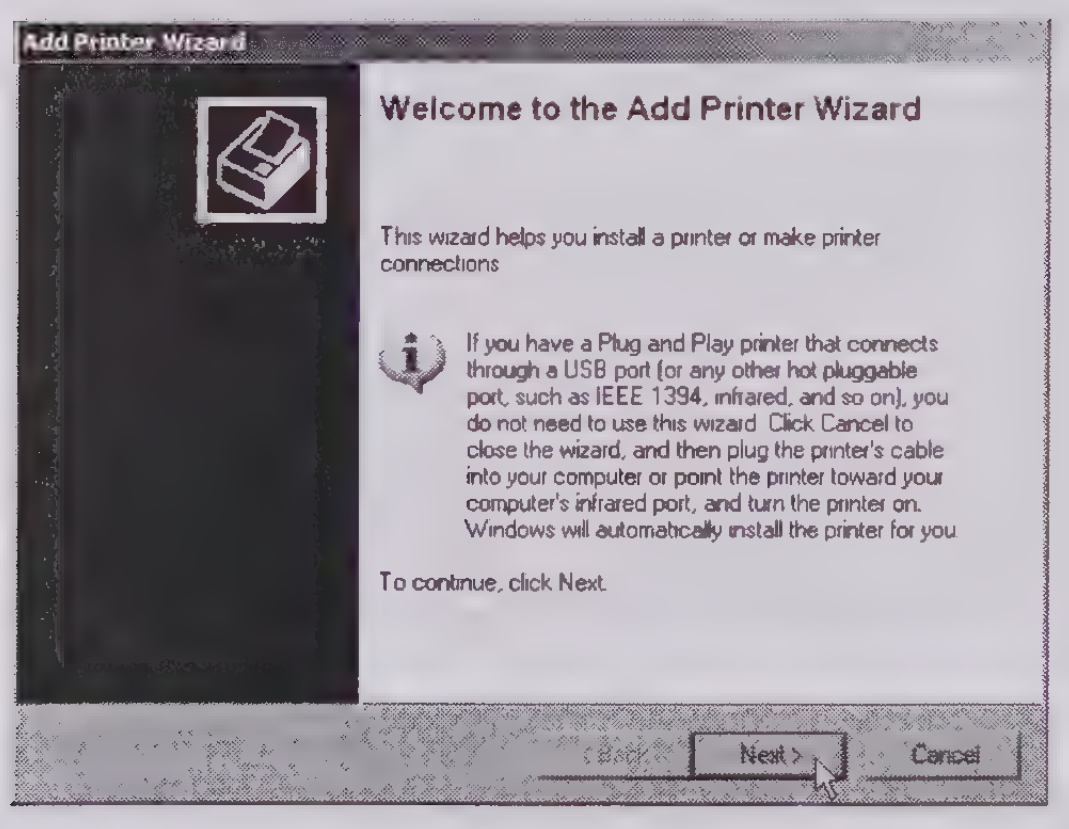

Welcome to the Add Printer Wizard

This wizard helps you install a printer or make printer connections

If you have a Plug and Play printer that connects through a USB port (or any other hot pluggable port, such as IEEE 1394, infrared, and so on), you do not need to use this wizard Click Cancel to close the wizard, and then plug the printer's cable into your computer or point the printer toward your computer's infrared port, and turn the printer on. Windows will automatically install the printer for you

To continue, click Next

- ➢ Select *NEXT* with the spinwheel and press the spinwheel for confirmation.

Local or Network Printer can be selected.

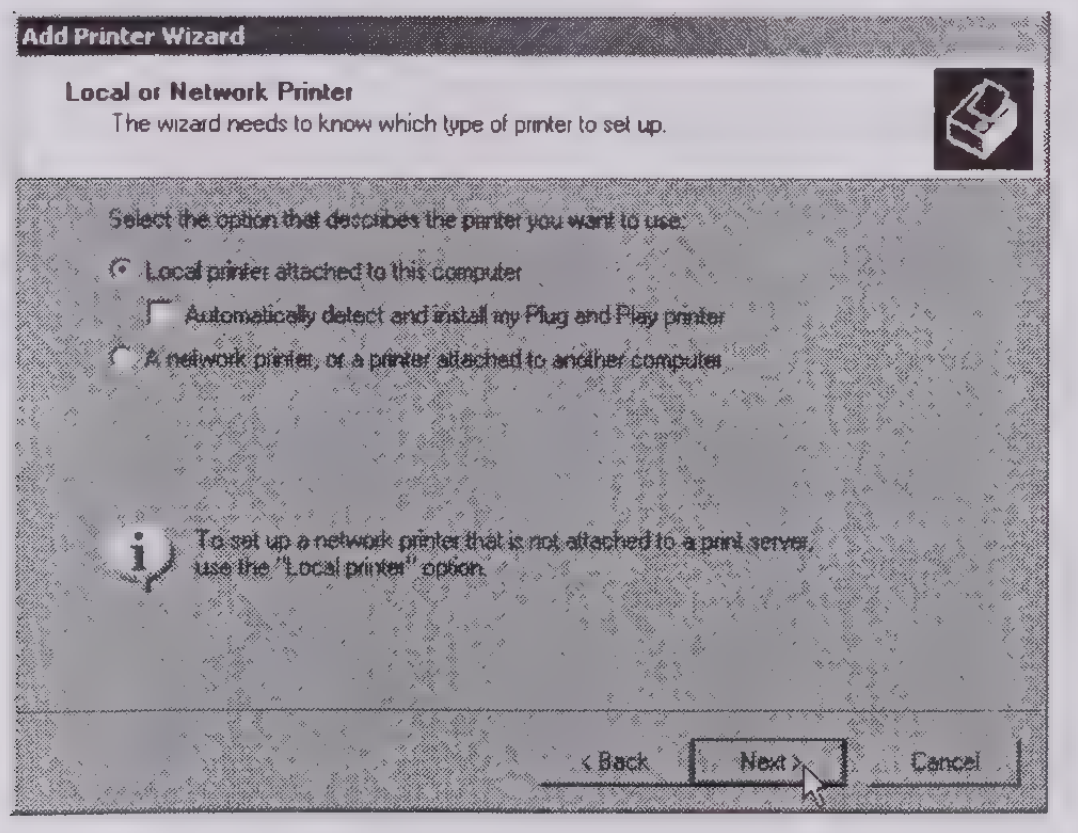

Local or Network Printer

The wizard needs to know which type of printer to set up.

Select the option that describes the printer you want to use:

● Local printer attached to this computer

☐ Automatically detect and install my Plug and Play printer

○ A network printer, or a printer attached to another computer

To set up a network printer that is not attached to a print server, use the "Local printer" option.

- ➢ To install a local printer, select *Local printer attached to this computer* with the spinwheel. Press the spinwheel for confirmation and continue with the “Local Printer” section.
- ➢ To install a network printer, select *A network printer or a printer attached to another computer.* Press the spinwheel for confirmation and continue with the “Network Printer” section.

Local Printer

In the following example, a Star LC24 printer is connected to the LPT1 interface and configured as *DEVICE2* for hardcopies of screen contents. The Add Printer Wizard has already been opened as described in the section "Starting the Add Printer Wizard" .

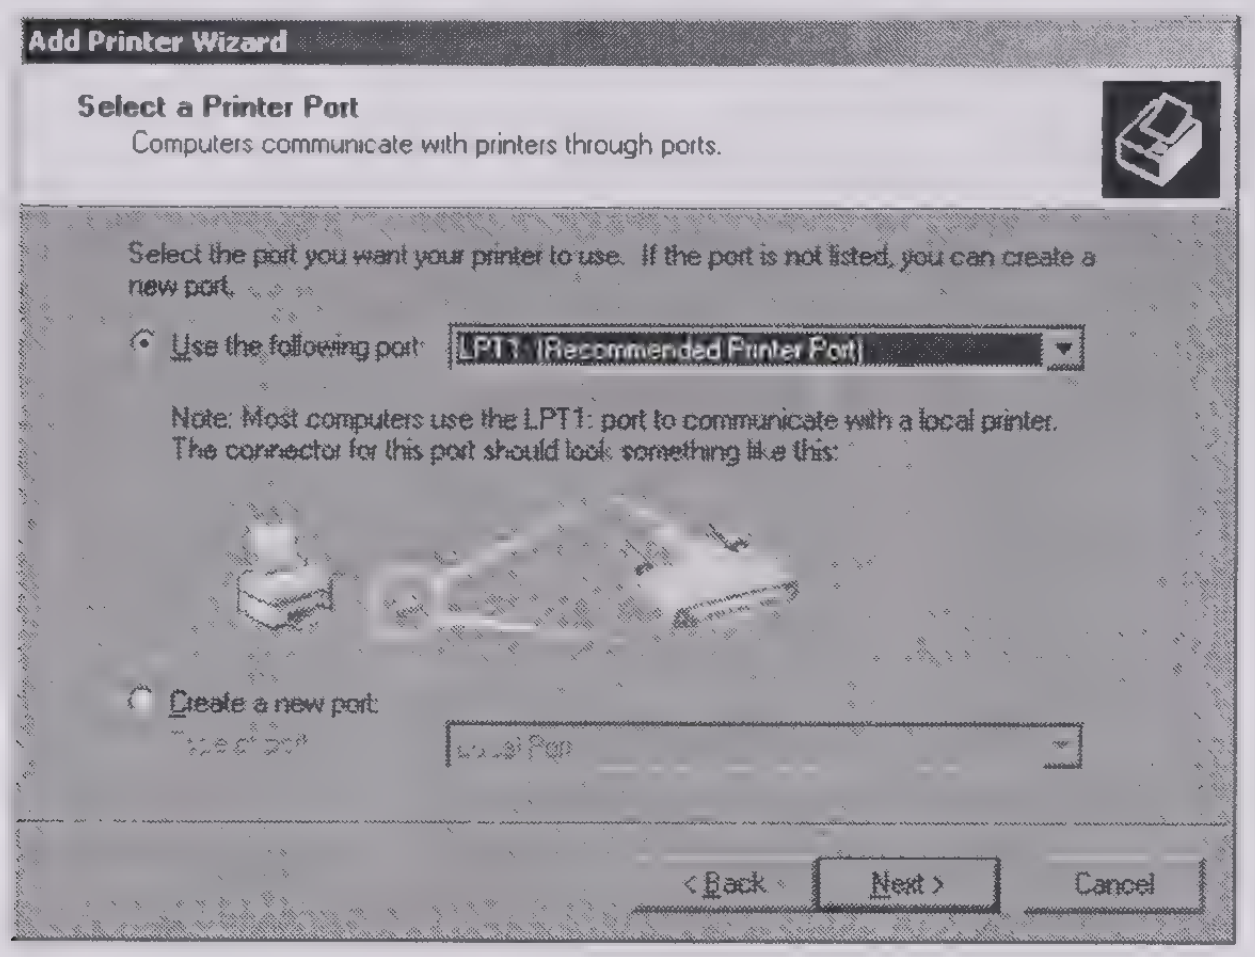

Select the port you want your printer to use. If the port is not listed, you can create a new port.

● Use the following port: LPT1: (Recommended Printer Port)

Note: Most computers use the LPT1: port to communicate with a local printer. The connector for this port should look something like this:

○ Create a new port:

- ➢ To select the USB interface, open the list of ports by clicking the spinwheel. Select the printer port with spinwheel/arrow keys and confirm by pressing the spinwheel. The selection list is closed again.
- ➢ To select the LPT connector, the selection list need not be opened.
- ➢ Place the cursor on the *Next* button and confirm by pressing the spinwheel.

The "Install Printer Software" dialog is opened.

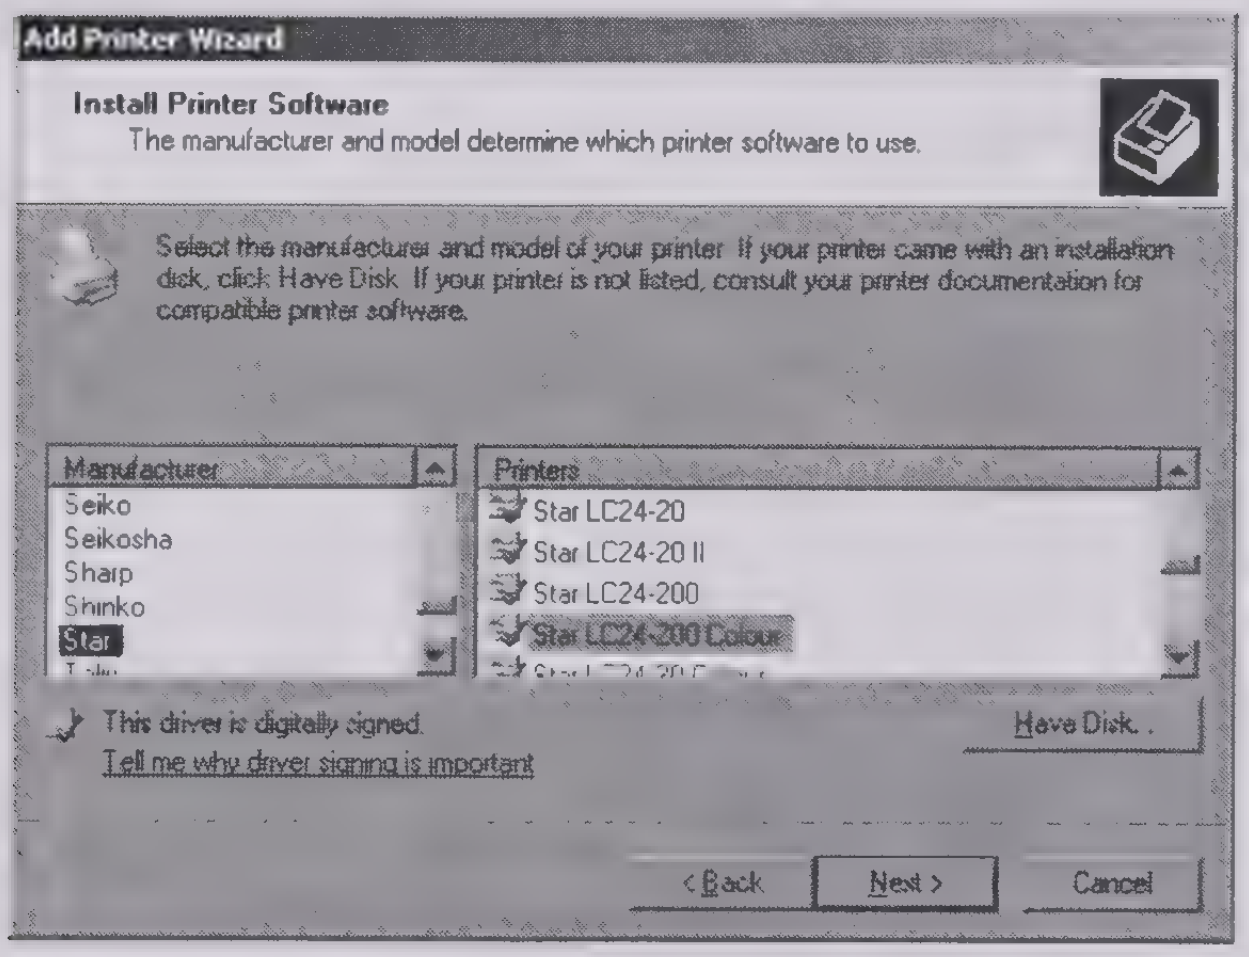
Add Printer Wizard
Install Printer Software
The manufacturer and model determine which printer software to use.

Select the manufacturer and model of your printer. If your printer came with an installation disk, click Have Disk. If your printer is not listed, consult your printer documentation for compatible printer software.

This driver is digitally signed.

- ➢ Select the desired manufacturer ("Star") in the Manufacturer table using the up / down keys.

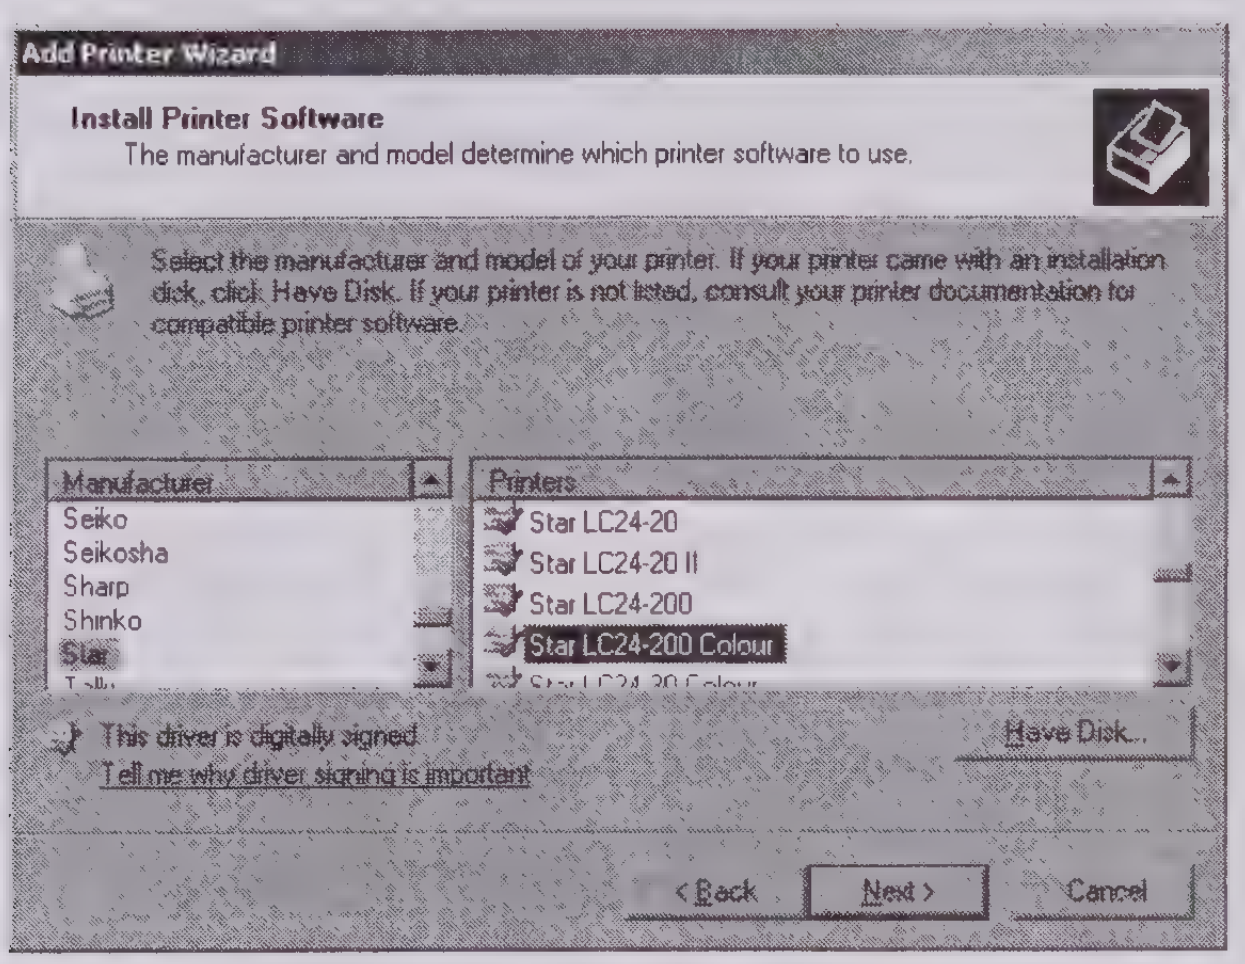

Install Printer Software
The manufacturer and model determine which printer software to use.

Select the manufacturer and model of your printer. If your printer came with an installation disk, click Have Disk. If your printer is not listed, consult your printer documentation for compatible printer software.

- ➢ Go to the *Printers* list with the spinwheel.
- ➢ Select the desired printer type (Star LC24-200 Colour) using the up / down keys and confirm with *ENTER*.

Note:
If the desired printer type is not in the list, the respective driver is not installed yet. In this case click the HAVE DISK button with the mouse key. You will be prompted to insert a disk with the corresponding printer driver. Press OK and select the desired printer driver.

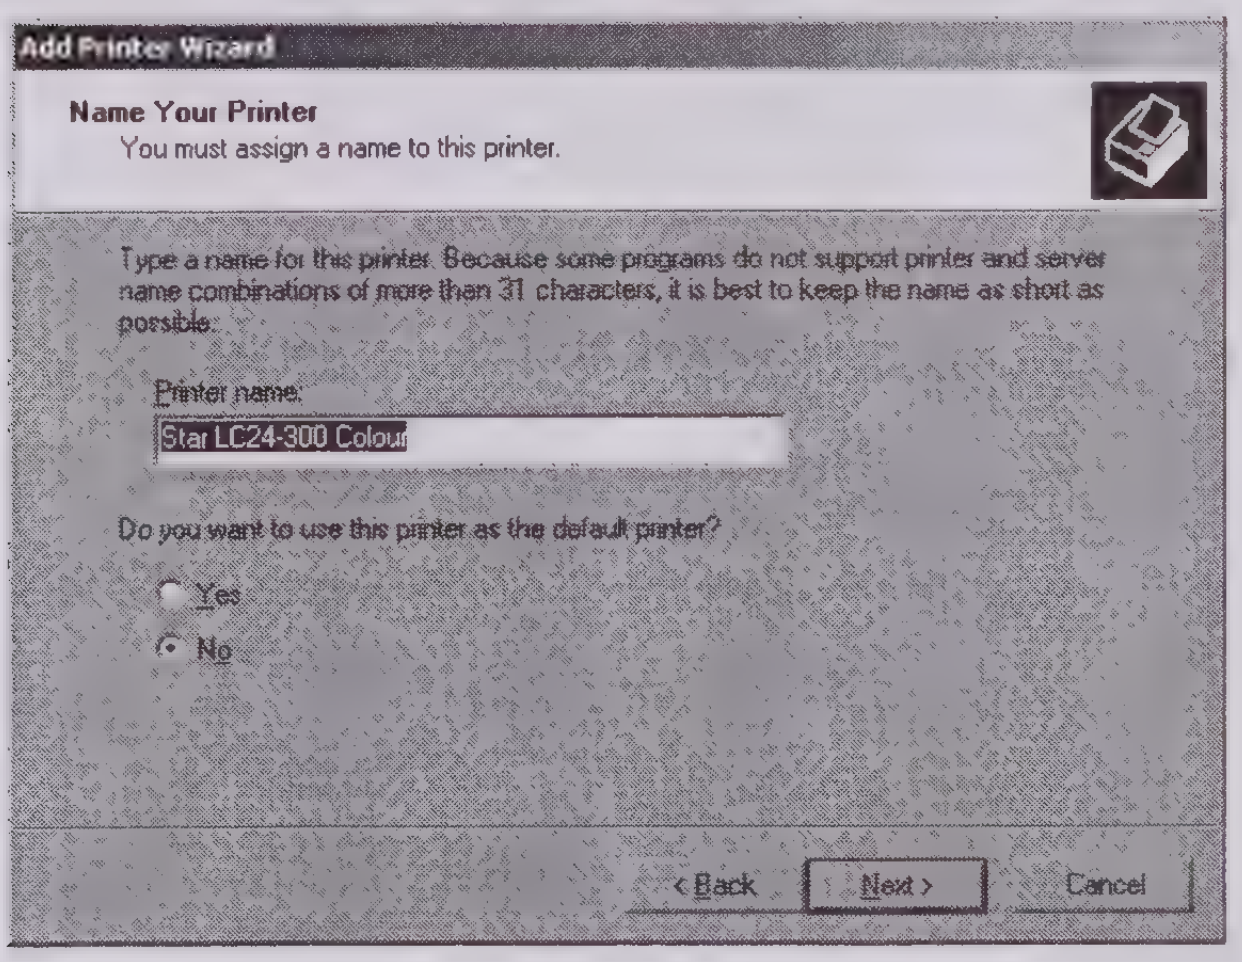

Name Your Printer
You must assign a name to this printer.

Type a name for this printer. Because some programs do not support printer and server name combinations of more than 31 characters, it is best to keep the name as short as possible.

Printer name: Star LC24-300 Colour

Do you want to use this printer as the default printer?

○ Yes
● No

- ➢ The printer name can be changed as required in the *Printer name* entry field (max. 60 characters). A PC keyboard is required in this case.
- ➢ Use the spinwheel to select *Yes or No* for the default printer.
- ➢ Choose the desired status with the up /down keys.
- ➢ Confirm with *ENTER*.

The *Printer Sharing* dialog is opened.

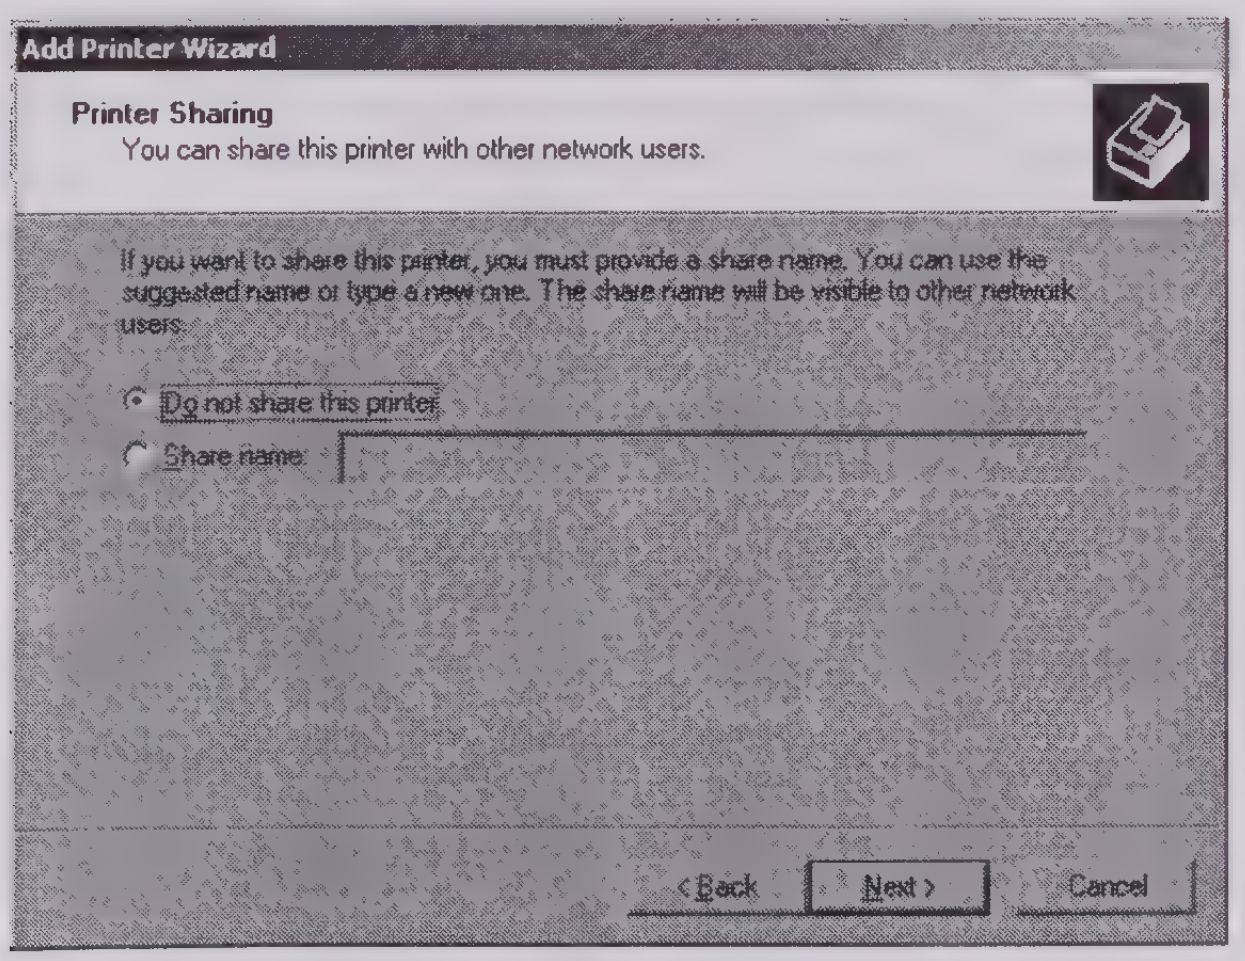

Printer Sharing
You can share this printer with other network users.

If you want to share this printer, you must provide a share name. You can use the suggested name or type a new one. The share name will be visible to other network users.

● Do not share this printer
○ Share name:

- ➢ Exit the dialog with *ENTER*.

The *Print Test Page* dialog is opened.

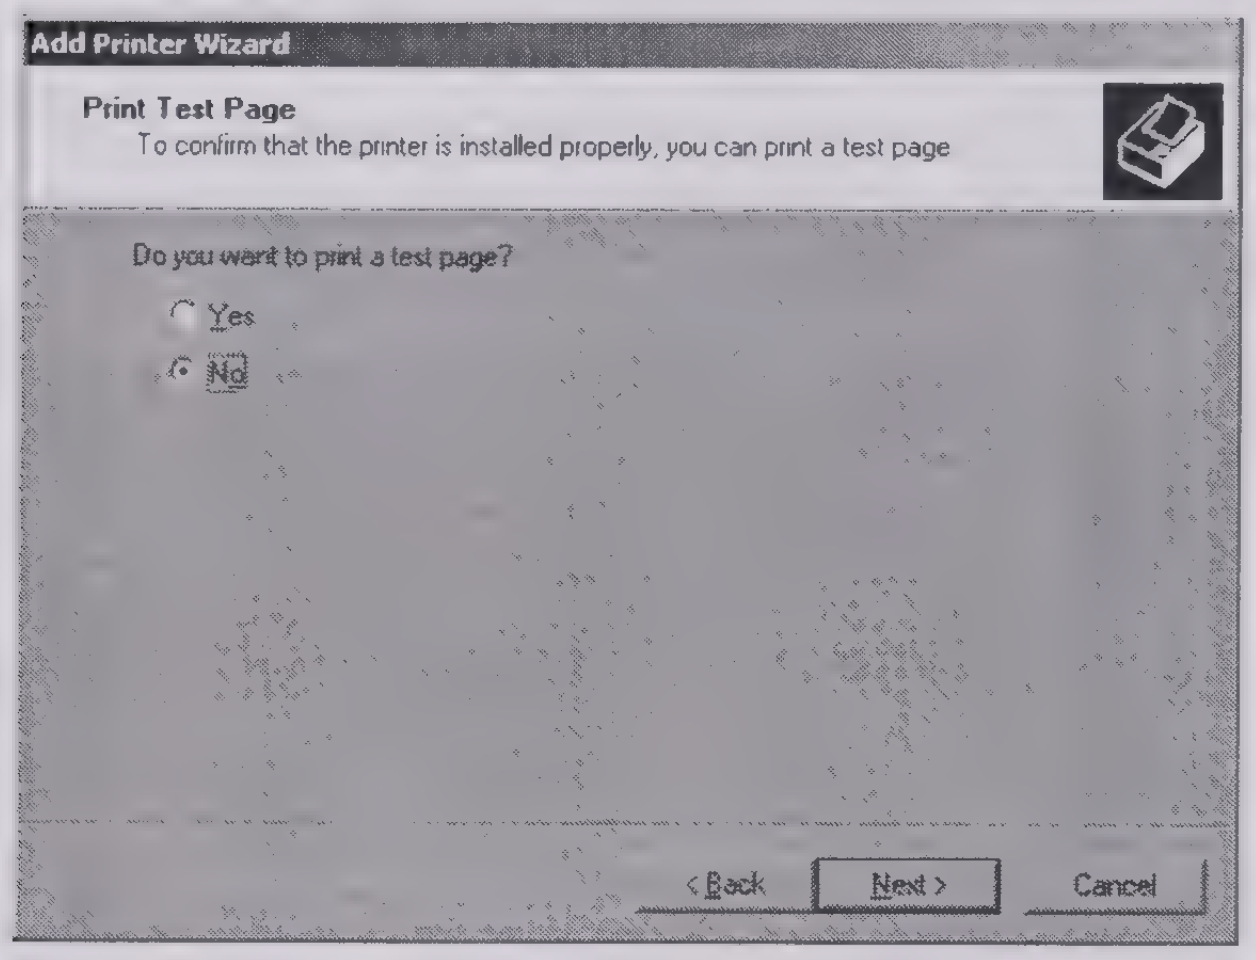

Print Test Page
To confirm that the printer is installed properly, you can print a test page

Do you want to print a test page?

○ Yes
● No

- Exit the dialog with *ENTER*.

  The *Completing the Add Printer Wizard* dialog is opened.

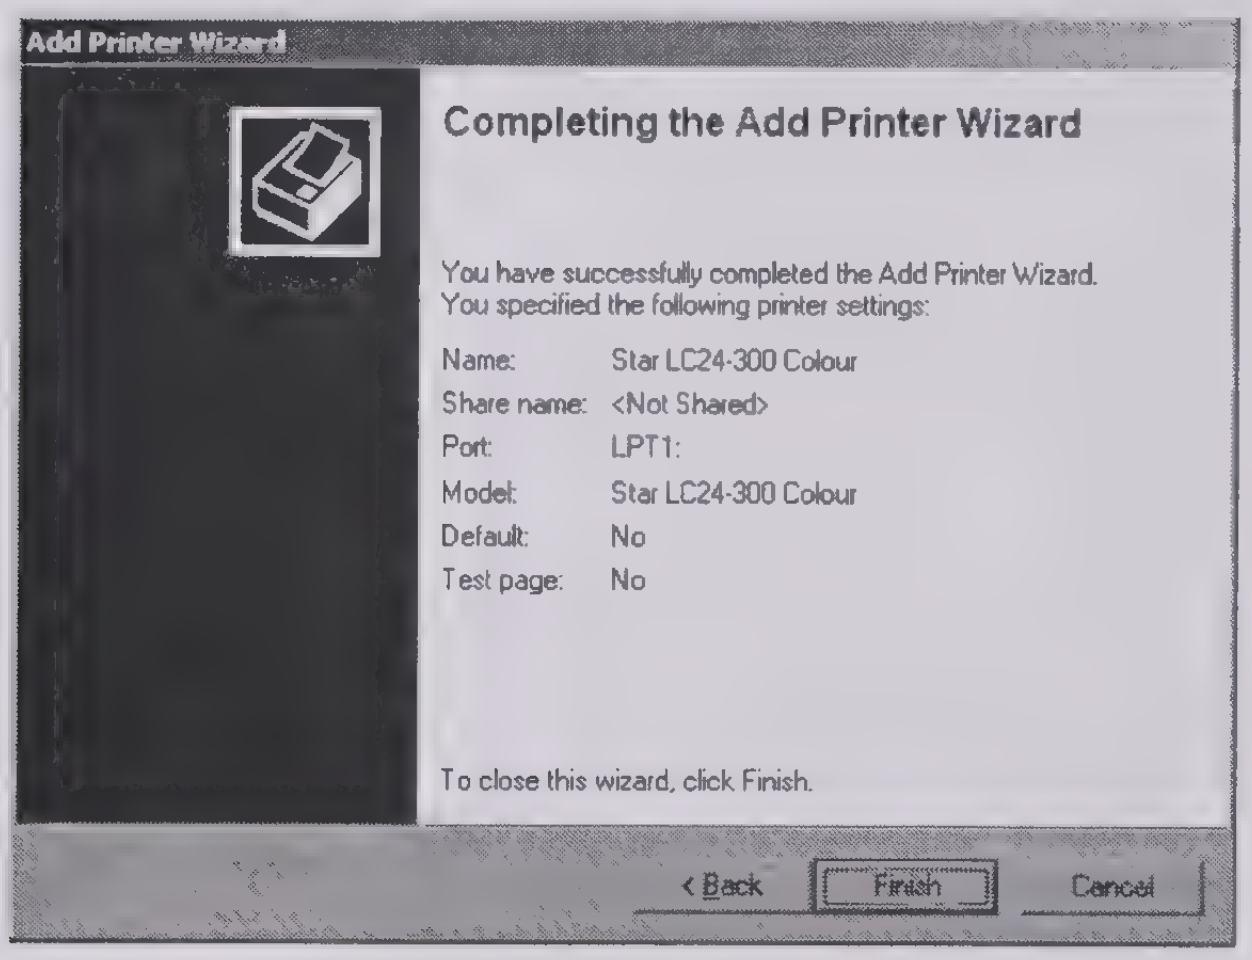

Completing the Add Printer Wizard

You have successfully completed the Add Printer Wizard.
You specified the following printer settings:

Name:	Star LC24-300 Colour
Share name:	<Not Shared>
Port:	LPT1:
Model:	Star LC24-300 Colour
Default:	No
Test page:	No

To close this wizard, click Finish.

- Check the displayed settings and exit the dialog with *ENTER*.

  The printer is installed. If Windows finds the required driver files, the installation is completed without any further queries.

  If Windows cannot find the required driver files, a dialog is opened where the path for the files can be entered.

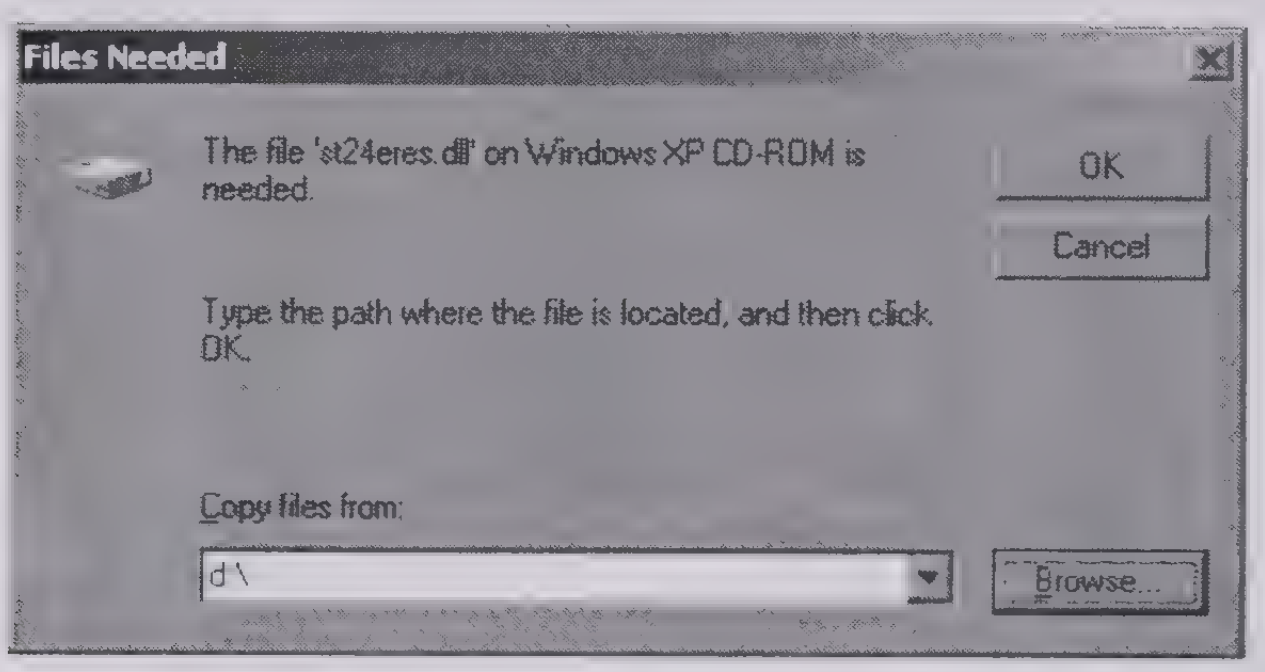

The file 'st24eres.dll' on Windows XP CD-ROM is needed.

Type the path where the file is located, and then click OK.

Copy files from:
d:\

- Select the *Browse* button with the spinwheel and confirm with by pressing the spinwheel.

  The *Locate File* dialog is opened.

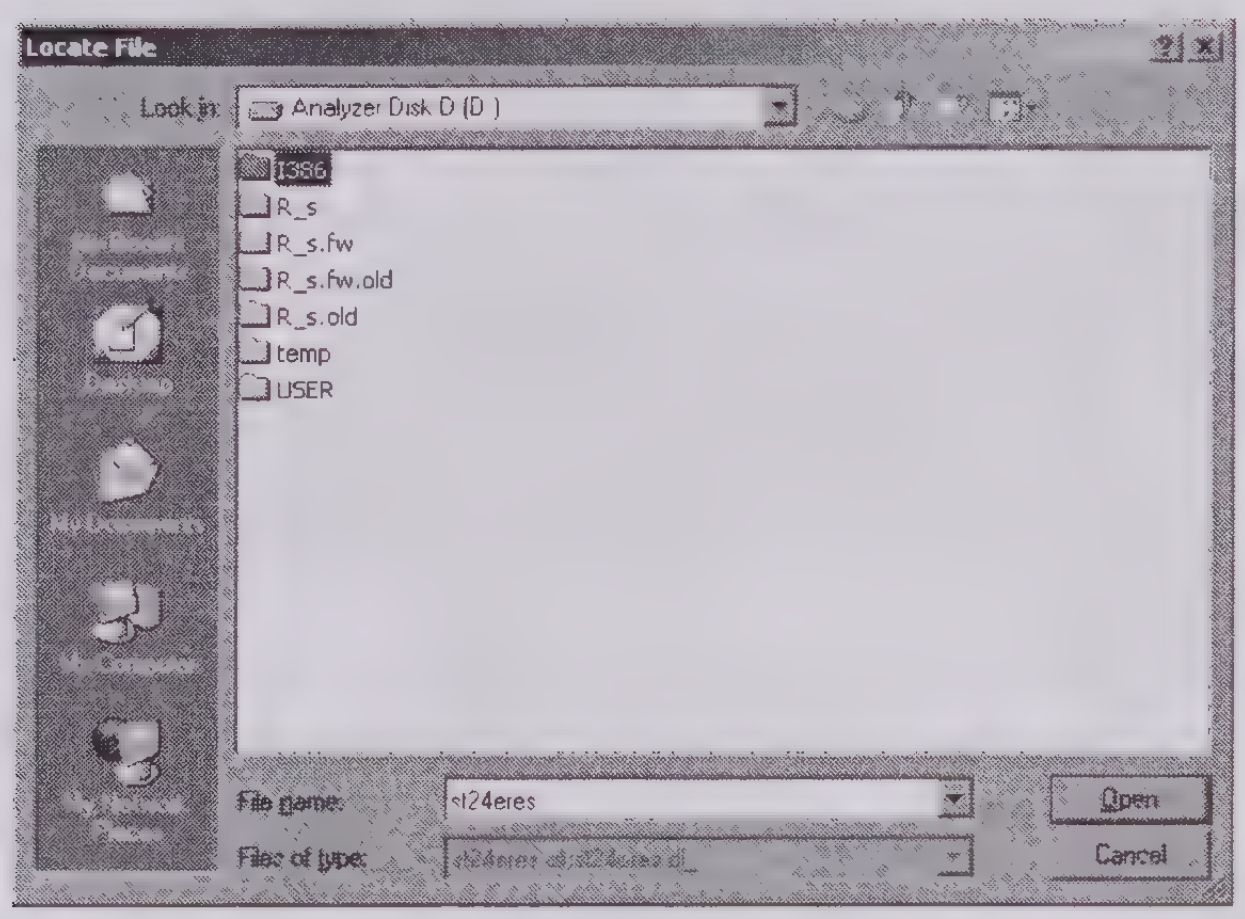

Locate File

Look in: Analyzer Disk D (D:)

I386
R_s
R_s.fw
R_s.fw.old
R_s.old
temp
USER

File name: st24eres

- ➢ Turn the spinwheel to select the directory and path D:\I386 and press it to confirm the selection.

If the selected item is not printed on a blue background, it must be marked with the cursor up / down keys before it can be activated by pressing the spinwheel.

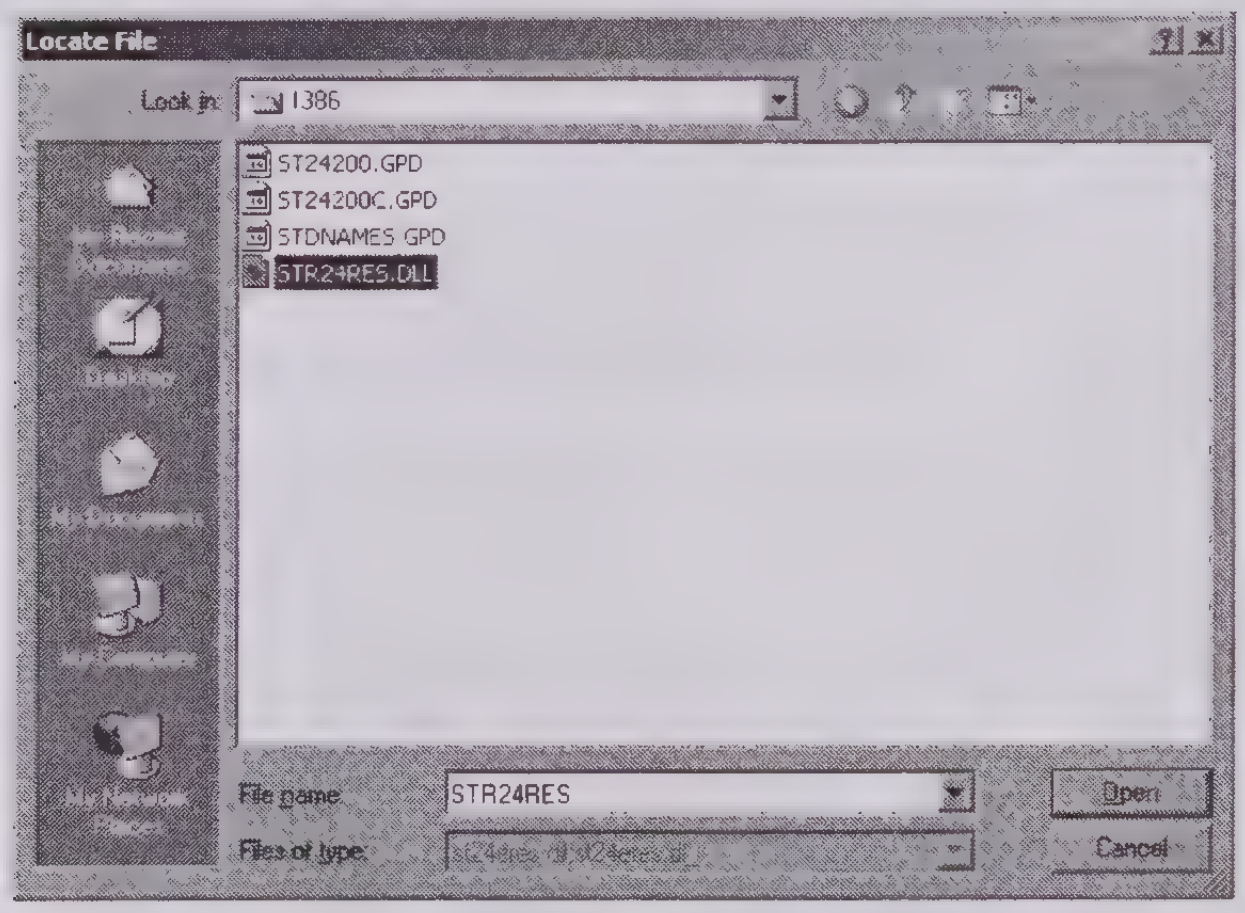

Locate File

Look in: I386

ST24200.GPD
ST24200C.GPD
STDNAMES.GPD
STR24RES.DLL

File name: STR24RES

- ➢ Select the driver file with the spinwheel and confirm by pressing the spinwheel.

The file is included in the *Files Needed* dialog.

Note:
If the desired file is not in the D:\I386 directory, a disk with the driver file is needed. In this case, exit the dialog with ESC and repeat the selection starting from the "Files needed" dialog.

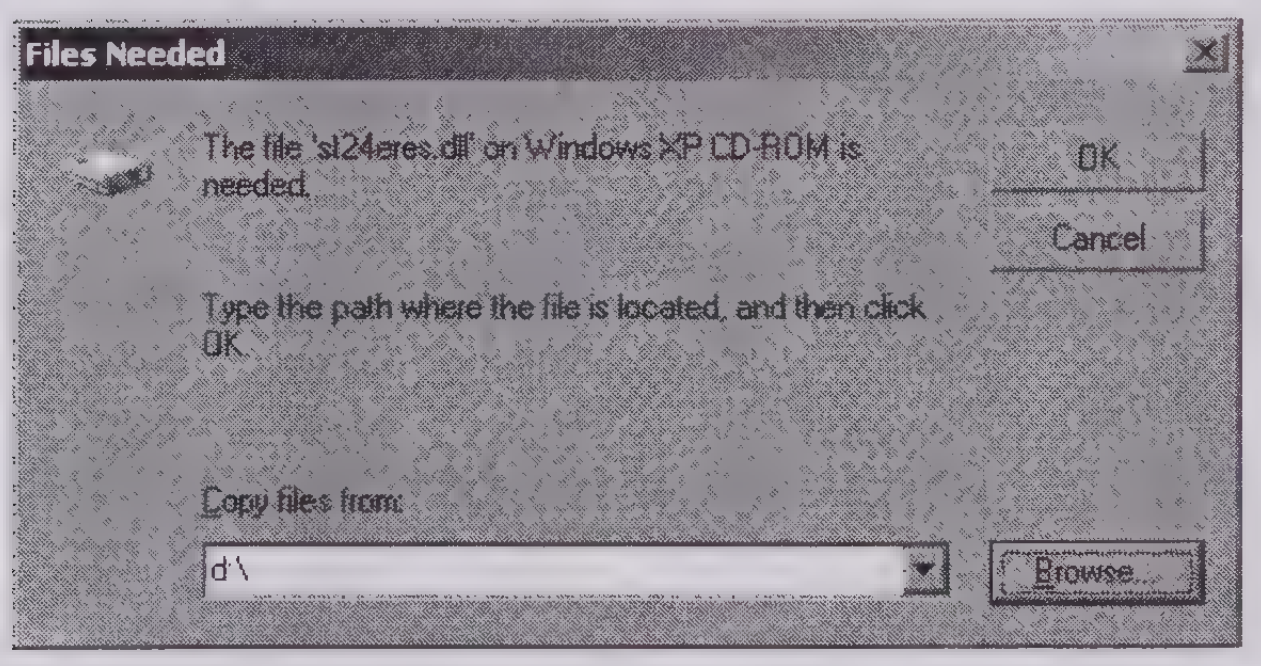

Files Needed

The file 'st24eres.dll' on Windows XP CD-ROM is needed.

Type the path where the file is located, and then click OK.

Copy files from: d:\

- ➢ Select the *OK* button with the spinwheel and press the spinwheel to confirm.

The installation is completed.

Finally, the instrument must be configured for printout with this printer using the softkeys *DEVICE SETUP* and *DEVICE 1/2* in the hardcopy main menu (see section "Selecting a printer").

Configuring a Network Printer

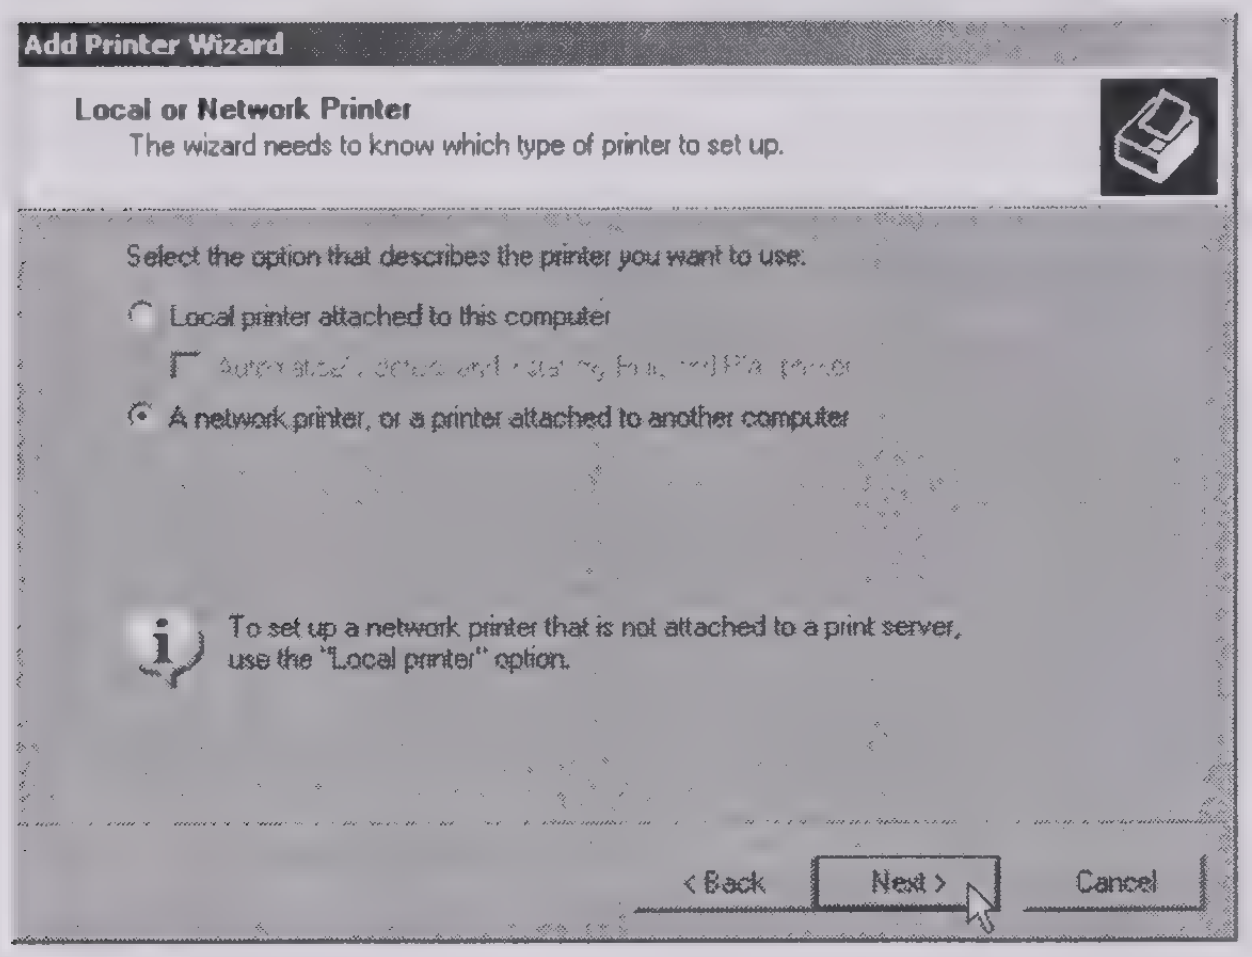

Add Printer Wizard

Local or Network Printer
The wizard needs to know which type of printer to set up.

Select the option that describes the printer you want to use:

○ Local printer attached to this computer

☐ Automatically detect and install my Plug and Play printer

● A network printer, or a printer attached to another computer

To set up a network printer that is not attached to a print server, use the "Local printer" option.

- To select a network printer, click the option "*A network printer or a printer attached to another computer*".

Continue with *Next.*

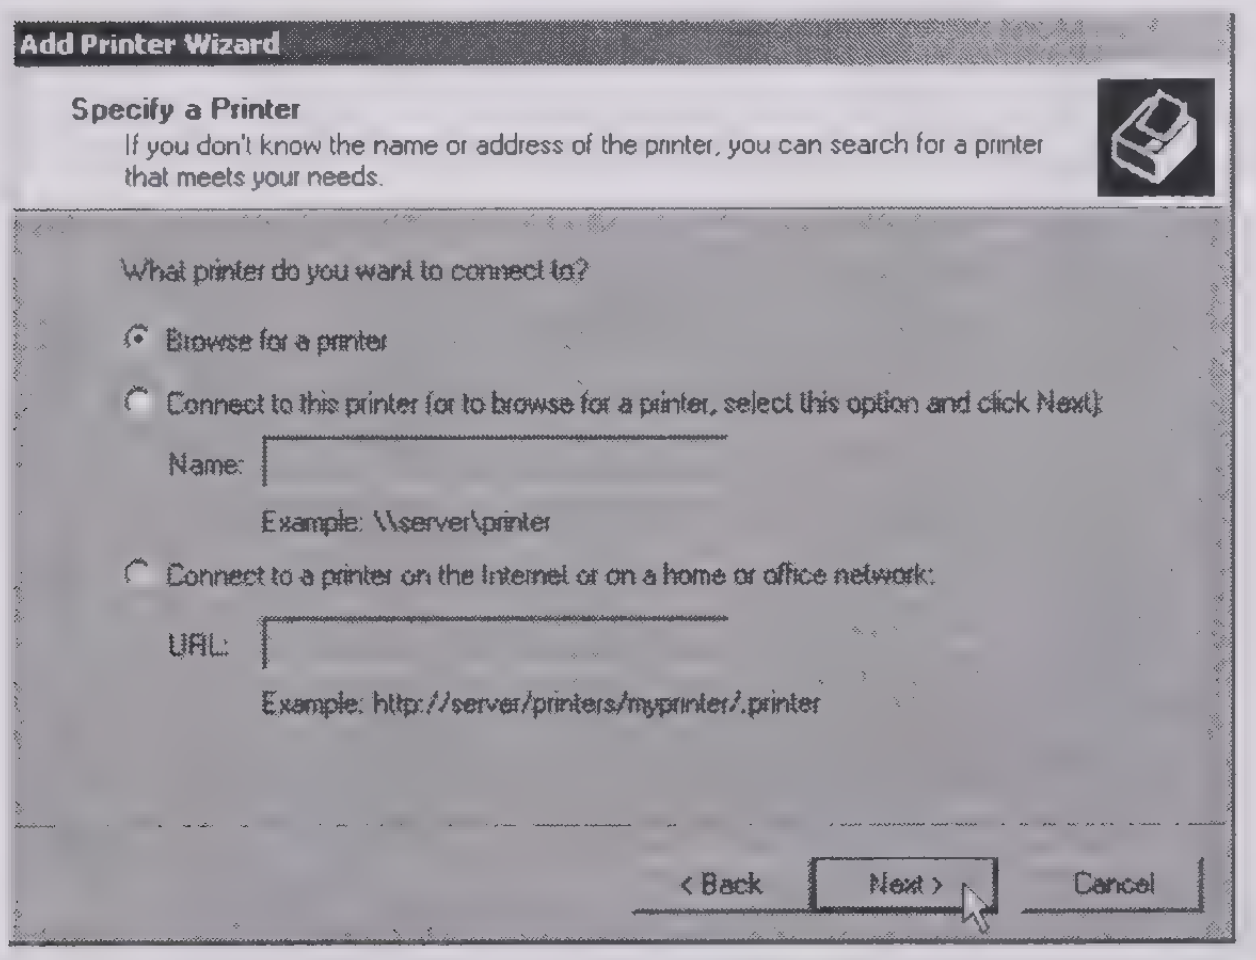

Add Printer Wizard

Specify a Printer
If you don't know the name or address of the printer, you can search for a printer that meets your needs.

What printer do you want to connect to?

● Browse for a printer

○ Connect to this printer (or to browse for a printer, select this option and click Next):

Name:

Example: \\server\printer

○ Connect to a printer on the Internet or on a home or office network:

URL:

Example: http://server/printers/myprinter/.printer

- Click *Browse for a printer* and then *Next.*

  A list of selectable printers is displayed.

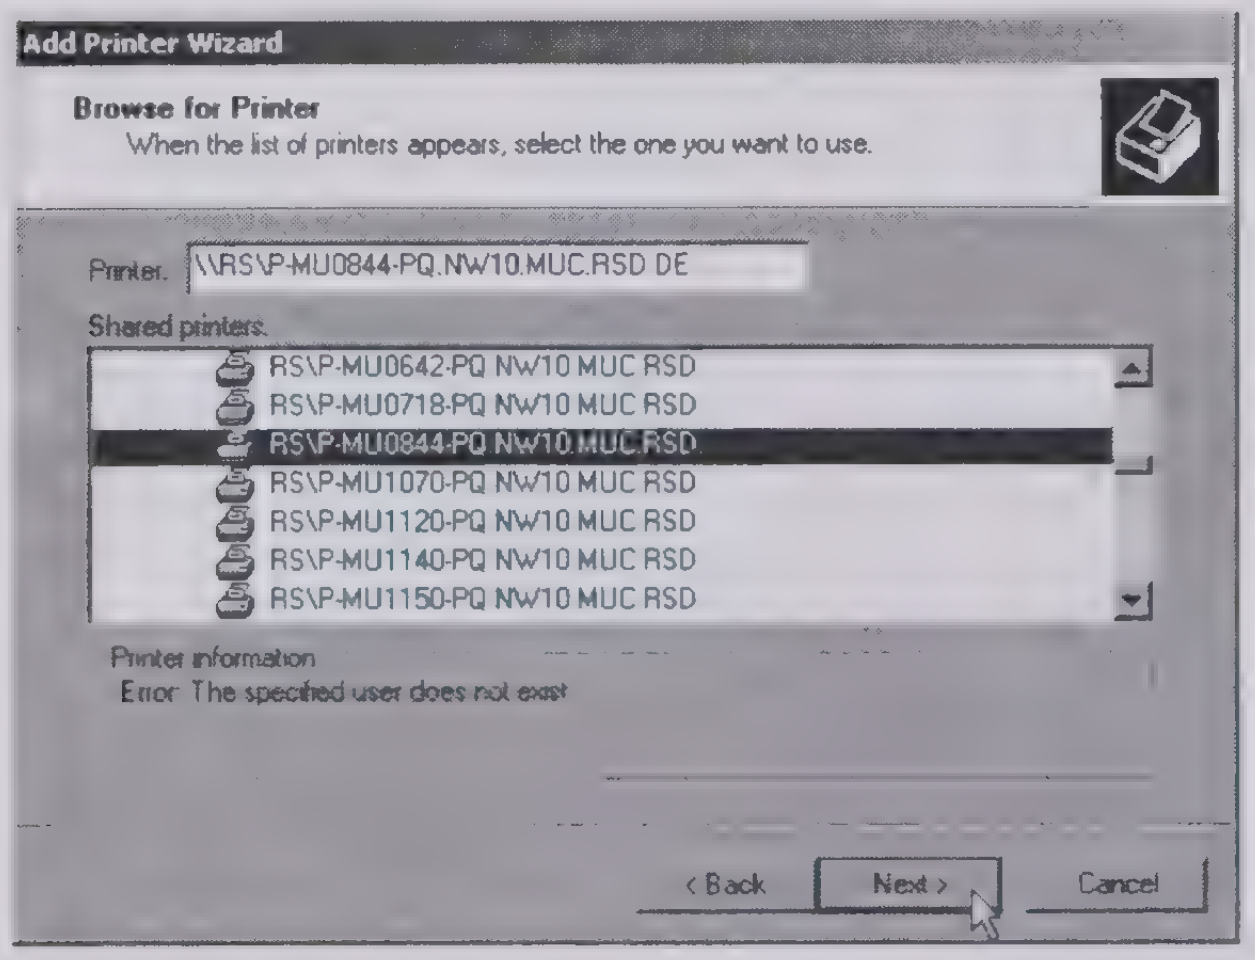

Add Printer Wizard

Browse for Printer
When the list of printers appears, select the one you want to use.

Printer: \\RS\P-MU0844-PQ.NW10.MUC.RSD DE

Shared printers:

RS\P-MU0642-PQ NW10 MUC RSD
RS\P-MU0718-PQ NW10 MUC RSD
RS\P-MU0844-PQ NW10.MUC.RSD
RS\P-MU1070-PQ NW10 MUC RSD
RS\P-MU1120-PQ NW10 MUC RSD
RS\P-MU1140-PQ NW10 MUC RSD
RS\P-MU1150-PQ NW10 MUC RSD

Printer information
Error The specified user does not exist

- Mark the desired printer and select it with OK.

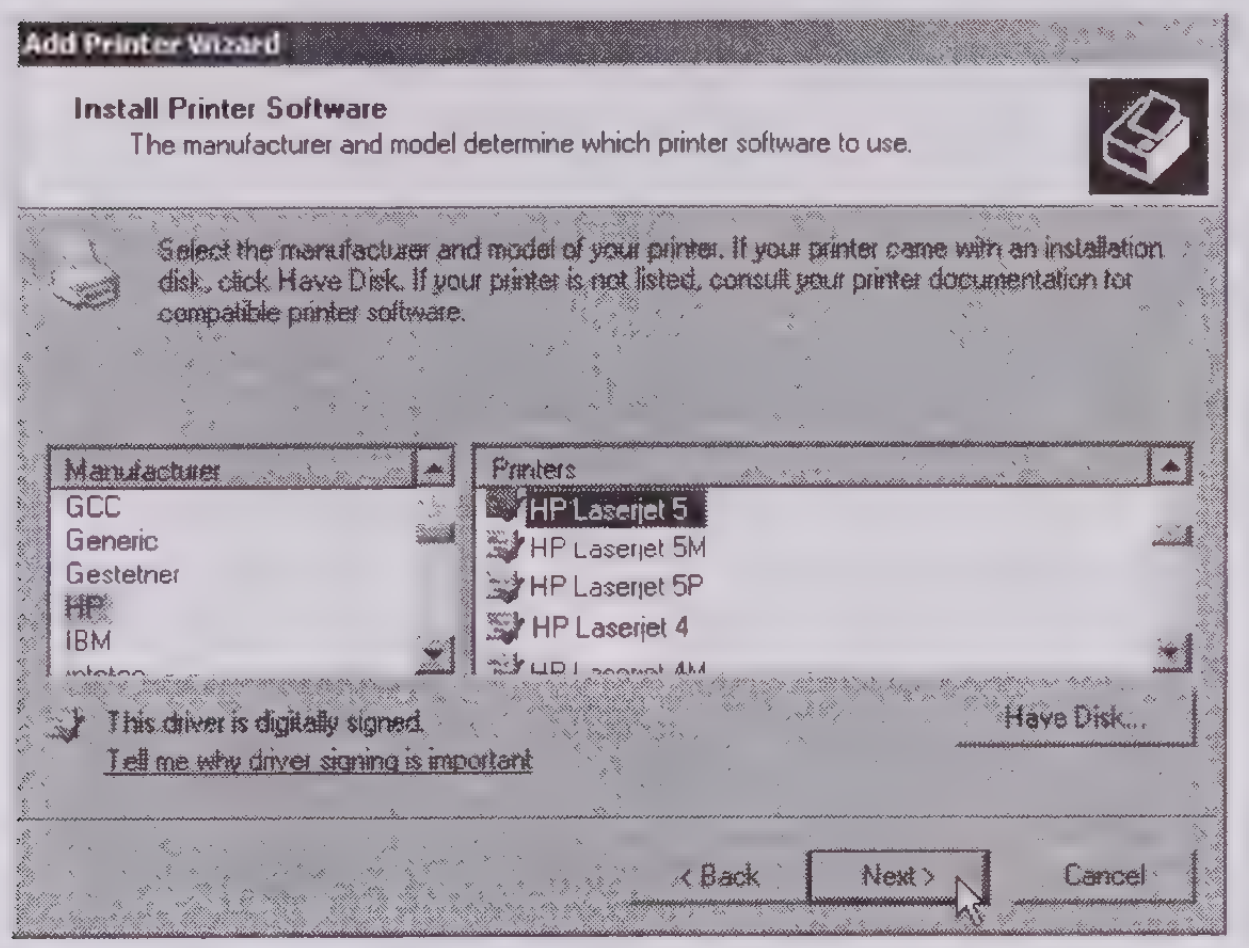
Add Printer Wizard

Install Printer Software

The manufacturer and model determine which printer software to use.

Select the manufacturer and model of your printer. If your printer came with an installation disk, click Have Disk. If your printer is not listed, consult your printer documentation for compatible printer software.

This driver is digitally signed.

Tell me why driver signing is important

- ➢ Confirm the subsequent prompt to install a suitable printer driver with "OK". The list of available printer drivers is displayed.
  The manufacturers are listed in the left-hand table, the available printer drivers in the right-hand table.
- ➢ Select the manufacturer from the *Manufacturers* table and then the printer driver from the *Printers* table.

Note:
If the desired type of output device is not shown in the list, the driver has not yet been installed. In this case, click the "HAVE DISK" button. You will be prompted to insert a disk with the corresponding printer driver. Insert the disk, select "OK" and then choose the desired printer driver.

- ➢ Click *Next*.

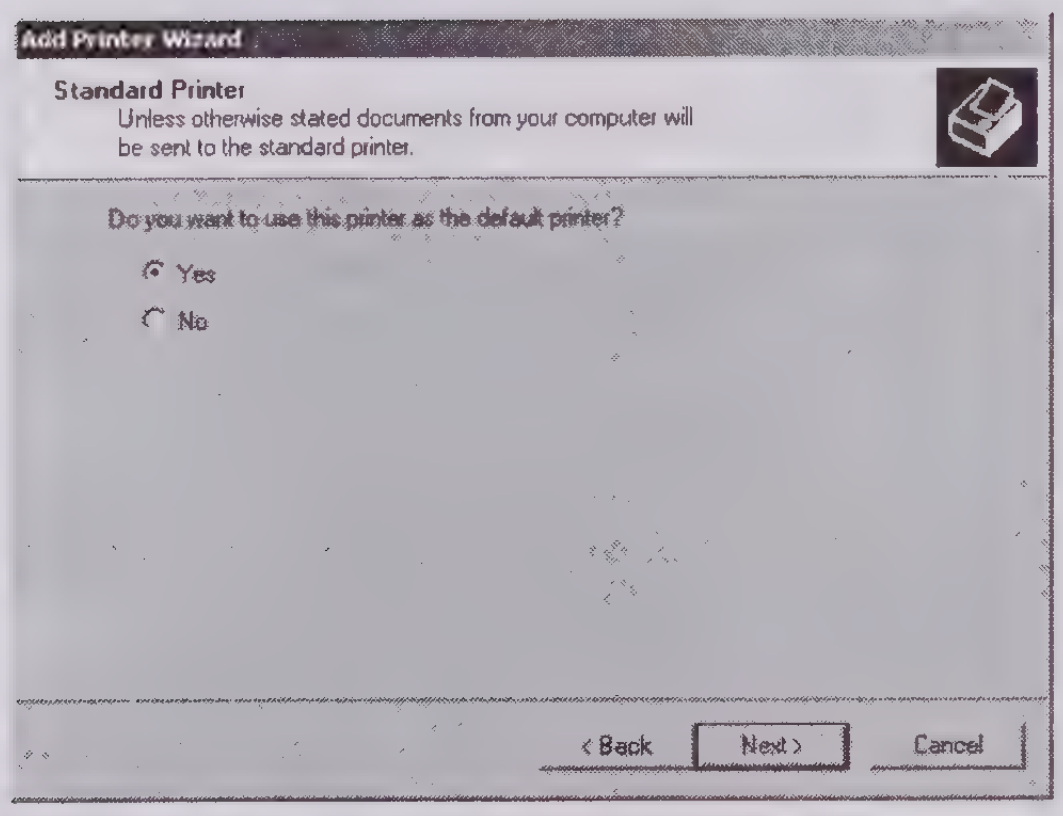
Add Printer Wizard

Standard Printer

Unless otherwise stated documents from your computer will be sent to the standard printer.

Do you want to use this printer as the default printer?

● Yes

○ No

If one or more printers have already been installed, this window queries whether the printer last installed is to be used as the default printer for the Windows XP applications. The default selection is *No*.

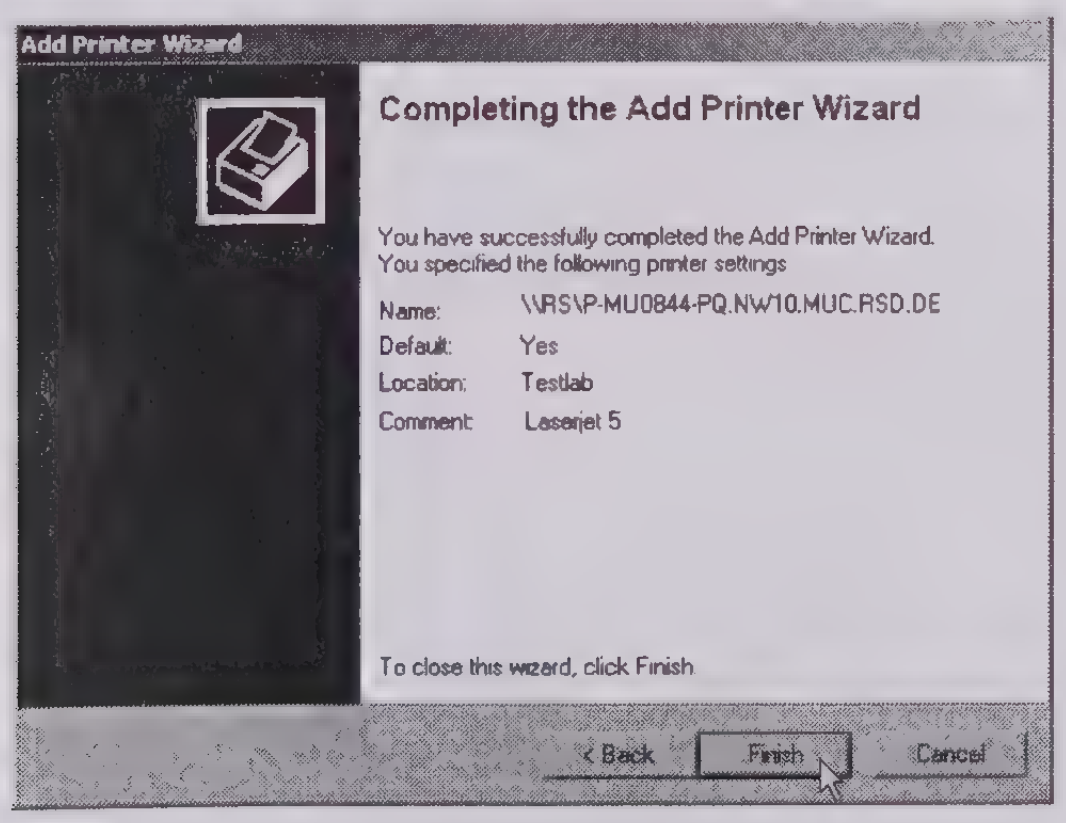
Add Printer Wizard

Completing the Add Printer Wizard

You have successfully completed the Add Printer Wizard. You specified the following printer settings

Name: \\RS\P-MU0844-PQ.NW10.MUC.RSD.DE
Default: Yes
Location: Testlab
Comment: Laserjet 5

To close this wizard, click Finish

- ➢ Start the printer driver installation with *Finish*.

Finally, the instrument has to be configured for printout with this printer using the softkeys *DEVICE SETUP* and *DEVICE 1/2* in the hardcopy menu (see section "Selection of a Printer").

Connection of USB Devices

Up to two USB devices can be directly connected to the analyzer via the USB interface on the rear of the R&S FSMR. This number can be increased as required by interconnecting USB hubs.
Owing to the wide variety of available USB devices, the R&S FSMR can be expanded with almost no limitations. The following list shows a selection of USB devices suitable for the R&S FSMR:

- Power Sensor R&S NRP-Z11 or R&S NRP-Z21 (Adapter Cable R&S NRP-Z4 required)
- Pendrive (memory stick) for easy data transfer from/to the PC (e.g. firmware updates)
- CD-ROM drive for easy installation of firmware applications
- PC keyboard for entering comments, file names, etc
- Mouse for easy operation of Windows dialogs
- Printer for documentation of measurement results
- Modem for remote control of the R&S FSMR over great distances

The installation of USB devices is quite simple under Windows XP since all USB devices are Plug&Play. Apart from the keyboard and the mouse, all USB devices can be connected to or disconnected from the R&S FSMR while the instrument is running.

After the instrument is connected to the USB interface, Windows XP automatically searches for a suitable device driver.

If Windows XP does not find a suitable driver, you will be prompted to specify a directory where the driver software can be found. If the driver software is on a CD, a USB CD-ROM should first be connected to drive to the R&S FSMR.

As soon as the connection between the R&S FSMR and the USB device is interrupted, Windows XP will again recognize the modified hardware configuration and will deactivate the corresponding device driver.

Example:

Connecting a pendrive (memory stick) to the R&S FSMR:

1. After the pendrive is connected to the USB interface, Windows XP will recognize the newly connected hardware:

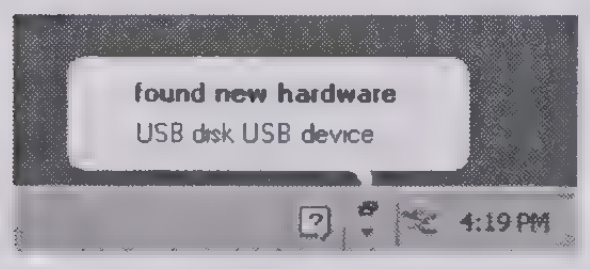

found new hardware
USB disk USB device

2. Windows XP installs the corresponding driver.
After successful installation, XP signals that the unit is ready for operation:

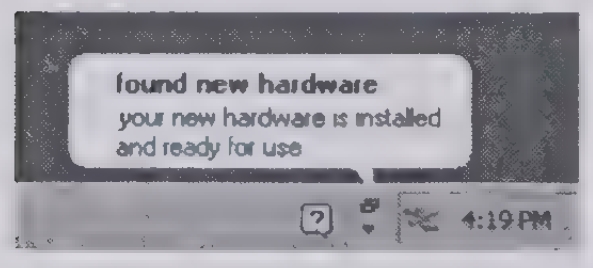

found new hardware
your new hardware is installed and ready for use

3. The pendrive is now available as a new drive and is displayed in Windows Explorer:

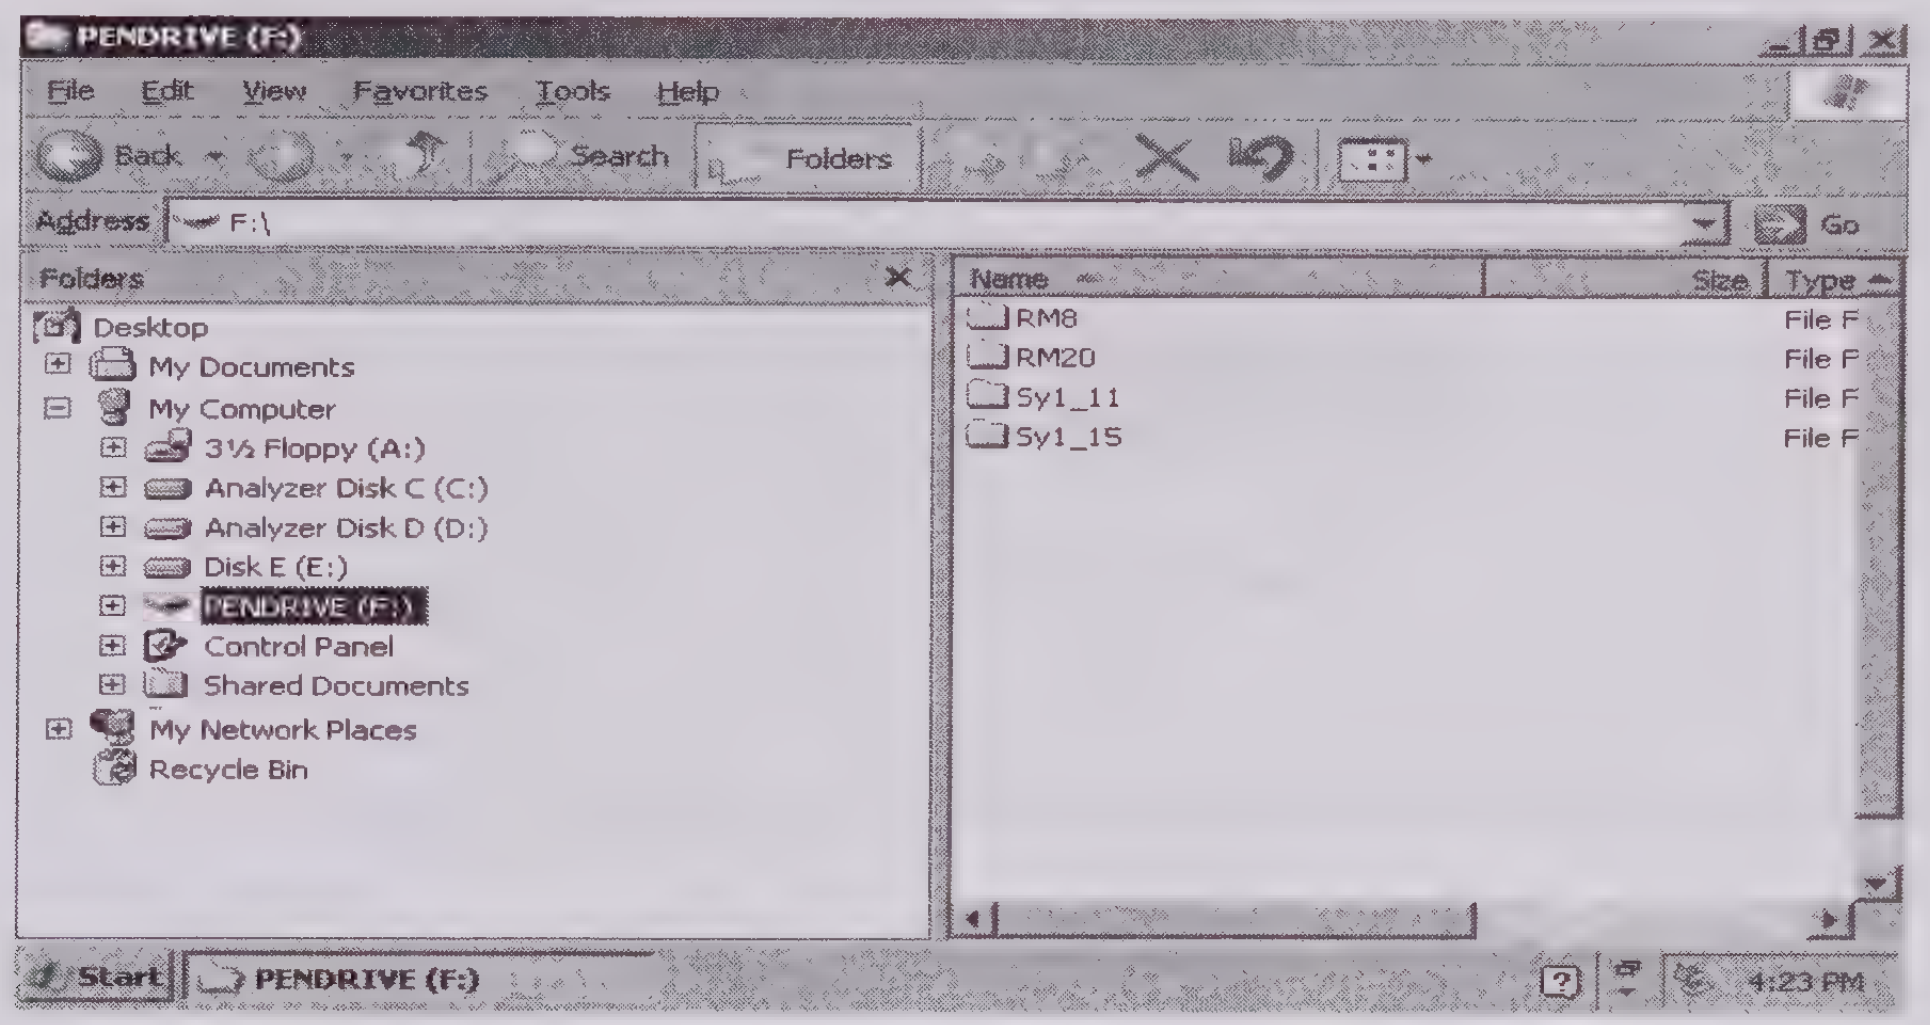

The pendrive can be used as a normal drive to load or save files.

4. If the pendrive is no longer required or if files are to be transferred to another computer, the pendrive is simply disconnected. Windows XP will then deactivate the driver.
   If the corresponding drive is still selected in Explorer, an error message will be displayed indicating that the drive is no longer available.

Installing Windows XP Software

Authorized Windows XP Software for the Instrument

The driver software and the system settings of Windows XP are adapted to the measurement functions of the instrument. Correct operation of the instrument can therefore be guaranteed only if the software and hardware used are authorized or supplied by Rohde & Schwarz.

The following program packages have been successfully tested for compatibility with the instrument's software:

- R&S FS-K3 – software for measuring noise factor and gain
- R&S FS-K4 – software for measuring phase noise
- R&S Power Viewer
  (virtual power sensor for displaying the results of Power Sensors NRP-xx
- Windows XP remote desktop
- FileShredder – for deleting files from the hard disk
- Symantec Norton AntiVirus – software for protection against viruses

The use of other software or hardware may cause failures in the functions of the R&S FSMR.
A current list of the software authorized for use on the R&S FSMR can be obtained from your nearest Rohde & Schwarz agency (see list of addresses).

Installing Windows XP Software

Authorized Windows XP Software for the Instrument

The driver software and the system settings of Windows XP are adapted to the measurement functions of the instrument. Correct operation of the instrument can therefore be guaranteed only if the software and hardware used are authorized or supplied by Rohde & Schwarz.

The following program packages have been successfully tested for compatibility with the instrument's software:

- R&S FS-K3 – software for measuring noise factor and gain
- R&S FS-K4 – software for measuring phase noise
- R&S Power Viewer
  (virtual power sensor for displaying the results of Power Sensors NRP-Z11 and -Z21)
- Windows XP remote desktop
- FileShredder – for deleting files from the hard disk
- Symantec Norton AntiVirus – software for protection against viruses

The use of other software or hardware may cause failures in the functions of the R&S FSMR.
A current list of the software authorized for use on the R&S FSMR can be obtained from your nearest Rohde & Schwarz agency (see list of addresses).

Contents - Chapter 3 "Manual Operation"

3 Manual Operation 3.1

The Screen 3.1

Diagram Area 3.2

Indications in the Diagram Area 3.3

Full Screen 3.9

Split Screen 3.9

Softkey Area 3.10

Hotkey Area 3.11

Calling and Changing the Menus 3.11

Setting Parameters 3.12

Numeric Keypad 3.12

Spinwheel and Cursor Keys 3.13

Selection and Setting of Parameters via Keys or Softkeys 3.14

Editing of Numeric Parameters 3.17

Entry of Alphanumeric Parameter 3.20

Editing with External Keyboard 3.20

Editing with Help Line Editor 3.21

Selection and Setting of Parameters via Tables 3.24

Menu Overview Receiver Mode 27

FREQENCY Key 27

SPAN Key 28

AMPT Key 29

BW Key 30

SWEEP/MEAS Keys 31

Hotkey Menus 32

RF LEVEL Key 32

PWR METER Key 33

DEMOD Key 34

AUDIO Key 35

Menu Overview Spectrum Analysis Mode 36

FREQUENCY Key 36

SPAN Key 37

AMPT Key 38

MEAS Key 39

BW Key 40

SWEEP Key 41

Menu Overview another Keys 42

MKR Key 42

MKR-> Key 43

MKR FCTN Key 44

TRIG Key 45

TRACE Key 46

LINES Key 47

DISP Key 48
FILE Key....49
CAL Key 50
SETUP Key 51
HCOPY Key....52
Hotkey Menu 53
LOCAL Menu....53

Menu Overview Ext. Generator Control 54

Menu Overview Option Network Mode....55

3 Manual Operation

Chapter 3 provides an overview of the operating concept and the basic steps of manual operation of the R&S FSMR. This includes a description of the screen, of the control of menus and of the setting of parameters. An overview of the menus will be listed at the end of this chapter.

The functions of the menus are described in detail in Chapter 4. Chapter 2 contains a short introduction on step-by-step simple measurements. The remote control of the instrument is described in Chapters 5, 6 and 7

The operation of the spectrum analyzer is menu-controlled via keys, hotkeys and softkeys. The setting of the instrument and test parameters in the menus is made either directly via softkeys or by entry of values in entry fields and by selection in tables. The operating mode and the screen mode is selected via the hotkeys.
If required, data entry windows and tables are superimposed on the screen.

The Screen

The screen informs continuously on the results and parameters of the selected measuring functions. It shows the assignment of the softkeys and menus, which are required for setting the measuring parameters. The display of test results, the softkey labeling and the type of menu depend on the selected measuring function.
The screen is subdivided into three areas:

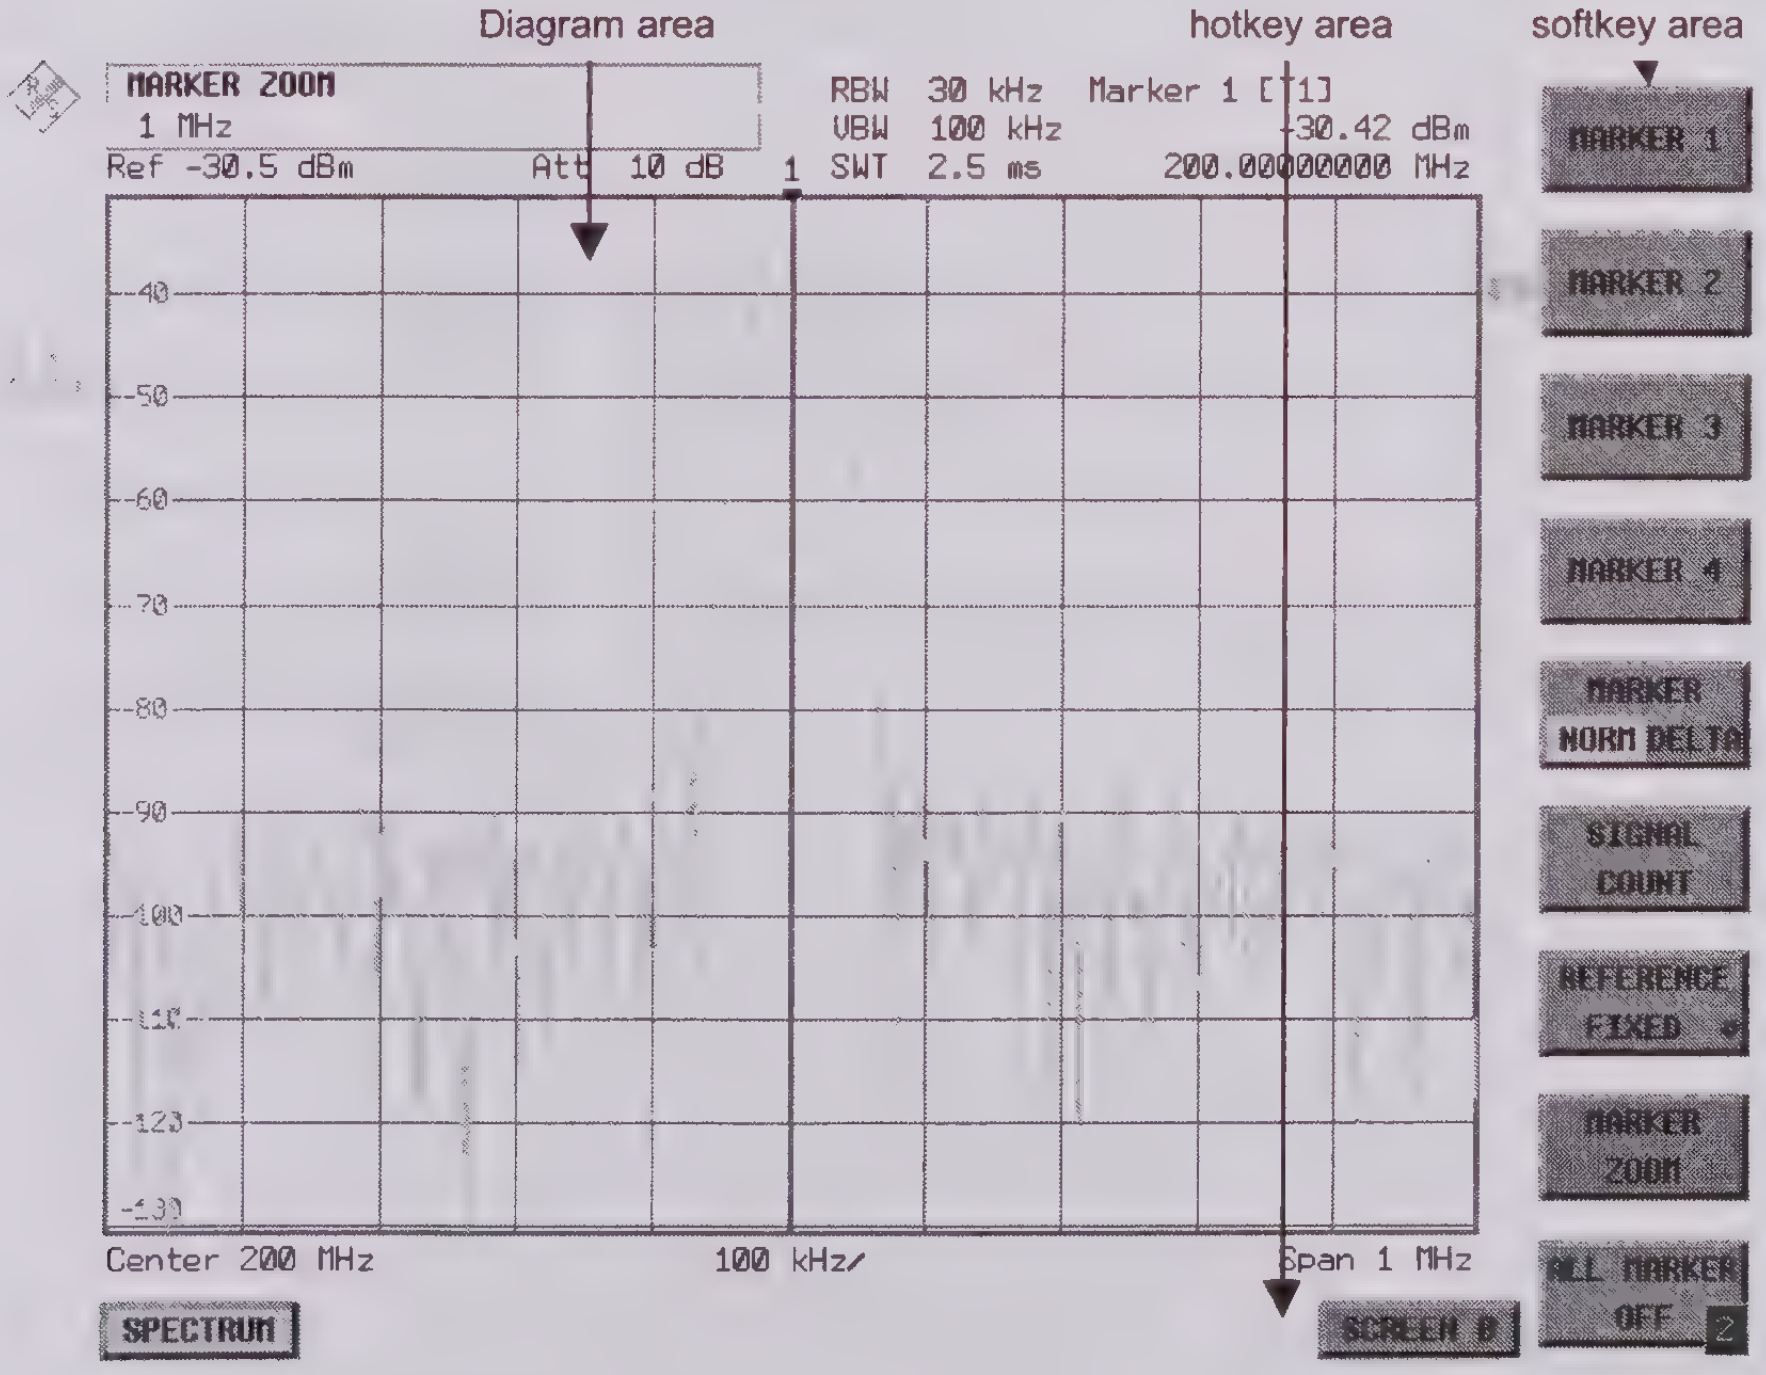

MARKER ZOOM
1 MHz
Ref -30.5 dBm Att 10 dB
RBW 30 kHz
VBW 100 kHz
SWT 2.5 ms
Marker 1 [T1]
-30.42 dBm
200.00000000 MHz
Center 200 MHz 100 kHz/ Span 1 MHz

Fig. 3-1 Subdivision of screen

Diagram area	This area contains the measuring diagrams and other measured-value information as well as the parameters and status information which are important for analysis of the results. In addition, message fields, entry windows and tables may be shown in this area.
Softkey area	This area contains the instrument functions which can be selected via the softkeys. The softkey area is not superimposed by other graphics.
Hotkey area	This area contains the available operating modes and screen modes. The hotkey area is not superimposed by other graphics.

Diagram Area

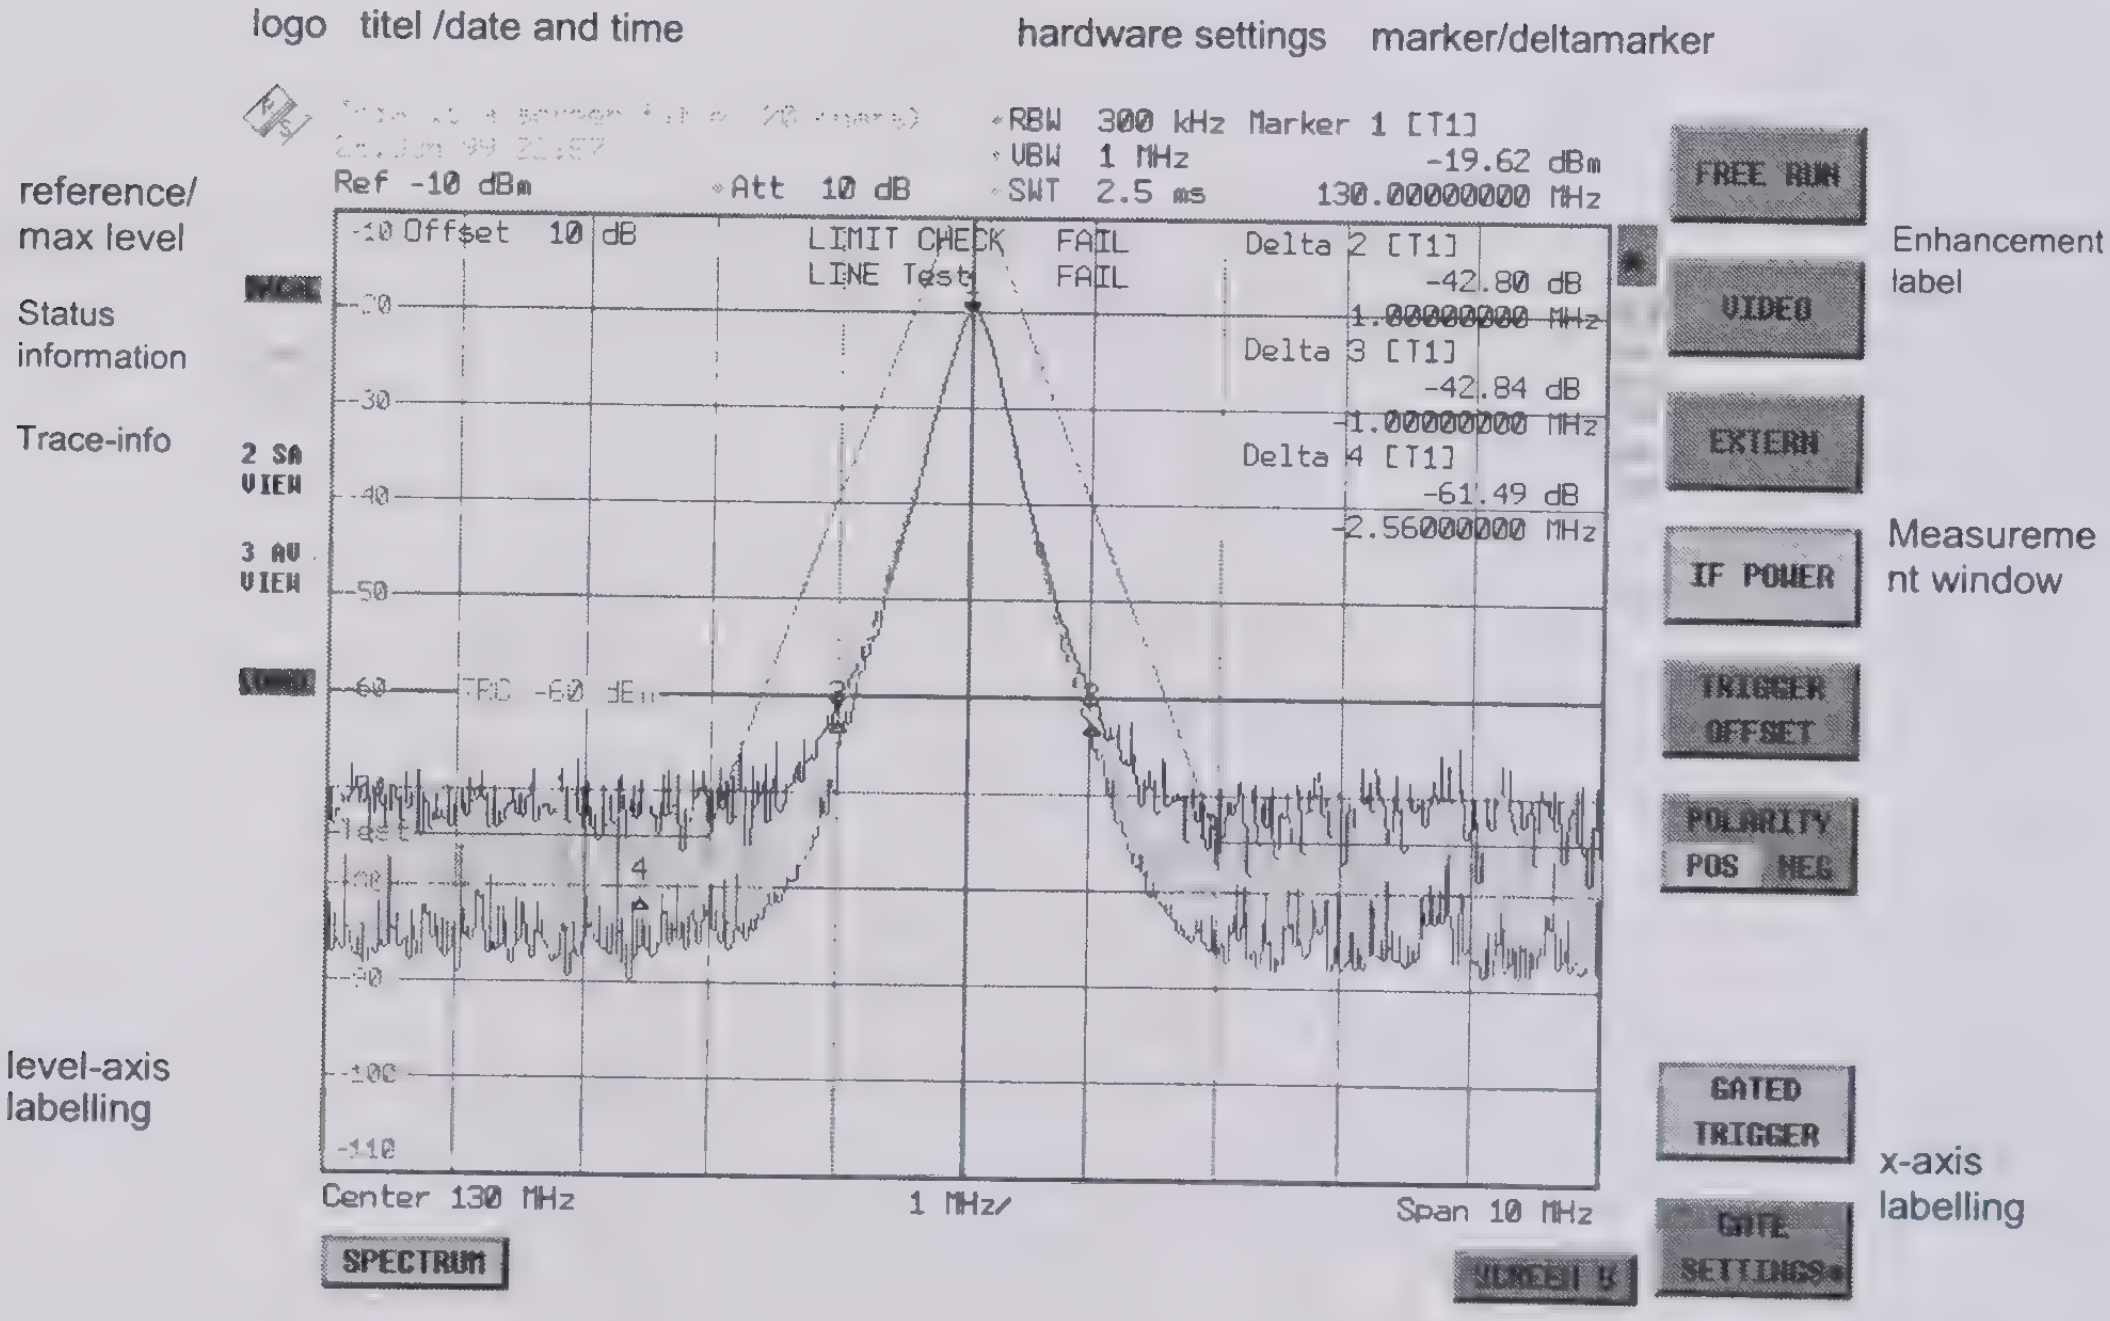

Ref -10 dBm
Att 10 dB
RBW 300 kHz
VBW 1 MHz
SWT 2.5 ms
Marker 1 [T1] -19.62 dBm 130.00000000 MHz
Offset 10 dB
LIMIT CHECK FAIL
LINE Test FAIL
Delta 2 [T1] -42.80 dB 1.00000000 MHz
Delta 3 [T1] -42.84 dB -1.00000000 MHz
Delta 4 [T1] -61.49 dB -2.56000000 MHz
TRC -60 dBm
Center 130 MHz
1 MHz/
Span 10 MHz

Fig. 3-2 Subdivision of the R&S FSMR screen in analyzer mode (without measuring diagram)

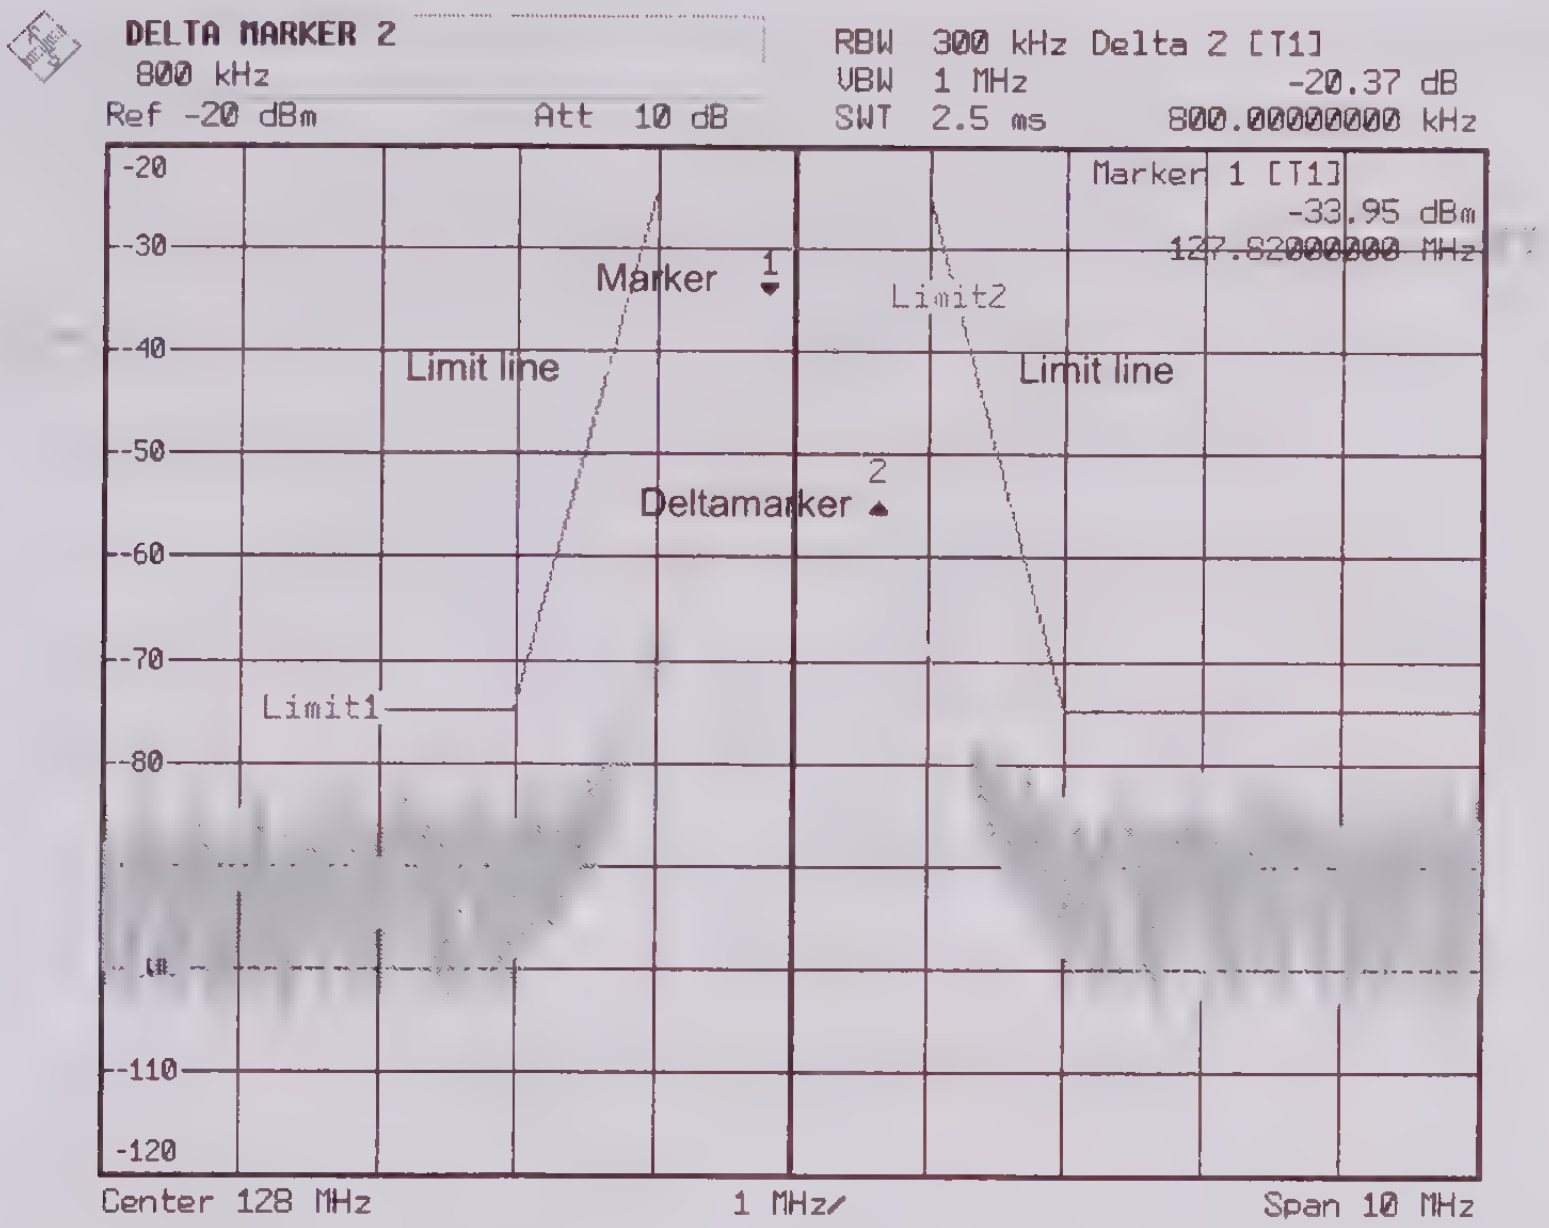

DELTA MARKER 2
800 kHz
Ref -20 dBm Att 10 dB
RBW 300 kHz Delta 2 [T1]
VBW 1 MHz -20.37 dB
SWT 2.5 ms 800.00000000 kHz
Marker 1 [T1]
-33.95 dBm
127.82000000 MHz
Center 128 MHz 1 MHz/ Span 10 MHz

Fig. 3-3 Measuring diagram

Indications in the Diagram Area

The following graphic elements are displayed in the diagram area:

General indications	Indication of the logo
Logo	
Screen title	Indication of selected screen title
Date / time	Indication of date and time
Hardware settings	
Ref	Indication of the reference level
Offset	Indication of the offset of reference level.
Att	Indication of the set RF attenuation.
RBW	Indication of the set resolution bandwidth. If the bandwidth does not correspond to the value of the automatic coupling, a green asterisk "*" is prefixed to the field.
VBW	Indication of the set video bandwidth. If the bandwidth does not correspond to the value of the automatic coupling, a green asterisk "*" is prefixed to the field.
SWT	Indication of the set sweep time. If the sweep time does not correspond to the value of the automatic coupling an asterisk "*" is prefixed to the field. The colour of the asterisk turns red as soon as the sweep time falls below the value of the automatic coupling.

Marker/deltamarker

This label displays the position of the last selected marker or deltamarker in the x and y-directions and the marker/deltamarker index. The square brackets contain the curve which the marker is assigned to and the active measuring function of the marker indicated. The measuring function of the markers in the second field is indicated by the following abbreviations:

FXD	reference fixed active
PHN	phase noise measurement active
CNT	frequency counter active
TRK	signal track active
NOI	noise measurement active
MOD	measurement of AM modulation depth active
TOI	TOI measurement active (3rd order intercept)

Limit check

Indication of the result of the limit check.

X-axis labelling

Display of the x-scaling.

`10 MHz/DIV`

The distance between two grid lines is displayed in this label.

`Center 1.2345678901234 GHz`

`Start 1.2345678901234 GHz`

The set center frequency or start frequency is displayed in this label depending on whether the keys FREQ/SPAN or the softkeys START/STOP were last pressed.
If span = 0 Hz, the center frequency is always displayed.

`Span 1.2345678901234 GHz`

`Stop 1.2345678901234 GHz`

`Trigger 1.234 ms`

The set frequency range (*SPAN*) or the stop frequency is displayed, depending on whether the keys FREQ/SPAN or the softkeys START/STOP were last pressed.
If span = 0 Hz, the trigger moment (*PRETRIGGER*) is displayed.

Status information	The status information on the left side of the diagram hint at irregularity (e.g. UNCAL)
#SMPL	"#SMPL" indicates that the relation Span / RBW is higher than 125 while the RMS detector is activated. In this case, a stable signal evaluation is no longer possible due to an insufficient number of A/D converter samples. ⇒ reduce span or increase RBW
UNCAL	"UNCAL" is indicated under the following circumstances: • correction data are switched off (menu CAL, CAL CORR OFF). ⇒ switch on CAL CORR ON or PRESET • no valid correction data. This may occur after a cold start of the instrument following a firmware update. ⇒ record correction data • Sweep time too short for current instrument settings (span, resolution bandwidth, video bandwidth). ⇒ increase sweep time
OVLD / IFOVL	OVLD is indicated when the input mixer is overloaded. ⇒ Increase input attenuation IFOVL is indicated when overload occurs in the IF signal path after the input mixer. ⇒ Increase reference level
LOUNL / EXREF	LOUNL is indicated when an error occurs in the frequency processing of the instrument. EXREF is indicated when the analyzer is configured for use of an external reference signal, but no reference signal is detected at the corresponding input.
OVEN	OVEN is indicated when the crystal oscillator (option R&S FSMR-B4) has not yet reached its operating temperature. This indication vanishes after a few minutes after switch on.
Trace info:	Every active measurement curve (trace ≠ BLANK) is allocated trace information of two or three lines at the left of the diagram. The trace information has the same colour as the measurement curve. The information on the currently selected trace is displayed in inverse video (see *TRACE - SELECT TRACE softkey*).

<n> <detector> <*>
<mode>
<trace math>

Example:

```
1 PK *
CLRWR
1-2
```

n = trace number (**1 ... 3**)

detector = selected detector
AP: AUTOPEAK detector
PK: MAX PEAK detector
MI: MIN PEAK detector
SA: SAMPLE detector
AV: AVERAGE detector
RM: RMS detector
QP: QUASIPEAK detector

* = indicates that the selected detector does not correspond to that of the automatic coupling.

mode = indication of sweep mode
CLRWR: CLEAR/WRITE
MAXH: MAX HOLD
MINH: MIN HOLD
AVG: AVERAGE
VIEW: VIEW

Trace math = trace math active
1 - 2 trace 1 - trace 2
1 - 3: trace 1 - trace 3

Instrument settings (Enhancement Labels)

Indication of user instrument settings which influence the measuring result and which are not immediately obvious when viewing the measured values.

*****	The current instrument setting does not correspond to the one which applied when one of the displayed curves had been stored. This occurs under the following circumstances: • The instrument setting is modified while a measurement is being performed. • The instrument setting is modified in SINGLE SWEEP mode subsequent to the end of the sweep and no new sweep is started. • The instrument setting is modified after setting the trace to VIEW. The display is retained until the cause is eliminated by the user. I.e., either a new sweep is started (SINGLE SWEEP mode), or the trace of interest is switched to BLANK.
A / B	Identification for screen A / B. When screen A / B is activated for the entry of test parameters, this label is highlighted.
SGL	The sweep is set to SINGLE SWEEP.
GAT	The frequency sweep is controlled via the *EXT TRIG/GATE* input of the instrument.
TRG	The instrument is not triggered in *FREE RUN* mode.
LVL	A level offset ≠ 0 dB has been set.
FRQ	A frequency offset ≠ 0 Hz has been set.
PRN	A printer output is active.
75 Ω	The input impedance of the instrument is set to 75 Ω.
EXT	The instrument is configured for operation with external reference
PA	The RF preamplification is switched on (option FSP-B25) The RF preamplification is switched on (option B23 or B25).

Entry fields:

Entry window	The data entry window is superimposed in the left upper corner of the diagram area, if required. It covers the display of the title and the time. The field is used to enter numeric or alphanumeric device parameters.
Tables	The tables are superimposed in the diagram area, if required. They are used for displaying and configuring device parameters.

Message windows:

Message field

Message fields provide notes on measurements, e.g. results of the limit check (PASS/FAIL).
These notes are no error messages, which are indicated as system messages.

They can be masked out by pressing the *ESC* key.

System messages

System messages indicate warnings and error messages.

Message without action field:
These system messages contain only arbitrary information. They hint at events which are of interest for the user but do not affect the measurement or functioning of the instrument.

They are deleted either automatically after a predefined time has passed (3 seconds) or upon any keystroke or mouse click.

Message with action field:
These system messages require a decision to be taken by the user. They are not deleted until any action has been selected. Deletion of the message initiates the action selected and appropriate measures to be taken. The action field consists of one (OK), two (OK/CANCEL) or three (arbitrary) buttons.
The user may select one of the buttons using the cursor keys and initiate the associated action by means of the unit keys. The ESC key is used to acknowledge the message without releasing any action.

Traces:

1 to 3

Up to 3 traces in each measurement diagram can be displayed simultaneously.

Limit lines

Limit lines are used to mark level curves or spectral distributions which must not be exceeded or dropped below.

The R&S FSMR provides two display modes:

- Full Screen: 1 window, the measurement is performed in the active diagram.
- Split Screen: 2 windows, the measurements are performed in both diagrams.

Full Screen

In the full-screen mode, the settings and measurements are performed in the active visible window. All indications on the screen refer to this window. The designation (SCREEN A or SCREEN B) is inserted as enhancement label A or B on the right diagram margin.
Switching between the windows is by means of *SCREEN A/B* hotkey. The current measurement is terminated when its window is blanked out.
Switching from split-screen to full-screen mode is performed in menu *DISP*.

Split Screen

In Split Screen mode, the screen is divided into two halves.

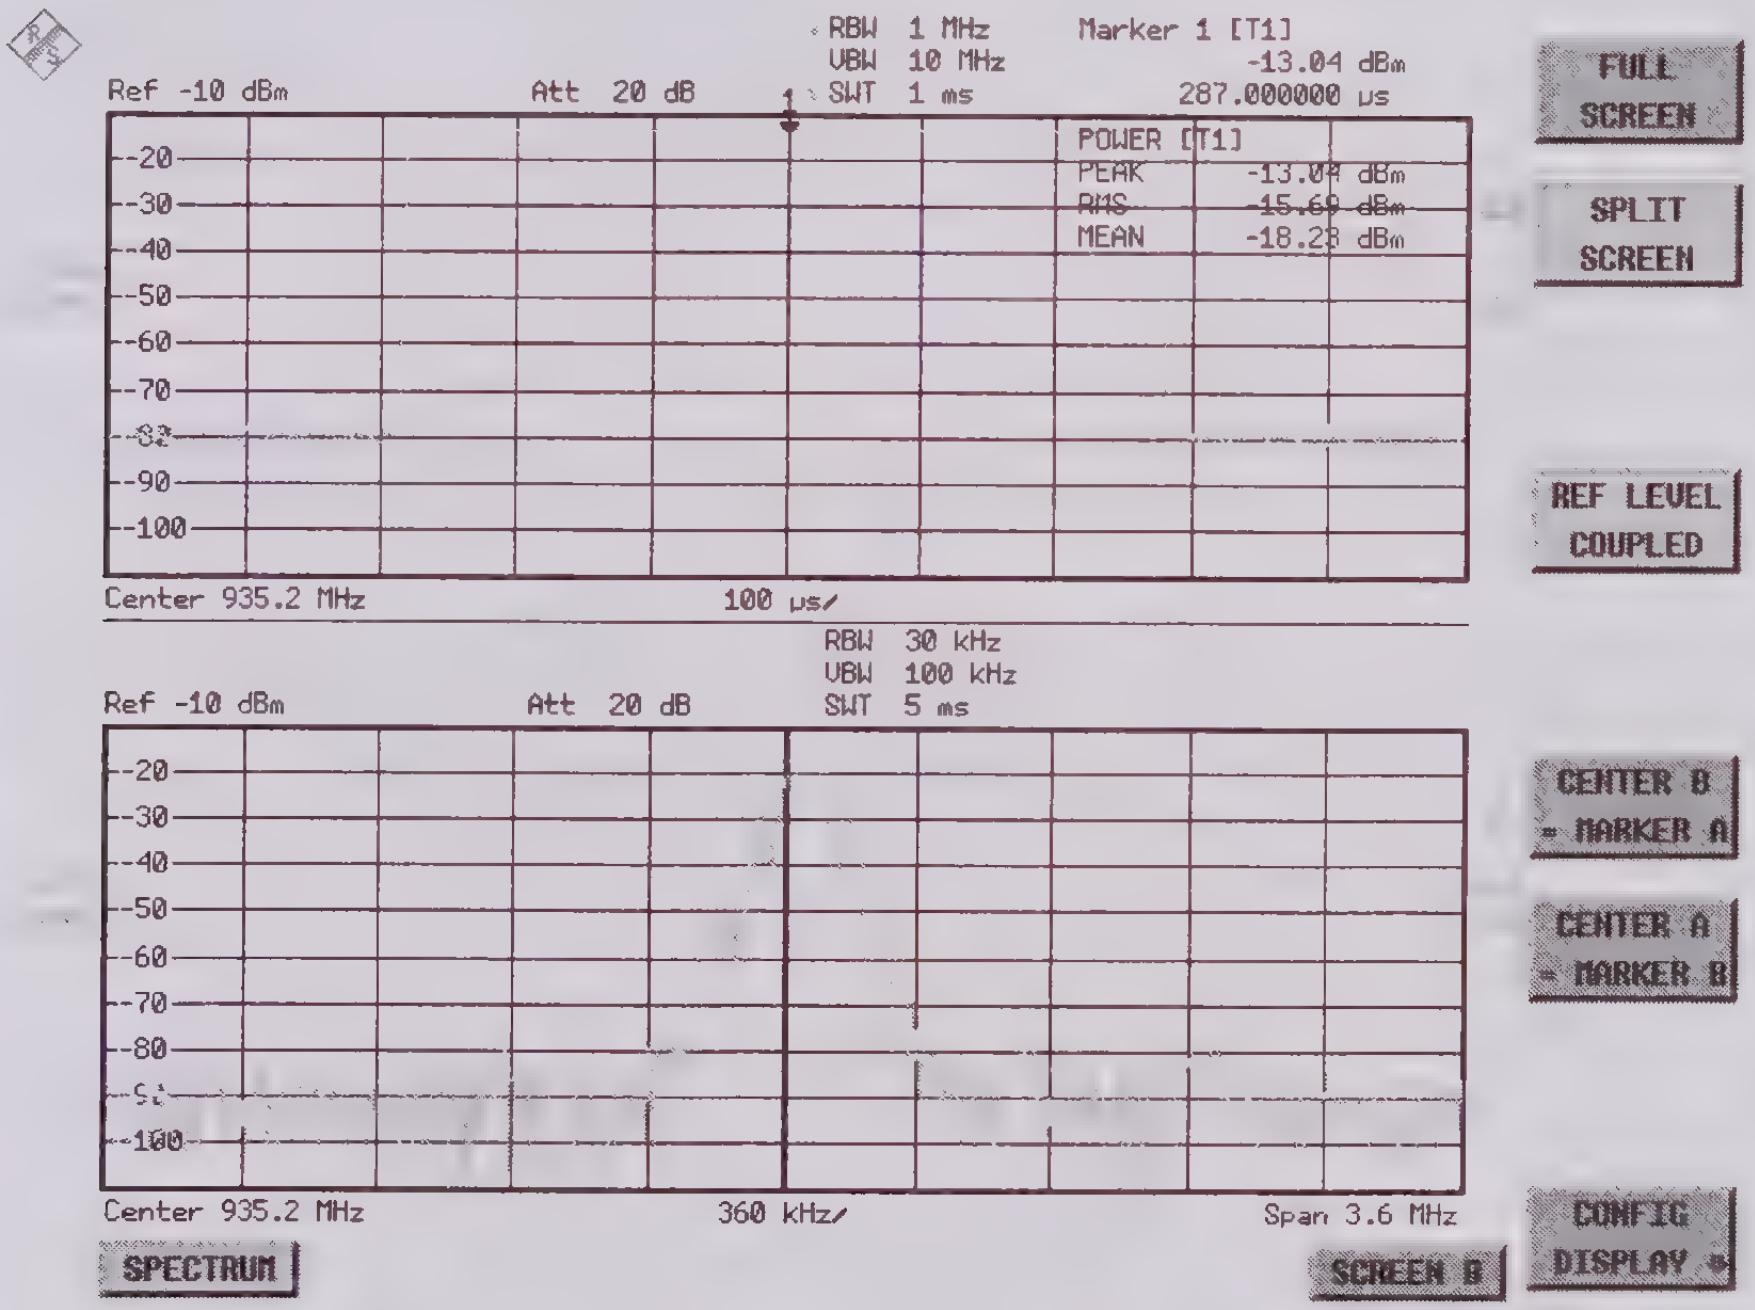

```
                                              RBW  1 MHz      Marker 1 [T1]
                                              VBW  10 MHz               -13.04 dBm
Ref -10 dBm                  Att  20 dB       SWT  1 ms            287.000000 µs

                                                              POWER [T1]
                                                              PEAK      -13.04 dBm
                                                              RMS       -15.69 dBm
                                                              MEAN      -18.23 dBm

Center 935.2 MHz                         100 µs/

                                              RBW  30 kHz
                                              VBW  100 kHz
Ref -10 dBm                  Att  20 dB       SWT  5 ms

Center 935.2 MHz                         360 kHz/                         Span 3.6 MHz
```

Fig.3-4 Subdivision of the screen in Split Screen mode

The upper half is assigned Screen A, the lower one Screen B. The settings for measurement can be selected independently for both screens. E.g., a spectrum may be displayed in Screen A and a time amplitude in the time range is displayed in Screen B.

The indications which are valid only for one window appear in the margin of the associated diagram. Indications which are valid for the two windows are displayed between the diagrams.

The window for entry of the measuring parameters or the marker operation is selected using the *SCREEN A/B* hotkey. The measurements are simultaneously performed in the two windows irrespective of the currently active one.
Switching from full-screen to split-screen mode is performed in menu *DISP*.

Softkey Area

The softkeys are assigned to the nine keys on the right side of the display
The setup of the softkey area is independent of the operating mode. It consists of the following graphic elements:

Softkey menu:

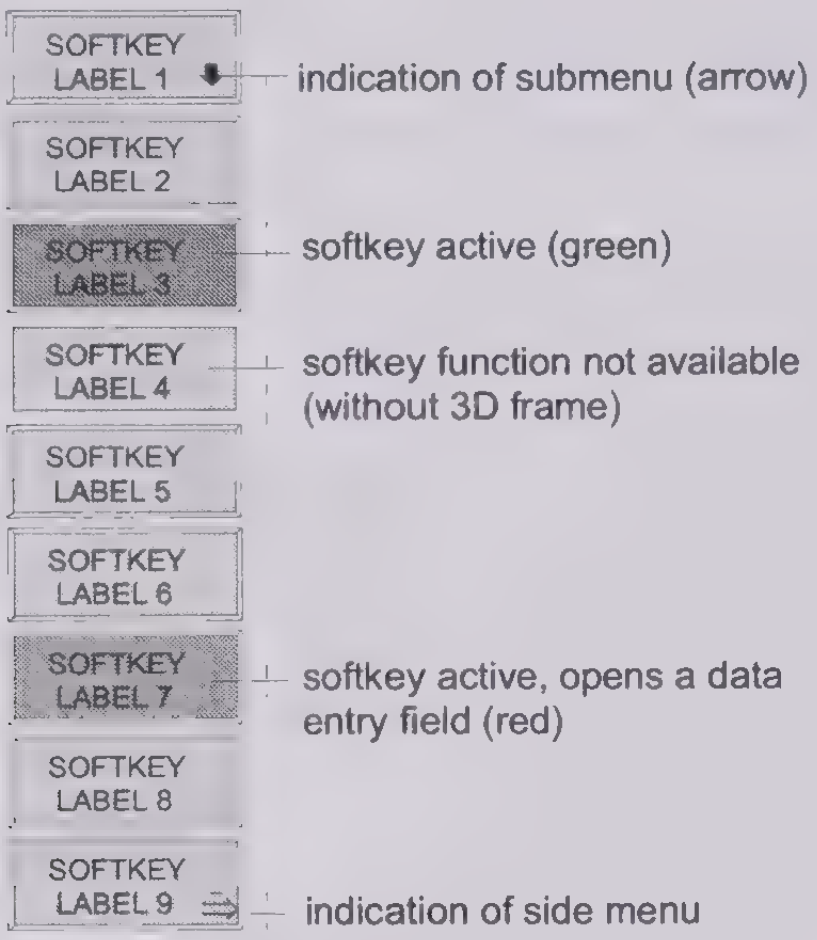

Fig.3-5 Setup of the softkey area

The softkeys have different functions depending on the instrument state. Therefore, their labeling can be varied. The labeling of all softkeys which call a submenu includes a ⇓ arrow.
The function and current state of the softkeys is indicated in the label by different texts and colors. The color assignment is factory-set as follows:

Table 3-1 Factory-set color assignment of soft keys

Softkey color	Meaning
gray	Softkey switched off
green	Softkey switched on
red	Softkey switched on and data entry active

These colors can be changed by the user as desired in the *DISP - CONFIG DISPLAY* menu.

A softkey is switched on or off by pressing the respective hardkey (see following section "Setting the Parameters").

Softkeys are masked out, too, if the functionality which they represent is not available. A distinction has to be made between two cases:

- If an instrument function depends on an option, and if this option is not fitted, the associated softkey is masked out,.
- If the instrument function is not available temporarily due to specific settings, the softkey is displayed without the 3D frame.

The label ➡ on the right lower corner of the softkey area indicates that a side menu is available. The side menu is called by pressing the *NEXT* key.

Hotkey Area

Hotkeys are allocated to the eight keys on the bottom margin of the screen. They change between modes and the active diagrams.
The menu only shows the hotkeys which are actually used:

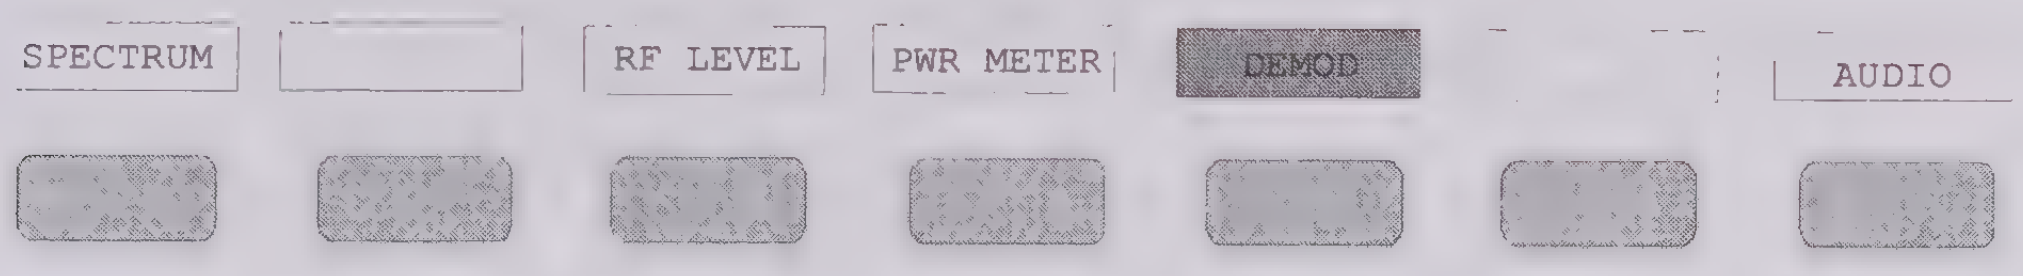

A keystroke activates the associated hotkey. An activated hotkey changes its frame:

Calling and Changing the Menus

The operation of the spectrum analyzer is menu-controlled via keys and softkeys. Various softkey menus are displayed depending on the instrument status. The individual menus constitute the so-called menu tree. The top menu (the root of the menu tree) is always called by means of a keystroke. Arrows at the lower edge of the softkey area indicate whether a supplementary menu can be entered or not. Softkeys with an arrow allow for branching into further menus (so-called submenus): The field "➔" at the lower right side of the softkey area indicates that this menu has a side menu.

The menu change keys on the front panel below the softkey area allow for switching between the main menu and the side menus and submenus.

The *NEXT* key calls the side menu.

The *PREVIOUS* key returns to the next higher menu.

Several menus provide for automatic change, i.e., return to the next higher menu is caused automatically after pressing a softkey.

Selection of a submenu is always effected via a softkey.

The labeling of all softkeys which call a submenu includes a ⇓ arrow.

Setting Parameters

Parameters are set either by simple selection (selection parameters) or by (alpha)numeric entries in data entry windows or tables.

The numeric keypad on the front panel, an external keyboard (optional), a spinwheel and the cursor keys are provided for the entry of instrument parameters in an entry window or in a table.

The external keyboard is optional. If it is not fitted, the help line editor is called automatically for entry of alphanumeric parameters. The help line editor provides for selection of individual letters and a number of special characters which are copied into the actual entry window.

Numeric Keypad

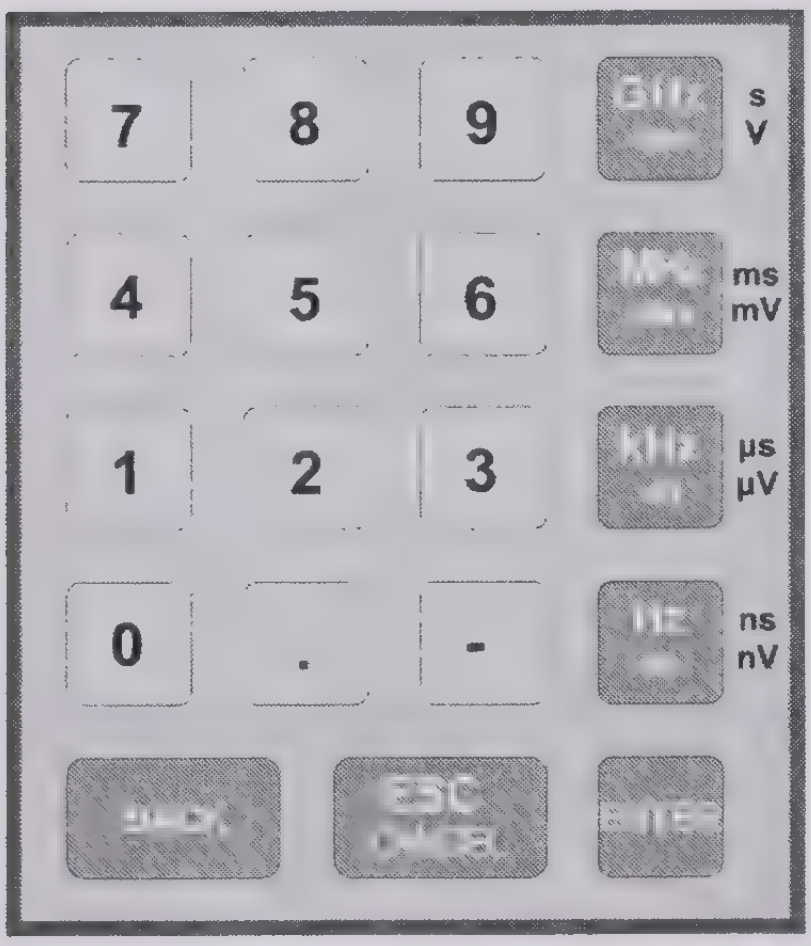

The numeric keypad is provided for entry of numeric parameters. It contains the following keys:

- Number keys 0 to 9
- Decimal point
  Inserts a decimal point "." at the cursor position.
- Sign key
  Changes the sign of the mantissa or exponent of a numeric parameter.
  A "-" is inserted at the cursor position in case of an alphanumeric parameter.
- Unit keys (*GHz/-dBm*, *MHz/dBm*, *kHz/dB* and *Hz/dB*)
  - Provide the numeric value entered with the selected unit and terminate the entry.
    The unit keys are all assigned the value "1" for dimensionless quantities or for level entries (e.g., in dB). The unit keys thus assume the function of an *ENTER* key. The same applies for an alphanumeric entry.
  - Open and close the selection windows of tables.
- *BACK* key
  - Deletes the character left to the cursor with numeric entry.
  - Allows for toggling between the current and the previous values subsequent or prior to entry (UNDO function).
- *ESC/CANCEL* key
  - Aborts the entry before it has been terminated. The previous value is restored.
  - Closes the entry field after termination of input.
  - Closes system messages.
- *ENTER* key
  - Terminates the input of dimensionless quantities. The new value is set.

Note: *The ENTER keys assumes the function of the Hz key for frequency input, and the function of the μs(kHz) key for time input.*

Spinwheel and Cursor Keys

The spinwheel and the cursor keys are arranged besides the numeric keypad.

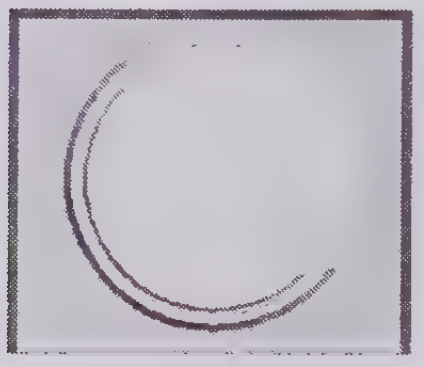

The spinwheel has various functions:

- With numeric entry, the instrument parameter is incremented (turning clockwise) or decremented (turning counterclockwise) at a defined step size.
- In tables, the spinwheel can be used to shift the cursor horizontally or vertically when no entry window is open. The direction (horizontal/ vertical) is switched over using the cursor keys.
- The spinwheel is used with the help-line editor to select the individual letters.
- It can be used to shift markers, display lines, limit lines etc.
- Pressing the spinwheel terminates the input of parameters.

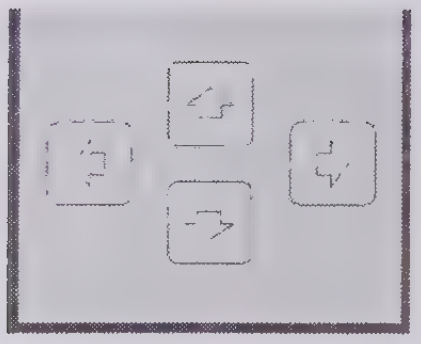

In tables, the cursor keys are used to shift the cursor between the lines and columns of the table.

The keys ⇦ and ⇨ are used to shift the cursor inside the entry window to reach a particular position in the string.

The keys ⇧ and ⇩

- increase or decrease the value of a parameter for numeric input .
- switch between editing line and help line editor for alphanumeric input.

Selection and Setting of Parameters via Keys or Softkeys

The selection of parameters and their settings is effected by means of a key, a softkey or in a table depending on the hierarchical level of the menu they are assigned to. Selection and setting of parameters in tables is described in section "Selection and Setting of Parameters in Tables" .

Selection via key

Most keys of the network analyzer are used to enter menus where the selection and the settings are made. Few settings can be made directly by means of a keystroke, only.

Example: Call up of preset settings

- Press *PRESET* key

  The spectrum analyzer is brought into a predefined initial state.

Selection via softkey

In most cases the selection is made by pressing the respective softkey. There are various alternatives of making the selection:

1. The softkey is active or inactive.

Example: Switching on/off the frequency counter

- Press *MKR* key.
- Press *SIGNAL COUNT* softkey.

  Each time the softkey is pressed, the marker info list is switched on or off. If the softkey is active (= marker info list on), it is illuminated.



2. The softkey acts like a toggle switch, each pressing changes the active selection.

Example: Selection of the reference (internal or external)

- Press *SETUP* key.
- Press *GENERAL SETUP* softkey, the *GENERAL SETUP* submenu is opened.
- Press *REFERENCE INT/EXT* softkey.

  With each pressing, the checkmark on the softkey changes from INT (internal reference) to EXT (external reference) and vice versa. When in the active setting the softkey menu item is illuminated.

3. Various softkeys act like selection switches. Only one softkey may be active at a time.

Example: sweep setting

➢ Press *SWEEP* key.

➢ Press *CONTINUOUS SWEEP* softkey.

The continuous sweep is thus set. The *CONTINOUS SWEEP* softkey is colored (factory-set: green). The second alternative, a series of n sweeps according to the trigger definition, can be selected via the *SINGLE SWEEP* softkey in the same menu. Only one of the two softkeys can be active at a time, the softkeys thus act like selection switches.

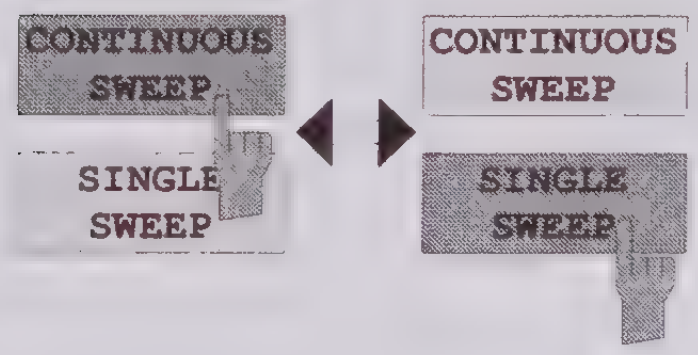

4. The softkey is used to select the parameter, the setting is made in an alphanumeric data entry window.

Example: SWEEP COUNT parameter

➢ Press *SWEEP* key

➢ Press *SWEEP COUNT* softkey.

The window for entering the number of sweeps for the SINGLE SWEEP mode is opened. The softkey is colored (factory-set: red). (Data entry is described in the next section).

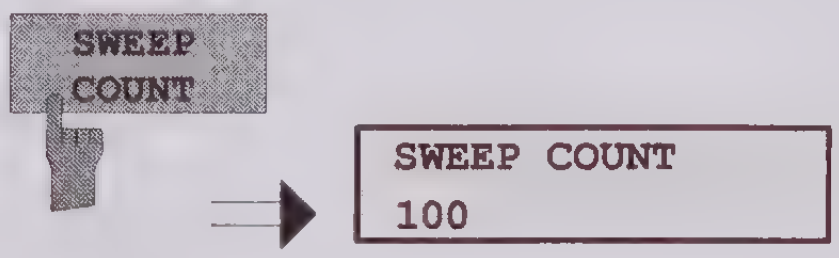

4. The softkey is used to select the parameter, the setting is made in an (alpha)numeric data entry window. The softkey function is switched on. To switch off the function, the softkey has to be pressed again.

Example: parameter MARKER

- ➢ Press *MRK* key.
- ➢ Press *MARKER 1* softkey.

The window for entering the marker frequency is opened. The softkey is colored (factory set: red). Marker 1 is switched on and the peak search is started.

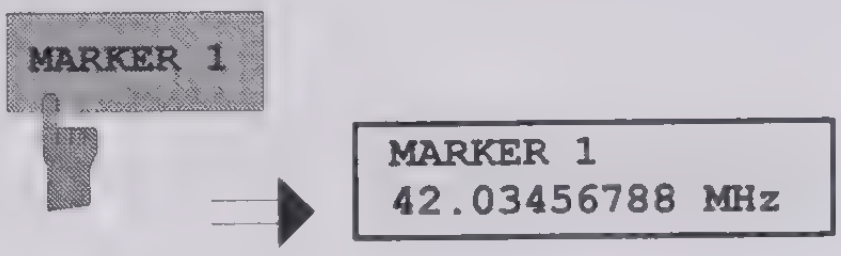

MARKER 1
42.03456788 MHz

- ➢ Press *MARKER 2* softkey.

The entry window for the marker frequency of marker 2 is opened. The softkey is colored (red), marker 2 is switched on, and the *MARKER 1* softkey turns green.

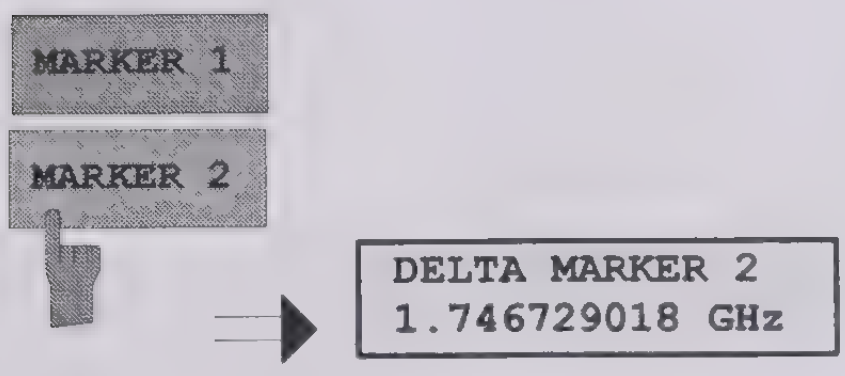

DELTA MARKER 2
1.746729018 GHz

- ➢ Press *MARKER 1* softkey again.

Marker 1 is switched off.

5. The softkey selects the parameter, the setting is made in a selection table.

Example: Selection of the sorting criteria of a file list

- ➢ Press *FILE* key.
- ➢ Press *FILE MANAGER* softkey.
- ➢ Press *SORT MODE* softkey.

A selection table is displayed. The softkey is colored (factory-set: red). (operation see below).

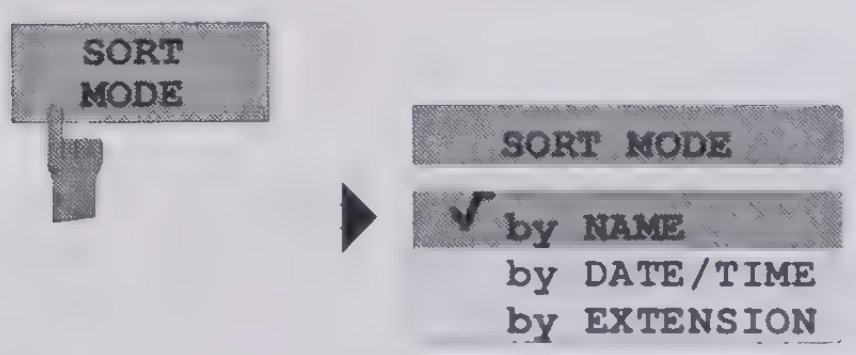

SORT MODE
✓ by NAME
by DATE/TIME
by EXTENSION

Editing of Numeric Parameters

The entry of numeric values is always made in a data entry window, which is displayed automatically after selection of the parameter.

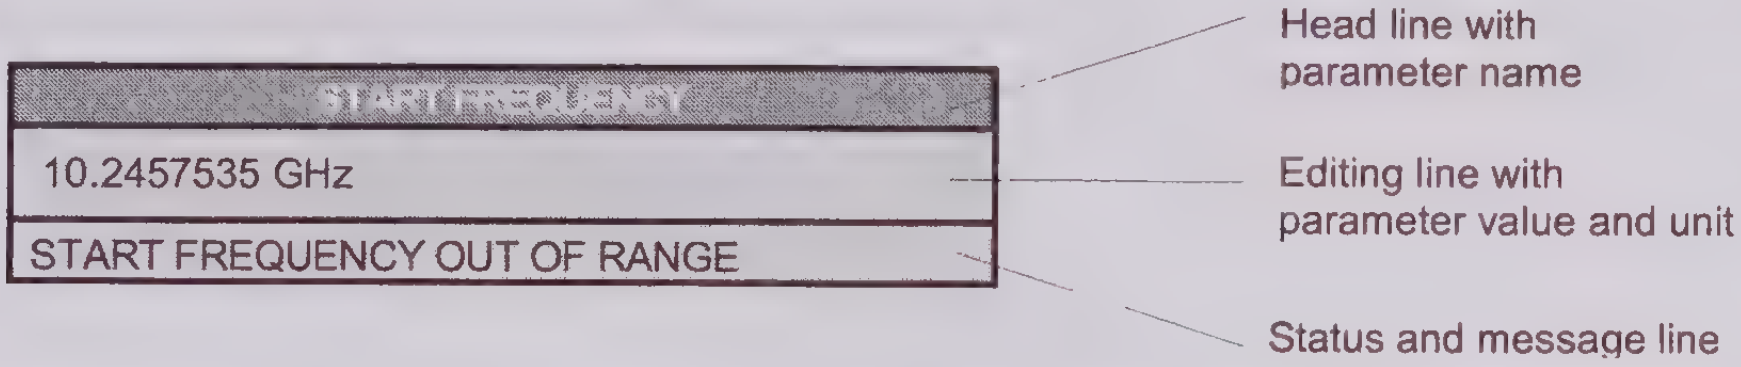
START FREQUENCY
10.2457535 GHz
START FREQUENCY OUT OF RANGE
Head line with parameter name
Editing line with parameter value and unit
Status and message line

The headline indicates the name of the instrument parameter, which has been selected. The entry is made in the editing line. Subsequent to calling the entry window, the current parameter value including the unit is displayed left-justified in the editing line. Status and error messages which refer to the current entry are displayed in the third and (optionally) fourth line.

Note: *Entry windows may be represented transparent (cf. DISPLAY - CONFIG DISPLAY menu)*

Entry of a numeric value

- ➢ Call data entry window (cf. selection of parameters) The editing line indicates the current value

Example: center frequency (frequency-sweep mode)

Entry via number keys

- ➢ Enter required value via number keys.

Example:

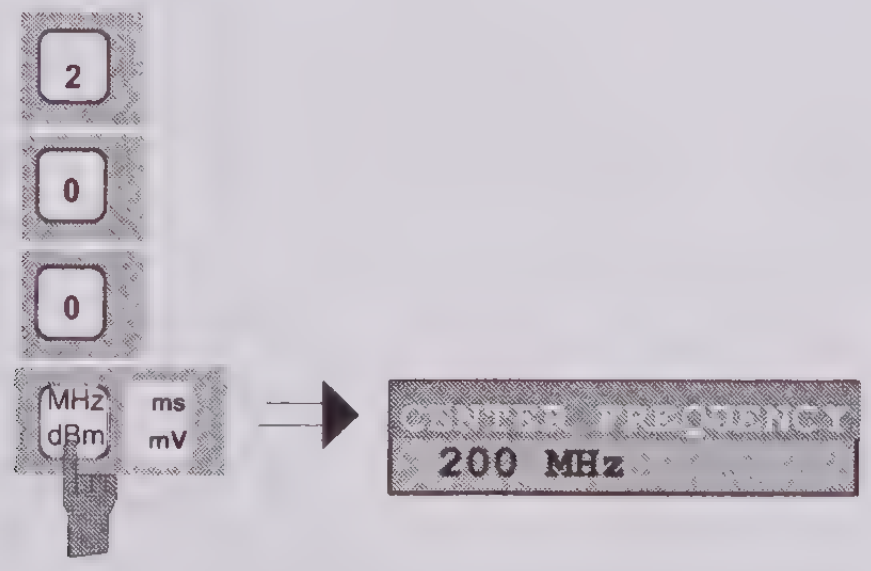

Entry via cursor keys

- ➢ Cursor ⇧ or ⇩ until obtaining the required value.

Example:

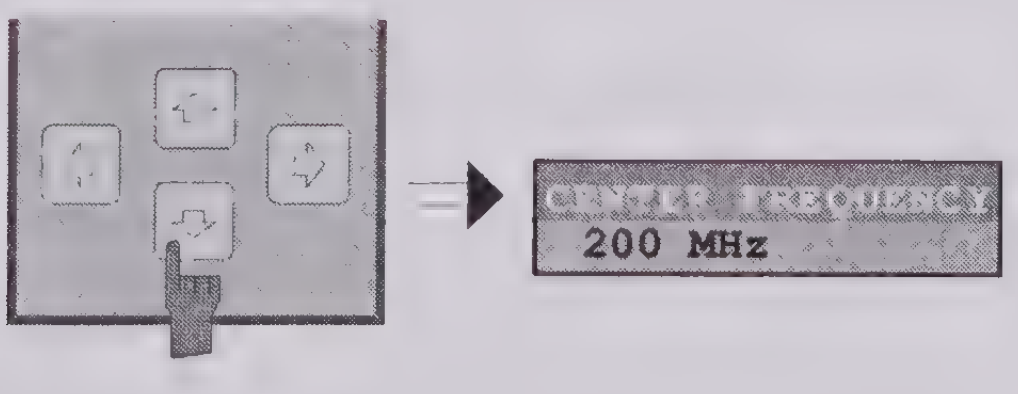

Entry via spinwheel

- ➢ Rotate the spinwheel until reaching the required value.

  The variation step size increases with increasing rotational speed.

  Turning the spinwheel clockwise increases the value, turning it counterclockwise decreases the value.

Example:

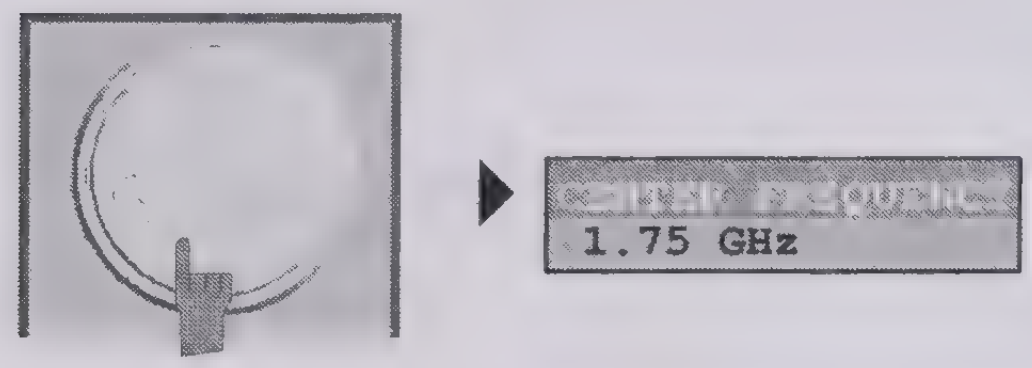

CENTER FREQUENCY
1.75 GHz

Note: *When the value is modified by means of the spinwheel or the cursor keys the new value is immediately set.*

Terminating the entry

- ➢ Press one of the unit keys

  The unit is entered in the entry window and the new setting is accepted by the instrument.

For dimensionless quantities:

- ➢ Press the ENTER key or the spinwheel

  The new setting is accepted by the instrument.

  A few data entry windows close automatically whereas others like the entry window for the start frequency remain open even after termination of the entry. They can be closed by pressing the *ESC* key.

  If an error occurs, a corresponding error message is displayed in the status line of the entry window, e.g., "Out of range", "Value adjusted", etc. In this case, the new value is not accepted for the instrument setting.

Example:

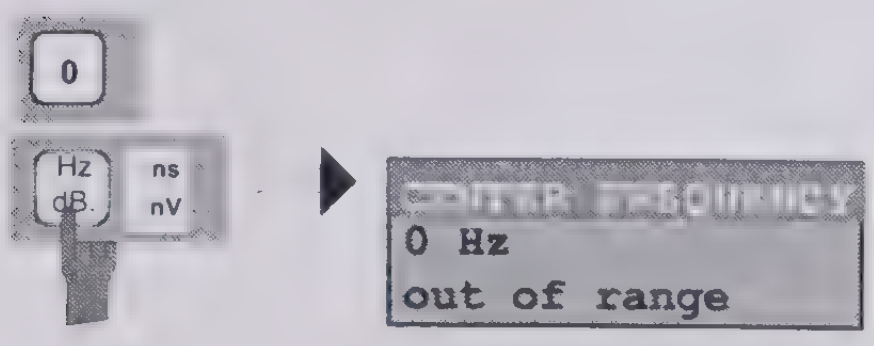

CENTER FREQUENCY
0 Hz
out of range

Correcting the entry

Deleting an entry

- ➢ Position the cursor beside the digit which is to be deleted using the cursor keys ◊ or ◊.
- ➢ Press the *BACK* key. The entry left to the cursor is deleted.
- ➢ Enter new numbers. The number is inserted to the left of the cursor, the other numbers are shifted right.

Restoring the original value

- Press the *BACK* key

  For numerous parameters, the data administration of the instrument stores the previously valid parameter value in addition to the current value. The BACK key can be used to toggle between these two values. This applies for terminated entries as long as the data entry window is displayed.

Aborting the entry

- Press *ESC* key

  The original parameter value is restored. The new entry is deleted.

- Press *ESC* key again

  The entry window is closed, the original value remains active.

or

- Press any key or any softkey (even the softkey which has opened the entry window).

  The entry is aborted and the entry window is closed. The original value remains active.

Entry of Alphanumeric Parameter

A help-line editor or an external keyboard (optional) are provided for the entry of alphanumeric instrument parameters.
The spinwheel and the exponent key have no function with alphanumeric entry. All unit keys assume the function of an ENTER key.

The entry is always made in a data entry window which is displayed automatically upon selection of the parameter. The editing line comprises 60 characters. Up to 256 characters may be entered. If a text exceeds 60 characters the contents is shifted automatically 20 characters left or right when the left or right margin of the editing line is touched by the cursor.

Editing with External Keyboard



BANDPASS-FILTER TEST 23A

Entry of text

- ➢ Select parameter.
  The data entry is active automatically upon calling the data entry window. The cursor is positioned at the beginning of the previous entry.
- ➢ Press the required character on the keyboard.
  The character is inserted prior to the cursor.
- ➢ Enter further characters

Correcting the entry

- ➢ Delete the entry using the *DELETE* key or *BACKSPACE* key.

Terminating the entry

- ➢ Press the *ENTER* key of the external keyboard
  The data entry window is closed and the new value is accepted for the instrument.

Aborting the entry

- ➢ Press the **ESC** key on the front panel

or

- ➢ any softkey.

The data entry window is closed, the original value is retained.

Editing with Help Line Editor

If the external keyboard is not fitted, the help line editor is called automatically with entry of alphanumeric parameters. The help line editor is an extension of the alphanumeric entry window. It contains the complete alphabet with uppercase and lowercase letters as well as special characters in two lines of 52 characters, each. Individual letters and a series of special characters can be selected in the help line editor and copied into the entry line.

The help line editor comes in two versions:

Version 1:

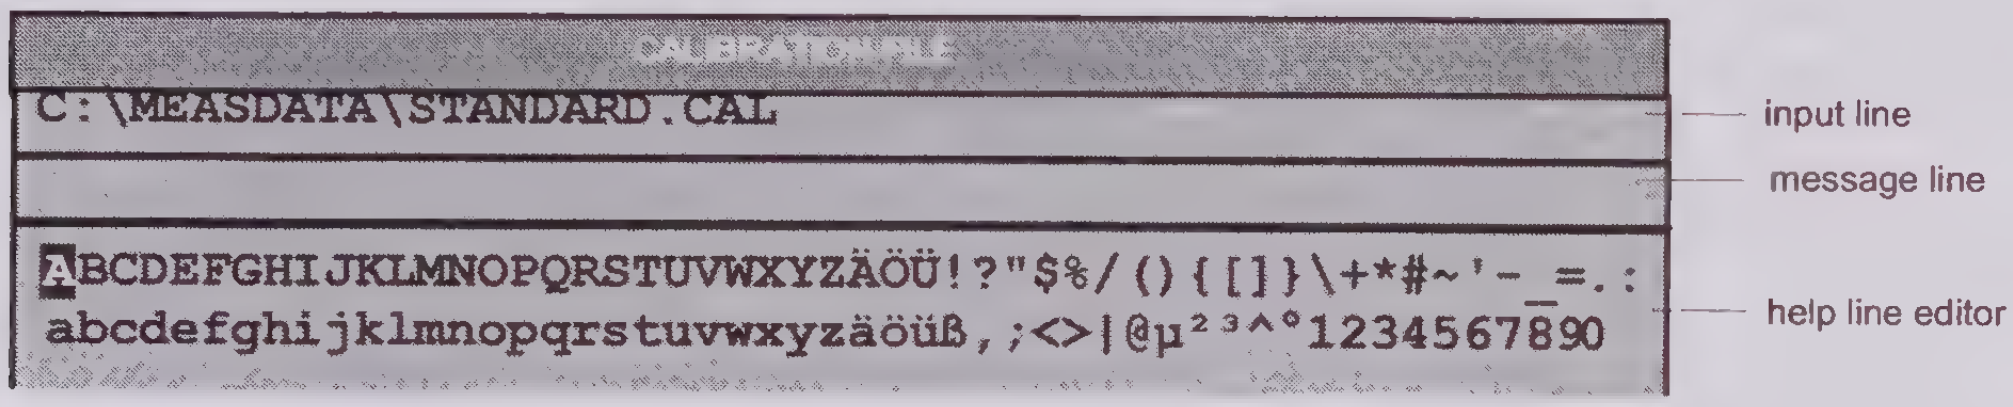

CALIBRATION FILE

C:\MEASDATA\STANDARD.CAL

ABCDEFGHIJKLMNOPQRSTUVWXYZÄÖÜ!?"$%/(){[]}\+*#~'-_=.:
abcdefghijklmnopqrstuvwxyzäöüß,;<>|@µ²³^°1234567890

The cursor keys ⇧ or ⇩ toggle between entry in the editing line and selection in the help line editor.

Entry of text

- ➢ Select parameter.
  The data entry is active automatically upon calling the data entry window. The cursor is positioned on the left in the editing line.
- ➢ Position the cursor in the help line editor using the cursor key. ⇩
  The cursor marks the first letter of the editor.
- ➢ Locate the cursor on the character which is to be entered into the editing line using the cursor keys ⇦ or ⇨ or the spinwheel.
- ➢ Press the *ENTER* key or the spinwheel
  The character is entered in the editing line.

Correcting the entry

- ➢ Locate the cursor in the editing line using the cursor key ⇧.
- ➢ Position the cursor after the character which is to be deleted using the cursor keys ⇦ and ⇨.
- ➢ Press the *BACK* key.
  The entry left to the cursor is deleted.

Terminating the entry

- ➢ Locate the cursor in the editing line using the cursor key ⇧ .
- ➢ Press any unit key or the spinwheel.
  The data entry window is closed, the new entry is accepted by the instrument.

Aborting the entry

- ➢ Press the *CLR* key.
  The data entry window is closed, the previous entry is retained.

Version 2:

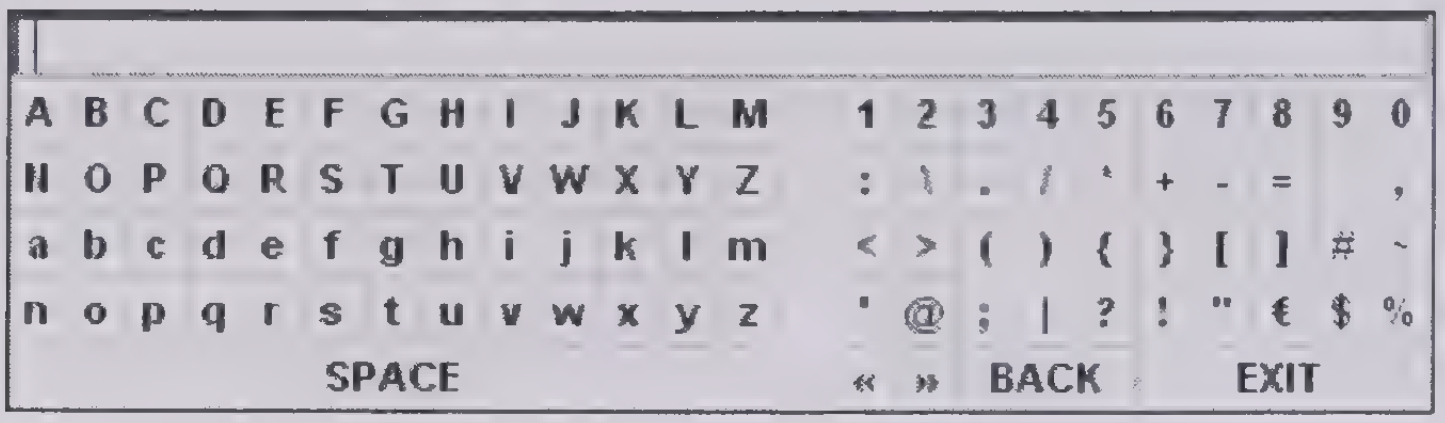
A B C D E F G H I J K L M 1 2 3 4 5 6 7 8 9 0
N O P Q R S T U V W X Y Z : \ . / * + - = ,
a b c d e f g h i j k l m < > ( ) { } [ ] # ~
n o p q r s t u v w x y z ' @ ; | ? ! " € $ %
SPACE
« » BACK EXIT

The entry area consists of two parts:

- the editing line
- the character selection field

The cursor keys ⇧ or ⇩ are used to toggle between entry in the editing line and the character selection field .

Entry of text

- Select parameter.
  The data entry is active automatically upon calling the data entry window. In tables, the help line editor is accessed by the cursor key ⇩ .
  In the editing line, the cursor is positioned at the beginning of the current entry.
- Position the cursor to the character selection field using the cursor key ⇩ .
  The cursor highlights the first letter of the editor.
- Position the cursor to the character to be entered in the editing line by means of the cursor keys ⇦ or ⇨ or the spinwheel.
- Press the *ENTER* key or the spinwheel.
  The character will be entered in the editing line.

Correcting the entry (Version 1)

- Move to the character << in the character selection field using the spinwheel.
- Position the cursor behind the character to be deleted by moving and pressing the spinwheel on << and >>.
- Move to the *BACK* field using the spinwheel and press the spinwheel.
  The entry to the left of the cursor in the editing line will be deleted.

Correcting the entry (Version 2)

- ➢ Position the cursor to the editing line by means of the cursor key ⇦ .
- ➢ Position the cursor after the character to be deleted by means of the cursor keys ⇦ and ⇨ or with the spinwheel.
- ➢ Press the *BACK* key.
  The entry to the left of the cursor will be deleted.

Terminating the entry (Version 1)

- ➢ Select the EXIT field using the spinwheel and press the spinwheel.
  The data entry window will be closed; the new entry will be accepted by the instrument.

Terminating the entry (Version2)

- ➢ Move the cursor to the editing line using the cursor key ⇧ .
- ➢ Press one of the unit keys or the spinwheel.
  The data entry window will be closed; the new entry will be accepted by the instrument.

Interrupting the entry

- ➢ Press the *ESC* key.
  The data entry window will be closed; the previous entry will be retained.

Selection and Setting of Parameters via Tables

The spectrum analyzer uses numerous tables for display and configuration of instrument parameters.

The tables differ considerably in the number of lines, columns and inscriptions. The basic steps of operation for the selection and setting of parameters are, however, the same for all tables. Shown below is the typical entry of parameters into a table.

Note:

Most of the tables are coupled to a softkey menu which provides further functions for editing table entries such as deletion of tables, copying of lines or columns, marking of table elements, restoring default states.

The definition of individual tables and the operation of particular editing functions can be looked up in the description of the corresponding softkey menu.

1. Activating the table

- If the menu has only one table, the latter is activated automatically subsequent to calling this menu in most cases and the marking cursor is positioned to the top field of the left column.
- If the menu contains various tables, the table of interest must be selected using the softkey which is labeled with the title of the table.

2. Selection of the parameter

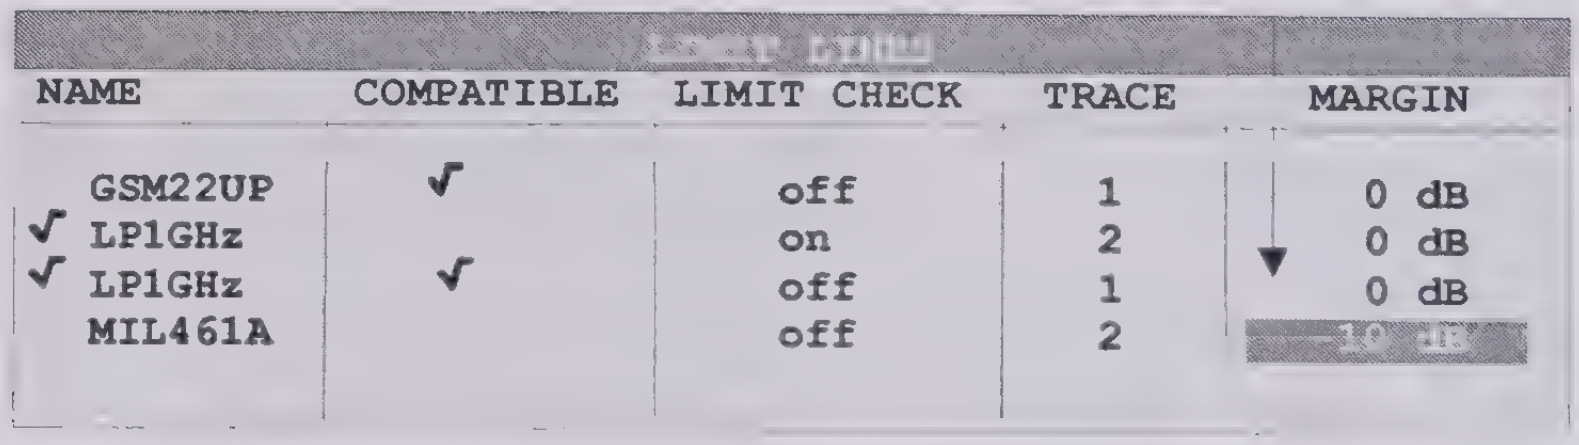

marking cursor

LIMIT LINES

NAME	COMPATIBLE	LIMIT CHECK	TRACE	MARGIN
GSM22UP	✓	off	1	0 dB
✓ LP1GHz		on	2	0 dB
✓ LP1GHz	✓	off	1	0 dB
MIL461A		off	2	-10 dB

Selection of the parameter (or the setting) is made using the marking cursor.

➢ Press the cursor keys to move to the wanted field.

or

➢ Rotate the spinwheel until the wanted field is marked. The cursor keys are used to specify the direction of the spinwheel movement (horizontal or vertical)

When shifting the cursor, elements may be skipped which can not be edited. Table elements, which can not be selected are indicated by a different color.

- ➢ Press the *ENTER* key or the spinwheel.
  The parameter/the setting has been selected.

  The selected parameter can be edited the way described below:

3. Editing the marked parameter

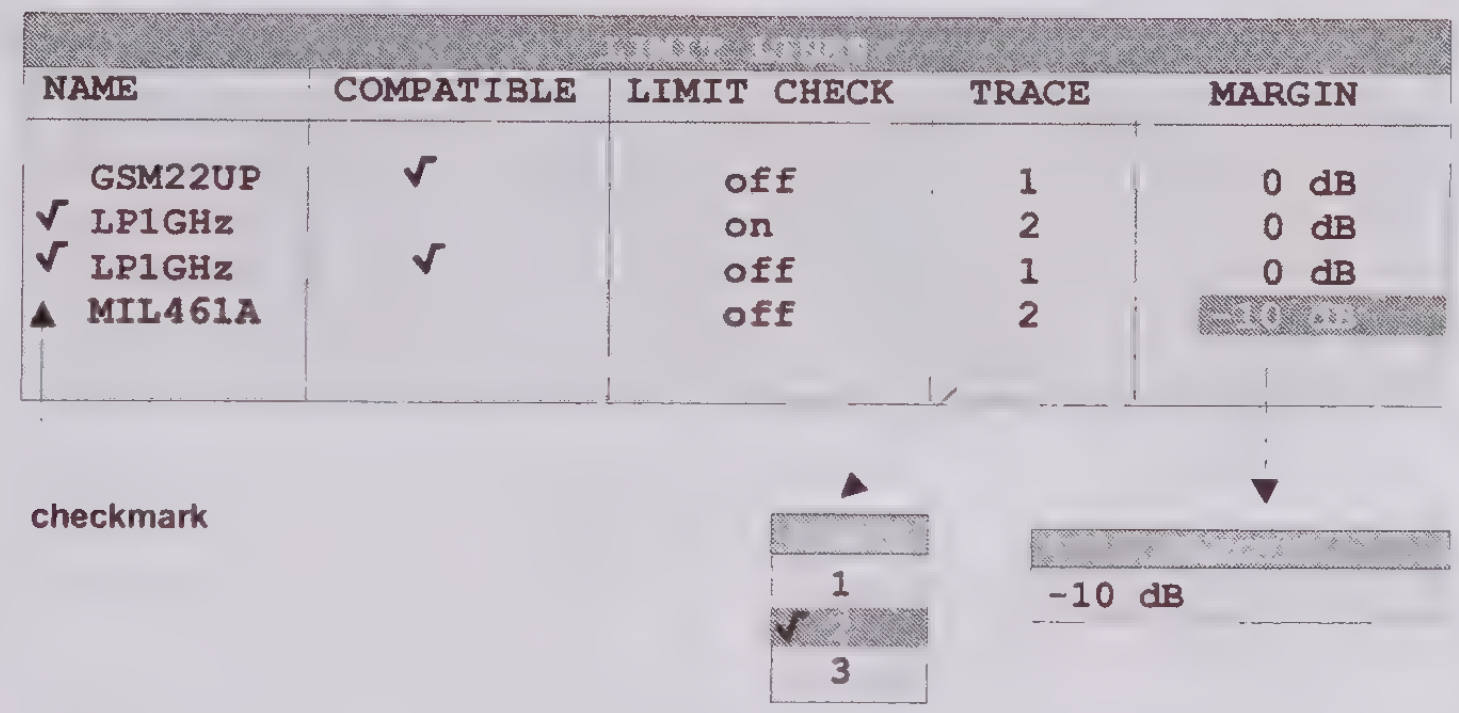

LIMIT LINES

NAME	COMPATIBLE	LIMIT CHECK	TRACE	MARGIN
GSM22UP	✓	off	1	0 dB
✓ LP1GHz		on	2	0 dB
✓ LP1GHz	✓	off	1	0 dB
▲ MIL461A		off	2	-10 dB

a) Toggling between two states

If an element of a table can be switched on and off only, the unit keys are used to toggle between these two states.

- ➢ Press one of the unit keys.
  The table element is switched on and provided with a checkmark. (√).
- ➢ Press one of the unit keys once more.
  The table element is switched off.

or

- ➢ Press one of the unit keys.
  The table element is switched on, "on" is displayed.
- ➢ Press one of the unit keys once more.
  The table element is switched off, "off" is displayed

b) Opening a data entry window

If a table entry consists of an (alpha-) numeric value, the corresponding entry window will be opened after selecting the numeric value by pressing the *ENTER* key or the spinwheel.

Note 1: *For numeric instrument parameters, the editing operation may be started by entering any number or letter on the front panel or on the external keyboard. In this case, the data entry window is opened automatically.*

Note 2: *For alphanumeric table fields for which the help line editor version 2 is required, the help line editor will be opened by pressing the CURSOR DOWN key after ENTER.*

c) Opening a selection table

If a table entry may have various states (e.g., colors from a color pallet, fixed filter bandwidths, etc.), a table indicating all possible states is displayed with selection. The current state is and marked by a checkmark and by the cursor.

- Set the cursor to the desired setting.
- Press one of the unit keys.
  The setting is switched on and marked (√). The selection table closes and the value is transferred to the original table. The cursor is positioned automatically on the next table element.

Abortion of entry

- Press the *ESC* key.

The current entry/selection is aborted and the original setting is restored.

Scrolling

Some tables contain more entries than can be displayed on one screen page. In this case, a **scrollbar** is displayed at the right margin of the table, whose slider shows the current position in the text.

- Actuate the *PAGE UP* or *PAGE DOWN* softkeys.

The table is paged forward or back by one page.

- Press cursor key ⇧ or ⇩.

The table is scrolled up or down by one line.

Menu Overview Receiver Mode

The following sections gives a graphical overview of the R&S FSMR menus. Side menus are marked by an arrow directed to the left/right, submenus by an arrow showing upwards.
The menus appear in the order corresponding to the arrangement of keys on the front panel. The available hotkeys and the LOCAL menu appearing during the remote control of the instrument are also displayed.

The functions of menus are described in detail in Chapter 4. The IEC/IEEE-bus command associated with each softkey is indicated. In addition, the softkey list at the of Chapter 6 gives the assignment of IEC/IEEE-bus commands to softkeys.

FREQENCY Key

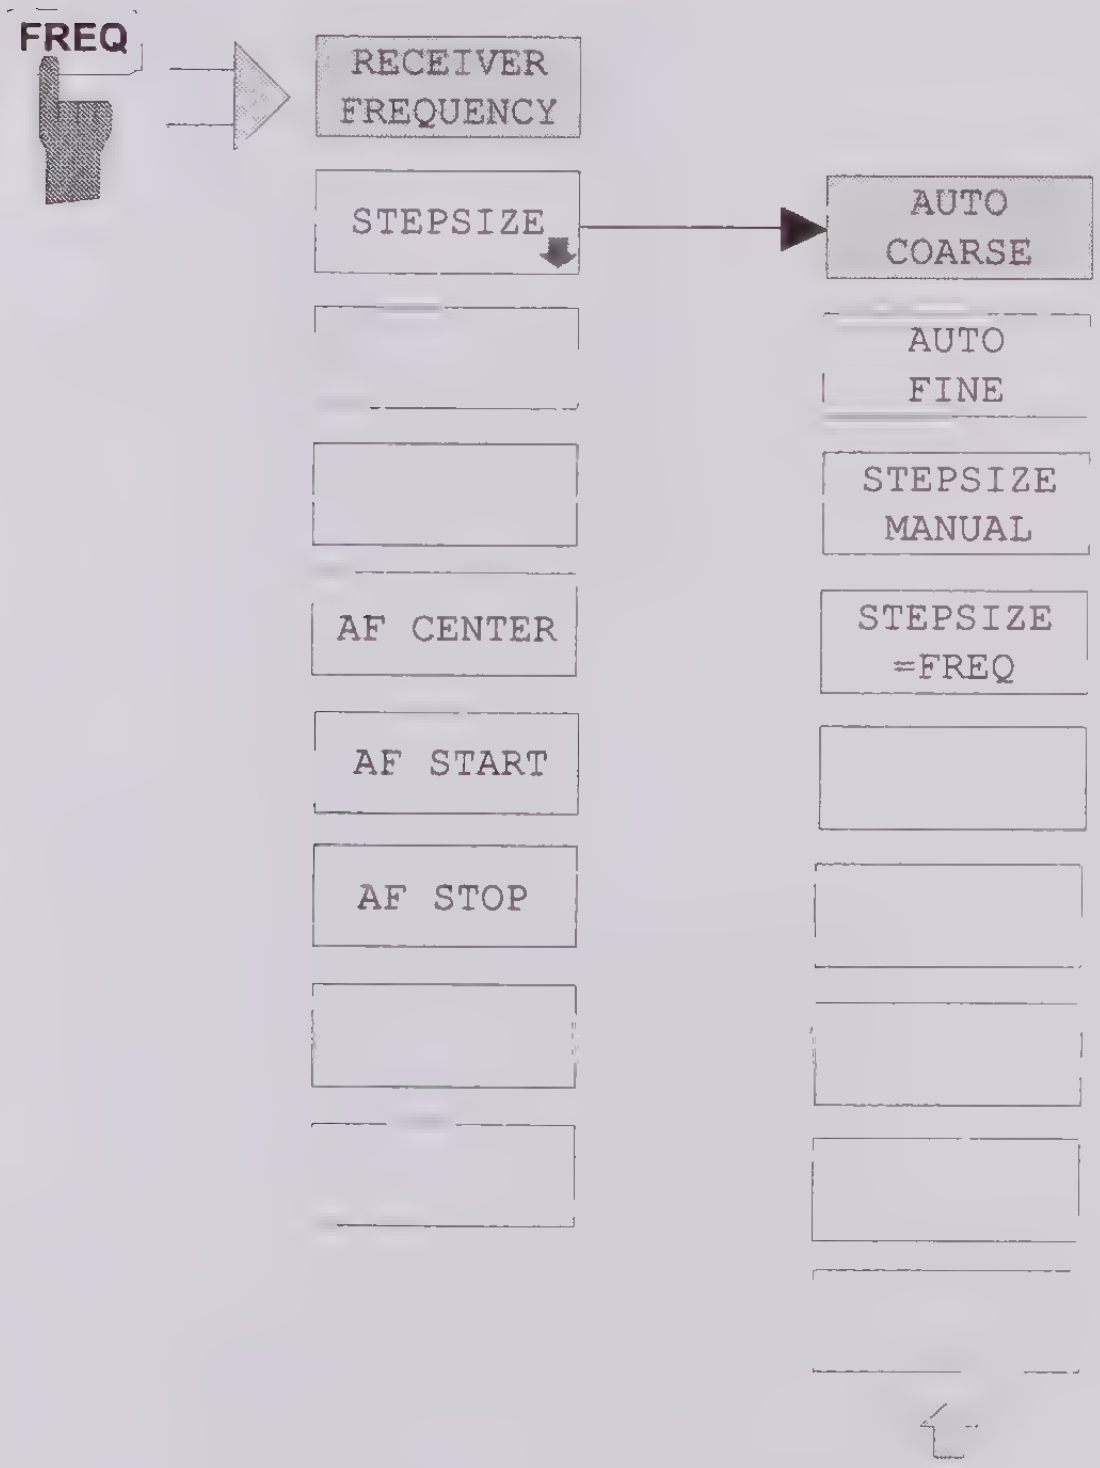

SPAN Key

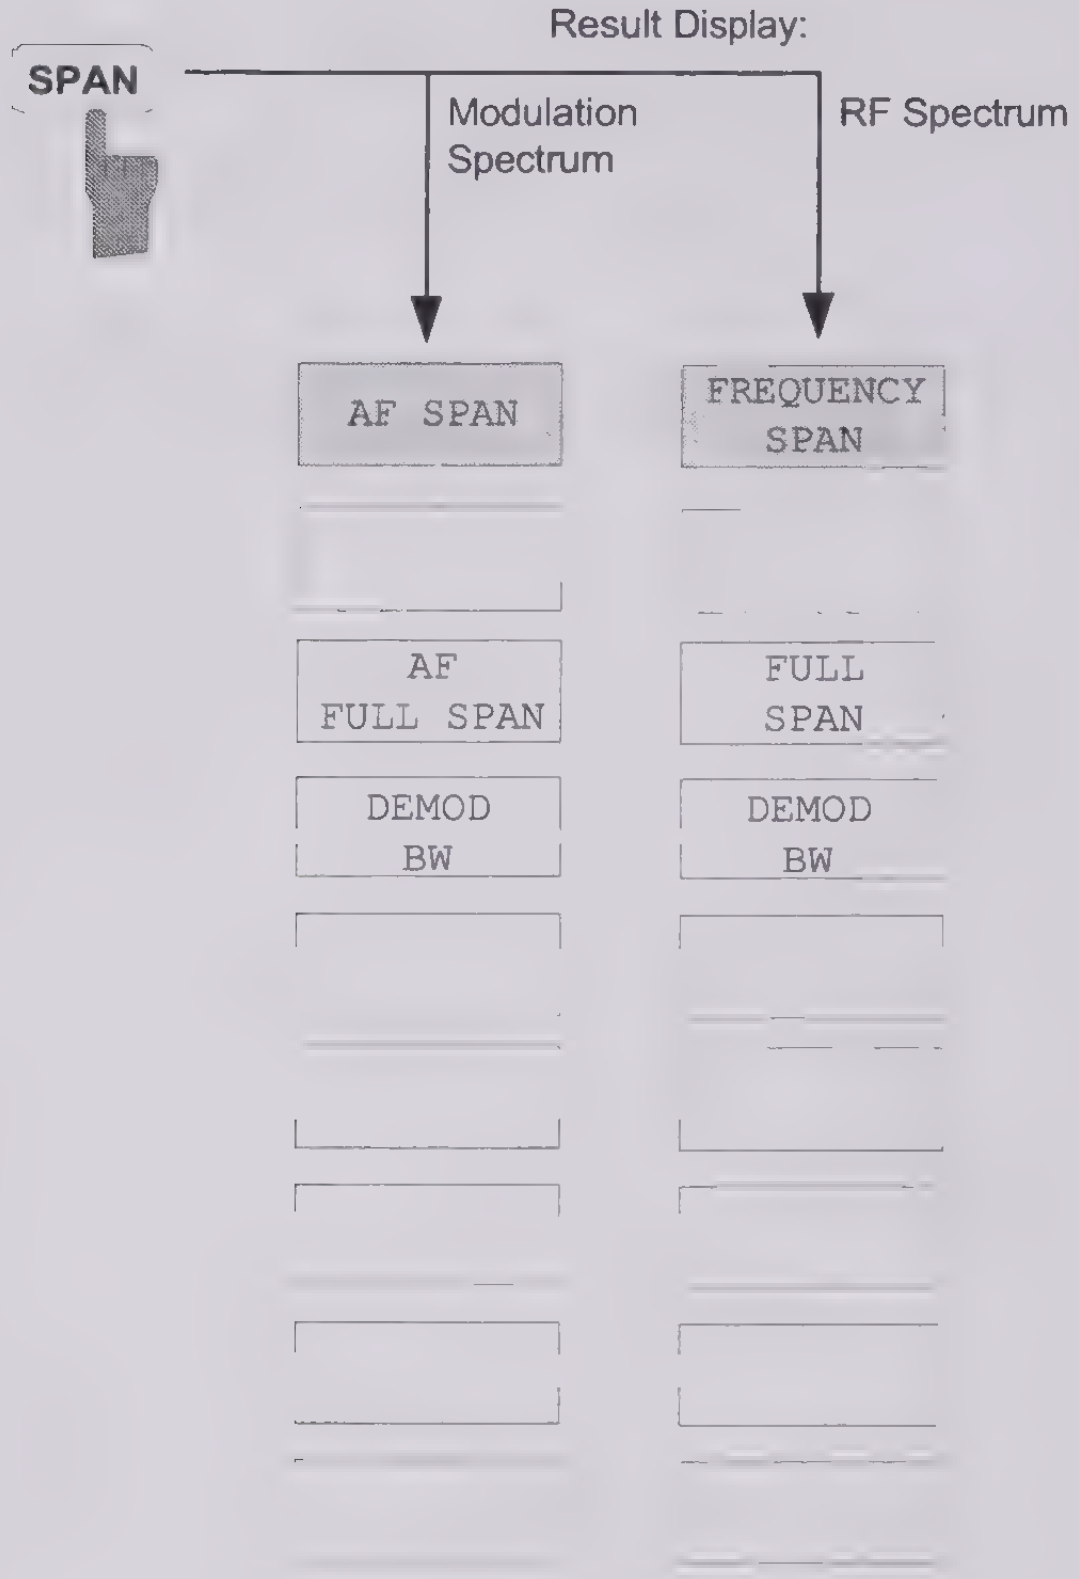
SPAN
Result Display:
Modulation Spectrum
RF Spectrum
AF SPAN
AF FULL SPAN
DEMOD BW
FREQUENCY SPAN
FULL SPAN
DEMOD BW

AMPT Key

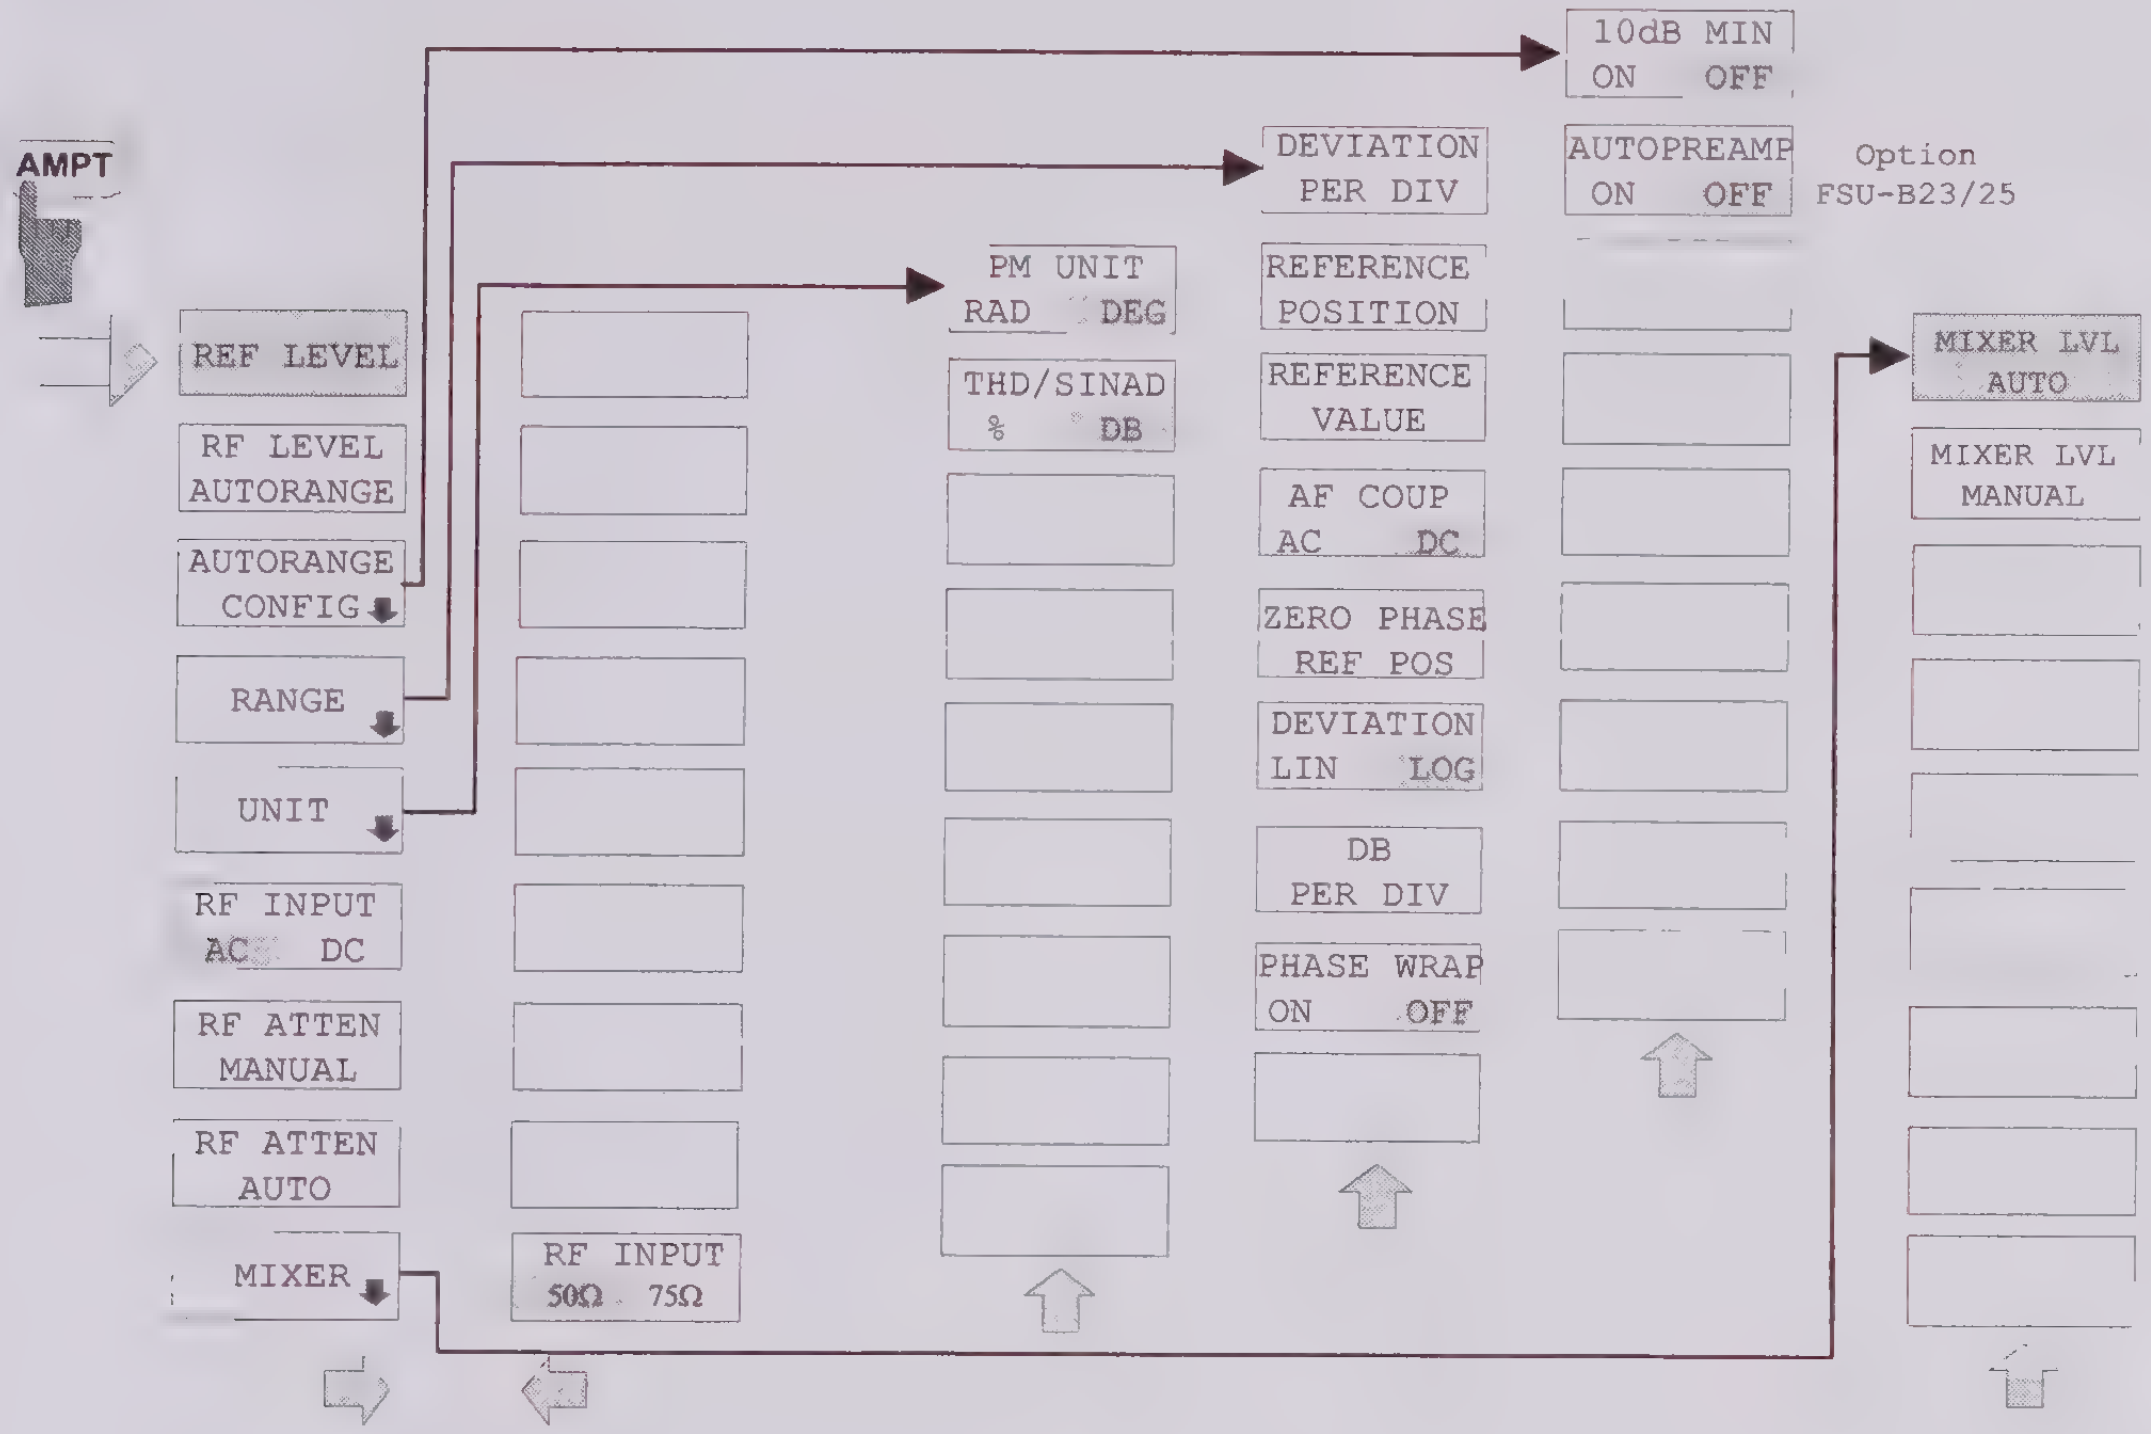
AMPT
REF LEVEL
RF LEVEL AUTORANGE
AUTORANGE CONFIG
RANGE
UNIT
RF INPUT AC DC
RF ATTEN MANUAL
RF ATTEN AUTO
MIXER
RF INPUT 50Ω 75Ω
PM UNIT RAD DEG
THD/SINAD % DB
DEVIATION PER DIV
REFERENCE POSITION
REFERENCE VALUE
AF COUP AC DC
ZERO PHASE REF POS
DEVIATION LIN LOG
DB PER DIV
PHASE WRAP ON OFF
10dB MIN ON OFF
AUTOPREAMP ON OFF
Option FSU-B23/25
MIXER LVL AUTO
MIXER LVL MANUAL

BW Key

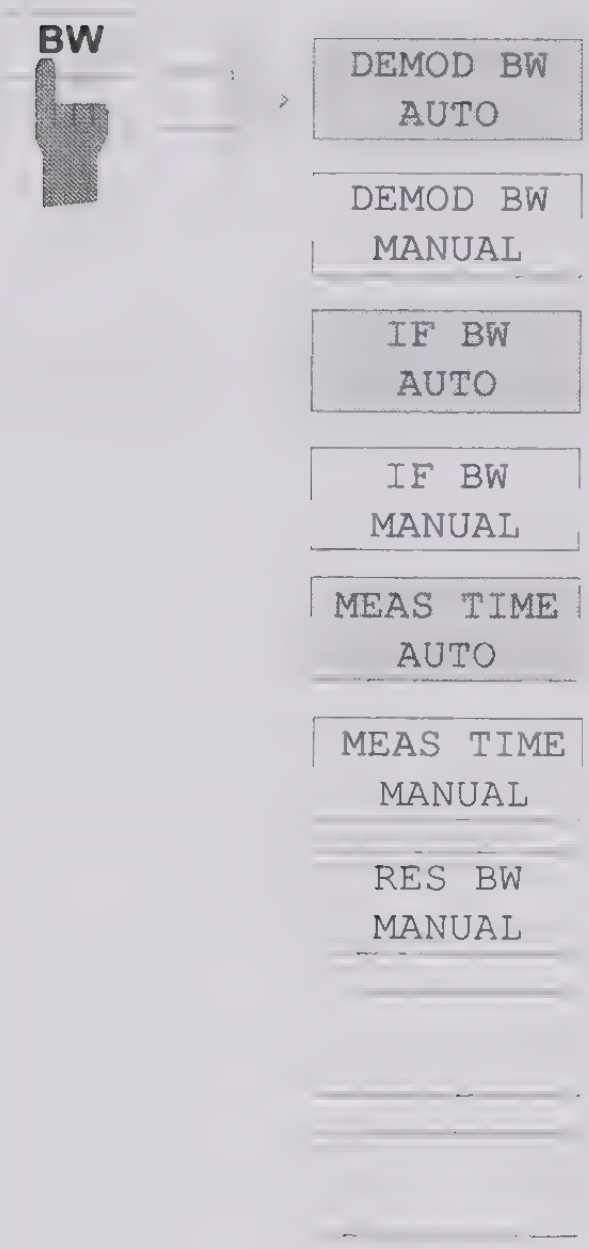
BW
DEMOD BW AUTO
DEMOD BW MANUAL
IF BW AUTO
IF BW MANUAL
MEAS TIME AUTO
MEAS TIME MANUAL
RES BW MANUAL

SWEEP/MEAS Keys

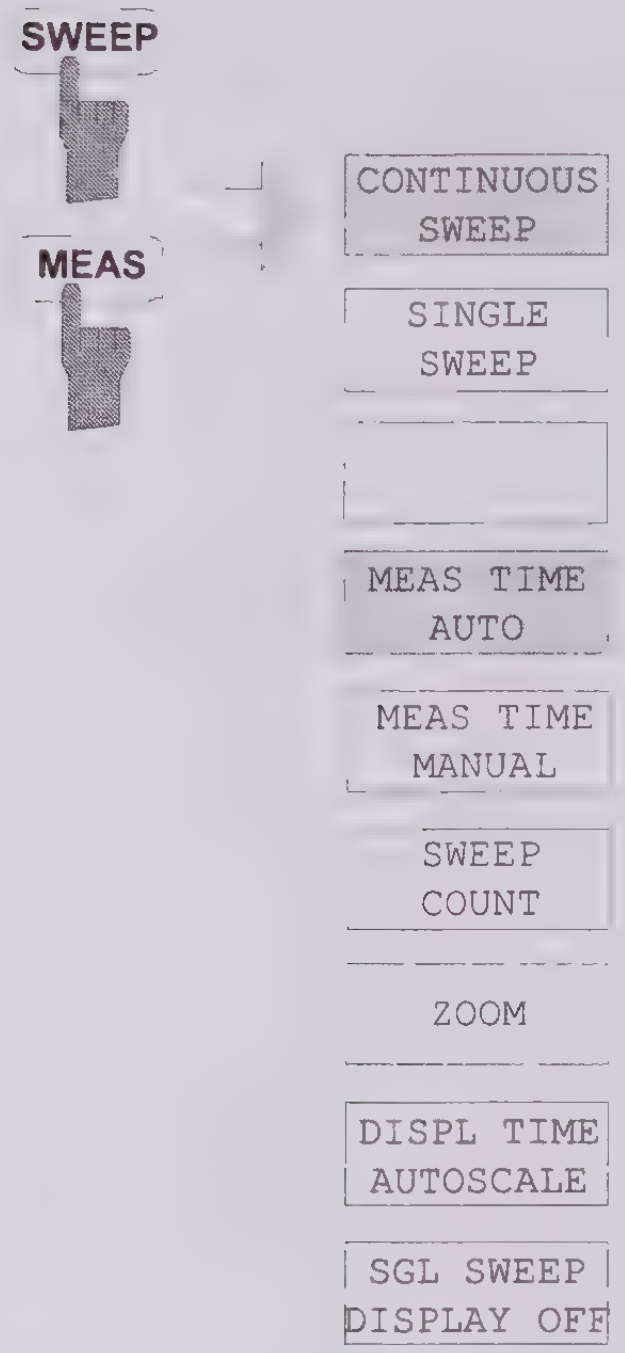

Hotkey Menus

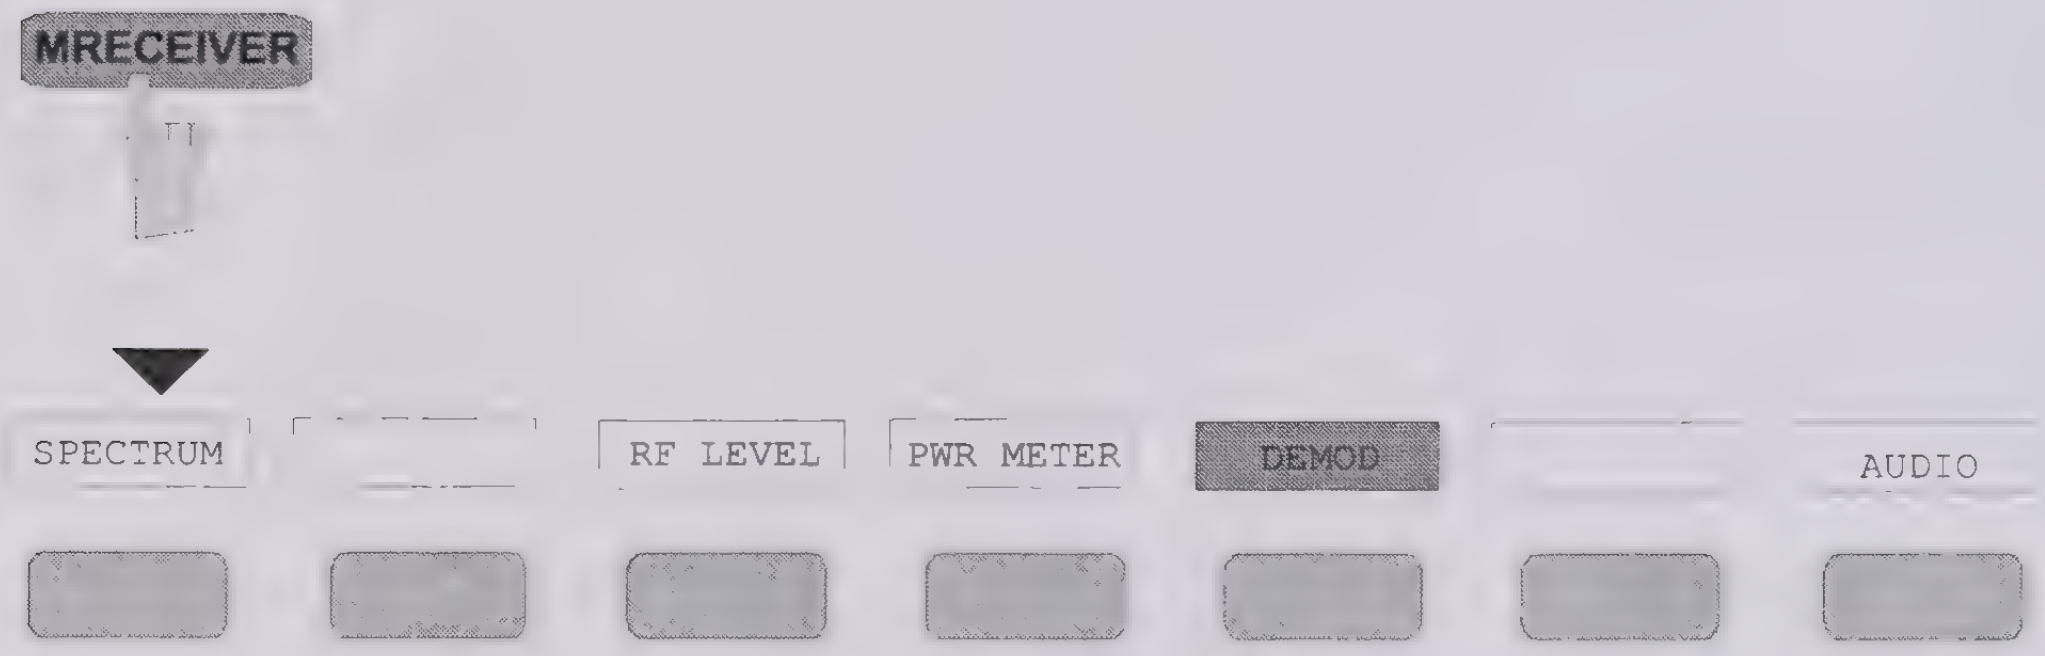

RF LEVEL Key

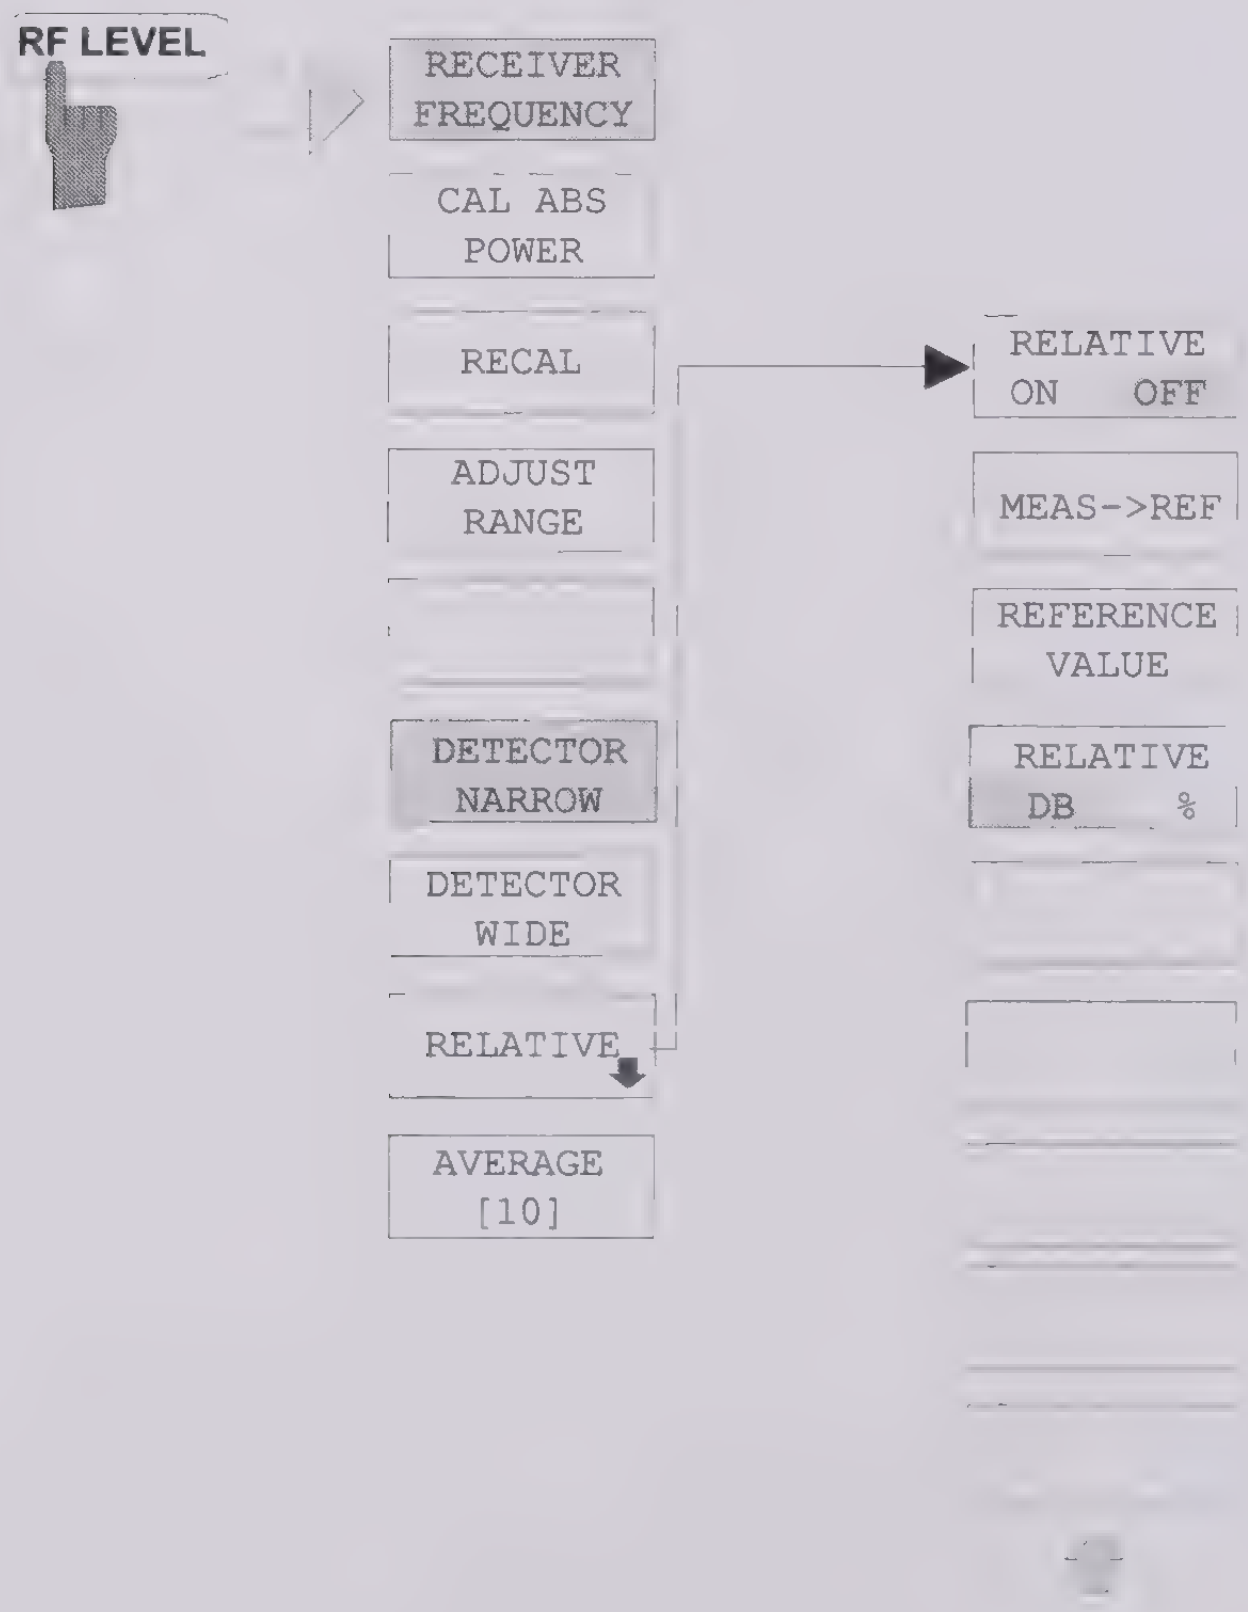

PWR METER Key

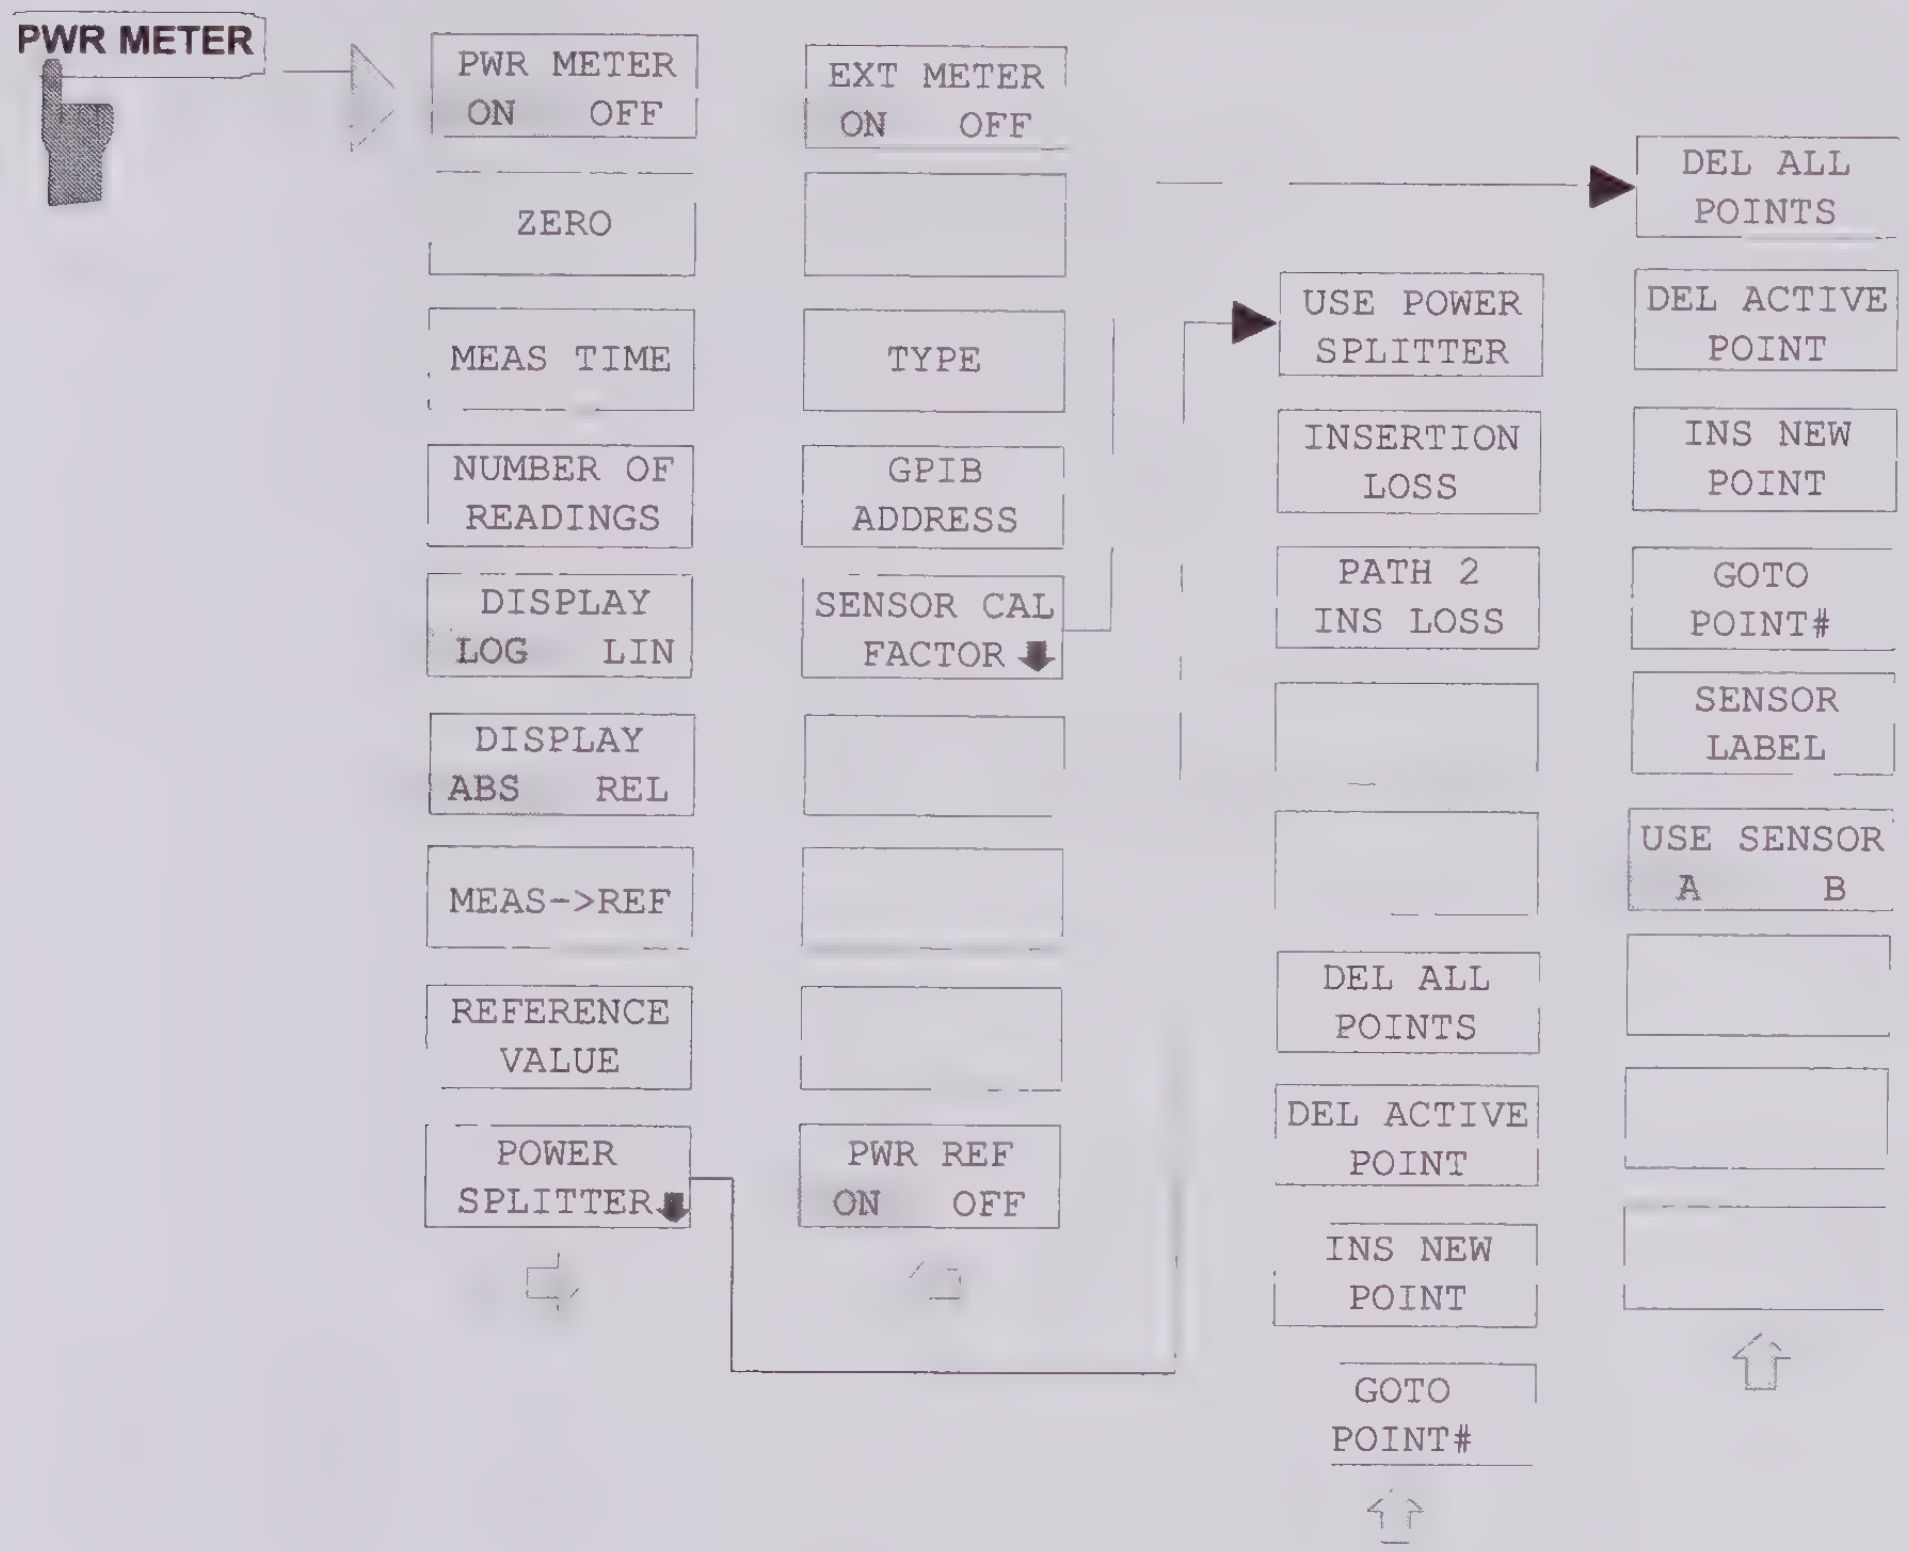

DEMOD Key

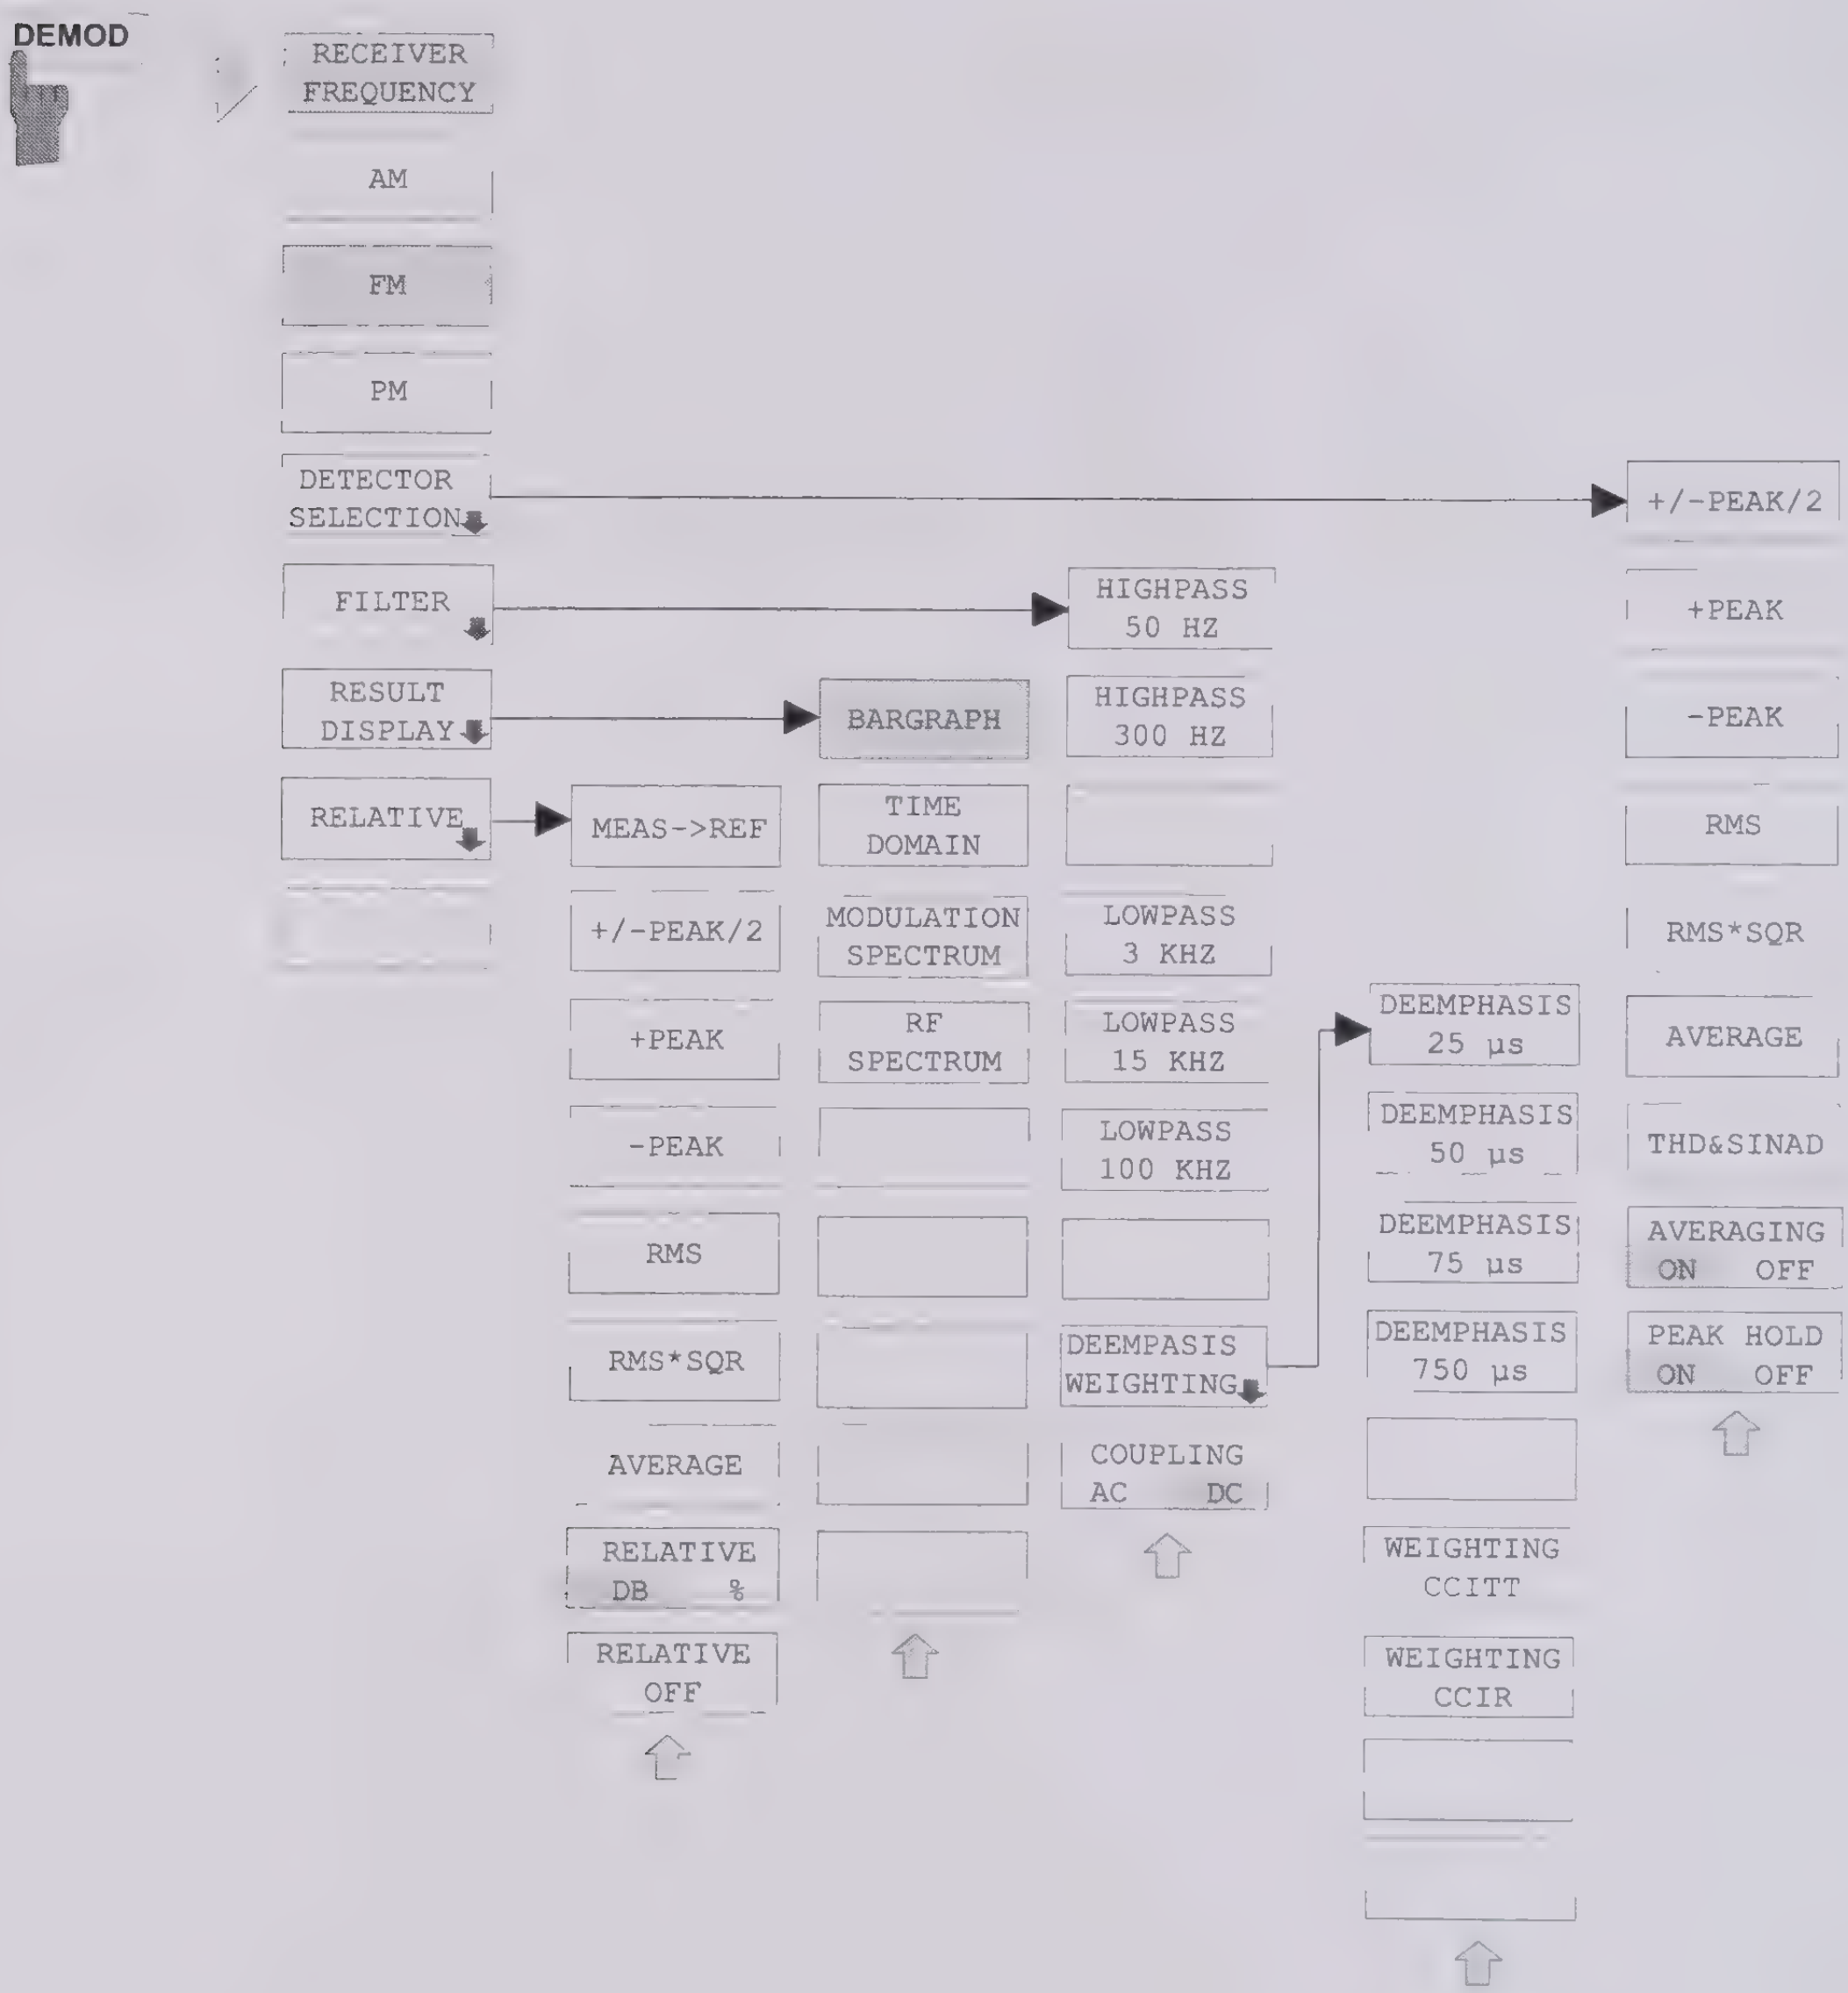
DEMOD
RECEIVER FREQUENCY
AM
FM
PM
DETECTOR SELECTION
FILTER
RESULT DISPLAY
RELATIVE
MEAS->REF
+/-PEAK/2
+PEAK
-PEAK
RMS
RMS*SQR
AVERAGE
RELATIVE DB %
RELATIVE OFF
BARGRAPH
TIME DOMAIN
MODULATION SPECTRUM
RF SPECTRUM
HIGHPASS 50 HZ
HIGHPASS 300 HZ
LOWPASS 3 KHZ
LOWPASS 15 KHZ
LOWPASS 100 KHZ
DEEMPASIS WEIGHTING
COUPLING AC DC
DEEMPHASIS 25 µs
DEEMPHASIS 50 µs
DEEMPHASIS 75 µs
DEEMPHASIS 750 µs
WEIGHTING CCITT
WEIGHTING CCIR
+/-PEAK/2
+PEAK
-PEAK
RMS
RMS*SQR
AVERAGE
THD&SINAD
AVERAGING ON OFF
PEAK HOLD ON OFF

AUDIO Key

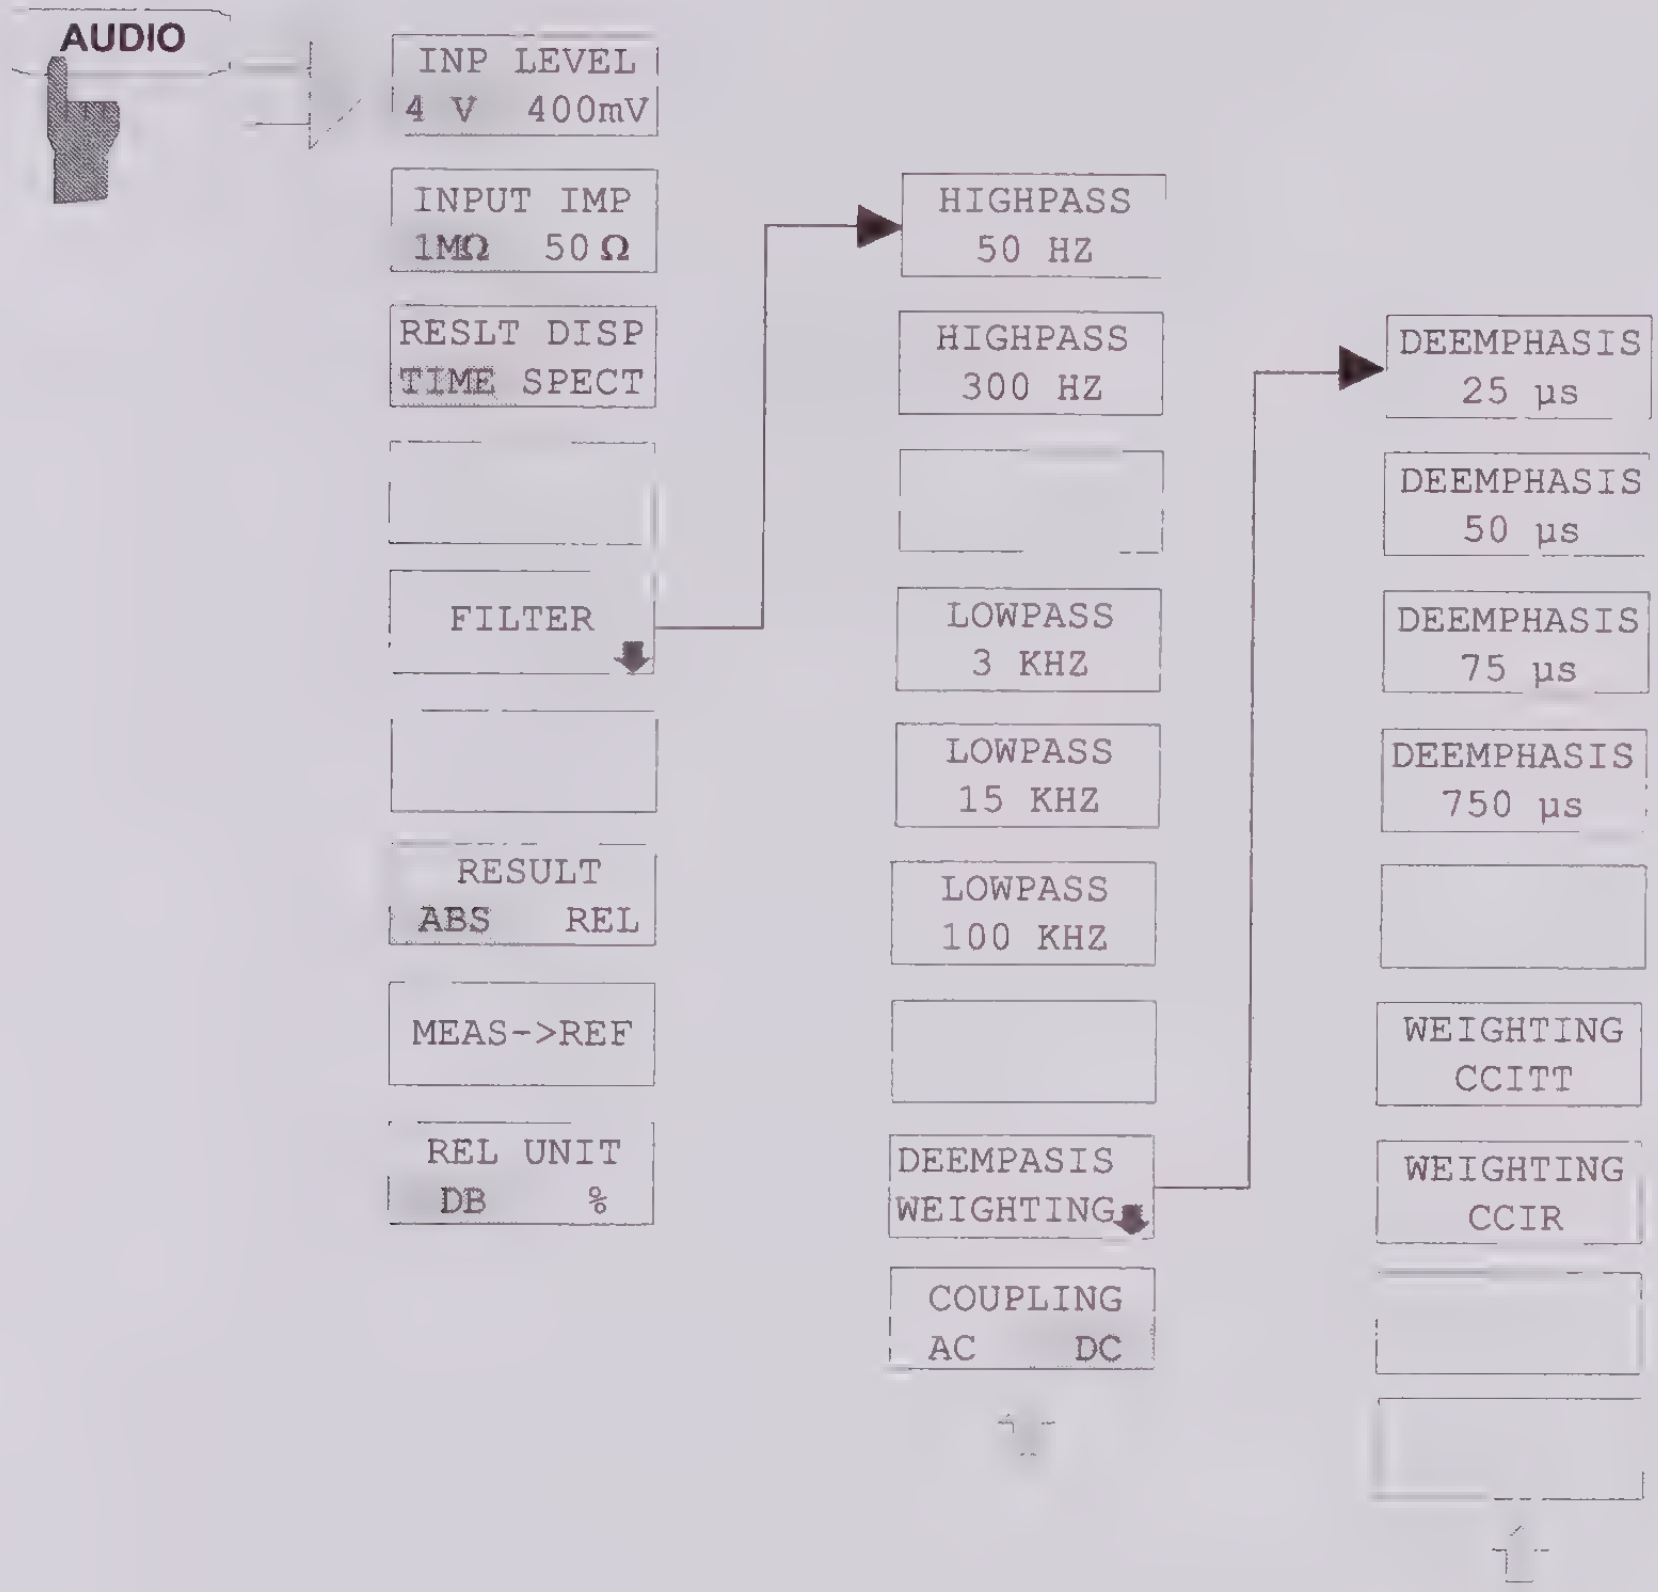
AUDIO
INP LEVEL 4 V 400mV
INPUT IMP 1MΩ 50 Ω
RESLT DISP TIME SPECT
FILTER
RESULT ABS REL
MEAS->REF
REL UNIT DB %
HIGHPASS 50 HZ
HIGHPASS 300 HZ
LOWPASS 3 KHZ
LOWPASS 15 KHZ
LOWPASS 100 KHZ
DEEMPASIS WEIGHTING
COUPLING AC DC
DEEMPHASIS 25 µs
DEEMPHASIS 50 µs
DEEMPHASIS 75 µs
DEEMPHASIS 750 µs
WEIGHTING CCITT
WEIGHTING CCIR

Menu Overview Spectrum Analysis Mode

FREQUENCY Key

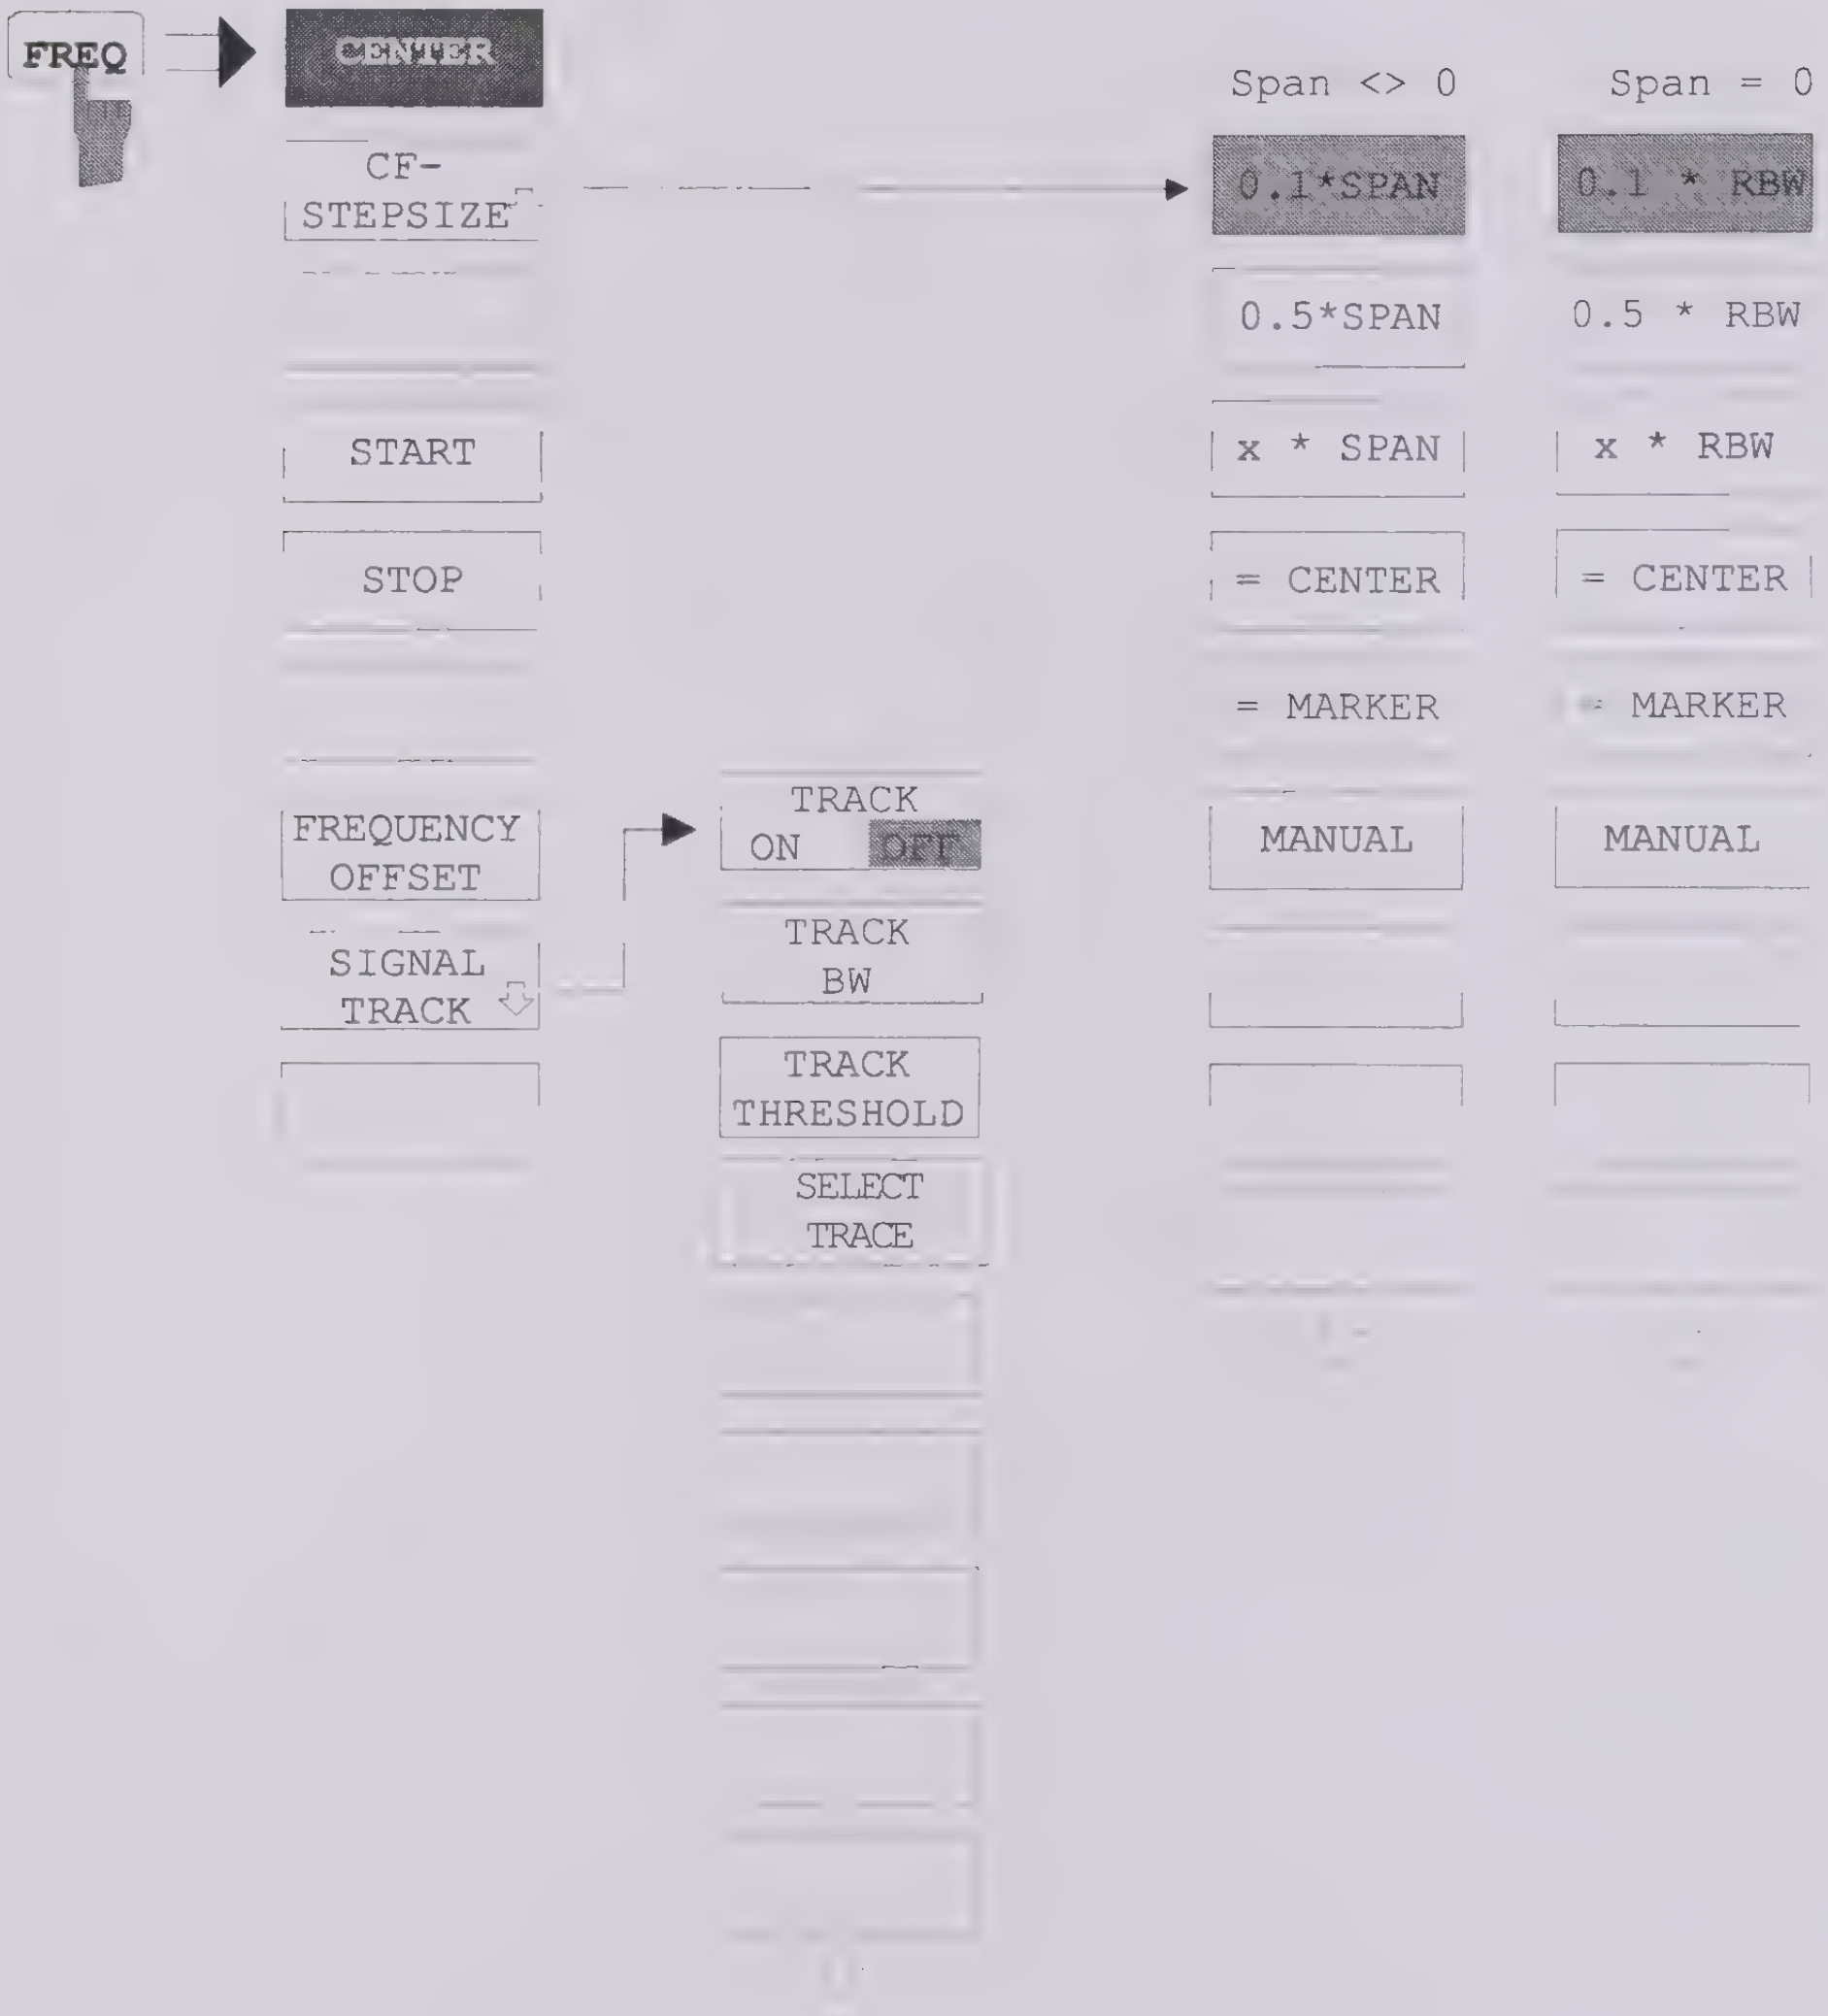

SPAN Key

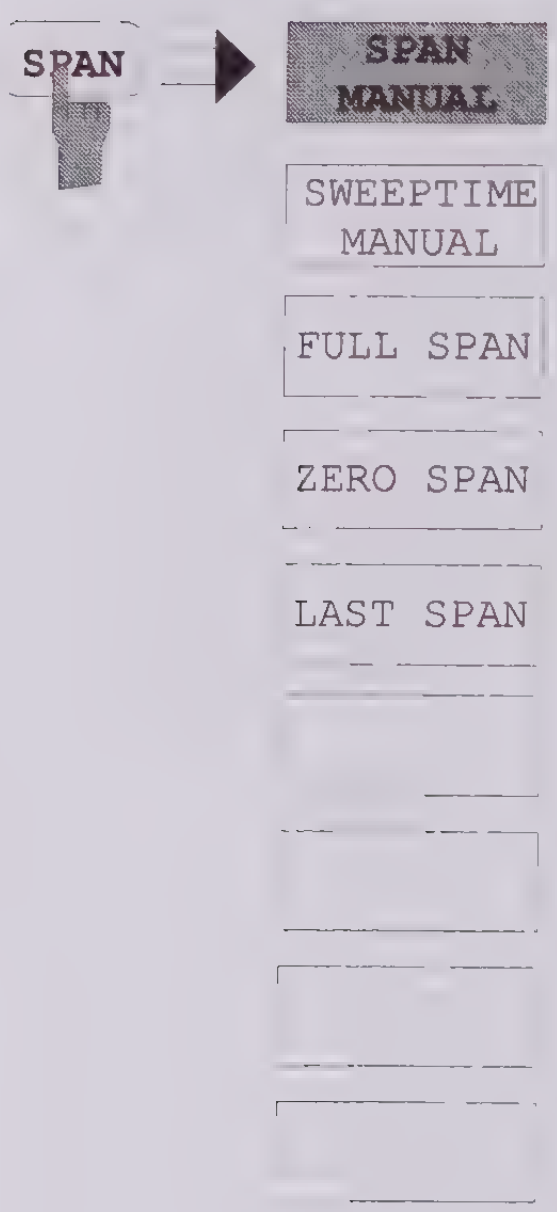
SPAN
SPAN MANUAL
SWEEPTIME MANUAL
FULL SPAN
ZERO SPAN
LAST SPAN

AMPT Key

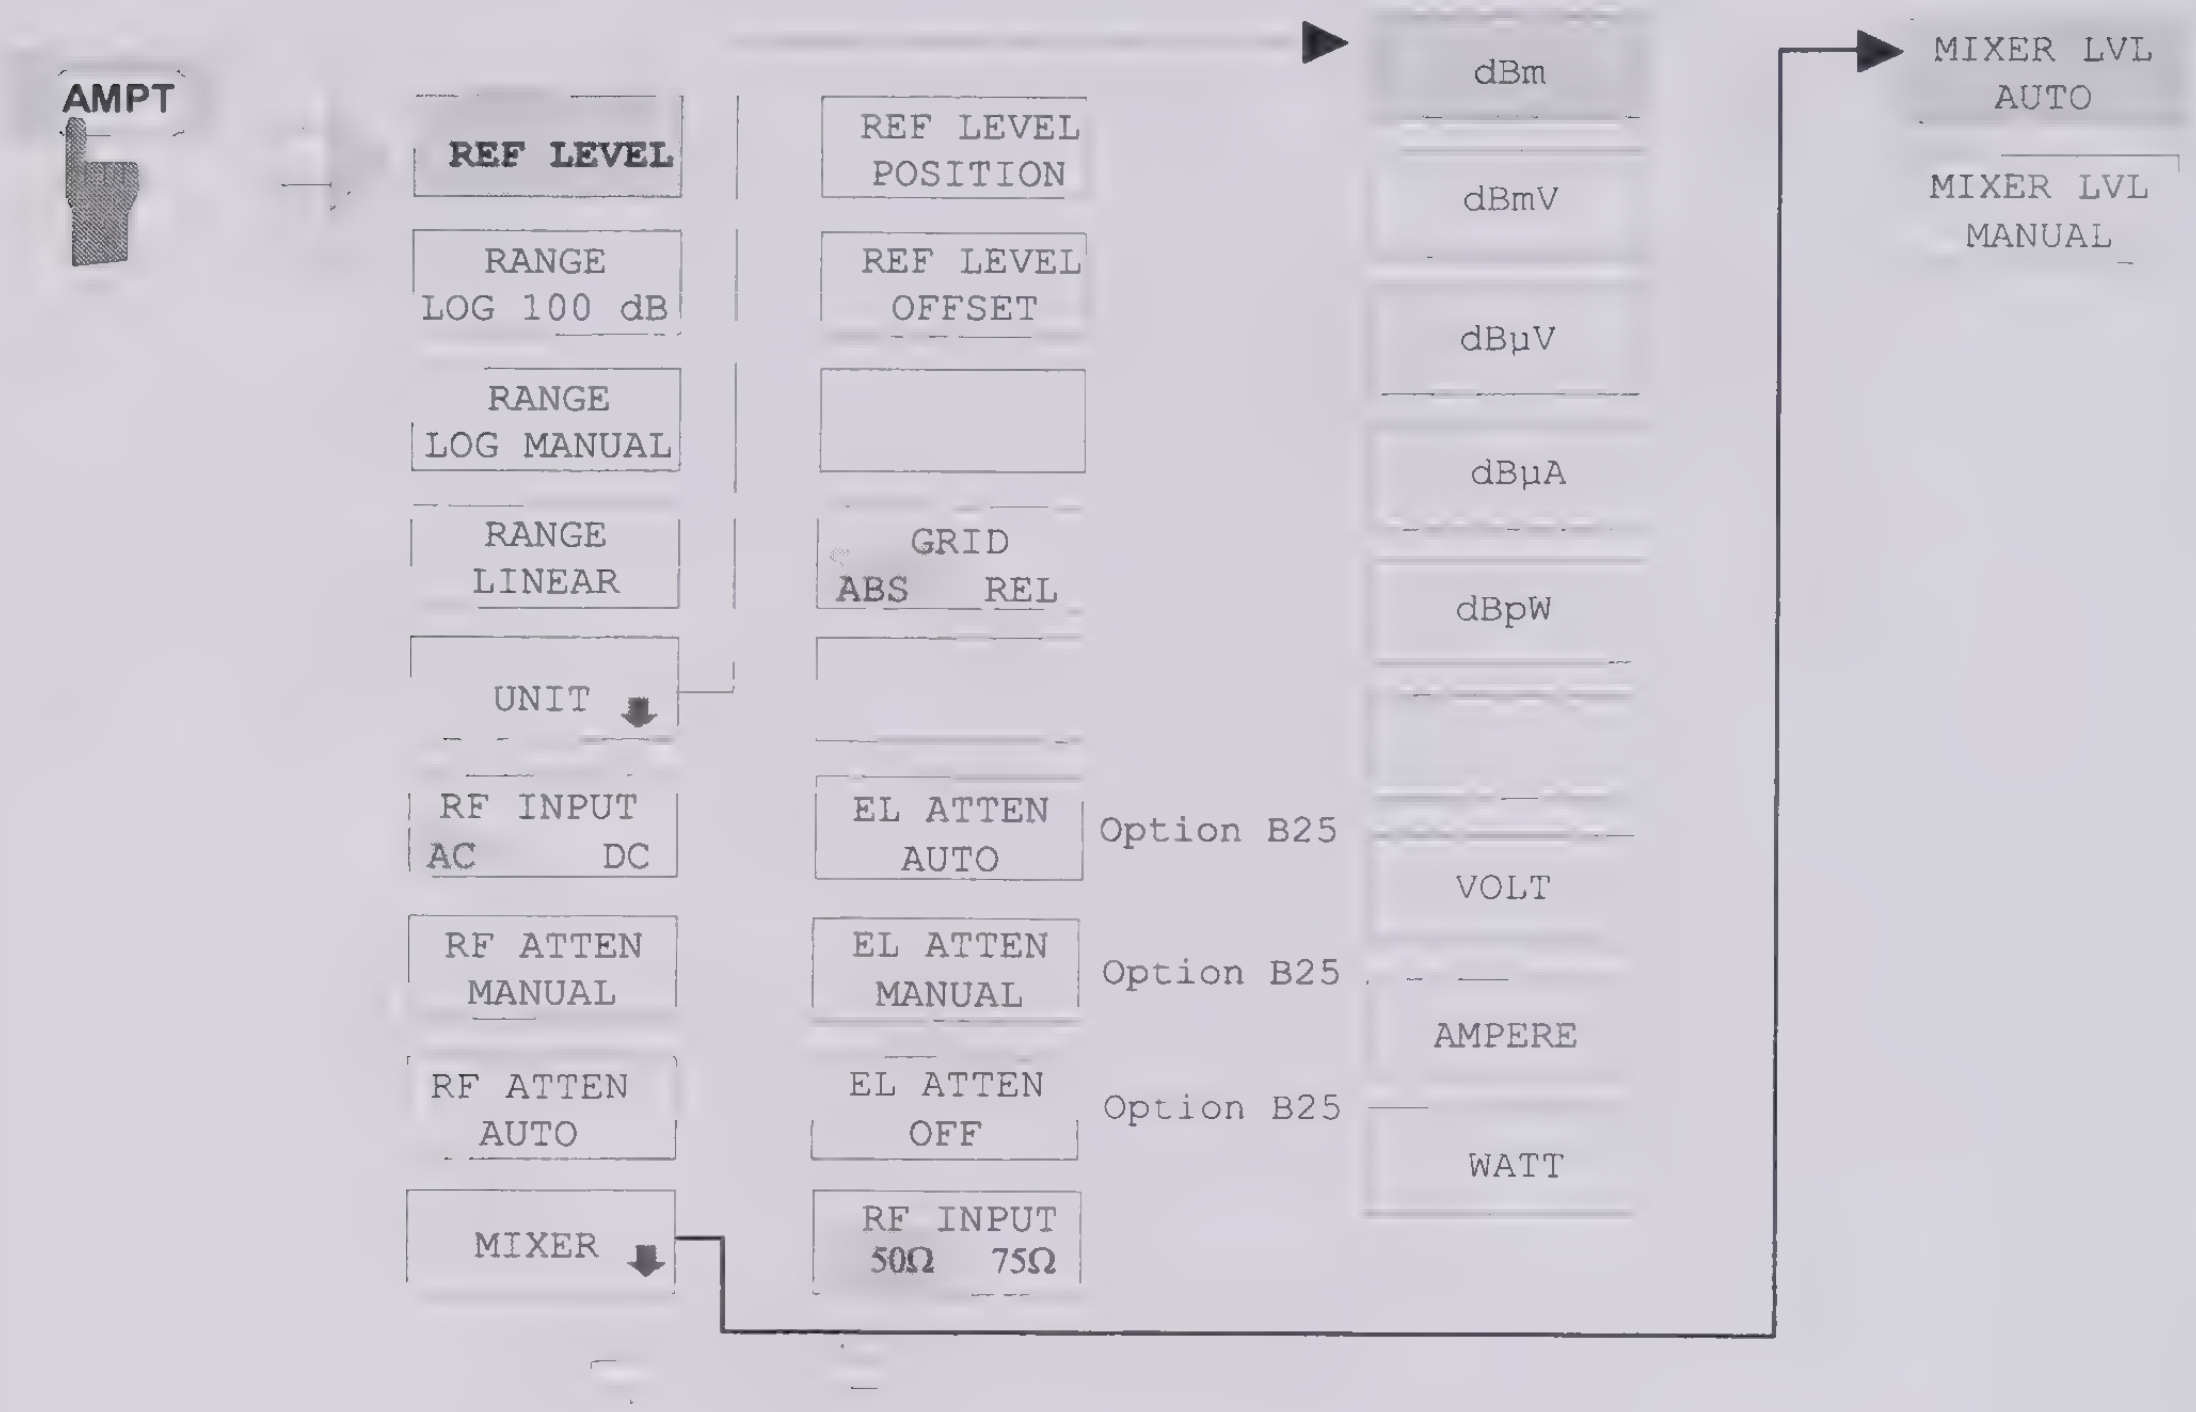
AMPT
REF LEVEL
RANGE LOG 100 dB
RANGE LOG MANUAL
RANGE LINEAR
UNIT
RF INPUT AC DC
RF ATTEN MANUAL
RF ATTEN AUTO
MIXER
REF LEVEL POSITION
REF LEVEL OFFSET
GRID ABS REL
EL ATTEN AUTO
Option B25
EL ATTEN MANUAL
Option B25
EL ATTEN OFF
Option B25
RF INPUT 50Ω 75Ω
dBm
dBmV
dBµV
dBµA
dBpW
VOLT
AMPERE
WATT
MIXER LVL AUTO
MIXER LVL MANUAL

MEAS Key

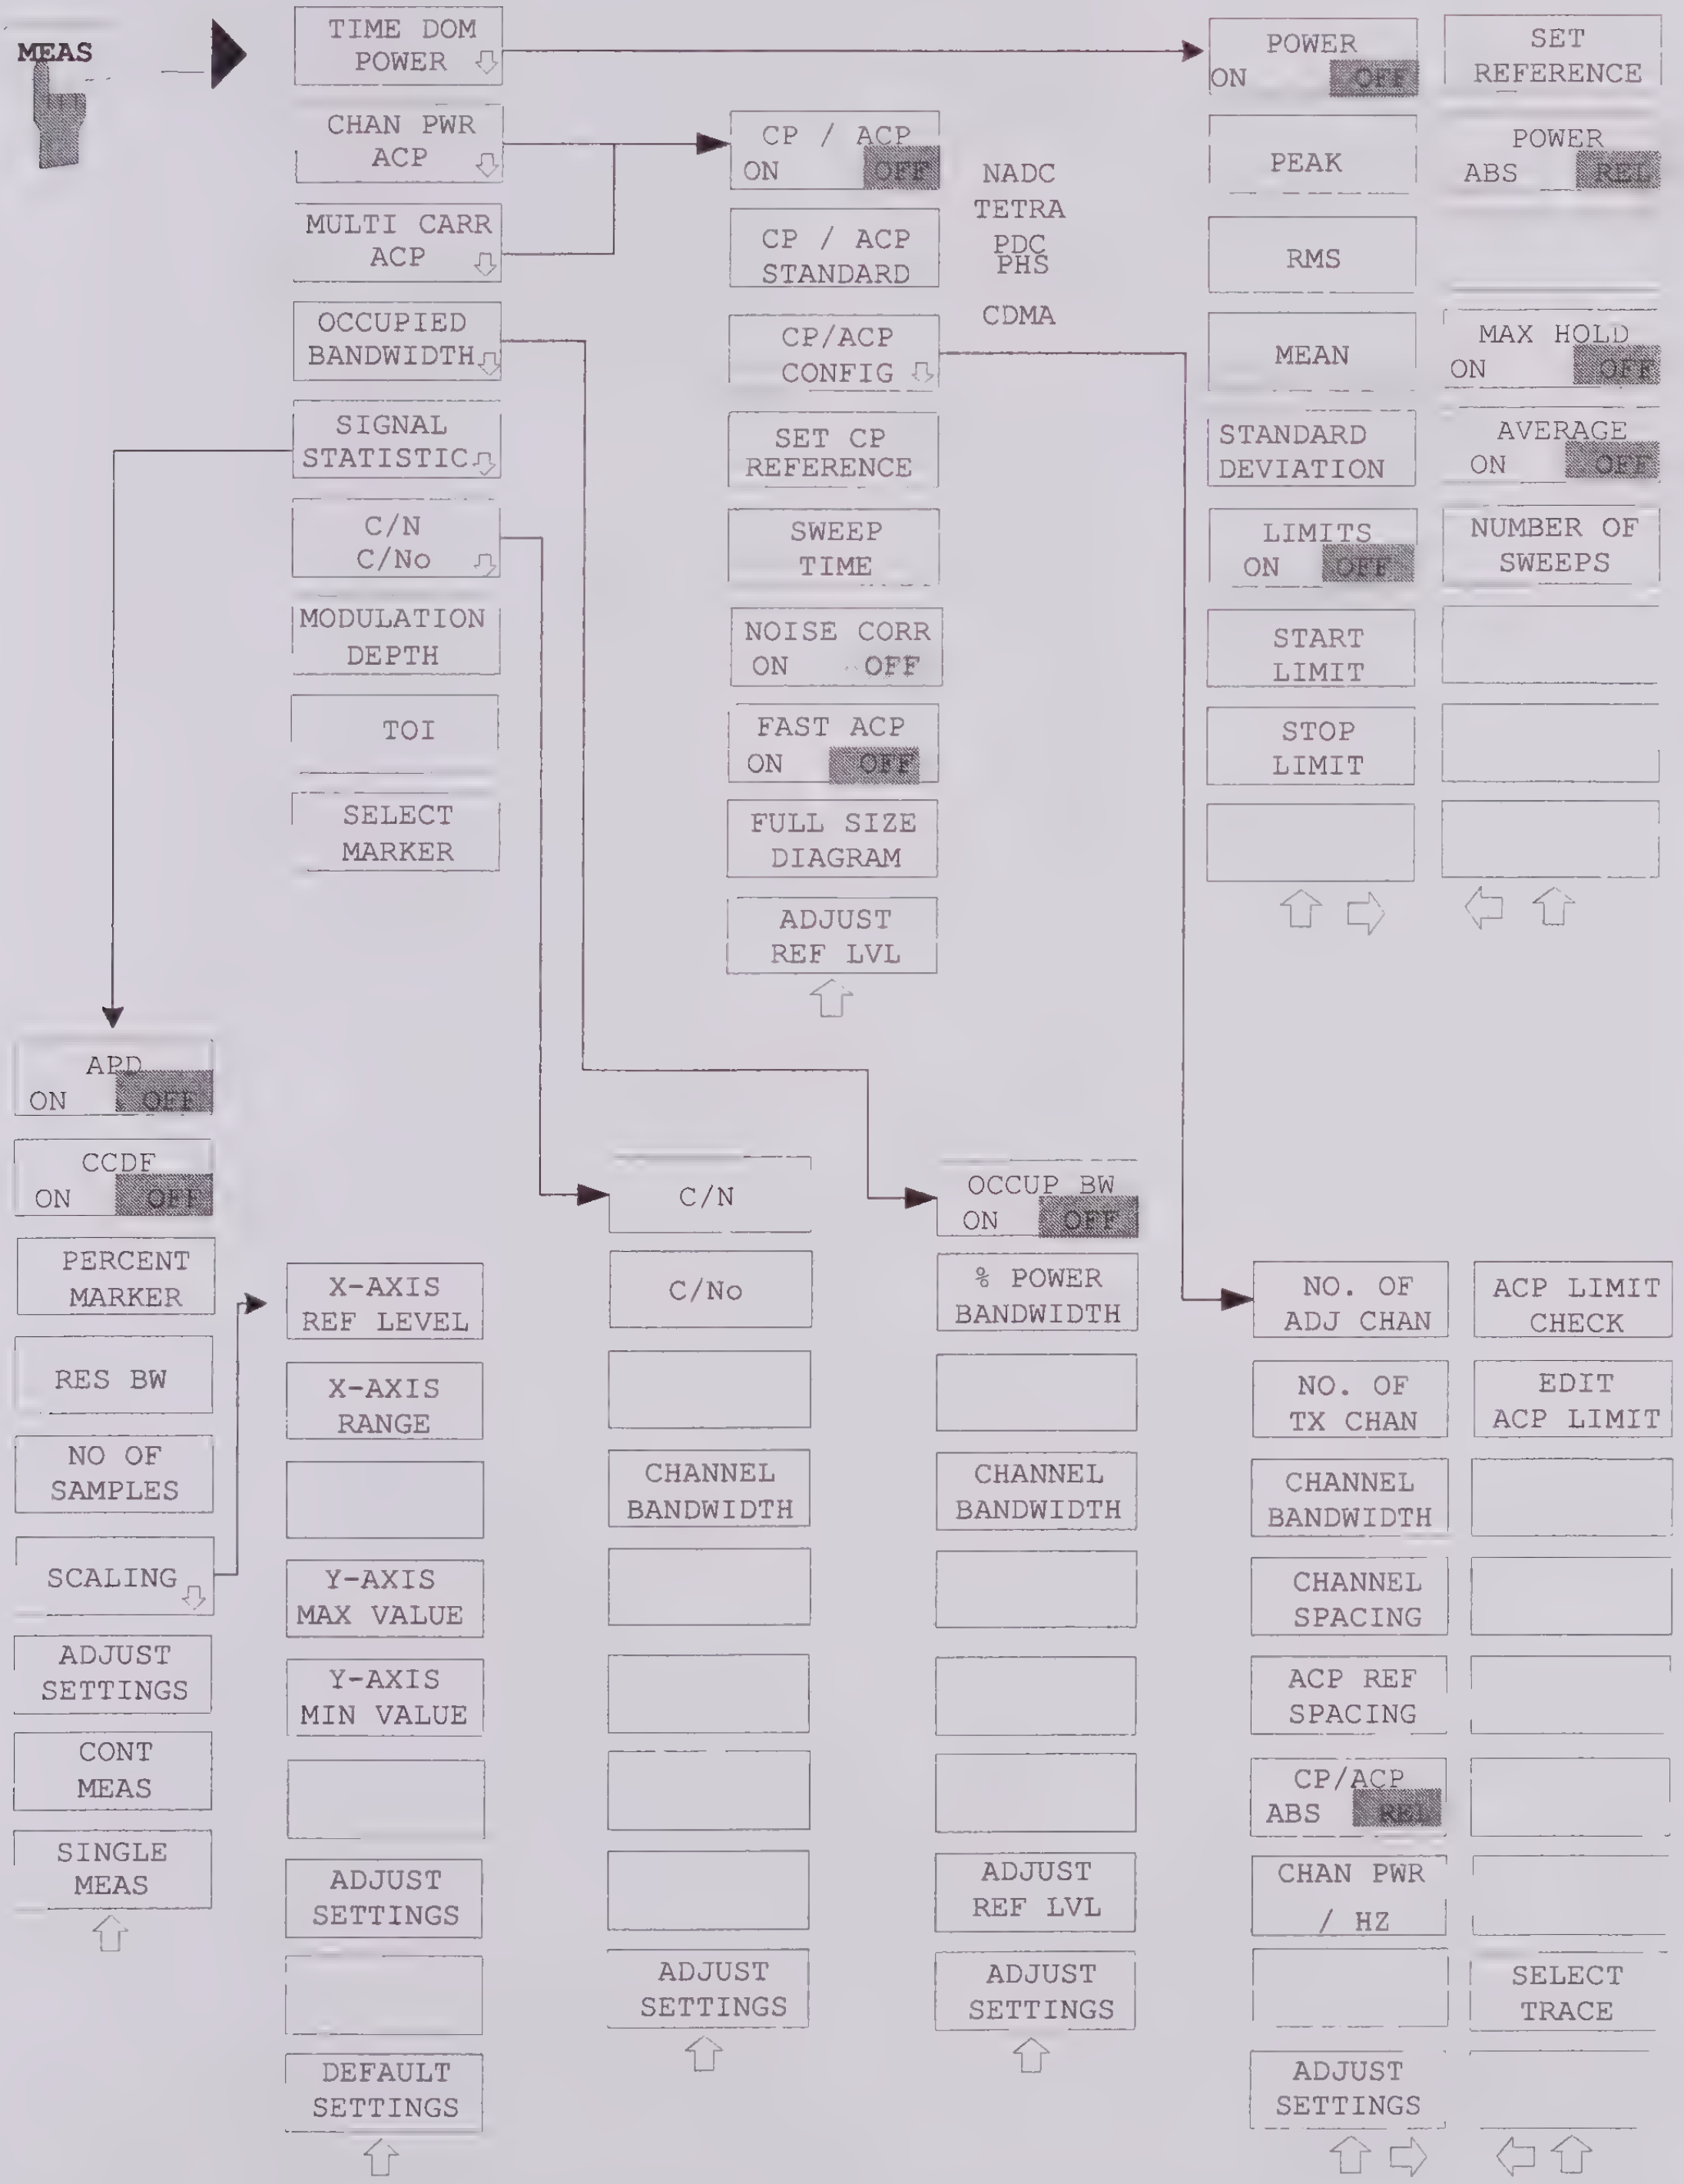
MEAS
TIME DOM POWER
CHAN PWR ACP
MULTI CARR ACP
OCCUPIED BANDWIDTH
SIGNAL STATISTIC
C/N C/No
MODULATION DEPTH
TOI
SELECT MARKER
CP / ACP ON OFF
CP / ACP STANDARD
CP/ACP CONFIG
SET CP REFERENCE
SWEEP TIME
NOISE CORR ON OFF
FAST ACP ON OFF
FULL SIZE DIAGRAM
ADJUST REF LVL
NADC
TETRA
PDC
PHS
CDMA
POWER ON OFF
PEAK
RMS
MEAN
STANDARD DEVIATION
LIMITS ON OFF
START LIMIT
STOP LIMIT
SET REFERENCE
POWER ABS REL
MAX HOLD ON OFF
AVERAGE ON OFF
NUMBER OF SWEEPS
APD ON OFF
CCDF ON OFF
PERCENT MARKER
RES BW
NO OF SAMPLES
SCALING
ADJUST SETTINGS
CONT MEAS
SINGLE MEAS
X-AXIS REF LEVEL
X-AXIS RANGE
Y-AXIS MAX VALUE
Y-AXIS MIN VALUE
ADJUST SETTINGS
DEFAULT SETTINGS
C/N
C/No
CHANNEL BANDWIDTH
ADJUST SETTINGS
OCCUP BW ON OFF
% POWER BANDWIDTH
CHANNEL BANDWIDTH
ADJUST REF LVL
ADJUST SETTINGS
NO. OF ADJ CHAN
NO. OF TX CHAN
CHANNEL BANDWIDTH
CHANNEL SPACING
ACP REF SPACING
CP/ACP ABS REL
CHAN PWR / HZ
ADJUST SETTINGS
ACP LIMIT CHECK
EDIT ACP LIMIT
SELECT TRACE

BW Key

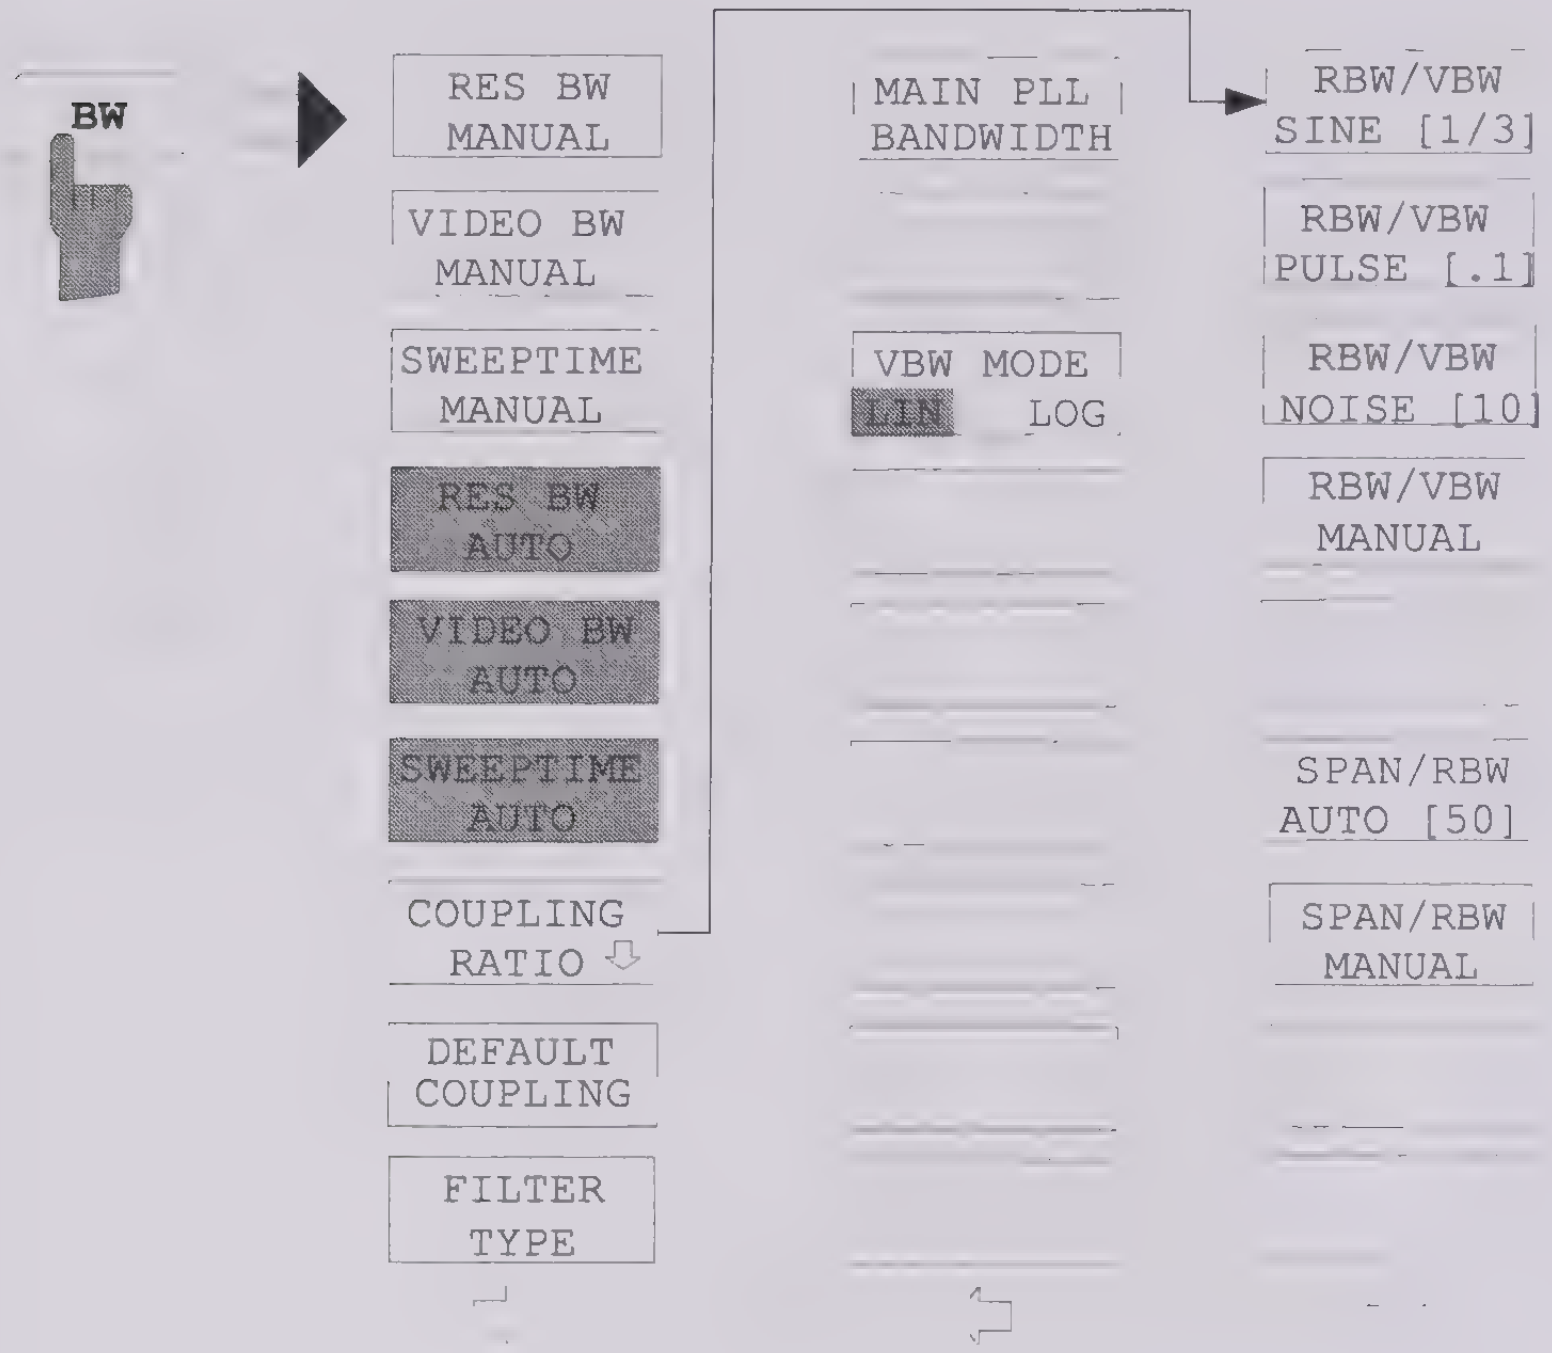
BW
RES BW MANUAL
VIDEO BW MANUAL
SWEEPTIME MANUAL
RES BW AUTO
VIDEO BW AUTO
SWEEPTIME AUTO
COUPLING RATIO
DEFAULT COUPLING
FILTER TYPE
MAIN PLL BANDWIDTH
VBW MODE LIN LOG
RBW/VBW SINE [1/3]
RBW/VBW PULSE [.1]
RBW/VBW NOISE [10]
RBW/VBW MANUAL
SPAN/RBW AUTO [50]
SPAN/RBW MANUAL

SWEEP Key

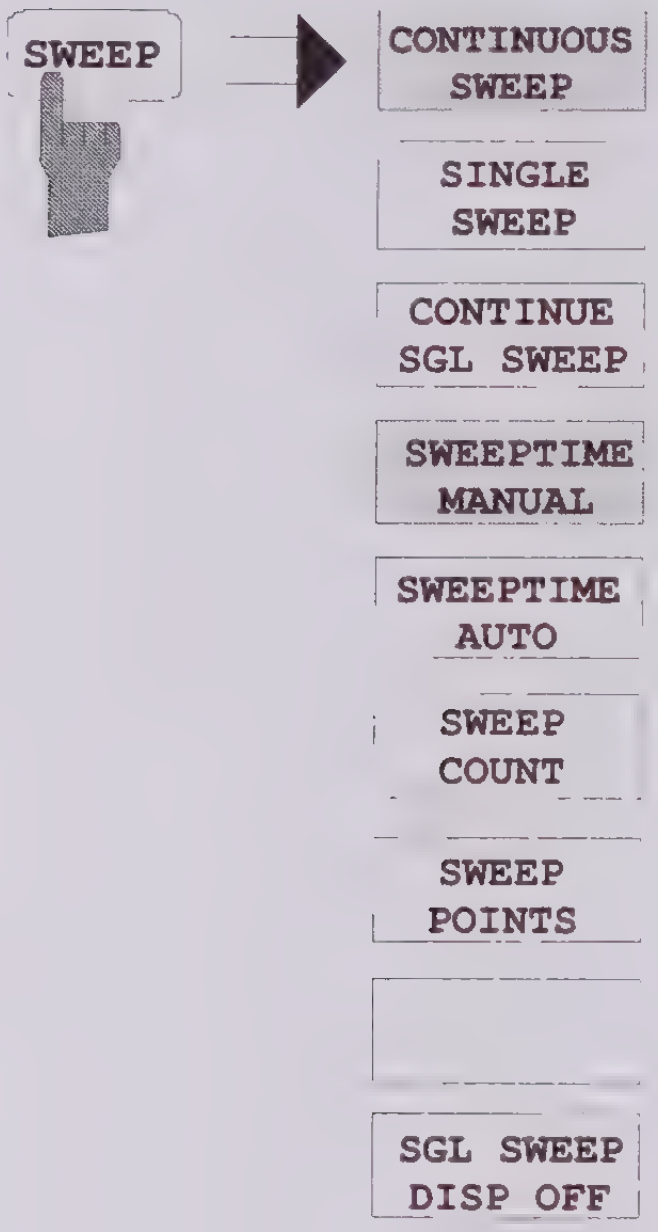
SWEEP
CONTINUOUS SWEEP
SINGLE SWEEP
CONTINUE SGL SWEEP
SWEEPTIME MANUAL
SWEEPTIME AUTO
SWEEP COUNT
SWEEP POINTS
SGL SWEEP DISP OFF

Menu Overview another Keys

MKR Key

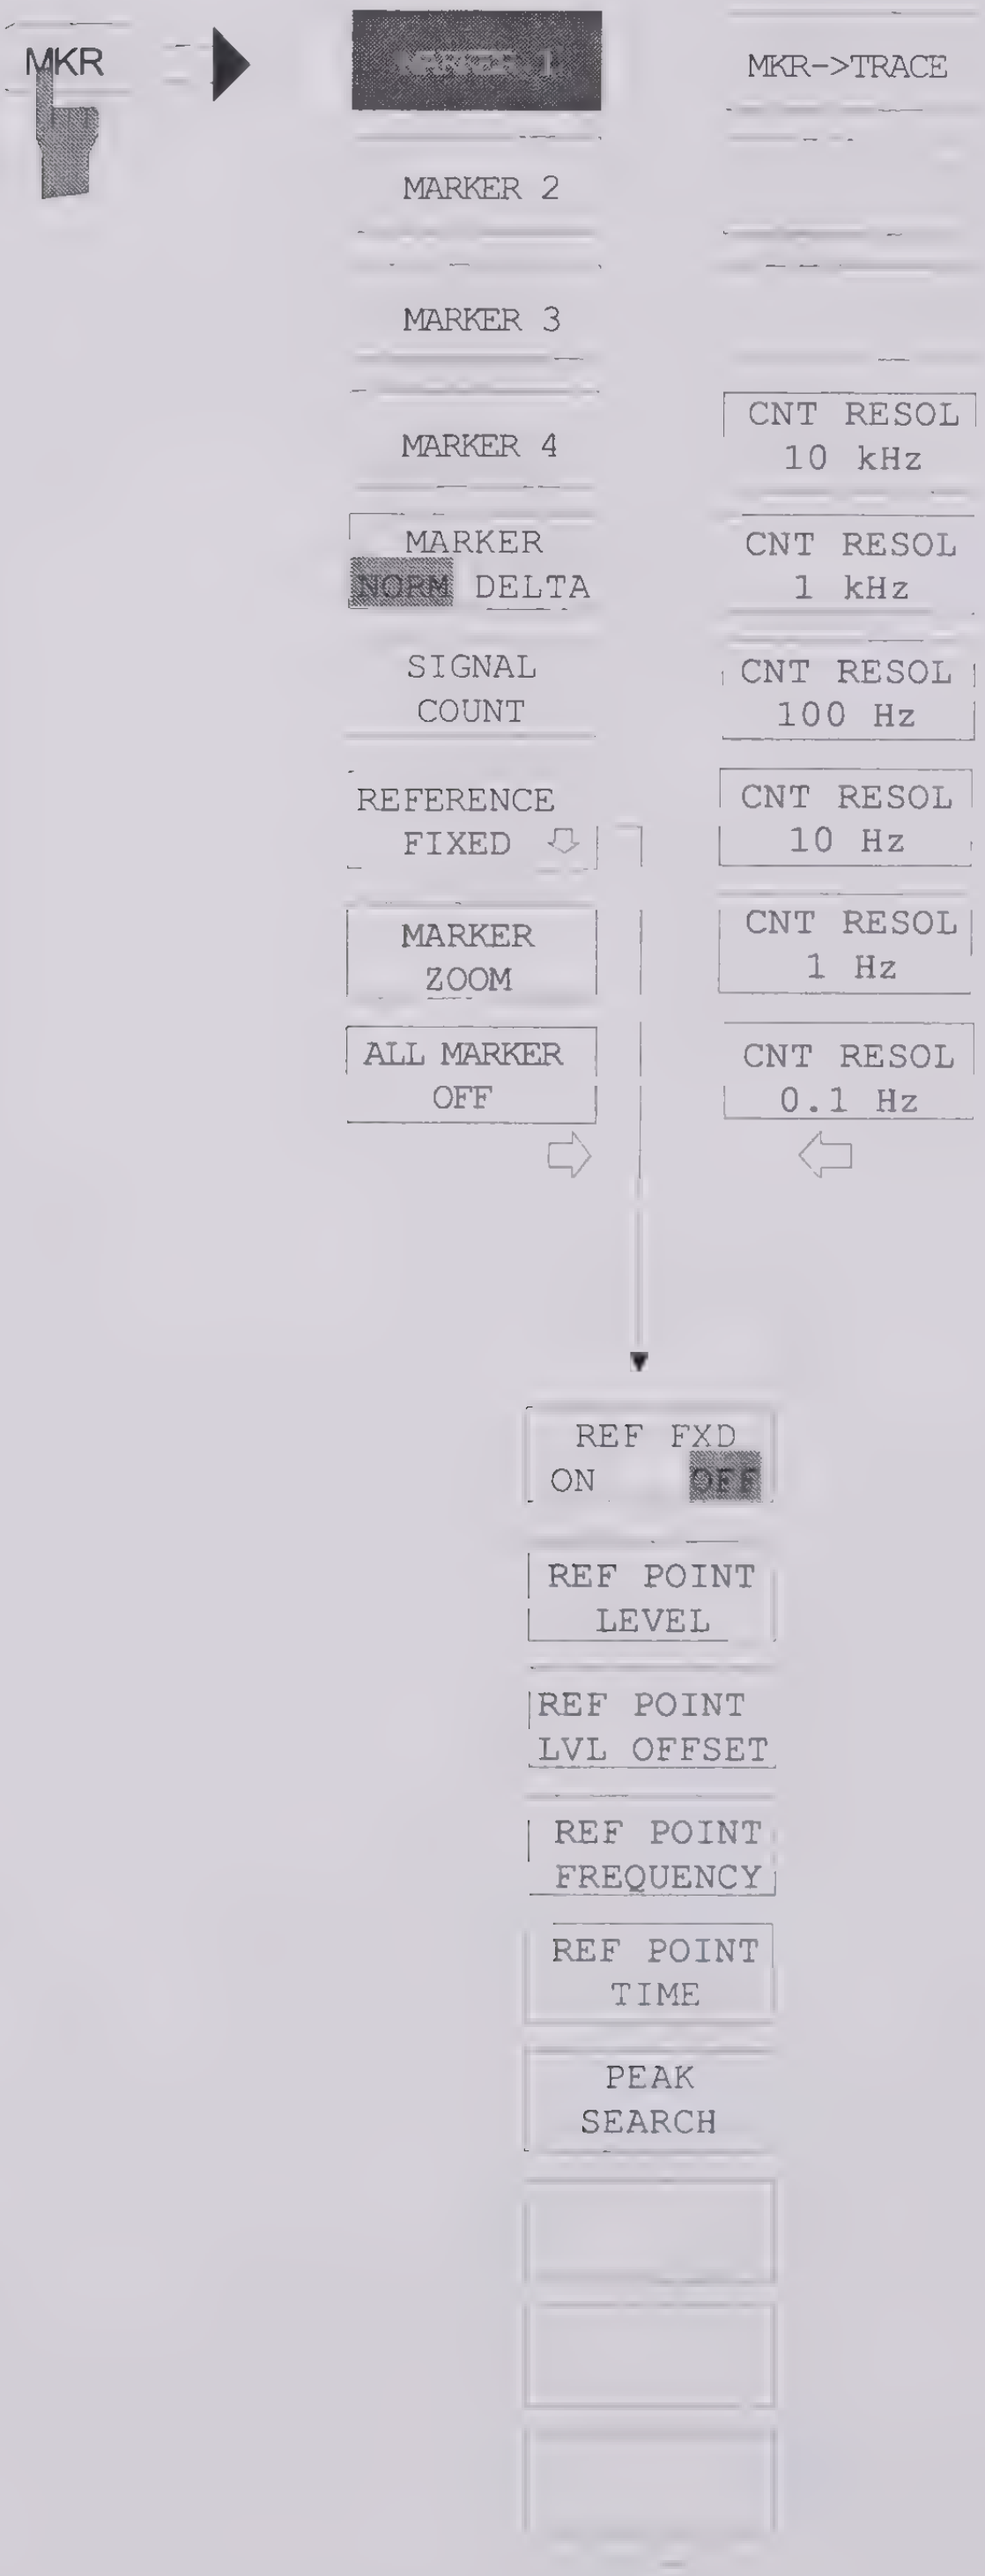

MKR-> Key

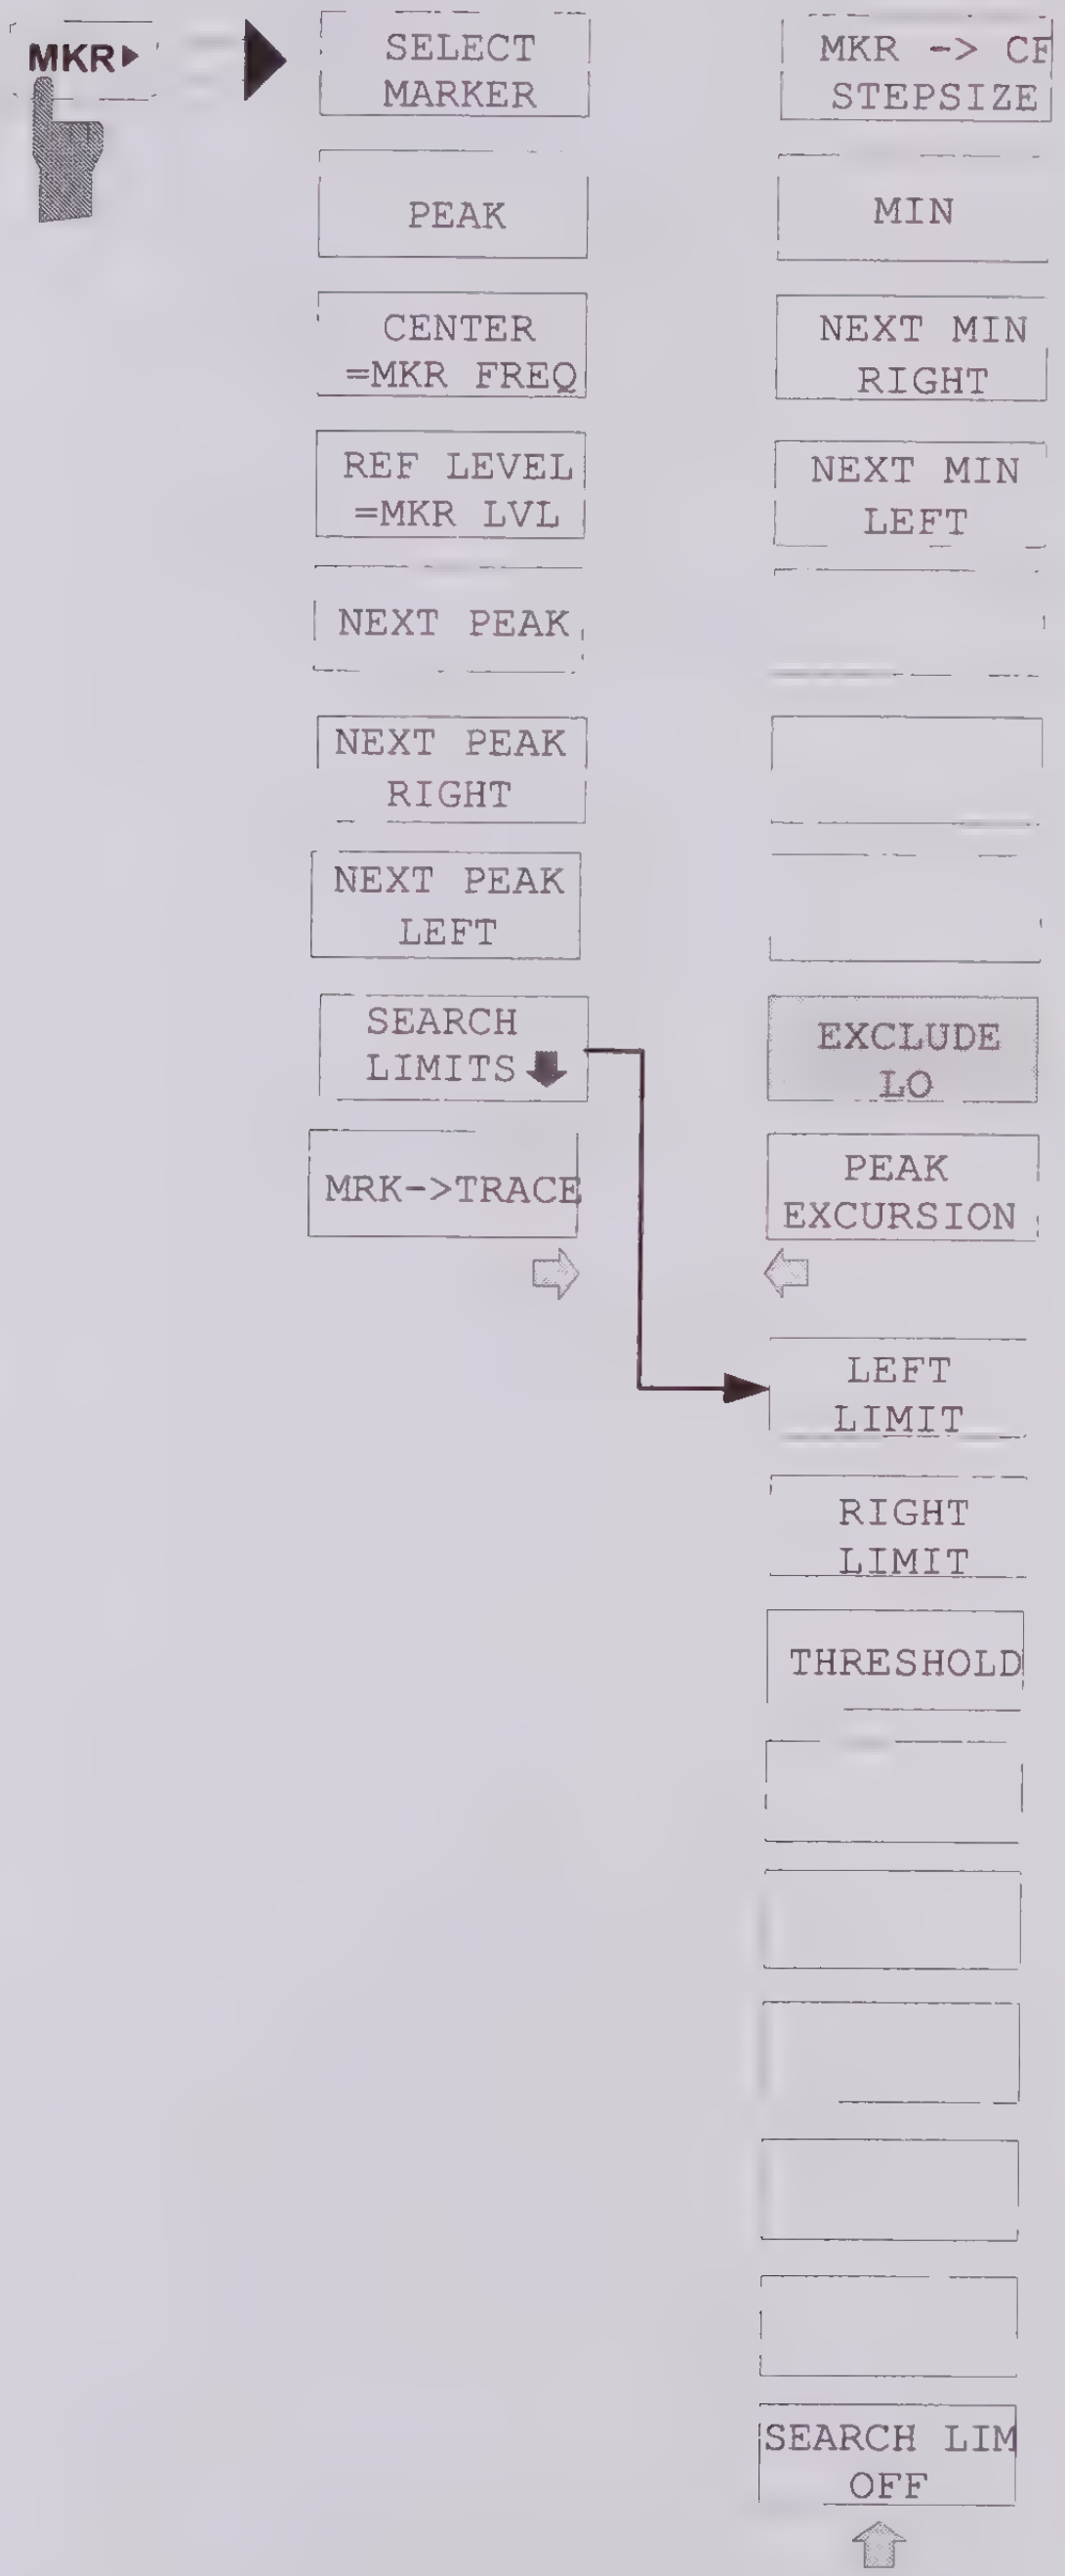
MKR▸
SELECT MARKER
PEAK
CENTER =MKR FREQ
REF LEVEL =MKR LVL
NEXT PEAK
NEXT PEAK RIGHT
NEXT PEAK LEFT
SEARCH LIMITS
MRK->TRACE
MKR -> CF STEPSIZE
MIN
NEXT MIN RIGHT
NEXT MIN LEFT
EXCLUDE LO
PEAK EXCURSION
LEFT LIMIT
RIGHT LIMIT
THRESHOLD
SEARCH LIM OFF

MKR FCTN Key

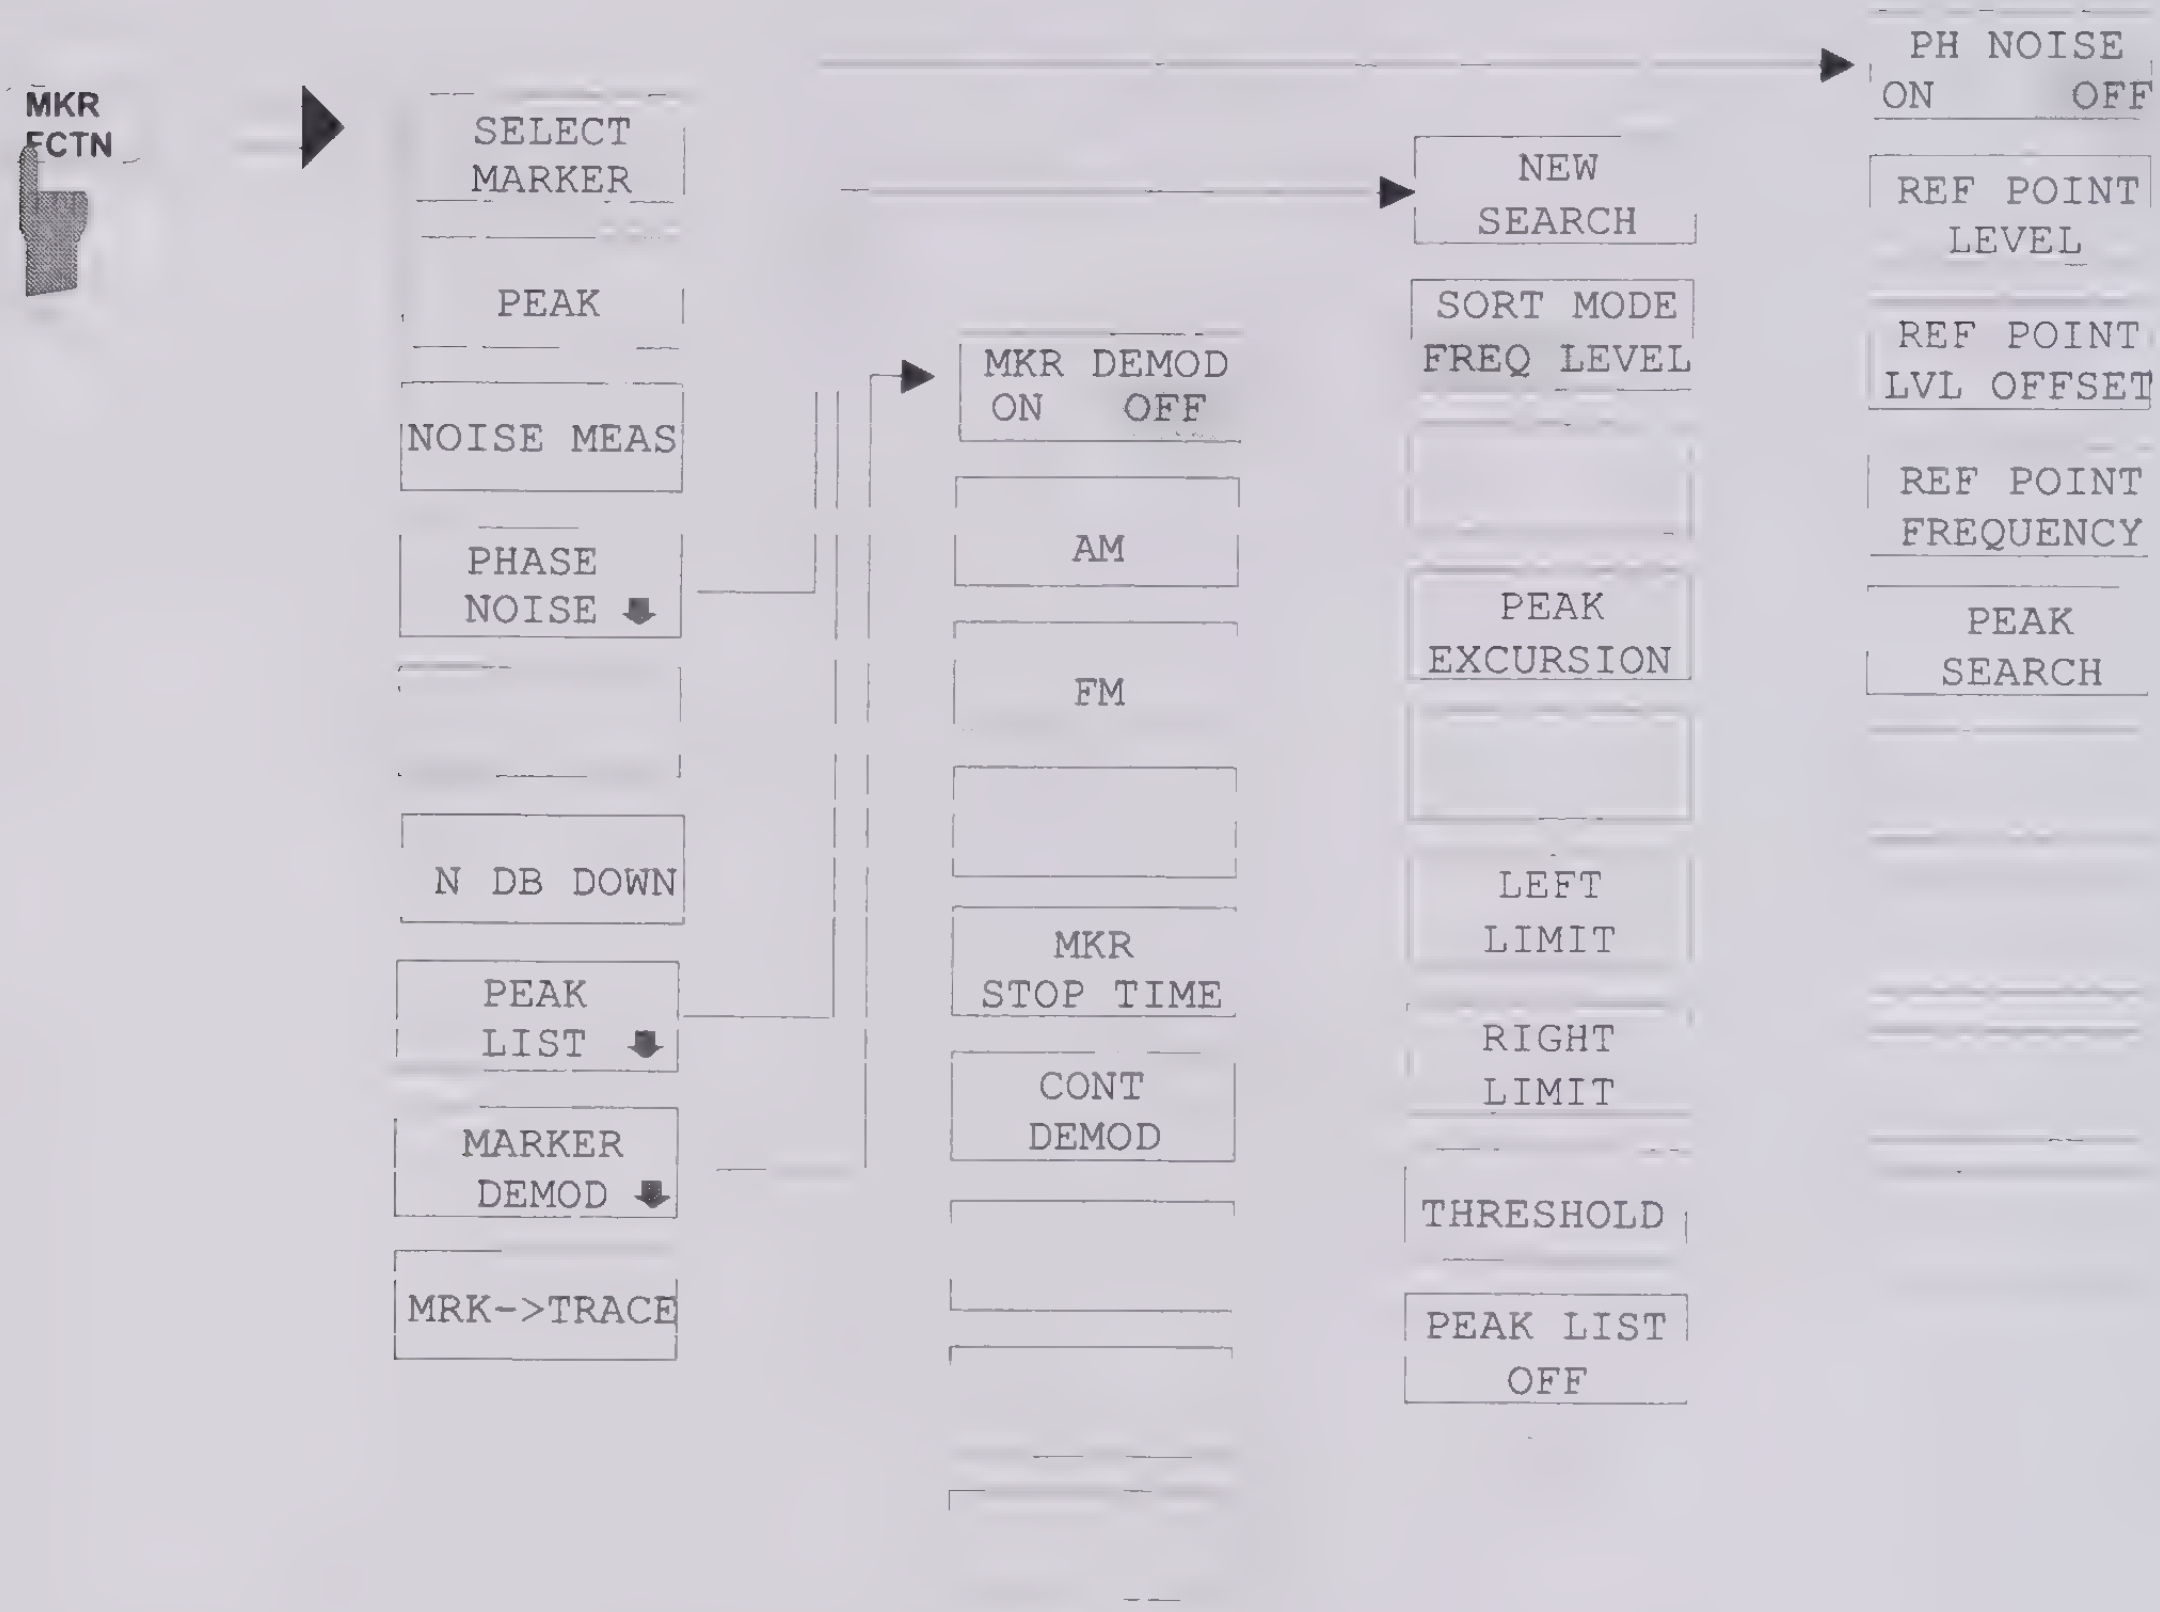
MKR FCTN
SELECT MARKER
PEAK
NOISE MEAS
PHASE NOISE
N DB DOWN
PEAK LIST
MARKER DEMOD
MRK->TRACE
MKR DEMOD ON OFF
AM
FM
MKR STOP TIME
CONT DEMOD
NEW SEARCH
SORT MODE FREQ LEVEL
PEAK EXCURSION
LEFT LIMIT
RIGHT LIMIT
THRESHOLD
PEAK LIST OFF
PH NOISE ON OFF
REF POINT LEVEL
REF POINT LVL OFFSET
REF POINT FREQUENCY
PEAK SEARCH

TRIG Key

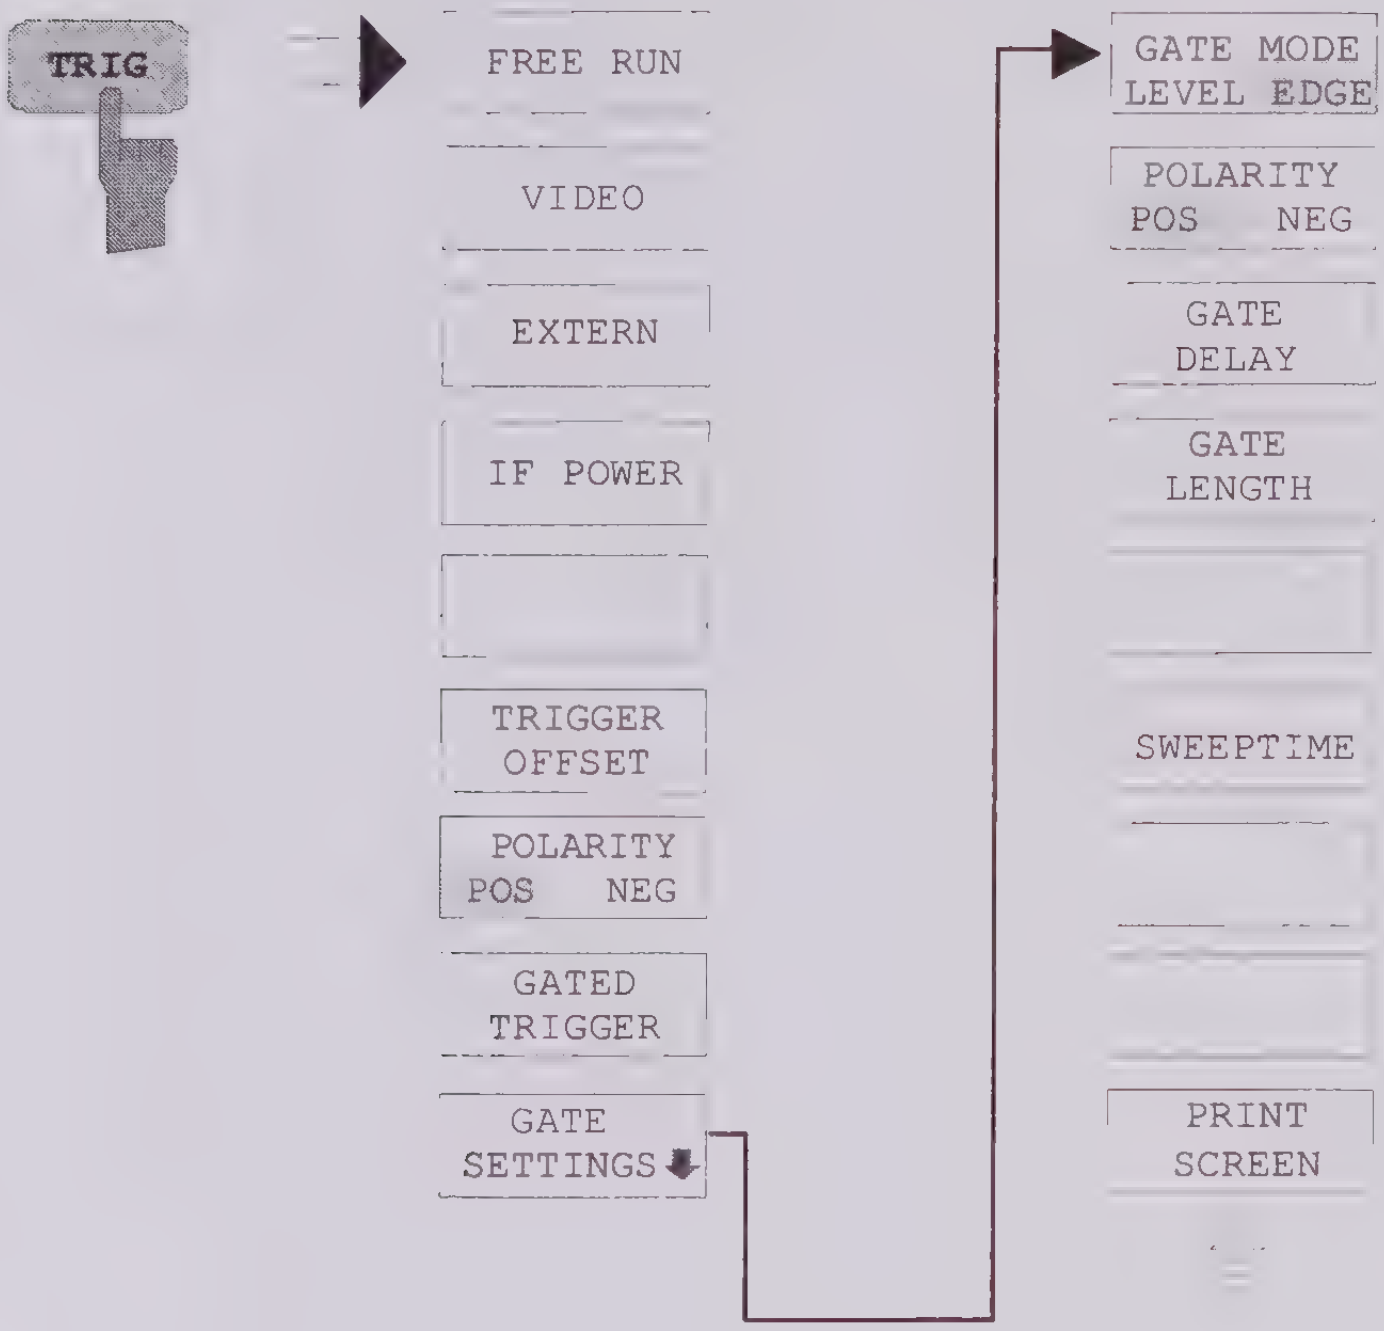
TRIG
FREE RUN
VIDEO
EXTERN
IF POWER
TRIGGER OFFSET
POLARITY POS NEG
GATED TRIGGER
GATE SETTINGS
GATE MODE LEVEL EDGE
POLARITY POS NEG
GATE DELAY
GATE LENGTH
SWEEPTIME
PRINT SCREEN

TRACE Key

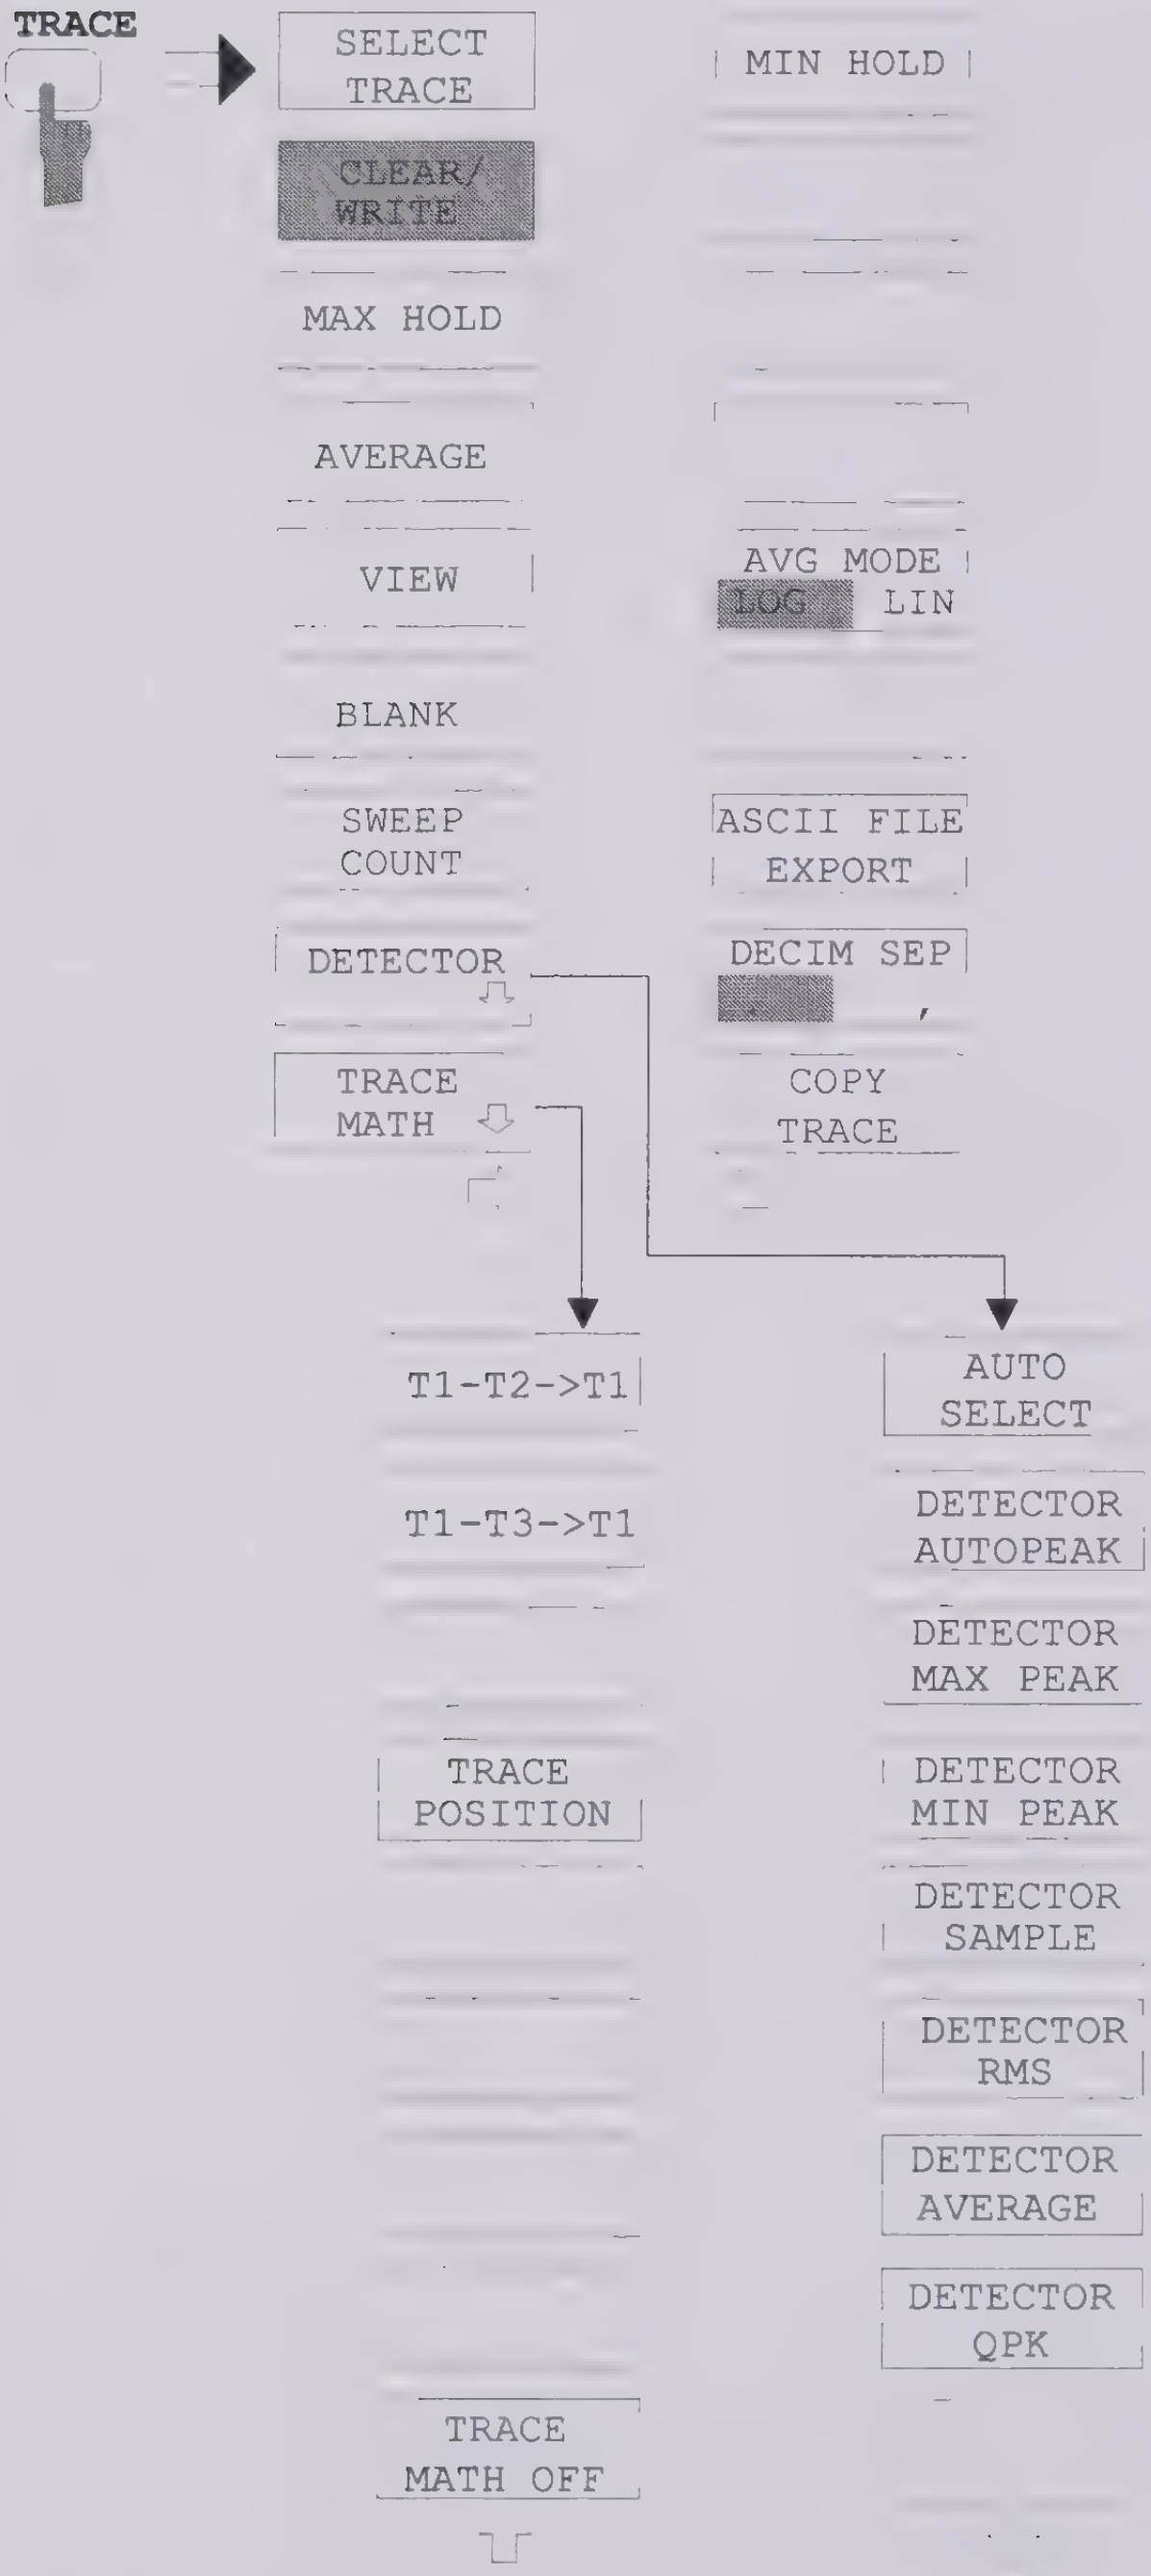
TRACE
SELECT TRACE
CLEAR/WRITE
MAX HOLD
AVERAGE
VIEW
BLANK
SWEEP COUNT
DETECTOR
TRACE MATH
MIN HOLD
AVG MODE LOG LIN
ASCII FILE EXPORT
DECIM SEP . ,
COPY TRACE
T1-T2->T1
T1-T3->T1
TRACE POSITION
TRACE MATH OFF
AUTO SELECT
DETECTOR AUTOPEAK
DETECTOR MAX PEAK
DETECTOR MIN PEAK
DETECTOR SAMPLE
DETECTOR RMS
DETECTOR AVERAGE
DETECTOR QPK

LINES Key

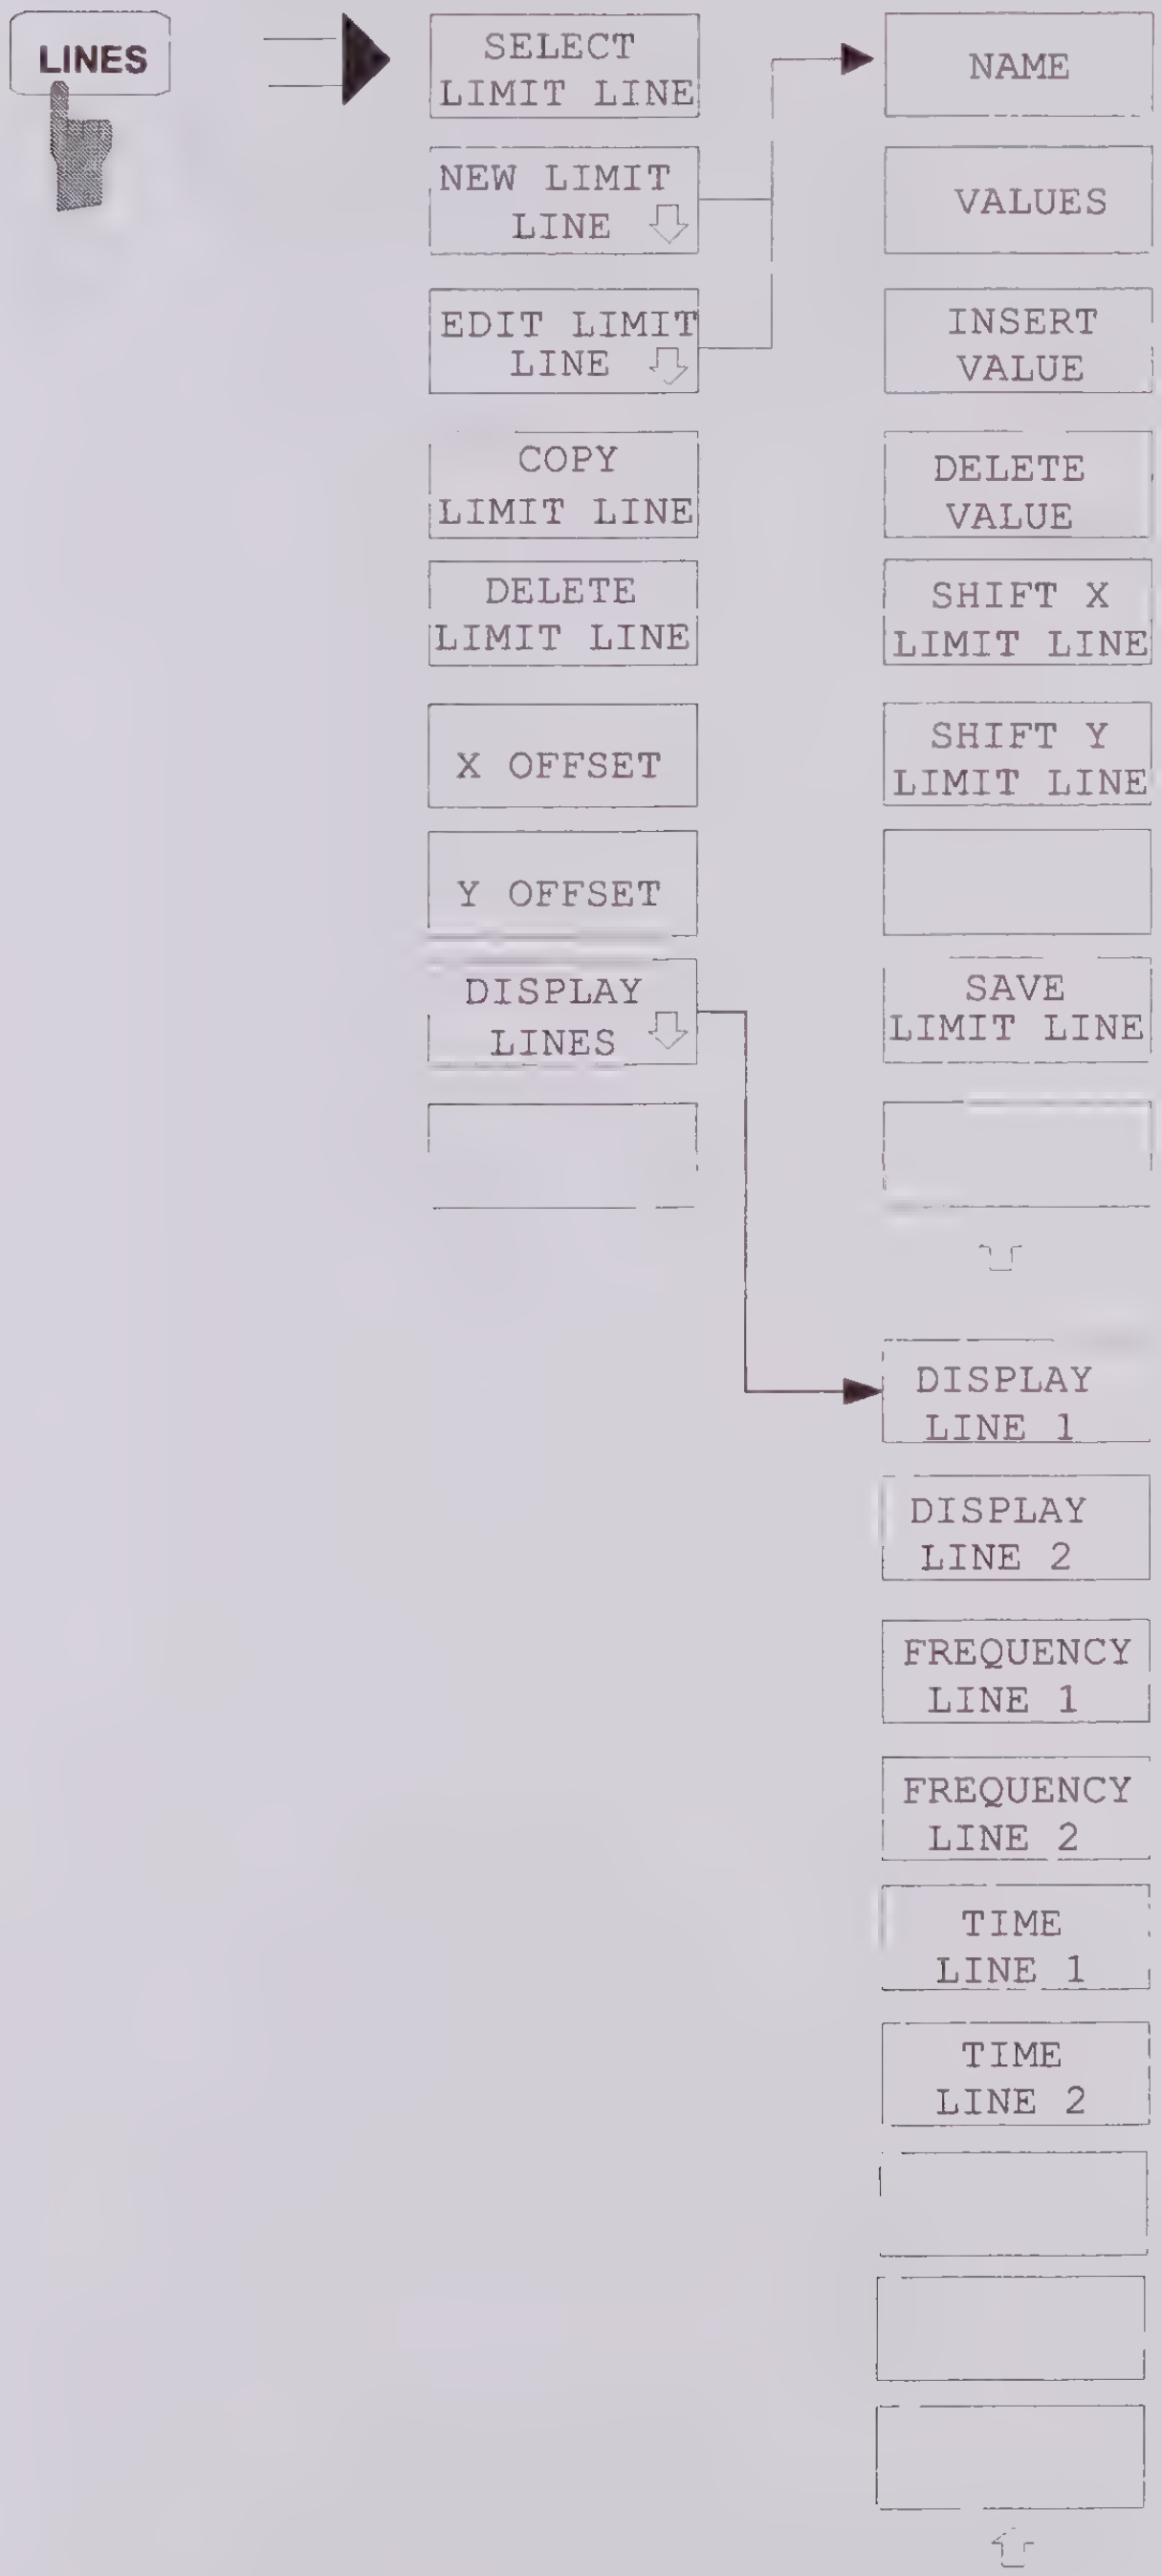
LINES
SELECT LIMIT LINE
NEW LIMIT LINE
EDIT LIMIT LINE
COPY LIMIT LINE
DELETE LIMIT LINE
X OFFSET
Y OFFSET
DISPLAY LINES
NAME
VALUES
INSERT VALUE
DELETE VALUE
SHIFT X LIMIT LINE
SHIFT Y LIMIT LINE
SAVE LIMIT LINE
DISPLAY LINE 1
DISPLAY LINE 2
FREQUENCY LINE 1
FREQUENCY LINE 2
TIME LINE 1
TIME LINE 2

DISP Key

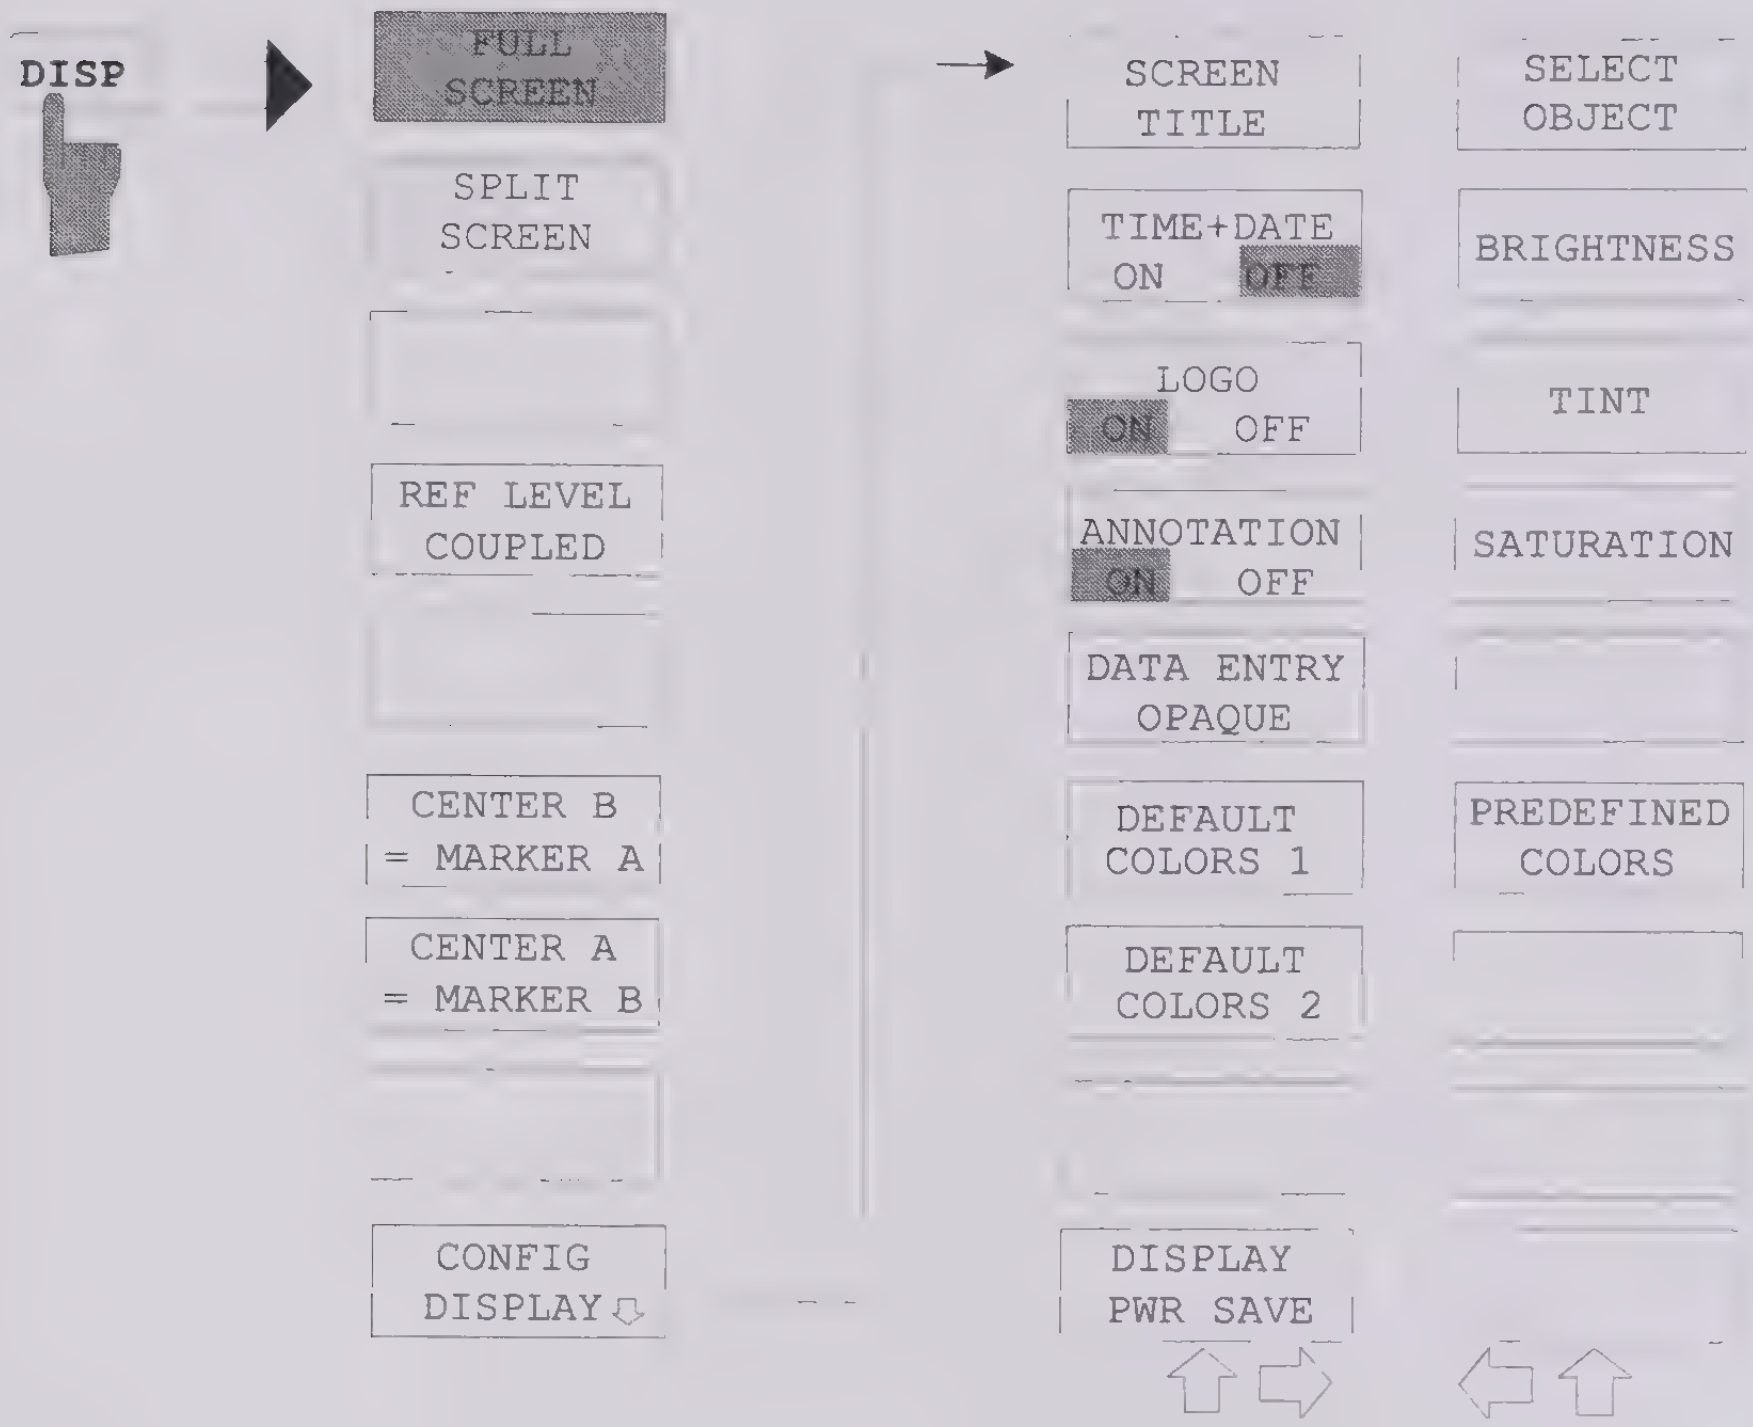
DISP
FULL SCREEN
SPLIT SCREEN
REF LEVEL COUPLED
CENTER B = MARKER A
CENTER A = MARKER B
CONFIG DISPLAY
SCREEN TITLE
TIME+DATE ON OFF
LOGO ON OFF
ANNOTATION ON OFF
DATA ENTRY OPAQUE
DEFAULT COLORS 1
DEFAULT COLORS 2
DISPLAY PWR SAVE
SELECT OBJECT
BRIGHTNESS
TINT
SATURATION
PREDEFINED COLORS

FILE Key

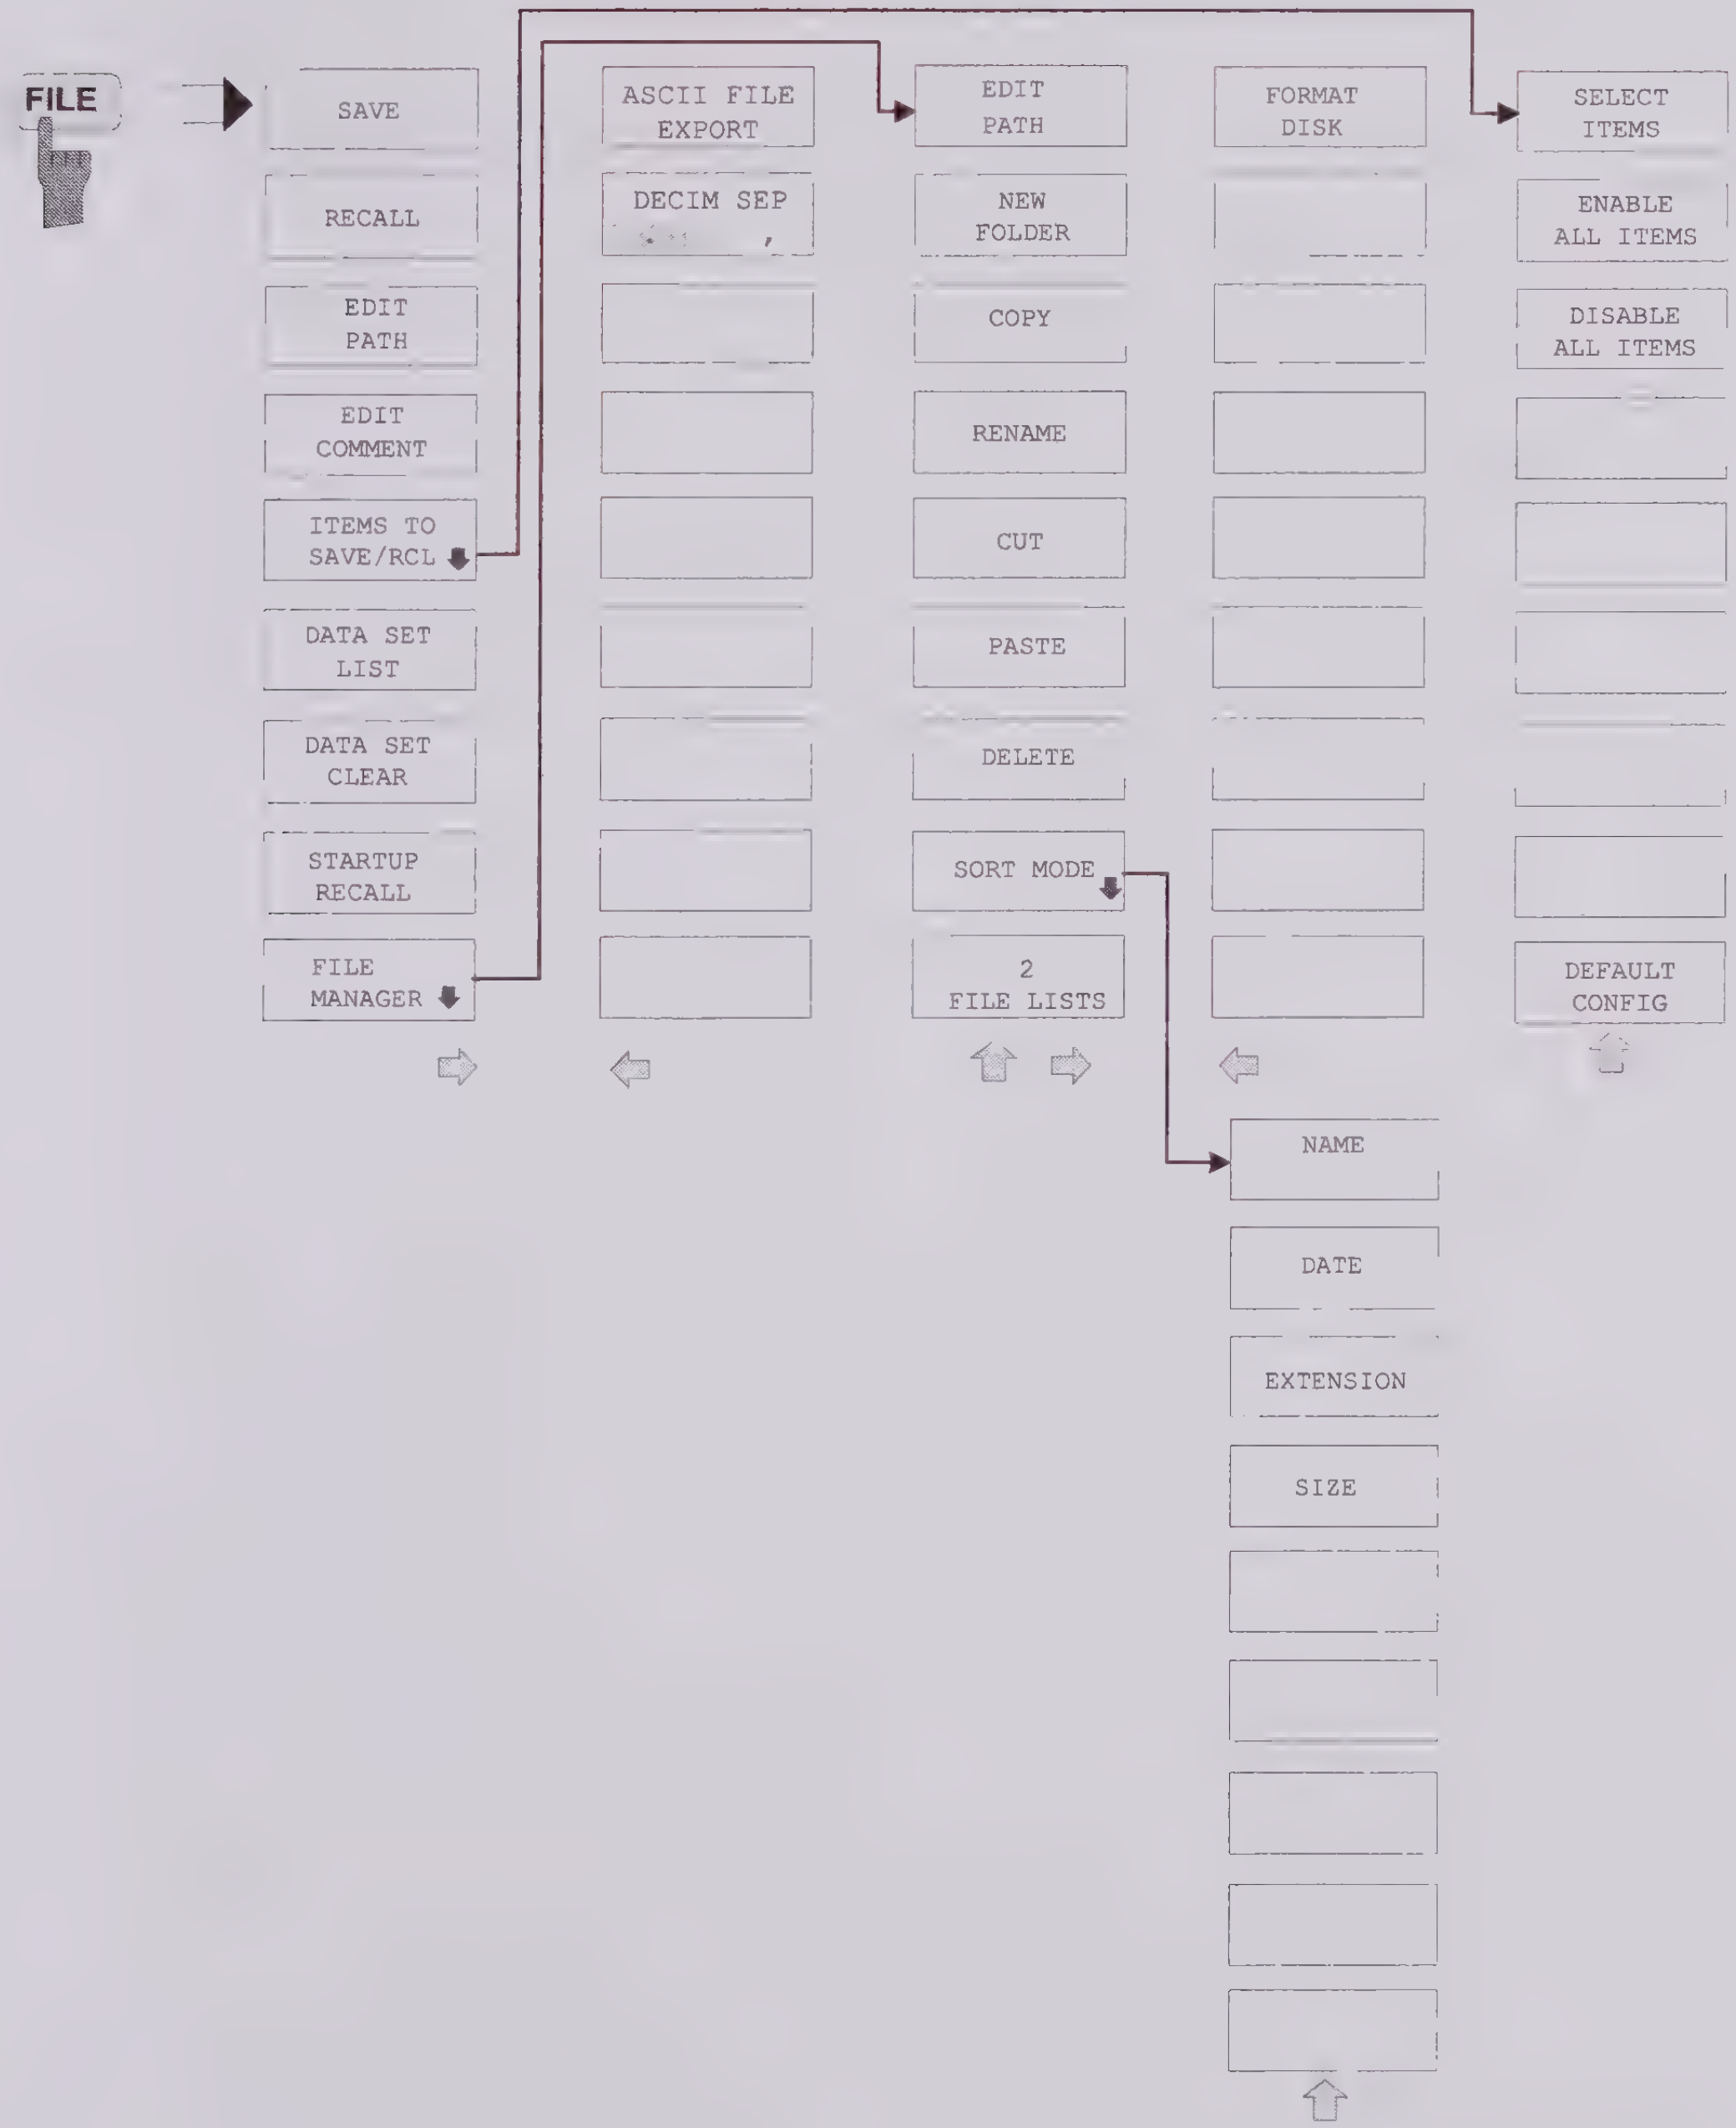
FILE
SAVE
RECALL
EDIT PATH
EDIT COMMENT
ITEMS TO SAVE/RCL
DATA SET LIST
DATA SET CLEAR
STARTUP RECALL
FILE MANAGER
ASCII FILE EXPORT
DECIM SEP
EDIT PATH
NEW FOLDER
COPY
RENAME
CUT
PASTE
DELETE
SORT MODE
2 FILE LISTS
FORMAT DISK
SELECT ITEMS
ENABLE ALL ITEMS
DISABLE ALL ITEMS
DEFAULT CONFIG
NAME
DATE
EXTENSION
SIZE

CAL Key

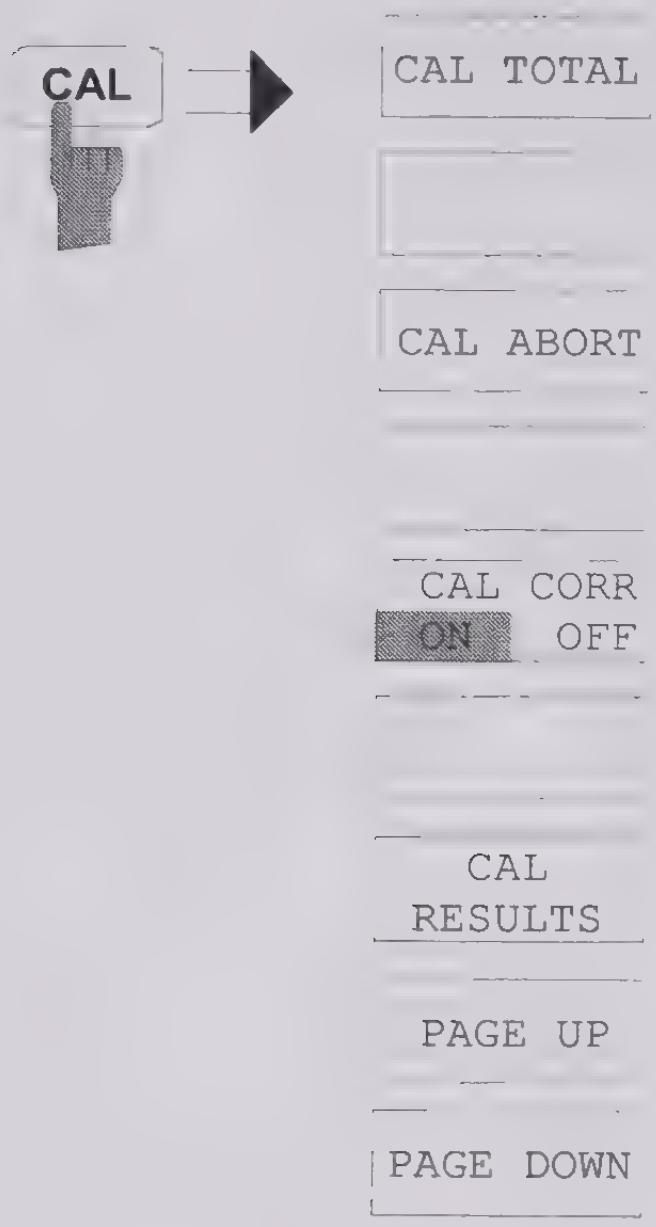
CAL
CAL TOTAL
CAL ABORT
CAL CORR ON OFF
CAL RESULTS
PAGE UP
PAGE DOWN

SETUP Key

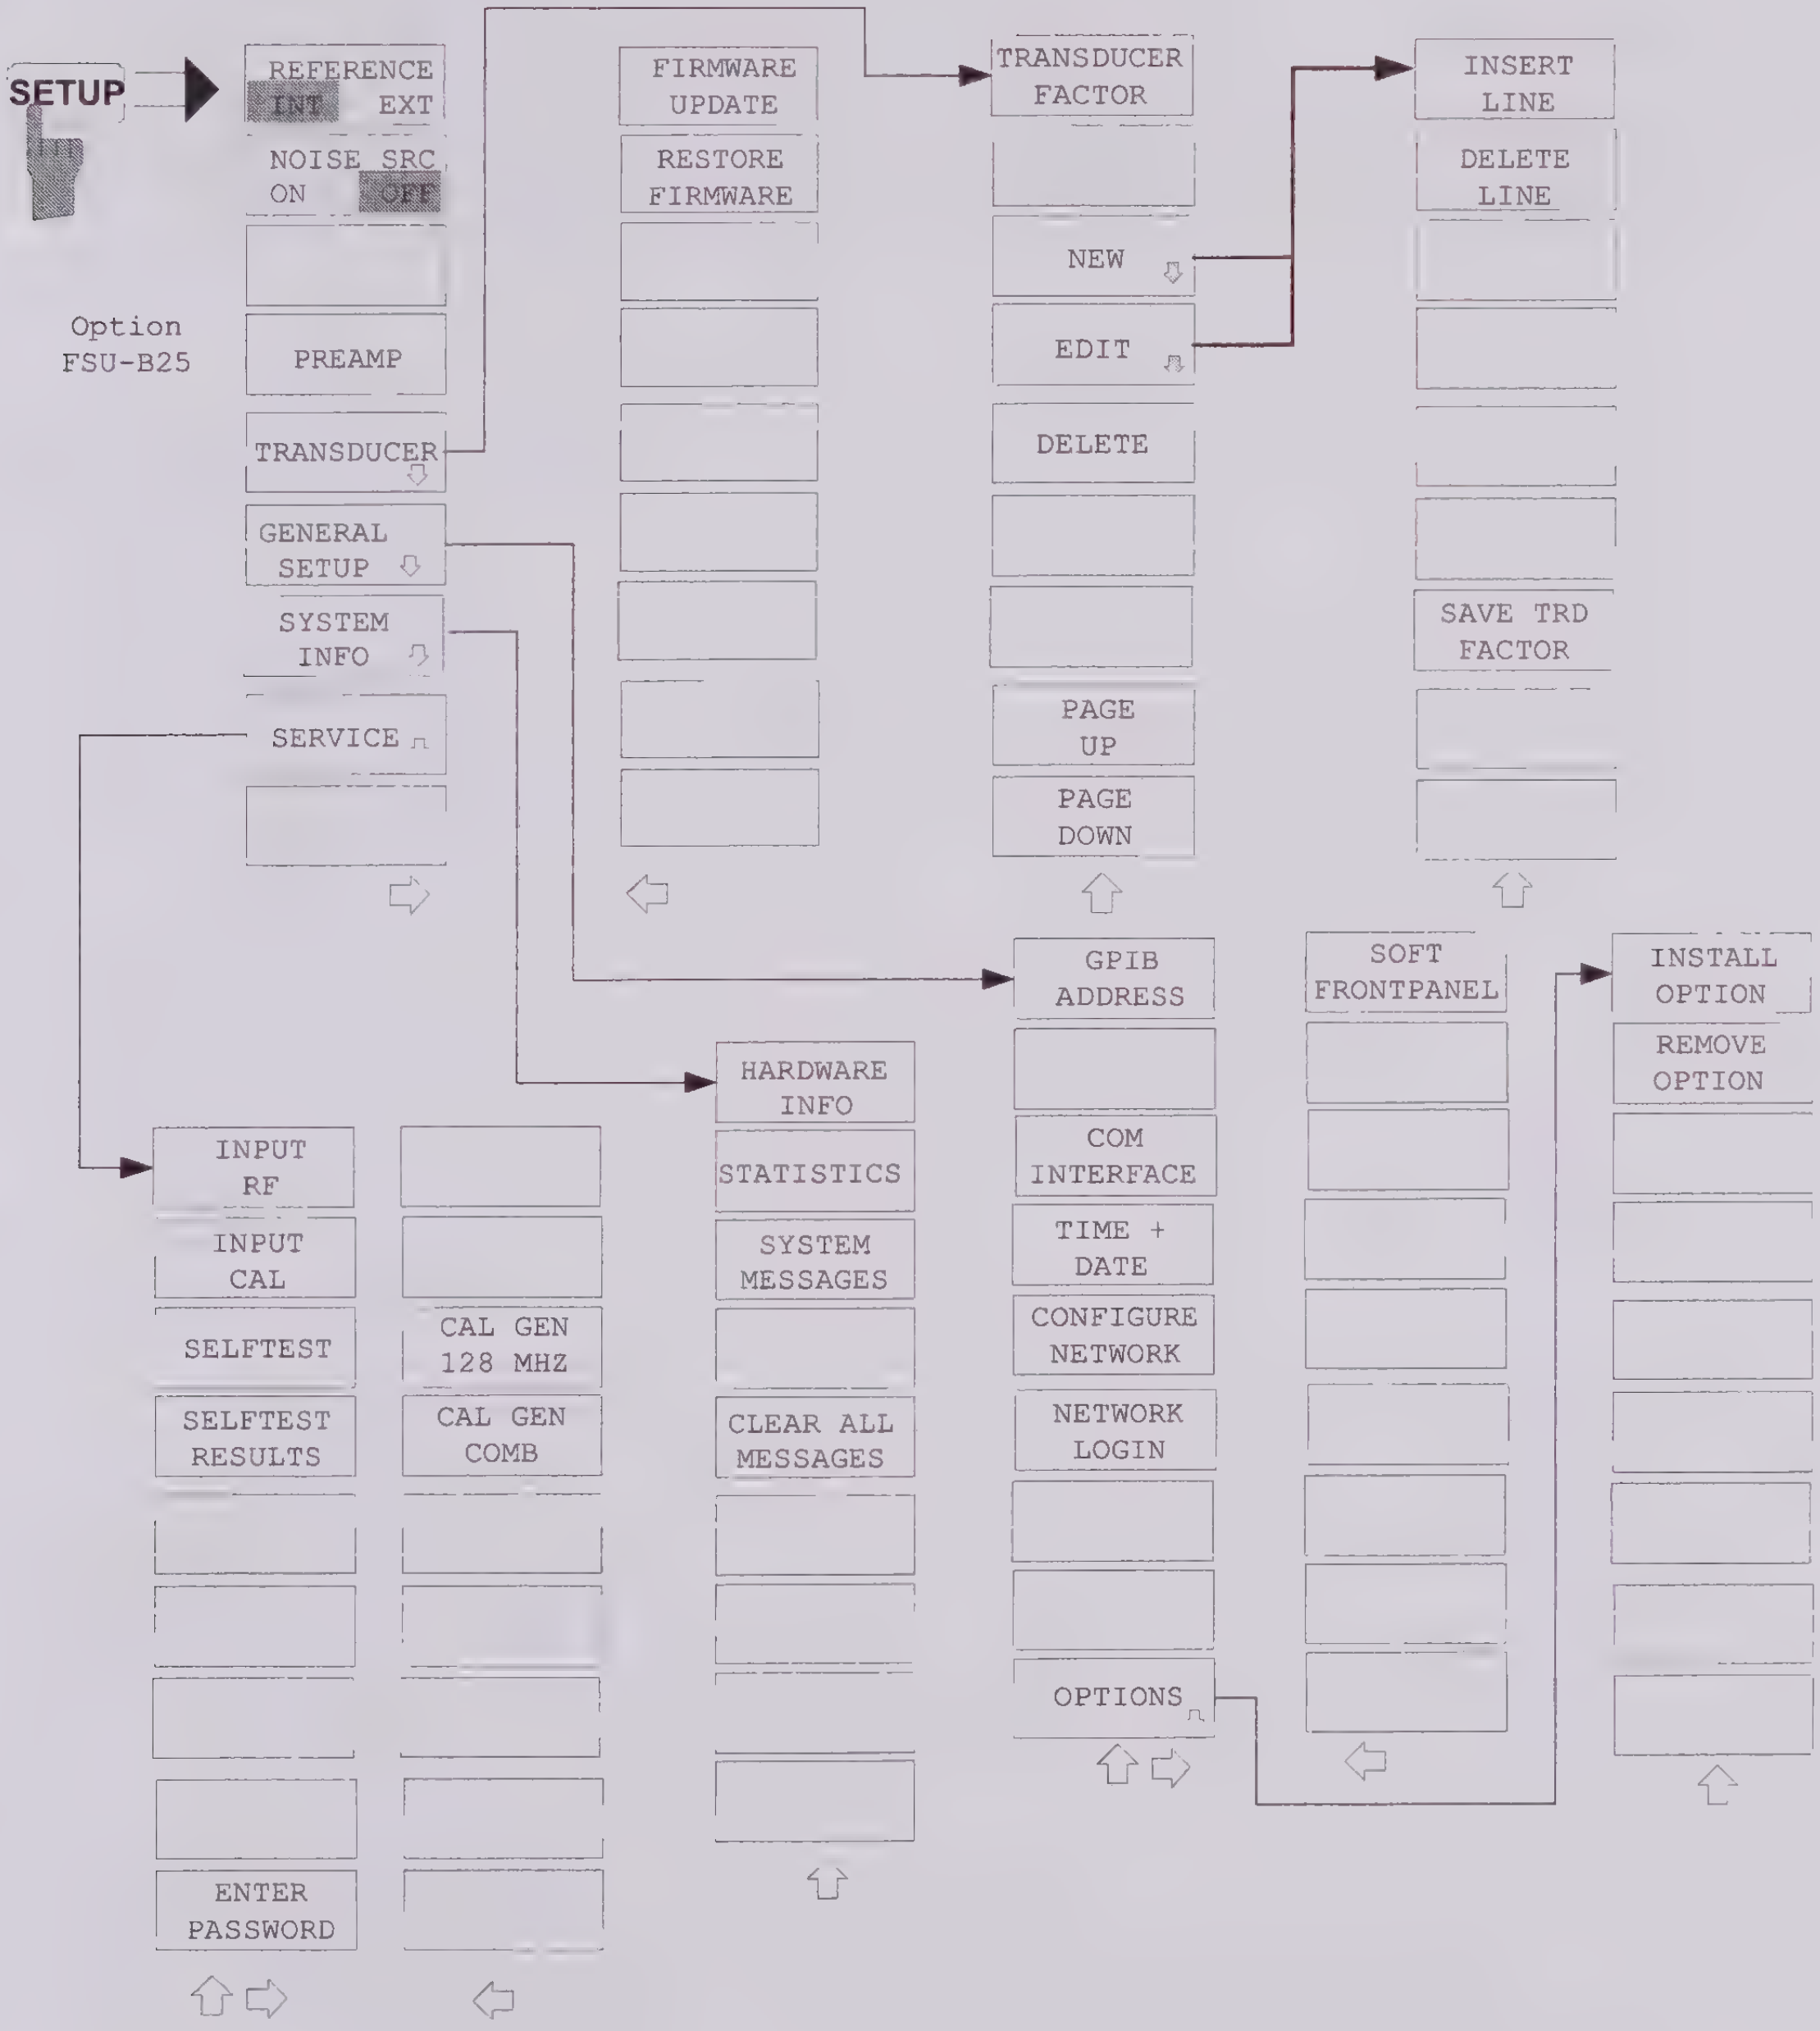
SETUP
REFERENCE INT EXT
NOISE SRC ON OFF
Option FSU-B25
PREAMP
TRANSDUCER
GENERAL SETUP
SYSTEM INFO
SERVICE
FIRMWARE UPDATE
RESTORE FIRMWARE
TRANSDUCER FACTOR
NEW
EDIT
DELETE
PAGE UP
PAGE DOWN
INSERT LINE
DELETE LINE
SAVE TRD FACTOR
GPIB ADDRESS
COM INTERFACE
TIME + DATE
CONFIGURE NETWORK
NETWORK LOGIN
OPTIONS
SOFT FRONTPANEL
INSTALL OPTION
REMOVE OPTION
HARDWARE INFO
STATISTICS
SYSTEM MESSAGES
CLEAR ALL MESSAGES
INPUT RF
INPUT CAL
SELFTEST
SELFTEST RESULTS
ENTER PASSWORD
CAL GEN 128 MHZ
CAL GEN COMB

HCOPY Key

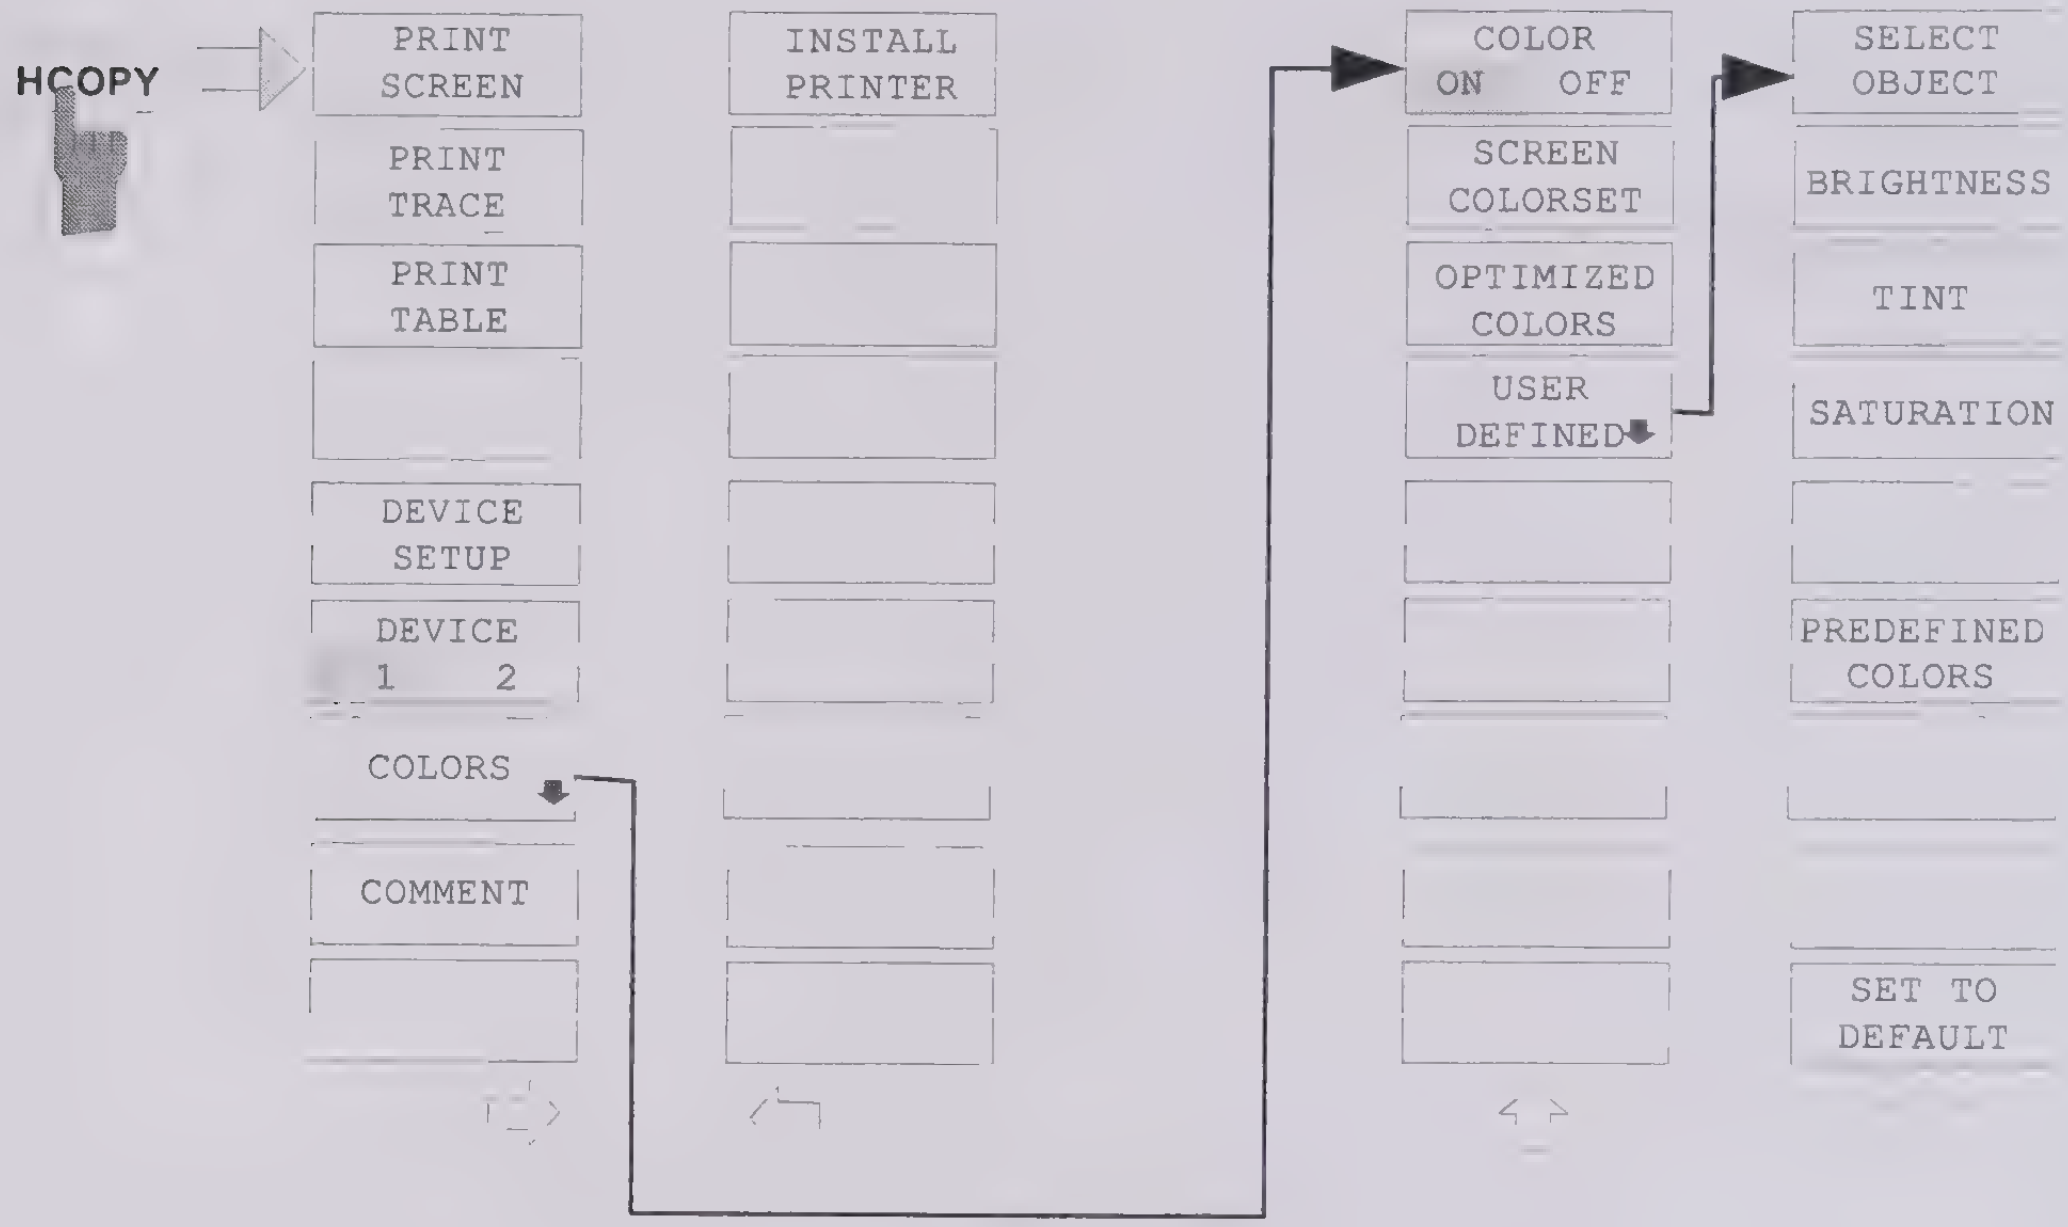
HCOPY
PRINT SCREEN
PRINT TRACE
PRINT TABLE
DEVICE SETUP
DEVICE 1 2
COLORS
COMMENT
INSTALL PRINTER
COLOR ON OFF
SCREEN COLORSET
OPTIMIZED COLORS
USER DEFINED
SELECT OBJECT
BRIGHTNESS
TINT
SATURATION
PREDEFINED COLORS
SET TO DEFAULT

Hotkey Menu

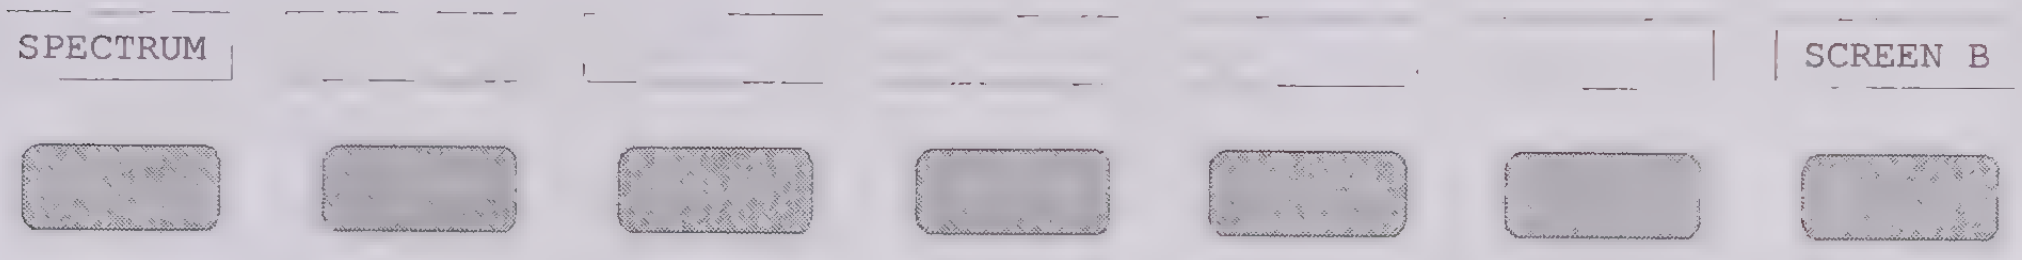

LOCAL Menu

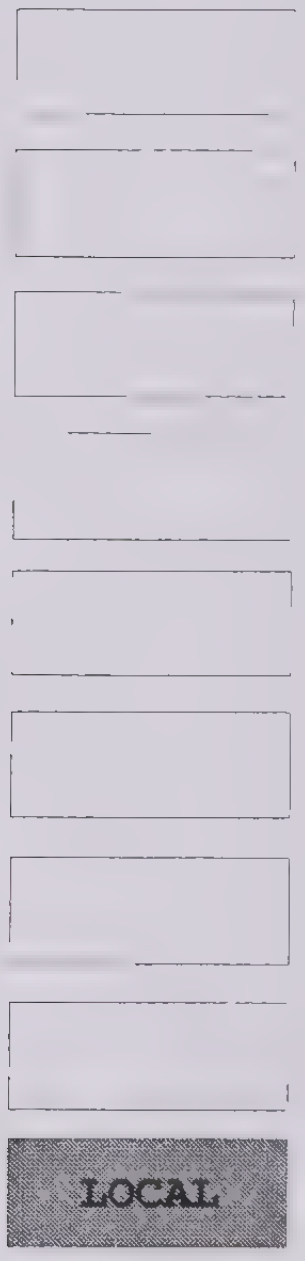

Menu Overview Ext. Generator Control

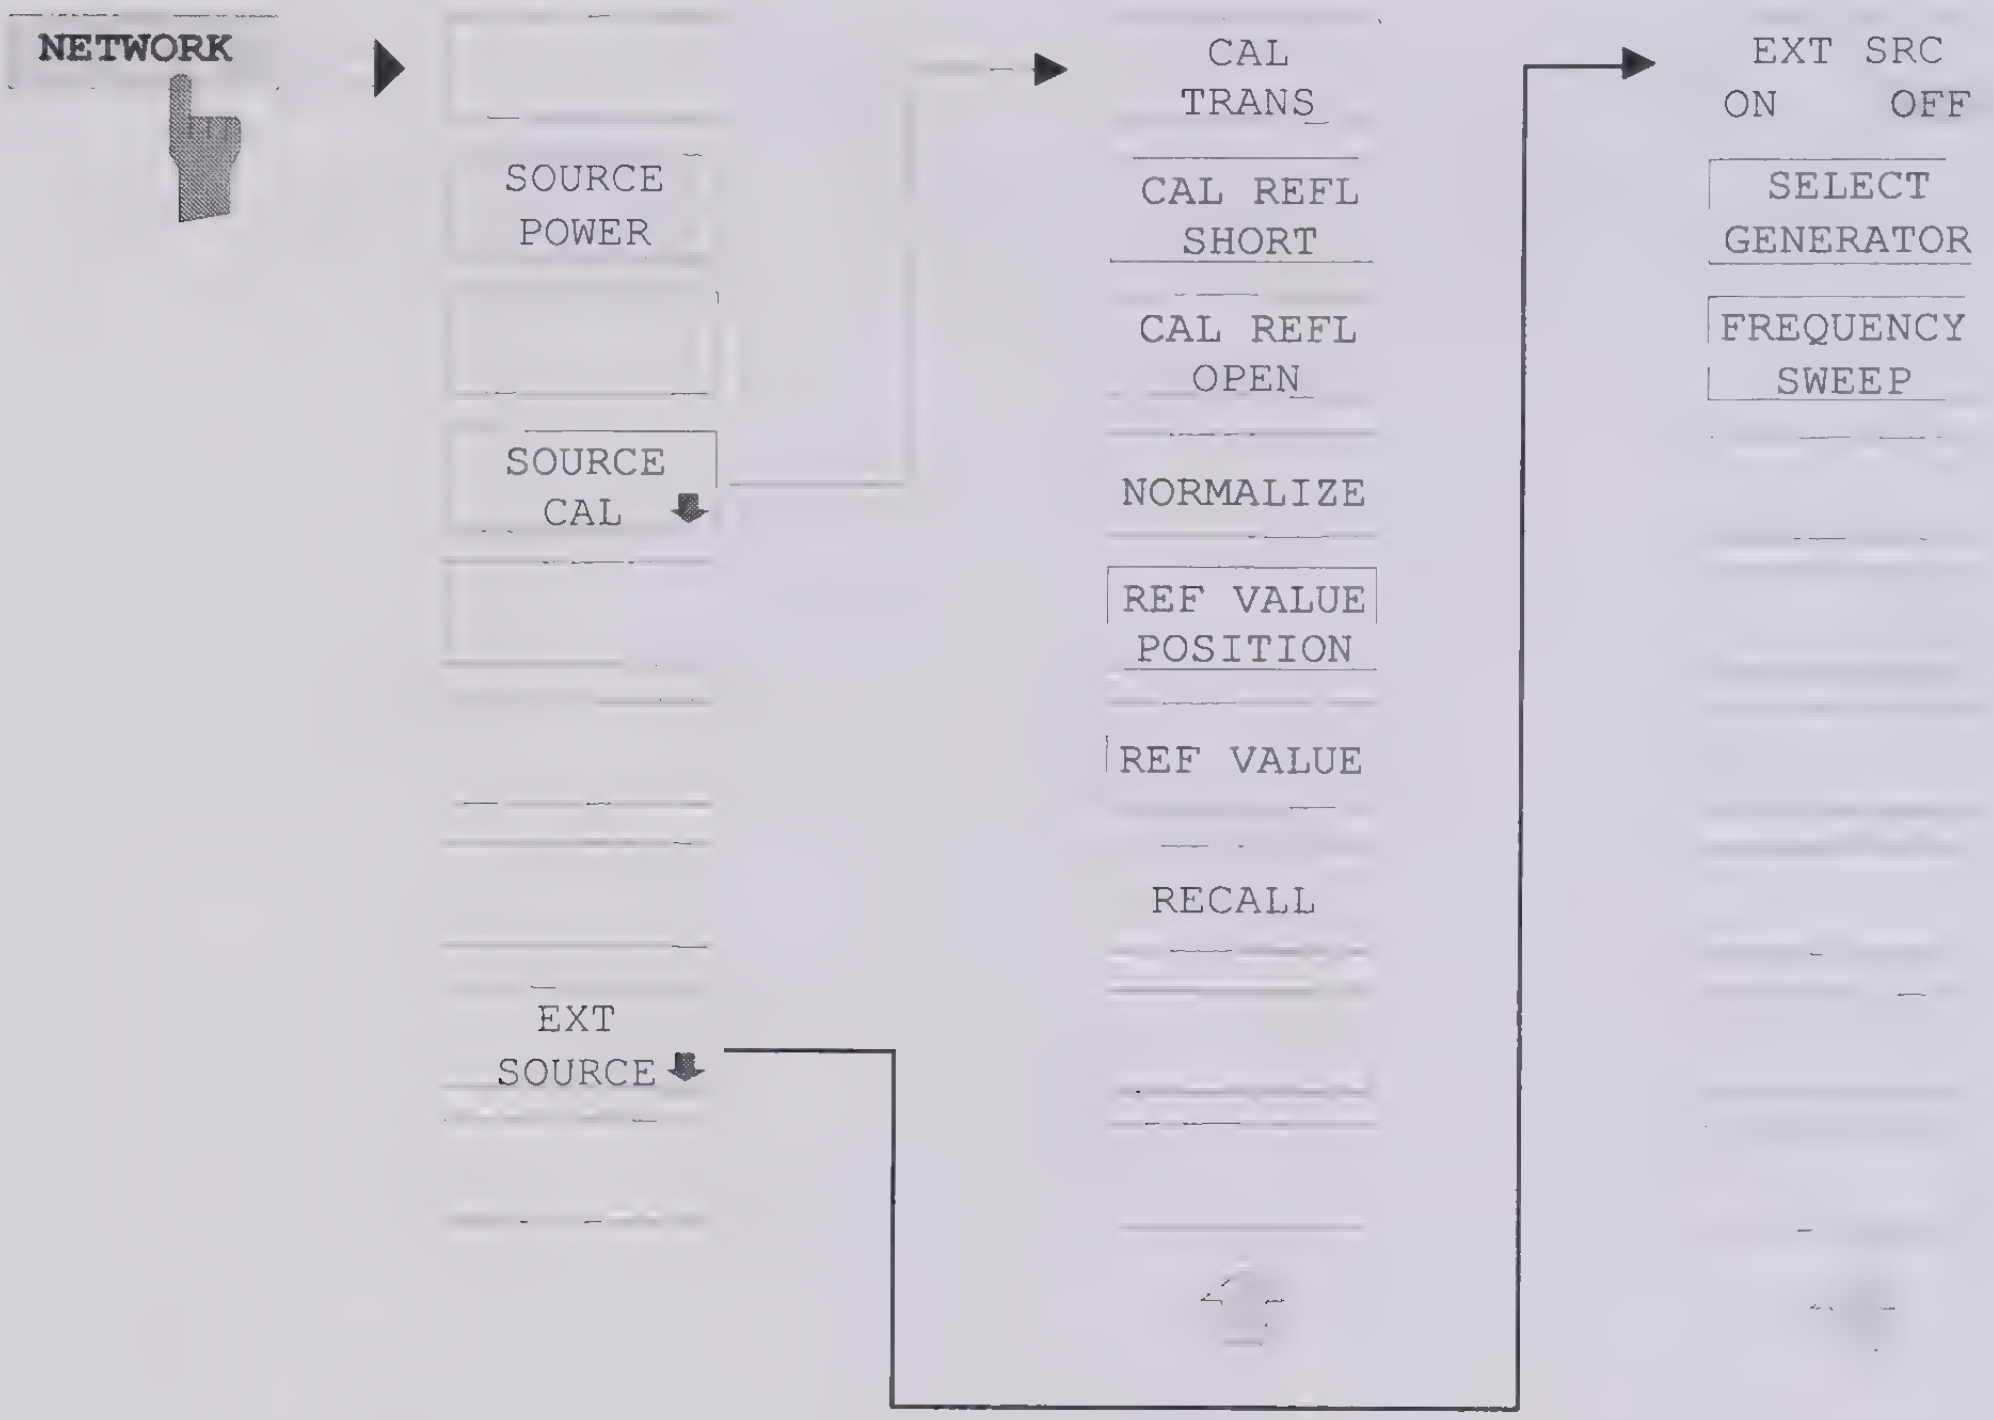

Menu Overview Option Network Mode

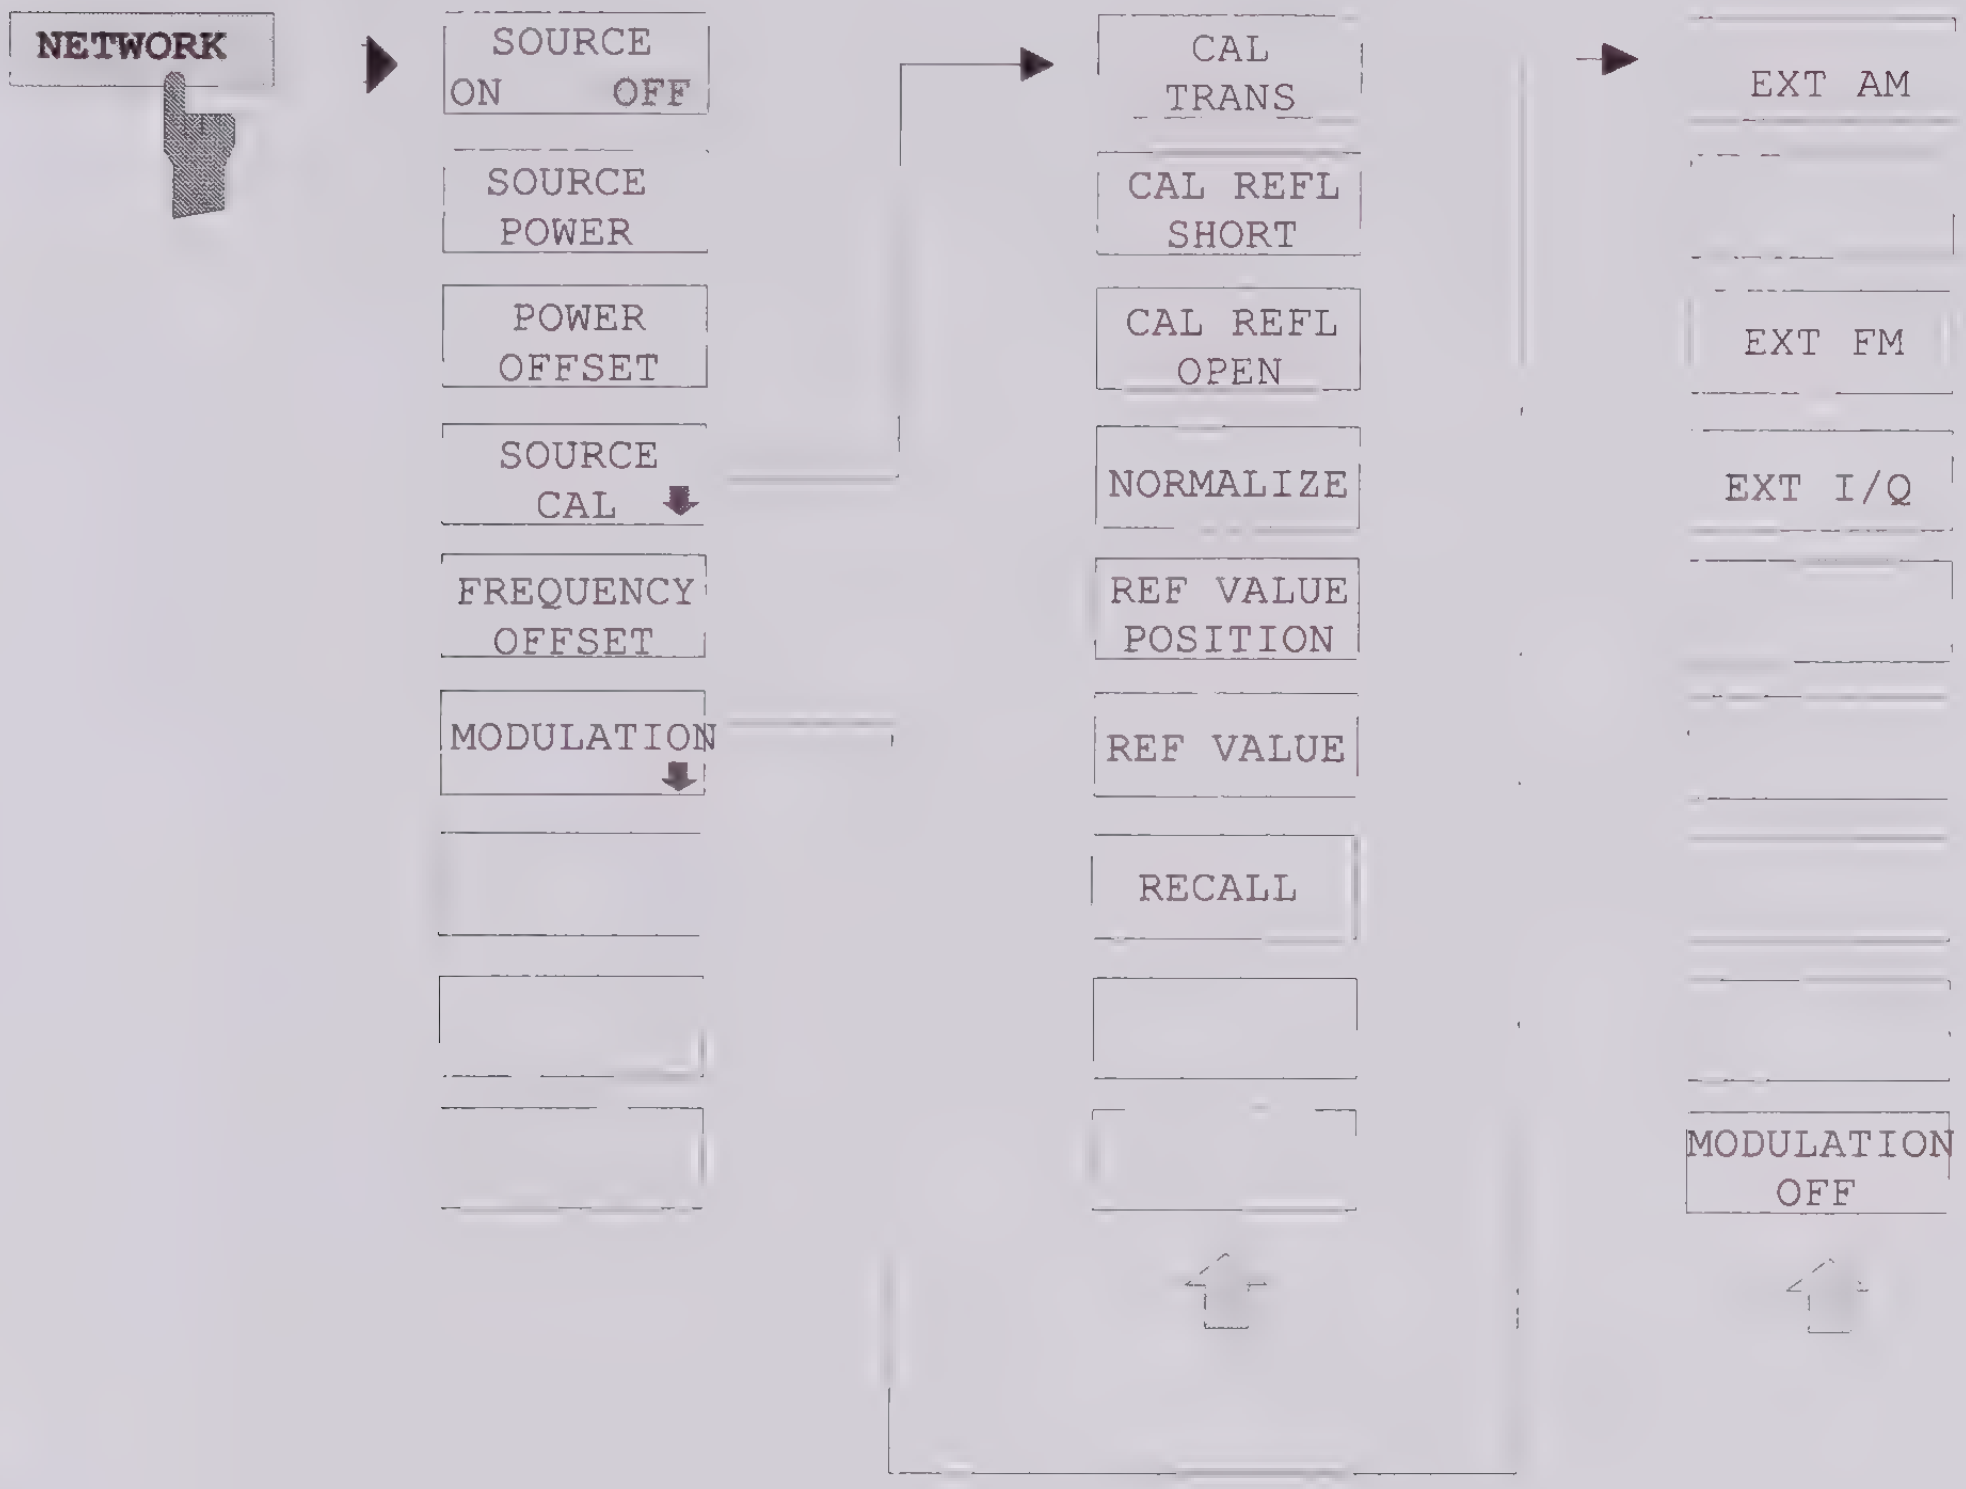

Contents - Chapter 4 "Instrument Functions"

4 Instrument Functions 4.1

R&S FSU Initial Configuration – PRESET Key 4.1-1

Selecting the Operating Mode – *HOTKEY* Bar 4.2-1

Return to manual control – *LOCAL* Menu 4.3-1

Measurement Receiver Mode 4.4-1

- Selective Level Measurement – *RF LEVEL* Key 4.4-2
- Level Measurement with the Power Sensor – *PWR METER* Key 4.4-7
- Modulation Measurements – *DEMOD* Key 4.4-15
- Measurements on the Audio Input – *AUDIO* Key 4.4-26
- Setting the Receiver Frequency and the Span – *FREQ* Key 4.4-30
- Setting the Level Display and Configuring the RF Input – *AMPT* Key 4.4-32
- Setting the Bandwidths and the Measurement Time – *BW* Key 4.4-37
- Setting the Sweep – *SWEEP/MEAS* Keys 4.4-39
- Setting the Span – *SPAN* Key 4.4-42

Spectrum Analyzer Mode 4.5.1

- Frequency and Span Selection – *FREQ* Key 4.5.1
- Setting the Frequency Span – SPAN Key 4.6-1
- Level Display Setting and RF Input Configuration – AMPT Key 4.7-1
  - Electronic Attenuator 4.7-5
- Setting the Bandwidths and Sweep Time – BW Key 4.8-1
  - List of available channel filters 4.8-9
- Sweep Settings – SWEEP Key 4.9-1
- Triggering the Sweep – TRIG Key 4.10-1
  - Menu TRIG - NEXT 4.10-8
- Selection and Setting of Traces – TRACE Key 4.11-1
  - Selection of Trace Function 4.11-1
  - Selection of Detector 4.11-9
  - Mathematical Functions for Traces 4.11-14
- Recording the Correction Data of R&S FSMR – CAL Key 4.12-1
- Markers and Delta Markers – MKR Key 4.13-1
  - Frequency Measurement with the Frequency Counter 4.13-3
- Marker Functions – MKR FCTN Key 4.14-1
  - Activating the Markers 4.14-2
  - Measurement of Noise Density 4.14-2
  - Phase Noise Measurement 4.14-4
  - Measurement of the Filter or Signal Bandwidth 4.14-6
  - Measurement of a Peak List 4.14-7
  - AF Demodulation 4.14-9
  - Selecting the Trace 4.14-10
- Change of Settings via Markers – MKR ⇒ Key 4.15-1
- Power Measurements – Hardkey MEAS 4.16-1
  - Power Measurement in Time Domain 4.16-2
  - Channel and Adjacent-Channel Power Measurements 4.16-7
  - Setting the Channel Configuration 4.16-14
  - Measurement of Signal Amplitude Statistics 4.16-26
  - Measurement of Carrier/Noise Ratio C/N and C/N$_0$ 4.16-32

Measurement of the AM Modulation Depth 4.16-34
Measurement of the Third Order Intercept (TOI) 4.16-35

Setup of Limit Lines and Display Lines – LINES Key 4.17-1
Selection of Limit Lines 4.17-2
Entry and Editing of Limit Lines 4.17-6
Display Lines 4.17-11

Configuration of Screen Display – DISP Key 4.18-1

Instrument Setup and Interface Configuration – *SETUP* Key 4.19-1
External Reference 4.19-2
External Noise Source 4.19-2
RF Preamplifier 4.19-3
Transducer 4.19-3
Activating Transducer Factors 4.19-3
Entry and Editing of Transducer Factors 4.19-6
Programming the Interface Configuration and Time Setup 4.19-10
Selecting the IEC/IEEE-Bus Address 4.19-10
Serial Interface Configuration 4.19-12
Setting Date and Time 4.19-15
Configuration of Network Settings FSU 4.19-16
Enabling Firmware Options 4.19-18
Emulation of the Instrument Front Panel 4.19-19
System Information 4.19-20
Display of Module Data 4.19-21
Display of Device Statistics 4.19-22
Display of System Messages 4.19-23
Service Menu 4.19-24
General Service Functions 4.19-25
Selftest 4.19-26
Hardware Adjustment 4.19-27
Firmware Update 4.19-27

Saving and Recalling Data Sets – *FILE* Key 4.20-1
Overview 4.20-1
Storing a Device Configuration 4.20-2
Storing a Complete Device Configuration 4.20-2
Storing Parts of a Device Configuration 4.20-2
Loading a Data Set: 4.20-3
Automatic Loading of a Data Set during Booting 4.20-4
Copying Data Sets to Disk 4.20-4
EnteringText with the Help Line Editor 4.20-5
Description of the Individual Softkeys 4.20-6
Operating Concept of File Managers 4.20-13

Measurement Documentation – *HCOPY* Key 4.21-1
HCOPY menu: 4.21-1
Selecting Printer, Clipboard and File Formats 4.21-4
File formats 4.21-4
Clipboard 4.21-4
Printer 4.21-5
Selecting Alternative Printer Configurations 4.21-6
Selecting Printer Colours 4.21-6
Entering a Text with the Auxiliary Line Editor 4.21-9

  - Installation of Plug&Play Printers 4.21-10
  - Installation of Non-Plug&Play Printers 4.21-10
    - Local Printer 4.21-11
  - Network Printer 4.21-15

Tracking Generator - Option R&S FSU-B9 4.22-1

- Tracking Generator Settings 4.22-2
- Transmission Measurement 4.22-4
  - Calibration of Transmission Measurement 4.22-5
  - Normalization 4.22-7
- Reflection Measurement 4.22-11
  - Calibration of Reflection Measurement 4.22-12
- Calibration mechanism 4.22-13
- Frequency-Converting Measurements 4.22-14
- External Modulation of the Tracking Generator 4.22-16

External Generator Control 4.23-1

- External Generator Settings 4.23-2
- Transmission Measurement 4.23-3
  - Calibration of Transmission Measurement 4.23-3
  - Normalization: 4.23-5
- Reflection Measurement 4.23-9
  - Calibration of Reflection Measurement 4.23-9
- Calibration mechanism 4.23-10
- Frequency-converting Measurements 4.23-11
- Configuration of an External Generator 4.23-12
- List of Generator Types Supported by the R&S FSMR 4.23-14

LAN Interface 4.24-1

- Connecting the Instrument to the Network 4.24-1
- Installing the Software 4.24-1
  - Installation of Drivers for the Network Card 4.24-1
  - Configuration of Available Network Protocols (TCP/IP Protocol) 4.24-3
  - Installation of Further Network Protocols and Services (e.g. Novell Netware Support) 4.24-6
  - Examples of Configurations 4.24-8
  - Subsequent Changing of the Network Configuration (Computer Name, Domain, Workgroup, etc) 4.24-9
  - Operating the Instrument without a Network 4.24-10
- Operating the Instrument on the Network 4.24-11
  - NOVELL Networks 4.24-11
  - MICROSOFT Network 4.24-11
  - Defining Users 4.24-12
  - Changing the User Password 4.24-14
  - Login in the Network 4.24-17
  - Disabling the Autologin Mechanism 4.24-17
  - Reenabling the Autologin Mechanism 4.24-17
  - Using Network Drives 4.24-18
  - Printing on a Network Printer 4.24-20
- Remote Monitoring of R&S R&S FSMR via XP Remote Desktop 4.24-25
  - Introduction 4.24-25
  - Configuration of R&S R&S FSMR for Using Remote Desktop 4.24-26
  - Configuration of Controller 4.24-27
  - Setting up the Connection with the R&S R&S FSMR 4.24-31

Interruption and Re-setup of Remote Desktop Connection with the R&S R&S FSMR 4.24-32
Switching off the R&S R&S FSMR from the Controller 4.24-33
Remote Data Transfer with TCP/IP Services 4.24-33
File Transfer via FTP 4.24-33

RSIB Protocol 4.24-35

Remote Control via RSIB Protocol 4.24-35
Windows Environment 4.24-35
UNIX Environment 4.24-36

RSIB Interface Functions 4.24-37

Overview of Interface Functions 4.24-37
Variables ibsta, iberr, ibcntl 4.24-38
Description of Interface Functions 4.24-39

Programming via the RSIB Protocol 4.24-45
Visual Basic 4.24-45
Visual Basic for Applications (Winword and Excel) 4.24-48
C / C++ 4.24-49

4 Instrument Functions

All functions of the spectrum analyzer and their application are explained in detail in this chapter. The sequence of the described menu groups depends on the procedure selected for the configuration and start of a measurement:

1. Resetting the instrument - *PRESET* key
2. Setting the mode – hotkey bar and *LOCAL* key
3. Setting the measurement parameters - keys *FREQ*, *SPAN*, *AMPT*, *BW*, *SWEEP*, *TRIG*, *TRACE*, *CAL*
4. Selecting and configuring the measurement function - keys *MKR*, *MKR->*, *MKR FCTN*, *MEAS*, *LINES*

The instrument functions for general settings, printout and data management are described at the end of this chapter – keys *DISP*, *SETUP*, *FILE* and *HCOPY*.

The different softkeys of a menu are described from top to bottom and from the left to the right side menu. The submenus are marked by an indentation or displayed in a separate section. The whole path (key - softkey - ...) is indicated in the line above the menu display.

An overview of the menus is given in chapter 3 which also contains the description of the operating concept.

The IEC/IEEE-bus commands (if any) are indicated for each softkey. For a fast overview a list of softkeys with the associated IEC/IEEE-bus commands is given at the end of Chapter 6.

An index at the end of the handbook serves as further help for the user.

R&S FSMR Initial Configuration – PRESET Key



The *PRESET* key sets the R&S FSMR to a predefined default state.
You can select between two different default states in the SETUP side menu. PRESET – RECEIVER is selected as standard. PRESET – ANALYZER is compatible with the Spectrum Analyzer R&S FSU and facilitates, for example, the development of a control software to control several of these instrument types.

Notes: *The setting is selected in such a way that the RF input is always protected from overload, provided the signal levels applied are within a range that is permissible for the instrument.*

The default setting performed with PRESET can be adapted to match your requirements by using the STARTUP RECALL function. In this case, the STARTUP RECALL data set is loaded by pressing the Preset key. For more information on STARTUP RECALL, see chapter "Saving and Recalling Data Sets".

After the *PRESET* key has been pressed, the R&S FSMR sets the selected default setting in accordance with table 1 or table 2:

Table 4.1-1 RECEIVER preset default setting

Parameter	Setting
Mode	measurement receiver
Center frequency	100 MHz
Center frequency step size	AUTO COARSE
RF attenuation	auto (10 dB)
Reference level	-20 dBm
Level range	100 dB log
Level unit	dBm
IF bandwidth	10 MHz
Demodulation bandwidth	1,6 MHz
Measurement time	100 ms
Averaging	off
Sweep	cont
Trigger	free run
Modulation mode	FM
Detector	+-peak/2 (demodulator)
Frequency offset	0 Hz
Reference level offset	0 dB
Reference level position	100%
Grid	abs
Cal correction	on
Noise source	off
Input	RF
Audio input	off
Display	split screen
Tracking generator (only with option R&S FSP-B9)	off
External generator 1/2 (only with option R&S FSP-B10)	off
Preamplifier	off
Preselector (only with option R&S FSMR-B2)	off
Power meter	off

Table 4.1-2 ANALYZER preset default setting

Parameter	Setting	
Mode	spectrum	
Center frequency	1.8 GHz / 13.25 GHz	(R&S FSMR 3/ 26)
Center frequency step size	0.1 * center frequency	
Span	3.6 GHz / 26.5	(R&S FSMR 3/ 26)
RF attenuation	auto (10 dB)	
Reference level	-20 dBm	
Level range	100 dB log	
Level unit	dBm	
Sweep time	auto	
Resolution bandwidth (Res BW)	auto (3 MHz)	
Video bandwidth (Video BW)	auto (10 MHz)	
FFT filters	off	
Span / RBW	50	
RBW / VBW	0.33	
Sweep	cont	
Trigger	free run	
Trace 1	clr write	
Trace 2/3	blank	
Detector	auto peak	
Trace math	off	
Frequency offset	0 Hz	
Reference level offset	0 dB	
Reference level position	100%	
Grid	abs	
Cal correction	on	
Noise source	off	
Input	RF	
Display	full screen, active screen A	

Selecting the Operating Mode – *HOTKEY* Bar

For fast mode selection, the R&S FSMR has seven hotkeys below the display which can be differently assigned, depending on the available instrument options and instrument modes.

The keys after instrument preset:

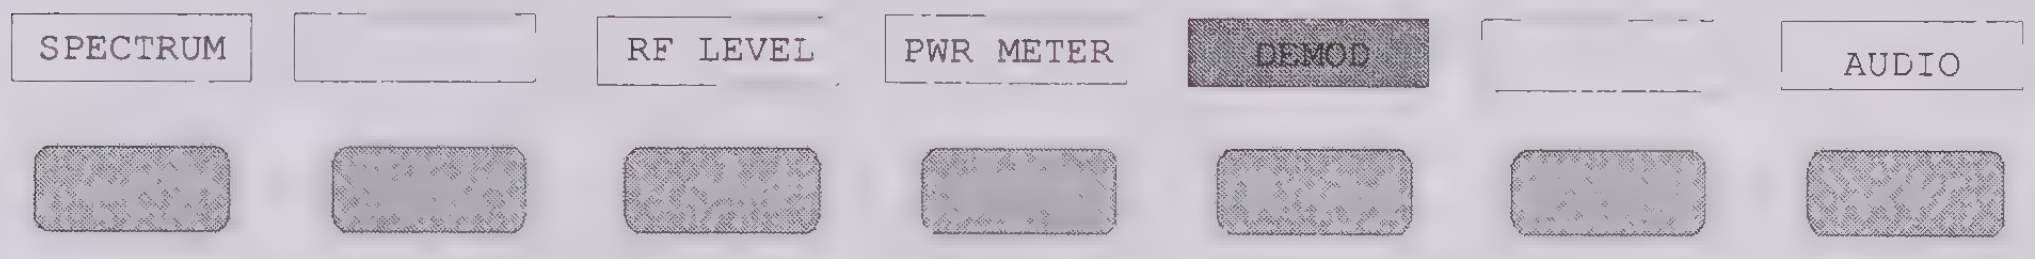

The keys in spectrum analysis mode:

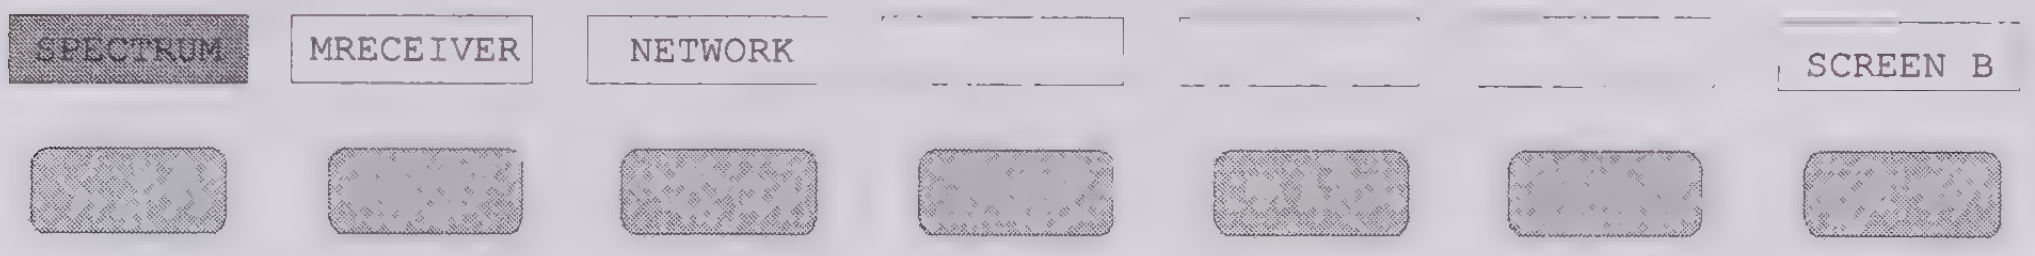

The *SPECTRUM* hotkey sets the R&S FSMR to spectrum analysis mode.

IEC/IEEE bus command: `INST:SEL SAN`

The *RF LEVEL* hotkey sets the R&S FSMR to Tuned RF Level mode.

IEC/IEEE bus command: `SENS:POW:AC:STAT ON`

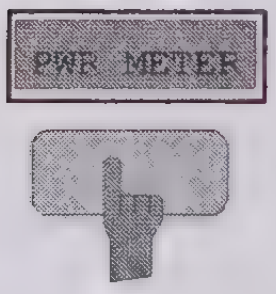

The *PWR METER* hotkey activates the level measurement with the power sensor or an external power meter.

IEC/IEEE bus command: `SENS:PMET:STAT ON`

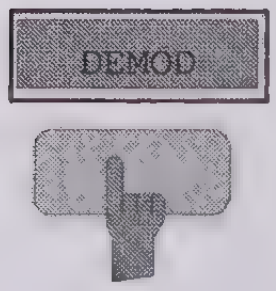

The *DEMOD* hotkey sets the R&S FSMR to modulation measurement mode.

IEC/IEEE bus command: `SENS:ADEM:STAT ON`

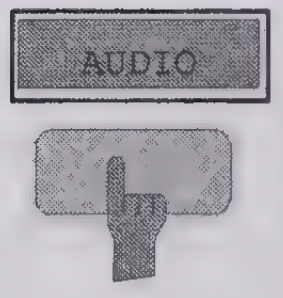

The *AUDIO* hotkey on the R&S FSMR activates the measurement of the signal applied at the audio input.

IEC/IEEE bus command: `INP AUDIO`

The *MRECEIVER* hotkey sets the R&S FSMR to measurement receiver mode.

IEC/IEEE bus command: `INST:SEL MREC`

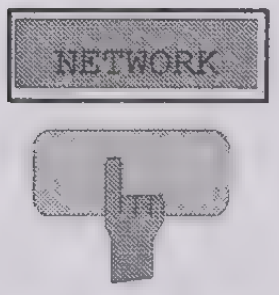

If the option R&S FSU-B9 is installed, the *NETWORK* hotkey activates the tracking generator or the control of an external generator (corresponds to the option R&S FSP-B10).

IEC/IEEE bus command: `OUTP:STAT ON`

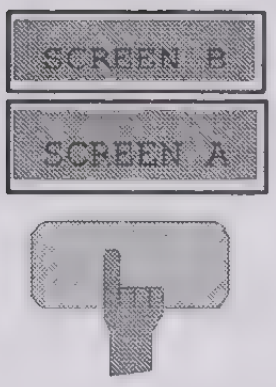

In FULL SCREEN mode, the *SCREEN A / SCREEN B* hotkey allows you to choose between two different instrument settings.
In SPLIT SCREEN mode, the key switches between the active diagrams A and B.
The key caption indicates which of the diagrams can be activated by pressing the key.
The currently active measurement window is specified by the display of A or B on the right-hand side of the diagram.

IEC/IEEE bus command: `DISP:WIND<1|2>:SEL A`

The meaning of the other keys is described in the chapter describing the various options.

Return to manual control – *LOCAL* Menu

The menu LOCAL is displayed on switching the instrument to remote control mode.

At the same time, the *HOTKEY* bar is blanked out and all keys are disabled except the *PRESET* key. The diagram, traces and display fields are then blanked out (they can be activated using the remote control command `SYSTem:DISPlay:UPDate ON`).

The menu contains only one softkey, the *LOCAL* key. The *LOCAL* key switches the instrument from remote to manual control, with the assumption that the remote controller has not previously set the LOCAL LOCKOUT function.

A change in the control mode consists of:

- **Enabling the Front Panel Keys**
  Returning to manual mode enables all inactive keys and turns on the hotkey menu. The soft key menu which is displayed is the main menu of the current mode.

  Inserting the measurement diagrams
  The blanked diagrams, traces and display fields are inserted.

- **Generating the message OPERATION COMPLETE**
  If, at the time of pressing the *LOCAL* softkey, the synchronisation mechanism via *OPC, *OPC? or *WAI is active, the currently running measurement procedure is aborted and synchronisation is achieved by setting the corresponding bits in the registers of the status reporting system.

- **Setting Bit 6 (User Request) of the Event Status Register**
  With a corresponding configuration of the status reporting system, this bit immediately causes the generation of a service request (*SRQ*) which is used to inform the control software that the user wishes to return to front-panel control. This information can be used, e.g., to interrupt the control program so that the user can make necessary manual corrections to instrument settings. This bit is set each time the *LOCAL* softkey is pressed.

Note: *If the LOCAL LOCKOUT function is active in the remote control mode, the front-panel PRESET key is also disabled. The LOCAL LOCKOUT state is left as soon as the process controller deactivates the REN line or the IEC/IEEE-bus cable is disconnected from the instrument.*

Measurement Receiver Mode

Use the *MRECEIVER* hotkey to select this operating mode
See also: Selecting the Operating Mode – Hotkey Bar.

RECEIVER menu:

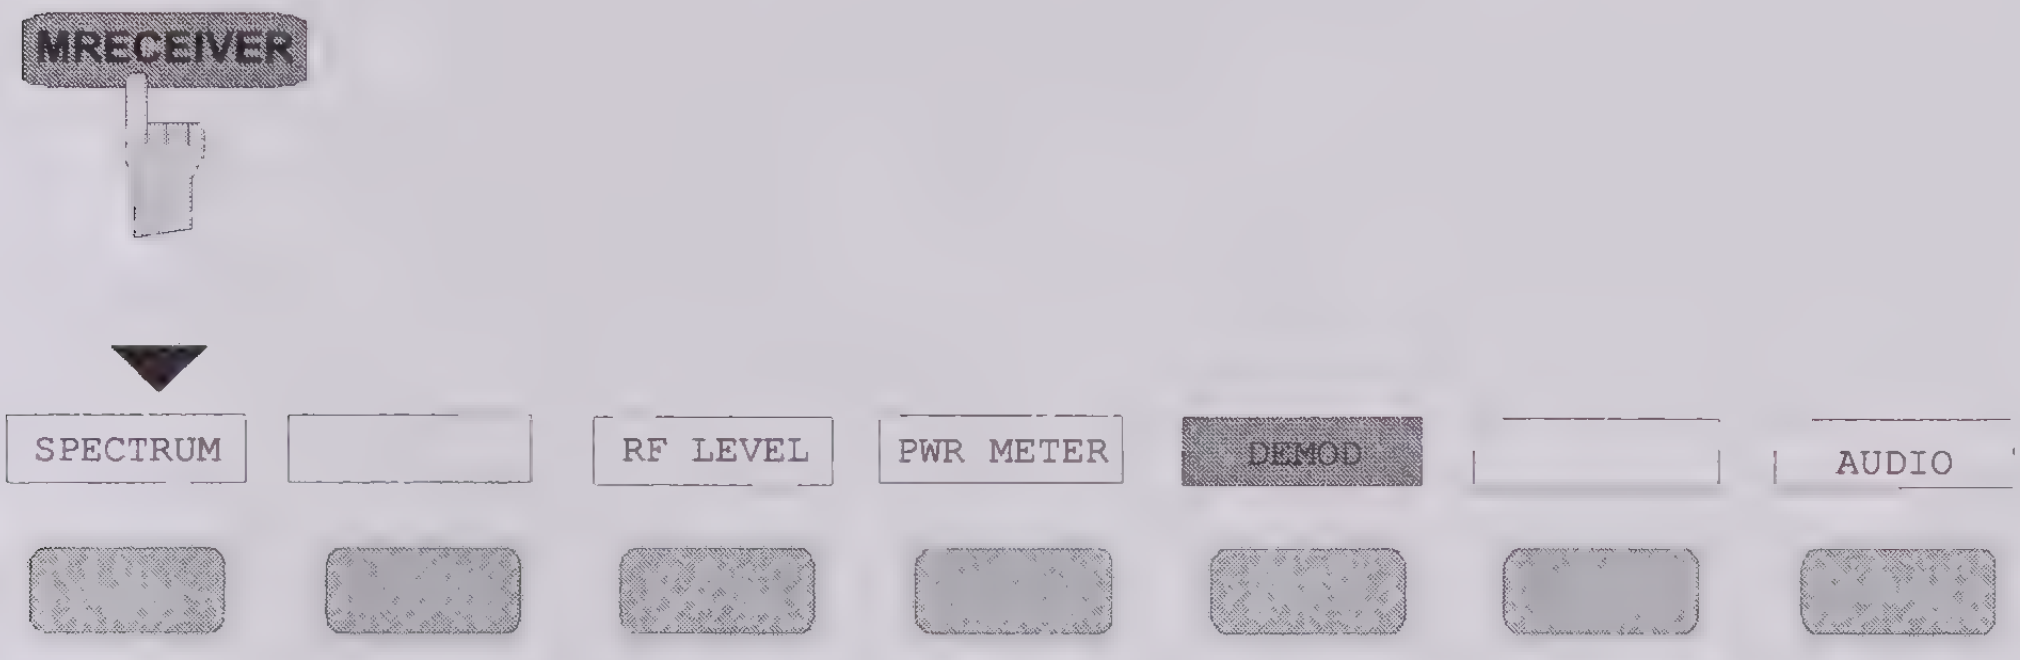

This operating mode corresponds to the instrument's default setting. You can access the spectrum analysis mode using the *SPECTRUM* hotkey.

The *MRECEIVER* (*measurement receiver*) hotkey selects the measurement receiver mode. The hotkey bar is assigned receiver-specific functions. A softkey menu suitable for the currently selected operating mode, i.e. *RF LEVEL, PWR METER, DEMOD or AUDIO*, is simultaneously displayed.

The individual settings are explained in the following menus:

RF LEVEL	Selective Level Measurement, page 4.4-2
PWR METER	Level Measurement with the Power Sensor, page 4.4-7
DEMOD	Modulation Measurements, page 4.4-15
AUDIO	Measurements on the Audio Input, page 4.4-26

IEC/IEEE bus command: `INST MREC`

In the Receiver mode, the R&S FSMR measures the level on the set frequency with the selected bandwidth and measurement time. Other signal parameters such as modulation depth and frequency deviation can additionally be determined. A whole gamut of AF filters allows you to weight the demodulated signal.

Selective Level Measurement – *RF LEVEL* Key

For highly accurate level measurements, you can calibrate absolute accuracy using a power meter as a reference and expand the linear measurement range with the aid of further calibrations.

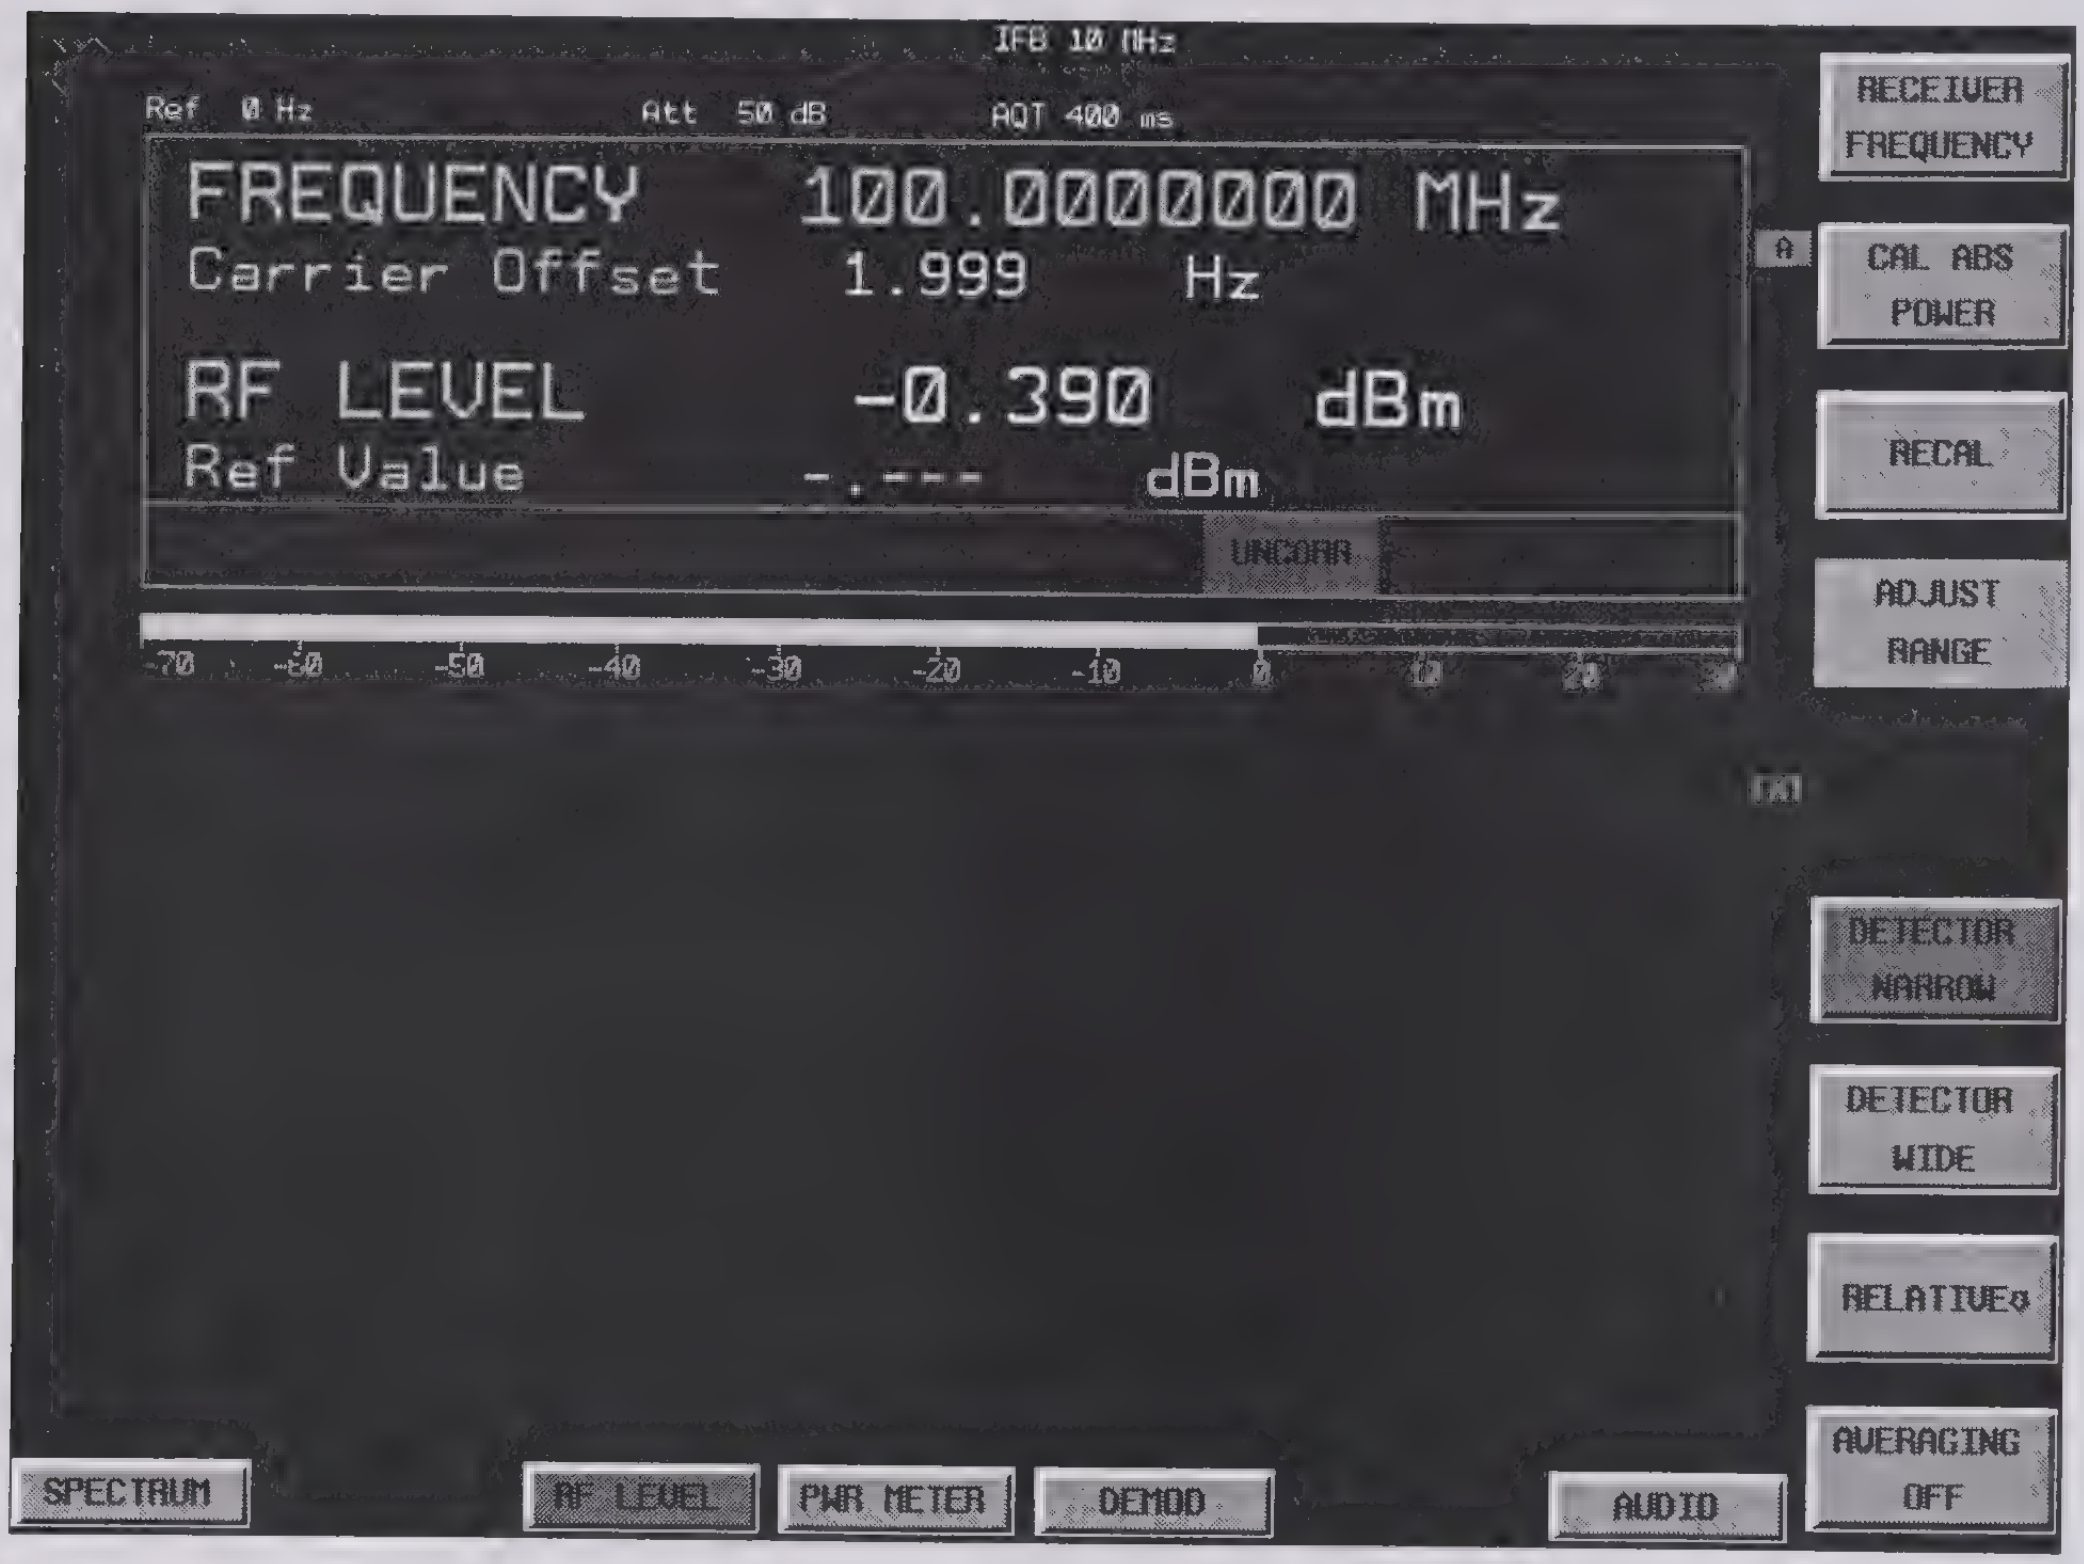

IFB 10 MHz
Ref 0 Hz Att 50 dB AQT 400 ms
FREQUENCY 100.0000000 MHz
Carrier Offset 1.999 Hz
RF LEVEL -0.390 dBm
Ref Value -.--- dBm
UNCORR

Fig. 4.4-1 RF level display

The RF LEVEL hotkey switches the R&S FSMR to the Tuned RF Level mode (selective level measurement) and opens a menu for configuring and controlling measurements.

IEC/IEEE bus command: `POW:AC:STAT ON`

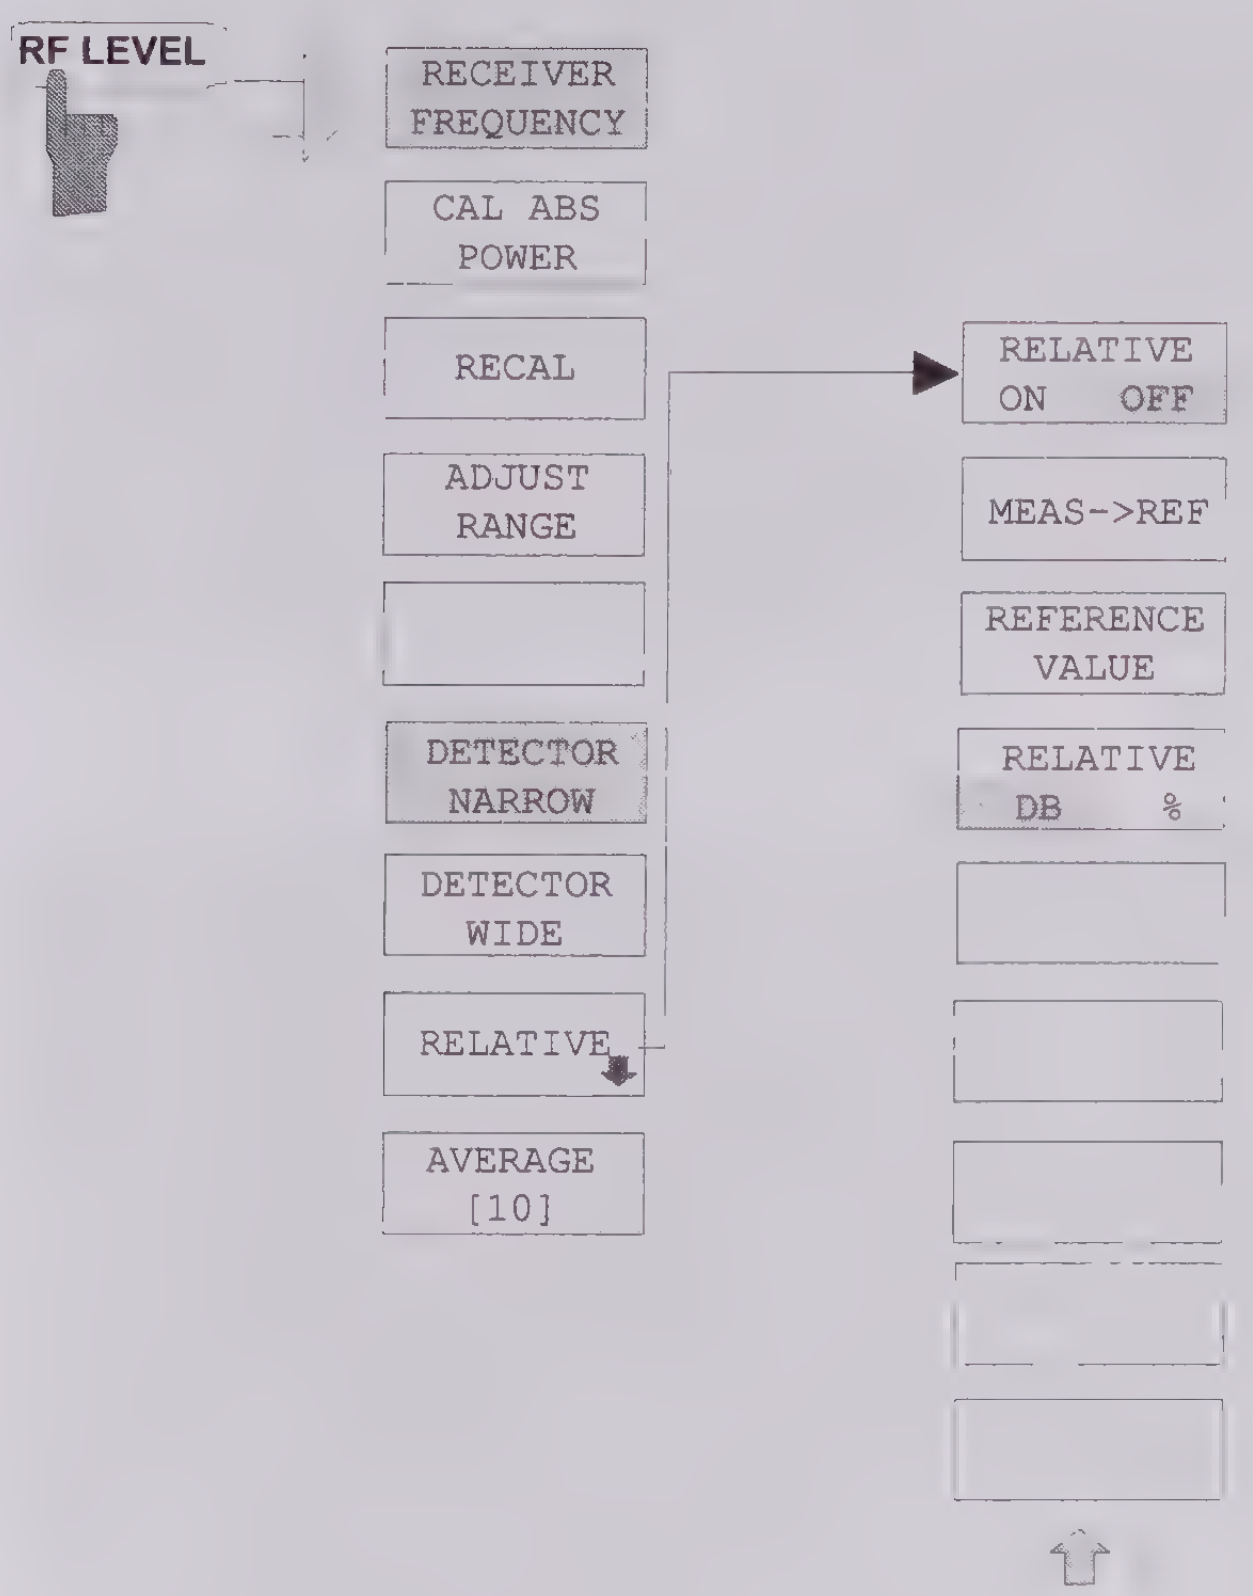

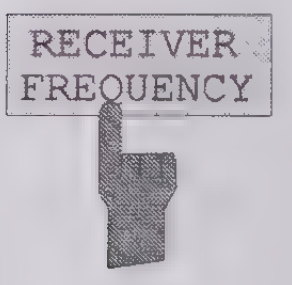

The *RECEIVER FREQUENCY* softkey activates the window for entering the receiver frequency.

The receiver frequency resolution is 0.1 Hz.
Setting range: 20 Hz ≤ f_{REC} ≤ f_{max}

Note: *This softkey is also available in the FREQ menu.*

IEC/IEEE bus command: `FREQ:CENT 300MHz`

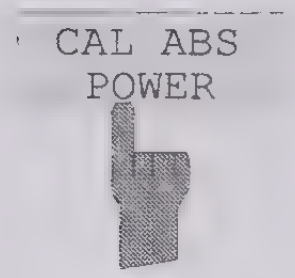

The *CAL ABS POWER* softkey starts the absolute calibration of the measurement path. For this purpose, a power sensor or an external power meter must be connected to the R&S FSMR.
The reference value is no longer valid if the following parameters are changed:

- Receive frequency
- Preamplification
- RF attenuation
- Coupling of RF input
- Preselection (YIG filter, option R&S FSMR-B2)
- IF bandwidth
- IF gain (*REF LEVEL*)
- Demodulation bandwidth
- Measurement time
- Detector
- Configuration of power splitter
- Total calibration (*CAL TOTAL*)

IEC/IEEE bus commands: -

`CORR:COLL PMET`	measures the reference level using the power meter
`CORR:COLL INP`	measures the reference value on the R&S FSMR RF input, which is then corrected using the reference level
`CORR:COLL PSPL`	subsequently measures the reference level and reference value; to do so, power meter and R&S FSMR RF input must be connected to the DUT via a power splitter

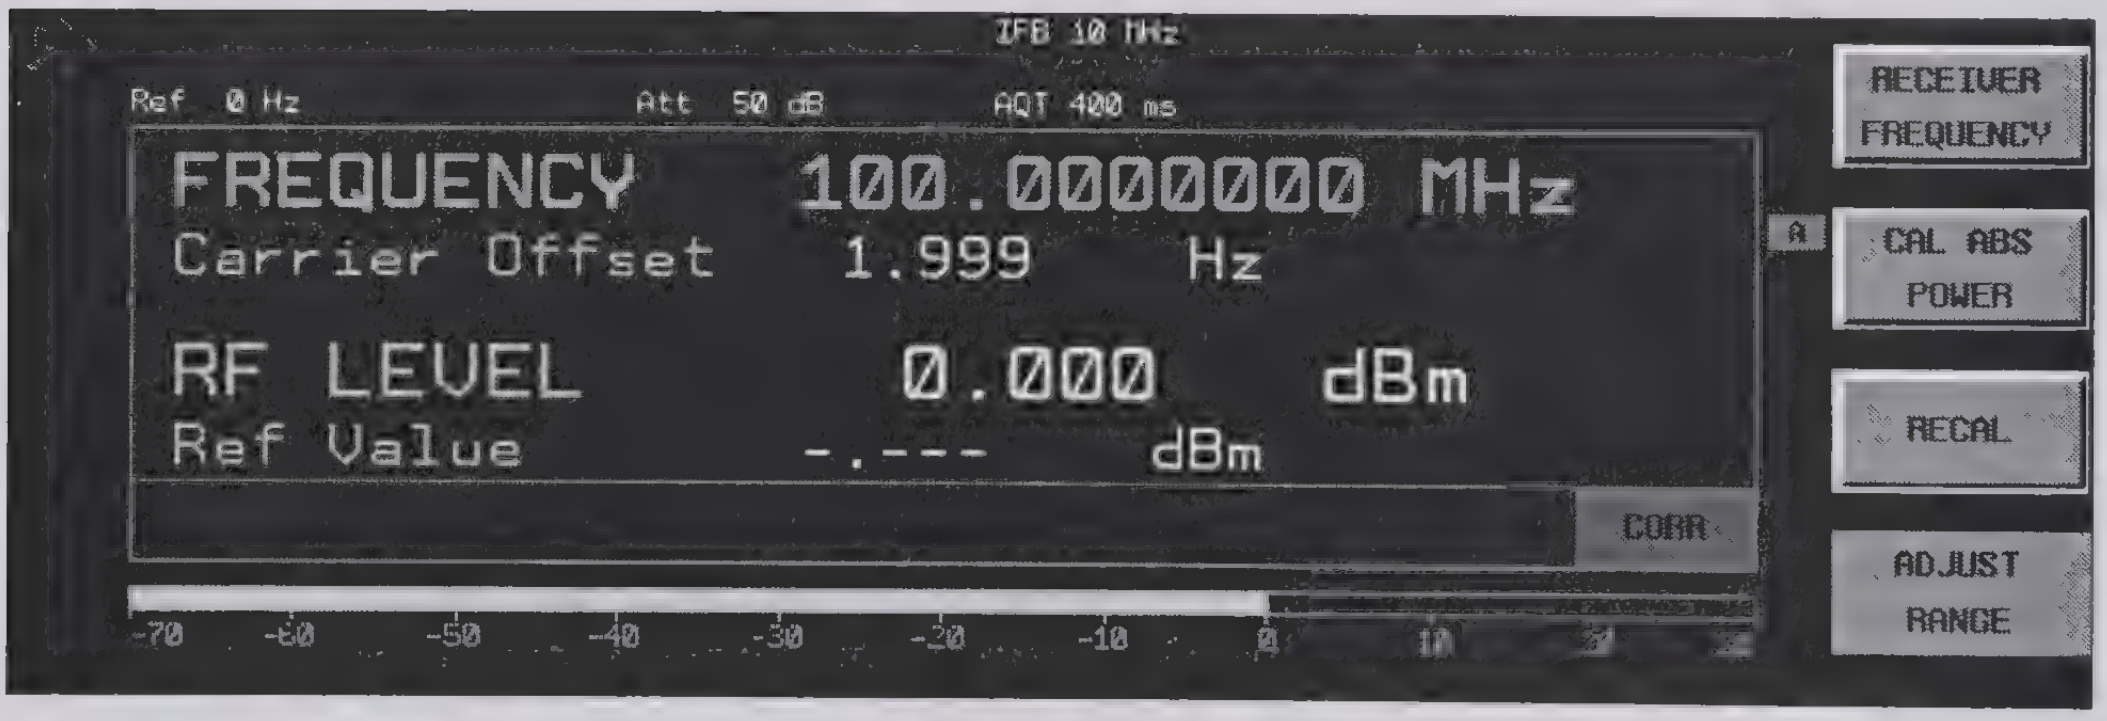

IFB 10 MHz

Ref 0 Hz Att 50 dB AQT 400 ms

FREQUENCY 100.0000000 MHz

Carrier Offset 1.999 Hz

RF LEVEL 0.000 dBm

Ref Value -.--- dBm

Fig. 4.4-2 CAL ABS POWER sequence

The *RECAL* softkey starts the subsequent calibration to expand the calibrated measurement range. This function is available whenever the measured level is in the range adjacent to the calibrated range. This is indicated via the RECAL field.

IEC/IEEE bus command: `INP:ATT:AUTO RECAL`

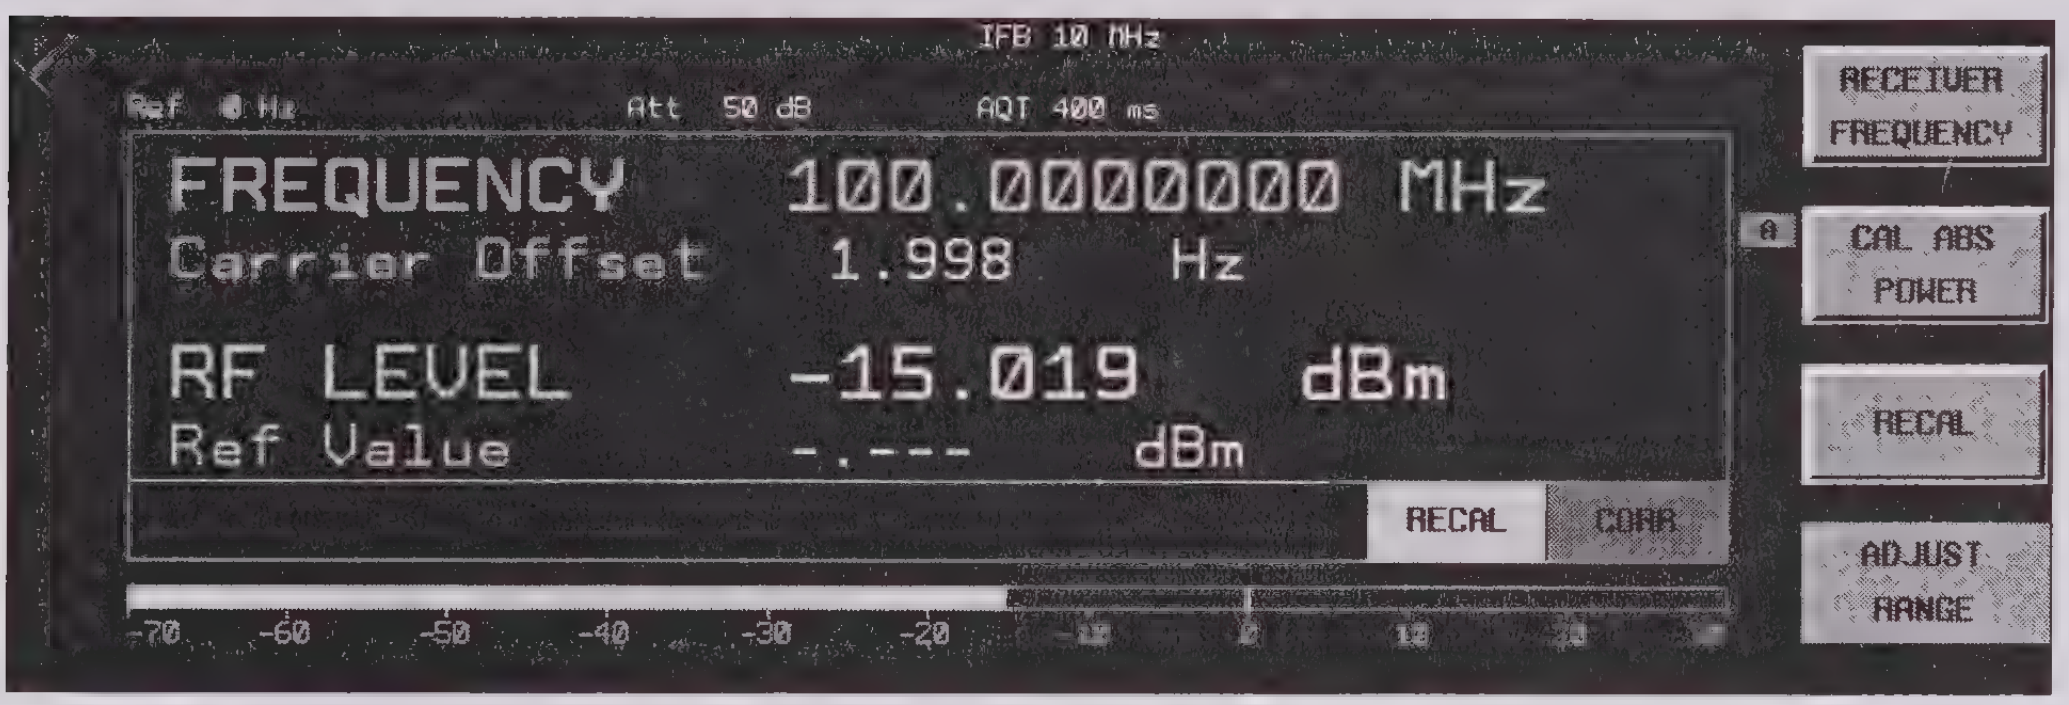

IFB 10 MHz

Ref 0 Hz Att 50 dB AQT 400 ms

FREQUENCY 100.0000000 MHz
Carrier Offset 1.998 Hz

RF LEVEL -15.019 dBm
Ref Value -.--- dBm

Fig. 4.4-3 RECAL display RF Level

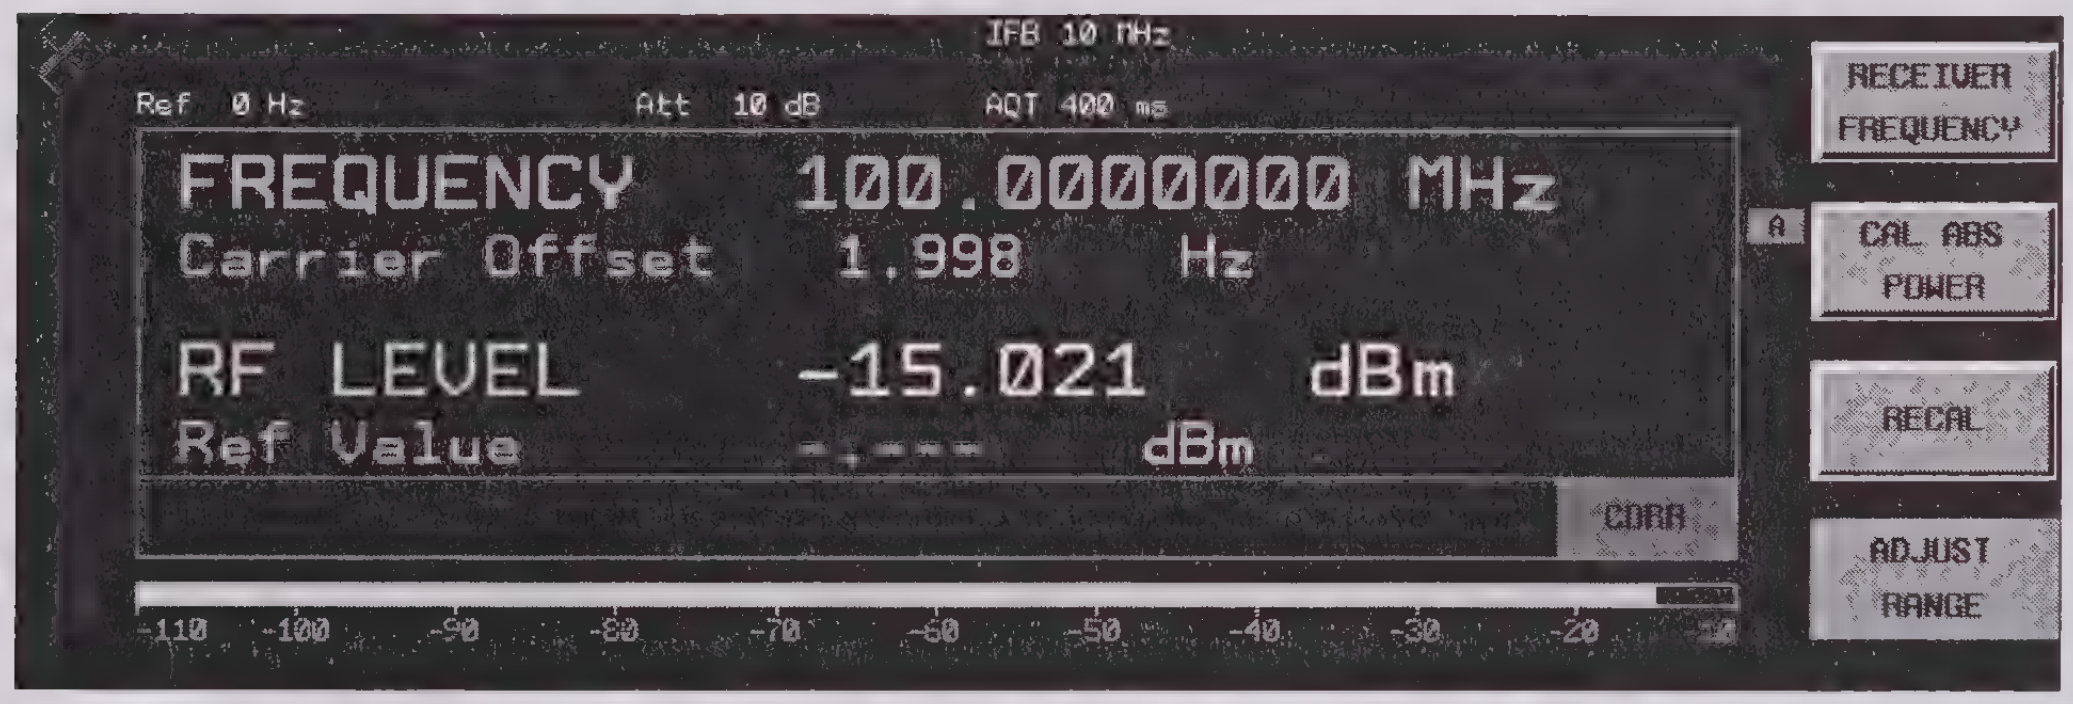

IFB 10 MHz

Ref 0 Hz Att 10 dB AQT 400 ms

FREQUENCY 100.0000000 MHz
Carrier Offset 1.998 Hz

RF LEVEL -15.021 dBm
Ref Value -.--- dBm

Fig. 4.4-4 Display after RECAL has been completed

ADJUST RANGE

The *ADJUST RANGE* softkey starts a single autoranging process. Readjusting RF attenuation, IF gain and, if necessary, preamplification, the R&S FSMR searches for a device status where sensitivity ideally matches the applied signal to be measured. When you activate the *Tuned RF Level* mode (*RF LEVEL* hotkey), this process is performed automatically.

IEC/IEEE bus command: `INP:ATT:AUTO ONCE`

DETECTOR NARROW

The *DETECTOR NARROW* softkey activates an FFT in the set demodulation bandwidth. The displayed level value is derived from the FFT peak value. The effective measurement bandwidth for this type of measurement is approx. 4 / measurement time. During the measurement time, the signal must remain in the effective bandwidth. Select *DETECTOR WIDE* if the signal sources are unstable (frequency drift, residual FM).

IEC/IEEE bus command: `DET:FUNC NARROW`

DETECTOR WIDE

The *DETECTOR WIDE* softkey activates a level measurement in the set demodulation bandwidth. The level is obtained by an RMS (root mean square) computation of all measurement points.

IEC/IEEE bus command: `DET:FUNC WIDE`

RELATIVE

The *RELATIVE* softkey opens a submenu for configuring the relative level measurement. At the same time, the current level measurement value is adopted as the reference value and the relative level measurement is activated.

RELATIVE
ON OFF

The *RELATIVE ON/OFF* softkey switches the relative level measurement on and off.

IEC/IEEE bus command: `POW:AC:REF ON | OFF`

MEAS->REF

The *MEAS->REF* softkey adopts the current level measurement value as the reference value.

IEC/IEEE bus command: `POW:AC:REF:AUTO ONCE`

REFERENCE
VALUE

The *REFERENCE VALUE* softkey opens the date entry field for defining the reference value for the relative level measurement.

IEC/IEEE bus command: `POW:AC:REF -30 DBM`

RELATIVE
DB %

The *RELATIVE DB/%* softkey selects the display mode for the relative level measurement.

IEC/IEEE bus command: `UNIT:POW:RAT DB | PCT`

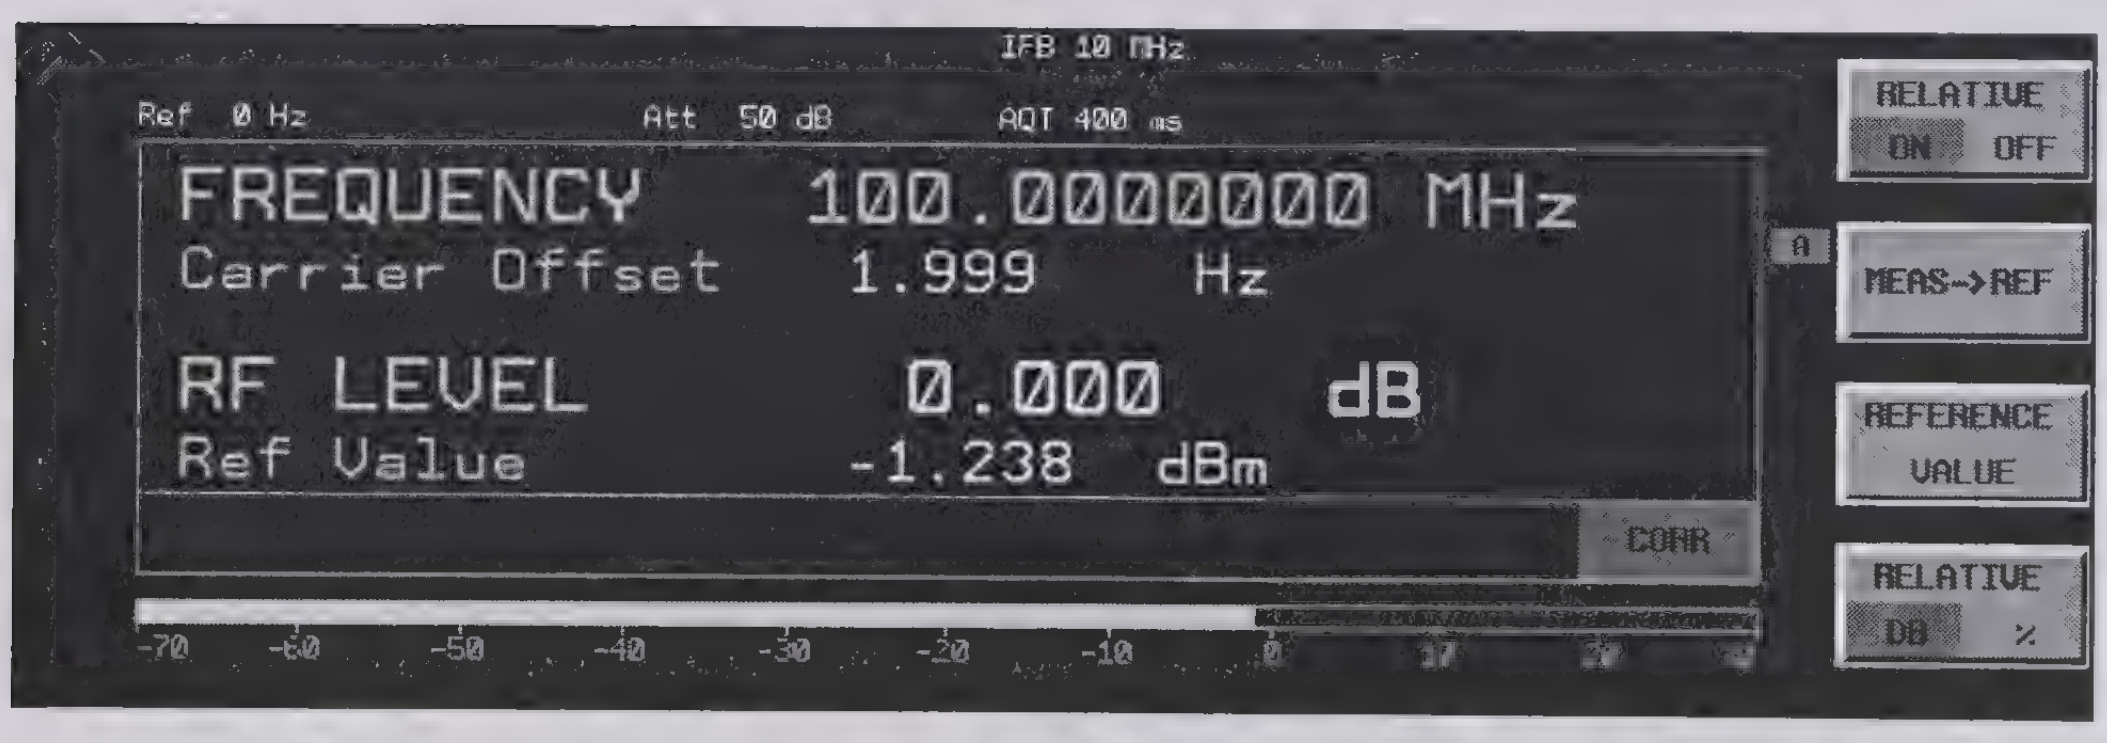

FREQUENCY 100.0000000 MHz
Carrier Offset 1.999 Hz
RF LEVEL 0.000 dB
Ref Value -1.238 dBm

Fig. 4.4-5 Display mode for the relative level measurement RF Level

AVERAGING
[10]

The *AVERAGING* softkey switches averaging of the level measurement on and off. At the same time, it opens the data entry field for determining the number of level measurements across which the average value is formed (average count). The permissible value range is 0 to 30000. Note the following:

Average count = 0 indicates continuous averaging

Average count = 1 indicates no averaging

Average count > 1 indicates averaging across the specified number of measurements; in the case of free-running measurements, this is switched to continuous averaging once the specified number has been reached.
In the default setting, averaging is not active, and an average count of 10 is preset.

IEC/IEEE bus commands:

```
POW:AC:AVER ON | OFF
POW:AC:AVER:COUN 10
```

Level Measurement with the Power Sensor – *PWR METER* Key

The *PWR METER* hotkey activates the measurement with the power sensor and opens a menu for configuring and controlling the measurements.

IEC/IEEE bus command: `SENS:PMET:STAT ON`

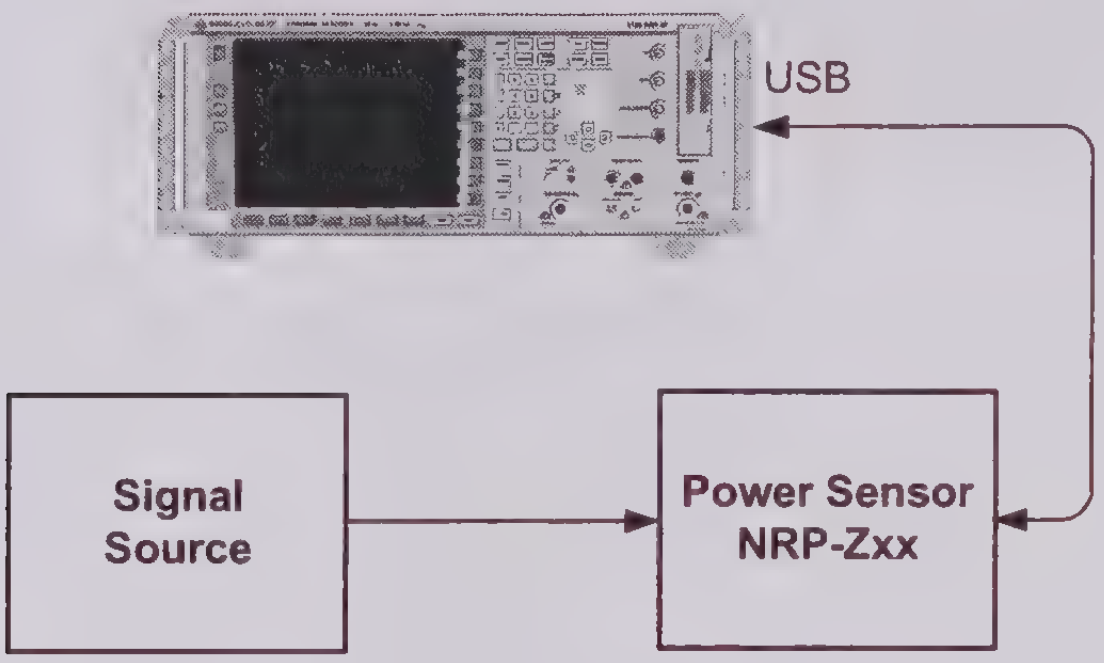

Fig. 4.4-6 Test setup

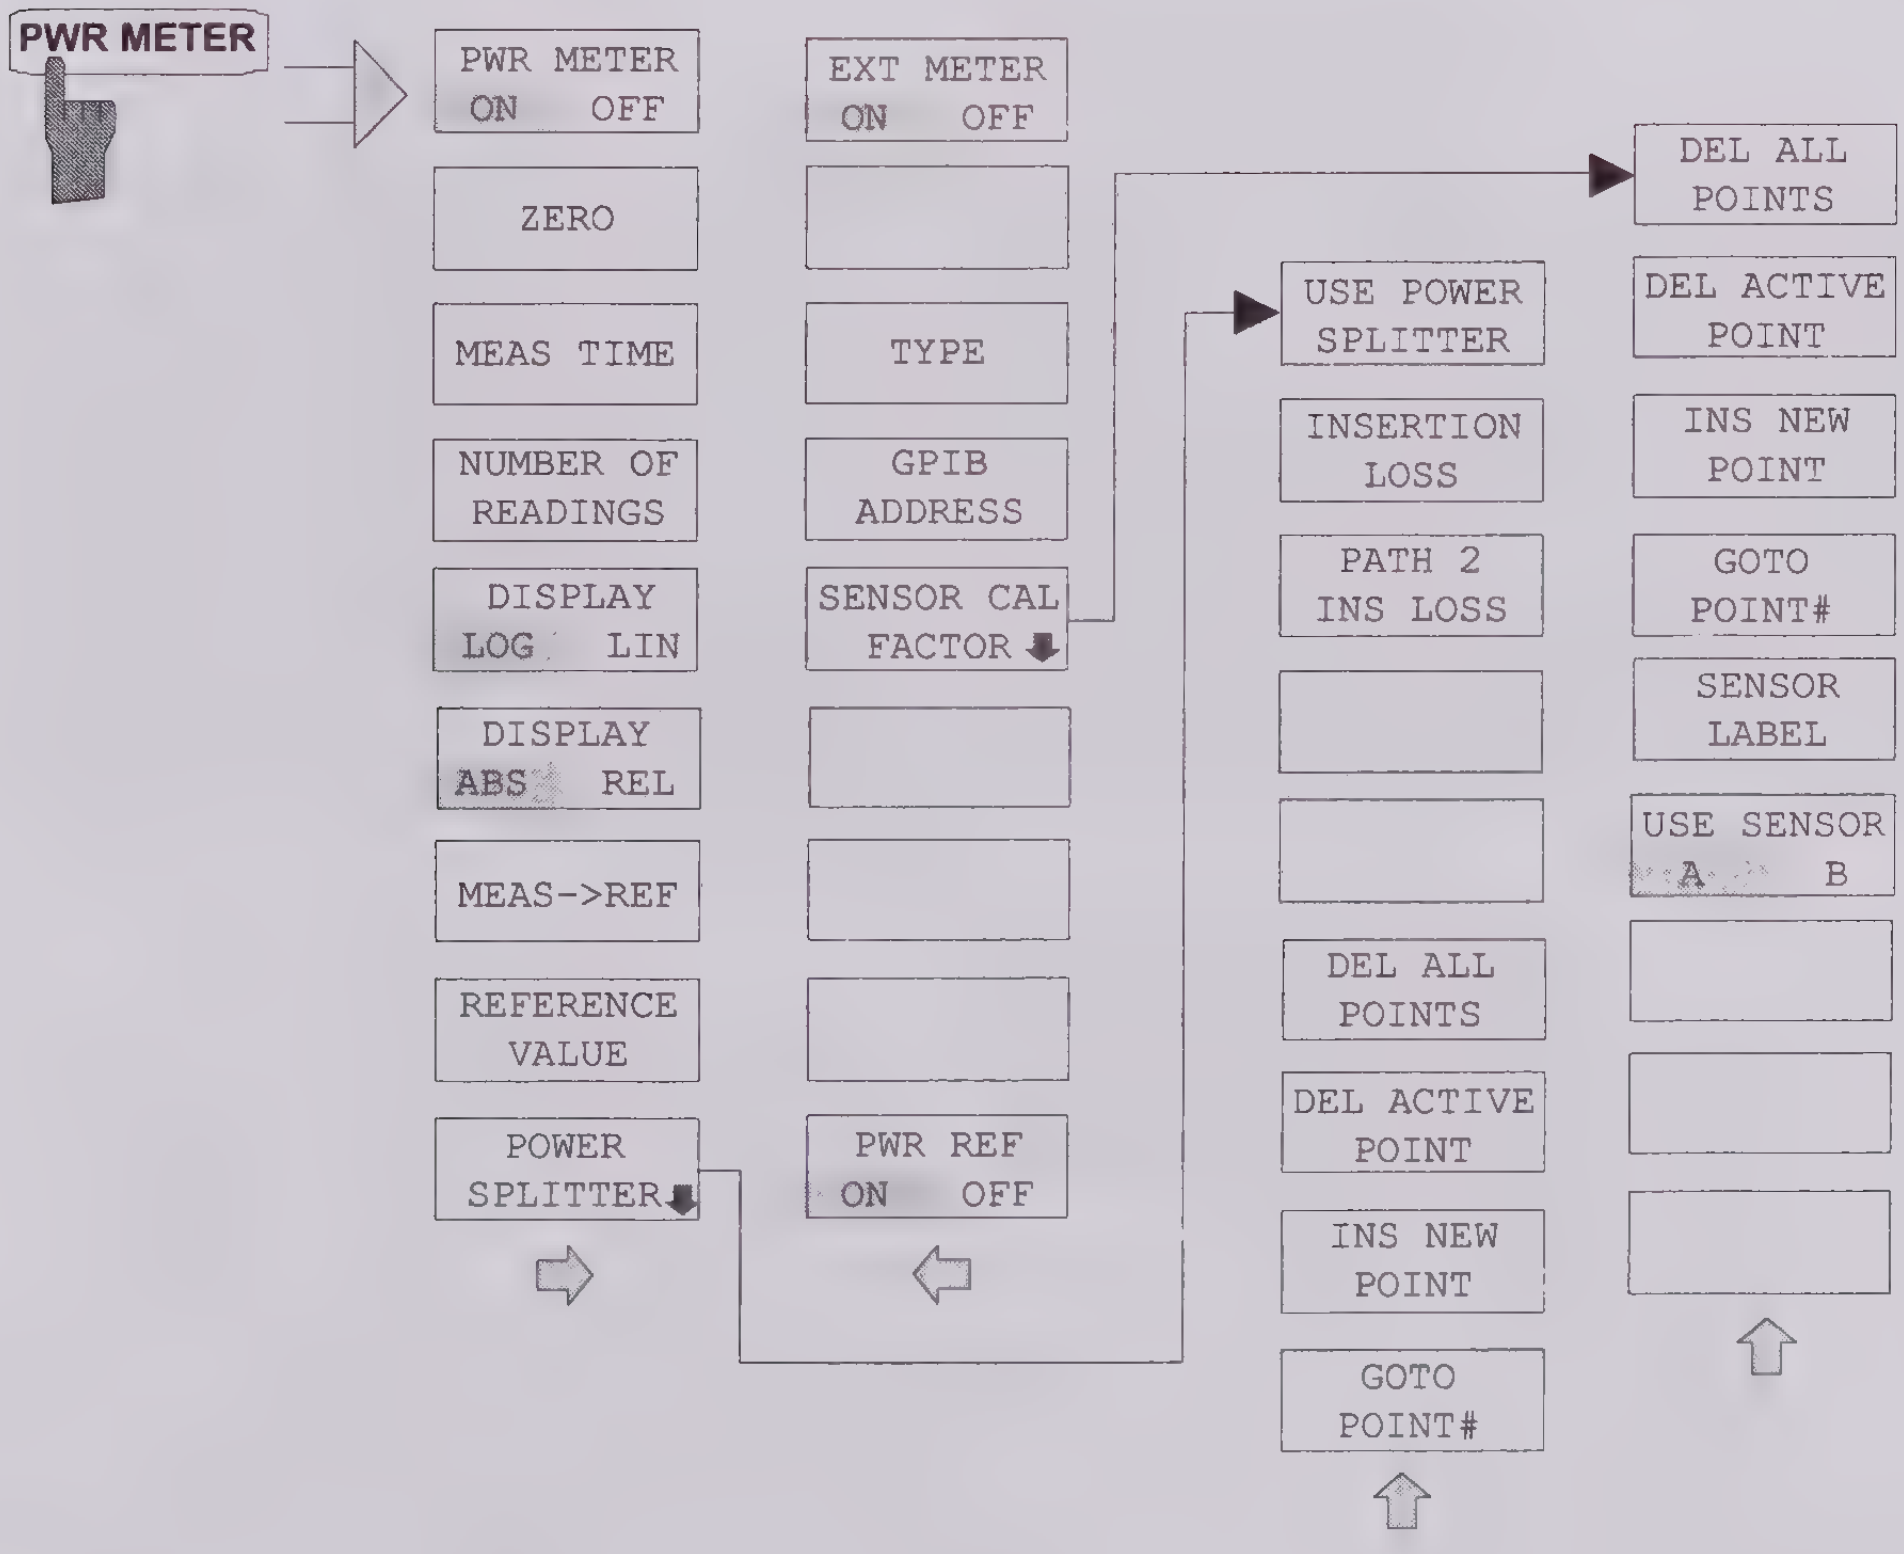

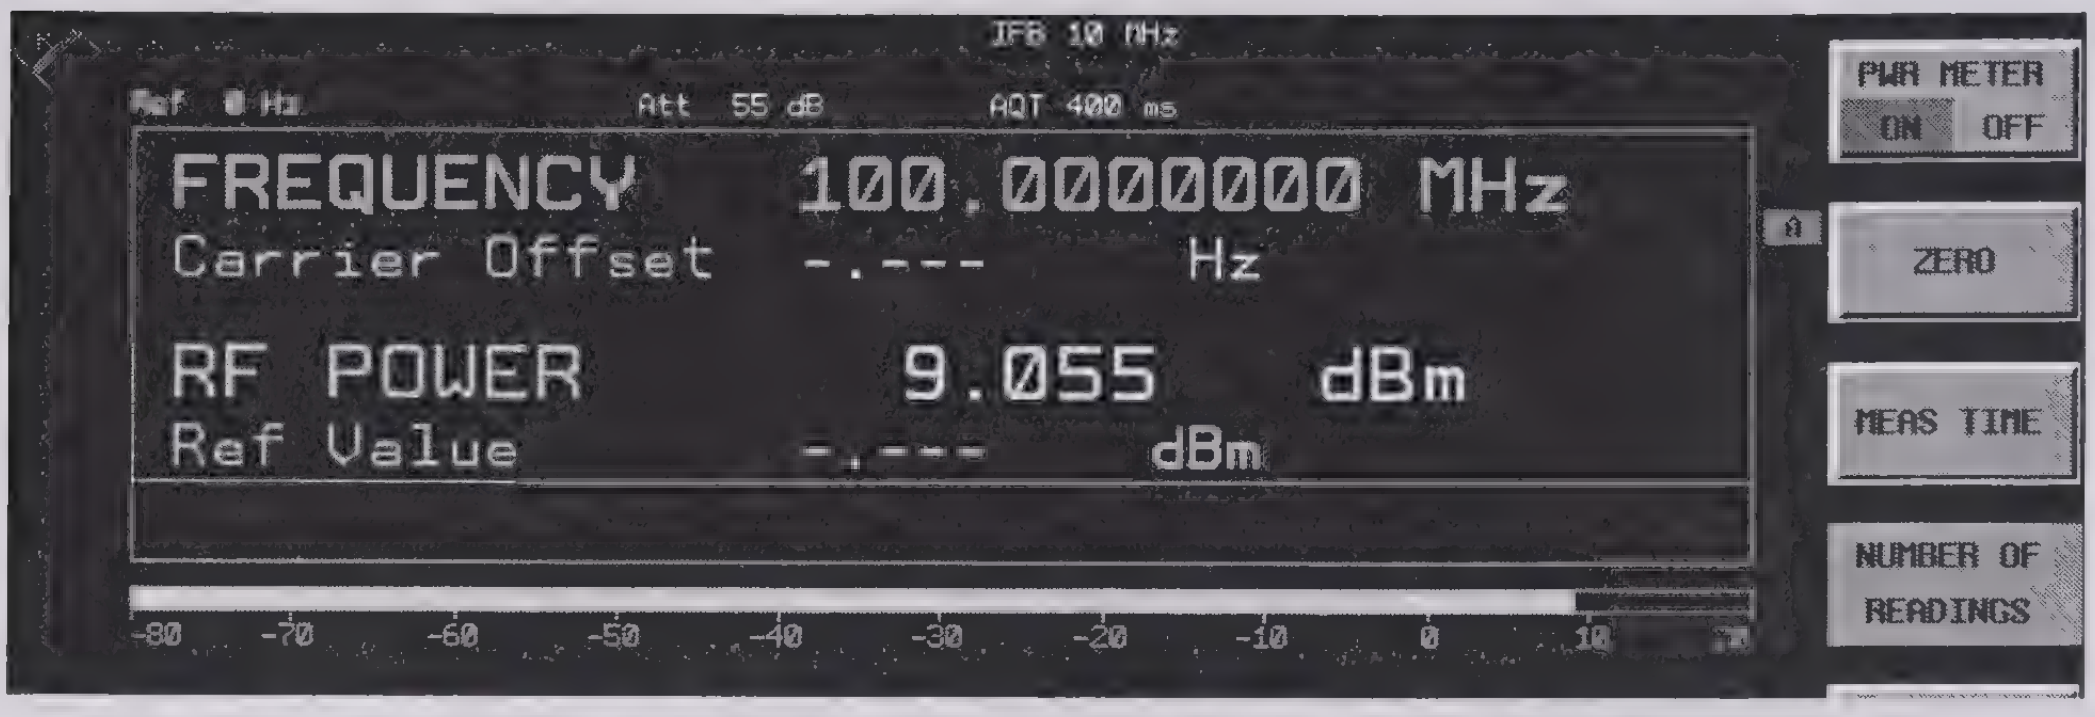

IFB 10 MHz

Ref 0 Hz Att 55 dB AQT 400 ms

FREQUENCY 100.0000000 MHz
Carrier Offset -.--- Hz

RF POWER 9.055 dBm
Ref Value -.--- dBm

Fig. 4.4-7 Display RF power with power sensor

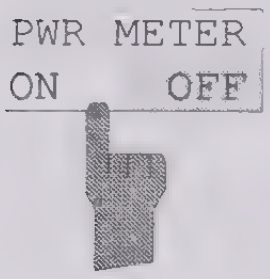

The *PWR METER ON/OFF* softkey switches the measurement with the power sensor on and off.

IEC/IEEE bus command: `SENS:PMET:STAT ON`

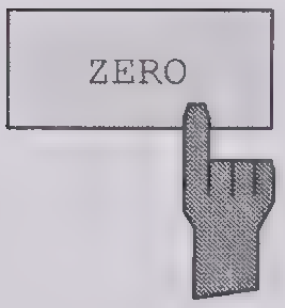

The *ZERO* softkey starts zeroing of the power sensor.

Before zeroing starts, you are prompted to disconnect all signals from the input of the power sensor.

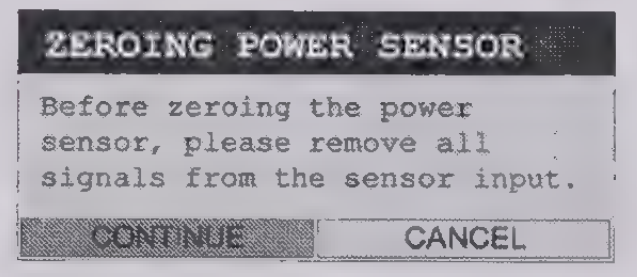

ZEROING POWER SENSOR

Before zeroing the power sensor, please remove all signals from the sensor input.

During zeroing, the following message appears:

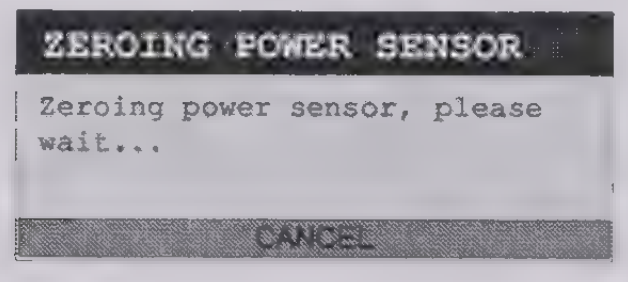

ZEROING POWER SENSOR

Zeroing power sensor, please wait...

When zeroing is complete, the following message appears:

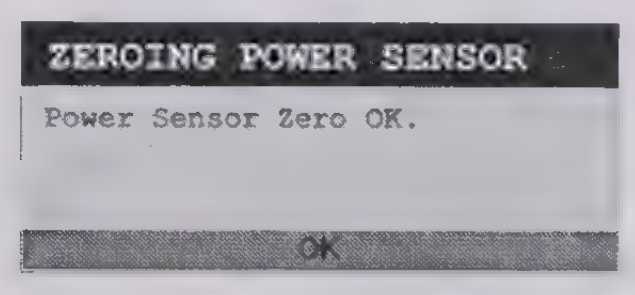

ZEROING POWER SENSOR

Power Sensor Zero OK.

This message is deleted after approx. 3 s.

IEC/IEEE bus command: `CAL:PMET:ZERO:AUTO ONCE;*WAI`

MEAS TIME

The *MEAS TIME* softkey opens a list in which the measurement time can be set. Results become more stable with extended measurement time, particularly if signals with low power are measured.

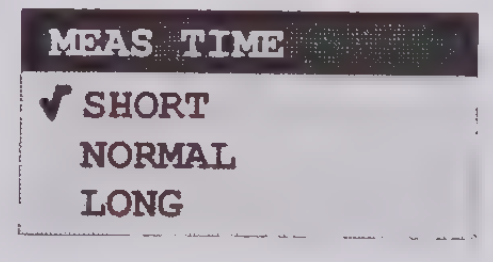

Stationary signals with high power (>-40 dBm) require only a short measurement time to yield stable and exact results. In this case, the *SHORT* setting is recommended because it provides the highest measurement repetition rates.
The *NORMAL* setting increases the stability of the displayed results for the measurement of signals with low power or of modulated signals.
The *LONG* setting is recommended for signals at the lower end of the measurement range (<-50 dBm). This setting can be used to minimize the influence of noise.

IEC/IEEE bus command: `PMET:MTIM LONG`

DISPLAY LOG LIN

The *DISPLAY LOG/LIN* softkey switches the result display between logarithmic display (units: dBm and dB) and linear display (units: W and %).

IEC/IEEE bus command: `UNIT:PMET:POW DBM`

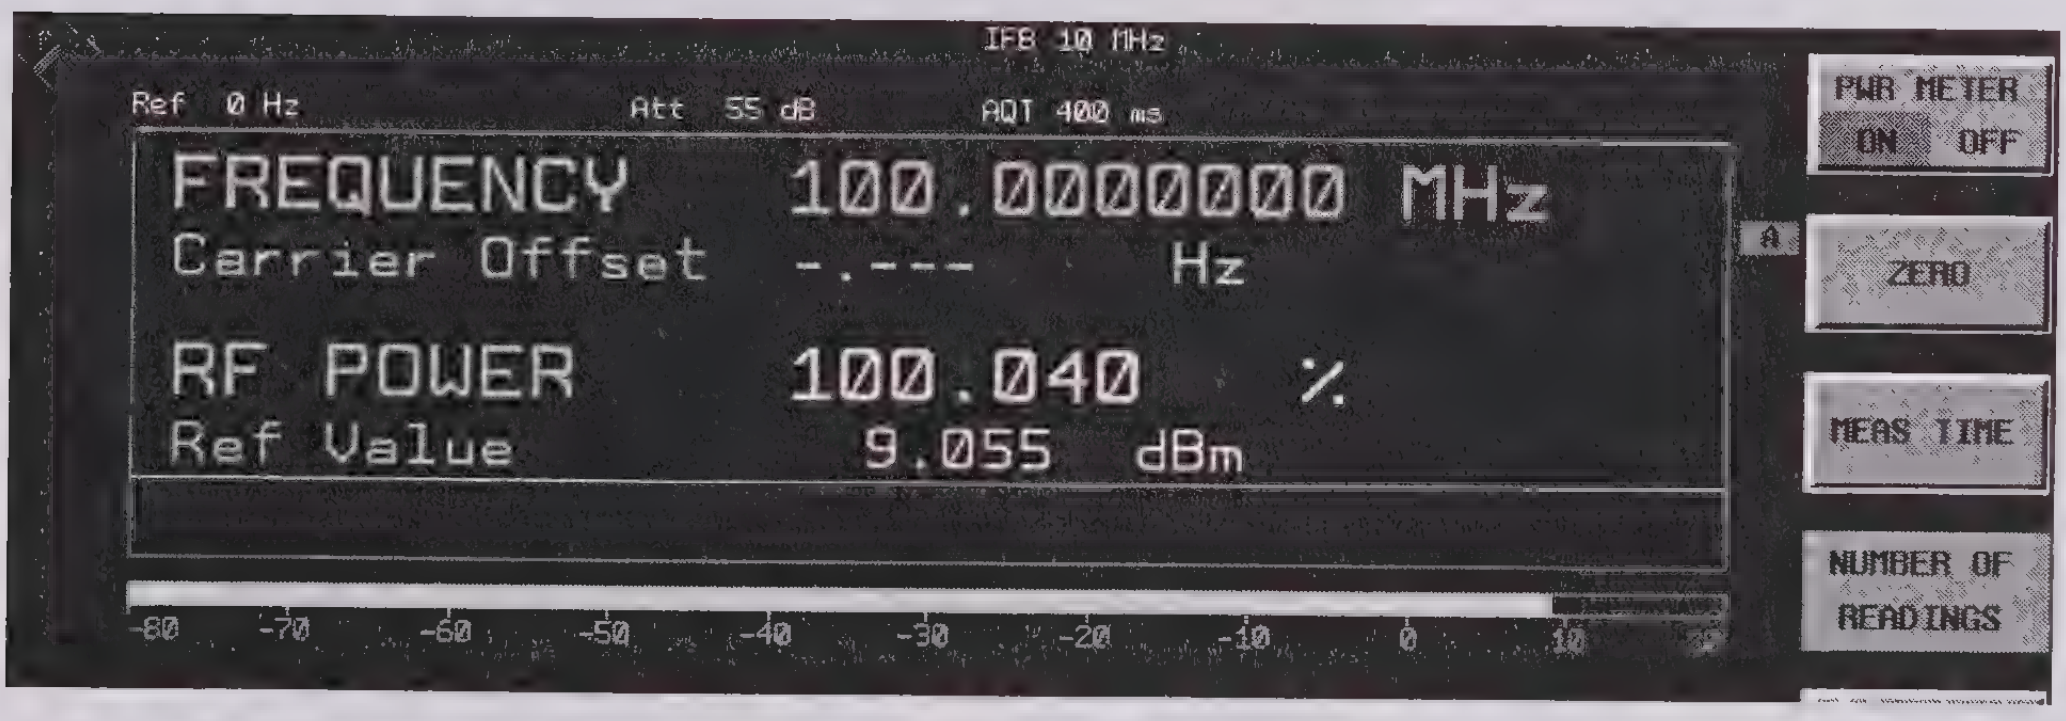
```
Ref  0 Hz              Att  55 dB        IFB 10 MHz
                                         AQT 400 ms
FREQUENCY         100.0000000 MHz
Carrier Offset    -.---       Hz

RF POWER          100.040     %
Ref Value           9.055   dBm
```

Fig. 4.4-8 Powersensor with relative display

DISPLAY ABS REL

The *DISPLAY ABS/REL* softkey switches the result display between absolute display (units: dBm and W) and relative display (units: dB and %).

IEC/IEEE bus command:

```
CALC:PMET:REL:STAT ON
UNIT:PMET:POW:RAT PCT
```

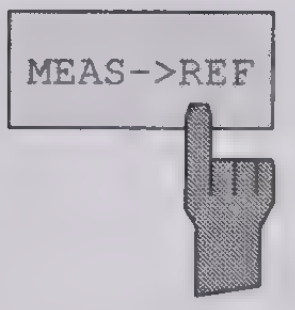

The *MEAS→REF* softkey is used to adopt the currently measured power as a reference value for the relative display.

The reference value can also be set manually via the *REFERENCE VALUE* softkey.

IEC/IEEE bus command: `CALC:PMET:REL:AUTO ONCE`

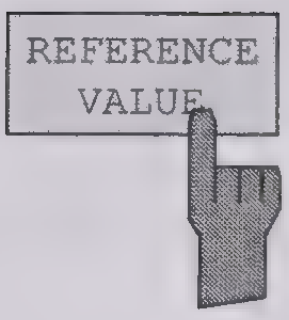

The *REFERENCE VALUE* softkey activates manual entry of a reference value for relative measurements in the unit dBm.

IEC/IEEE bus command: `CALC:PMET:REL -30DBM`

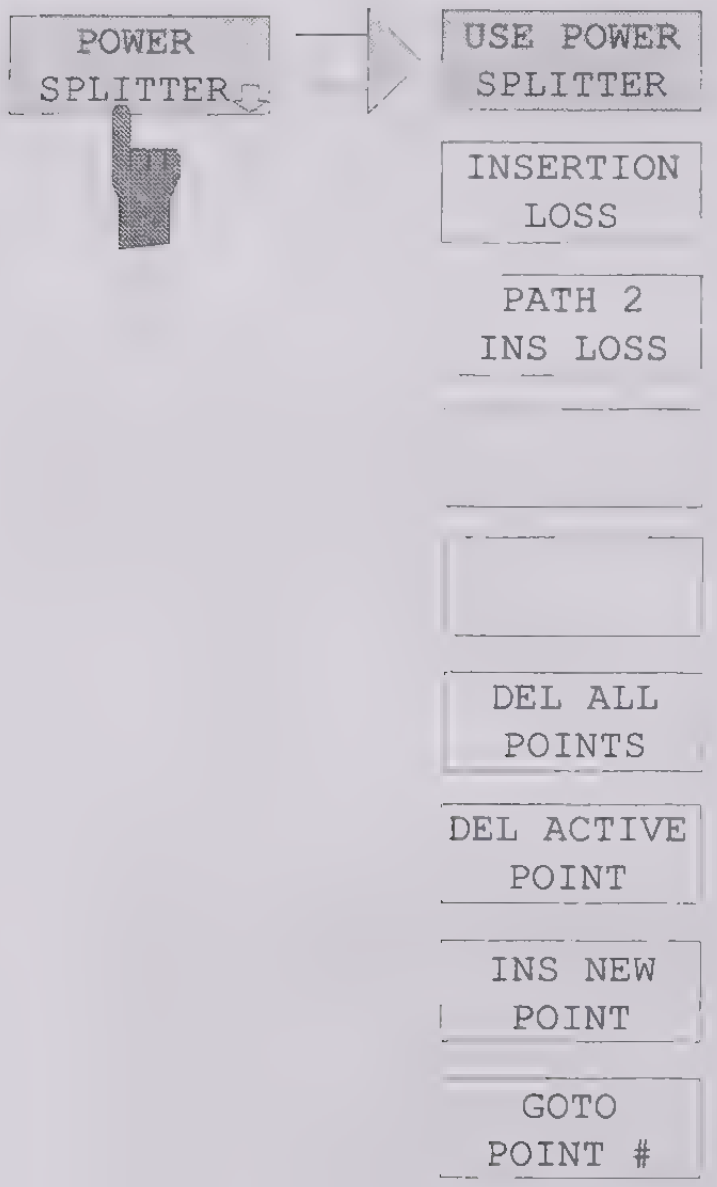

The *POWER SPLITTER* softkey opens a submenu for power splitter settings.
A table for entering the frequency-dependent insertion loss of the power splitter is opened simultaneously. It is valid for the path between power meter and signal source.

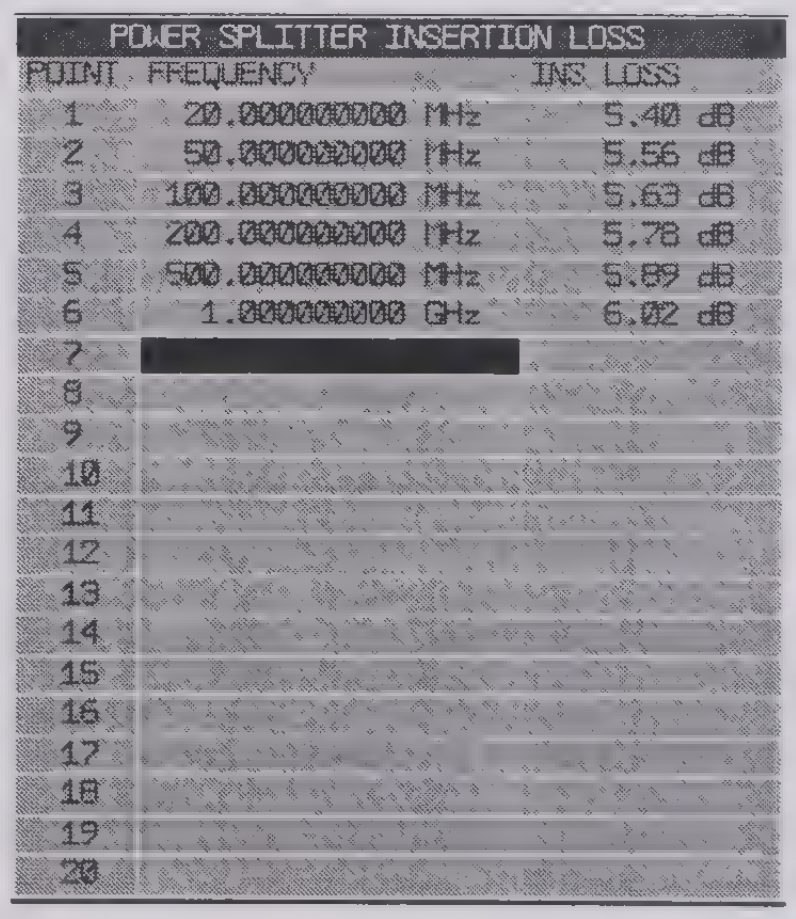

POWER SPLITTER INSERTION LOSS

POINT	FREQUENCY	INS LOSS
1	20.000000000 MHz	5.40 dB
2	50.000000000 MHz	5.56 dB
3	100.000000000 MHz	5.63 dB
4	200.000000000 MHz	5.78 dB
5	500.000000000 MHz	5.89 dB
6	1.000000000 GHz	6.02 dB
7		
8		
9		
10		
11		
12		
13		
14		
15		
16		
17		
18		
19		
20		

The *USE POWER SPLITTER* softkey activates and deactivates automatic consideration of a power splitter that splits the present RF signal between the power meter and the R&S FSMR RF input.

IEC/IEEE bus command: `CORR:PLOS:INP:STAT ON`

The *INSERTION LOSS* softkey opens the table for entering the frequency-dependent insertion loss of a power splitter.

IEC/IEEE bus command:
`CORR:PLOS:INP 1e6,4.6,2e6,4.85`

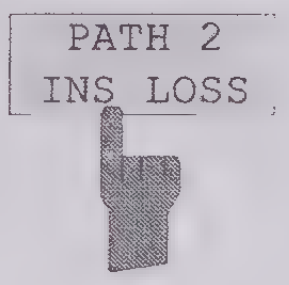

The *PATH 2 INS LOSS* softkey opens a data entry field for defining the insertion loss of the power splitter between the signal source and the R&S FSMR RF input. This value is used only for checking the plausibility during absolute value calibration. The exact value is determined during calibration.

IEC/IEEE bus command: `CORR:PLOS:INP:PATH2 4 DB`

The *DEL ALL POINTS* softkey deletes all values from the table with the frequency-dependent insertion loss of the power splitter.

IEC/IEEE bus command: –

The *DEL ACTIVE POINT* softkey deletes the marked value from the table with the frequency-dependent insertion loss of the power splitter.

IEC/IEEE bus command: –

The *INS NEW POINT* softkey inserts a new line at the spot where the table is marked.

IEC/IEEE bus command: –

The *GOTO POINT #* softkey sets the marking to the specified line within the table.

IEC/IEEE bus command: –

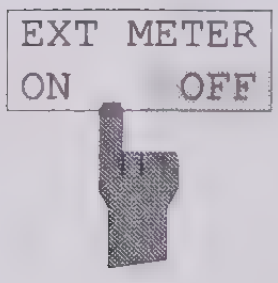

The *EXT METER ON/OFF* softkey switches the measurement with the power sensor on and off.

IEC/IEEE bus command: `PMET:STAT ON`

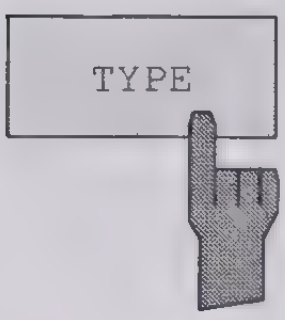

The *TYPE* softkey selects the type of power meter used from a list.

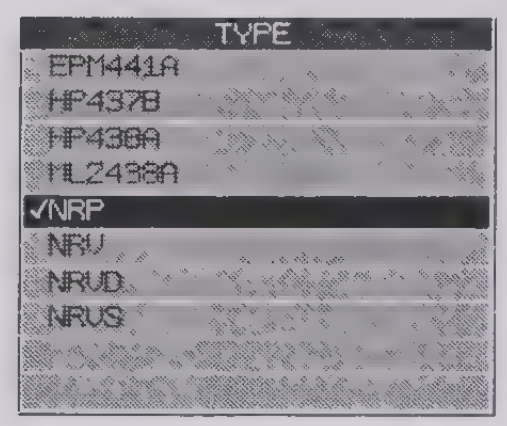

The R&S NRVS, R&S NRVD, R&S NRV and R&S NRP power meters from Rohde & Schwarz as well as EPM4419A, 437 B and 438 A from Hewlett-Packard/Agilent plus Anritsu ML 2438A are supported.

IEC/IEEE bus command: `SYST:COMM:RDEV:PMET:TYPE 'NRP'`

The *GPIB ADDRESS* softkey opens a data entry field for setting the IEC/IEEE bus address via which the external power meter is addressed for remote-control.

IEC/IEEE bus command: `SYST:COMM:GPIB:RDEV:PMETer:ADDR 5`

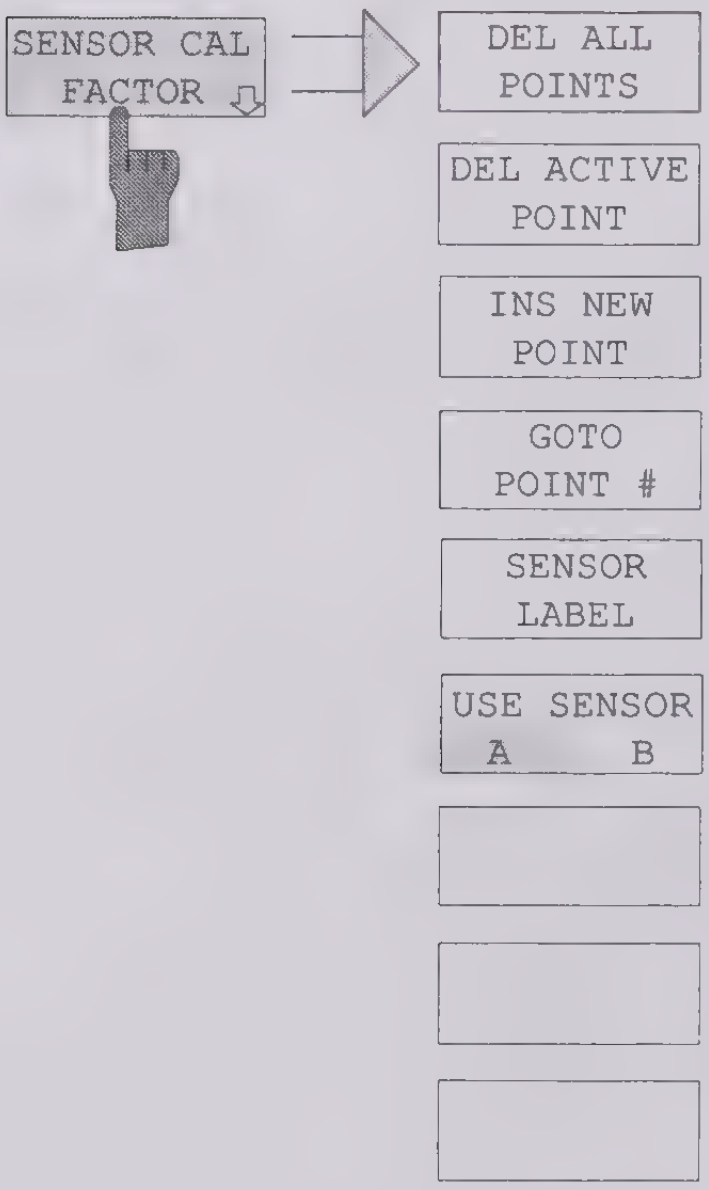

The *SENSOR CAL FACTOR* softkey opens a submenu for entering the frequency-dependent calibration factor of the power sensor used.

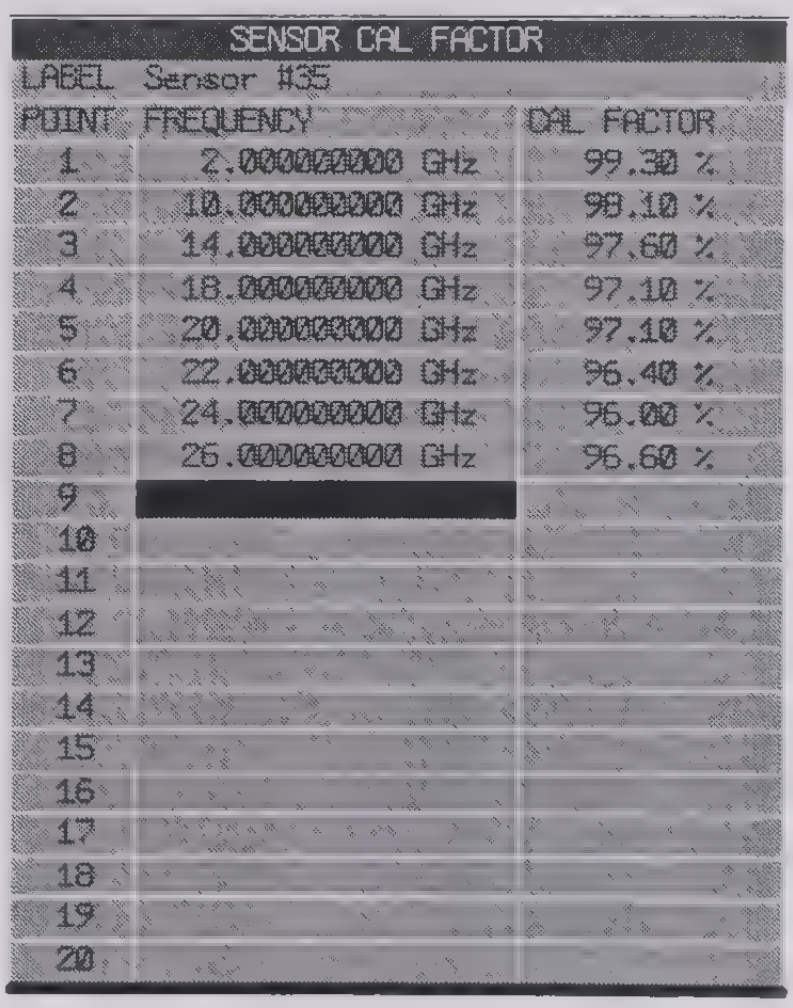

SENSOR CAL FACTOR

LABEL Sensor #35

POINT	FREQUENCY	CAL FACTOR
1	2.000000000 GHz	99.30 %
2	10.000000000 GHz	98.10 %
3	14.000000000 GHz	97.60 %
4	18.000000000 GHz	97.10 %
5	20.000000000 GHz	97.10 %
6	22.000000000 GHz	96.40 %
7	24.000000000 GHz	96.00 %
8	26.000000000 GHz	96.60 %
9		
10		
11		
12		
13		
14		
15		
16		
17		
18		
19		
20		

Due to mismatch, loss and change of sensitivity of the power sensor used, frequency-dependent errors occur during the power measurement. The calibration factor of a sensor, which is usually specified in percentage, describes which section of the forward power toward the sensor is actually sampled and displayed. Some power sensors, such as the R&S NRV family from Rohde & Schwarz, read in the calibration factor from a memory in the sensor and automatically take this factor into account. With other devices (e.g. HP 436 A), you have to set the calibration factor manually on the device; however, the factor applies only to a specific frequency. In this case, you can enter a table of the calibration factor above the frequency via the *SENSOR CAL FACTOR* menu; when measurements are performed, this factor is taken into account. You then have to set the calibration factor of 100% on the power meter.

You can enter the calibration factor for two different sensors on up to 20 frequency points each. Depending on the setting of the *USE SENSOR A B* softkey, either the SENSOR A CAL FACTOR LIST table or the SENSOR B CAL FACTOR LIST table is displayed. In the second line, a name for identifying the sensor is displayed; this name can be defined via the *SENSOR LABEL* softkey. The individual frequency points of the list are detailed below, but they can only be entered in ascending frequency order. Next to the number of the frequency point, there are two editable columns.

FREQUENCY – frequency value of the frequency point
CAL FACTOR – associated calibration factor in percentage

Linear interpolation occurs between the frequency points of the active calibration factor list. The calibration factors of the lower or upper cutoff frequency apply outside the specified frequency range. In the presetting, the table is empty and no correction has been made, i.e. the calibration factor is generally assumed to be 100%. If the list contains only one frequency point, the FREQUENCY field cannot be edited, and CAL FACTOR then applies to all frequencies.

IEC/IEEE bus command:

```
SYST:COMM:RDEV:PMET:CFAC:ASEN 2GHZ,99PCT,4GHZ,98PCT
```

DEL ALL POINTS

The *DEL ALL POINTS* softkey deletes all values from the table with the frequency-dependent insertion loss of the power splitter.

IEC/IEEE bus command: –

DEL ACTIVE POINT

The *DEL ACTIVE POINT* softkey deletes the marked value from the table with the frequency-dependent insertion loss of the power splitter.

IEC/IEEE bus command: –

INS NEW POINT

The *INS NEW POINT* softkey inserts a new line where the table is marked.

IEC/IEEE bus command: –

GOTO POINT #

The *GOTO POINT #* softkey sets the marking to the specified line within the table.

IEC/IEEE bus command: –

SENSOR LABEL

The *SENSOR LABEL* softkey sets the marking within the table to the LABEL line so that an alphanumeric label can be entered.

IEC/IEEE bus command:
`SYST:COMM:RDEV:PMET:CFAC:ASEN:LABEL 'SENSOR1'`

USE SENSOR A B

The *USE SENSOR A/B* softkey switches between the calibration factors of the sensors A and B.
Switchover refers both to the table displayed and to the data set used during power calibration.

IEC/IEEE bus command:
`SYST:COMM:RDEV:PMET:CFAC:SEL ASEN`

PWR REF ON OFF

The *POWER REF ON/OFF* softkey switches the POWER REF reference source on the front panel on and off.

IEC/IEEE bus command: `OUTP:REF:STAT ON`

Modulation Measurements – *DEMOD* Key

The *DEMOD* hotkey switches the R&S FSMR to modulation measurement mode and opens a menu for configuring and controlling measurements.

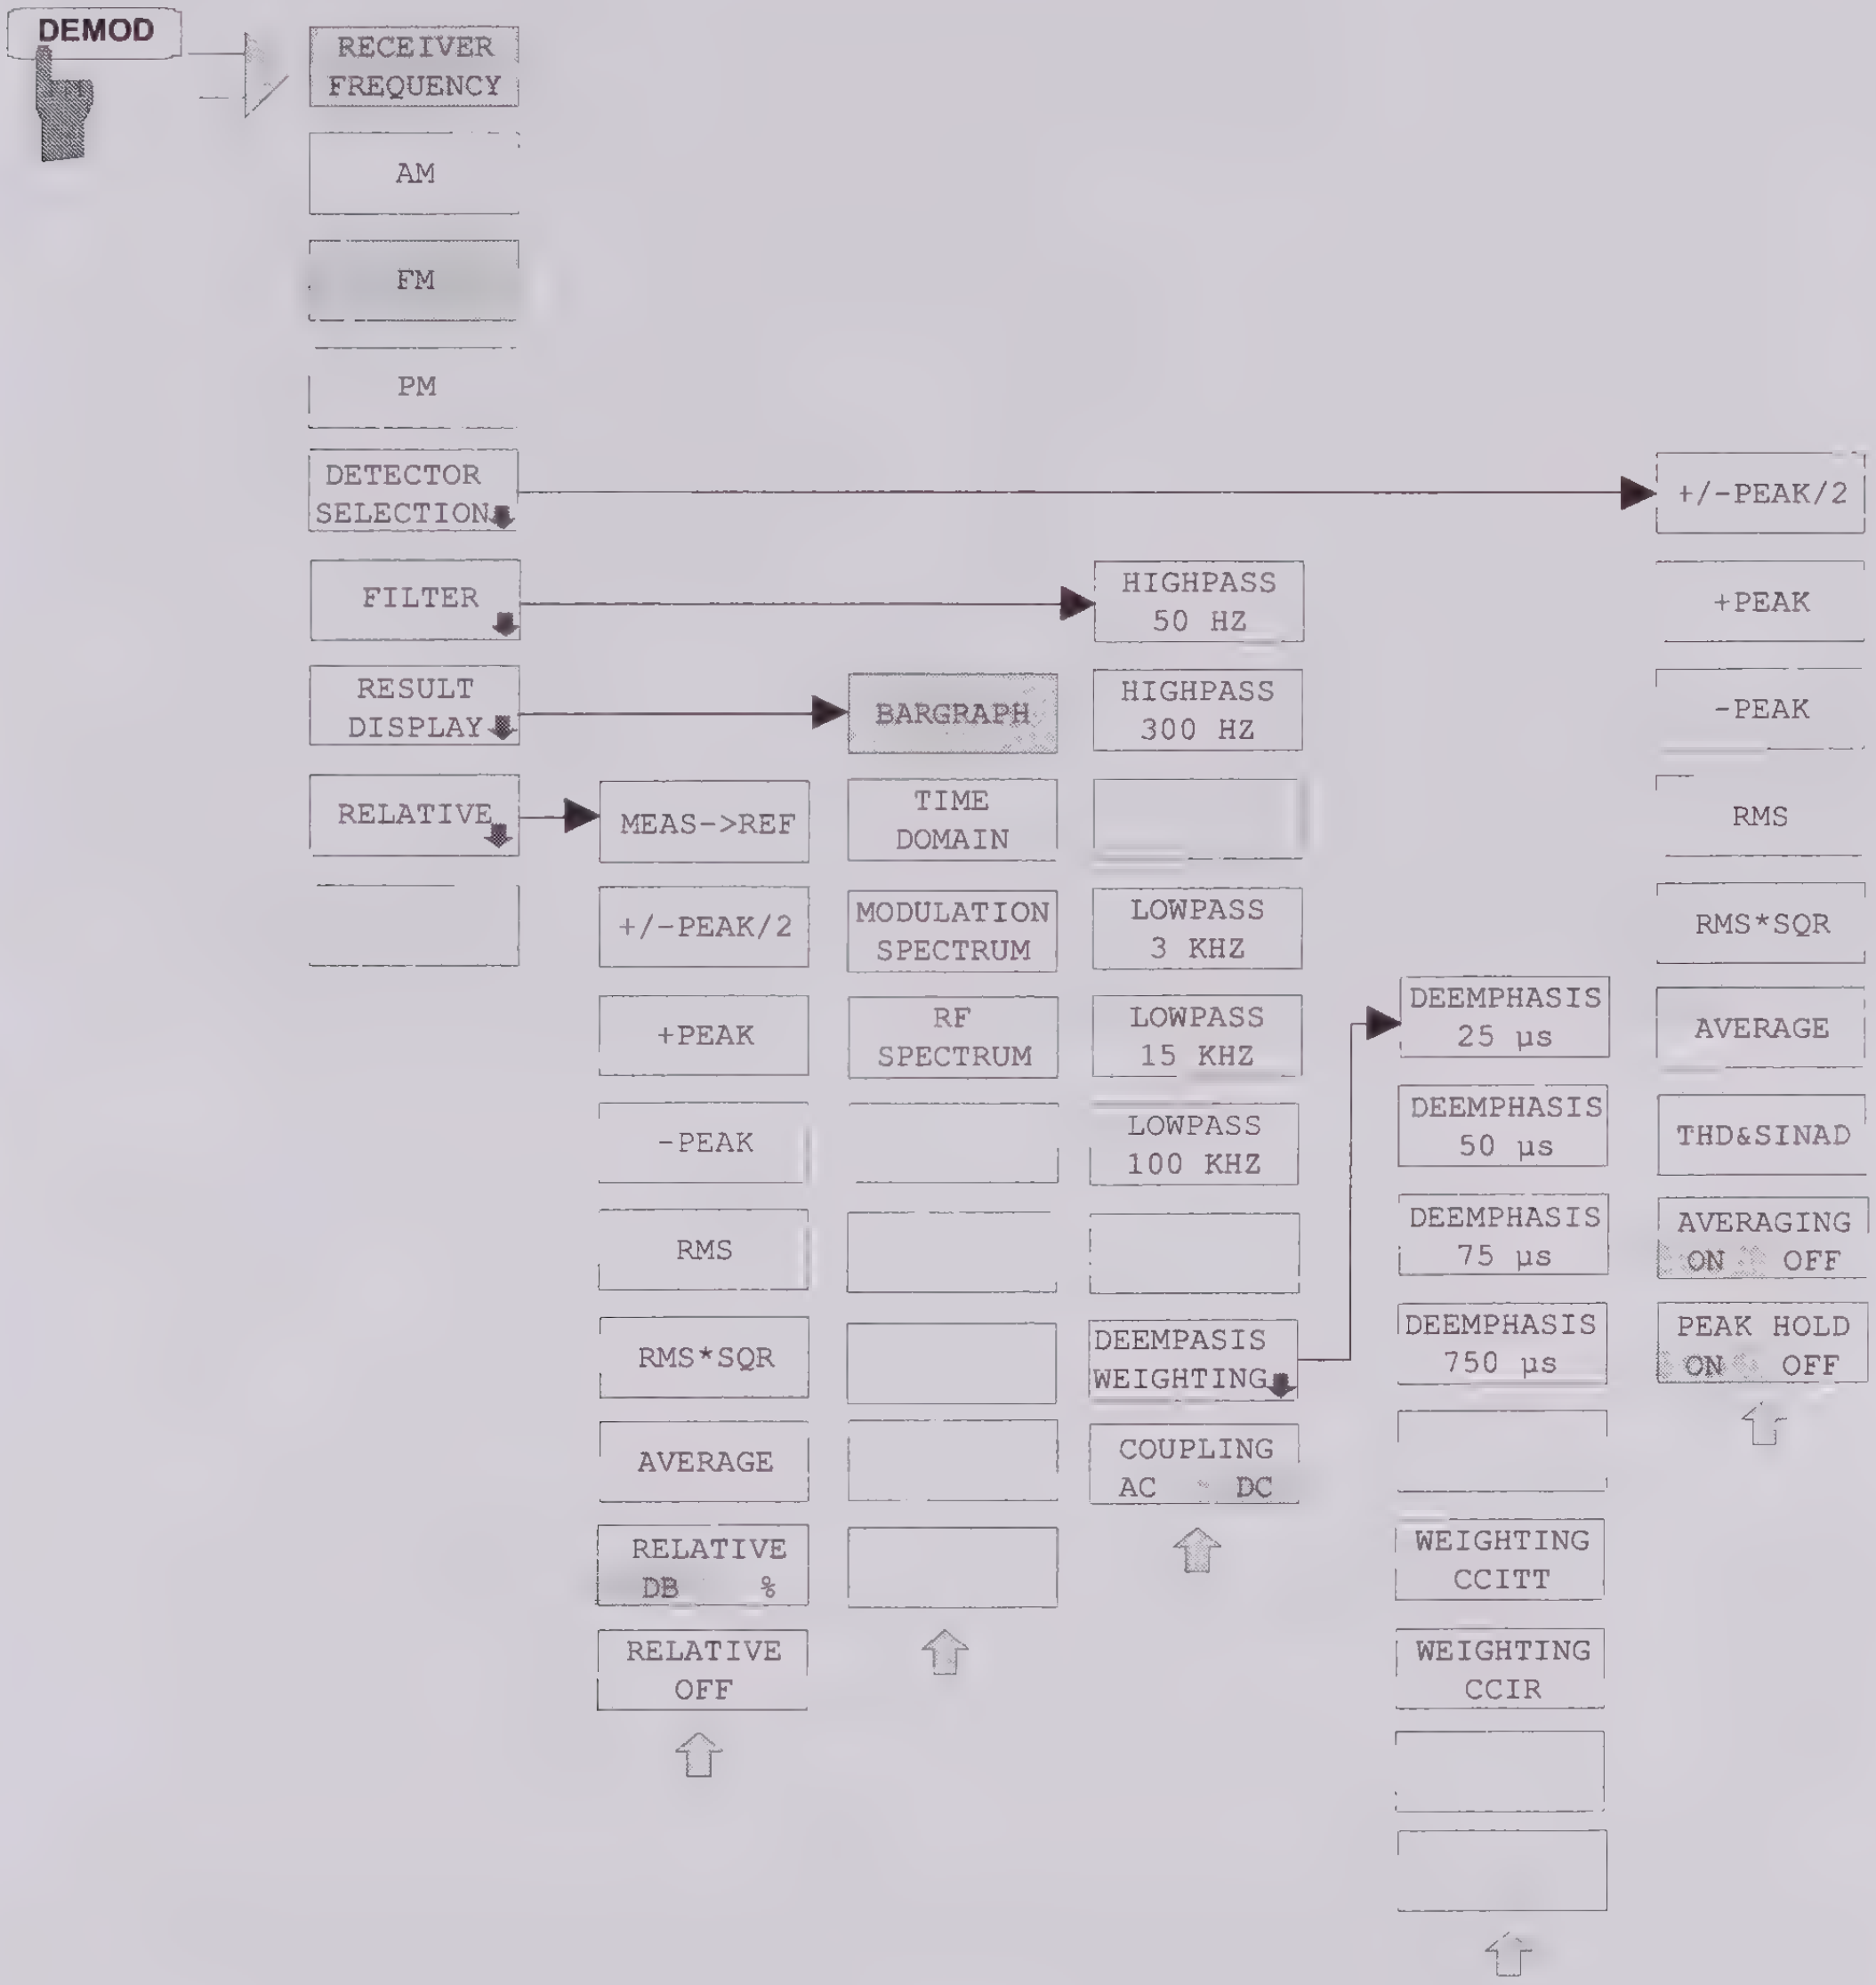

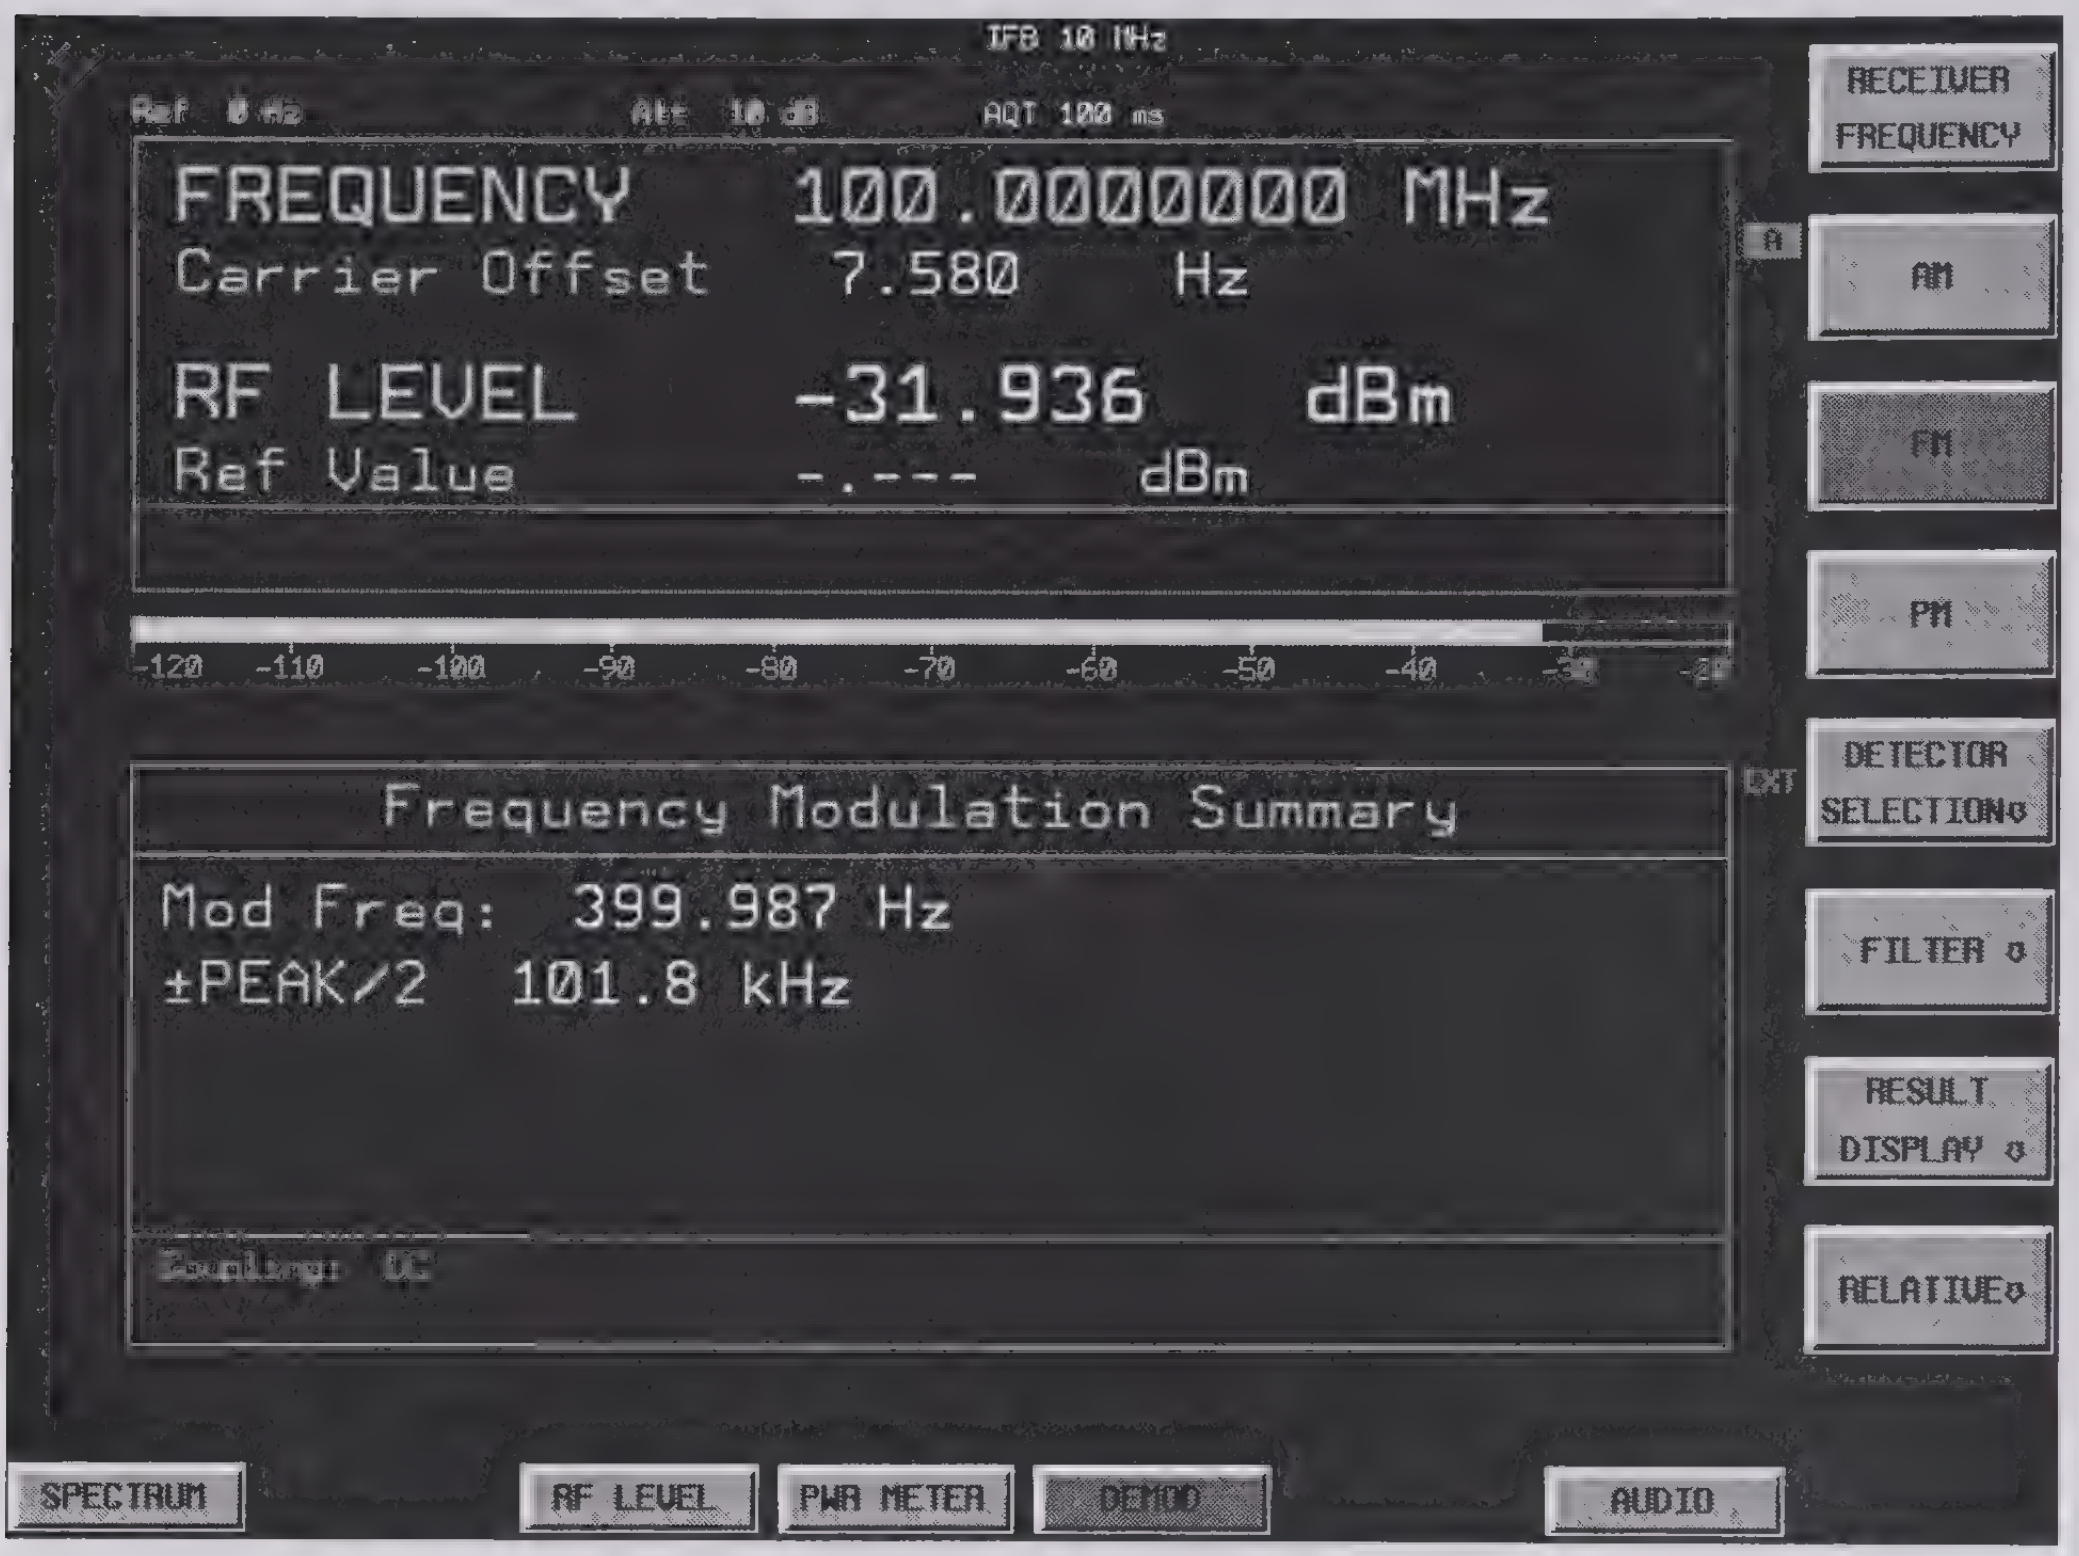

```
FREQUENCY        100.0000000 MHz
Carrier Offset     7.580     Hz

RF LEVEL         -31.936    dBm
Ref Value        -.---      dBm

Frequency Modulation Summary
Mod Freq:  399.987 Hz
±PEAK/2  101.8 kHz

Coupling: DC
```

Fig. 4.4-9 Screen display: modulation measurement

The *RECEIVER FREQUENCY* softkey activates the window for entering the receiver frequency .

The receiver frequency resolution is 0.1 Hz.
Setting range: $20\ \text{Hz} \le f_{REC} \le f_{max}$

Note: *This softkey is also available in the FREQ menu.*

IEC/IEEE bus command: `FREQ:CENT 300MHz`

The *AM* softkey activates the amplitude modulation measurement with its result displays.

IEC/IEEE bus command: `CALC2:FEED 'XTIM:AM:REL'`

The *FM* softkey activates the frequency modulation measurement with its result displays. In the device default setting of the modulation measurement mode, the FM measurement is active.

IEC/IEEE bus command: `CALC2:FEED 'XTIM:FM'`

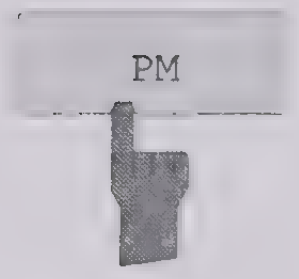

The *PM* softkey activates the phase modulation measurement with its result displays.

IEC/IEEE bus command: `CALC2:FEED 'XTIM:PM'`

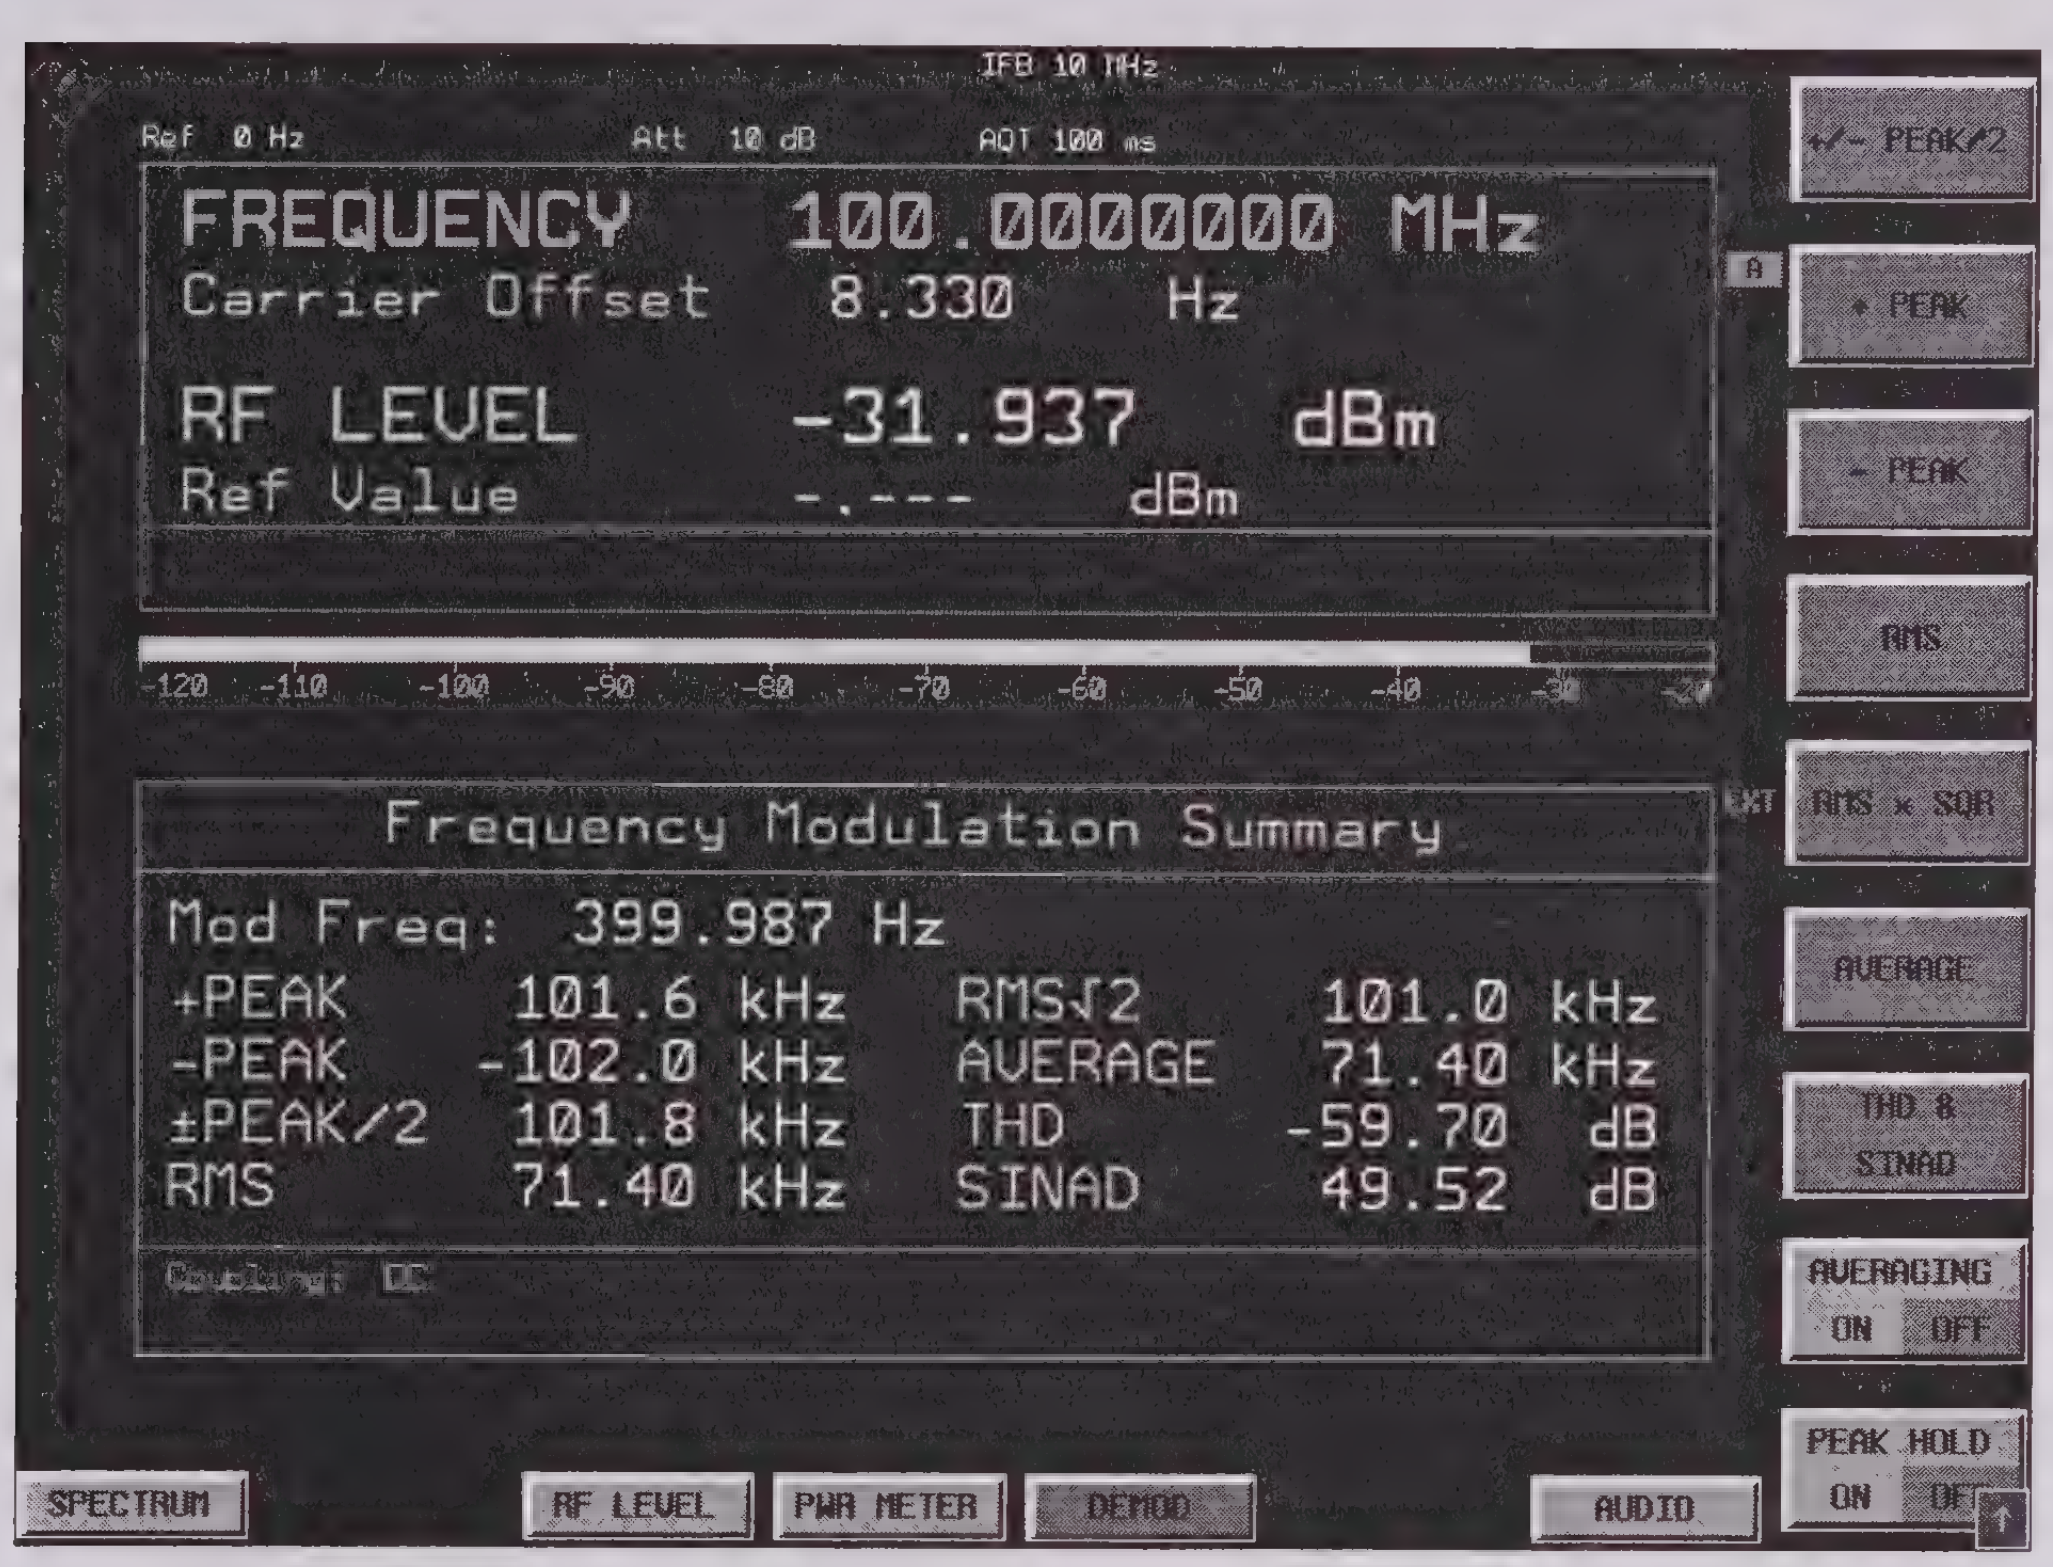

```
Ref  0 Hz            Att  10 dB      IFB 10 MHz
                                     AQT 100 ms
FREQUENCY        100.0000000 MHz
Carrier Offset    8.330    Hz

RF LEVEL         -31.937   dBm
Ref Value        -.---     dBm

      Frequency Modulation Summary
Mod Freq:  399.987 Hz
+PEAK       101.6 kHz  RMS√2      101.0 kHz
-PEAK      -102.0 kHz  AVERAGE    71.40 kHz
±PEAK/2     101.8 kHz  THD       -59.70  dB
RMS         71.40 kHz  SINAD      49.52  dB
Coupling: DC
```

Fig. 4.4-10 Screen display: modulation measurement with detectors

DETECTOR SELECTION

The *DETECTOR SELECTION* softkey opens a submenu for selecting the detectors for the result display.

+/-PEAK/2

The *+/-PEAK/2* softkey activates the display of the arithmetic average value from the positive and the negative peak value for the currently active modulation mode.

This detector is active in the device default setting.

IEC/IEEE bus command: `ADEM:DET:PAV ON`
The following commands are used for reading out the individual measured value:

```
CALC:MARK:FUNC:ADEM:AM? PAV
CALC:MARK:FUNC:ADEM:FM? PAV
CALC:MARK:FUNC:ADEM:PM? PAV
```

+PEAK

The *+PEAK/2* softkey activates the display of the positive peak value for the active modulation mode.

IEC/IEEE bus command: `ADEM:DET:PPE ON`
The following commands are used for reading out the individual measured value:

```
CALC:MARK:FUNC:ADEM:AM? PPE
CALC:MARK:FUNC:ADEM:FM? PPE
CALC:MARK:FUNC:ADEM:PM? PPE
```

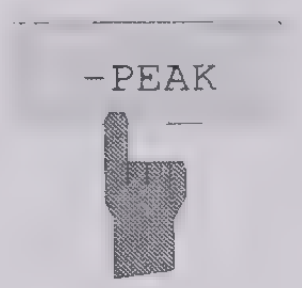

The *-PEAK/2* softkey activates the display of the negative peak value for the active modulation mode.

IEC/IEEE bus command: `ADEM:DET:MPE ON`
The following commands are used for reading out the individual measured value:

```
CALC:MARK:FUNC:ADEM:AM? MPE
CALC:MARK:FUNC:ADEM:FM? MPE
CALC:MARK:FUNC:ADEM:PM? MPE
```

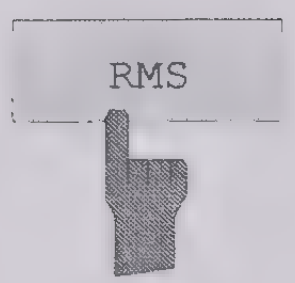

The *RMS* softkey activates the RMS value display for the active modulation mode.

IEC/IEEE bus command: `ADEM:DET:RMS ON`
The following commands are used for reading out the individual measured value:

```
CALC:MARK:FUNC:ADEM:AM? RMS
CALC:MARK:FUNC:ADEM:FM? RMS
CALC:MARK:FUNC:ADEM:PM? RMS
```

The *RMS*SQR* softkey activates the display of the RMS*√2 value for the active modulation mode.

IEC/IEEE bus command: `ADEM:DET:SRMS ON`
The following commands are used for reading out the individual measured value:

```
CALC:MARK:FUNC:ADEM:AM? SRMS
CALC:MARK:FUNC:ADEM:FM? SRMS
CALC:MARK:FUNC:ADEM:PM? SRMS
```

The *AVERAGE* softkey activates the display of the average value for the active modulation mode.

IEC/IEEE bus command: `ADEM:DET:AVER ON`
The following commands are used for reading out the individual measured value:

```
CALC:MARK:FUNC:ADEM:AM? AVER
CALC:MARK:FUNC:ADEM:FM? AVER
CALC:MARK:FUNC:ADEM:PM? AVER
```

The *THD&SINAD* softkey activates the displays of *total harmonic distortion* and *signal, noise and distortion* for the active modulation mode.

IEC/IEEE bus commands:

```
ADEM:DET:THD ON
ADEM:DET:SINAD ON
```

Each of the IEC/IEEE bus commands switches both displays on or off.

The following commands are used for reading out the individual measured value:

```
CALC:MARK:FUNC:ADEM:SINAD?
CALC:MARK:FUNC:ADEM:THD?
```

For all selected detectors, the *AVERAGING ON/OFF* softkey additionally activates the display of the average value from several measurements.

IEC/IEEE bus command: `ADEM:AVER ON`

For reading out the individual measured value, `AVER` is inserted into the command, e.g.:

```
CALC:MARK:FUNC:ADEM:AM:AVER? PAV
CALC:MARK:FUNC:ADEM:FM:AVER? PPE
CALC:MARK:FUNC:ADEM:PM:AVER? RMS
```

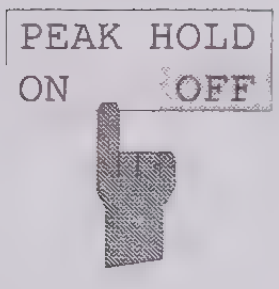

For all selected detectors, the *PEAK HOLD ON/OFF* softkey additionally activates the display of the maximum value from several measurements.

IEC/IEEE bus command: `ADEM:PHOL ON`

For reading out the individual measured value, `PHOL` is inserted into the command, e.g.:

```
CALC:MARK:FUNC:ADEM:AM:PHOL? PAV
CALC:MARK:FUNC:ADEM:FM:PHOL? PPE
CALC:MARK:FUNC:ADEM:PM:PHOL? RMS
```

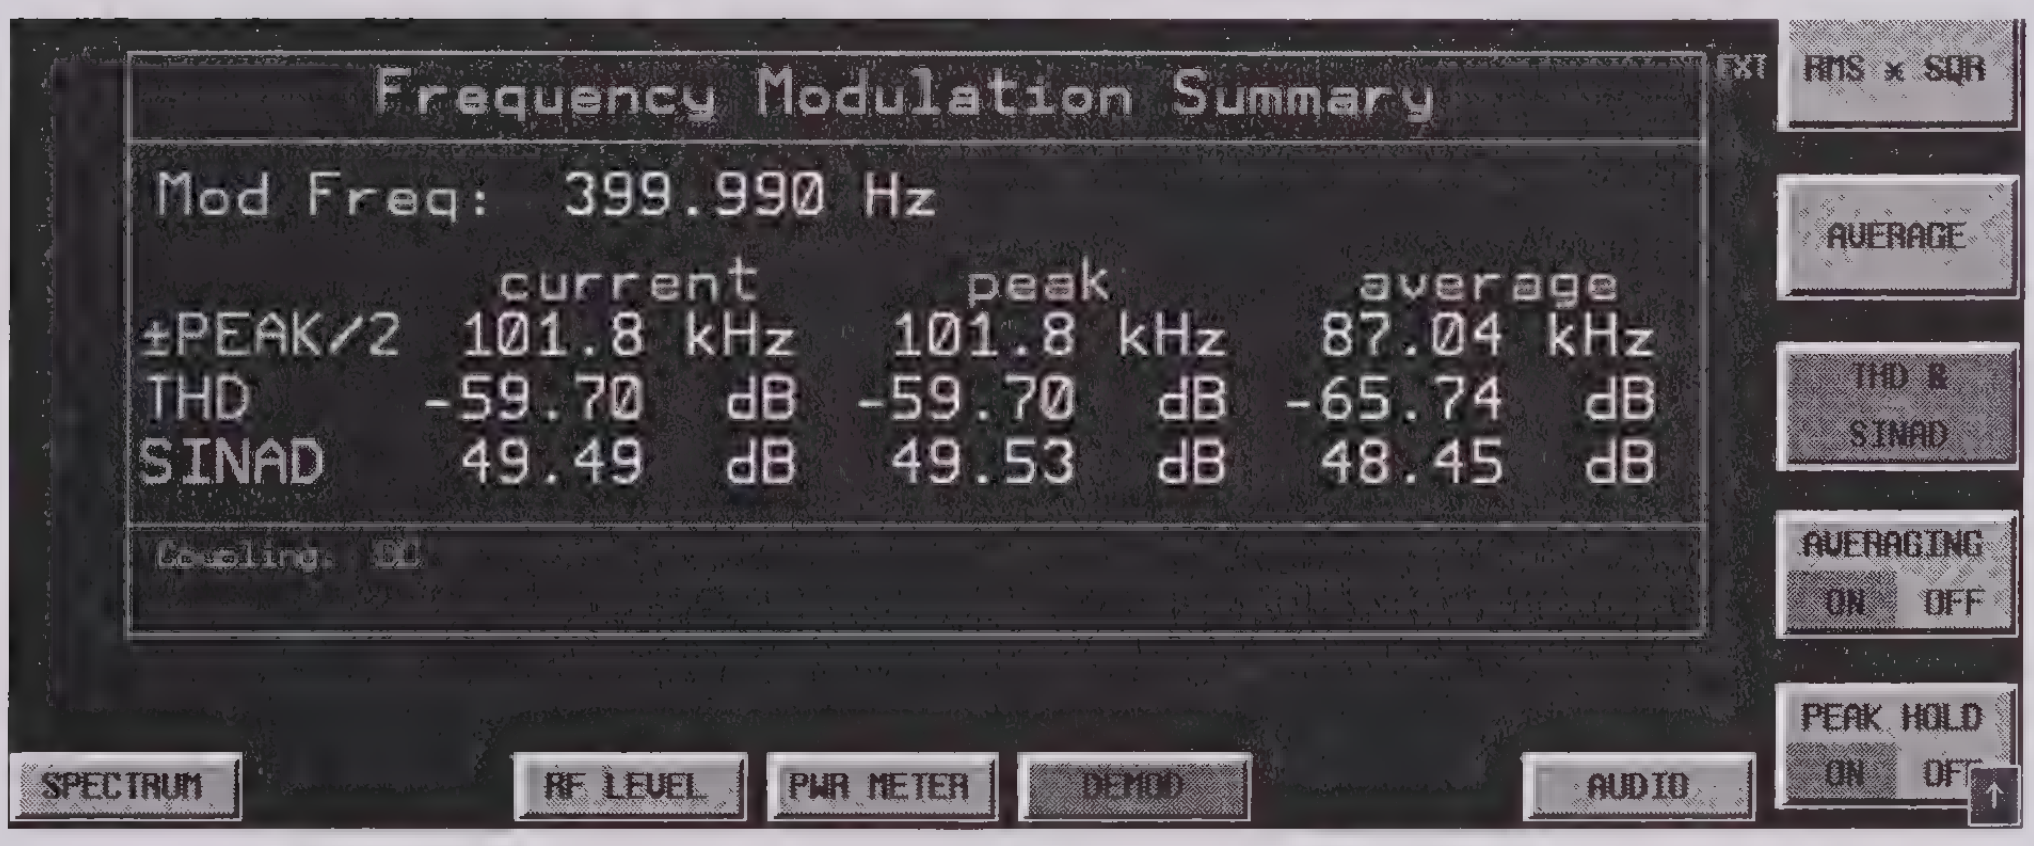

```
Frequency Modulation Summary
Mod Freq:  399.990 Hz
            current      peak        average
±PEAK/2   101.8 kHz   101.8 kHz   87.04 kHz
THD      -59.70  dB  -59.70  dB  -65.74  dB
SINAD     49.49  dB   49.53  dB   48.45  dB
Coupling: DC
```

Fig. 4.4-11 Modulation measurement results with Averaging and Peak Hold

If many detectors and result options are active, the measurement results are output in smaller characters.

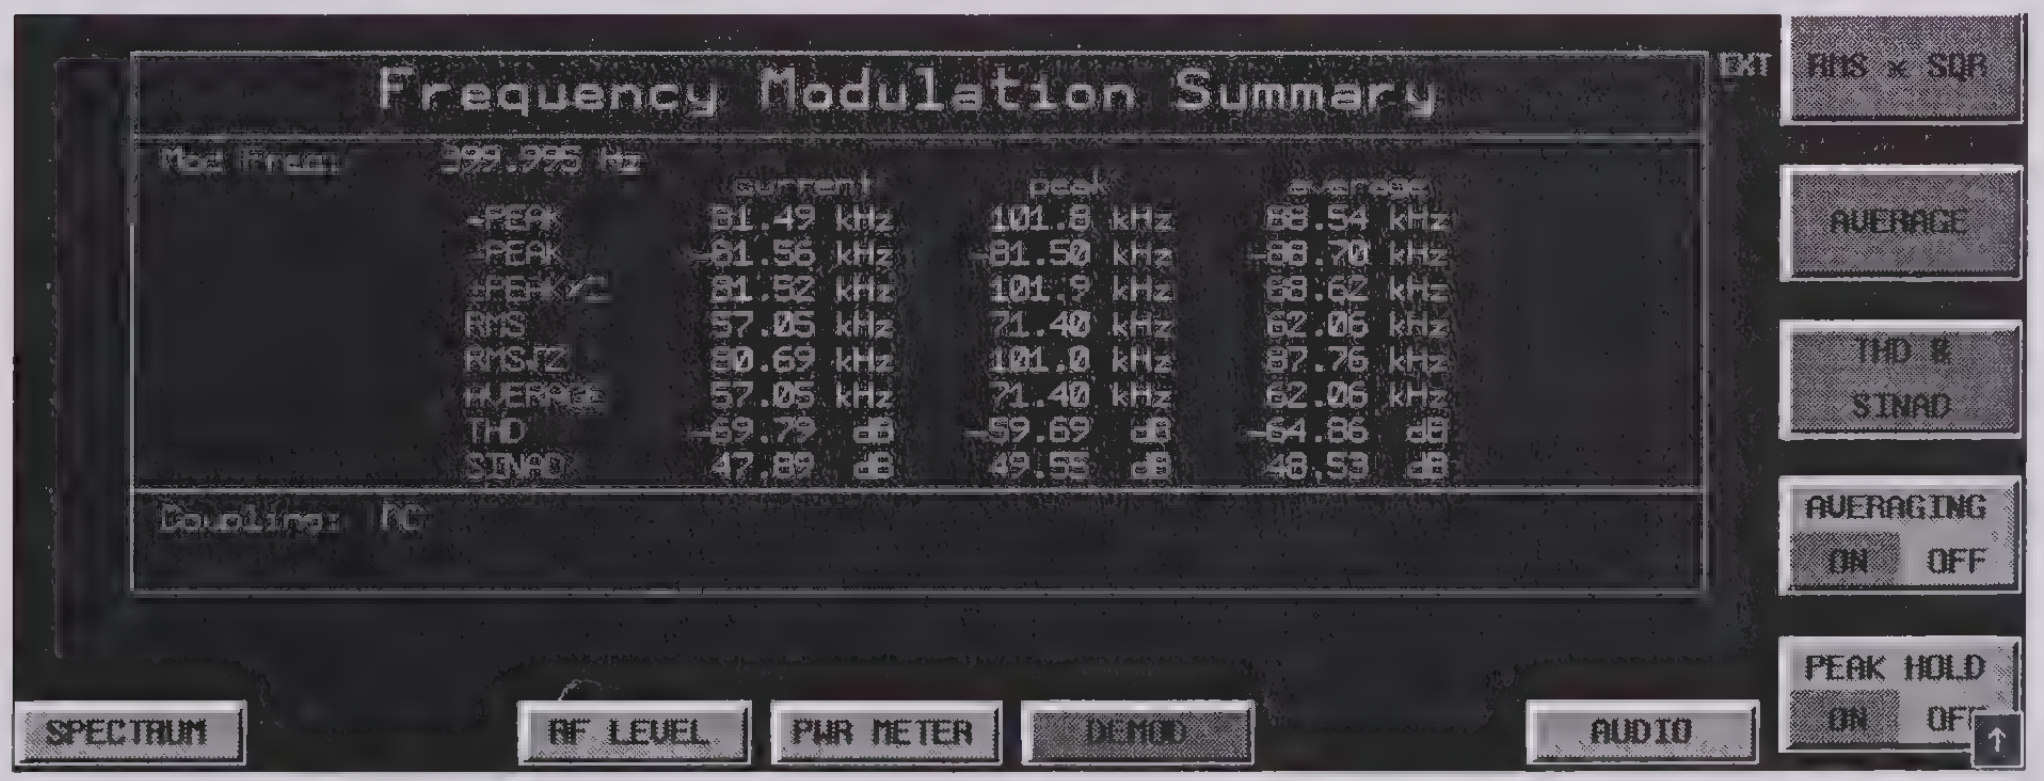

```
Frequency Modulation Summary
Mod Freq:   399.995 Hz
              current      peak         average
+PEAK       81.49 kHz    101.8 kHz     88.54 kHz
-PEAK      -81.56 kHz   -81.50 kHz    -88.70 kHz
±PEAK/2     81.52 kHz    101.9 kHz     88.62 kHz
RMS         57.05 kHz    71.40 kHz     62.06 kHz
RMS√2       80.69 kHz    101.0 kHz     87.76 kHz
AVERAGE     57.05 kHz    71.40 kHz     62.06 kHz
THD        -69.79  dB   -59.69  dB    -64.86  dB
SINAD       47.89  dB    49.55  dB     48.53  dB
Coupling: AC
```

Fig. 4.4-12 All detectors with Averaging and Peak Hold displayed in smaller font

FILTER

The *FILTER* softkey opens a submenu for setting the AF filters.

HIGHPASS 50 HZ

HIGHPASS 300 HZ

The *HIGHPASS 50 HZ* and *HIGHPASS 300 HZ* softkeys insert a highpass filter of 50 Hz or 300 Hz into the audio signal path. In the default setting, no highpass filter is inserted.

IEC/IEEE bus commands:

```
FILT:HPAS ON
FILT:HPAS:FREQ 300 HZ
```

LOWPASS 3 KHZ

LOWPASS 15 KHZ

LOWPASS 100 KHZ

The *LOWPASS 3 KHZ, LOWPASS 15 KHZ* and *LOWPASS 100 KHZ* softkeys insert a lowpass filter of 3 kHz, 15 kHz or 100 kHz into the audio signal path.
In the default setting, no lowpass filter is inserted.

IEC/IEEE bus commands:

```
FILT:LPAS ON
FILT:LPAS:FREQ 100 KHZ
```

DEEMPHASIS WEIGHTING

The *DEEMPHASIS/WEIGHTING* softkey opens a submenu for setting the AF filters.

DEEMPHASIS 25 µs

DEEMPHASIS 50 µs

DEEMPHASIS 75 µs

DEEMPHASIS 750 µs

The *DEEMPHASIS 25 µs, DEEMPHASIS 50 µs, DEEMPHASIS 75 µs* and *DEEMPHASIS 750 µs* softkeys insert a user-selectable deemphasis of either 25 µs, 50 µs, 75 µs or 750 µs into the audio signal path.

In the default setting, no deemphasis is inserted.

IEC/IEEE bus commands:

```
FILT:DEMP ON
FILT:DEMP:TCON 25 us
```

WEIGHTING CCITT

The *WEIGHTING CCITT* softkey inserts a weighting filter in line with the CCITT P53 standard into the signal path.

This filter is deactivated in the default setting.

IEC/IEEE bus command: `FILT:CCIT ON`

WEIGHTING CCIR

The *WEIGHTING CCIR* softkey inserts a weighting filter in line with the CCIR 468-4 standard into the signal path.

This filter is deactivated in the default setting.

IEC/IEEE bus command: `FILT:CCIR ON`

RESULT DISPLAY

The *RESULT DISPLAY* softkey opens a submenu for configuring the screen display.

BARGRAPH

The *BARGRAPH* softkey inserts a numeric frequency and level display in the upper screen half as well as a graphic level display with a bargraph.

IEC/IEEE bus command: `CALC:FEED 'XTIM:RFP:BARG'`

TIME DOMAIN

The *TIME DOMAIN* softkey inserts a graphical display with the time characteristics of the demodulated signal in the upper screen half.

IEC/IEEE bus commands:

```
CALC:FEED 'XTIM:AM:REL'
CALC:FEED 'XTIM:FM'
CALC:FEED 'XTIM:PM'
```

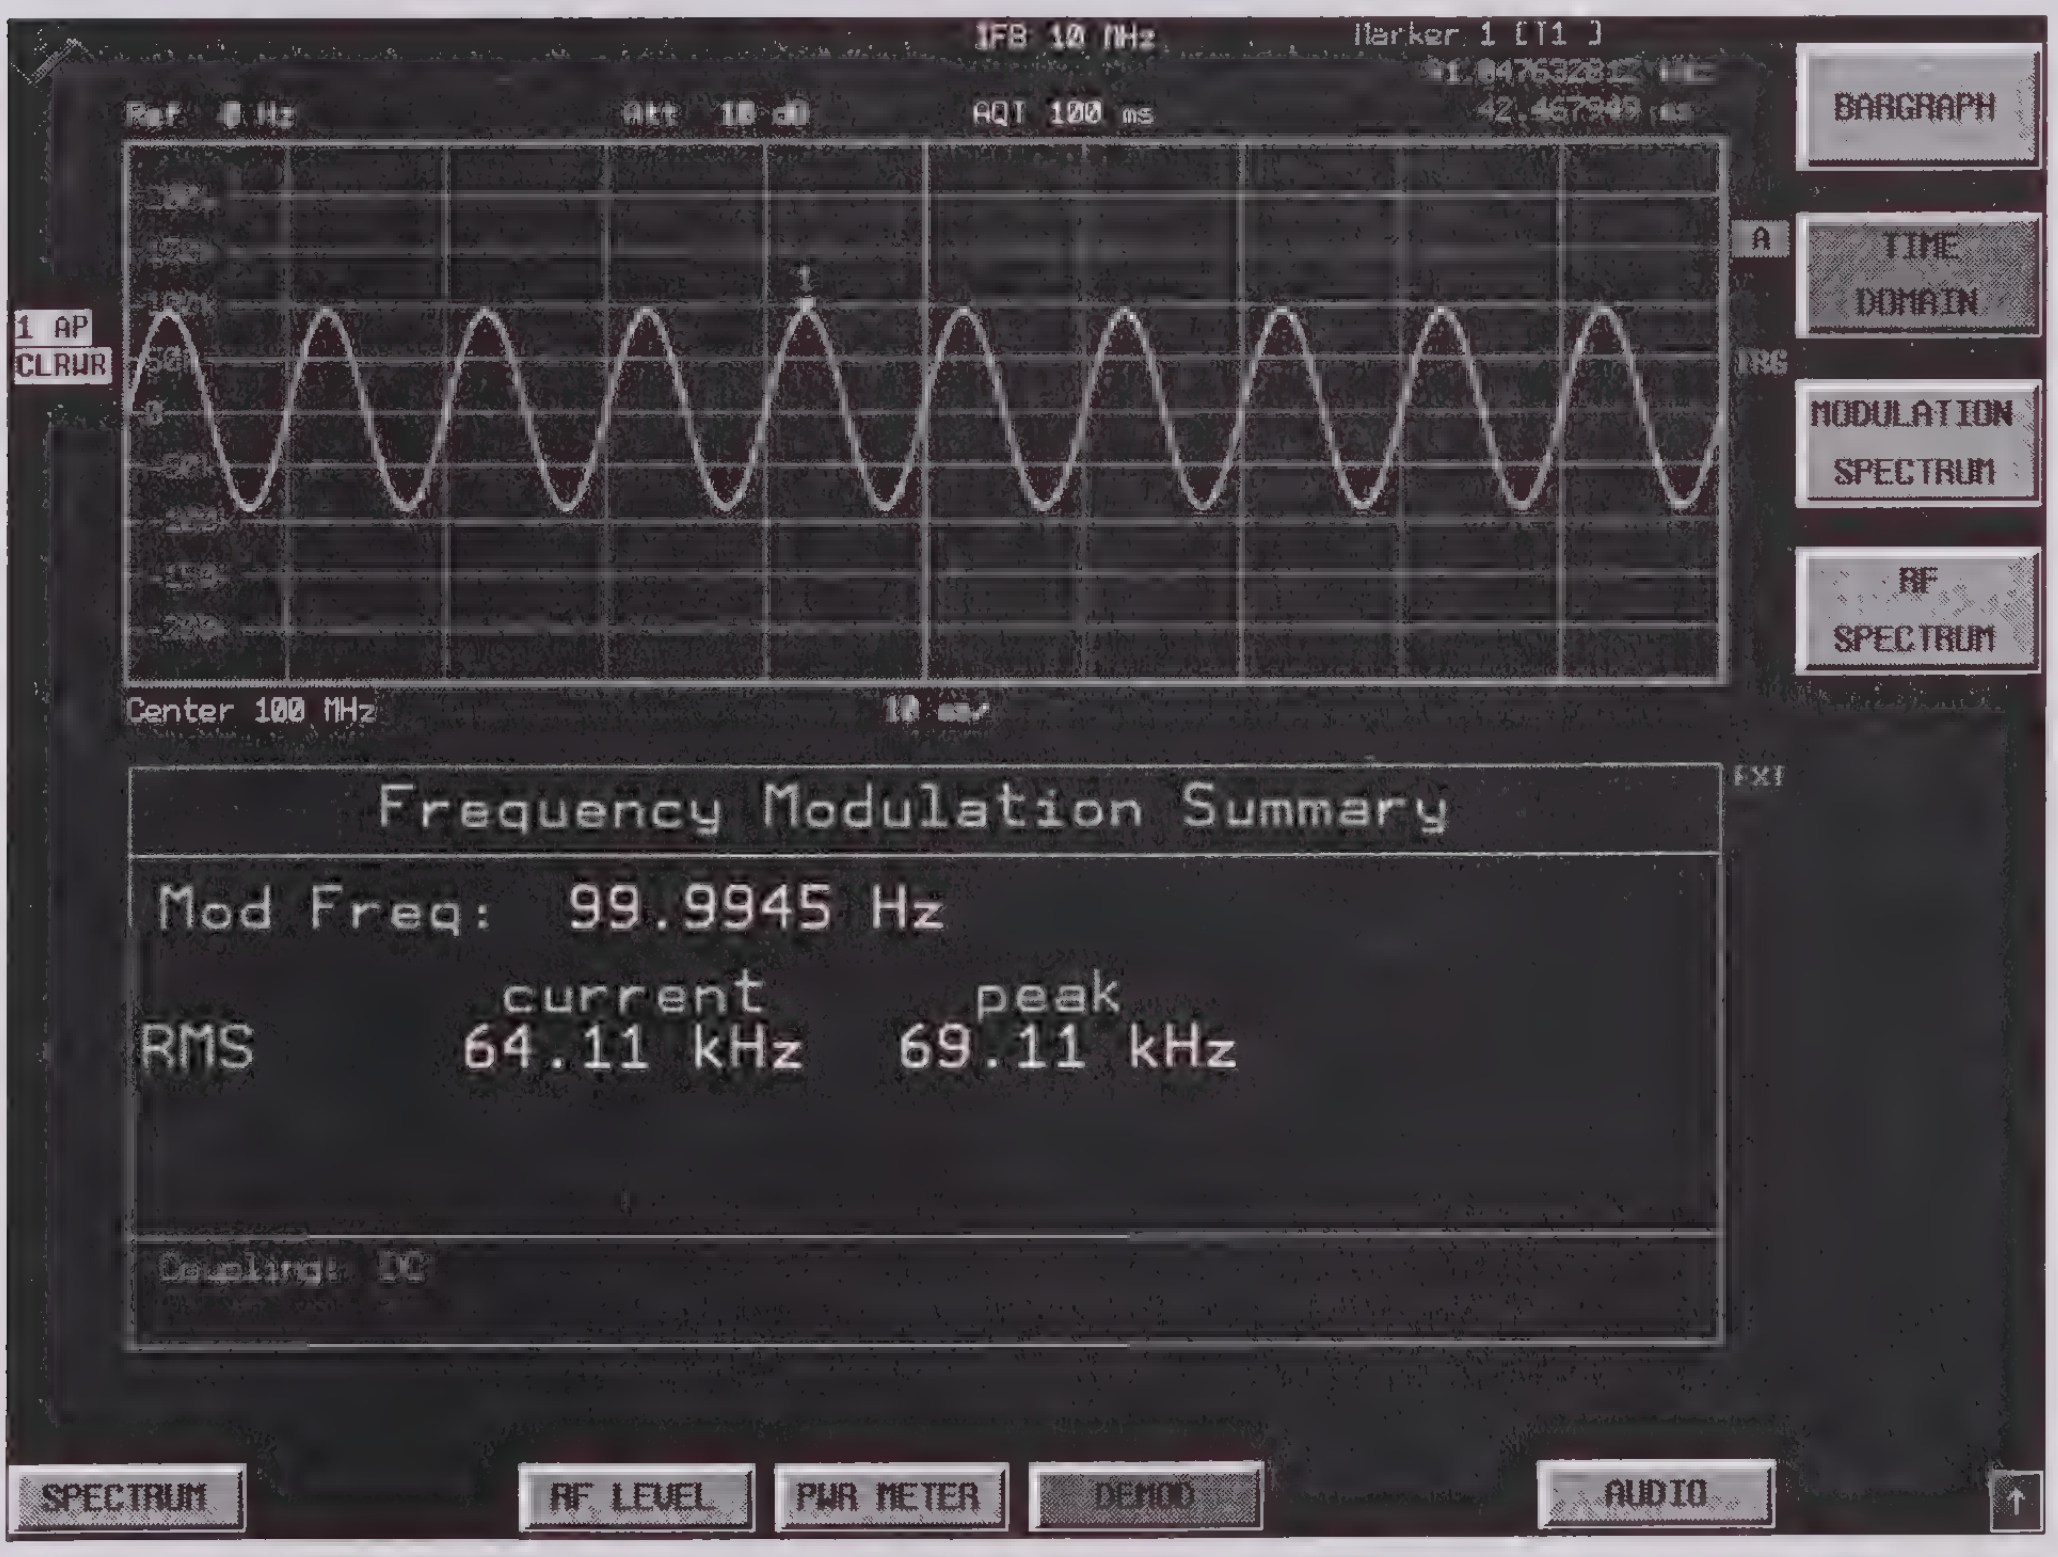

```
Frequency Modulation Summary
Mod Freq:   99.9945 Hz
              current      peak
RMS         64.11 kHz   69.11 kHz

Coupling: DC
```

Fig. 4.4-13 Time domain display in upper window

MODULATION SPECTRUM

The *MODULATION SPECTRUM* softkey inserts in the upper screen half a graphical display with the AF spectrum of the demodulated signal.

IEC/IEEE bus commands:

```
CALC:FEED 'XTIM:AM:REL:AFSP'
CALC:FEED 'XTIM:FM:AFSP'
CALC:FEED 'XTIM:PM:AFSP'
```

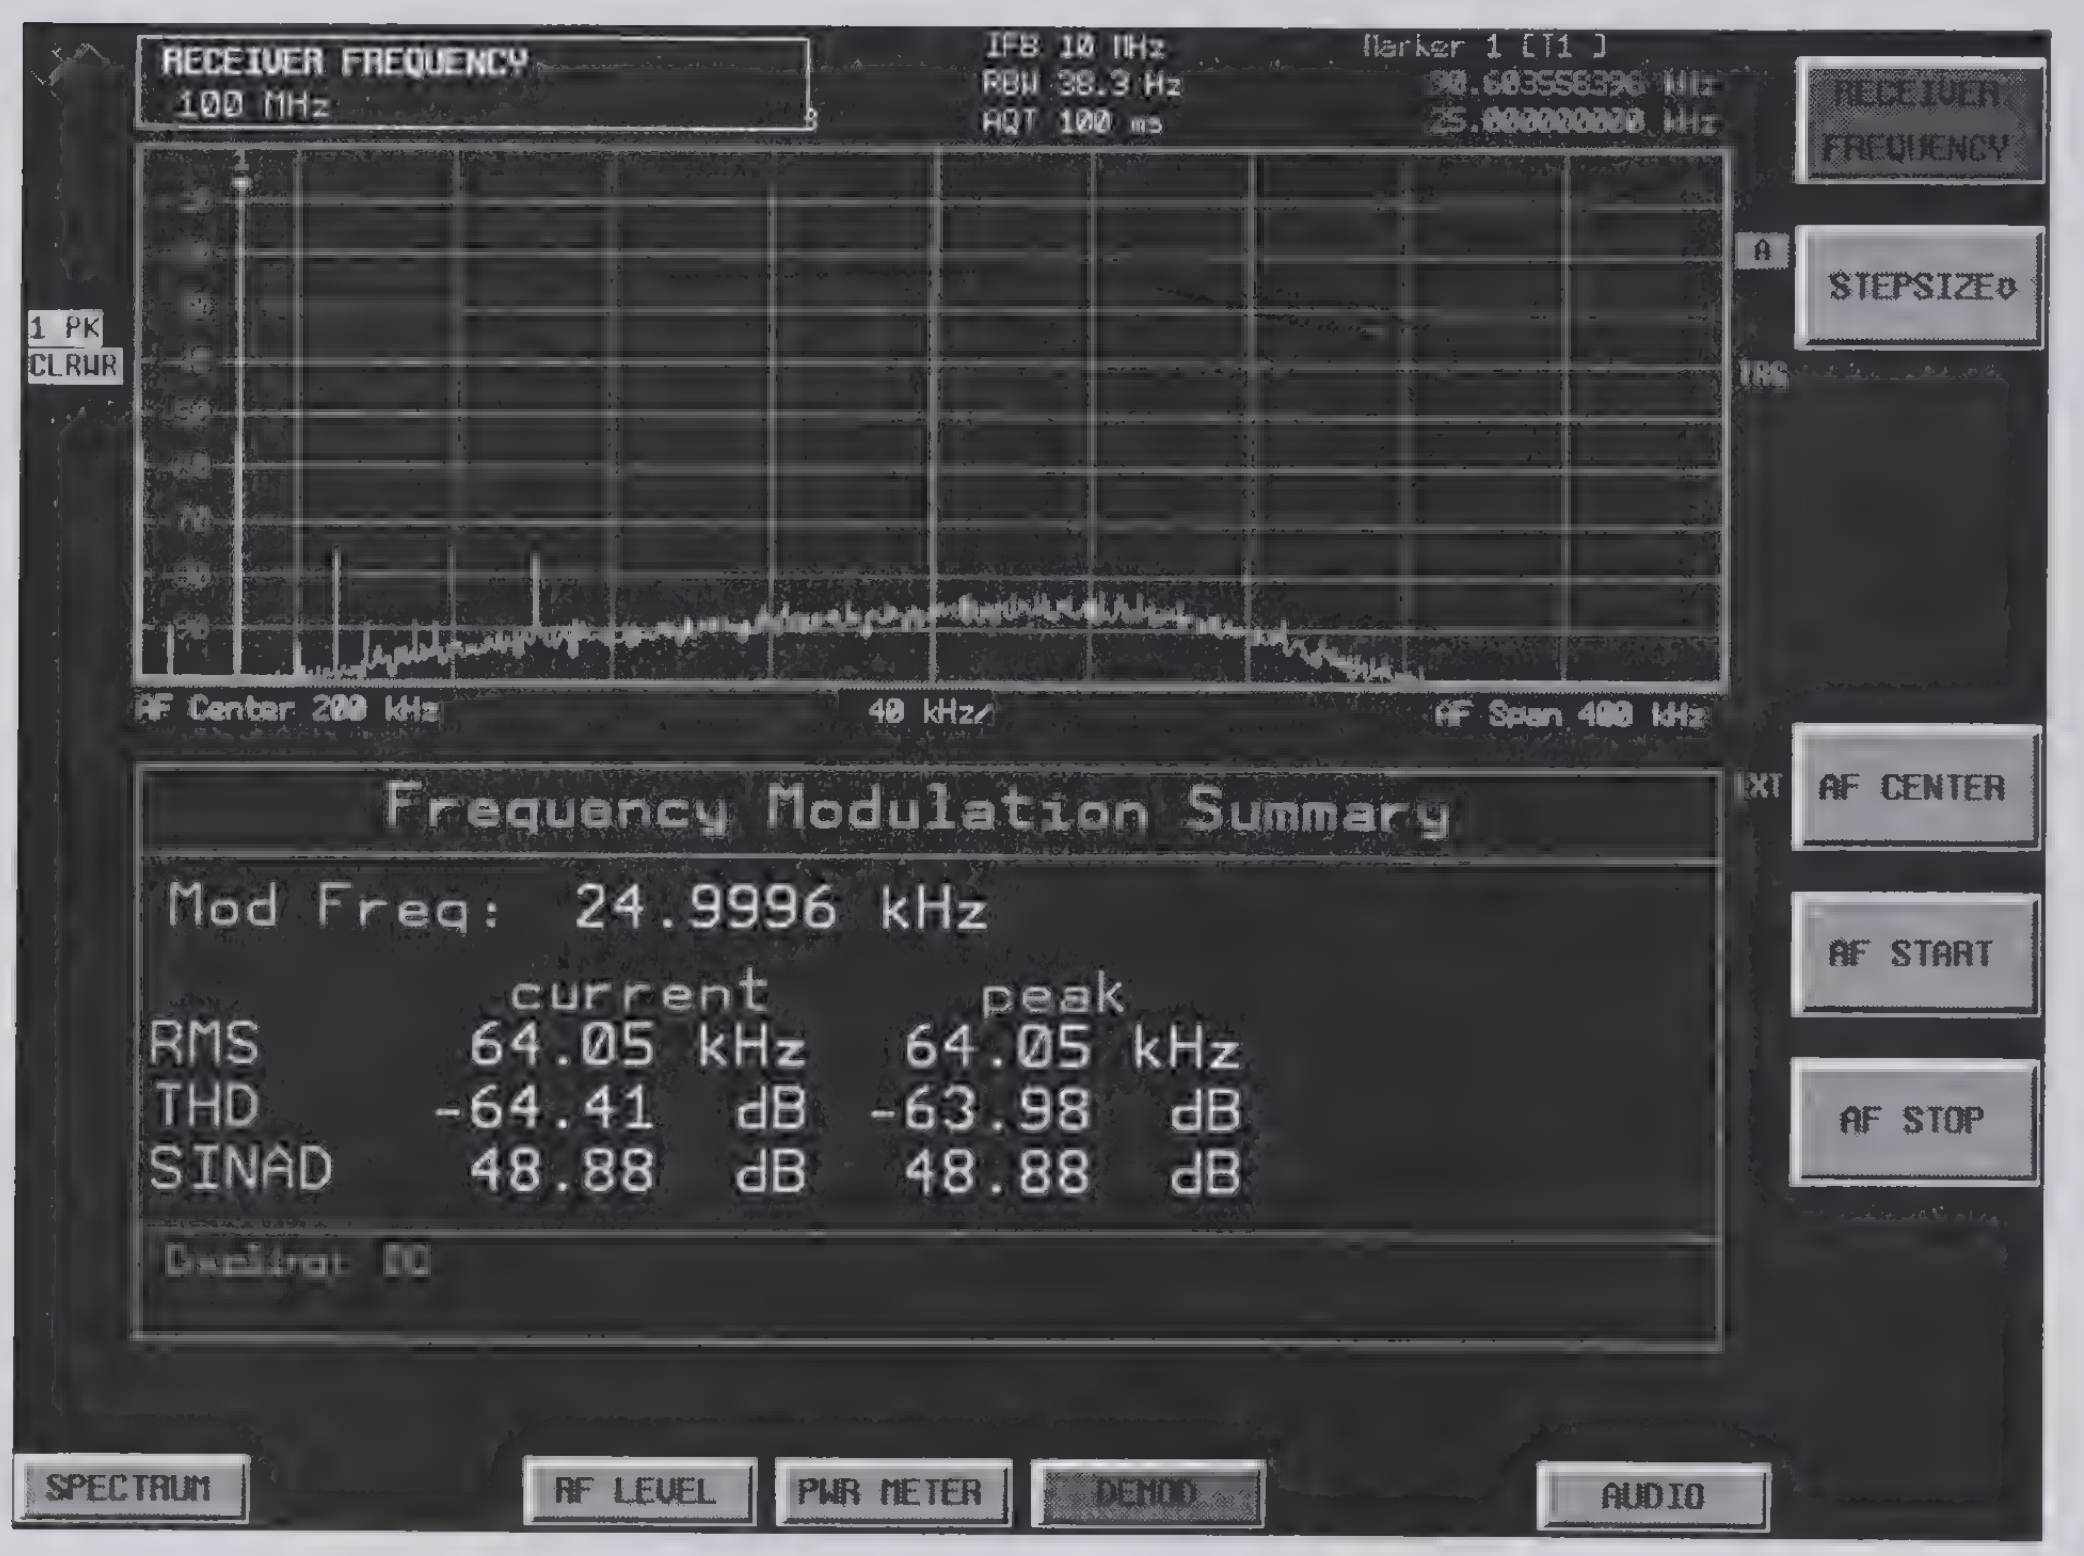

RECEIVER FREQUENCY
100 MHz

IFB 10 MHz
RBW 38.3 Hz
AQT 100 ms

Marker 1 [T1]
90.603556396 kHz
25.000000000 kHz

AF Center 200 kHz
40 kHz/
AF Span 400 kHz

Frequency Modulation Summary

Mod Freq: 24.9996 kHz

	current	peak
RMS	64.05 kHz	64.05 kHz
THD	-64.41 dB	-63.98 dB
SINAD	48.88 dB	48.88 dB

Fig. 4.4-14 Modulation spectrum display in upper window

RF SPECTRUM

The *RF SPECTRUM* softkey inserts a graphical display with the RF spectrum of the received signal in the upper screen half.

IEC/IEEE bus command: `CALC:FEED 'XTIM:SPEC'`

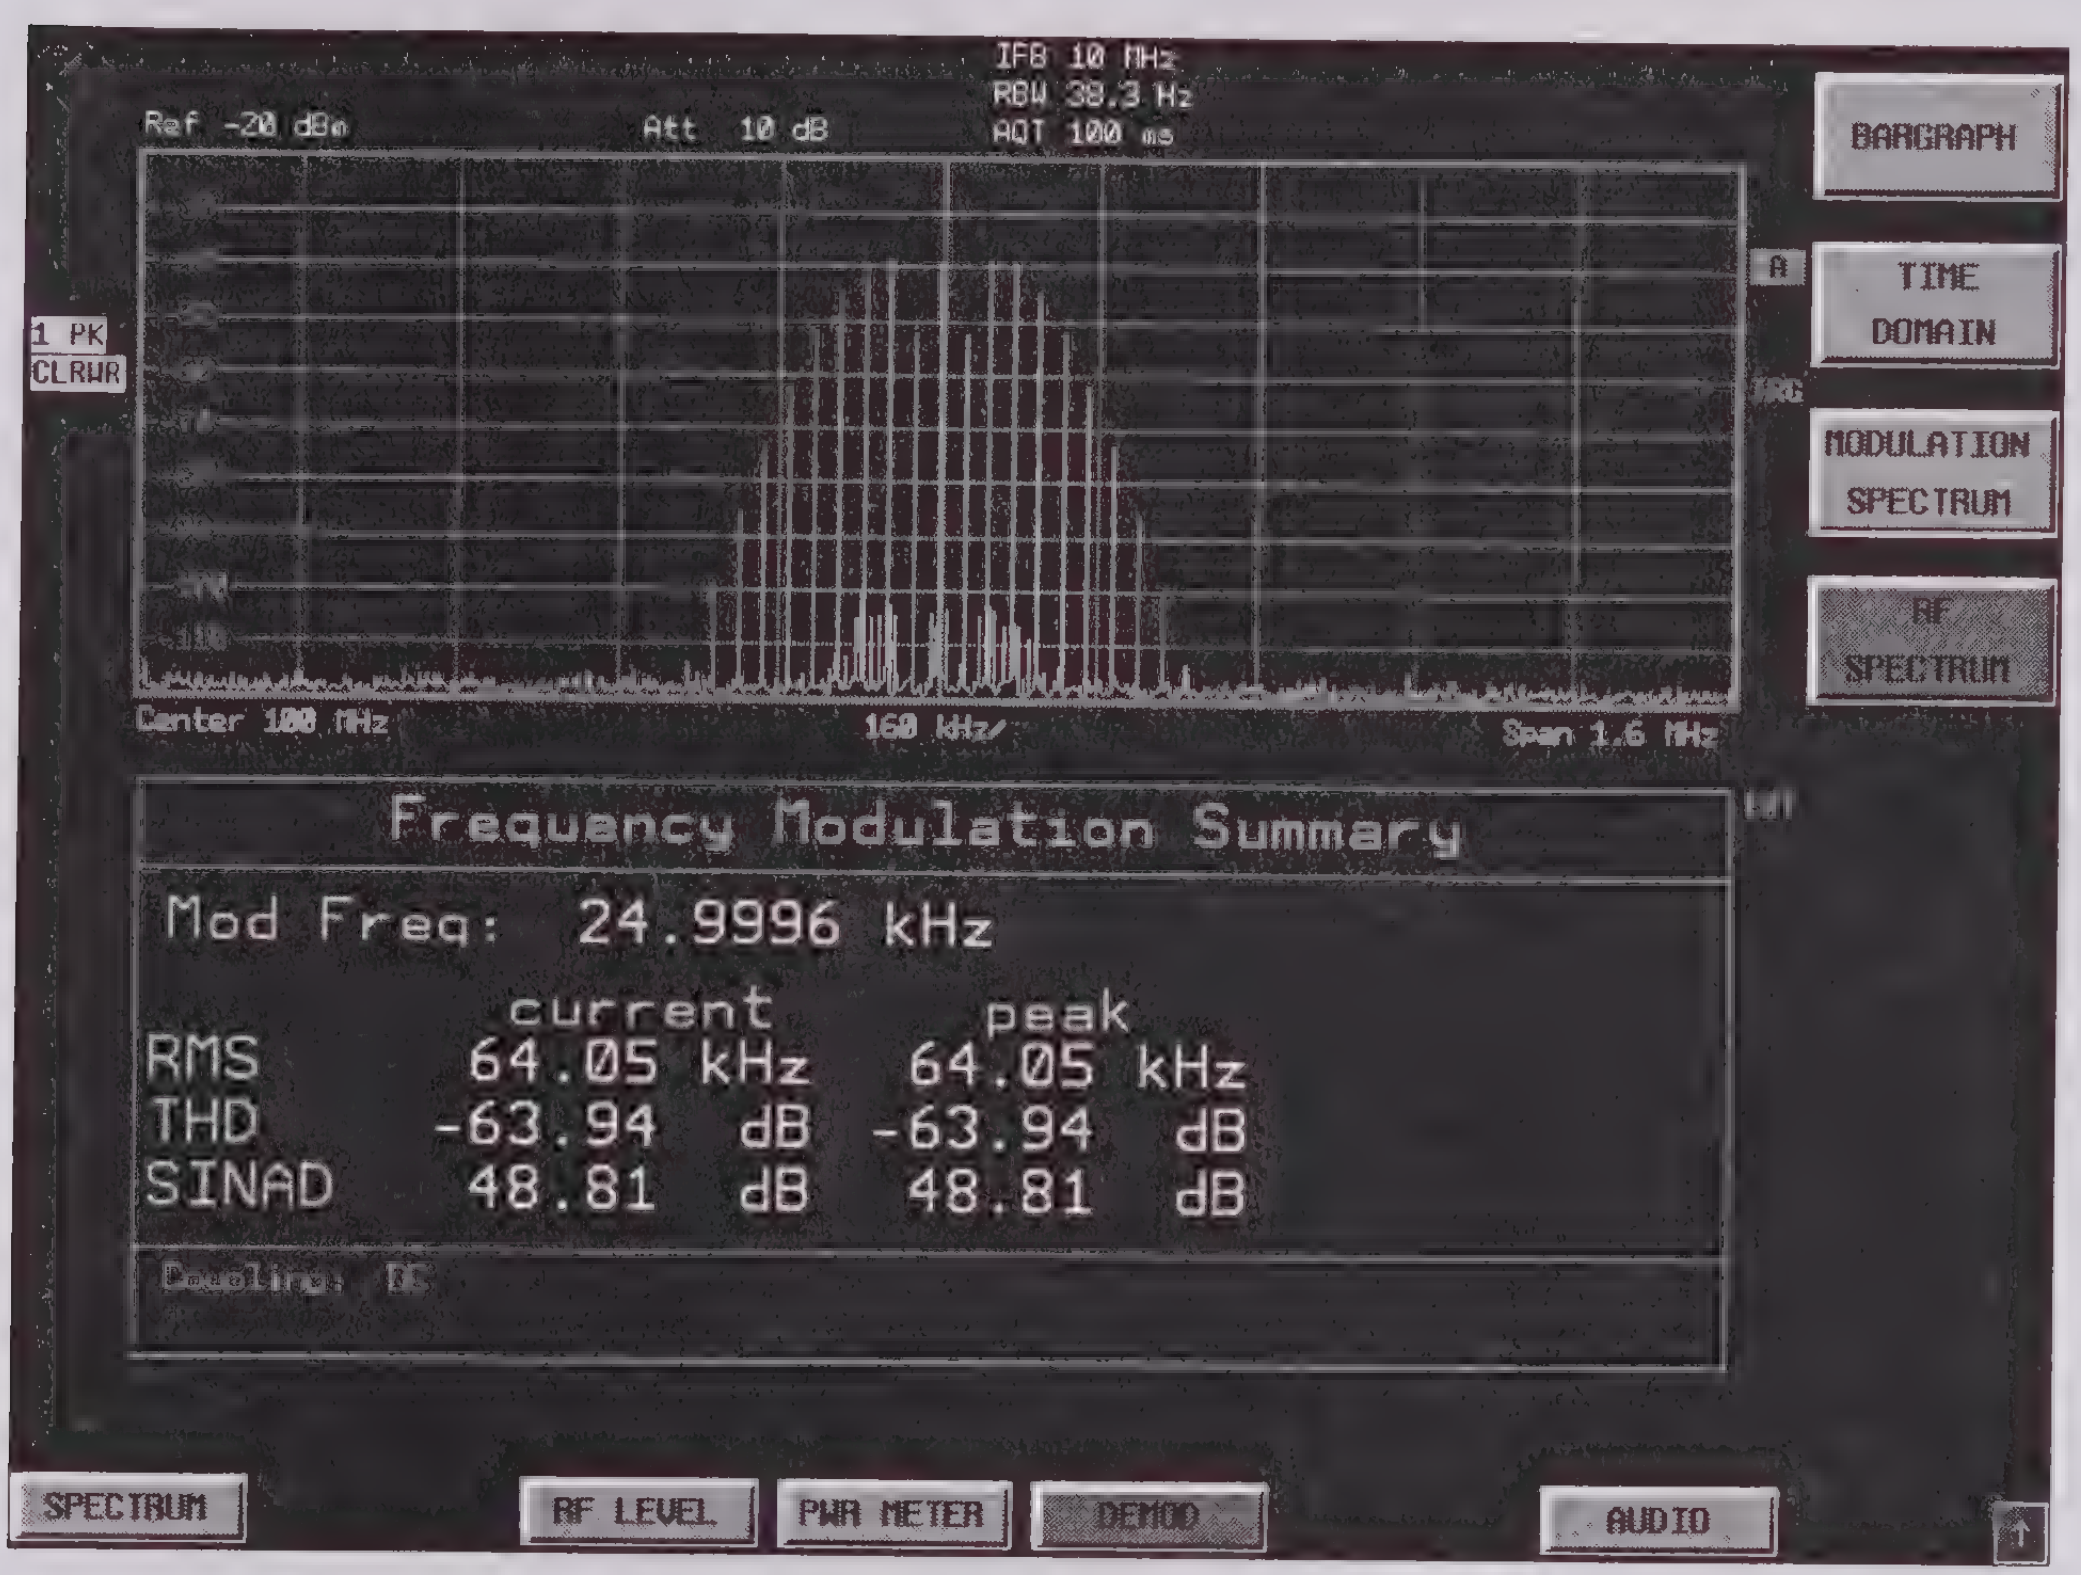

Frequency Modulation Summary

Mod Freq: 24.9996 kHz

	current	peak
RMS	64.05 kHz	64.05 kHz
THD	-63.94 dB	-63.94 dB
SINAD	48.81 dB	48.81 dB

Coupling: DC

Fig. 4.4-15 RF-spectrum- display in upper window

RELATIVE

The *RELATIVE* softkey opens a submenu for configuring the relative display of the modulation measurement results.

MEAS->REF

The *MEAS->REF* softkey adopts the current modulation measurement values for all active detectors as reference values.

IEC/IEEE bus command: `ADEM:DET:REF:AUTO ONCE`

+/-PEAK/2

The *+/-PEAK/2* softkey switches the relative display of the arithmetic average value from the positive and the negative peak value for the currently active modulation mode on or off. When the relative display is switched on, the current measured value of this detector is automatically adopted as the reference value.
The softkey opens a data entry field that also allows you to define the reference value manually.

IEC/IEEE bus commands:

```
ADEM:DET:PAV:~~MOD~~ MODE REL
ADEM:DET:PAV:REF 10
ADEM:DET:PAV:REF:AUTO ONCE
```

+PEAK

The *+PEAK* softkey switches the relative display of the positive peak value for the active modulation mode on or off. When the relative display is switched on, the current measured value of this detector is automatically adopted as the reference value.
The softkey opens a data entry field that also allows you to define the reference value manually.

IEC/IEEE bus commands:

```
ADEM:DET:PPE:MOD REL
ADEM:DET:PPE:REF 10
ADEM:DET:PPE:REF:AUTO ONCE
```

-PEAK

The *-PEAK* softkey switches the relative display of the negative peak value for the active modulation mode on or off. When the relative display is switched on, the current measured value of this detector is automatically adopted as the reference value.
The softkey opens a data entry field that also allows you to define the reference value manually.

IEC/IEEE bus commands:

```
ADEM:DET:MPE:MOD REL
ADEM:DET:MPE:REF 10
ADEM:DET:MPE:REF:AUTO ONCE
```

RMS

The *RMS* softkey switches the relative display of the RMS detector for the active modulation mode on or off. When the relative display is switched on, the current measured value of this detector is automatically adopted as the reference value.
The softkey opens a data entry field that also allows you to define the reference value manually.

IEC/IEEE bus commands:

```
ADEM:DET:RMS:MOD REL
ADEM:DET:RMS:REF 10
ADEM:DET:RMS:REF:AUTO ONCE
```

RMS*SQR

The *RMS*SQR* softkey switches the relative display of the RMS*√2 detector for the active modulation mode on or off. When the relative display is switched on, the current measured value of this detector is automatically adopted as the reference value.
The softkey opens a data entry field that also allows you to define the reference value manually.

IEC/IEEE bus commands:

```
ADEM:DET:SRMS:MOD REL
ADEM:DET:SRMS:REF 10
ADEM:DET:SRMS:REF:AUTO ONCE
```

AVERAGE

The *AVERAGE* softkey switches the relative display of the average value detector for the active modulation mode on or off. When the relative display is switched on, the current measured value of this detector is automatically adopted as the reference value.
The softkey opens a data entry field that also allows you to define the reference value manually.

IEC/IEEE bus commands:

```
ADEM:DET:AVER:MOD REL
ADEM:DET:AVER:REF 10
ADEM:DET:AVER:REF:AUTO ONCE
```

RELATIVE
DB %

The RELATIVE DB/% softkey switches between the units dB and % for the relative display of the modulation measurement results.

IEC/IEEE bus command: `UNIT:POW:RAT DB | PCT`

RELATIVE
OFF

The *RELATIVE OFF* softkey switches all relative displays of the modulation measurement results to absolute display.

IEC/IEEE bus command: `ADEM:DET:REF AOFF`

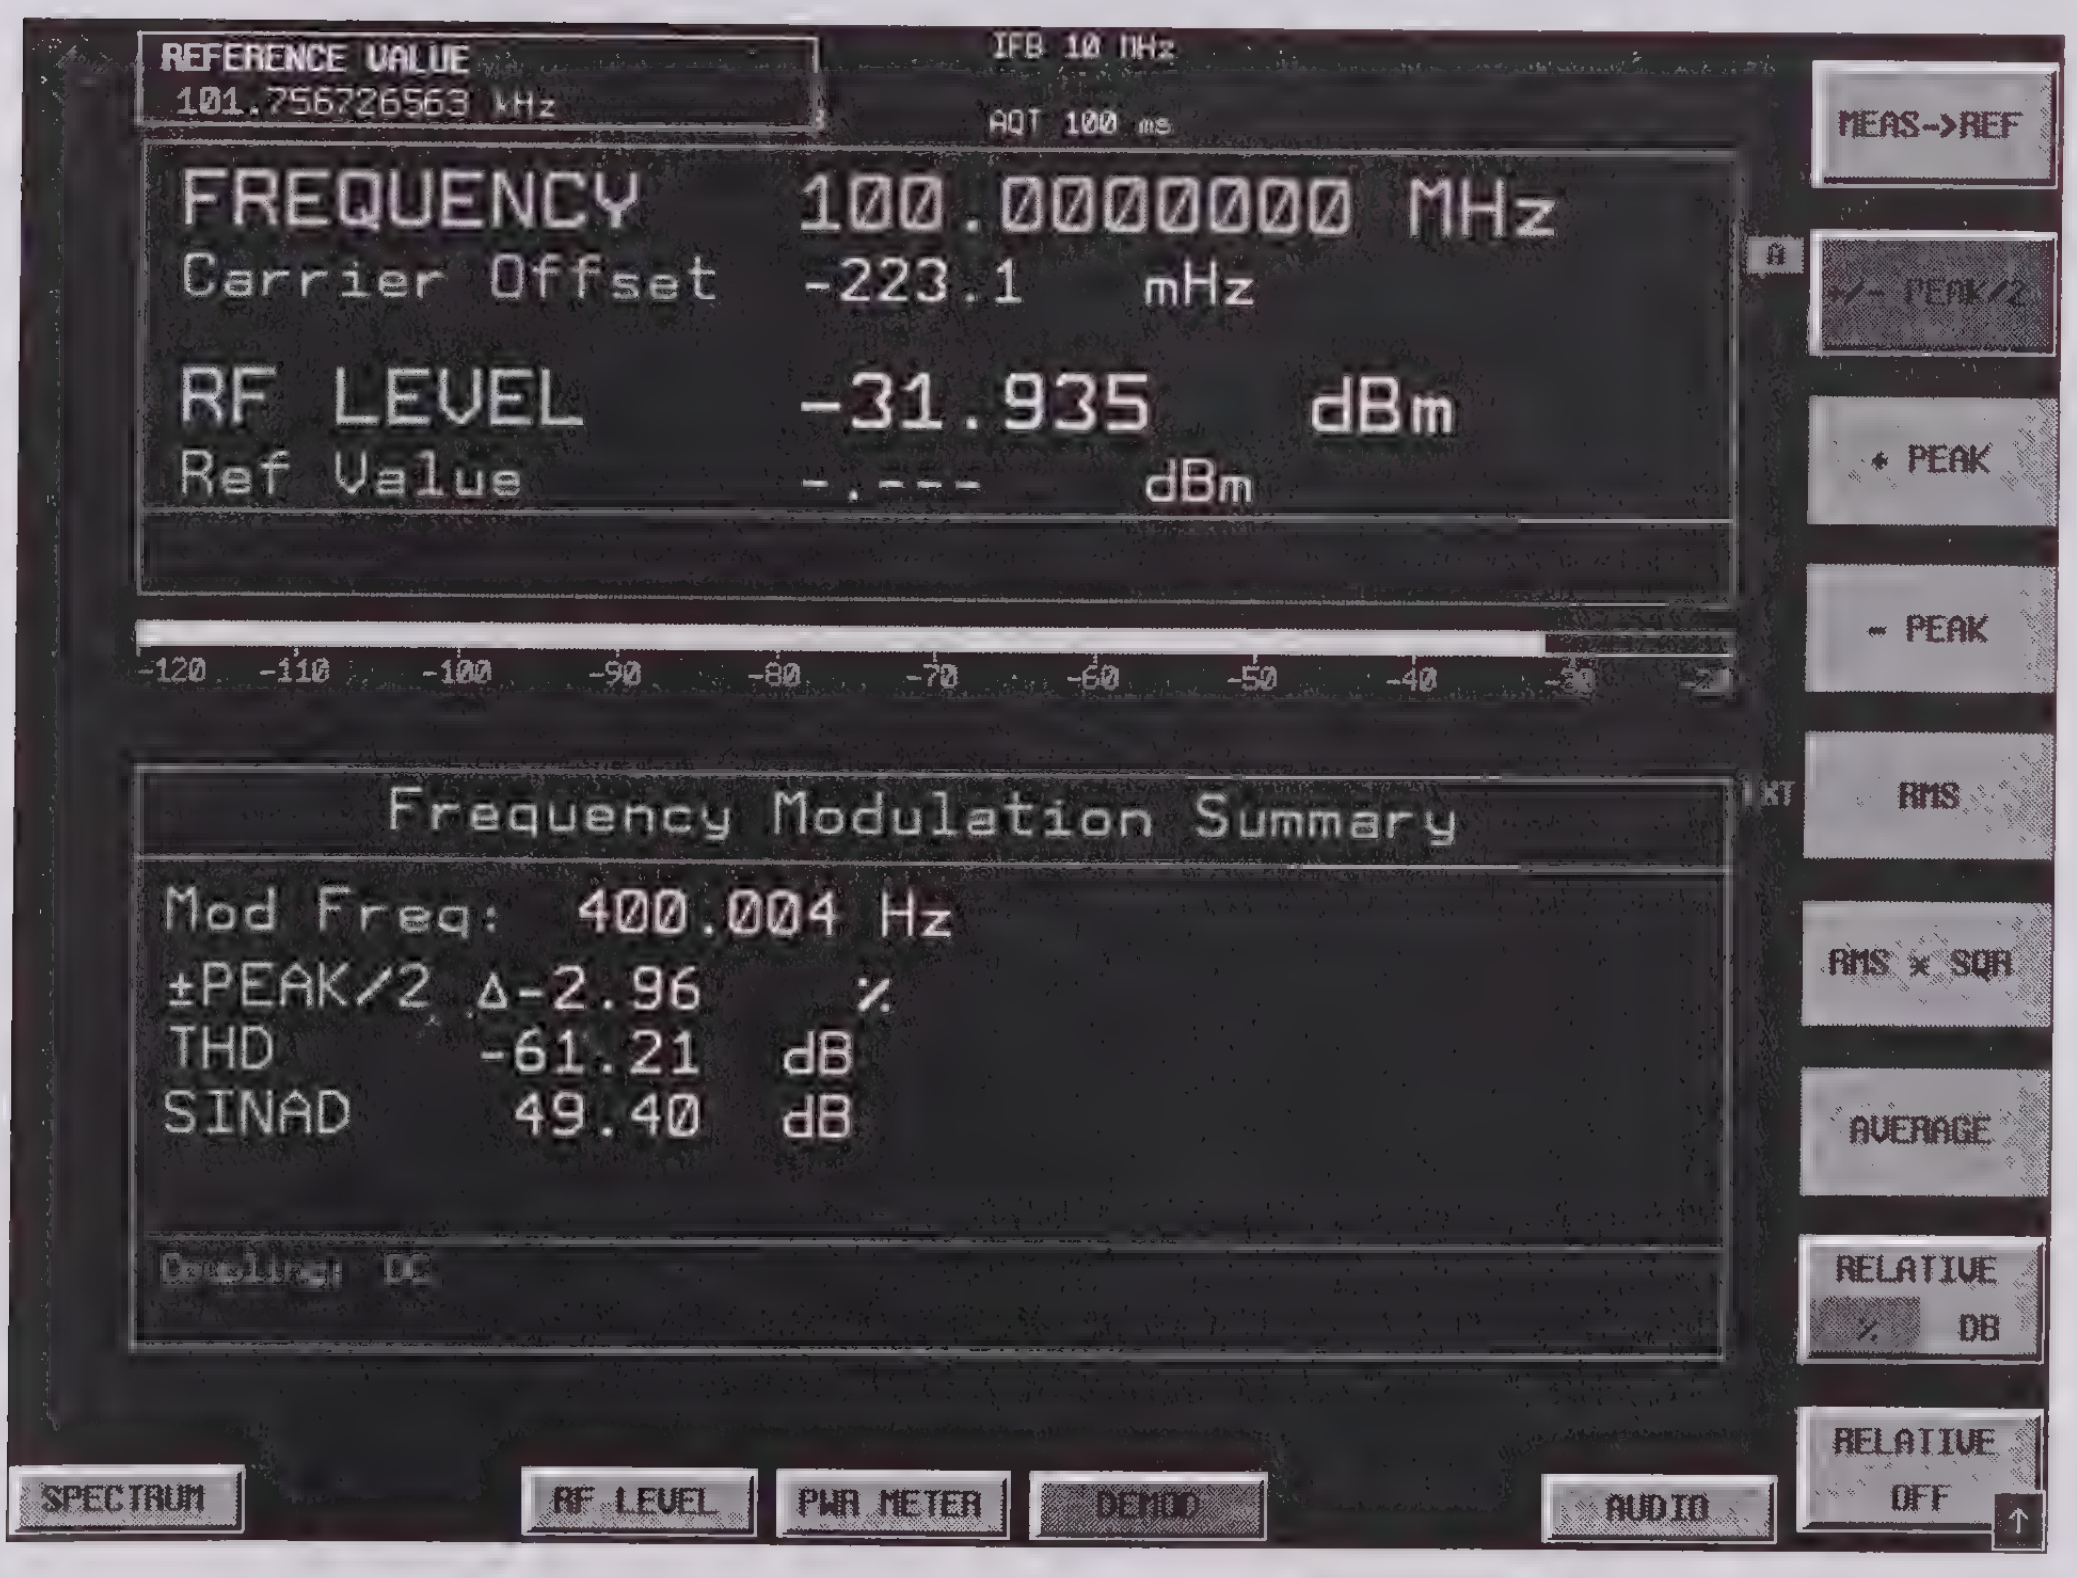

```
REFERENCE VALUE
101.756726563 kHz
                    IFB 10 MHz
                    AQT 100 ms
FREQUENCY       100.0000000 MHz
Carrier Offset  -223.1    mHz

RF LEVEL        -31.935   dBm
Ref Value       -.---     dBm

      Frequency Modulation Summary
Mod Freq:   400.004 Hz
±PEAK/2 Δ-2.96    %
THD      -61.21  dB
SINAD     49.40  dB

Coupling: DC
```

Fig. 4.4-16 Relative displays of the modulation measurement results

Measurements on the Audio Input – *AUDIO* Key

The R&S FSMR features an *AUDIO* baseband input for measurements in the audio frequency range. The AUDIO hotkey in the receiver mode switches the audio input to active and opens a menu for configuring and controlling the measurements.

IEC/IEEE bus command: `INP AUDIO`

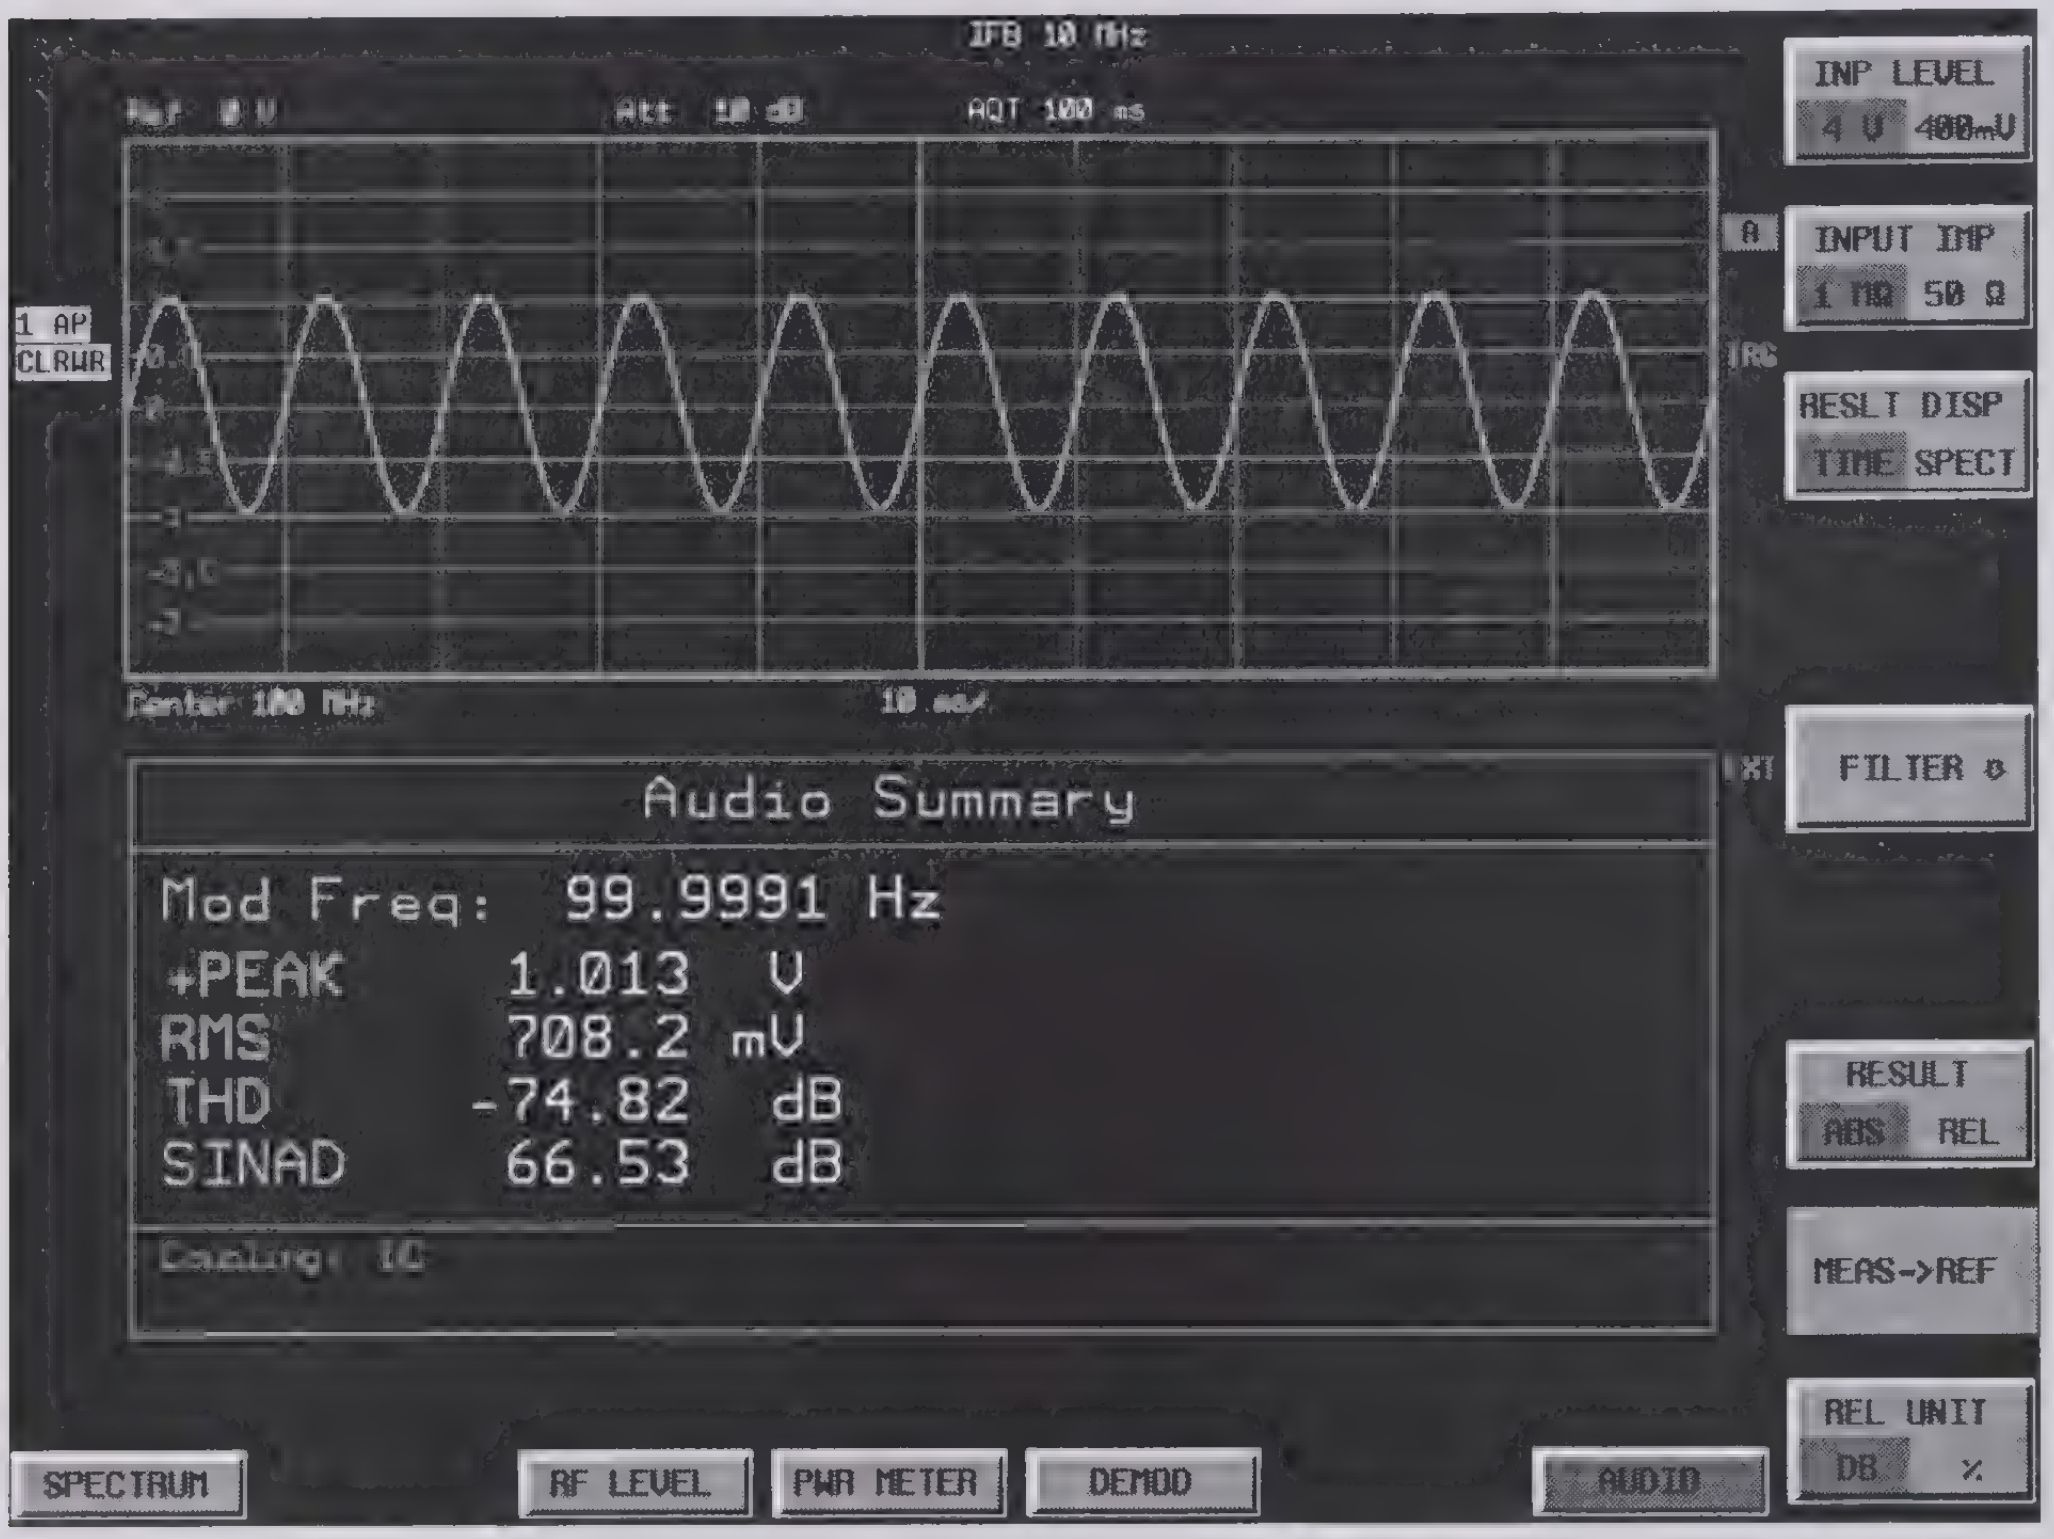

```
Audio Summary
Mod Freq:  99.9991 Hz
+PEAK      1.013  V
RMS        708.2 mV
THD       -74.82  dB
SINAD      66.53  dB
Coupling: DC
```

Fig. 4.4-17 Screen display of measurements on the audio input

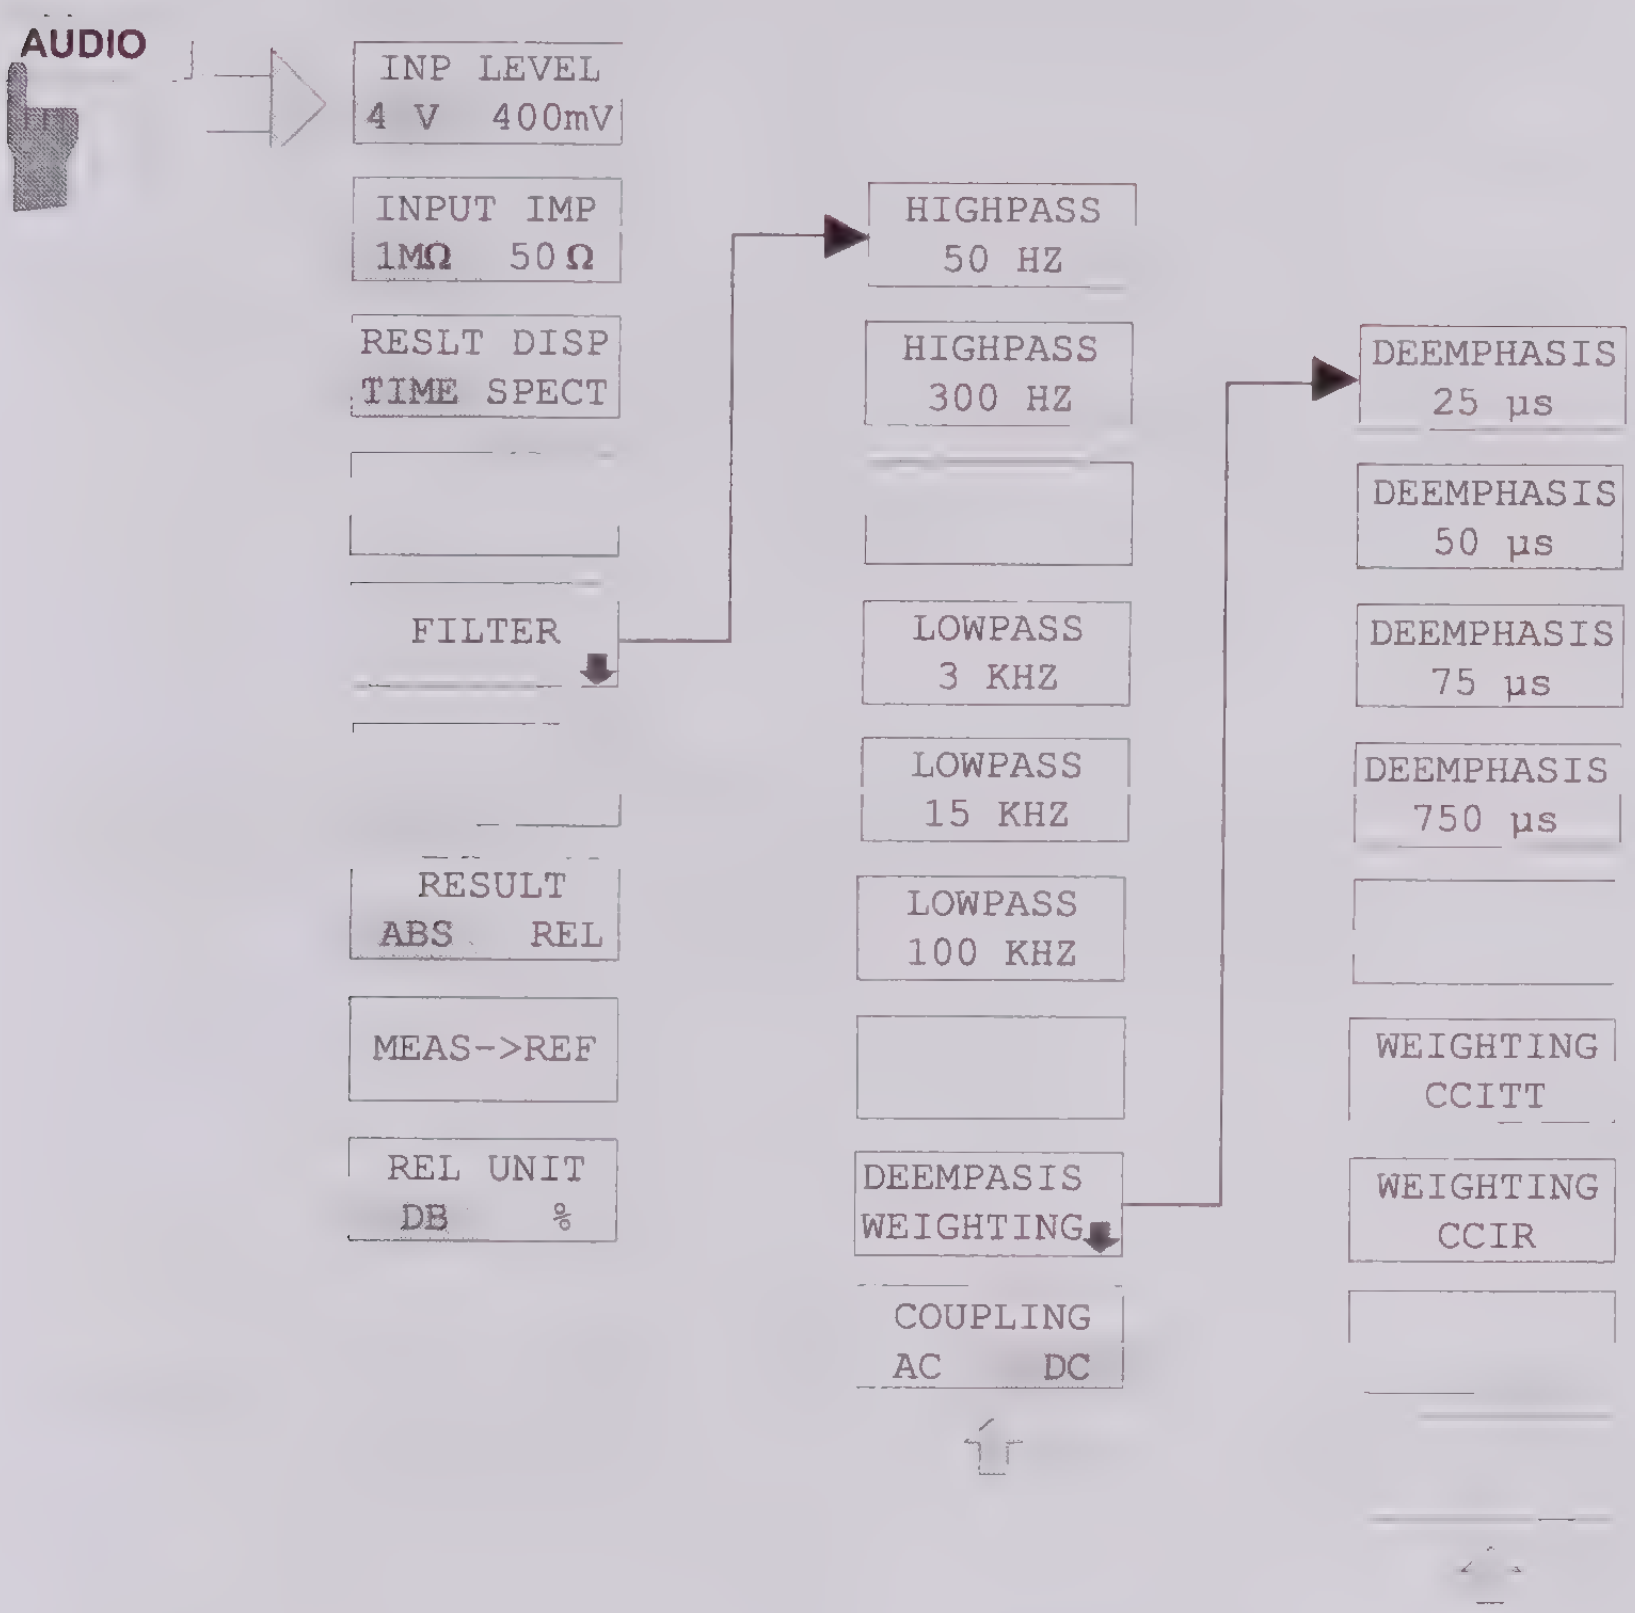

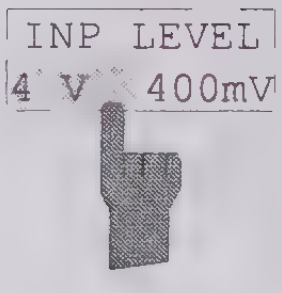

The *INP LEVEL 4V/400mV* softkey switches the input voltage range of the audio input between 4 V and 400 mV.

In the default setting, the 4 V range is switched on.

IEC/IEEE bus command: `VOLT:AC:RANG:UPP 4 V`

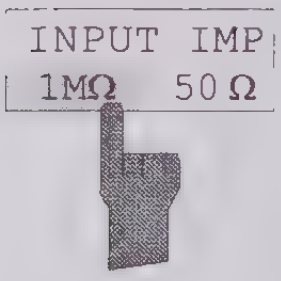

The *INPUT IMP 50Ω/1MΩ* softkey switches the input impedance of the audio input between 50 Ω and 1 MΩ.

In the default setting, an input impedance of 1 MΩ is switched on.

IEC/IEEE bus command: `INP:IMP 50 OHM`

The *RSLT DISP TIME/SPECT* softkey selects the graphical result display in the upper screen half.

In the default setting, the time domain display is switched on.

IEC/IEEE bus commands:
```
CALC:FEED 'XTIM:AC:TDOM'
CALC:FEED 'XTIM:AC:SPEC'
```

FILTER

The *FILTER* softkey opens a submenu for setting the AF filters.

HIGHPASS 50 HZ

HIGHPASS 300 HZ

The *HIGHPASS 50 HZ* and *HIGHPASS 300 HZ* softkeys insert a highpass filter of 50 Hz or 300 Hz into the audio signal path. In the default setting, no highpass filter is inserted.

IEC/IEEE bus commands:

```
FILT:HPAS ON
FILT:HPAS:FREQ 300 HZ
```

LOWPASS 3 KHZ

LOWPASS 15 KHZ

LOWPASS 100 KHZ

The *LOWPASS 3 KHZ, LOWPASS 15 KHZ* and *LOWPASS 100 KHZ* softkeys insert a lowpass filter of 3 kHz, 15 kHz or 100 kHz into the audio signal path.
In the default setting, no lowpass filter is inserted.

IEC/IEEE bus commands:

```
FILT:LPAS ON
FILT:LPAS:FREQ 100 KHZ
```

DEEMPHASIS WEIGHTING

The *DEEMPHASIS/WEIGHTING* softkey opens a submenu for setting the AF filters.

DEEMPHASIS 25 µs

DEEMPHASIS 50 µs

DEEMPHASIS 75 µs

DEEMPHASIS 750 µs

The *DEEMPHASIS 25 µs, DEEMPHASIS 50 µs, DEEMPHASIS 75 µs* and *DEEMPHASIS 750 µs* softkeys insert a user-selectable deemphasis of either 25 µs, 50 µs, 75 µs or 750 µs into the audio signal path.

In the default setting, no deemphasis is inserted.

IEC/IEEE bus commands:

```
FILT:DEMP ON
FILT:DEMP:TCON 25 us
```

WEIGHTING CCITT

The *WEIGHTING CCITT* softkey inserts a weighting filter in line with the CCITT P53 standard into the signal path.

This filter is deactivated in the default setting.

IEC/IEEE bus command: `FILT:CCIT ON`

WEIGHTING CCIR

The *WEIGHTING CCIR* softkey inserts a weighting filter in line with the CCIR 468-4 standard into the signal path.

This filter is deactivated in the default setting.

IEC/IEEE bus command: `FILT:CCIR ON`

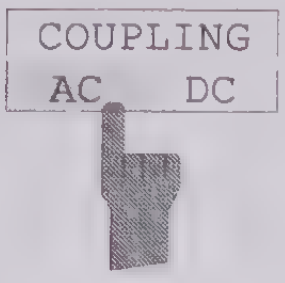

The *COUPLING AC/DC* softkey selects the DC coupling of the input signal.

The default setting is the AC coupling.

IEC/IEEE bus command: `ADEM:AF:COUP DC`

The *RESULT ABS/REL* softkey selects the display mode of the measurement results, either absolute or relative in relation to a reference value.

In the default setting, the absolute value display is switched on.

IEC/IEEE bus command: `VOLT:AC:REF ON`

The *MEAS->REF* softkey adopts the current level measurement value as the reference value for the display of a relative measured value.

IEC/IEEE bus command: `VOLT:AC:REF:AUTO ONCE`

The *REL UNIT DB/%* softkey selects the unit for the display of the relative measurement results.

In the default setting, the relative value display in dB is switched on.

IEC/IEEE bus command: `UNIT:POW:RAT DB`

Setting the Receiver Frequency and the Span – *FREQ* Key

Using the FREQ key, the receiver frequency is set in manual mode.

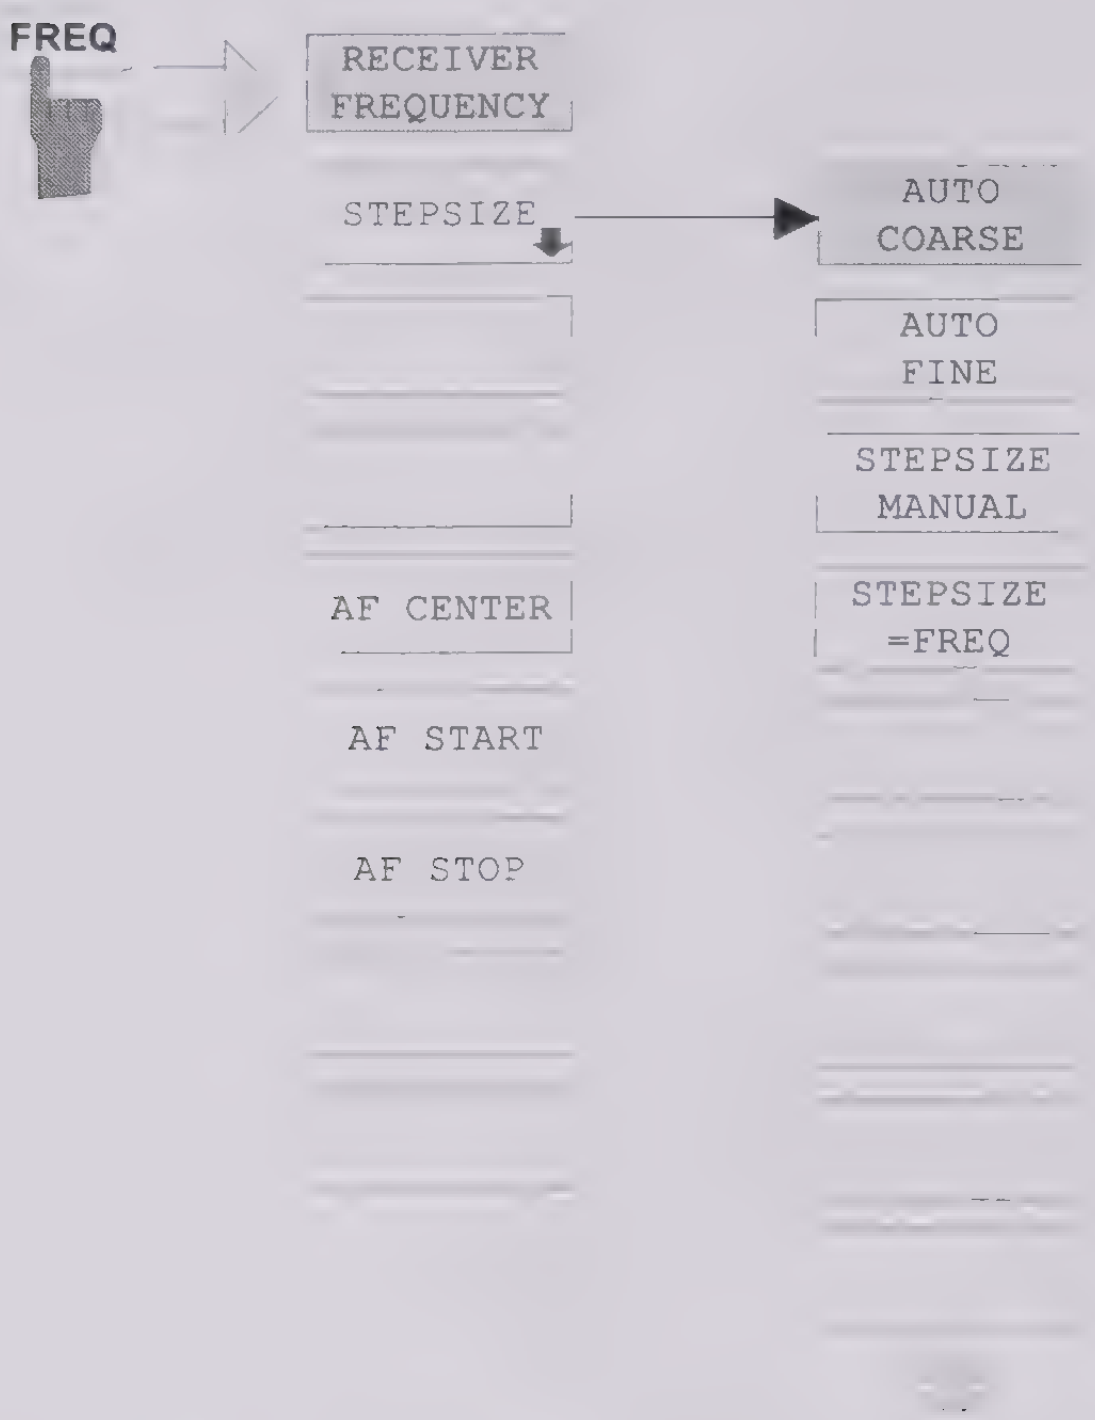

The *RECEIVER FREQUENCY* softkey activates the window for entering the receiver frequency .

The receiver frequency resolution is 0.1 Hz.
Setting range: 20 Hz ≤ f_{REC} ≤ f_{max}

IEC/IEEE bus command: `FREQ:CENT 300MHz`

The *STEPSIZE* softkey opens a submenu for setting the step size of the receive frequency. The step size can either be coupled to the set frequency or be manually set to a fixed value. The menu softkeys are selection switches, and only one of them at a time can be active.

The *AUTO COARSE* softkey sets the step size of the receive frequency to coarse. In this setting, the fourth position of the set frequency is varied.

IEC/IEEE bus command: --

AUTO FINE

The *AUTO FINE* softkey sets the step size of the receive frequency to fine. In this setting, the seventh position of the set frequency is varied.

IEC/IEEE bus command: --

STEPSIZE MANUAL

The *STEPSIZE MANUAL* softkey activates the window for entering a fixed value for the step size.

IEC/IEEE bus command: `FREQ:CENT:STEP 50 kHz`

STEPSIZE = FREQ

The *STEPSIZE = FREQ* softkey sets the step size to the receive frequency value. This function is particularly useful for measuring the harmonics of a signal. If the receiver is first tuned to the fundamental, the frequency of another harmonic is set with each frequency variation by using the rotary knob or the *STEP* keys.

IEC/IEEE bus command: --

AF CENTER

The *AF CENTER* softkey allows you to select the center frequency within the AF spectrum.

IEC/IEEE bus command: `ADEM:AF:CENT 1MHZ`

AF START

The *AF START* softkey allows you to select the start frequency within the AF spectrum.

IEC/IEEE bus command: `ADEM:AF:STAR 0HZ`

AF STOP

The *AF STOP* softkey allows you to select the stop frequency within the AF spectrum.
The maximum AF stop frequency is half the demodulation bandwidth.

IEC/IEEE bus command: `ADEM:AF:STOP 2MHZ`

Setting the Level Display and Configuring the RF Input – *AMPT* Key

Using the *AMPT* key, you can set the RF attenuation, the preamplifier, the autorange function and the display unit.

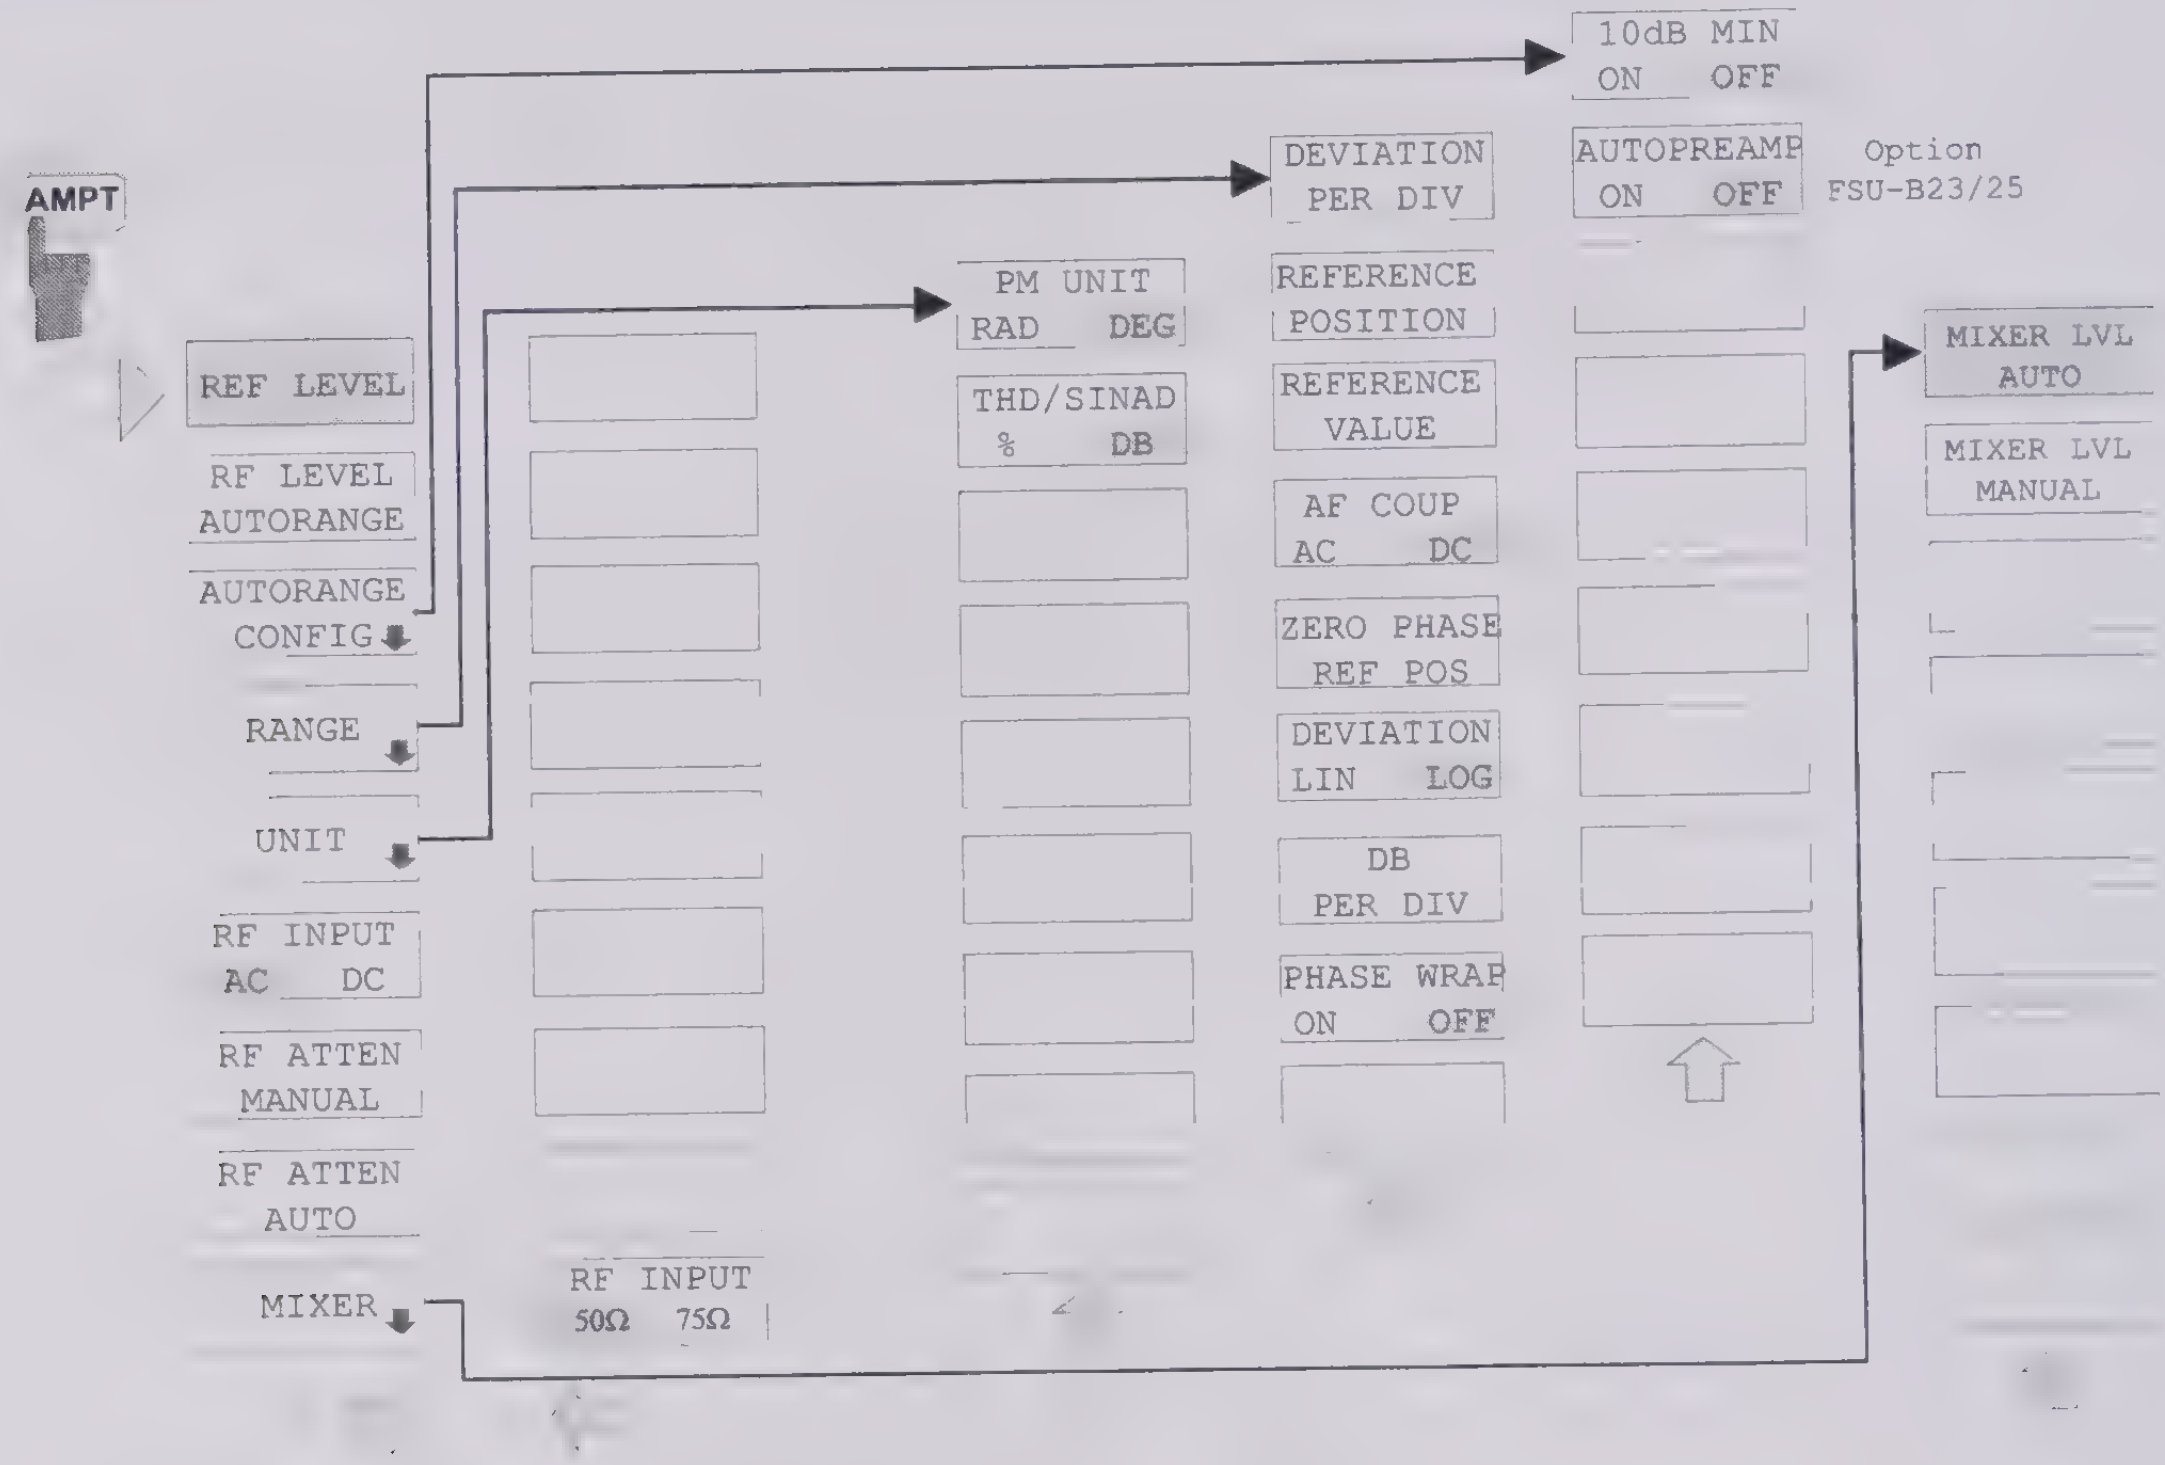

The *REF LEVEL* softkey activates the window for entering the reference level. The entry is made in the currently active unit (dBm, dBµV, etc).

IEC/IEEE bus command: `DISP:WIND:TRAC:Y:RLEV -60dBm`

The *RF LEVEL AUTORANGE* softkey activates the autorange function; attenuation, IF gain and, if necessary, preamplification, are automatically matched to the applied RF signal.

IEC/IEEE bus command: `INP:ATT:AUTO ON`

The *AUTORANGE CONFIG* softkey opens a submenu for configuring the automatic setting of attenuation and IF gain and, if necessary, preamplification.

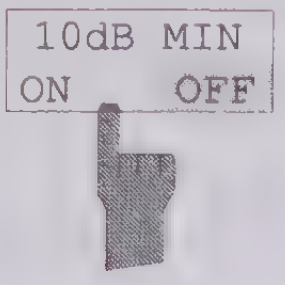

The 10 dB MIN ON/OFF softkey determines whether or not the 0 dB position of the attenuator is used when setting the insertion manually or automatically.
The default setting is 10 dB MIN ON.
Thus, an RF attenuation of at least 10 dB is always switched on in the R&S FSMR to ensure specific adjustment.
Even manually, the 0 dB position cannot be switched on.

IEC/IEEE bus command: `INP:ATT:PROT ON`

The *AUTO PREAMP ON/OFF* softkey activates the preamplifier for the autorange function.

ON	The autorange function takes the preamplifier into account. The preamplifier is activated only when the attenuation of the attenuator has been reduced to the minimum settable value.
OFF	The autoranging does not take into account the preamplifier.

The softkey is only available with the R&S FSU-B23/B25 *preamplifier* option.

IEC/IEEE bus command: `INP:GAIN:AUTO ON`

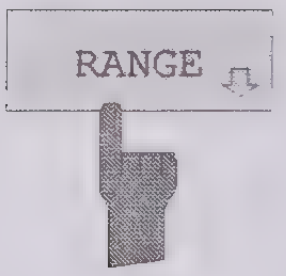

The *RANGE* softkey opens a submenu for configuring the y axis in the graphical display of the modulation measurement results.

The *DEVIATION PER DIV* softkey allows you to select the phase or frequency deviation that is to be displayed in the range from 1 Hz/div to 1 MHz/div with FM display or from 0.0001 rad/div to 1000 rad/div with PM display. In the AM display, the modulation depth is set in the range from 0.0001%/div to 1000%/div.
To ensure that the measurement results are not distorted, select an analyzer IF bandwidth that is larger than the maximum frequency deviation plus modulation frequency (*IF BANDWIDTH* softkey in the *BW* menu).
The softkey is not available in the AF spectrum display because scaling here is effected via the *DB PER DIV* and *REFERENCE VALUE* softkeys.

IEC/IEEE bus command: `DISP:WIND:TRAC:Y:PDIV 50kHz`

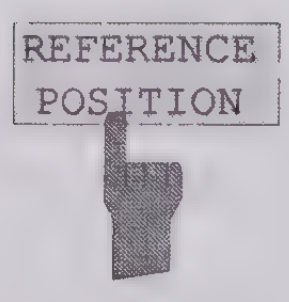

The *REFERENCE POSITION* softkey defines the position of the reference line for the phase or frequency deviation (FM/PM) or the modulation depth (AM) on the y axis of the diagram. In the analyzer's default setting, this line corresponds to a frequency deviation of 0 Hz (FM) or a phase deviation of 0 rad (PM) or a modulation depth of 0% (AM).
The entry is in percentage of the diagram height, where 100% corresponds to the top edge of the diagram. The default setting is 50% (diagram center) for displaying the FM, PM or AM signal, and 100% (top edge of diagram) for displaying the AF spectrum of the signal.

IEC/IEEE bus command: `DISP:WIND:TRAC:Y:RPOS 50PCT`

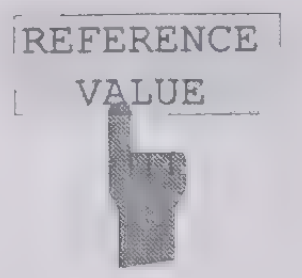

The *REFERENCE VALUE* softkey defines the frequency or phase deviation (FM/PM) or the modulation depth (AM) on the reference line of the y axis. The reference value is set separately both for each FM, PM and AM signal display and for the AF spectrum display of the FM, PM and AM signal.

FM signal display:

The reference value allows you to take into account individual frequency offsets in the trace display (while the *AF COUP AC/DC* softkey permits automatic correction by the average frequency offset of the signal).

The settable value range is 0 MHz to ±10 MHz. The softkey is not available if the *AF COUP AC* function is active.

AF spectrum display of the FM signal:

In the default setting, the reference value defines the FM deviation at the top edge of the diagram.

The settable value range is 0 MHz to 10 MHz.

PM signal display:

The reference value allows you to take into account individual phase offsets in the trace display (while the *AF COUP AC/DC* softkey permits automatic correction by the average phase offset of the signal).

The settable value range is 0 rad to ±10000 rad. The softkey is not available if the *AF COUP AC* function is active.

AF spectrum display of the PM signal:

In the default setting, the reference value defines the PM deviation at the top edge of the diagram.

The settable value range is 0 rad to 10000 rad.

AM signal display:

The settable value range is 0% to ±10000%.

AF spectrum display of the AM signal:

In the default setting, the reference value defines the modulation depth at the top edge of the diagram.

The settable value range is 0% to 10000%.

IEC/IEEE bus command: `DISP:WIND:TRAC:Y:RVAL 0HZ`

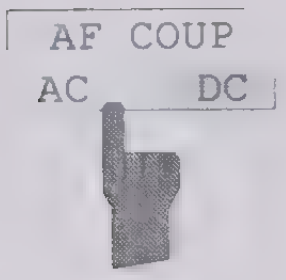

The *AF COUP AC/DC* softkey controls the automatic correction of the frequency offset and the phase offset of the input signal.

FM signal display:

If *DC* is selected, the absolute frequency offset is displayed, i.e. an input signal shifted with respect to the center frequency is displayed as not symmetrical to the zero line.

However, if *AC* is selected, the frequency offset is automatically corrected, i.e. the trace is always displayed as symmetrical to the zero line.

PM signal display:

If DC is selected, the phase drifts off, depending on the frequency offset that is present. Moreover, the DC signal has a phase offset of ±π.

However, if *AC* is selected, the frequency and phase offset is automatically corrected, i.e. the trace is always displayed as symmetrical to the zero line.

The softkey is not available if the FM or PM signal is displayed in the AF spectrum.

IEC/IEEE bus command `SENS:ADEM:AF:COUP DC`

The *ZERO PHASE REF POS* softkey defines the position where the PM-demodulated signal phase is set to 0 rad. Entry is on a time basis. In the default setting, the first measured value is set to 0 rad.
The softkey is only available in the PM display with DC coupling.

IEC/IEEE bus command: `SENS:ADEM:PM:RPO:X 10us`

The *DEVIATION LIN/LOG* softkey switches between logarithmic and linear frequency and phase deviation display (FM/PM) or modulation depth display (AM).
The softkey is only available if the FM, PM or AM signal is displayed in the AF spectrum.

IEC/IEEE bus command: `DISP:WIND:TRAC:Y:SPAC LOG`

The *DB PER DIV* softkey allows you to select either the FM or PM deviation to be displayed or the modulation depth in the range from 0.1 dB/div to 20 dB/div.
The softkey is not available with linear displays.

IEC/IEEE bus command: `DISP:WIND:TRAC:Y:PDIV 5DB`

The *PHASE WRAP ON/OFF* softkey activates and deactivates a phase wrap in the graphical display of the phase modulation.

ON The phase is displayed in the ±180° (±π) range. If the phase exceeds e.g. +180°, 360° are deducted from the phase value resulting in a display of >-180°.

OFF The phase is not wrapped.

The softkey is available in the displays of PM signals.

IEC/IEEE bus command: `CALC:FORM PHAS`

The *UNIT* softkey opens a submenu from which the desired unit for the y axis can be selected.

The *PM UNIT RAD/DEG* softkey allows you to select the unit for the PM signal display.

IEC/IEEE bus command: `UNIT:ANGL RAD`

The *THD/SINAD %/DB* softkey selects between % and dB for displaying the THD and SINAD measurement results.

IEC/IEEE bus command: `UNIT:THD PCT`

RF INPUT
AC DC

The *RF INPUT AC/DC* softkey switches the analyzer input between AC and DC coupling.

Note: The softkey is only available with models 3 and 26.

IEC/IEEE bus command: `INP:COUP AC`

RF ATTEN
MANUAL

The *RF ATTEN MANUAL* softkey activates the window for entering attenuation independently of the reference level.

The attenuation can be altered in 5 dB steps between 0 dB and 75 dB. Other entries are rounded down to the next lowest integral value.

If the specified reference level can no longer be set with the specified RF attenuation, the level is adjusted and the "Limit reached" message is displayed.

Note: The 0 dB value cannot be switched on unless the 10 dB MIN function is off. This protects the input mixer from overloading by mistake.

IEC/IEEE bus command: `INP:ATT 40 DB`

RF ATTEN
AUTO

The *RF ATTEN AUTO* softkey automatically sets the RF attenuation depending on the set reference level.
This ensures that the optimum RF attenuation is always used.

RF ATTEN AUTO is the default setting.

IEC/IEEE bus command: `INP:ATT:AUTO ON`

MIXER

The *MIXER* softkey opens a submenu for changing the mixer level on the input mixer.

MIXER LVL
AUTO

The *MIXER LVL AUTO* softkey activates the automatic coupling of the maximum mixer level to the reference level and the RF attenuation.

IEC/IEEE bus command: `INP:MIX:AUTO ON`

MIXER LVL
MANUAL

The *MIXER LVL MANUAL* softkey activates the window for entering the maximum mixer level that can be achieved with reference levels.

The setting range is 0 dB to -100 dBm with a step size of 10 dB.

IEC/IEEE bus command: `INP:MIX -25DBM`

RF INPUT
50Ω 75Ω

The *RF INPUT 50 Ω / 75 Ω* softkey switches the reference impedance for the measured level values between 50 Ω (= default setting) and 75 Ω.
Select the 75 Ω setting if the 50 Ω input impedance is transformed to the next higher impedance by using a 75 Ω matching pad of the RAZ type (= 25 Ω in series with the input impedance of the analyzer). The correction value used is 1.76 dB = 10 log (75 Ω/50 Ω).
All level specifications in this manual refer to the default setting (50 Ω) of the device.

IEC/IEEE bus command: `INP:IMP 50 OHM`

Setting the Bandwidths and the Measurement Time – *BW* Key

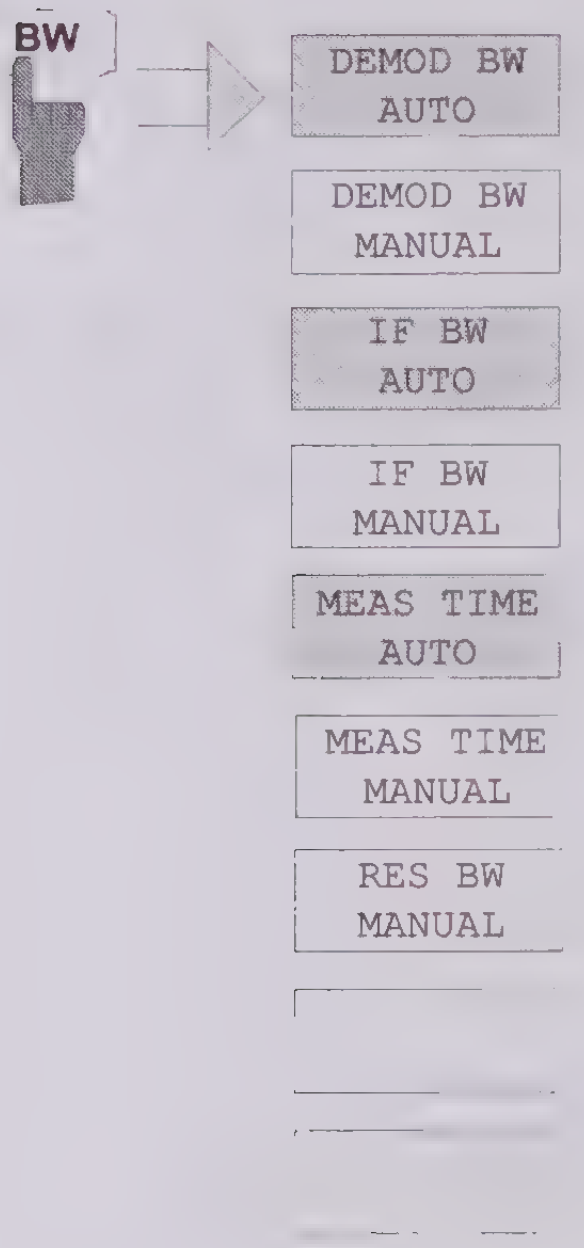

The *BW* key calls up a menu for setting the receiver mode bandwidths and measurement times.

Note: *In the default setting, demodulation bandwidth, IF bandwidth and measurement time are automatically selected depending on the selected operating mode. To obtain optimum measurement results, you should keep these settings.*

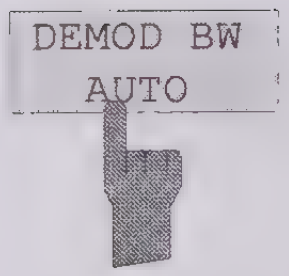

The *DEMOD BW AUTO* softkey activates the automatic setting of the demodulation bandwidth. Depending on the operating mode (Audio, AM, FM, PM, RF Level), the demodulation bandwidth is set in such a way that only the smallest possible measurement error occurs within the specified measurement range.

Mode	Demodulation bandwidth
RF Level	12.5 kHz
Demod	1.6 MHz

IEC/IEEE bus command: `BAND:DEM:AUTO ON`

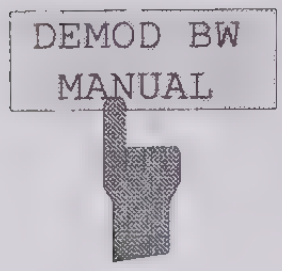

The *DEMOD BW MANUAL* softkey selects a bandwidth between 100 Hz and 10 MHz with which the signal to be measured is sampled.

IEC/IEEE bus command: `BAND:DEM 200 KHZ`

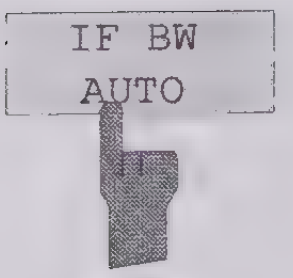

The *IF BW AUTO* softkey couples the IF bandwidth of the R&S FSMR (i.e. the bandwidth of the analog LC filters) to the selected receive frequency.

Receive frequency	IF bandwidth
≥10 MHz	10 MHz
<10 MHz	500 kHz

IEC/IEEE bus command: `BAND:RES:AUTO ON`

IF BW MANUAL

The *IF BW MANUAL* softkey activates the entry of the IF bandwidth of the R&S FSMR (i.e. the bandwidth of the analog filters). Bandwidths from 300 kHz to 10 MHz can be set.

Notes: *In most cases, you need not set the IF bandwidth manually. If the IF bandwidth is set more narrowly than specified by the AUTO coupling, the following occurs:*

a) *In the case of spectrum display, an RF frequency response occurs that equals that of the IF filter.*

b) *In the case of FM demodulation, an AF frequency response corresponding to a lowpass filter occurs that is equivalent to an IF filter.*

c) In the case of level measurement, an additional linearity error occurs.

IEC/IEEE bus command: `BAND:RES 10 MHZ`

MEAS TIME AUTO

The *MEAS TIME AUTO* softkey activates automatic coupling of the measurement time.

Mode	Demodulation bandwidth
RF Level	12.5 kHz
Demod	1.6 MHz

Note: *To obtain a correct result display, at least five periods of the demodulated signal should be monitored. If the modulation frequencies are low, it may be useful to manually prolong the measurement time (= signal monitoring time).*

IEC/IEEE bus command: `SWE:TIME:AUTO ON`

MEAS TIME MANUAL

The *MEAS TIME MANUAL* softkey opens the entry field for determining the data acquisition time. The permissible value range depends on the selected demodulation bandwidth:

Note: *To obtain a correct result display, at least five periods of the demodulated signal should be monitored.*

IEC/IEEE bus command: `SWE:TIME 200 MS`

RES BW MANUAL

If the spectrum display is active, the *RES BW MANUAL* softkey selects the resolution bandwidth for the displayed signal. Note that these resolution bandwidths are implemented as FFT filters.

Notes: *The softkey is only available if the RF SPECTRUM or AF SPECTRUM result displays are active.*
The IF BW MANUAL und IF BW AUTO softkeys help to limit the IF bandwidth via analog LC filters.

IEC/IEEE bus command: `ADEM:SPEC:BAND 100`

Setting the Sweep – *SWEEP/MEAS* Keys

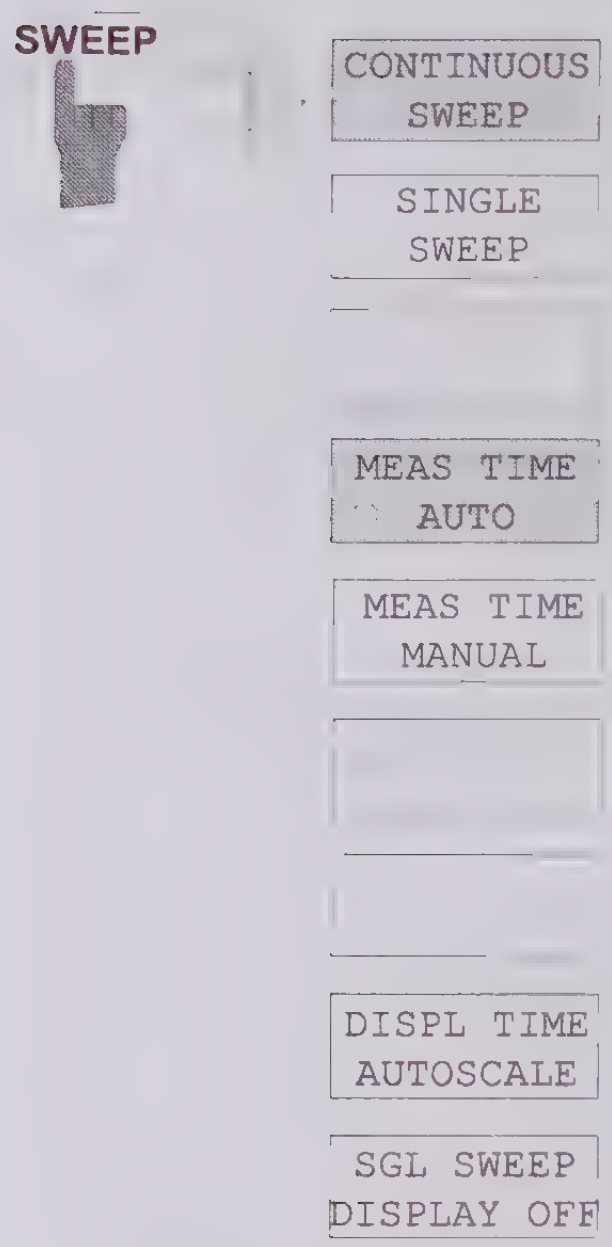

With spectrum displays, the *SPAN* menu allows you to select the frequency range to be displayed.

The *CONTINUOUS SWEEP* softkey sets the continuous sweep triggering, i.e. the sweep occurs continuously in accordance with the trigger setting.

In the case of split-screen display and different settings in both measurement windows, first screen A and then screen B is swept. After pressing the softkey, the sweep is always restarted.

CONTINUOUS SWEEP is the default setting of the R&S FSMR.

IEC/IEEE bus command: `INIT:CONT ON`

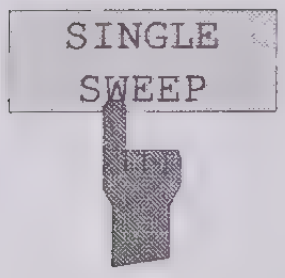

The *SINGLE SWEEP* softkey starts an n-times sweep after the trigger event has occurred. The *SWEEP COUNT* softkey defines the number of sweeps.

In the split-screen display, the frequency ranges of the two windows are subsequently swept.

If a trace is sampled with *TRACE AVERAGE* or *MAXHOLD*, the value set with the SWEEP COUNT softkey defines the number of measurements. If the value is 0, a sweep is performed.

IEC/IEEE bus command: `INIT:CONT OFF;:INIT`

MEAS TIME AUTO

The *MEAS TIME AUTO* softkey activates the automatic coupling of measurement time.

Mode	Measurement time
RF Level	100 ms
Audio	100 ms
Demod	100 ms

Note: *To obtain a correct result display, at least five periods of the demodulated signal should be monitored. If the modulation frequencies are low, it may be useful to manually prolong the measurement time (= signal monitoring time).*

IEC/IEEE bus command: `SWE:TIME:AUTO ON`

MEAS TIME MANUAL

The *MEAS TIME MANUAL* softkey opens the entry field for determining the data acquisition time. The permissible value range depends on the selected demodulation bandwidth:

Demodulation bandwidth	min. measurement time	max. measurement time
10 MHz	31.25 ns	12.5 ms
8 MHz	62.5 ns	25 ms
5 MHz	125 ns	50 ms
3 MHz	250 ns	100 ms
1.6 MHz	500 ns	200 ms
800 kHz	1 µs	400 ms
400 kHz	2 µs	800 ms
200 kHz	4 µs	1.6 s
100 kHz	8 µs	3.2 s
50 kHz	16 µs	6.4 s
25 kHz	32 µs	12.8 s
12.5 kHz	64 µs	25.6 s
6.4 kHz	128 µs	51.2 s
3.2 kHz	256 µs	102.4 s
1.6 kHz	512 µs	204.8 s
800 Hz	1024 ms	409.6 s
400 Hz	2048 ms	819.2 s
200 Hz	4096 ms	1638.4 s
100 Hz	8192 ms	3276.8 s

Note: *To obtain a correct result display, at least five periods of the demodulated signal should be monitored.*

IEC/IEEE bus command: `SWE:TIME 200 MS`

The *SWEEP COUNT* softkey activates the window for entering the number of sweeps that the R&S FSMR performs after a single sweep has been started. If Trace Average, Max Hold or Min Hold has been activated, the number of averages or maximum value findings is specified as well.

Example:
[**TRACE1**: *MAX HOLD*]
[**SWEEP**: *SWEEP COUNT*: {10} **ENTER**]
[*SINGLE SWEEP*]

The R&S FSMR performs the Max Hold function across ten sweeps.

The value range permissible for the sweep count is 0 to 32767. If the sweep count is 0 or 1, a sweep is performed. With trace averaging and if the sweep count is 0, the R&S FSMR performs sliding averaging across ten sweeps in continuous sweep mode; if the sweep count is 1, no averaging occurs.

The sweep count is valid for all traces in a diagram.

Note: *Setting the number of sweeps in the TRACE menu is identical with setting them in the SWEEP menu.*
In the SINGLE SWEEP setting, the measurement is stopped once the selected number of sweeps has been reached.

IEC/IEEE bus command: `SWE:COUN 64`

The *SGL SWEEP DISP OFF* softkey starts a sweep and switches off the display during a single sweep. Once the sweep is completed, the display is reactivated and the trace displayed.

IEC/IEEE bus command: `INIT:DISP OFF;:INIT`

Setting the Span – *SPAN* Key

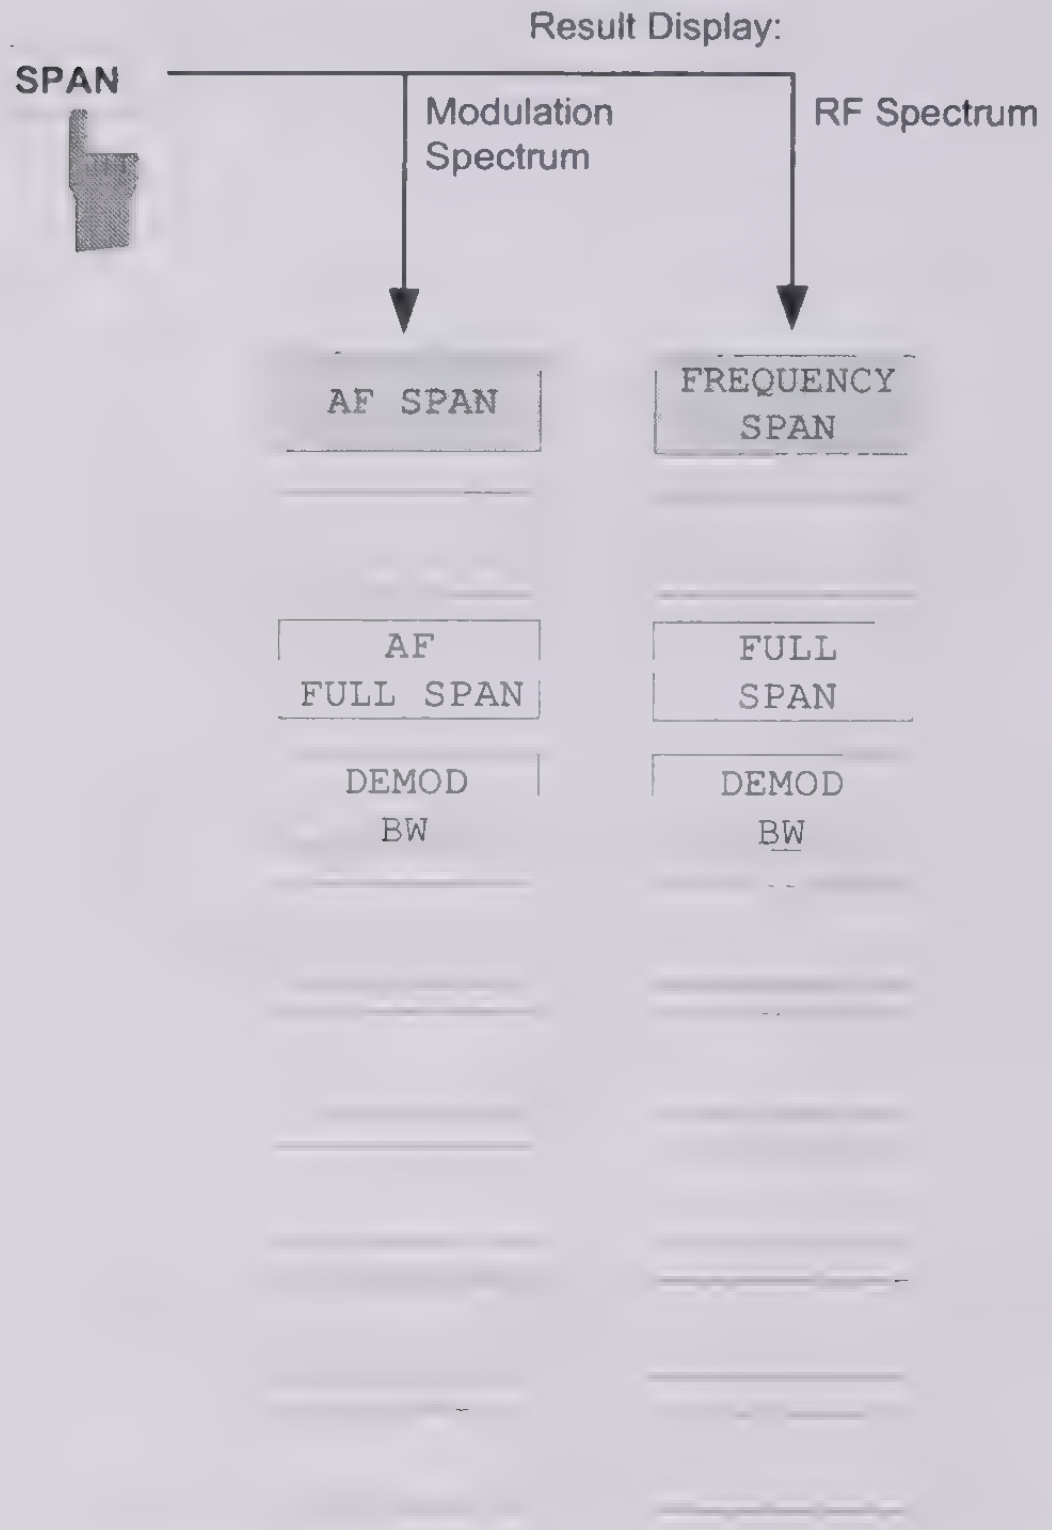

The *AF SPAN* softkey allows you to select the frequency range with AF spectrum displays.

IEC/IEEE bus command: `ADEM:AF:SPAN 2.5 MHz`

The *AF FULL SPAN* softkey sets the maximum frequency range with AF spectrum displays.
The maximum frequency range is half the demodulation bandwidth.

IEC/IEEE bus command: `ADEM:AF:SPAN:FULL`

The *DEMOD BW* softkey selects the demodulation bandwidth of the demodulator.

Note: *This function is identical with the DEMOD BW softkey function in the FM DEMOD main menu.*

IEC/IEEE bus command: `SENS:BAND:DEM 10MHz`

The *FREQUENCY SPAN* softkey allows you to select the frequency range with RF SPECTRUM displays.

IEC/IEEE bus command: `ADEM:SPEC:SPAN:ZOOM 5 MHz`

FULL SPAN

The *FULL SPAN* softkey sets the maximum frequency range with RF spectrum displays. The maximum frequency range corresponds to the demodulation bandwidth.

IEC/IEEE bus command: `ADEM:SPEC:SPAN:ZOOM MAX`

Spectrum Analyzer Mode

The analyzer mode is activated by pressing hotkey *SPECTRUM* (see also Section 'Mode Selection')



The *SPECTRUM* hotkey selects the *ANALYZER* mode.

The functions provided correspond to those of a conventional spectrum analyzer. The analyzer measures the frequency spectrum of the test signal over the selected frequency range with the selected resolution and sweep time, or, for a fixed frequency, displays the waveform of the video signal.

Frequency and Span Selection – *FREQ* Key

The *FREQ* key is used to specify the frequency axis of the active display window. The frequency axis can be defined either by the start and stop frequency or by the center frequency and the span (*SPAN* key). With two windows (*SPLIT SCREEN)* displayed at the same time, the input data always refer to the window selected in the *SYSTEM-DISPLAY* menu.
After pressing one of the *CENTER*, *START* or *STOP* softkeys, the value of the corresponding parameter can be defined in an input window.

FREQ menu:

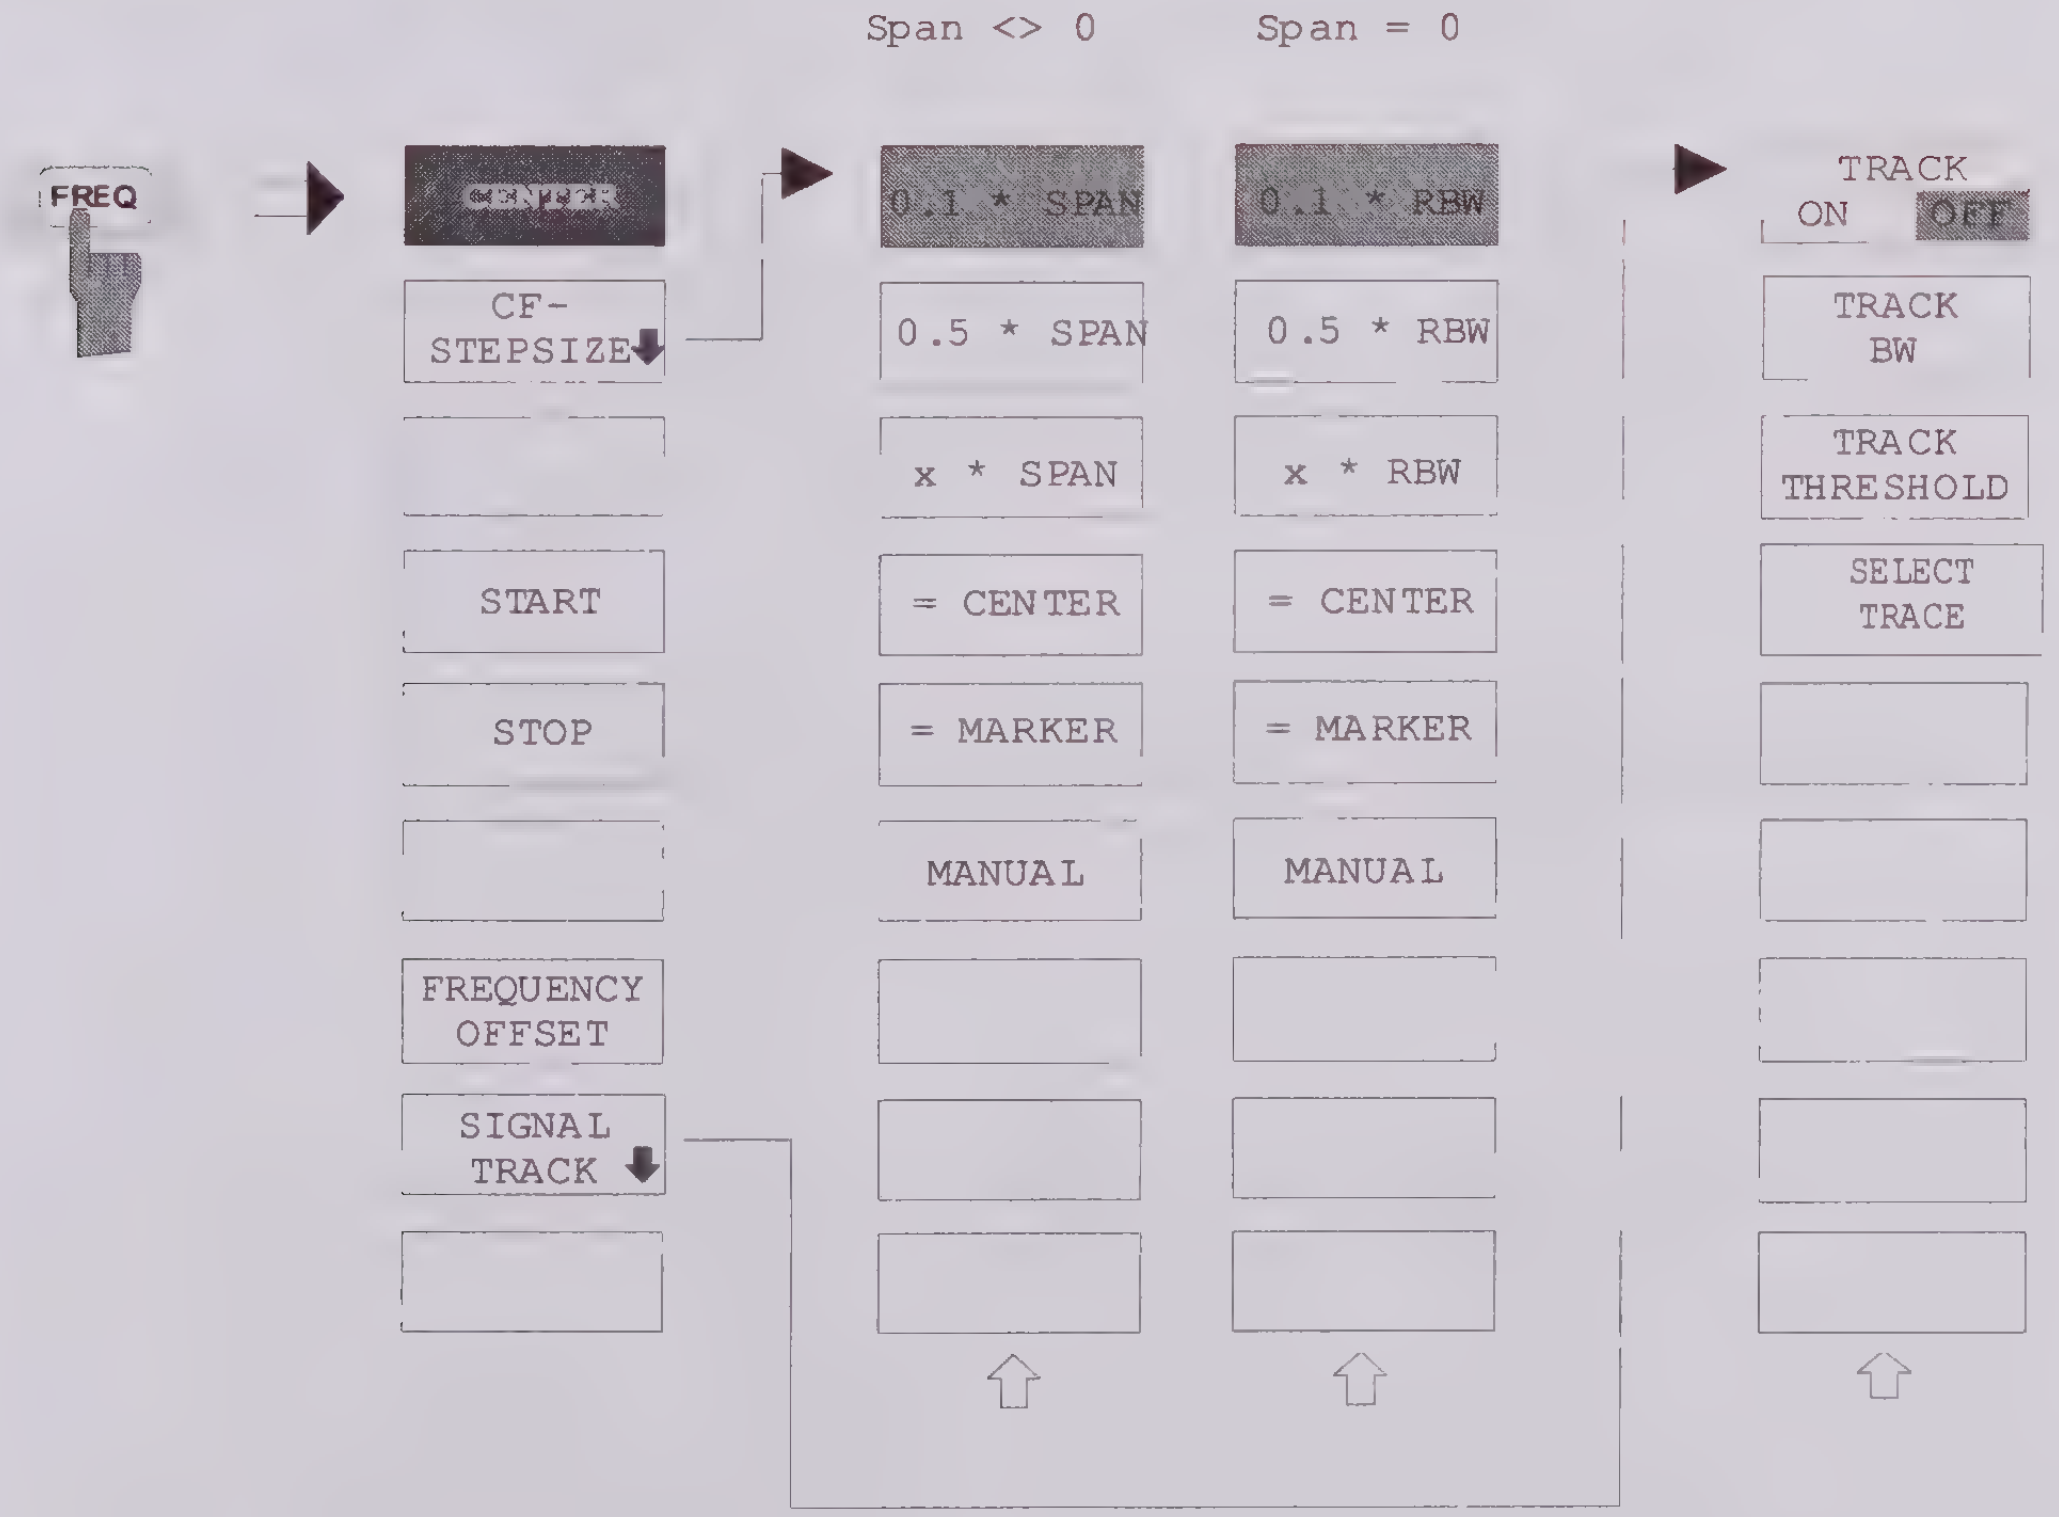

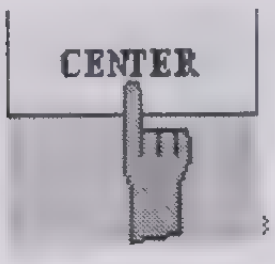

The *CENTER* softkey opens the window for manually entering the center frequency.

The allowed range of values for the center frequency is:

for the frequency domain (span >0):

$$\text{minspan} / 2 \leq f_{\text{center}} \leq f_{\text{max}} - \text{minspan} / 2$$

and for the time domain (span = 0):

$$0\ \text{Hz} \leq f_{\text{center}} \leq f_{\text{max}}$$

f_{center}	center frequency
minspan	smallest selectable span > 0 Hz (10 Hz)
f_{max}	max. frequency

IEC/IEEE-bus command: `FREQ:CENT 100MHz`

The CF *STEPSIZE* softkey opens a submenu for setting the step size of the center frequency. The step size can be coupled to the span (frequency domain) or the resolution bandwidth (time domain) or it can be manually set to a fixed value. The softkeys are mutually exclusive selection keys.

The softkeys are presented according to the selected domain (frequency or time).

Softkeys in frequency domain:

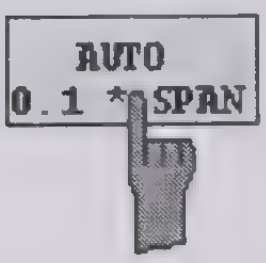

The *0.1 * SPAN* softkey sets the step size for the center frequency entry to 10% of the span.

IEC/IEEE-bus command:

```
FREQ:CENT:STEP:LINK SPAN
FREQ:CENT:STEP:LINK:FACT 10PCT
```

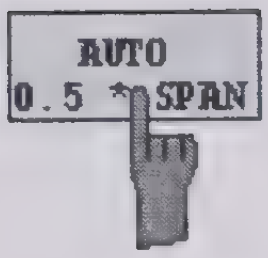

The *0.5 * SPAN* softkey sets the step size for the center frequency entry to 50% of the span.

IEC/IEEE-bus command:

```
FREQ:CENT:STEP:LINK SPAN
FREQ:CENT:STEP:LINK:FACT 50PCT
```

The *X * SPAN* softkey allows the factor defining the center frequency step size to be entered as % of the span.

IEC/IEEE-bus command:

```
FREQ:CENT:STEP:LINK SPAN
FREQ:CENT:STEP:LINK:FACT 20PCT
```

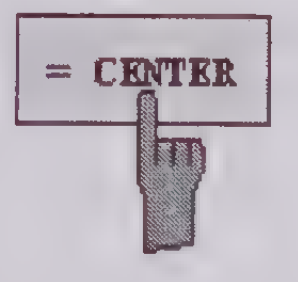

The = *CENTER* softkey sets the step size coupling to *MANUAL* and the step size to the value of the center frequency. This function is especially useful during measurements of the signal harmonic content because by entering the center frequency each stroke of the *STEP* key selects the center frequency of another harmonic.

IEC/IEEE-bus command: --

The = *MARKER* softkey sets the step size coupling to *MANUAL* and the step size to the value of the marker. This function is especially useful during measurements of the signal harmonic content at the marker position because by entering the center frequency each stroke of the *STEP* key selects the center frequency of another harmonic.

IEC/IEEE-bus command: --

The *MANUAL* softkey activates the window for entering a fixed step size.

IEC/IEEE-bus command:

```
FREQ:CENT:STEP 120MHz
```

Softkeys in time domain:

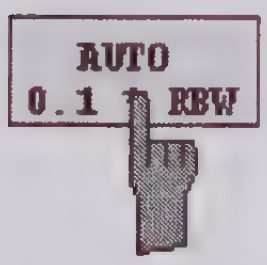

The *0.1 * RBW* softkey sets the step size for the center frequency entry to 10% of the resolution bandwidth.

*AUTO 0.1 * RBW* corresponds to the default setting.

IEC/IEEE-bus command:

```
FREQ:CENT:STEP:LINK RBW
FREQ:CENT:STEP:LINK:FACT 10PCT
```

The *0.5 * RBW* softkey sets the step size for the center frequency entry to 50% of the resolution bandwidth.

IEC/IEEE-bus command:

```
FREQ:CENT:STEP:LINK RBW
FREQ:CENT:STEP:LINK:FACT 50PCT
```

The *X * RBW* softkey allows the factor defining the center frequency step size to be entered as % of the resolution bandwidth.

Values between 1 and 100% in steps of 1% are allowed. The default setting is 10%.

IEC/IEEE-bus command:

```
FREQ:CENT:STEP:LINK RBW
FREQ:CENT:STEP:LINK:FACT 20PCT
```

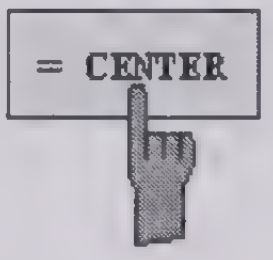

The = *CENTER* softkey sets the step size coupling to *MANUAL* and the step size to the value of the center frequency. This function is especially useful during measurements of the signal harmonic content because by entering the center frequency each stroke of the *STEP* key selects the center frequency of another harmonic.

IEC/IEEE-bus command: --

The = *MARKER* softkey sets the step size coupling to *MANUAL* and the step size to the value of the marker. This function is especially useful during measurements of the signal harmonic content at the marker position because by entering the center frequency each stroke of the *STEP* key selects the center frequency of another harmonic.

IEC/IEEE-bus command: --

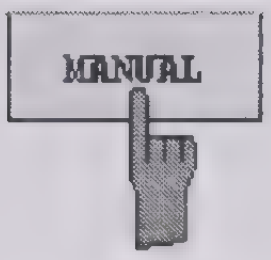

The *MANUAL* softkey activates the window for entering a fixed step size.

IEC/IEEE-bus command: `FREQ:CENT:STEP 120MHz`

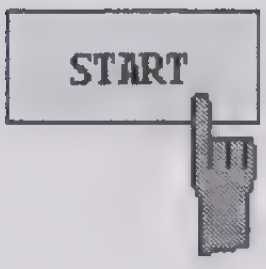

The *START* softkey activates the window for manually entering the start frequency.

The allowed range of values for the start frequency is:

$0\ \text{Hz} \leq f_{start} \leq f_{max} - \text{minspan}$

f_{start}	start frequency
minspan	smallest selectable span (10 Hz)
f_{max}	max. frequency

IEC/IEEE-bus command: `FREQ:STAR 20MHz`

The *STOP* softkey activates the window for entering the stop frequency.

The allowed range of values for the stop frequency is:

$\text{minspan} \leq f_{stop} \leq f_{max}$

f_{stop}	stop frequency
minspan	smallest selectable span (10 Hz)
f_{max}	max. frequency

IEC/IEEE-bus command: `FREQ:STOP 2000MHz`

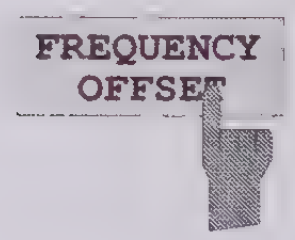

The *FREQUENCY OFFSET* softkey activates the window for entering an arithmetical frequency offset which is added to the frequency axis labelling. The allowed range of values for the offset is -100 GHz to 100 GHz. The default setting is 0 Hz.

IEC/IEEE-bus command: `FREQ:OFFS 10 MHz`

The *SIGNAL TRACK* softkey switches on the tracking of a signal near the center frequency. The signal is tracked as long it is in the search bandwidth around the center frequency defined with *TRACK BW* and above the level threshold defined with *TRACK THRESHOLD*.
For that purpose, the maximum signal is searched (*PEAK SEARCH)* on the screen and the center frequency set to this signal (*MARKER ->CENTER)* after each frequency sweep within the search bandwidth.

If the signal falls below the level threshold or jumps out of the search bandwidth around the center frequency, the center frequency is not varied until a signal is in the search bandwidth above the level threshold. This can be achieved by manually modifying the center frequency, for example.

On switching on, the softkey is highlighted and the search bandwidth and the threshold value are marked on the diagram by two vertical lines and one horizontal line. All these lines are allocated the designation TRK.

At the same time a submenu is opened in which the search bandwidth, the threshold value and the trace can be modified for the maximum search.

The softkey is only available in the frequency domain (span >0).

IEC/IEEE-bus command: `CALC:MARK:FUNC:STR OFF`

The *TRACK ON/OFF* softkey switches on and off signal tracking.

IEC/IEEE-bus command: `CALC:MARK:FUNC:STR OFF`

The *TRACK BW* softkey defines the search bandwidth for signal tracking. The frequency range is symmetrical with respect to the center frequency.

IEC/IEEE-bus command:
`CALC:MARK:FUNC:STR:BAND 10KHZ`

The *TRACK THRESHOLD* softkey defines the threshold value for signal detection. The value is always entered as an absolute level value.

IEC/IEEE-bus command:
`CALC:MARK:FUNC:STR:THR -70DBM`

The *SELECT TRACE* softkey selects the trace on which signal tracking is to be performed.

IEC/IEEE-bus command:
`CALC:MARK:FUNC:STR:TRAC 1`

Setting the Frequency Span – *SPAN* Key

SPAN menu

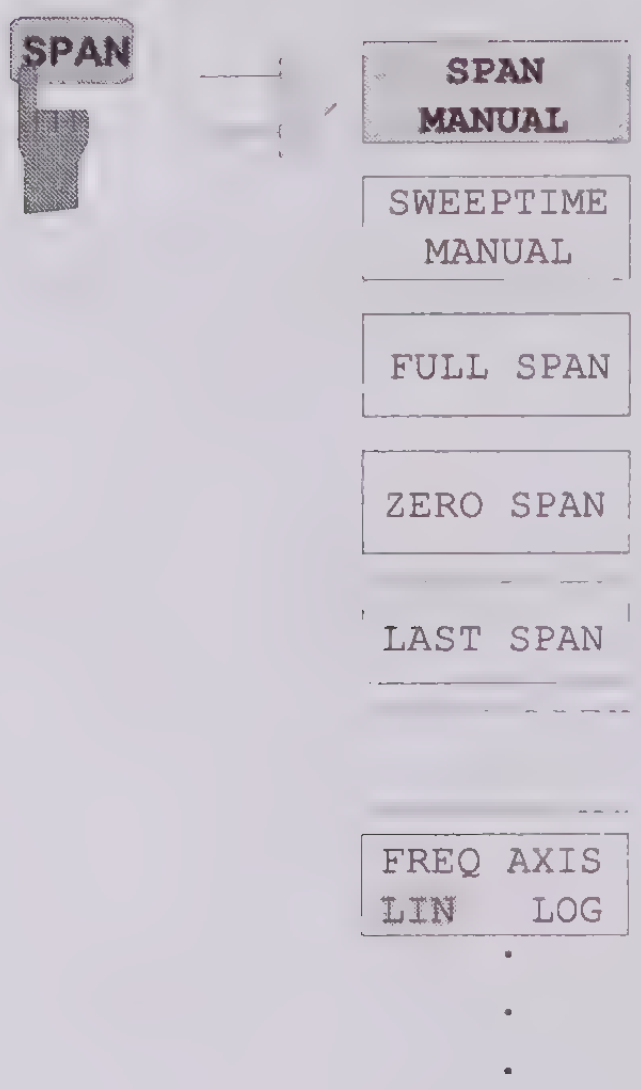

The *SPAN* key opens a menu which offers various options for setting the span.
The entry of the span (*SPAN MANUAL* softkey) is automatically active for span > 0 Hz.
For span = 0 Hz the entry for sweep time (*SWEEPTIME MANUAL*) is automatically active.
With two windows (*SPLIT SCREEN)* displayed at the same time, the input data always refer to the window selected with hotkey *SCREEN A/B*.

SPAN MANUAL

The *SPAN MANUAL* softkey activates the window for manually entering the frequency span. The center frequency is kept constant.

The allowed range of span values is for the time domain (span = 0): 0 Hz
and for the frequency domain (span >0): minspan $\leq f_{span} \leq f_{max}$

f_{span}	frequency span
minspan	smallest selectable span (10 Hz)
f_{max}	max. frequency

IEC/IEEE-bus command `FREQ:SPAN 2GHz`

SWEEPTIME MANUAL

The *SWEEPTIME MANUAL* softkey activates the window for entering the sweep time manually with Span = 0 Hz. The softkey is not available for Span > 0 Hz.

IEC/IEEE-bus command: `SWE:TIME 10s`

FULL SPAN

The *FULL SPAN* softkey sets the span to the full frequency range of R&S FSMR.

IEC/IEEE-bus command `FREQ:SPAN:FULL`

ZERO SPAN

The *ZERO SPAN* softkey sets the span to 0 Hz. The x axis becomes the time axis with the grid lines corresponding to 1/10 of the current sweep time (SWT).

IEC/IEEE-bus command `FREQ:SPAN 0Hz`

LAST SPAN

After changing the span setting the *LAST SPAN* softkey activates the previous setting. With this function a fast change between overview measurement (*FULL SPAN*) and detailed measurement (manually set center frequency and span) is possible.

Note: *Only values > 0 Hz are restored, i.e. a transition between time and frequency domain is not possible.*

IEC/IEEE-bus command `---`

FREQ AXIS LIN LOG

The *FREQ AXIS LIN/LOG* softkey switches between linear and logarithmic scaling of the frequency axis Switchover is only possible if the stop/start frequency ratio is ≥10.

IEC/IEEE-bus command `SWE:SPAC LIN`

Level Display Setting and RF Input Configuration – AMPT Key

The *AMPT* key is used to set the reference level, the maximum level and the display range of the active window as well as the input impedance and the input attenuation of the RF input.

The *AMPT* key opens a menu for setting the reference level and the input attenuation of the active window. The data entry for the reference level (*REF LEVEL* softkey) is opened automatically.

Further settings regarding level display and attenuation can be made in this menu.

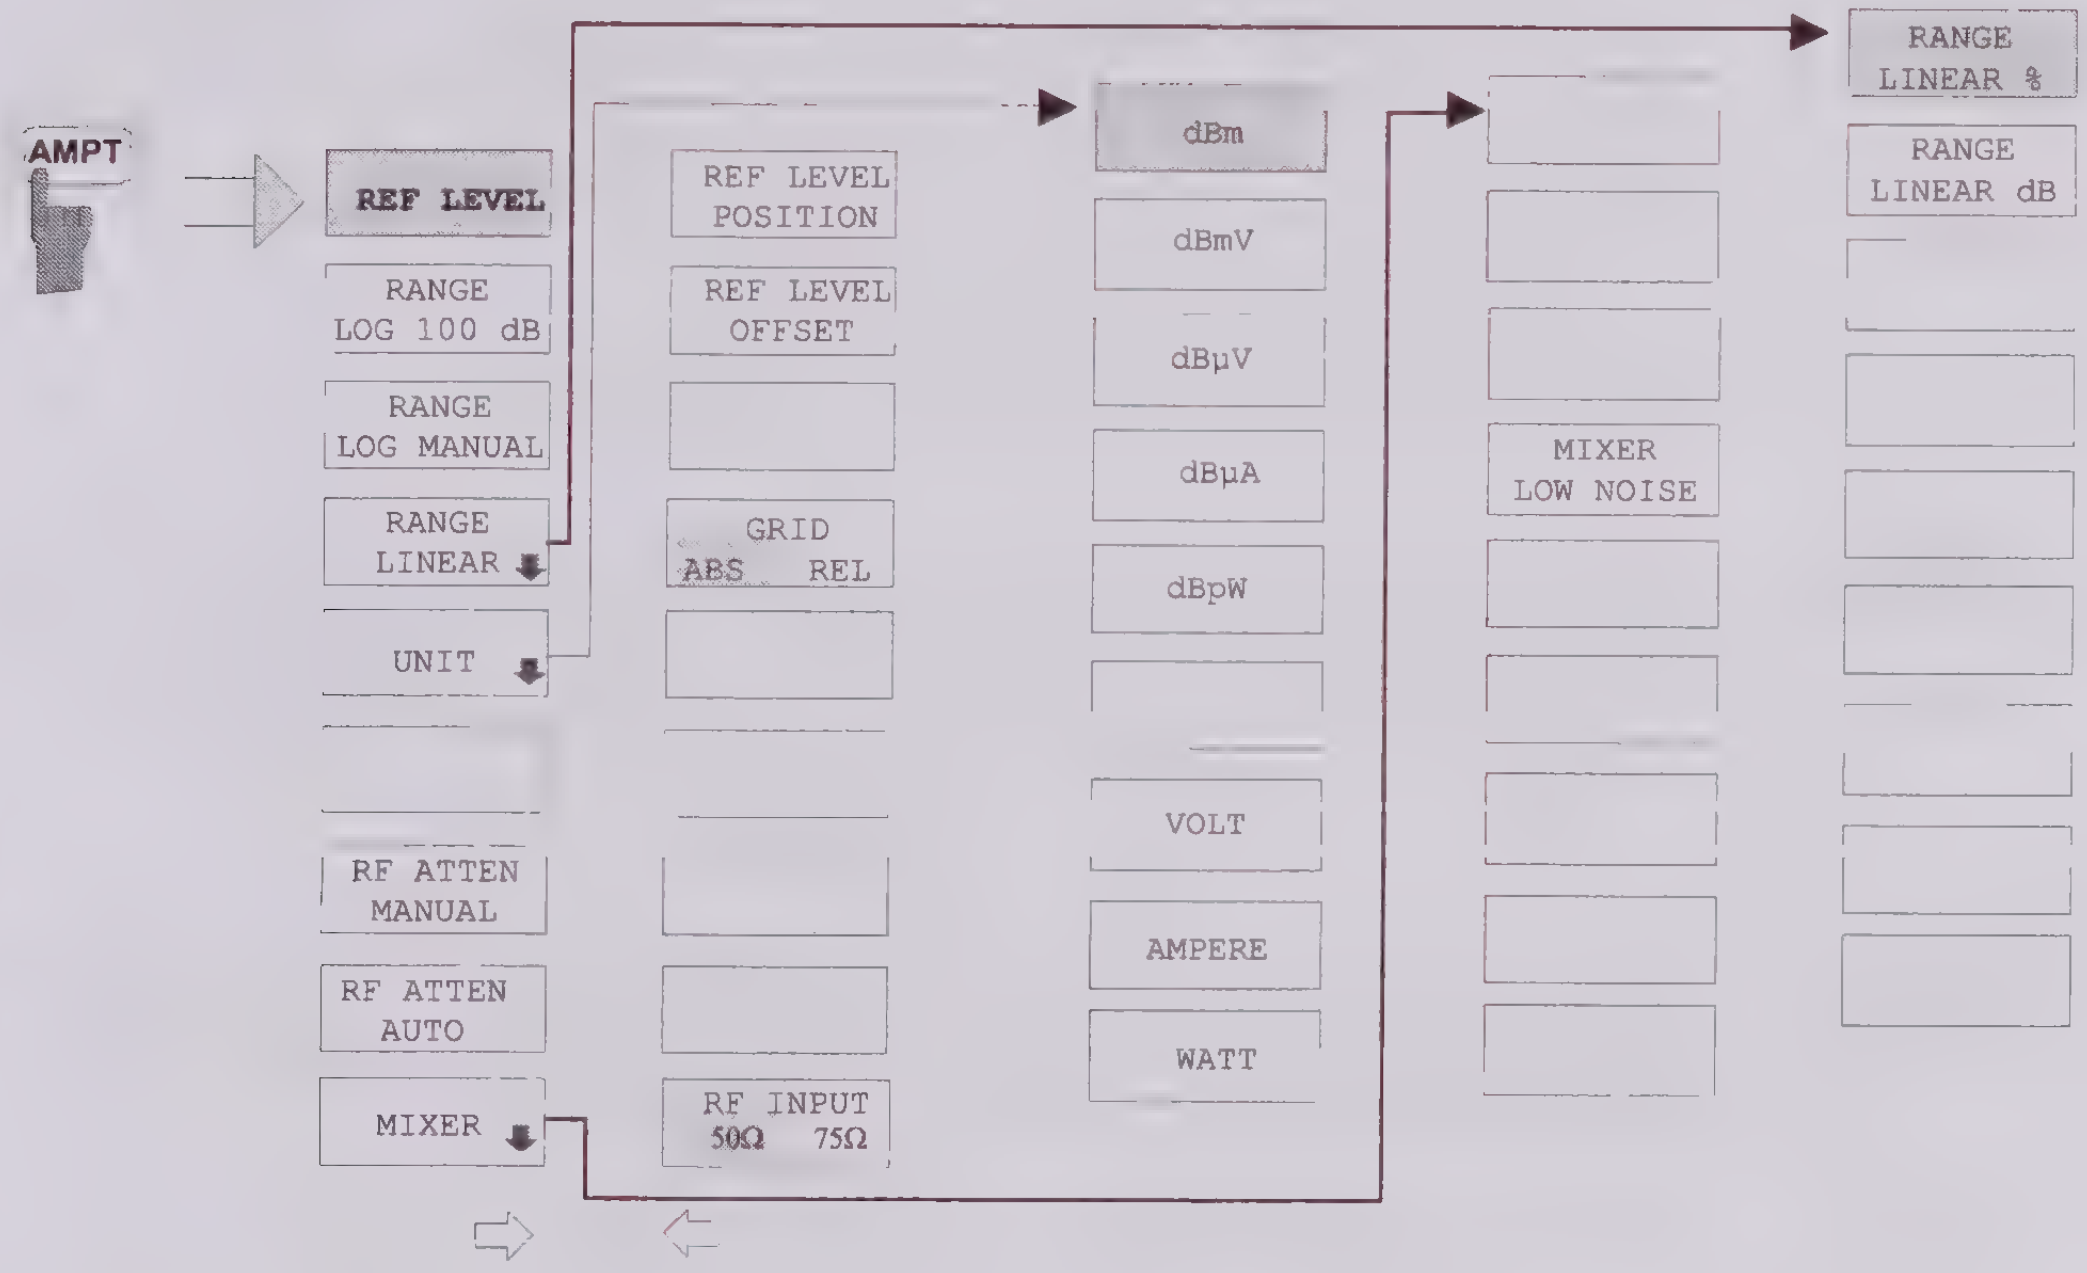

The *REF LEVEL* softkey allows the reference level to be input in the currently active unit (dBm, dBµV, etc).

IEC/IEEE-bus command: `DISP:WIND:TRAC:Y:RLEV -60dBm`

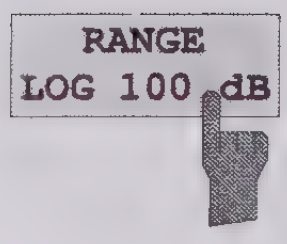

The *RANGE LOG 100 dB* softkey sets the level display range to 100 dB.

IEC/IEEE-bus command:

```
DISP:WIND:TRAC:Y:SPAC LOG
DISP:WIND:TRAC:Y 100DB
```

RANGE LOG MANUAL

The *RANGE LOG MANUAL* softkey activates the manual entry of the level display range. Display ranges from 10 to 200 dB are allowed in 10 dB steps. Inputs which are not allowed are rounded to the next valid value.

The default setting is 100 dB.

IEC/IEEE-bus command:
```
DISP:WIND:TRAC:Y:SPAC LOG
DISP:WIND:TRAC:Y 120DB
```

RANGE LINEAR

The *RANGE LINEAR* softkey selects linear scaling for the level display range of the analyzer. In addition, it opens a submenu for selecting % or dB for the scaling.
When linear scaling is selected, the % scaling is first activated (see also *RANGE LINEAR dB* softkey).

IEC/IEEE-bus command:
```
DISP:WIND:TRAC:Y:SPAC LIN
```

RANGE LINEAR %

The *RANGE LINEAR %* softkey selects linear scaling in % for the level display range, i.e. the horizontal lines are labelled in %. The grid is divided in decadic steps. Markers are displayed in the selected unit; delta markers are displayed in % referenced to the voltage value at the position of marker 1.

IEC/IEEE-bus command:
```
DISP:WIND:TRAC:Y:SPAC LIN
```

RANGE LINEAR dB

The *RANGE LINEAR dB* softkey selects linear scaling in dB for the level display range, i.e. the horizontal lines are labelled in dB.
Markers are displayed in the selected unit; delta markers are displayed in dB referenced to the power value at the position of marker 1.

IEC/IEEE-bus command:
```
DISP:WIND:TRAC:Y:SPAC LDB
```

UNIT ▶

dBm
dBmV
dBµV
dBµA
dBpW

VOLT
AMPERE
WATT

The *UNIT* softkey opens a sub menu allowing to select the unit for the level axis.

The default setting is dBm.

In general, the spectrum analyzer measures the signal voltage at the RF input. The level display is calibrated in rms values of an unmodulated sinewave signal. In the default state, the level is displayed at a power of 1 mW (= dBm). Via the known input resistance of 50 Ω or 75Ω , conversion to other units is possible. The units dBm, dBmV, dBµV, dBµA, dBpW, V, A and W are directly convertible.

IEC/IEEE-bus command:
```
CALC:UNIT:POW DBM
```

RF INPUT AC DC

The RF INPUT AC/DC softkey toggles the RF input of the analyzer between AC and DC coupling.

Note: *The softkey is only available for models 3, 8 and 26.*

IEC/IEEE-bus command: `INP:COUP AC`

RF ATTEN MANUAL

The *RF ATTEN MANUAL* softkey allows the attenuation to be entered irrespective of the reference level.

The attenuation can be set in 10 dB steps between 0 and 70 dB (in 5 dB steps between 0 and 75 dB if option *-B25, Electronic Attenuator*, is fitted). The attenuation can be set in 5 dB steps between 0 and 75 dB. Other entries will be rounded to the next lower integer value.

If the defined reference level cannot be set for the given RF attenuation, the reference level will be adjusted accordingly and the warning "Limit reached" will be output.

Note: *The 0 dB value can be entered only via the numeric keypad in order to protect the input mixer against overload.*

IEC/IEEE-bus command: `INP:ATT 40 DB`

RF ATTEN AUTO

The *RF ATTEN AUTO* softkey sets the RF attenuation automatically as a function of the selected reference level.
This ensures that the optimum RF attenuation desired by the user is always used.

RF ATTEN AUTO is the default setting.

IEC/IEEE-bus command: `INP:ATT:AUTO ON`

MIXER LEVEL

The *MIXER LEVEL* softkey opens a submenu for defining the maximum mixer level attainable for the selected reference level.

MIXER LVL AUTO

The *MIXER LVL AUTO* softkey activates the automatic calculation of the mixer level dependent on the selected reference level and the selected RF attenuation.

IEC/IEEE-bus command: `INP:MIX:AUTO ON`

MIXER LVL MANUAL

The *MIXER LVL MANUAL* softkey allows the maximum mixer level attainable at the reference level to be entered.

The available range is 0 to -100 dBm in 10 dB steps.

IEC/IEEE-bus command: `INP:MIX -25DBM`

AMPT – NEXT menu:

REF LEVEL POSITION

The *REF LEVEL POSITION* softkey allows the reference level position to be entered.

The setting range is from -200 to +200%, 0% corresponding to the lower and 100% to the upper limit of the diagram.

IEC/IEEE-bus command: `DISP:WIND:TRAC:RPOS 100PCT`

REF LEVEL OFFSET

The *REF LEVEL OFFSET* softkey allows the arithmetic level offset to be entered. This offset is added to the measured level irrespective of the selected unit. The scaling of the Y axis is changed accordingly.

The setting range is ±200 dB in 0.1 dB steps.

IEC/IEEE-bus command: `DISP:WIND:TRAC:RLEV:OFFS -10dB`

GRID ABS REL

The *GRID ABS/REL* softkey switches between absolute and relative scaling of the level axis.

GRID ABS is the default setting.

ABS	The labelling of the level lines refers to the absolute value of the reference level.
REL	The upper line of the grid is always at 0 dB. The scaling is in dB whereas the reference level is always in the set unit (dBm, dBµV,..).

For setting *RANGE LINEAR* (linear scaling, labelling of axes in %) the softkey is not displayed since the unit % itself implies a relative scale.

IEC/IEEE-bus command: `DISP:WIND:TRAC:Y:MODE ABS`

RF INPUT 50Ω 75Ω

The *RF INPUT 50 Ω / 75 Ω* softkey switches the input impedance of the instrument between 50 Ω (= default setting) and 75 Ω.

The setting 75 Ω should be used if the input impedance (50 Ω) is transformed to 75 Ω using the corresponding adapter unit of type RAZ (= 25 Ω in series to the input impedance of the analyzer). The correction value used for the adaption is 1.76 dB = 10 log (75Ω / 50Ω).

All levels specified in this operating manual refer to the default setting of the instrument (50 Ω).

IEC/IEEE-bus command: `INP:IMP 50OHM`

Electronic Attenuator

Besides the mechanical attenuator at the RF input, the FSU also offers an electronic attenuation setting (option *ELECTRONIC ATTENUATOR FSU-B25*). The attenuation range is 0 to 30 dB, with the default attenuation being preset by the mechanical attenuator.

EL ATTEN MANUAL

The *EL ATTEN MANUAL* softkey switches the electronic attenuator on and allows the attenuation of the electronic attenuator to be set.

The attenuation can be varied in 5 dB steps from 0 to 30 dB. Other entries are rounded to the next lower integer value.

If the defined reference level cannot be set for the given RF attenuation, the reference level will be adjusted accordingly and the warning "Limit reached" will be output.

IEC/IEEE-bus command:

```
INP:EATT:AUTO OFF
INP:EATT 10 DB
```

This function is only available with option *ELECTRONIC ATTENUATOR -B25*.

EL ATTEN AUTO

The *EL ATTEN AUTO* softkey switches the electronic attenuator on and automatically sets its attenuation to 0 dB.
The allowed setting range of the reference level ranges from the current reference level on switching on the electronic attenuator to over 30 dB. If a reference level is set outside the allowed 30-dB range, setting is performed by means of the mechanical attenuator. From this new reference level to over 30 dB the setting is again performed with the electronic attenuator.

IEC/IEEE-bus command:

```
INP:EATT:AUTO ON
```

This function is only available with option *ELECTRONIC ATTENUATOR -B25*.

EL ATTEN OFF

The *EL ATTEN OFF* softkey switches the electronic attenuator off.

IEC/IEEE-bus command:

```
INP:EATT:STAT OFF
```

This function is only available with option *ELECTRONIC ATTENUATOR -B25*.

Setting the Bandwidths and Sweep Time – *BW* Key

The *BW* key calls a menu for setting the resolution bandwidth (*RBW*), video bandwidth (*VBW*) and sweep time (*SWT*) for the frequency sweep. The parameters may be coupled dependent on the span (stop minus start frequency) or freely set by the user. When working with a split screen display, the settings always refer to the active window.

The R&S FSMR offers resolution bandwidths from 10 Hz to 20 MHz in 1, 2, 3, 5, 10 steps and additionally 50 MHz as maximum bandwidth.

Resolution bandwidths up to 100 kHz are realized using digital bandpasses with Gaussian characteristics. As far as the attenuation characteristic is concerned they behave like analog filters but have a much higher measurement speed than comparable analog filters. This is due to the fact that the transient response can be compensated as a result of an accurately defined filter behaviour.

Bandwidths above 100 kHz are realized using decoupled 5-circuit LC filters.

As an alternative to the analog filters, FFT filters are available for the bandwidths between 1 Hz and 30 kHz. When working with bandwidths up to 30 kHz, the FFT algorithm offers considerably higher measurement speeds with all the other settings remaining the same. The reason is that with analog filters the sweep time required for a particular span is proportional to ($Span/RBW^2$). When using the FFT algorithm, however, the sweep time is proportional to (Span/RBW).

The video bandwidths are available in 1, 2, 3, 5, 10 steps between 1 Hz and 10 MHz. They can be set in accordance with the resolution bandwidth.

The video filters serve for smoothing the displayed trace. Video bandwidths that are small compared to the resolution bandwidth average out noise peaks and pulsed signals, so that only the signal average is displayed. If pulsed signals are to be measured, it is recommended to use a video bandwidth that is large compared to the resolution bandwidth ($VBW \geq 10 \times RBW$) for the amplitudes of pulses to be measured correctly.

Note: *For analog and digital filters, the R&S FSMR has overload reserves of different magnitude above the reference level. Due to the LO breakthrough the overload display OVLD responds with digital filters with RBW < 100 kHz, as soon as the start frequency is selected <6 * resolution bandwidth, for RBW = 100 kHz, as soon as the start frequency is below 3 MHz.*

BW menu:

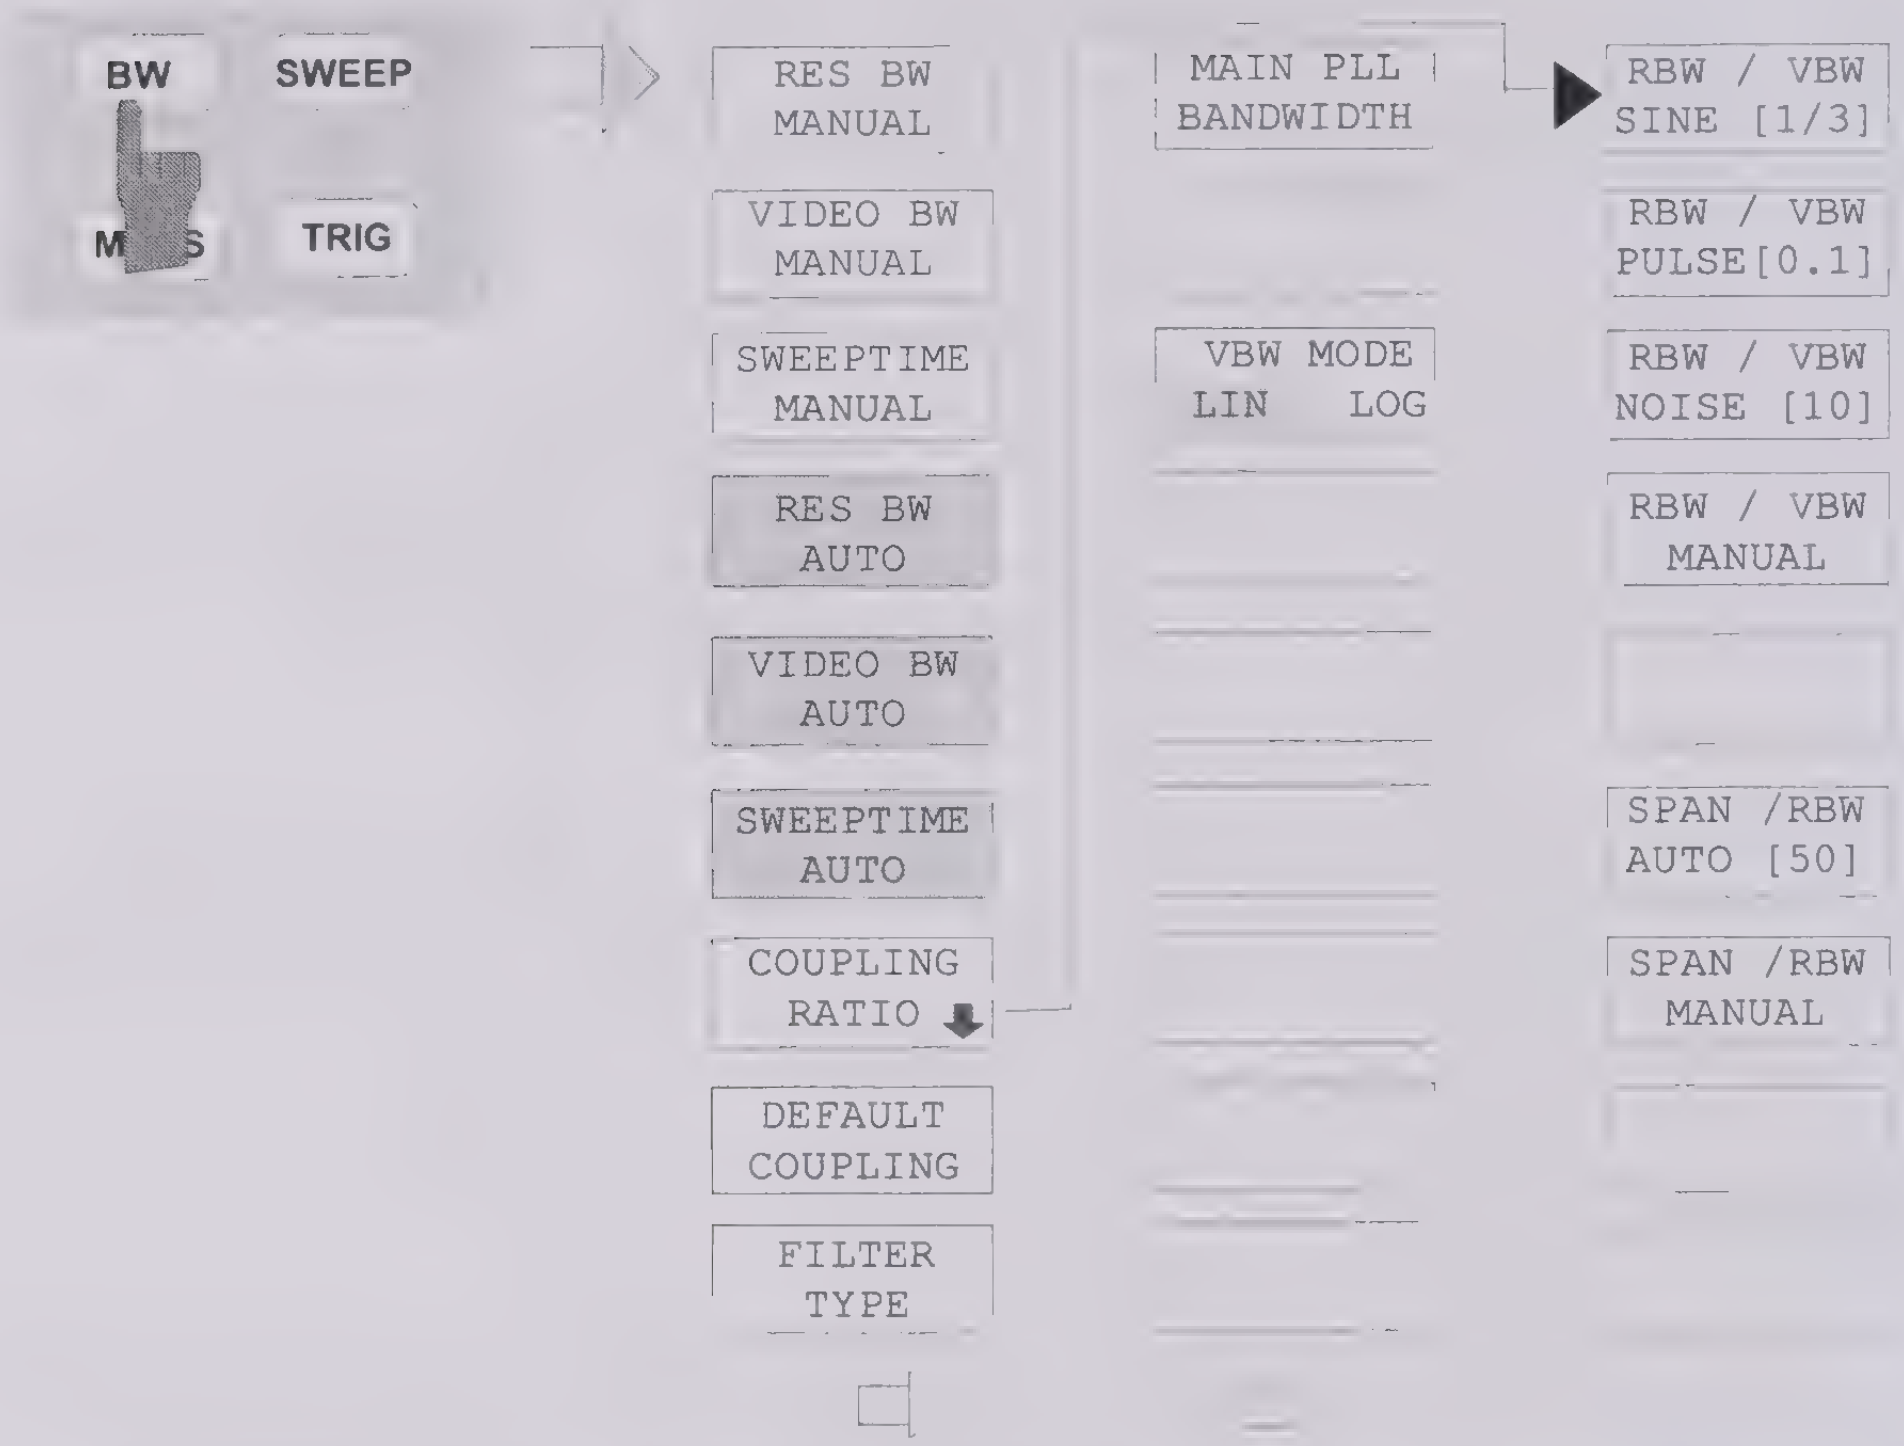

The *BW* key opens a menu for setting the resolution bandwidth, the video bandwidth, the sweep time and their couplings.

The .. *BW AUTO* softkeys are used to couple the functions. The coupling ratios are selected by means of the *COUPLING RATIO* softkey.

The .. *BW MANUAL* softkeys allow a parameter to be entered. This parameter is not coupled to the other parameters.

Note: *With the ... BW AUTO softkeys the resolution bandwidth, the video bandwidth and the sweep time can be entered separately for the frequency domain (span > 0 Hz) and the time domain (span = 0 Hz).*
But with ...BW MANUAL softkeys the selected values apply to both the frequency and time domain.

RES BW MANUAL

The *RES BW MANUAL* softkey activates the manual data entry for the resolution bandwidth.

The resolution bandwidth can be selected in 1/2/3/5/10 steps in the range between 10 Hz and 20 MHz. Additionally a maximum bandwidth of 50 MHz is available. The nominal resolution bandwidth is the 3 dB bandwidth.

When FFT filters are used, the lower limit of the bandwidth is 1 Hz. FFT filters may be used with bandwidths up to 30 kHz.

For numeric inputs, the values are always rounded to the nearest possible bandwidth. For rollkey or UP/DOWN key inputs, the bandwidth is adjusted in steps either upwards or downwards.

For filter type CHANNEL or RRC the bandwidth is selected from the list of available channel filters given at the end of this chapter. For data entry, the cursor keys ↑ and ↓ scroll through this list.

The manual input mode of the resolution bandwidth is indicated by a green terisk (*) on the display.

IEC/IEEE-bus command:

```
BAND:AUTO OFF;
BAND 1MHz
```

VIDEO BW MANUAL

The *VIDEO BW MANUAL* softkey activates the manual data entry for the video bandwidth.

The video bandwidth can be selected in 1/2/3/5/10 steps in the range between 1 Hz and 10 MHz.
For numeric inputs, the values are always rounded to the nearest possible allowed bandwidth. For rollkey or UP/DOWN key inputs, the bandwidth is adjusted in steps either downwards or upwards.
The manual input mode of the video bandwidth is indicated by a green terisk (*) on the display.

IEC/IEEE-bus command:

```
BAND:VID:AUTO OFF;
BAND:VID 10 kHz
```

SWEEP TIME MANUAL

The *SWEEPTIME MANUAL* softkey activates the manual data entry for the sweep time. At the same time, the coupling of the sweep time is cancelled. Other couplings (*VIDEO BW, RES BW*) remain effective.

In the frequency domain (span > 0 Hz) and for resolution bandwidths above 1 kHz, the allowed sweep times for spans > 3.2 kHz range from 2.5 ms through to 16000 s. With spans below 3.2 kHz, the maximum allowed sweep time is reduced to 5 s * span/Hz.
If FFT filters are used, the sweep time is fixed by the span and the bandwidth and therefore cannot be set.
In time domain (span = 0 Hz), the range of sweep times is 1 µs to 16000 s is selectable in steps of max. 5% of the sweep time. For numeric inputs, rounding is made to the nearest possible sweep time. For rollkey or UP/DOWN key inputs, the sweep time is adjusted in steps either downwards or upwards.

The manual input mode of the sweep time is indicated by a green asterisk (*) on the display. If the selected sweep time is too short for the selected bandwidth and span, level measurement errors will occur. This happens because the available settling time for the resolution or video filters is too short. In this case, the R&S FSMR outputs *UNCAL* on the display and marks the indicated sweep time with a red asterisk (*).
IEC/IEEE-bus command: `SWE:TIME:AUTO OFF;`
`SWE:TIME 10s`

RES BW AUTO

The *RES BW AUTO* softkey couples the resolution bandwidth to the selected span. Changing the span causes automatic adjustment of the resolution bandwidth.

Automatic coupling of resolution bandwidth to span is always recommended when a favourable setting of the resolution bandwidth in relation to the selected span is desired for the measurement under request.

The coupling ratio is set in the *COUPLING RATIO* submenu.

The *RES BW AUTO* softkey is only available in the frequency domain (span > 0 Hz). The softkey is blanked in the time domain.

IEC/IEEE-bus command: `BAND:AUTO ON`

VIDEO BW AUTO

The *VIDEO BW AUTO* softkey couples the video bandwidth to the resolution bandwidth. If the resolution bandwidth is changed, the video bandwidth is automatically adjusted.

The coupling of the video bandwidth is always recommended when the minimum sweep time is required for a selected resolution bandwidth. Narrower video bandwidths require longer sweep times due to the longer settling time. Wider bandwidths reduce the signal/noise ratio.

The coupling ratio is set in the *COUPLING RATIO* submenu.

The coupling of the video bandwidth to the resolution filter is also permitted for the time domain display (span = 0).

IEC/IEEE-bus command: `BAND:VID:AUTO ON`

The *SWEEPTIME AUTO* softkey couples the sweep time to the span, video bandwidth (VBW) and resolution bandwidth (RBW). The sweep time is automatically adjusted on any change in span, resolution bandwidth or video bandwidth.

The softkey is only available in the frequency domain (span >0 Hz). It is blanked in the time domain.
The R&S FSMR always selects the shortest sweep time possible without falsifying the signal. The maximum level error compared to using a longer sweep time is < 0.1 dB. If additional bandwidth and level errors are to be avoided, the sweep time is to be set to three times the time offered in coupled mode.
IEC/IEEE-bus command: `SWE:TIME:AUTO ON`

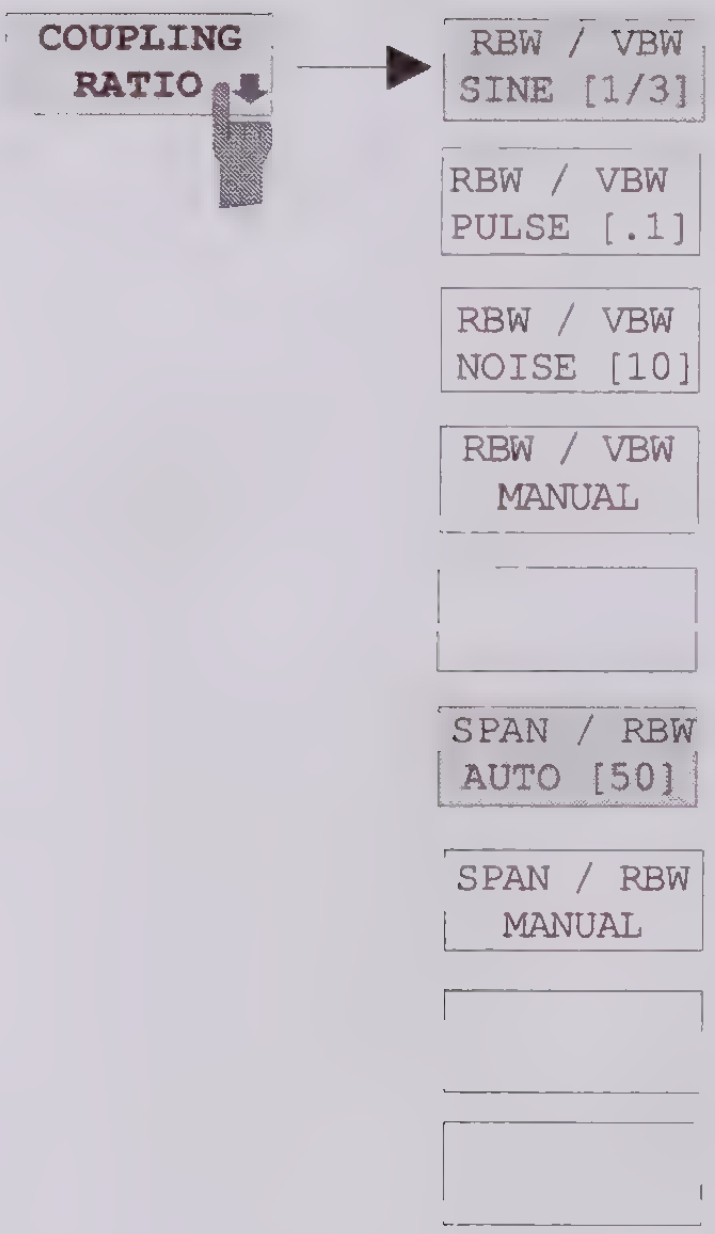

The *COUPLING RATIO* softkey opens a sub menu for selection of the coupling ratios.

When the default setting is active, i.e. the *COUPLING RATIO* softkey is deactivated (not highlighted), the ratio span/resolution bandwidth (SPAN/RBW) is 50 (this corresponds to SPAN / RBW AUTO [50]) and the ratio resolution bandwidth/video bandwidth (RBW/VBW) is 0.33 (this corresponds to RBW / VBW SINE [1/3]).

If the ratio RBW/VBW or SPAN/RBW is different from the default setting, the *COUPLING RATIO* softkey is highlighted.

The softkeys RBW/VBW... are selection keys. Only one softkey can be enabled at any one time. The softkeys are only effective for the *VBW AUTO* selection in the main menu.

The softkeys SPAN/RBW... are also selection keys. They are only effective for the *RBW AUTO* selection in the main menu.



The *RBW/VBW SINE [1/3]* softkey sets the following coupling ratio:
video bandwidth = 3 x resolution bandwidth.

This is the default setting for the coupling ratio resolution bandwidth/video bandwidth.

This is the coupling ratio recommended if sinusoidal signals are to be measured.

IEC/IEEE-bus command `BAND:VID:RAT 3`

This setting is only effective for the *VBW AUTO* selection in the main menu.



The *RBW/VBW PULSE [.1]* softkey sets the following coupling ratio:
video bandwidth = 10 x resolution bandwidth or
video bandwidth = 10 MHz (= max. VBW).

This coupling ratio is recommended whenever the amplitudes of pulsed signals are to be measured correctly. The IF filter is exclusively responsible for pulse shaping. No additional evaluation is performed by the video filter.

IEC/IEEE-bus command `BAND:VID:RAT 10`

This setting is only effective for the *VBW AUTO* selection in the main menu.



The *RBW/VBW NOISE [10]* softkey sets the following coupling ratio:
video bandwidth = resolution bandwidth/10

At this coupling ratio, noise and pulsed signals are suppressed in the video domain. For noise signals, the average value is displayed.

IEC/IEEE-bus command `BAND:VID:RAT 0.1`

This setting is only effective for the *VBW AUTO* selection in the main menu.



The *RBW/VBW MANUAL* softkey activates the manual input of the coupling ratio.

The resolution bandwidth/video bandwidth ratio can be set in the range 0.001 to 1000.

IEC/IEEE-bus command `BAND:VID:RAT 10`

This setting is only effective for the *VBW AUTO* selection in the main menu.



The *SPAN/RBW AUTO [50]* softkey sets the following coupling ratio:
resolution bandwidth = span/50

This coupling ratio is the default setting of the R&S FSMR

IEC/IEEE-bus command `BAND:RAT 0.02`

This setting is only effective for the *RBW AUTO* selection in the main menu.

SPAN /RBW MANUAL

The *SPAN/RBW MANUAL* softkey activates the manual input of the coupling ratio.

The span / resolution bandwidth ratio can be set in the range 1 to 10000.

IEC/IEEE-bus command `BAND:RAT 0.1`

This setting is only effective for the *RBW AUTO* selection in the main menu.

DEFAULT COUPLING

The *DEFAULT COUPLING* softkey sets all coupled functions to the default state (*AUTO)*. In addition, the ratio *RBW/VBW* is set to *SINE [1/3]* and the ratio *SPAN/RBW* to 50 in the *COUPLING RATIO* submenu (default setting, *COUPLING RATIO* softkey not highlighted).

IEC/IEEE-bus command

```
BAND:AUTO ON
BAND:VID:AUTO ON
SWE:TIME:AUTO ON
```

FILTER TYPE

The *FILTER TYPE* softkey opens the selection list for different filter types. In the range up to 30 kHz digital band filters with Gaussian characteristic and filtering with FFT algorithm can be selected.

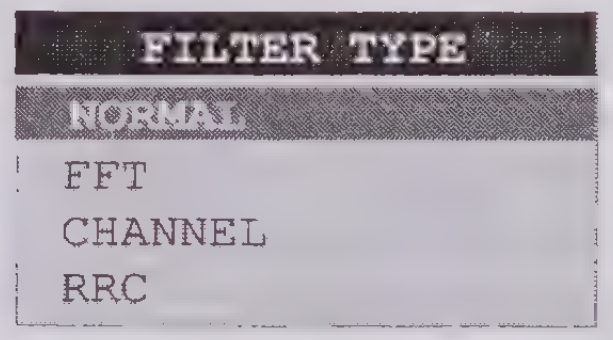

FILTER TYPE

NORMAL

FFT

CHANNEL

RRC

NORMAL	For resolution bandwidths up to 100 kHz digital bandpasses are used.
FFT	An FFT is performed. For that purpose, the filtered IF signal is digitized and then transformed into the spectral domain via FFT. The transformation range depends on the selected filter bandwidths and can be set between 4 kHz to 50 kHz. If the span is larger than the transformation range, several transformations are performed and the results are appended to each other in the spectral domain. If the span is smaller than the transformation range, the measurement results are interpolated when the number of measurement points provided by the FFT is smaller than the number of display points in x-direction. A flattop window serves as a window in the time domain so that high amplitude precision with good selection is achieved.A flat-top window serves as a window in the time domain so that high amplitude accuracy as well as good selection are achieved.

Sweep time	Defined by the selected bandwidth and span (reason: FFT filtering is a block transformation). It cannot be changed (softkey deactivated).
Detector	Sample detector and peak detector are available. Peak detector is active when AUTO SELECT is selected.
Video bandwidth	Not defined in case of FFT; therefore cannot be set (softkeys deactivated).

Compared to bandpasses, FFT filters lead to significantly reduced sweep times. For a span of 50 kHz and a bandwidth of 100 Hz, for instance, the sweep time is reduced from 5 s to 40 ms. FFT filters are particularly suitable for stationary signals (sinusoidal signals or signals that are continuously modulated in time). For burst signals (TDMA) or pulsed signals, normal filters are preferable.

Note:

As soon as the FFT filters are active (RBW ≤ 30 kHz) the sweep time display field (SWT) is replaced by the acquisition time (AQT) display field.

FFT is a block transformation so the result depends on the time relation between the data set to be transformed and the burst or pulsed signal. A gated sweep measurement for TDMA signals is therefore not provided if FFT filters are used.

Additionally, a number of especially steep-edged channel filters are available for power measurement since firmware version 1.10.

A distinction is made between the following filter types:

CHANNEL = general, steep-edged channel filters

RRC = filters with root-raised cosine characteristic (RRC = Root Raised Cosine)

When selecting these filter types, the automatic coupling of the resolution bandwidth to the span is not available. The filters are selected via the *RES BW* softkey.

A list of all available channel filters with their associated applications can be found at the end of this chapter.

IEC/IEEE-bus command: `BAND:TYPE NORM`

List of available channel filters

The channel filters included in the following table are can be activated via the *FILTER TYPE* softkey and are then available as resolution filters (softkey *RES* available for firmware version 1.10 or higher. They *BW*).

Note:
For filters of type RRC (Root Raised Cosine), the filter bandwidth indicated describes the sampling rate of the filter.
For all other filters (CFILter) the filter bandwidth is the 3 dB bandwidth.

Filter Bandwidth	Filter Type	Application
100 Hz	CFILter	
200 Hz	CFILter	A0
300 Hz	CFILter	
500 Hz	CFILter	
1 kHz	CFILter	
1.5 kHz	CFILter	
2 kHz	CFILter	
2.4 kHz	CFILter	SSB
2.7 kHz	CFILter	
3 kHz	CFILter	
3.4 kHz	CFILter	
4 kHz	CFILter	DAB, Satellite
4.5 kHz	CFILter	
5 kHz	CFILter	
6 kHz	CFILter	
8.5 kHz	CFILter	ETS300 113 (12.5 kHz channels)
9 kHz	CFILter	AM Radio
10 kHz	CFILter	
12.5 kHz	CFILter	CDMAone
14 kHz	CFILter	ETS300 113 (20 kHz channels)
15 kHz	CFILter	
16 kHz	CFILter	ETS300 113 (25 kHz channels)
18 kHz, α=0.35	RRC	TETRA
20 kHz	CFILter	
21 kHz	CFILter	PDC
24.3 kHz, α=0.35	RRC	IS 136
25 kHz	CFILter	
30 kHz	CFILter	CDPD, CDMAone
50 kHz	CFILter	
100 kHz	CFILter	
150 kHz	CFILter	FM Radio
192 kHz	CFILter	PHS
200 kHz	CFILter	
300 kHz	CFILter	
500 kHz	CFILter	J.83 (8-VSB DVB, USA)
1.0 MHz	CFILter	CDMAone
1.2288 MHz	CFILter	CDMAone
1.5 MHz	CFILter	DAB
2.0 MHz *)	CFILter	
3.0 MHz *)	CFILter	
3.84 MHz, α=0.22 *)	RRC	W-CDMA 3GPP
4.096 MHz, α=0.22 *)	RRC	W-CDMA NTT DOCoMo
5.0 MHz *)	CFILter	

*) This filter is avaible with hardware index > 2 of the IF filter module (see softkey SETUP - SYSTEM INFO - HARDWARE INFO).

MAIN PLL BANDWIDTH

The MAIN PLL BANDWIDTH softkey defines the bandwidth of the main PLL of the analyzer synthesizer and thus influences the phase noise of the analyzer. Three bandwidth settings are possible (High / Medium / Low); if AUTO is selected, the bandwidth is set automatically (default).

IEC/IEEE-bus command: `BAND:PLL AUTO`

VBW MODE LIN LOG

The *VBW MODE LIN/LOG* softkey determines the position of the video filter in the signal path for resolution bandwidths ≤ 100 kHz:

- If LINear is selected, the video filter will be in front of the logarithmic amplifier (default).
- If LOGarithmic is selected, the video filter will be behind the logarithmic amplifier.

The essential difference between the two operating modes relates to the settling in the case of falling signal edges:

With LINear, the falling signal edge will be "flatter" than with LOGarithmic.
This is due to the conversion from linear power to logarithmic level units: a reduction of the linear power by 50% reduces the logarithmic signal level by only 3 dB.

IEC/IEEE-bus-command: `BAND:VID:TYPE LIN`

Sweep Settings – *SWEEP* Key

The SWEEP key serves for configuring the sweep mode.

SWEEP menu

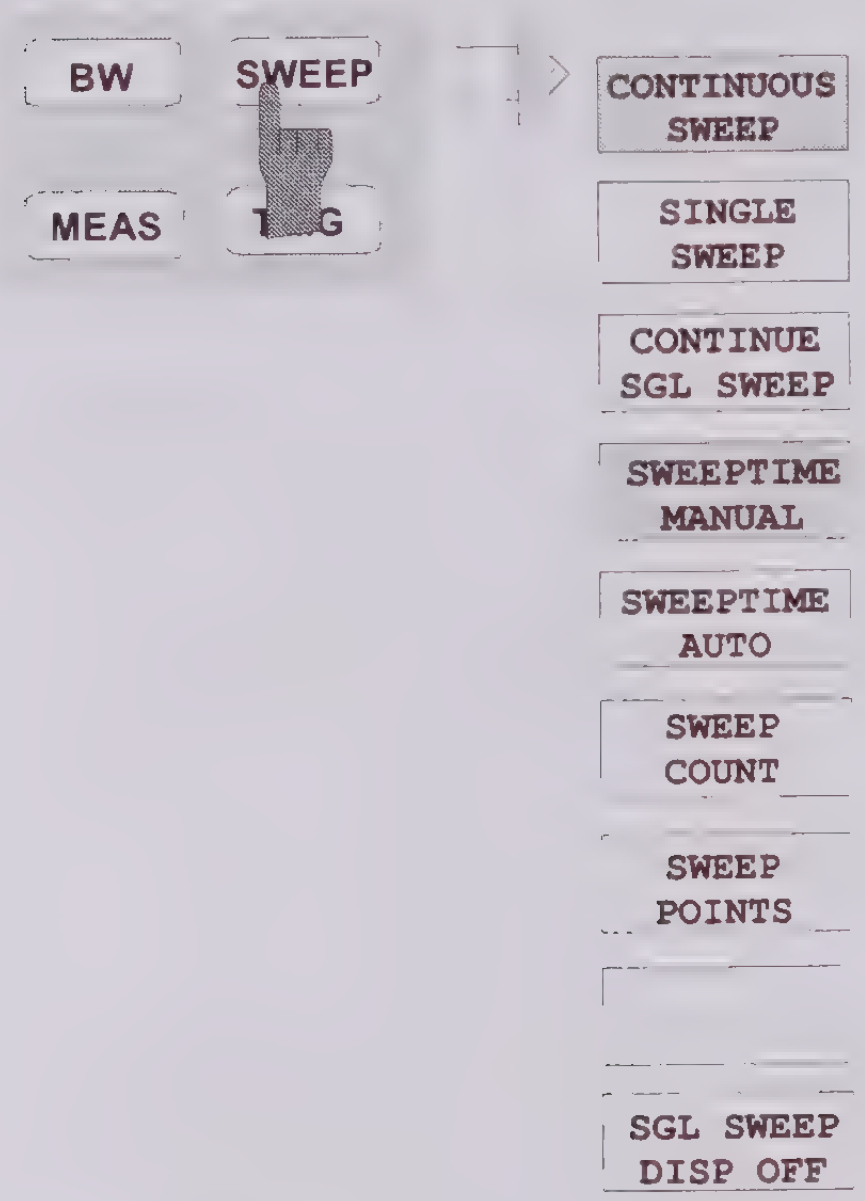

The *SWEEP* key calls a menu in which the sweep mode is defined. In split-screen mode, the entries made are valid for the active window only.

The *CONTINUOUS SWEEP, SINGLE SWEEP* and *SGL SWEEP DISP OFF* softkeys are mutually exclusive selection keys.

The *CONTINUOUS SWEEP* softkey activates the continuous sweep mode, which means that the sweep takes place continuously according to the trigger mode set.

When working in the split-screen mode and with different settings in the two windows, screen A is swept first, followed by screen B. When the softkey is pressed, the sweep is restarted.

CONTINUOUS SWEEP is the default setting of R&S FSMR.

IEC/IEEE-bus command: `INIT:CONT ON`

The *SINGLE SWEEP* softkey starts n sweeps after triggering. The number of sweeps is determined by the *SWEEP COUNT* softkey.

When working in the split-screen mode, the frequency ranges of the two windows are swept one after the other.

If a trace is swept using *TRACE AVERAGE* or *MAXHOLD*, the value set via the SWEEP COUNT softkey determines the number of sweeps. If 0 has been entered, one sweep is performed.

IEC/IEEE-bus command: `INIT:CONT OFF`

CONTINUE SGL SWEEP

The *CONTINUE SGL SWEEP* softkey repeats the number of sweeps set under *SWEEP COUNT,* however without first deleting the trace.

This is particularly of interest when using the functions *TRACE AVERAGE* and *MAXHOLD*, if previously recorded measurement results are to be taken into consideration for averaging / maximum search.

If *SGL SWEEP DISP OFF* is active, the screen is switched off also during repeated sweeps.

IEC/IEEE-bus command: `INIT:CONM`

SWEEPTIME MANUAL

The *SWEEPTIME MANUAL* softkey activates the window for entering the sweep time manually (see also BW menu).

IEC/IEEE-bus command: `SWE:TIME 10s`

SWEEPTIME AUTO

The *SWEEPTIME AUTO* softkey activates the automatic selection of the sweep time as a function of the bandwidth of the resolution and video filters (see also BW menu).

IEC/IEEE-bus command: `SWE:TIME:AUTO ON`

SWEEP COUNT

The *SWEEP COUNT* softkey activates the window for the entry of the number of sweeps to be performed by R&S FSMR after a single sweep has been started. If Trace Average, Max Hold or Min Hold is activated, this also determines the number of averaging or maximum search procedures.

Example:
[**TRACE1**: *MAX HOLD*]
[**SWEEP**: *SWEEP COUNT*: {10} **ENTER**]
[*SINGLE SWEEP*]

R&S FSMR performs the Max Hold function over 10 sweeps.

The permissible range for the sweep count is 0 to 32767. For sweep count = 0 or 1, one sweep is performed. For trace averaging in the continuous-sweep mode, R&S FSMR performs running averaging over 10 sweeps if sweep count = 0; if sweep count = 1, no averaging is performed.

The sweep count is valid for all the traces in a diagram.

Note: *The number of sweeps set in the TRACE menu is the same as that in the SWEEP menu.*
If SINGLE SWEEP is selected, the measurement stops after the selected number of sweeps has been performed.

IEC/IEEE-bus command: `SWE:COUN 64`

SWEEP POINTS

The *SWEEP POINTS* softkey selects the number of measurement samples acquired during a sweep.

The following numbers of points per sweep are available: 155, 313, 625 (default), 1251, 2501, 5001, 10001

Note:
The autopeak detector will be disabled while the number of points per sweep is ≠ 625.

EC/IEEE-bus command: `SWE:POIN 625`

SGL SWEEP DISP OFF

The *SGL SWEEP DISP OFF* softkey deactivates the display while a single sweep is being performed. Once the sweep has been completed, the trace is shown.

IEC/IEEE-bus command: `INIT:DISP OFF;:INIT`

Triggering the Sweep – TRIG Key

The *TRIG* key opens a menu for selection of the various trigger sources, trigger polarity and external gate function. The active trigger mode is indicated by highlighting the corresponding softkey.

For video trigger, a trigger threshold can be entered, which is represented in the diagram as a horizontal line.

To indicate that a trigger mode other than *FREE RUN* has been set, the enhancement label **TRG** is displayed on the screen. If two windows are displayed, TRG appears next to the appropriate window.

TRIGGER menu

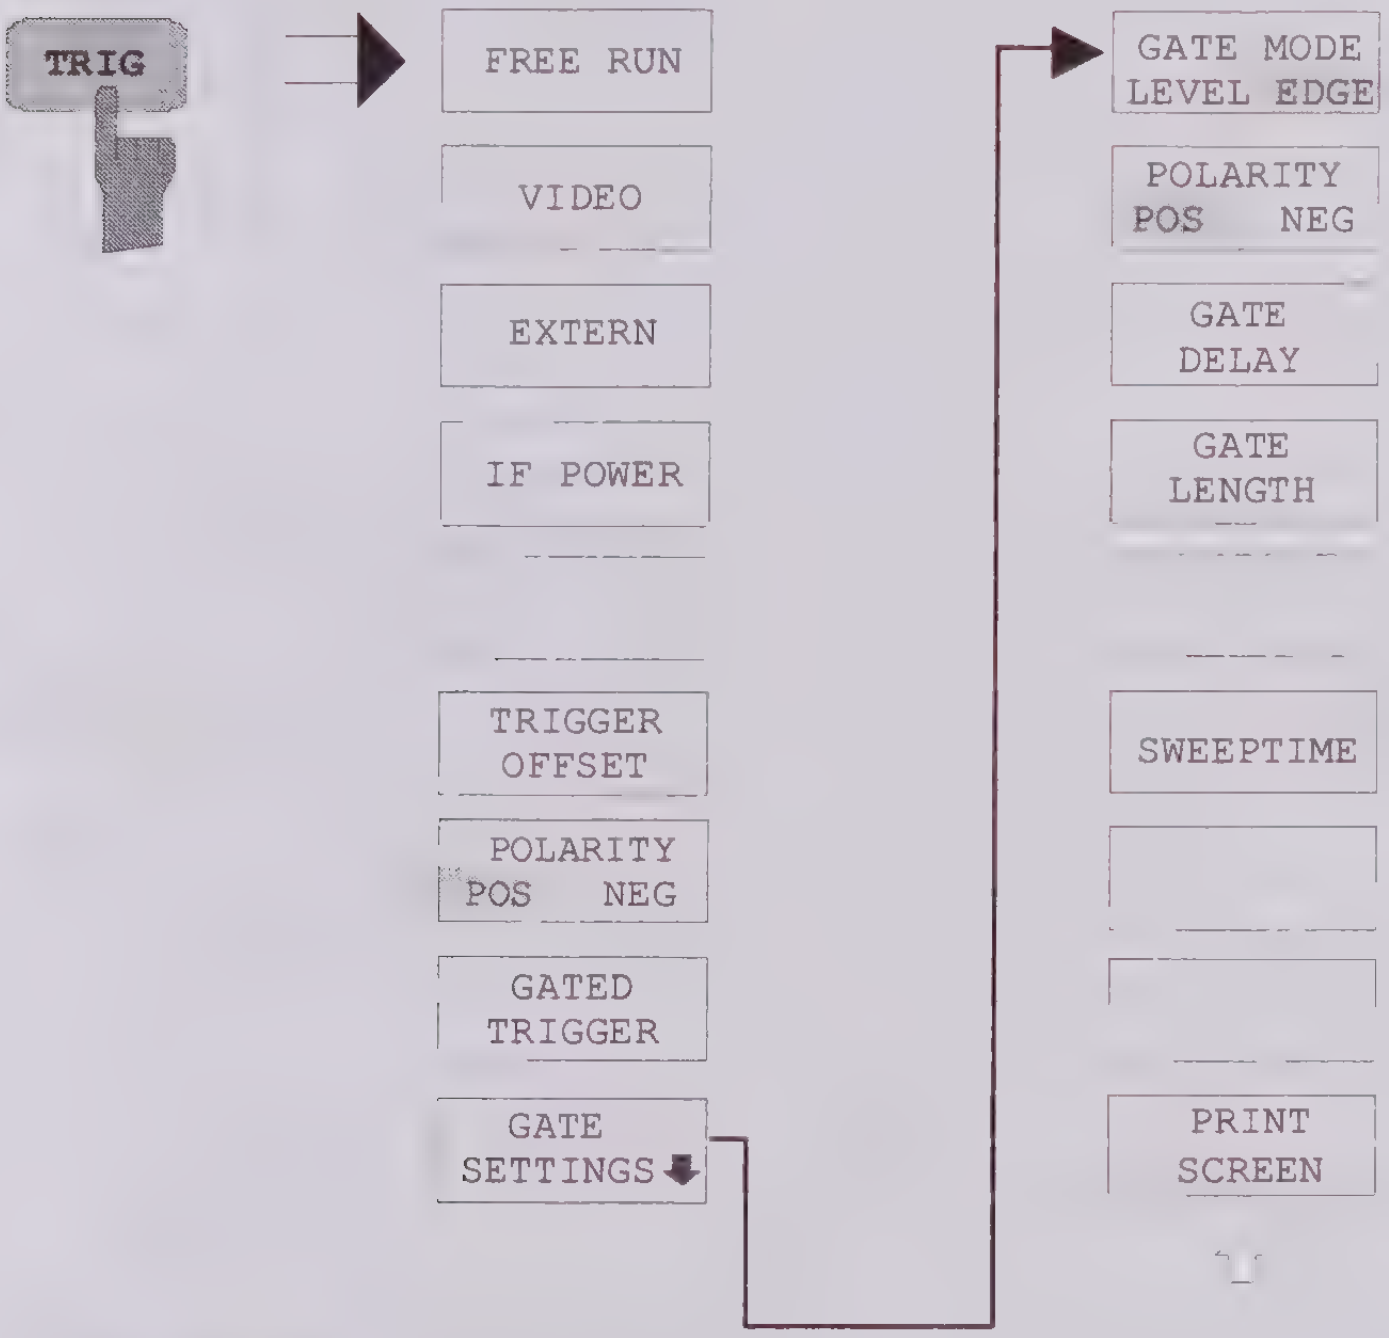

The *FREE RUN* softkey activates the free-run sweep mode, i.e. start of a sweep is not triggered. Once a measurement is completed, another is started immediately.

FREE RUN is the default setting of R&S FSMR.

IEC/IEEE-bus command: `TRIG:SOUR IMM`

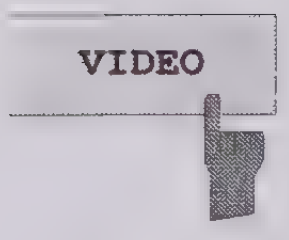

The *VIDEO* softkey activates triggering through the displayed voltage.

For the video triggering mode, a horizontal trigger line is shown in the diagram. It may be used to set the trigger threshold between 0% and 100% of the overall diagram height.

IEC/IEEE-bus command: `TRIG:SOUR VID`
`TRIG:LEV:VID 50 PCT`

EXTERN

The *EXTERN* softkey activates triggering via a TTL signal at the input connector *EXT TRIGGER/GATE* on the rear panel.

IEC/IEEE-bus command:
```
TRIG:SOUR  EXT
SWE:EGAT:SOUR  EXT
```

IF POWER

The *IF POWER* softkey activates triggering of the measurement via signals which are outside the measurement channel.

For this purpose, the R&S FSMR uses a level detector at the second intermediate frequency. can be selected in a range between –30 dBm and -10 dBm at the input mixer. The resulting trigger level at the RF input is calculated via the following formula:

$$Mixerlevel_{\min} + RFAtt - PreampGain \;\leq\; Input\ Signal \;\leq\; Mixerlevel_{\max} + RFAtt - PreampGain$$

The bandwidth at the intermediate frequency is 10 MHz. The R&S FSMR is triggered as soon as the trigger threshold is exceeded within a 5 MHz range around the selected frequency (= start frequency in the frequency sweep).

Thus, the measurement of spurious emissions, e.g. for pulsed carriers, is possible even when the carrier lies outside the selected frequency span.

IEC/IEEE-bus command:
```
TRIG:SOUR  IFP
SWE:EGAT:SOUR  IFP
```

TRIGGER OFFSET

The *TRIGGER OFFSET* softkey activates the window for entering the time offset between the trigger signal and the start of the sweep.

Triggering is delayed by the entered time with respect to the trigger signal (time entered > 0) or is started earlier (time entered < 0). The time may be entered in multiples of 125 ns in the range -100 s to 100 s (default 0 s).

Note: *A negative offset (pretrigger) can be set in the time domain only (SPAN = 0 Hz) provided GATED TRIGGER is not active in that domain.*
The maximum allowed range and the maximum resolution of the pretrigger is limited by the set sweep time:
max. range = - 499/500 x sweep time
max. resolution = sweep time/500.
Pretriggering is not possible when the rms or the average detector is activated

As a common input signal is used for both trigger and gate when selecting *EXTERN* and *IF POWER*, changes to the gate delay will affect the trigger delay *(TRIGGER OFFSET)* as well.

IEC/IEEE-bus command:
```
TRIG:HOLD  10US
```

POLARITY
POS NEG

The *POLARITY POS/NEG* softkey selects the polarity of the trigger source.

The sweep starts after a positive or negative edge of the trigger signal. The selected setting is highlighted.

The selection is valid for all trigger modes with the exception of *FREE RUN*; in the gate mode, it also applies to the gate polarity.

The default setting is *POLARITY POS.*

IEC/IEEE-bus command:
```
TRIG:SLOP  POS
```

By using a gate in sweep mode and stopping the measurement while the gate signal is inactive, the spectrum for pulsed RF carriers can be displayed without the superposition of frequency components generated during switching. Similarly, the spectrum can also be examined for an inactive carrier. The sweep can be controlled by an external gate or by the internal power trigger.

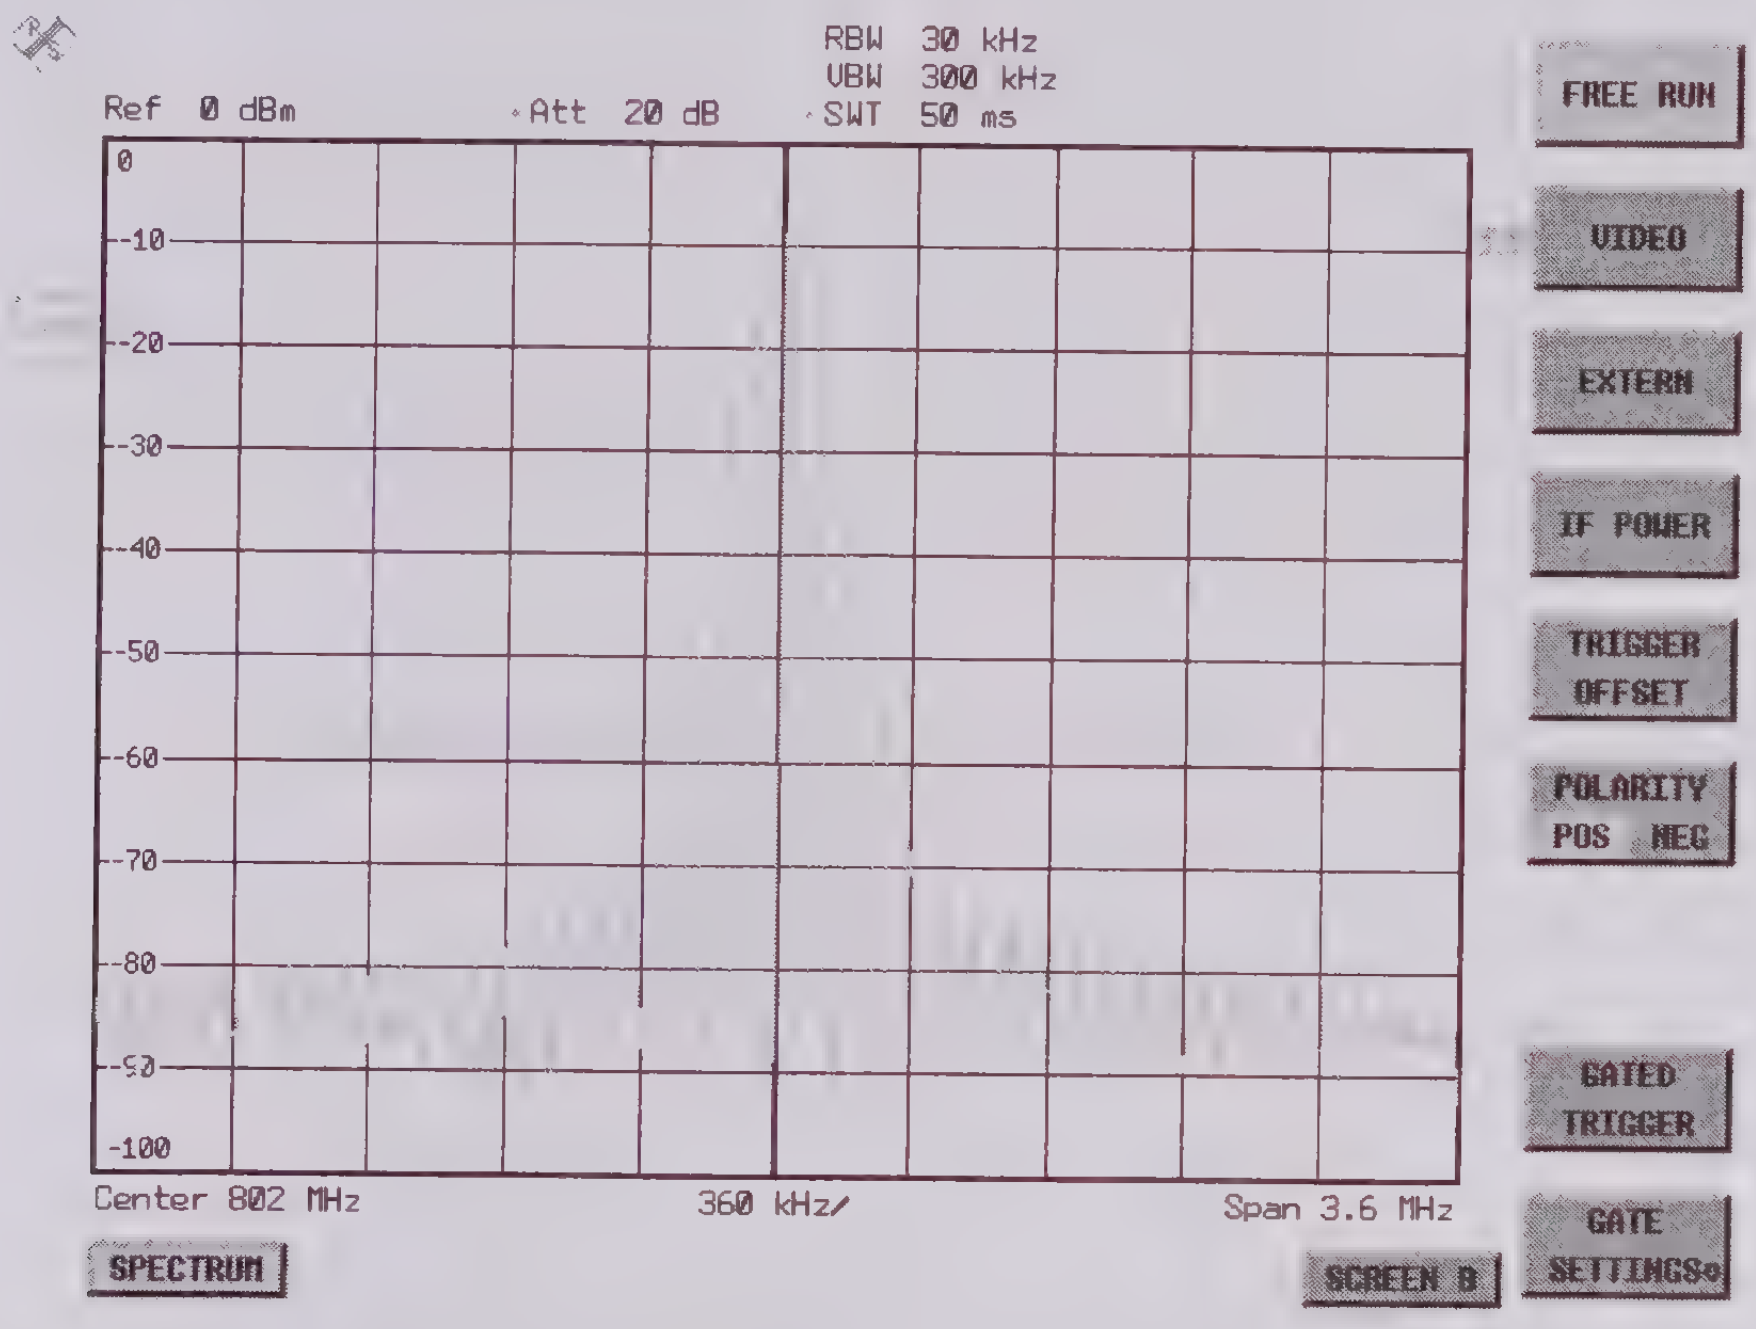

RBW 30 kHz
VBW 300 kHz
SWT 50 ms
Ref 0 dBm
Att 20 dB
Center 802 MHz
360 kHz/
Span 3.6 MHz

Fig. 4.10-1 Pulsed signal GATE OFF

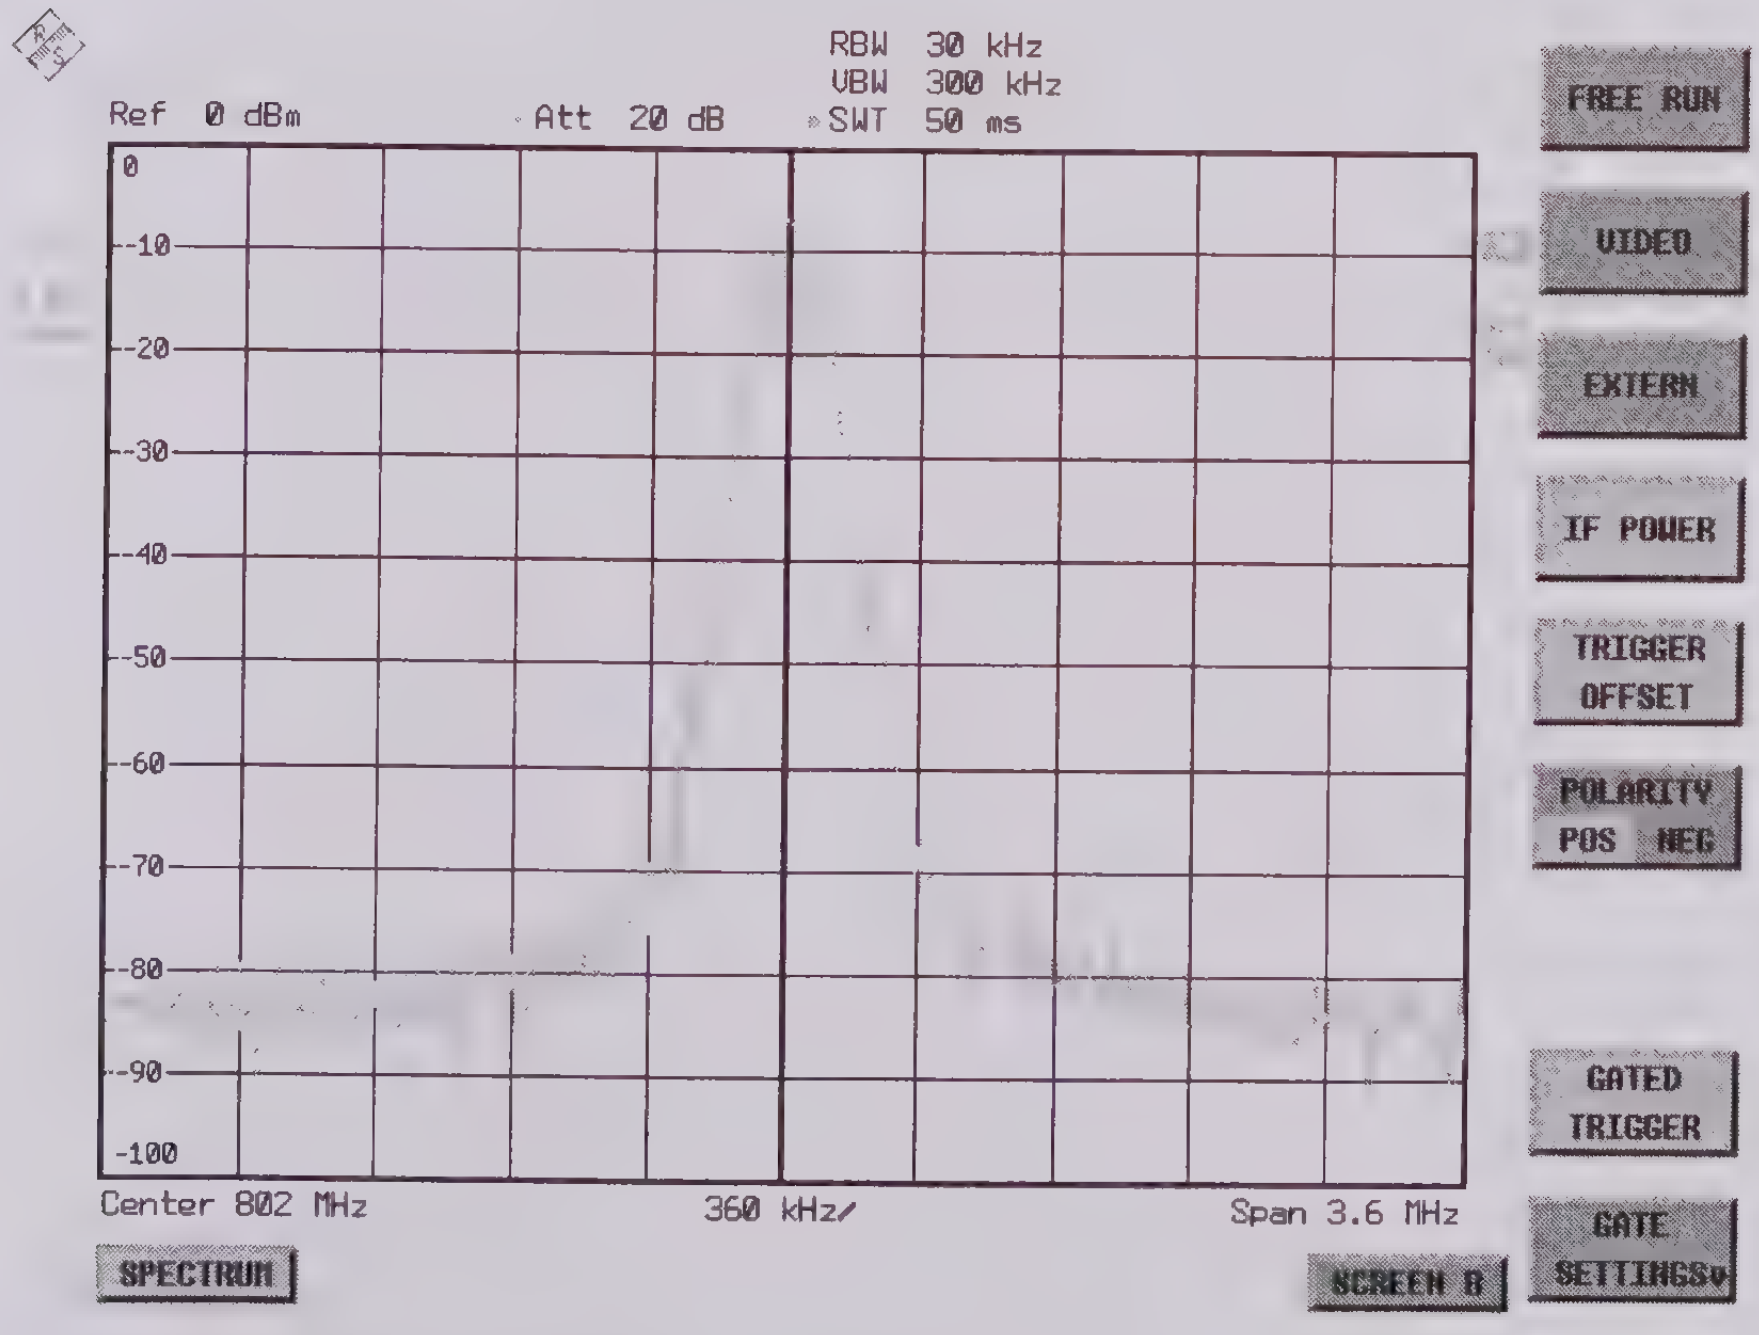

RBW 30 kHz
VBW 300 kHz
SWT 50 ms
Ref 0 dBm
Att 20 dB
Center 802 MHz
360 kHz/
Span 3.6 MHz

Fig. 4.10-2 TDMA signal with GATE ON

The gated-sweep mode is activated by the *GATED TRIGGER* softkey. The setting of the mode takes place in the *GATE SETTINGS* submenu.

GATED TRIGGER

The *GATED TRIGGER* softkey switches the sweep mode with gate on and off.

When gate is switched on, a gate signal applied to the rear panel connector *EXT TRIGGER/GATE* or the internal IF power detector controls the sweep of the analyzer. This selection is made via the *EXTERN* and *IF POWER* softkeys for trigger and gate.
The length of the gate signal defines when the sweep is to be interrupted. Here a differentiation is made between edge-triggered and level-triggered modes: in case of edge triggering the gate length can be set via the *GATE LENGTH* softkey, while in case of level triggering the gate length depends on the length of the gate signal.

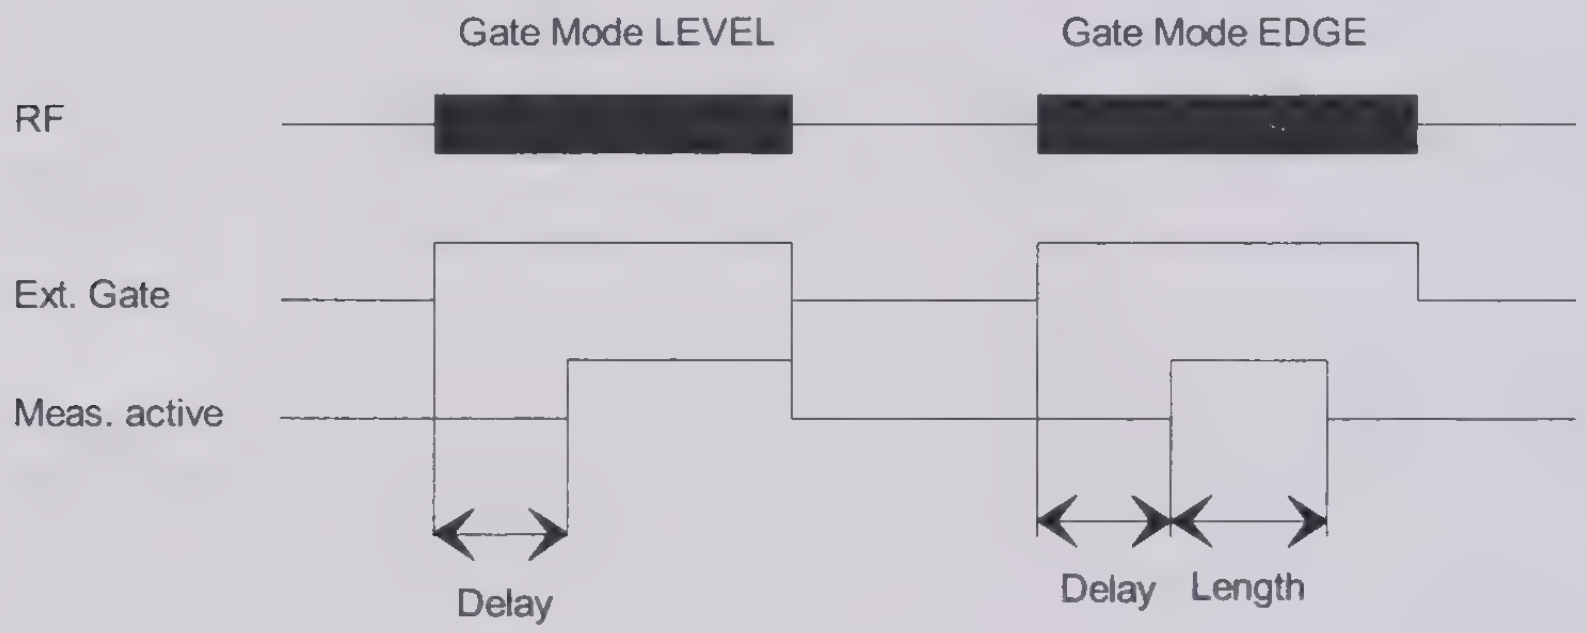

Fig.4.10-3 Timing diagram for GATE, GATE DELAY and GATE LENGTH

This softkey requires the *EXTERN* or *IF POWER* trigger mode. If a different mode is active, IF POWER is automatically selected.

Gated-sweep operation is also possible in the time domain. This enables - e.g. in burst signals - level variations of individual slots to be displayed versus time.

To indicate that a gate is used for the sweep, the enhancement label **GAT** is displayed on the screen. This label appears to the right of the window for which the gate is configured.

IEC/IEEE-bus command:

```
SWE:EGAT  ON
SWE:EGAT:SOUR  IFP
or:
SWE:EGAT:SOUR  EXT
```

GATE SETTINGS ▶

GATE MODE LEVEL EDGE

POLARITY POS NEG

GATE DELAY

GATE LENGTH

SWEEPTIME

PRINT SCREEN

The *GATE SETTINGS* softkey calls a submenu for making all the settings required for gated-sweep operation.

At the same time, a transition is made to the time domain (span = 0) and the time parameters *GATE DELAY* and *GATE LENGTH* are represented as vertical lines. This allows the required gate time parameters to be set easily.

For highly accurate setting of gate delay and gate length, the x axis can be altered using the *SWEEPTIME* softkey in a way that the signal range concerned (e.g. one full burst) is displayed.

Then the sampling time and duration can be set by *GATE DELAY* and *GATE LENGTH* in a way that the desired portion of the signal is shown.

When quitting the submenu, the program will return to the frequency domain provided it was active before. The original span is restored so the desired measurement can now be performed with the accurately set gate.

IEC/IEEE-bus command: --

GATE MODE LEVEL EDGE

The *GATE MODE LEVEL/EDGE* softkey selects the trigger mode. Gated sweep is possible in the level-triggered as well as in the edge-triggered mode.

If level triggering is selected, the *GATE LENGTH* softkey becomes inactive and cannot be operated.

IEC/IEEE-bus command: `SWE:EGAT:TYPE EDGE`

POLARITY POS NEG

The *POLARITY POS/NEG* softkey controls the polarity of the *EXT TRIGGER/GATE* control line.

In case of level triggering the sweep is stopped by *POLARITY POS* and a logic ´0´ signal; the signal ´1´ will restart the sweep after the *GATE DELAY* time has elapsed.

In case of edge triggering the sweep is continued on a ´0´ to ´1´ transition for the duration of *GATE LENGTH* after a delay (*GATE DELAY)* has elapsed.

Changing the polarity automatically implies a transition of the trigger-edge polarity (*POLARITY* softkey in the higher menu).

IEC/IEEE-bus command: `SWE:EGAT:POL POS`

GATE DELAY

The *GATE DELAY* softkey activates the window for setting the delay time between the gate signal and the continuation of the sweep.

This may be useful for taking into account a delay between the gate signal and the stabilization of an RF carrier for example.

As gate delay, values between 125 ns and 100 s may be set. The position of the delay on the time axis in relation to the sweep is indicated by the line labelled **GD**.

As there is a common input signal for trigger and gate if *EXTERN* or *IF POWER* is selected, changes to the gate delay will affect the trigger delay (*TRIGGER OFFSET*) as well.

IEC/IEEE-bus command: `SWE:EGAT:HOLD 1US`

GATE LENGTH

The *GATE LENGTH* softkey activates the window for setting the sweep duration of R&S FSMR in the edge-triggered mode.

Values between 125 ns and 100 s may be set for the gate length. The length of the gate in relation to the sweep is indicated by the line labelled **GL**.

This softkey is only available if *GATE MODE EDGE* (edge triggering) has been selected.

IEC/IEEE-bus command: `SWE:EGAT:LENG 100US`

SWEEPTIME

The *SWEEP TIME* softkey enables the user to change the time axis to obtain a higher resolution for positioning gate delay and gate length.
When this is to be done, the sweep time temporarily changes; the original value is restored when the menu is quit.

IEC/IEEE-bus command: --

PRINT SCREEN

The *PRINT SCREEN* softkey allows the gate settings to be output on a printer.

IEC/IEEE-bus command: --

Measurement example:

The modulation spectrum of a GSM or PCS1900 signal is to be measured using the gated-sweep function. The signal is generated by a Signal Generator SME03 whose RF output is directly connected to the RF input of R&S FSMR.
The modulation spectrum of a GSM 900 signal is to be measured using the gated-sweep function. The signal is generated by a Signal Generator SME03 whose RF output is directly connected to the RF input of R&S FSMR.

Settings on SME03:

FREQ:	802 MHz
Level:	0 dBm: Return
Digital Mod:	Select: GMSK: Select
Source:	Select: PRBS: Select: Return
Level Attenuation:	Select: 60 dB: Return

The SME03 supplies a GMSK-modulated TDMA signal (GSM).

Settings on R&S FSMR**:**

Conventions:	**[KEY]**	Menu called by this key. All information between the brackets refers to this menu.
	{Number}	Numeric value to be entered for the parameter on hand.
	SOFTKEY	Softkey to be used for making a selection or entering a value.

[PRESET]
[FREQ: *CENTER* {802} **MHz]**
[SPAN {3.6} **MHz]**
[AMPT: *REF LEVEL* {0} **dBm**: *RF ATTEN MANUAL*: {10} **dB]**
[BW: *RES BW MANUAL*: {30} **kHz]**
[TRACE : *TRACE 1* *DETECTOR*: *RMS*]
[SWEEP: *SWEEPTIME MANUAL*: {50} **ms]**
[TRIG: *EXTERN*
GATED TRIGGER;
GATE SETTINGS: *GATE MODE EDGE; POLARITY POS*
SWEEPTIME MANUAL {1} **ms**: *GATE DELAY* {300} **µs**:
GATE LENGTH: {250} **µs]**

The following figure shows the screen display for setting gate parameters. The vertical lines for gate delay (GD) and gate length (GL) can be adjusted to the burst signal by entering numeric values or by means of the rollkey.

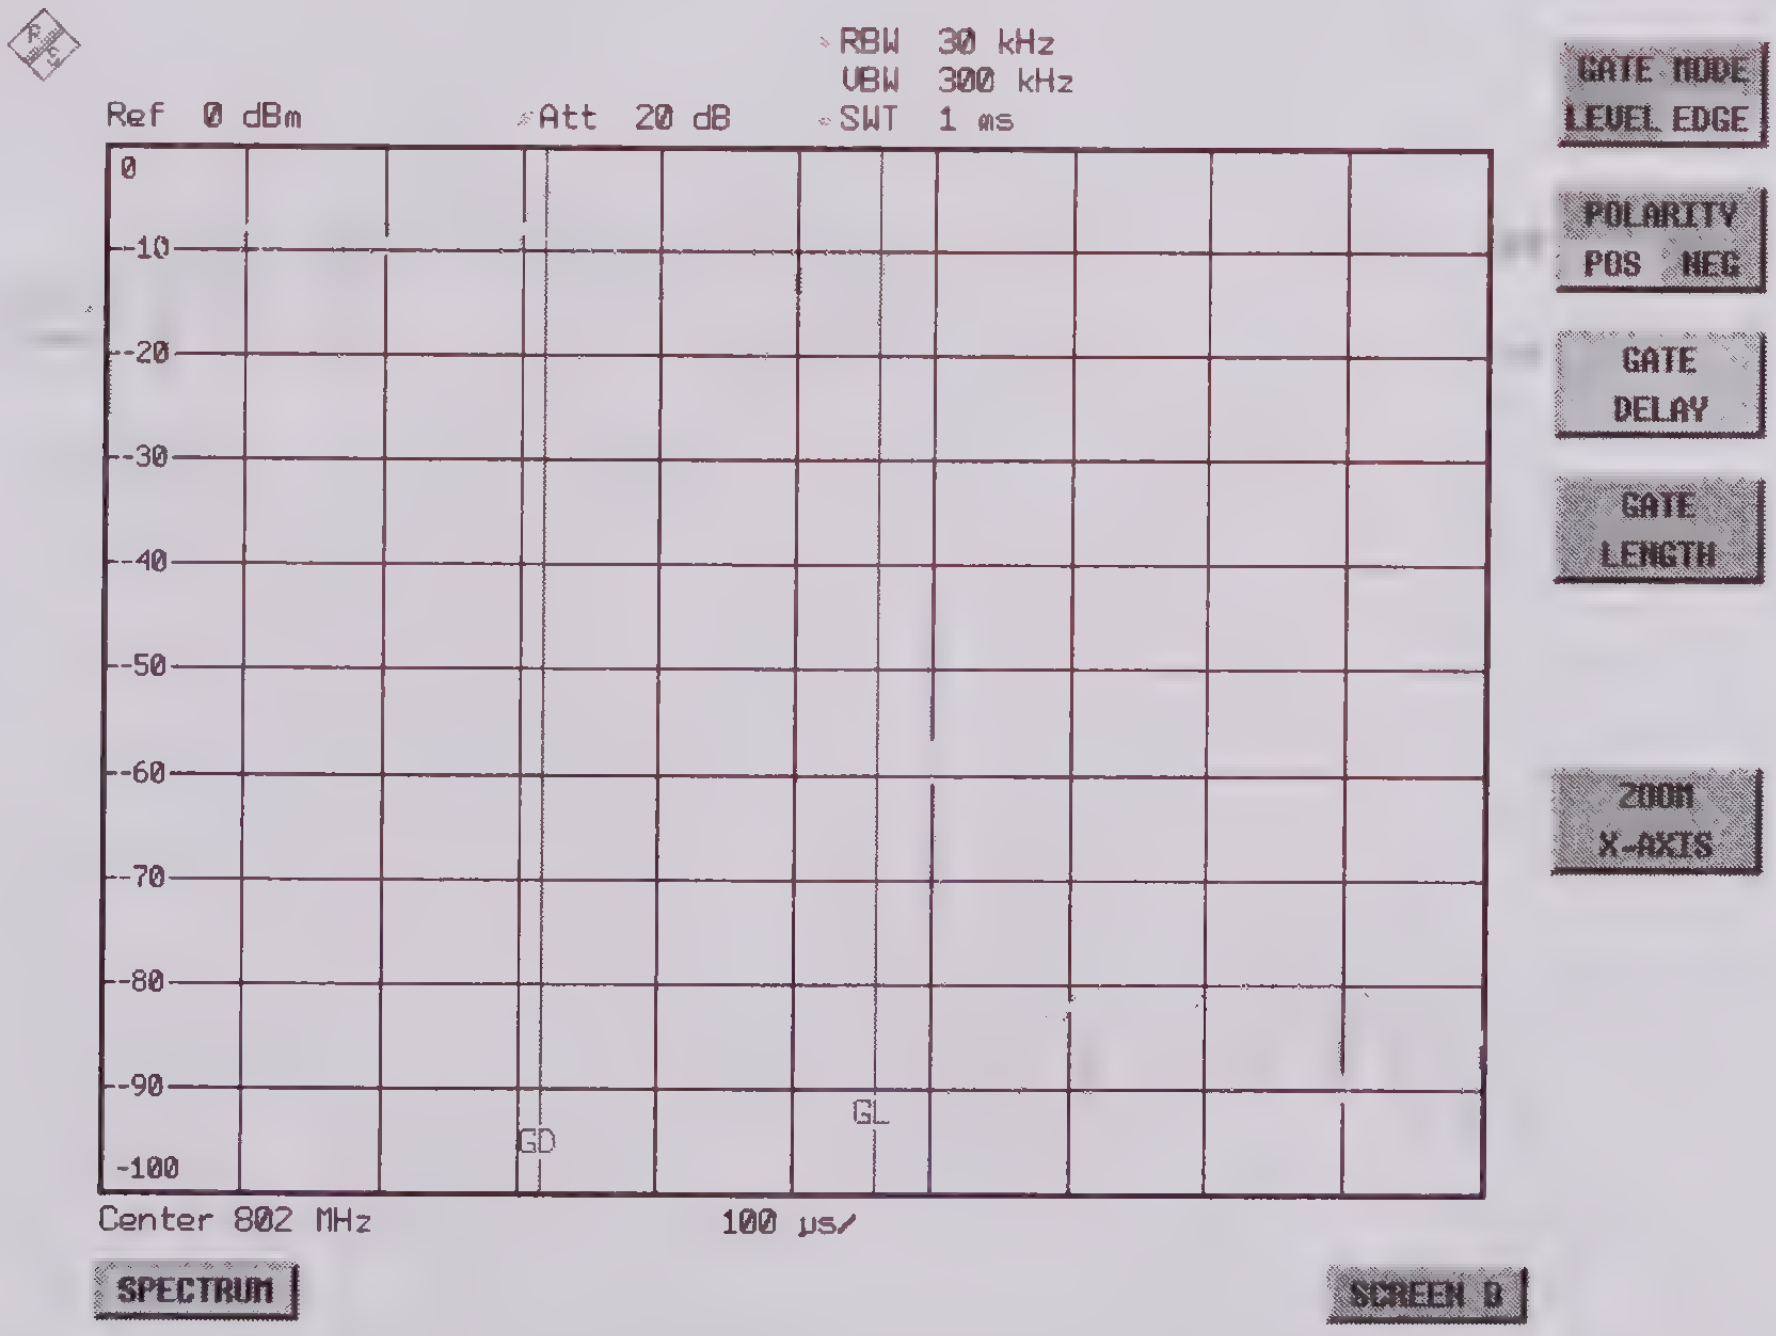

Fig.4.10-4 Setting GATE DELAY and GATE LENGTH in time domain by means of lines GD and GL

On quitting the *GATE SETTINGS* menu, R&S FSMR returns to the previous screen.

Menu TRIG - NEXT

DELAY COMP
ON OFF

The *DELAY COMP ON/OFF* softkey enables the filter group delay compensation for the external trigger. If a bursted signal is analyzed in zero span and the delay compensation is on, a change of the RBW will not change the rising slope of the signal.
Default is *OFF*.

IEC/IEEE-bus command: `TRIG:HOLD:ADJ:AUTO ON|OFF`

Selection and Setting of Traces – TRACE Key

The traces are selected using the *SELECT TRACE* softkey in the menu of the *TRACE* key.

The traces can individually be activated for a measurement or frozen after completion of a measurement. Traces that are not activated are blanked.

The display mode can be selected for each trace. Traces can be overwritten in each measurement (CLEAR/WRITE mode), averaged over several measurements (AVERAGE mode), or a maximum or minimum value can be determined from several measurements and displayed (MAX HOLD or MIN HOLD). Individual detectors can be selected for the various traces. The autopeak detector displays maximum and minimum values connected by a vertical line. The max peak detector and min peak detector display the maximum and minimum value of the level within a pixel. The sample detector displays the instantaneous value of the level at a pixel. The rms detector displays the power (rms value) of the measured values within a pixel, the average detector the average value.

Selection of Trace Function

The trace functions are subdivided as follows:

- Display mode of trace (CLEAR/WRITE, VIEW and BLANK)
- Evaluation of the trace as a whole (AVERAGE, MAX HOLD and MIN HOLD)
- Evaluation of individual pixels of a trace (AUTOPEAK, MAX PEAK, MIN PEAK, SAMPLE, RMS, AVERAGE and QUASIPEAK)

TRACE menu

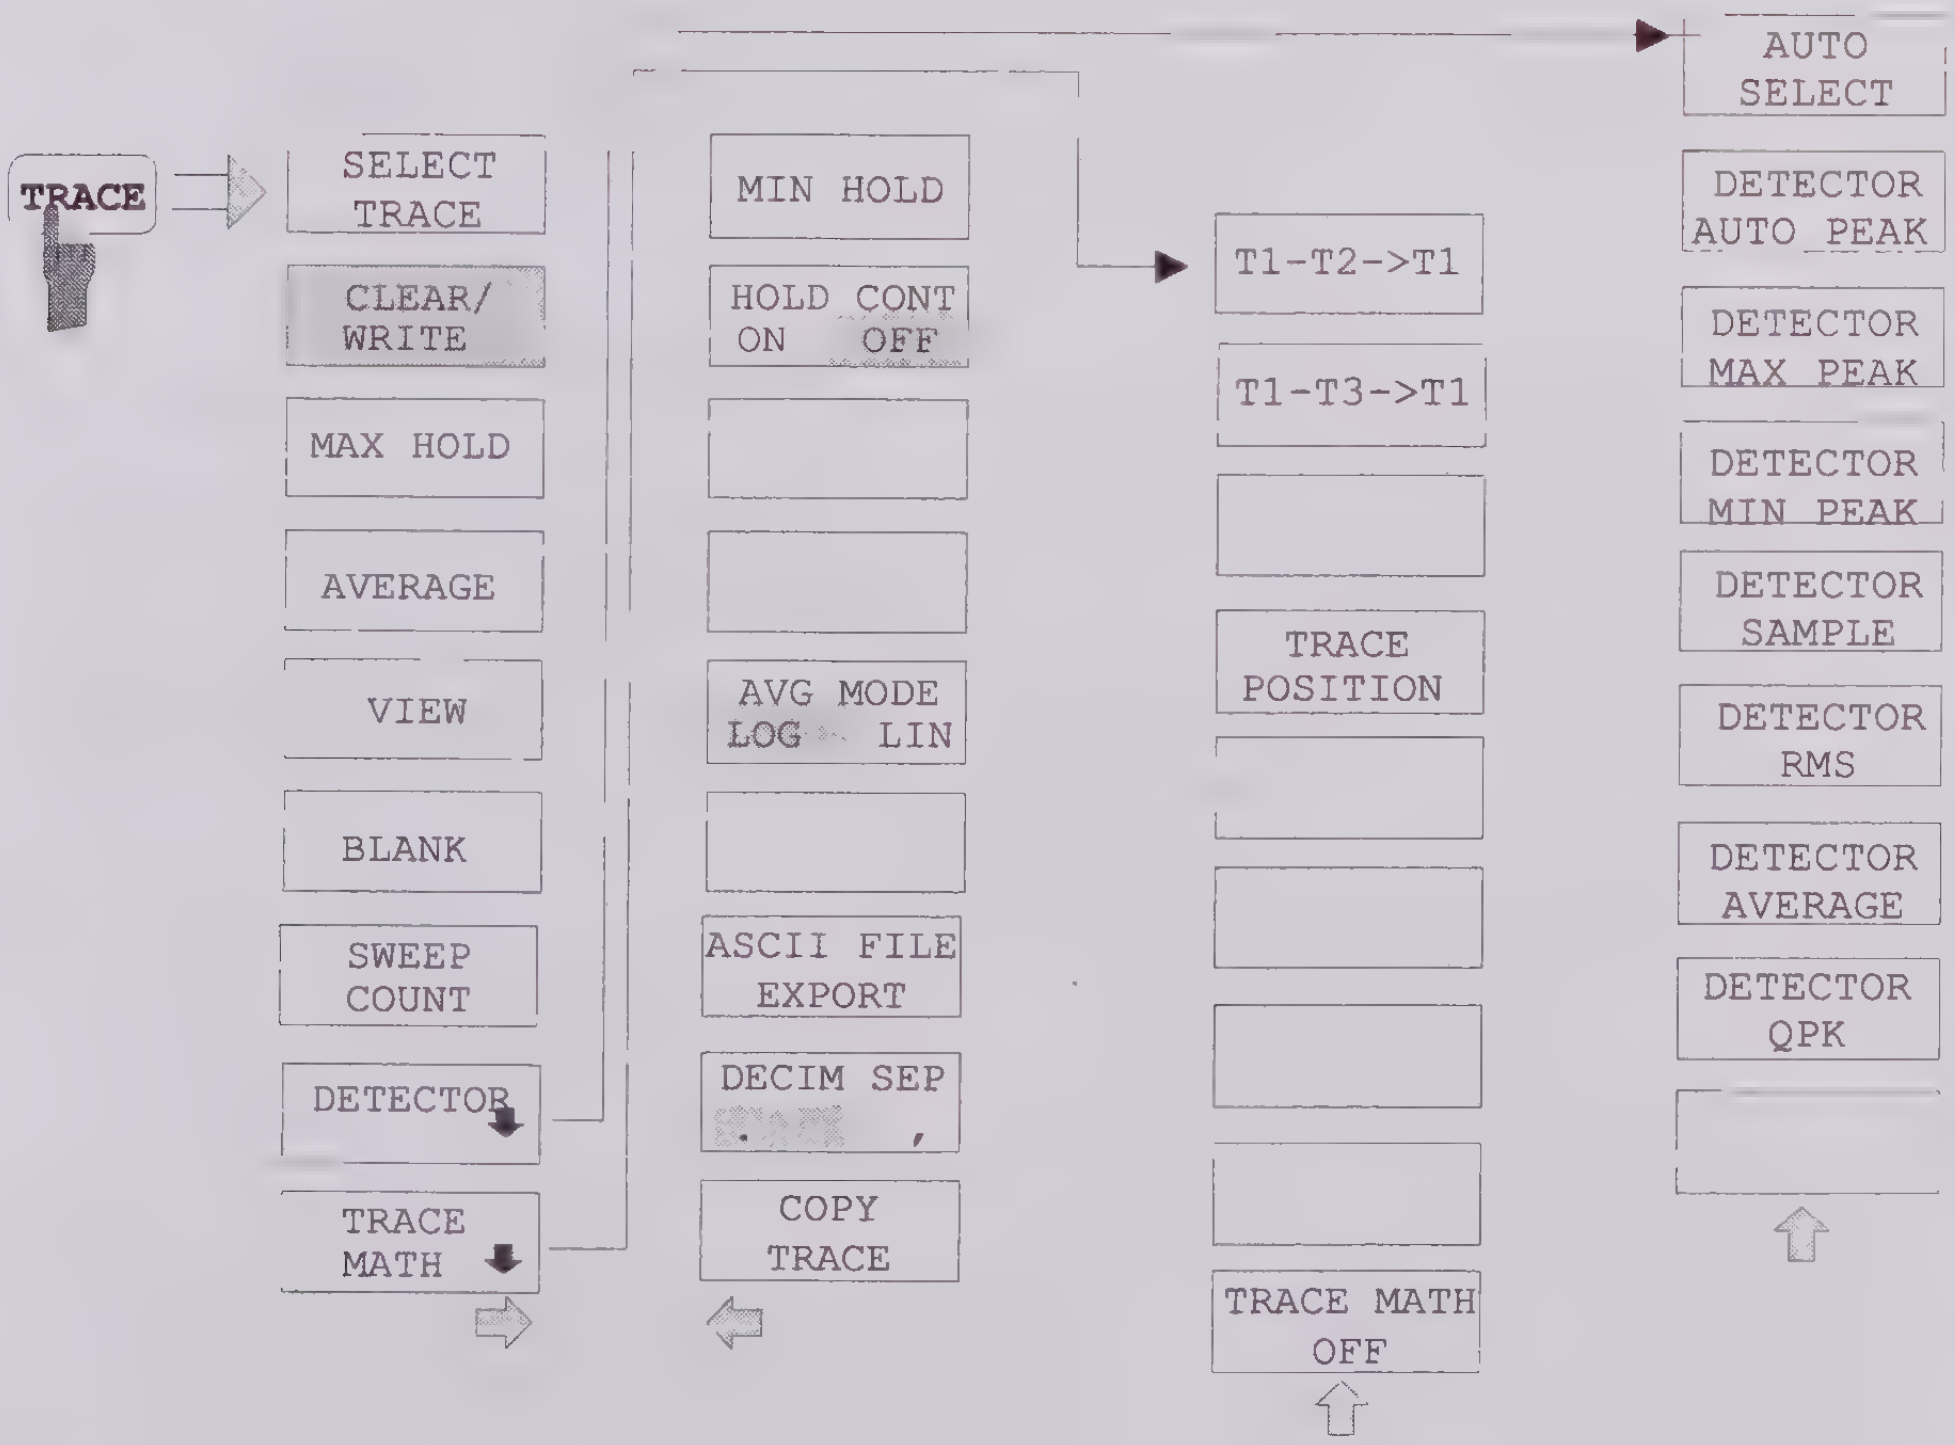

The *TRACE* key opens a menu offering the setting options for the selected trace.

Traces can be displayed, blanked and copied. Traces can also be corrected with the aid of mathematical functions.
The measurement detector for the individual display modes can be selected directly by the user or set automatically by R&S FSMR.

The default setting is trace 1 in the overwrite mode (*CLEAR / WRITE)*, the other traces 2 and 3 are switched off (*BLANK*).

The *CLEAR/WRITE, MAX HOLD, MIN HOLD, AVERAGE, VIEW* and *BLANK* softkeys are mutually exclusive selection keys.

The *SELECT TRACE* softkey activates the entry for the active trace (1, 2, 3).

IEC/IEEE-bus command -- (selected via numeric suffix of `:TRACe`)



The *CLEAR/WRITE* softkey activates the overwrite mode for the collected measured values, ie the trace is overwritten by each sweep.

In the *CLEAR/WRITE* display mode all the available detectors can be selected. In the default mode the autopeak detector (setting *AUTO*) is selected.

Each time the *CLEAR/WRITE* softkey is actuated, R&S FSMR clears the selected trace memory and starts the measurement anew.

IEC/IEEE-bus command `DISP:WIND:TRAC:MODE WRIT`

The *MAX HOLD* softkey activates the max peak detector.
R&S FSMR saves the sweep result in the trace memory only if the new value is greater than the previous one.

The detector is automatically set to *MAX PEAK*. The maximum value of a signal can thus be determined over several sweeps.

This is especially useful with modulated or impulsive signals. The signal spectrum is filled up upon each sweep until all signal components are detected in a kind of envelope.

Pressing the *MAX HOLD* softkey again clears the trace memory and restarts the max hold mode.

IEC/IEEE-bus command `DISP:WIND:TRAC:MODE MAXH`

AVERAGE

The *AVERAGE* softkey activates the trace averaging function. The average is formed over several sweeps. Averaging can be performed with any of the detectors available. If the detector is automatically selected by R&S FSMR, the sample detector is used.

Depending on the setting of AVG MODE LOG / LIN, the logarithmic level values or the measured power/voltage values are averaged.

Averaging is restarted every time the *AVERAGE* softkey is pressed. The trace memory is always cleared.

IEC/IEEE-bus command `DISP:WIND:TRAC:MODE AVER`

Description of averaging

Averaging is carried out over the pixels derived from the measurement samples. Several measured values may be combined in a pixel. This means that with linear level display the average is formed over linear amplitude values and with logarithmic level display over levels. For this reason the trace must be measured again when changing between *LIN* and *LOG* display mode. The settings *CONT/SINGLE SWEEP* and running averaging apply to the average display analogously.

There are two methods for calculating the average. For a sweep count = 0 , a running average is calculated according to the following formula:

$$\text{TRACE} = \frac{9 * \text{TRACE} + \text{meas. value}}{10}$$

Due to the weighting between the new measured value and the trace average, past values have practically no influence on the displayed trace after about ten sweeps. With this setting, signal noise is effectively reduced without need for restarting the averaging process after a change of the signal.

If the sweep count is >1, averaging takes place over the selected number of sweeps. In this case the displayed trace is determined during averaging according to the following formula:

$$\text{Trace}_n = \frac{1}{n}\left[\sum_{i=1}^{n-1}(T_i) + \text{meas. value}_n\right]$$

where n is the number of the current sweep (n = 2 ... SWEEP COUNT). No averaging is carried out for the first sweep but the measured value is stored in the trace memory. With increasing n, the displayed trace is increasingly smoothed since there are more single sweeps for averaging.

After the selected number of sweeps the average trace is saved in the trace memory. Until this number of sweeps is reached, a preliminary average is displayed.

After completion of averaging, ie when the averaging length defined by *SWEEP COUNT* is attained, a running averaging is continued with *CONTINUOUS SWEEP* according to the following formula:

$$\text{Trace} = \frac{(N-1)\cdot \text{Trace}_{\text{old}} + \text{meas. value}}{N}$$

where
Trace = new trace
$\text{Trace}_{\text{old}}$ = old trace
N = SWEEP COUNT

The display "Sweep N of N" does not change any more until a new start is triggered.

In the *SINGLE SWEEP* mode, the number of sweeps is triggered with *SWEEP START*. The sweeps are stopped when the selected number of sweeps is attained. The number of the current sweep and the total number of sweeps are shown on the display: "Sweep 3 of 200".

VIEW

The *VIEW* softkey freezes the current contents of the trace memory and displays it.

If a trace is frozen by *VIEW*, the instrument settings can be changed without the displayed trace being modified (exception: level display range and reference level, see below). The fact that the trace and the current instrument setting do not agree any more is indicated by an enhancement label "*" at the right edge of the grid.

If in the *VIEW* display mode the level display range (*RANGE*) or the reference level (*REF LEVEL*) are changed, R&S FSMR automatically adapts the measured data to the changed display range. This allows an amplitude zoom to be made after the measurement in order to show details of the trace.

IEC/IEEE-bus command `DISP:WIND:TRAC:MODE VIEW`

BLANK

The *BLANK* softkey activates the blanking of the trace on the screen.

IEC/IEEE-bus command `DISP:WIND:TRAC OFF`

SWEEP COUNT

The *SWEEP COUNT* softkey activates the entry of the number of sweeps used for averaging. The allowed range of values is 0 to 30000 and the following should be observed:

- Sweep Count = 0 means running averaging
- Sweep Count = 1 means no averaging being carried out
- Sweep Count > 1 means averaging over the selected number of sweeps; in the continuous sweep mode averaging is performed until the set number of sweeps is attained and is then continued as running averaging.

The default setting is running averaging (Sweep Count = 0). The number of sweeps used for averaging is the same for all active traces in the selected diagram.

Note: *The setting of the sweep count in the trace menu is equivalent to the setting in the sweep menu.*

IEC/IEEE-bus command `SWE:COUN 64`

DETECTOR

See following Section "Selection of Detector"

TRACE MATH

See following Section "Mathematical Functions for Traces"

TRACE - NEXT menu

The *MIN HOLD softkey* activates the min peak detector. R&S FSMR saves for each sweep the smallest of the previously stored/currently measured values in the trace memory. The detector is automatically set to *MIN PEAK*. In this way, the minimum value of a signal can be determined over several sweeps.

This function is useful eg for making an unmodulated carrier in a composite signal visible. Noise, interference signals or modulated signals are suppressed by the min hold function whereas a CW signal is recognized by its constant level.

Pressing the *MIN HOLD* softkey again clears the trace memory and restarts the min hold function.

IEC/IEEE-bus command `DISP:WIND:TRAC:MODE MINH`



The *HOLD CONT* softkey defines whether the traces in min hold and max hold mode are reset after some specific parameter changes.

OFF	The traces are reset after some definite parameter changes (default)
ON	This mechanism is switched off.

In general, parameter changes require a restart of the measurement before results are evaluated (e. g. with markers). For those changes that are known to require a new measurement (e. g. modification of the span), the trace is automatically reset.

This mechanism can be switched off for those exceptional cases where the described behavior is unwelcome.

IEC/IEEE-bus command
`:DISPlay[:WINDow<1|2>]:TRACe<1..4>:MODE:HCON ON|OFF`



The *AVG MODE LOG/LIN* softkey selects logarithmic or linear averaging for the logarithmic level display mode.

At the same time the difference calculation is switched between linear and logarithmic in submenu *TRACE MATH*.

IEC/IEEE-bus command `CALC:MATH:AVER:MODE LIN`

With logarithmic averaging, the dB values of the display voltage are averaged or substracted from each other with trace mathematical functions. With linear averaging the level values in dB are converted into linear voltages or powers prior to averaging. Voltage or power values are averaged or offset against each other and reconverted into level values.

For stationary signals the two methods yield the same result.

Logarithmic averaging bzw. Verrechnung is recommended if sinewave signals are to be clearly visible against noise since with this type of averaging noise suppression is improved while the sinewave signals remain unchanged.

For noise or pseudo-noise signals the positive peak amplitudes are decreased in logarithmic averaging due the characteristic involved and the negative peak values are increased relative to the average value. If the distorted amplitude distribution is averaged, a value is obtained that is smaller than the actual average value. The difference is -2.5 dB.

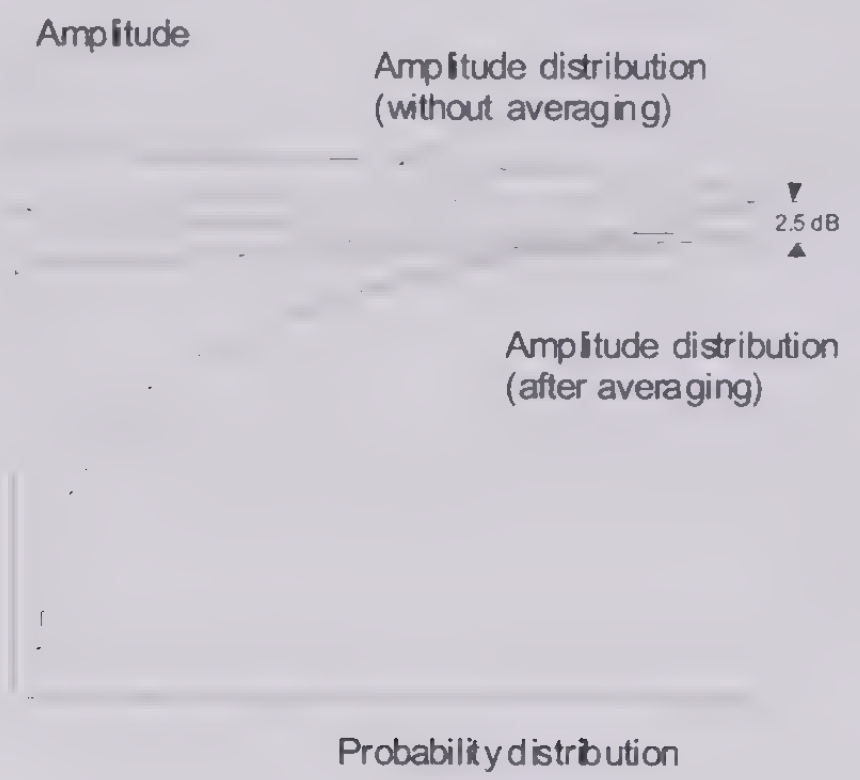

This low average value is usually corrected in noise power measurements by a 2.5 dB factor. Therefore the R&S FSMR offers the selection of linear averaging. The trace data are delogarithmized prior to averaging, then averaged and logarithmized again for display on the screen. The average value is always correctly displayed irrespective of the signal characteristic.

ASCII FILE EXPORT

The *ASCII FILE EXPORT* softkey stores the active trace in ASCII format on a floppy disk.

IEC/IEEE command

```
FORM ASC;
MMEM:STOR:TRAC 1,'TRACE.DAT'
```

The file consists of the header containing important scaling parameters and a data section containing the trace data.

The data of the file header consist of three columns, each separated by a semicolon:
parameter name; numeric value; basic unit

The data section starts with the keyword " Trace <n> " (<n> = number of stored trace), followed by the measured data in one or several columns (depending on measurement) which are also separated by a semicolon.
This format can be read in from spreadsheet calculation programs, eg MS-Excel. It is necessary to define ';' as a separator.

Note: *Different language versions of evaluation programs may require a different handling of the decimal point. It is therefore possible to select between separators '.' (decimal point) and ',' (comma) using softkey DECIM SEP.*

Example:

	File contents	Description
File header	Type;R&S FSMR3;	Instrument model
	Version;1.00;	Firmware version
	Date;01.Jul 1999;	Date of data set storage
	Mode;Spectrum;	Instrument mode
	Center Freq;55000;Hz	Center frequency
	Freq Offset;0;Hz	Frequency offset
	Span;90000;Hz	Frequency range (0 Hz with zero span and statistics measurements)
	x-Axis;LIN;	Scaling of x axis linear (LIN) or logarithmic (LOG)
	Start;10000;Hz Stop;100000;Hz	Start/stop of the display range. Unit: Hz for span > 0, s for span = 0, dBm/dB for statistics measurements
	Ref.Level;-30;dBm	Reference level
	Level Offset;0;dB	Level offset
	Ref Position;75;%	Position of reference level referred to diagram limits (0% = lower edge)
	y-Axis;LOG;	Scaling of y axis linear (LIN) or logarithmic (LOG)
	Level Range;100;dB	Display range in in y direction. Unit: dB with x axis LOG, % with x axis LIN
	RF Att;20;dB	Input attenuation
	RBW;100000;Hz	Resolution bandwidth
	VBW;30000;Hz	Video bandwidth
	SWT;0.005;s	Sweep time
	Trace Mode;AVERAGE;	Display mode of trace: CLR/WRITE,AVERAGE,MAXHOLD,MINHOLD
	Detector;SAMPLE;	Detector set: AUTOPEAK,MAXPEAK,MINPEAK,AVERAGE, RMS,SAMPLE,QUASIPEAK
	Sweep Count;20;	Number of sweeps set
Data section of the file	Trace 1:;;	Selected trace
	x-Unit;Hz;	Unit of x values: Hz with span > 0; s with span = 0; dBm/dB with statistics measurements
	y-Unit;dBm;	Unit of y values: dB*/V/A/W depending on the selected unit with y axis LOG or % with y axis LIN
	Values; 625;	Number of test points
	10000;-10.3;-15.7 10180;-11.5;-16.9 10360;-12.0;-17.4 ...;...;	Measured values: <x value>, <y1>, <y2> <y2> being available only with detector AUTOPEAK and containing in this case the smallest of the two measured values for a test point.



The *DECIM SEP* softkey selects the decimal separator between '.' (decimal point) and ',' (comma) with floating-point numerals for the function ASCII FILE EXPORT.
With the selection of the decimal separator different language versions of evaluation programs (eg MS-Excel) can be supported.

IEC/IEEE-bus command `FORM:DEXP:DSEP POIN`

The *COPY TRACE* softkey copies the screen contents of the current trace into another trace memory. The desired memory is selected by entering the number 1, 2 or 3.

Upon copying, the contents of the selected memory is overwritten and the new contents displayed in view mode.

IEC/IEEE-bus command `TRAC:COPY TRACE1,TRACE2`

Selection of Detector

The detectors of the R&S FSMR are implemented as pure digital devices. The detectors available are the peak detectors which determine the maximum and/or the minimum value from a number of samples, the rms detector which measures the power within a pixel, the average, the quasipeak and the sample detector. The sample detector routes through the sampled data without any modification or performs a data reduction by suppressing measured values that cannot be displayed.
The peak detectors compare the current level value with the maximum or minimum level from the previously sampled data. When the number of samples defined by the instrument setting is reached, the samples are combined in displayable pixels. Each of the 625 pixels of the display thus represents 1/625 of the sweep range and contains all single measurements (frequency samples) in this subrange in compressed form. For each trace display mode an optimized detector is selected automatically. Since peak detectors and sample detector are connected in parallel, a single sweep is sufficient for collecting all detector values for 3 traces.

Peak detectors (*MAX PEAK* and *MIN PEAK*)	Peak detectors are implemented by digital comparators. They determine the largest of all positive (max peak) or the smallest of all negative (min peak) peak values of the levels measured at the individual frequencies which are displayed in one of the 625 pixels. This procedure is repeated for each pixel so that for wide frequency spans and despite the limited resolution of the display a large number of measurements can be taken into consideration for the display of the spectrum.
Autopeak detector	The *AUTOPEAK* detector combines the two peak detectors. The max peak detector and the min peak detector simultaneously determine the maximum and the minimum level within a displayed testpoint and display it as a single measured value. The maximum and minimum levels within a frequency point are connected by a vertical line.
Sample detector	The *SAMPLE* detector routes through the sampled data without any further evaluation and either displays them directly or, for reasons of speed in case of short sweep times, first writes them into a memory and processes them subsequently. There is no data reduction, ie no summing up of measured values of neighbouring frequencies or time samples. If during a frequency sweep more measured values are obtained than can be displayed, measured values will be lost. This means that discrete signals might be lost. The sample detector therefore can only be recommended for a span-to-resolution bandwidth ratio of up to approx. 250 in order to ensure that no signal will be suppressed (example: span 1 MHz, -> min. bandwidth 5 kHz).

RMS detector	The RMS detector forms the rms value of the measured values within a pixel. To this effect, R&S FSMR uses the linear voltage after envelope detection. The sampled linear values are squared, summed and the sum is divided by the number of samples (= root mean square). For logarithmic display the logarithm is formed from the square sum. For linear display the root mean square value is displayed. Each pixel thus corresponds to the power of the measured values summed up in the pixel. The rms detector supplies the power of the signal irrespective of the waveform (CW carrier, modulated carrier, white noise or impulsive signal). Correction factors as needed for other detectors for measuring the power of the different signal classes are not required.
Average detector	The average detector forms the average value of the measured values within a pixel. To this effect, R&S FSMR uses the linear voltage after envelope detection. The sampled linear values are summed up and the sum is divided by the number of samples (= linear average value). For logarithmic display the logarithm is formed from the average value. For linear display the average value is displayed. Each pixel thus corresponds to the average of the measured values summed up in the pixel. The average detector supplies the average value of the signal irrespective of the waveform (CW carrier, modulated carrier, white noise or impulsive signal).
Quasipeak detector	The quasipeak detector similates the behaviour of an analog voltmeter by evaluating the measured values in a pixel. The quasipeak detector is especially designed for the requirements of EMC measurements and is used for evaluating pulse-shaped spurious.

Note: *During a frequency sweep, R&S FSMR increments the 1st local oscillator in steps that are smaller than approximately 1/10 of the bandwidth. This is to ensure that the signal level is correctly measured. For narrow bandwidths and wide frequency spans a very large number of measured values is thus obtained. The number of frequency steps, however, always is a multiple of 625 (= number of pixels that can be displayed). With the sample detector selected, only every n^th^ value is displayed. The value of n depends on the number of measured values, ie on the frequency span, the resolution bandwidth and the measurement rate.*

TRACE-DETECTOR submenu

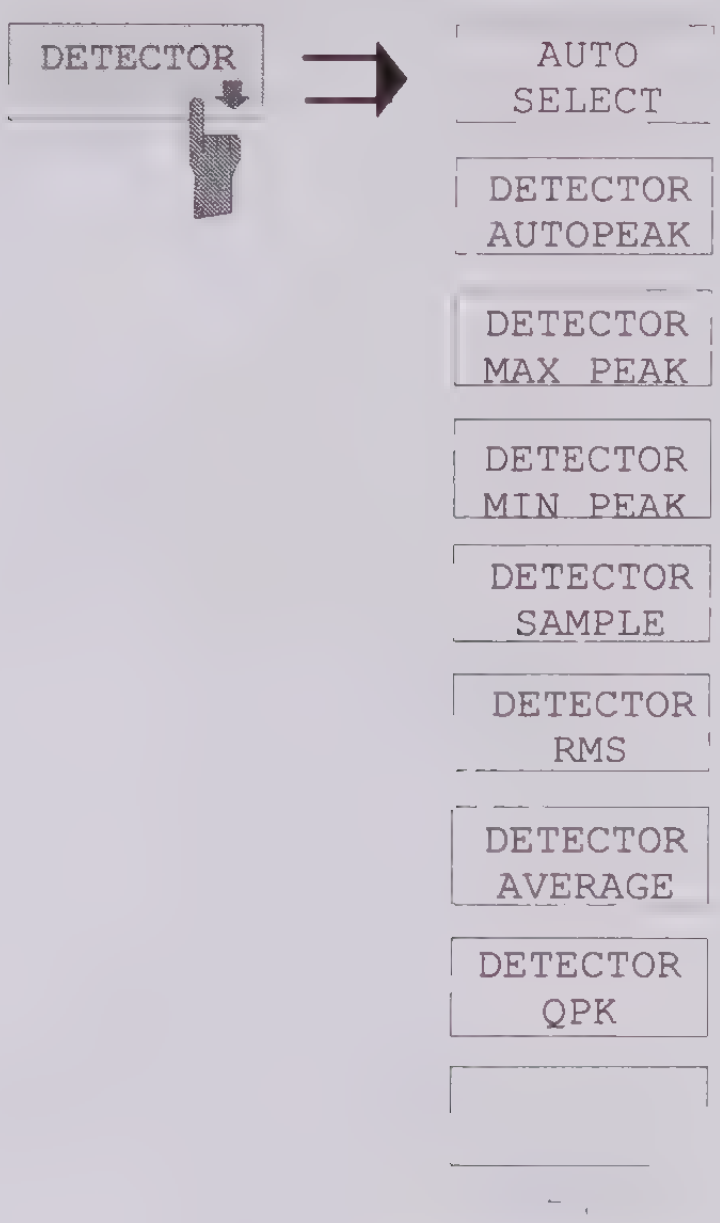

The *DETECTOR* softkey opens a submenu for selecting the detector for the selected trace. The softkey is highlighted if the detector is not selected with *AUTO SELECT*.

The detector can be selected independently for each trace. The *AUTO SELECT* mode selects the optimum detector for each display mode of the trace (Clear/Write, Max Hold or Min Hold).

The softkeys for the detectors are mutually exclusive selection keys.

The *AUTO SELECT* softkey (= default setting) selects the optimum detector for the set display mode of the trace (Clear/Write, Max Hold and Min Hold) and the selected filter mode (bandpass/FFT).

Trace display	**Detector (bandpass)**	**Detector (FFT)**
Clear/Write	Auto Peak	Max Peak
Average	Sample	Sample
Max Hold	Max Peak	Max Peak
Min Hold	Min Peak	Max Peak

The detector activated for the specific trace is identified in the respective trace display field as follows:

Detector	
Auto Peak	AP
Max Peak	PK
Min Peak	MI
Average	AV
RMS	RM
Sample	SA
Quasipeak	QP

IEC/IEEE-bus command `DET:AUTO ON`

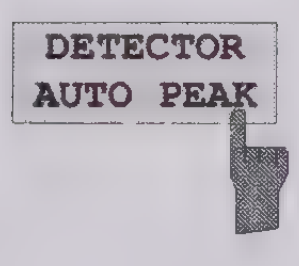

The *DETECTOR AUTOPEAK* softkey activates the autopeak detector.

IEC/IEEE-bus command `DET APE`

DETECTOR MAX PEAK

The *DETECTOR MAX PEAK softkey* activates the max peak detector. It is recommended for measurement of impulsive signals.

IEC/IEEE-bus command `DET POS`

DETECTOR MIN PEAK

The *DETECTOR MIN PEAK* softkey activates the min peak detector. Weak sinewave signals become clearly visible in noise using this detector. In case of a composite signal made up of sinewave and impulsive signals, the impulsive signals are suppressed.

IEC/IEEE-bus command `DET NEG`

DETECTOR SAMPLE

The *DETECTOR SAMPLE* softkey activates the sample detector.

It is used for measuring uncorrelated signals such as noise. The power can be determined with the aid of fixed correction factors for evaluation and the logarithmic function.

IEC/IEEE-bus command `DET SAMP`

DETECTOR RMS

The *DETECTOR RMS* softkey activates the rms detector.

The rms detector supplies the power of the signal independent of the waveform. For this effect the root mean square of all sampled level values is formed during the sweep of a pixel. The sweep time thus determines the number of averaged values and with increasing sweep time better averaging is obtained. The rms detector is thus an alternative for averaging over several sweeps (see TRACE AVERAGE).

Since the video bandwidth must be at least 10 times the resolution bandwidth (RBW) to ensure that video filtering does not invalidate the rms values of the signal, this ratio is set automatically upon activating the detector.

IEC/IEEE-bus command `DET RMS`

DETECTOR AVERAGE

The *DETECTOR AVERAGE* softkey activates the average detector.

In contrast to the rms detector, the average detector supplies the linear average of all sampled level values during the sweep of a pixel.
The same relations as for the rms detector apply (see above).

IEC/IEEE-bus command `DET AVER`

DETECTOR QPK

The *DETECTOR QPK* softkey activates the quasipeak detector.

This detector evaluates the sampled level values during the sweep of a pixel like an analog voltmeter.
On switching the quasipeak detector on the video bandwidth is automatically set to 10 MHz so as to exclude the influence of the video filter on the signal evaluation.

IEC/IEEE-bus command `DET QPE`

Mathematical Functions for Traces

TRACE 1-TRACE MATH submenu:

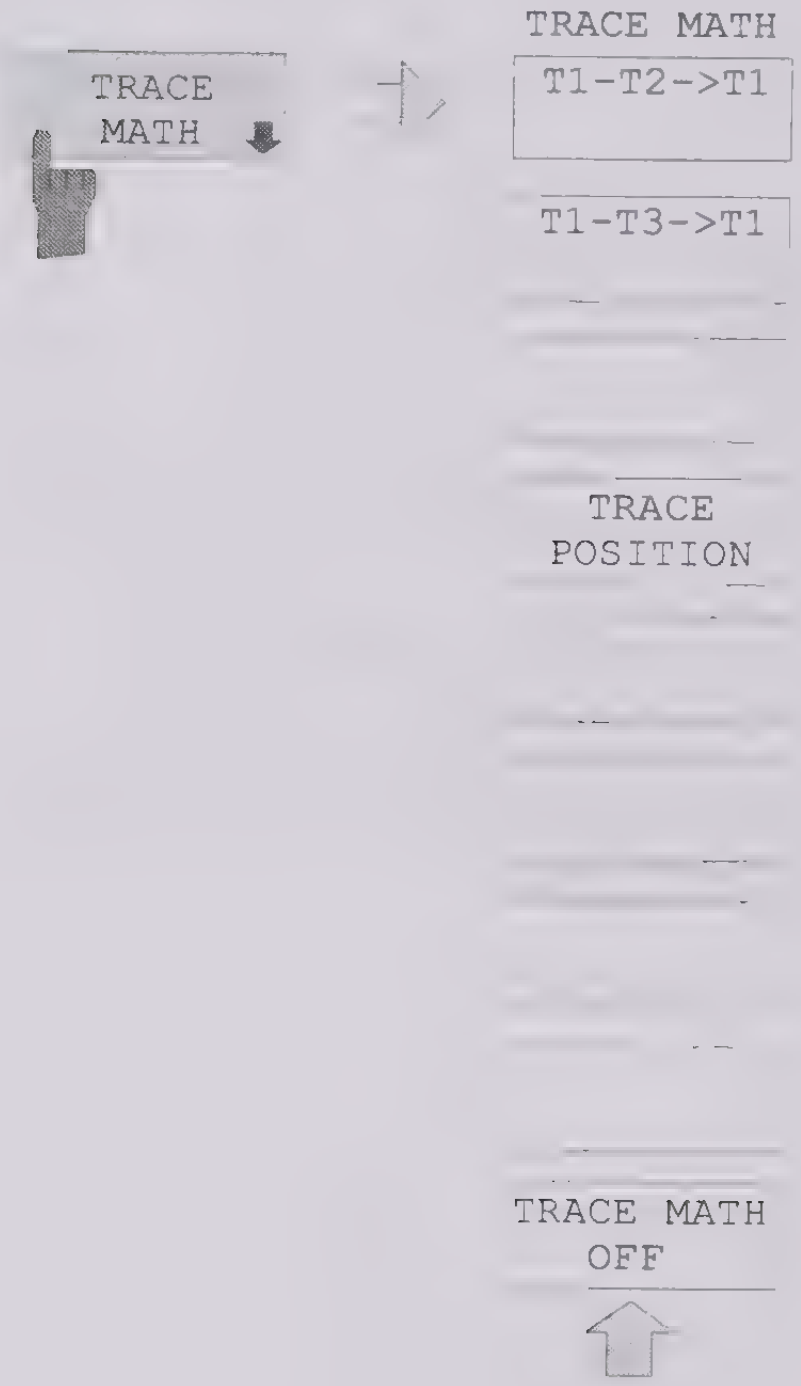

The *TRACE MATH* softkey opens a submenu in which the difference between the selected trace to trace 1 is calculated. The softkey is highlighted if a math function is activated.

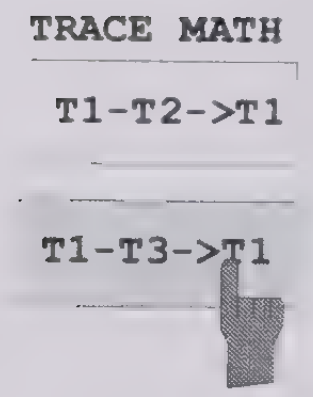

The *T1-T2* and *T1-T3* softkeys subtract the corresponding traces. The result displayed is referred to the zero point defined by *TRACE POSITION*.

To indicate that the trace has been obtained by subtraction, the difference "1 - 2" or "1 - 3" is indicated on the trace info of trace 1 and in the *TRACE* main menu the *TRACE MATH* softkey is highlighted.

IEC/IEEE-bus command `CALC:MATH (TRACE1-TRACE2)`
`CALC:MATH (TRACE1-TRACE3)`

The *TRACE POSITION* softkey activates the entry of the trace position for 0 difference. The position is stated in % of the diagram height.
The range of values extends from -100% to +200%

IEC/IEEE-bus command `DISP:MATH:POS 50PCT`



The *TRACE MATH OFF* softkey switches the math function off.

IEC/IEEE-bus command `CALC:MATH:STAT OFF`

Recording the Correction Data of R&S FSMR – *CAL* Key

The R&S FSMR obtains its high measurement accuracy through its inbuitl self-alignment method.

The correction data and characteristics required for the alignment are determined by comparison of the results at different settings with the known characteristics of the high-precision calibration signal source of R&S FSMR at 128 MHz. The correction data are then available in the instrument as a file and can be displayed by means of the *CAL RESULTS* softkey.
For service purposes the use of correction data can be deactivated by means of the *CAL CORR ON/OFF* softkey. If the correction data recording is aborted, the last complete correction data set is restored.

Note: *The term "Calibration" formerly used for the integrated self alignment was often mistaken for the "true" calibration of the instrument at the test set in production and in service. It is therefore no longer used although it appears in the abbreviated form in the name of keys ("CAL...").*

CAL menu:

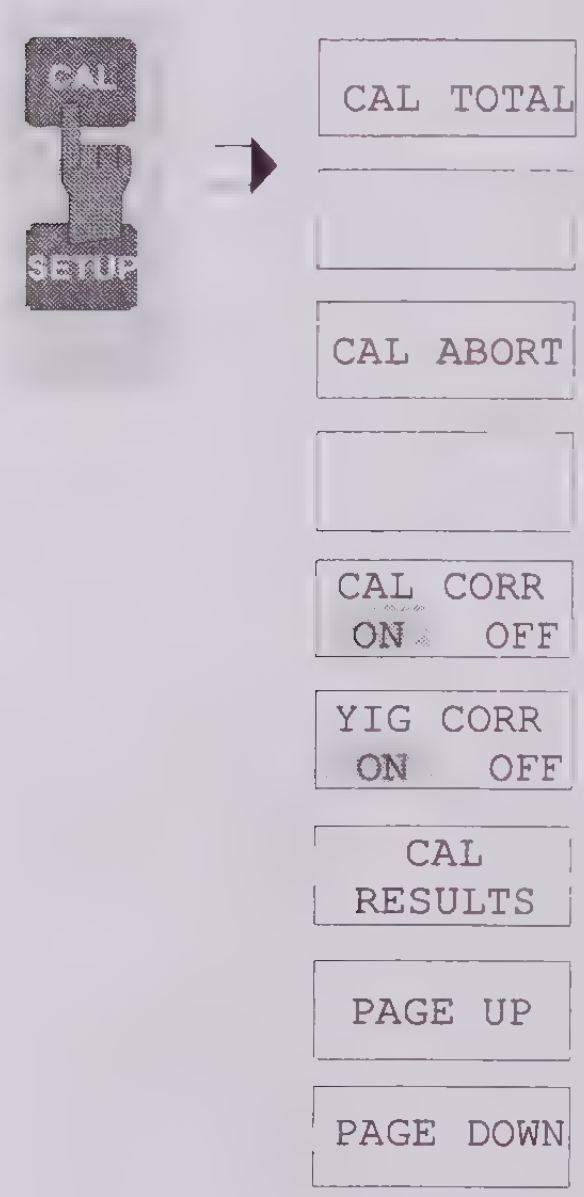

The *CAL* key opens a menu with the available functions for recording, displaying and activating the data for self alignment.

Note: *The YIG CORR ON/OFF softkey is available only on model R&S R&S FSMR 26 and higher.*



The *CAL TOTAL* softkey starts the recording of correction data of the instrument.

If the correction data recording has failed or if the correction values are deactivated (*CAL CORR = OFF* softkey), the status field indicates

UNCAL.

IEC/IEEE-bus command: `*CAL?`

The *CAL ABORT* softkey interrupts the recording of correction data and restores the last complete correction data set.

IEC/IEEE-bus command: `CAL:ABOR`

The *CAL CORR ON/OFF* softkey switches the calibration data on/off.

ON	The status message depends upon the results of the total calibration.
OFF	The message *UNCAL* appears in the status line.

IEC/IEEE-bus command: `CAL:STAT ON`

The *YIG CORR ON/OFF* softkey switches on or off the automatic, cyclic correction of the temperature-dependent frequency drift of the YIG filter.

When switched to ON (default setting), it is checked once per minute whether a frequency correction for the YIG filter is required. Frequency correction is performed if the temperature has changed by more than 5K relative to the last instance of correction.

Note: *If the instrument is operated in a temperature-controlled environment, the cyclic frequency drift correction can – for time-critical applications – be switched off after an operating period of ≥ 30 minutes.*
*This function is available only on model R&S R&S FSMR*8 *and higher.*

IEC/IEEE-bus command:

```
:[SENSe<1|2>:]CORRection:YIG:TEMPerature:AUTO ON | OFF
```

CAL RESULTS

The *CAL RESULTS* softkey calls the *CALIBRATION RESULTS* table, which shows the correction data found during calibration.

The *CALIBRATION RESULTS* table contains the following information:

- date and time of last record of correction valuesKorrekturwertaufnahme
- overall results of correction value record
- list of found correction values according to function/module

The results have the following meaning:

PASSED	calibration successful without any restrictions
CHECK	deviation of correction value larger than expected, correction could however be performed
FAILED	deviations of correction value too large, no correction was possible. The found correction data are not valid.
ABORTED	calibration aborted

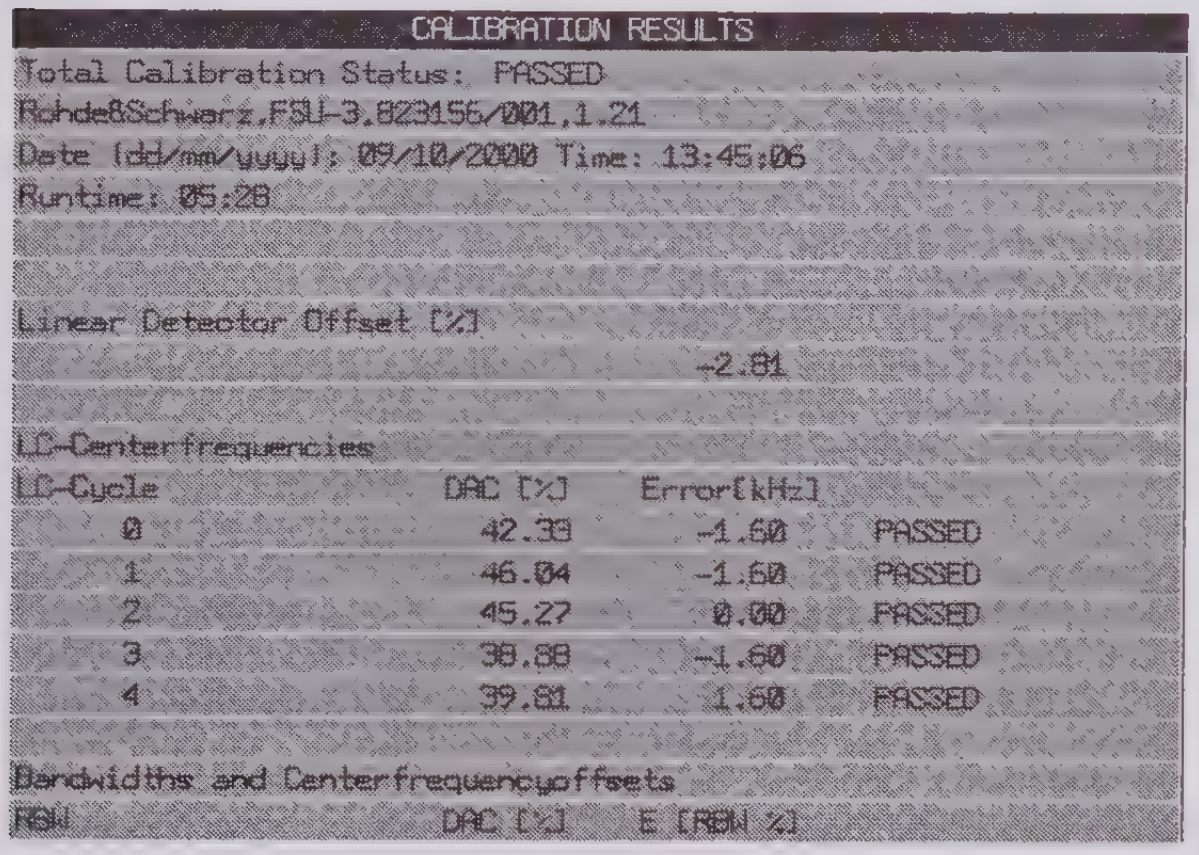

```
                    CALIBRATION RESULTS
Total Calibration Status:  PASSED
Rohde&Schwarz,FSU-3,823156/001,1.21
Date (dd/mm/yyyy): 09/10/2000 Time: 13:45:06
Runtime: 05:28


Linear Detector Offset [%]
                                        -2.81

LC-Centerfrequencies
LC-Cycle                   DAC [%]    Error[kHz]
      0                      42.33        -1.60    PASSED
      1                      46.04        -1.60    PASSED
      2                      45.27         0.00    PASSED
      3                      38.88        -1.60    PASSED
      4                      39.81         1.60    PASSED

Bandwidths and Centerfrequencyoffsets
RBW                        DAC [%]     E [RBW %]
```

IEC/IEEE-bus command: `CAL:RES?`

PAGE UP

PAGE DOWN

The softkeys *PAGE UP* and *PAGE DOWN* scroll one page forward or backward in the *CALIBRATION RESULTS* table. They have no function when the table is closed.

IEC/IEEE-bus command: --

Markers and Delta Markers – MKR Key

The markers are used for marking points on traces, reading out measurement results and for quickly selecting a display section. R&S FSMR provides four markers per display window. All markers can be used either as markers or delta markers. The availability of marker functions depends on whether the measurement is performed in the frequency, time or level domain.
The marker that can be moved by the user is defined in the following as the **active marker**.
Examples of marker display:

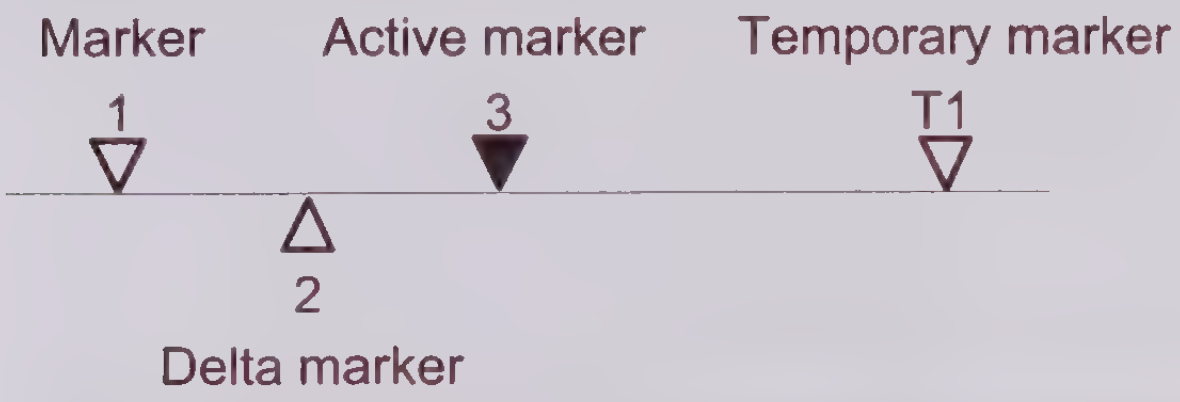

Temporary markers are used in addition to the markers and delta markers to evaluate the measurement results. They disappear when the associated function is deactivated.
The measurement results of the active marker (also called **marker values**) are displayed in the marker field. The marker info field at the upper right of the display shows the marker location (here, frequency), the level and the currently selected trace [T1].



```
MARKER 1   [T1]
 -27.5 dBm
123.4567 MHz
```

The *MKR* key calls a menu that contains all marker and delta marker standard functions. If no marker is active, *MARKER 1* will be enabled and a peak search on the trace carried out. Otherwise, the data entry for the marker activated last is opened.

MKR menu:

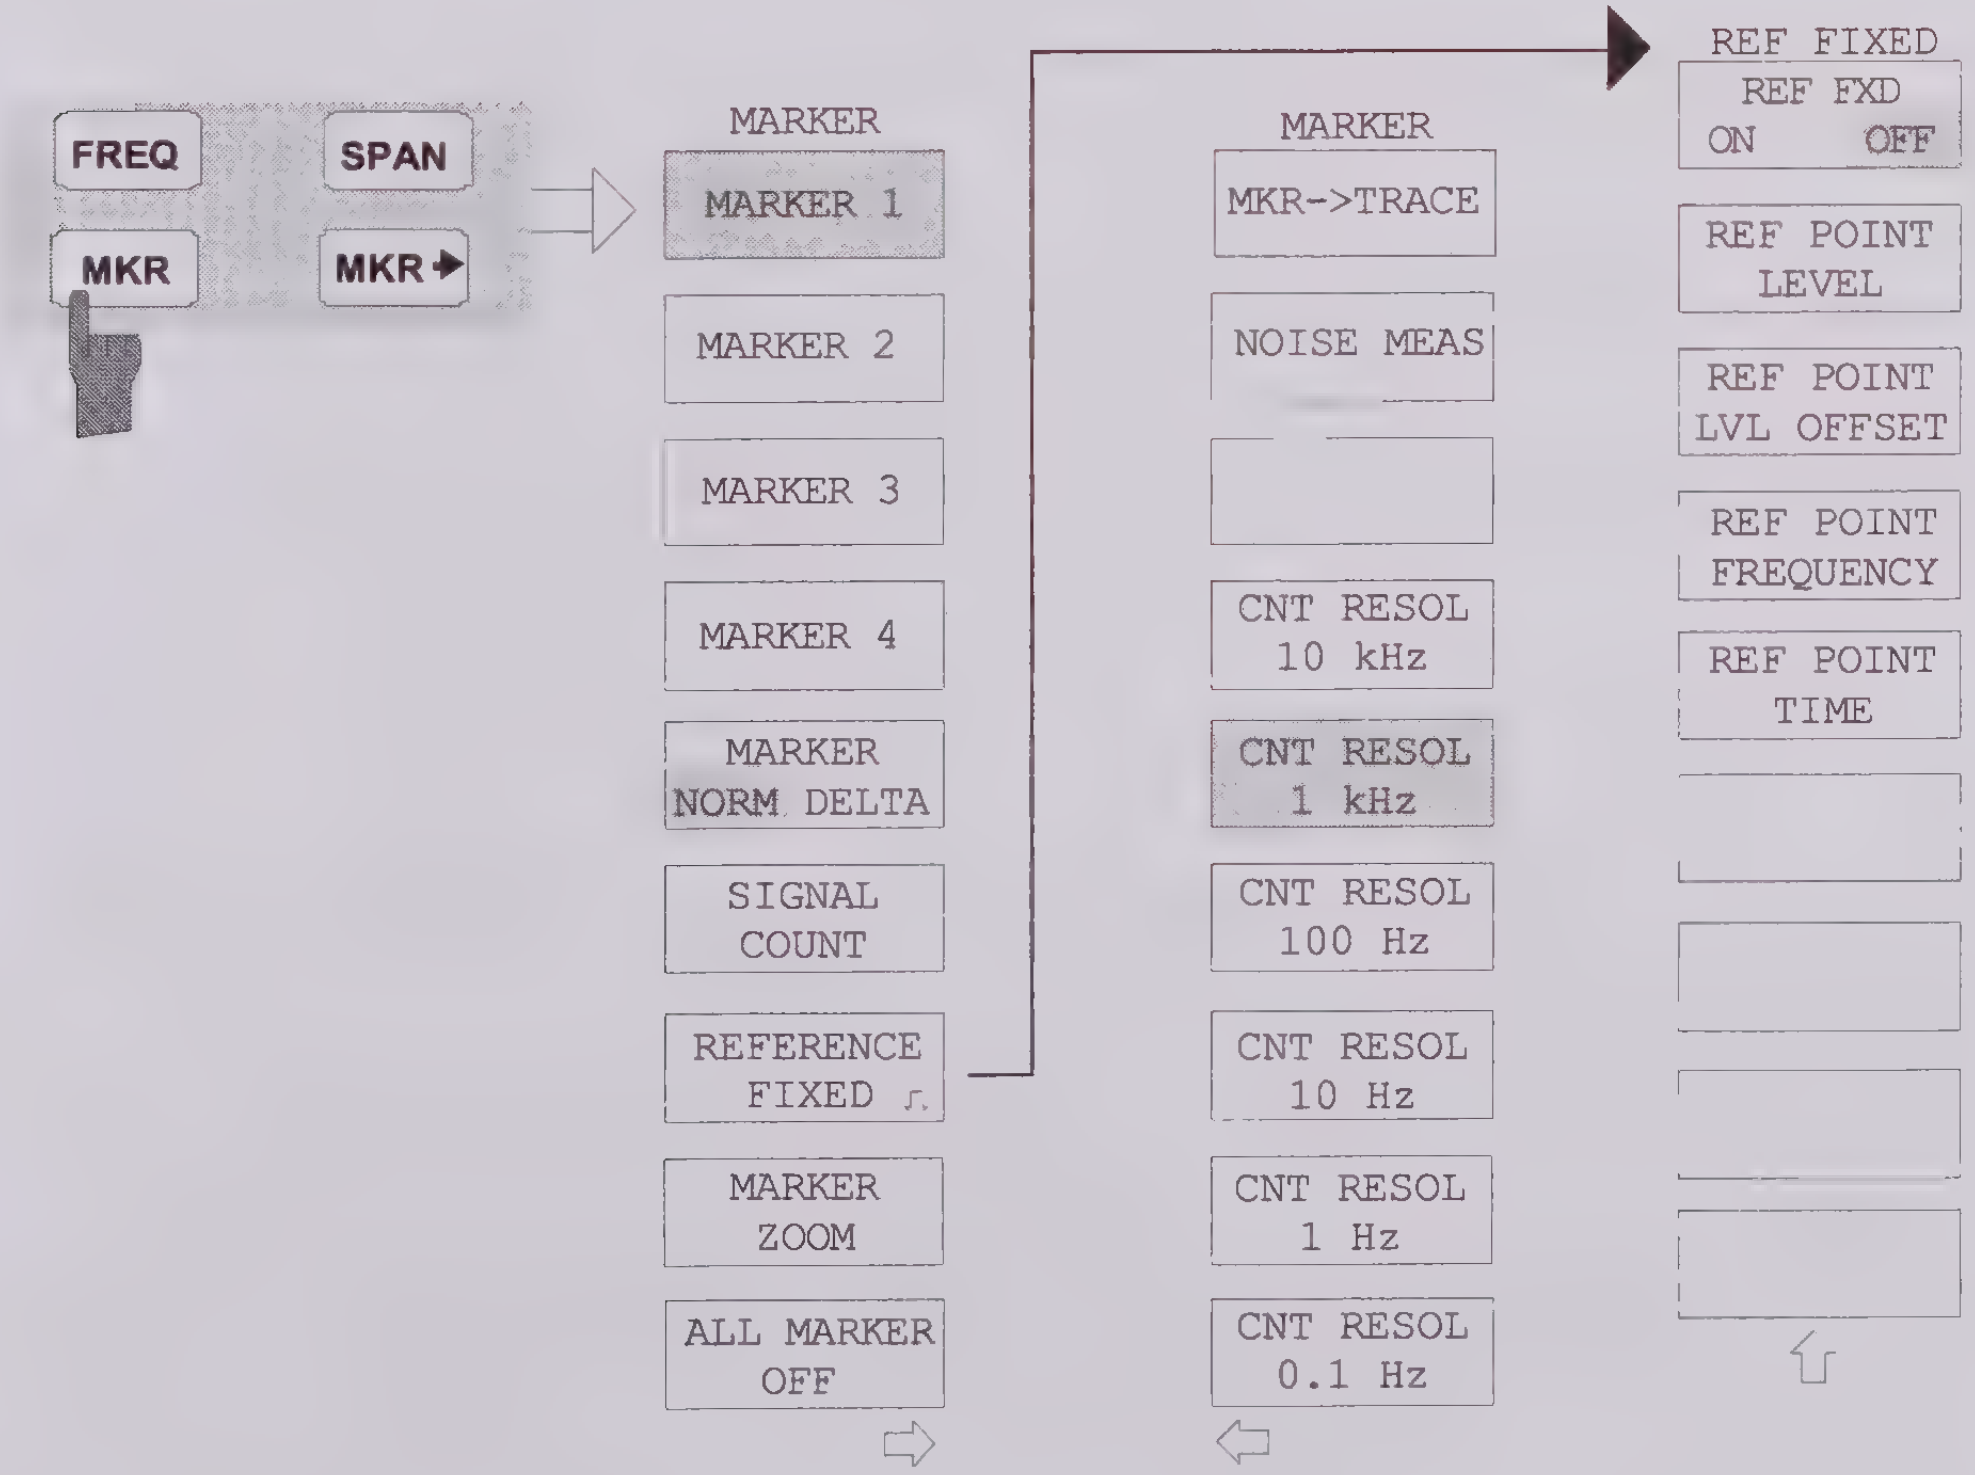

MARKER 1
:
MARKER 4

MARKER NORM DELTA

The *MARKER 1/2/3/4* .softkey selects the corresponding marker and activates it.

MARKER 1 is always the normal marker. After they have been switched on, *MARKERS 2 to 4* are delta markers that refer to *MARKER 1*. These markers can be converted into markers with absolute value display by means of the *MARKER NORM DELTA* softkey. When *MARKER 1* is the active marker, pressing the *MARKER NORM DELTA* softkey switches on an additional delta marker.

Pressing the *MARKER 1 to 4* softkey again switches off the selected marker.

Example:

[**PRESET**]	R&S FSMR is set to the default setting.
[**MKR**]	On calling the menu, *MARKER 1* is switched on ('1' highlighted in the softkey) and positioned on the maximum value of the trace. It is a normal marker and the *MARKER NORMAL* softkey is highlighted.
[*MARKER 2*]	*MARKER 2* is switched on ('2' highlighted in the softkey). It is automatically defined as a delta marker on switching on so the *DELTA* is is highlighted on softkey *MARKER NORM DELTA*. The frequency and level of *MARKER 2* with reference to *MARKER 1* are output in the marker info field.
[MARKER NORM DELTA]	The *MARKER NORM DELTA* softkey is highlighted. *MARKER 2* becomes a normal marker. The frequency and level of *MARKER 2* are output as absolute values in the marker info field.
[MARKER 2]	*MARKER 2* is switched off. *MARKER 1* is the active marker for entry. The frequency and level of *MARKER 1* are output in the marker info field.

IEC/IEEE-bus command:

```
CALC:MARK ON;
CALC:MARK:X <value>;
CALC:MARK:Y?

CALC:DELT ON;
CALC:DELT:MODE ABS|REL
CALC:DELT:X <value>;
CALC:DELT:X:REL?
CALC:DELT:Y?
```

When several traces are being displayed, the marker is set to the maximum value (peak) of the active trace which has the lowest number (1 to 3). In case a marker is already located there, it will be set to the frequency of the next lowest level (next peak).

When the split-screen display mode is active, the marker will be placed in the active window. A marker can only be enabled when at least one trace in the corresponding window is visible.

If a trace is turned off, the corresponding markers and marker functions are also deactivated. If the trace is switched on again (*VIEW*, *CLR/WRITE*;..), the markers along with coupled functions will be restored to their original positions provided the markers have not been used on another trace.

MRK →TRACE

The *MKR→TRACE* softkey places the marker on a new trace. The trace is selected via a data entry field. Only those traces can be selected which are visible on the screen in the same window.

Example:
Three traces are presented on the screen. The marker is always on Trace 1 on switching on.

[*MKR ->TRACE]* *"2"<ENTER>*	The marker jumps to Trace 2 but remains on the previous frequency or time.
[*MKR ->TRACE]* *"3"<ENTER>*	The marker jumps to Trace 3. '

IEC/IEEE-bus command: `CALC:MARK1:TRAC 1`
`CALC:DELT:TRAC 1`

Frequency Measurement with the Frequency Counter

In order to accurately determine the frequency of a signal, R&S FSMR is equipped with a frequency counter which measures the frequency of the RF signal at the intermediate frequency. Using the measured IF, R&S FSMR calculates the frequency of the RF input signal by applying the known frequency conversion factors.

The frequency measurement error depends only upon the accuracy of the frequency standard used (external or internal reference). Although R&S FSMR always operates synchronously irrespective of the set span, the frequency counter delivers a more exact result than a measurement performed with a marker. This is due to the following:

- The marker measures only the position of the pixel on the trace and infers the frequency of the signal from this value. The trace, however, contains only a limited number of pixels. Depending upon the selected span, each pixel may contain many measurement values, which therefore limits the frequency resolution.
- The resolution with which the frequency can be measured is proportional to the measurement time. For this reason, the bandwidth is normally made as wide as possible and the sweep time as short as possible. This results in a loss of frequency resolution.

For the measurement with the frequency counter, the sweep is stopped at the reference marker, the frequency is counted with the desired resolution and then the sweep is allowed to continue.

SIGNAL COUNT

The *SIGNAL COUNT* softkey switches the frequency counter on/off.

The frequency is counted at the position of the reference marker (*MARKER* 1). The sweep stops at the reference marker until the frequency counter has delivered a result. The time required for a frequency measurement depends on the selected frequency resolution. The resolution is set in the side menu.

If no marker is enabled when the *SIGNAL COUNT* softkey is pressed, *MARKER 1* is switched on and set at the largest signal.

In addition, the *SIGNAL COUNT* function is displayed in the marker info field on the screen with [Tx CNT].

```
MARKER 1 [T1 CNT]
   -27.5 dBm
 23.4567891 MHz
```

Switching the *SIGNAL COUNT* function off is accomplished by pressing the softkey again.

IEC/IEEE-bus command: `CALC:MARK1:COUN ON;`
`CALC:MARK:COUN:FREQ?`

MARKER NEXT menu

The resolution of the frequency counter is set in the *NEXT* menu of the MARKER menu. R&S FSMR offers counter resolutions between 0.1 Hz and 10 kHz.

MARKER

CNT RESOL 10 kHz

CNT RESOL 1 kHz

CNT RESOL 100 Hz

CNT RESOL 10 Hz

CNT RESOL 1 Hz

CNT RESOL 0.1 Hz

The *CNT RESOL ...* softkeys select the counter resolution. They are selection switches, i.e. only one of the can be active at any one time.
The marker stop time, ie the frequency measurement time, depends on the selected resolution.

IEC/IEEE-bus command: `CALC:MARK1:COUN:RES <value>`

Measurement example:
The frequency of a CW signal is to be determined by means of the frequency counter with a resolution of 10 Hz.

[**PRESET**]	R&S FSMR is set to the default setting.
[**MARKER**]	*MARKER 1* is switched on and set to the maximum value of the displayed spectrum.
[*SIGNAL COUNT*]	The frequency counter is switched on. R&S FSMR counts the frequency of the signal at the marker position with a resolution of 1 kHz. The counted frequency is indicated in the marker info field.
[*NEXT*]	Changes to the submenu for setting the counter resolution.
[*CNT RESOL 10 Hz*]	The frequency counter resolution is increased to 10 Hz.

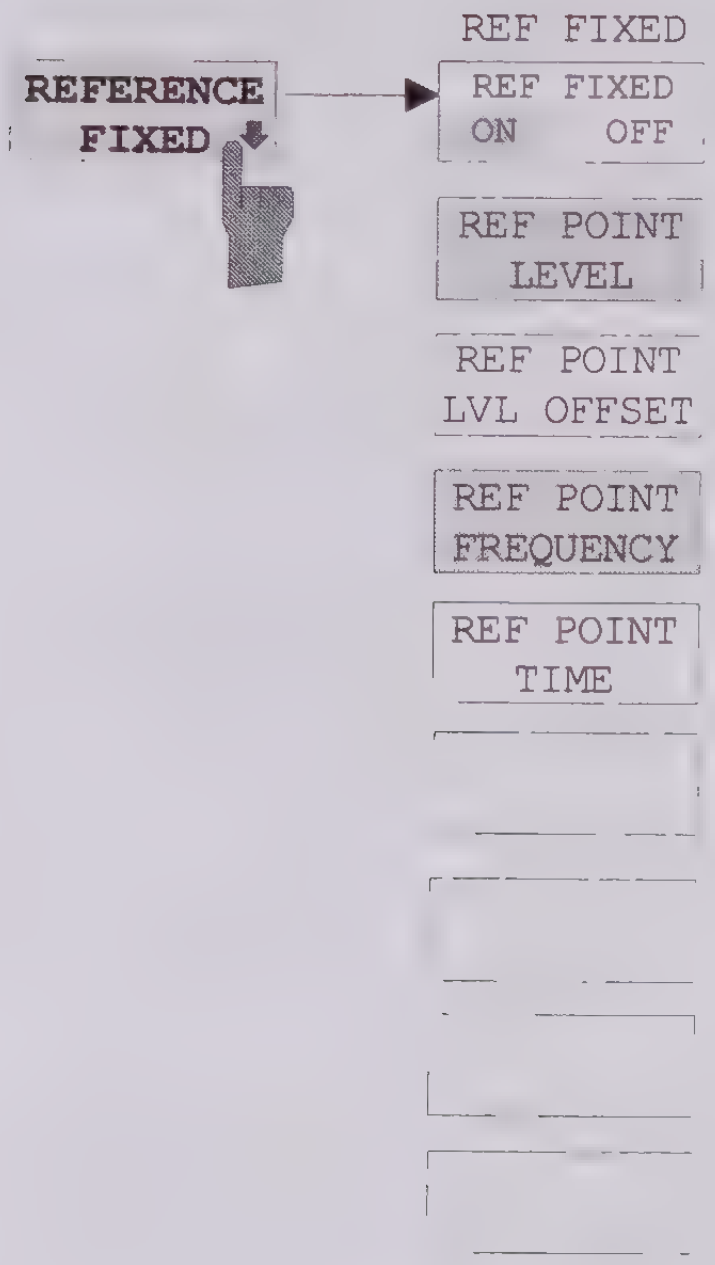

The *REFERENCE FIXED* softkey defines the level and the frequency or time of *MARKER 1* as a reference for one or several delta markers. The measured values for one or several markers displayed in the marker info field are derived from this reference point instead of the current values of the reference marker (*MARKER* 1).

On actuating the softkey, reference fixed is switched on and thus, the level value and the frequency, time or x-level value of *MARKER 1* immediately become the reference point.

Additionally, the *REFERENCE FIXED* softkey opens the submenu where it is possible to determine manually a reference point with level and frequency, time or x-axis level, to define a level offset or deactivate the reference point.

The *REFERENCE FIXED* function is useful for the measurement of the harmonic suppression at small span (fundamental not represented).

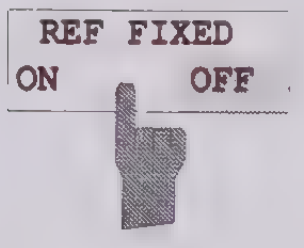

The *REF FXD ON/OFF* softkey switches on or off the relative measurement to a fixed reference value (*REFERENCE POINT*) independent of the trace.

IEC/IEEE-bus command: `CALC:DELT2:FUNC:FIX ON`

The *REF POINT LEVEL* softkey enters a reference level independent of the reference marker level. All relative level values of the delta markers refer to this reference level.

IEC/IEEE-bus command:
`CALC:DELT2:FUNC:FIX:RPO:Y -10dBm`

The *REF POINT LVL OFFSET* softkey specifies a level offset relevant to the reference level. The relative level values of the delta markers refer to the reference point level plus the level offset.

The level offset is set to 0 dB on enabling the *REFERENCE FIXED* or *PHASE NOISE* function.

IEC/IEEE-bus command:
`CALC:DELT2:FUNC:FIX:RPO:Y:OFFS 0dB`



With the *REF POINT FREQUENCY* softkey a reference frequency can be manually activated for the delta markers when the *REFERENCE FIXED* or *PHASE NOISE* function is used.

IEC/IEEE-bus command:
`CALC:DELT2:FUNC:FIX:RPO:X 10.7MHz`



The *REF POINT TIME* softkey activates the entry box for the input of a reference time for the *REFERENCE FIXED* function in the time domain (span = 0 Hz).

IEC/IEEE-bus command:

```
CALC:DELT2:FUNC:FIX:RPO:X 5MS
```

For phase noise measurement, input of reference time is not possible.



The *REF POINT x-LEVEL* softkey activates the entry box for the input of a reference level on the x-axis for the *REFERENCE FIXED* function when the power sweep is active.

IEC/IEEE-bus command:

```
CALC:DELT2:FUNC:FIX:RPO:X -5DBM
```

Measurement example:
Small-span harmonics measurement to increase sensitivity
CW signal (eg 100 MHz, 0 dBm) with harmonics at the RF input of R&S FSMR.

[**PRESET**]	R&S FSMR is set to the default setting.
[**CENTER**: 100 **MHz**]	The center frequency of R&S FSMR is set to 100 MHz.
[**SPAN**: 1 **MHz**]	The span is set to 1 MHz.
[**AMPL**: 3 **dBm**]	The reference level is set to 3 dBm (3 dB above the expected RF level).
[**MKR**]	*MARKER* 1 is switched on ('1' highlighted in the softkey) and set to the signal peak.
[*MARKER 2*]	*MARKER 2* is switched on and automatically defined as the delta marker (*DELTA* is highlighted on *MARKER NORM DELTA* softkey).
[*REFERENCE FIXED*]	The frequency and level of *MARKER 1* are a reference for the delta marker.
[**CENTER**: 200 **MHz**]	The center frequency is set to 200 MHz (= frequency of the 2nd harmonic). The reference level may have to be reduced to see the 2nd harmonic from the noise. This does not affect the reference level set with *REFERENCE FIXED*.
[**MKR->**: *PEAK*]	The delta marker jumps to the 2nd harmonic of the signal. The level spacing of the harmonic to the fundamental is displayed in the marker info field.

The *MARKER ZOOM* softkey expands the area around MARKER 1. With the zoom function, more details of the spectrum can be seen. The desired display range can be defined in an entry window.
The following sweep is stopped at the position of the reference marker. The frequency of the signal is counted and the measured frequency becomes the new center frequency. The zoomed display range is then configured and the new settings are used by R&S FSMR for further measurements.

As long as switching to the new frequency display range has not yet taken place, pressing the softkey will abort the procedure.

If *MARKER 1* is not active when the softkey is pressed, it is automatically activated and set to the highest peak in the window.

If an instrument setting is changed after selection of *MARKER ZOOM*, the function is aborted.

The *MARKER ZOOM* softkey is only available in the frequency domain (span > 0).

IEC/IEEE-bus command: `CALC:MARK1:FUNC:ZOOM 1kHz`

The *ALL MARKER OFF* softkey switches off all markers (reference and delta markers). It also switches off all functions and displays associated with the markers/delta markers.

IEC/IEEE-bus command: `CALC:MARK:AOFF`

Marker Functions – MKR FCTN Key

The MKR FCTN menu offers further measurements with the markers:

- Measurement of noise density (*NOISE MEAS* softkey)
- Measurement of phase noise (*PHASE NOISE* softkey)
- Measurement of filter or signal bandwidth (*N DB DOWN* softkey)
- Activating of AF demodulation (*MARKER DEMOD* softkey)

On calling the menu, the entry for the last active marker is activated (*SELECT MARKER* softkey); if no marker is activated, marker 1 is activated and a maximum search (*PEAK* softkey) is performed. The marker can be set to the desired trace by means of *MKR -> TRACE* softkey.

Menu *MKR FCTN*:

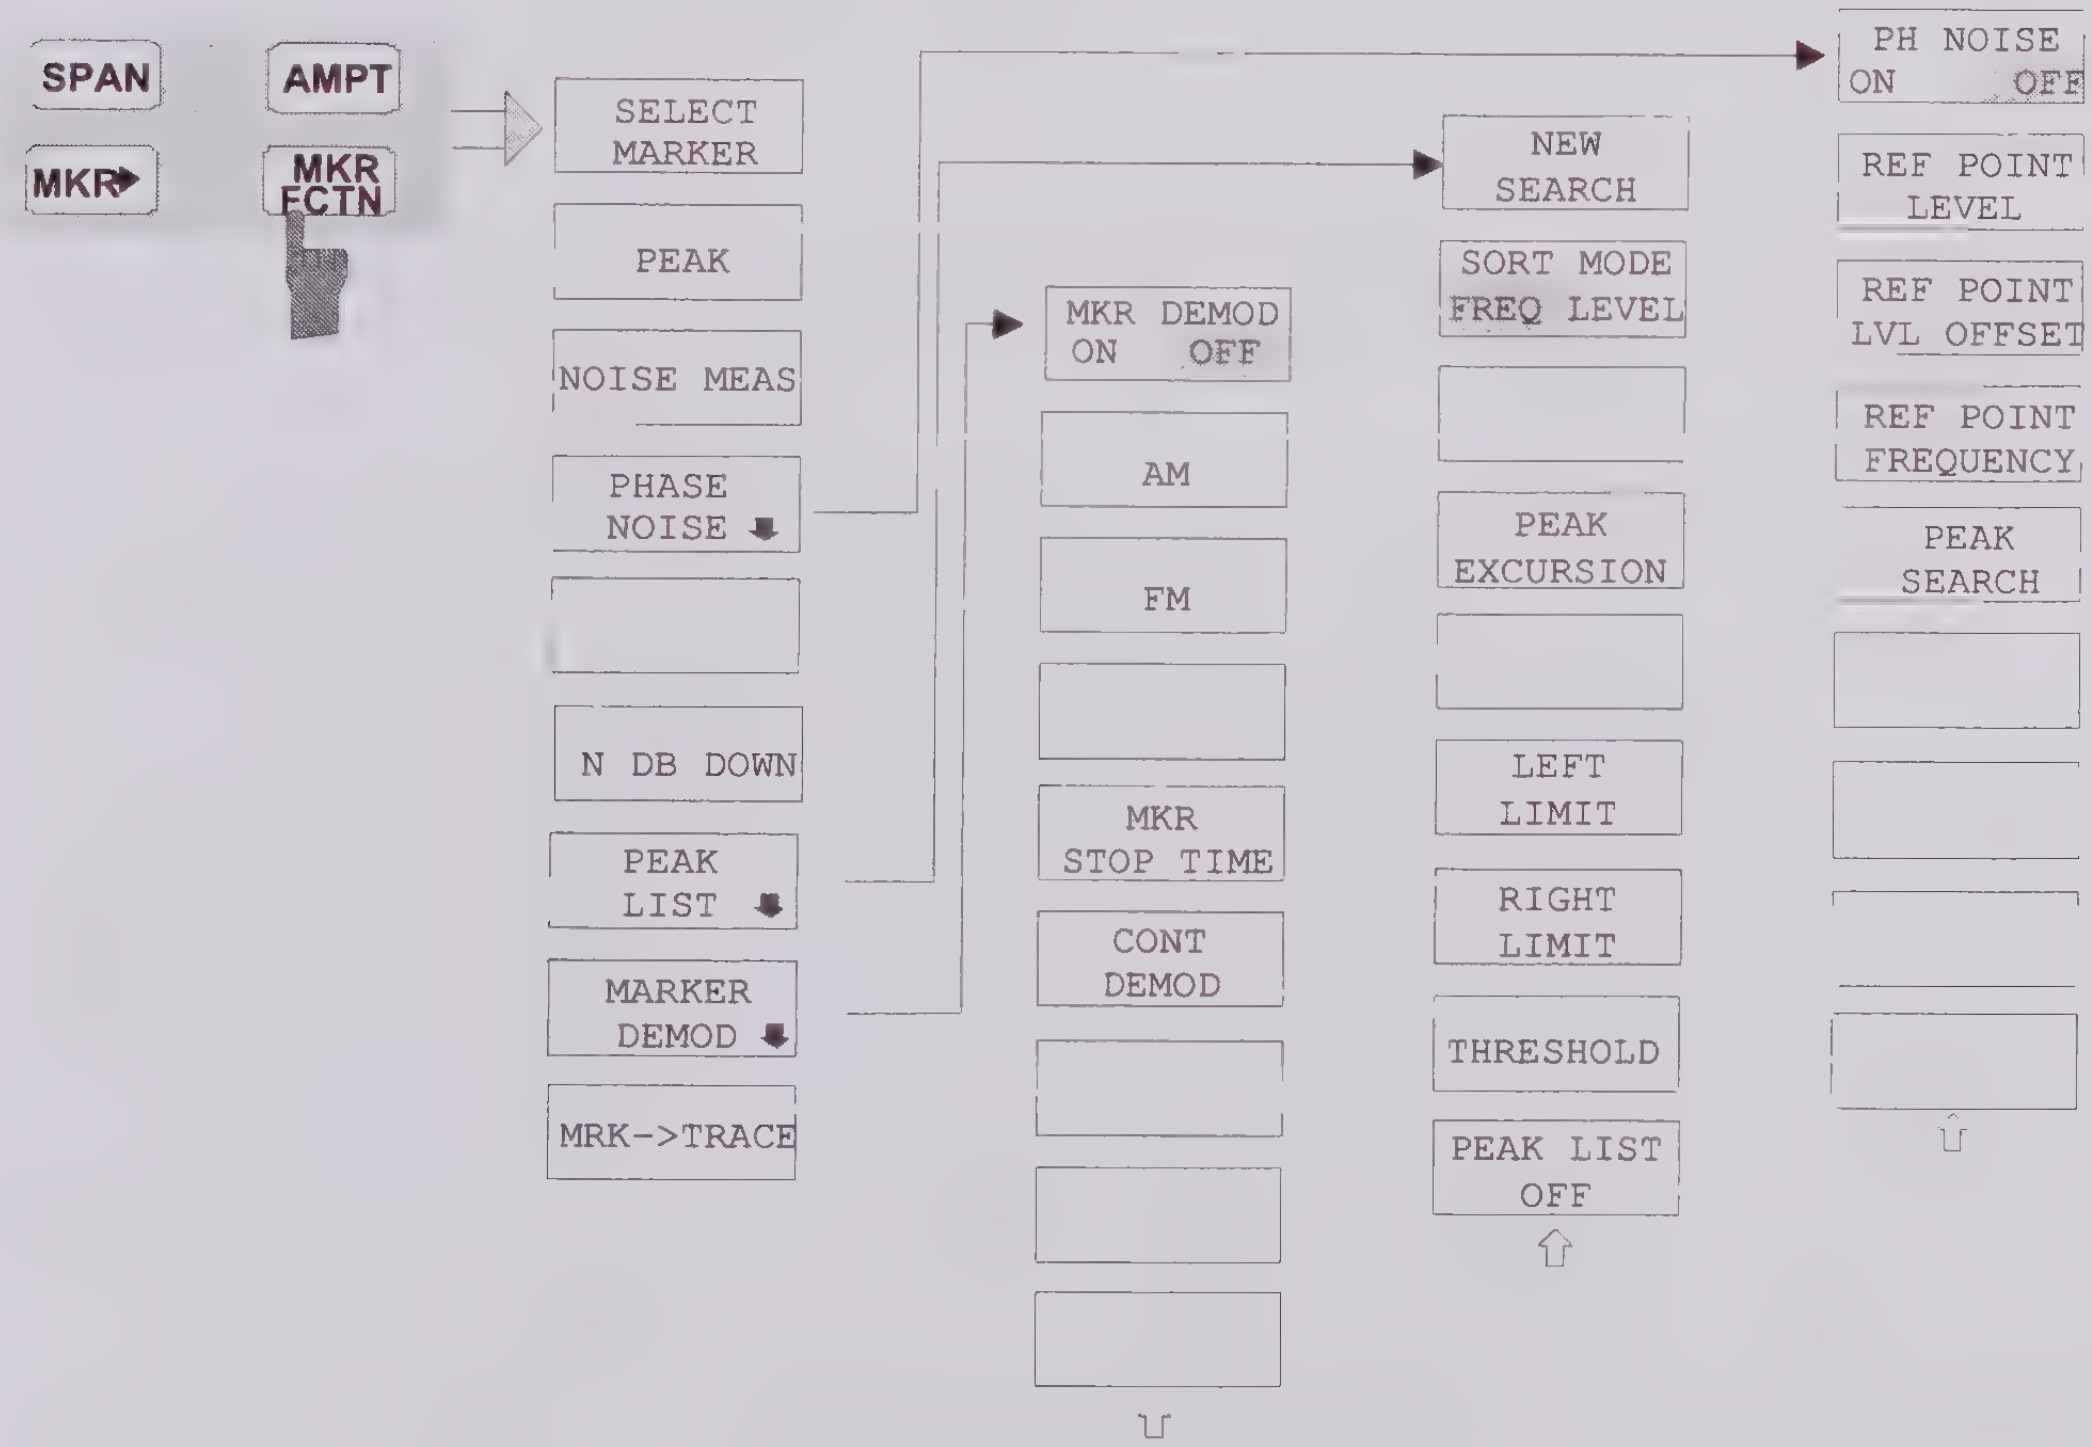

Activating the Markers

Menu *MKR FCTN*:

SELECT MARKER

The *SELECT MARKER* softkey activates the numerical selection of the marker in the data entry field. Delta marker 1 is selected by input of ' 0 '.
If the marker is switched off, then it is switched on and can be moved later on.

IEC/IEEE-bus command:

```
CALC:MARK1 ON;
CALC:MARK1:X <value>;
CALC:MARK1:Y?
```

PEAK

The *PEAK* softkey sets the active marker/delta marker to the peak of the trace.

IEC/IEEE-bus command:

```
CALC:MARK1:MAX
CALC:DELT1:MAX
```

Measurement of Noise Density

NOISE MEAS

The *NOISE MEAS* softkey switches the noise measurement for the active marker on or off. The corresponding marker becomes the *NORMAL* marker.

During noise measurement, the noise power density is measured at the position of the marker. In the time domain mode, all points of the trace are used to determine the noise power density. When measurements are performed in the frequency domain, two points to the right and left of the marker are used for the measurement to obtain a stable result.
The noise power density is indicated in the marker field. With a logarithmic amplitude units (dBm, dBmV, dBmμV, dBμA) the noise power density is output in dBm/Hz i.e. as level in 1 Hz bandwidth with reference to 1 mW. With linear amplitude units (V, A, W) the noise voltage density is evaluated in μV/√Hz, the noise current density in μA/√Hz or the noise power density in μW/Hz.

The following settings have to be made to ensure that the power density measurement yields correct values:

Detector: Sample or RMS

Video bandwidth:
≤ 0.1 x resolution bandwidth with sample detector
(corresponds to RBW / VBW NOISE)
≥ 3 x resolution bandwidth with RMS detector
(corresponds to RBW / VBW SINE)

In the default setting, the R&S FSMR uses the sample detector for the noise function.

With the sample detector, the trace can additionally be set to AVERAGE to stabilize the measured values. With RMS detector used, trace averaging must not be used since in this case it produces too low noise levels which cannot be corrected. Instead, the sweep time can be increased to obtain stable measurement results.

The R&S FSMR uses the following correction factors to evaluate the noise density from the marker level:

- Since the noise power is indicated with reference to 1 Hz bandwidth, the bandwidth correction value is deducted from the marker level. It is 10 x lg (1 Hz/BW_{Noise}), where BW_{Noise} is the noise or power bandwidth of the set resolution filter (RBW).

Sample detector:

- As a result of video filter averaging and trace averaging, 1.05 dB is added to the marker level. This is the difference between the average value and the RMS value of white noise.
- With a logarithmic level axis, 1.45 dB is added additionally. Logarithmic averaging is thus fully taken into account which yields a value that is 1.45 dB lower than that of linear averaging.

RMS detector:

- With the exception of bandwidth correction, no further corrections are required for the RMS detector since it already indicates the power with every point of the trace.

To allow a more stable noise display the adjacent (symmetric to the measurement frequency) points of the trace are averaged.

In time domain mode, the measured values are averaged versus time (after a sweep).

IEC/IEEE-bus command: `CALC:MARK:FUNC:NOIS ON;`
`CALC:MARK:FUNC:NOIS:RES?`

Example: Measurement of inherent R&S FSMR noise

[PRESET]	The R&S FSMR is set to default setting.
[MARKER]	Marker 1 is switched on and set to the maximum value of the displayed spectrum. Set marker to desired frequency using the rotary knob.
[*NOISE*]	The R&S FSMR switches the sample detector on and sets the video bandwidth to 300 kHz (0.1 x RBW). The power density level of inherent noise is displayed in dBm/Hz in the marker info field.

Note: *The R&S FSMR noise figure can be calculated from the measured power density level. It is calculated by deducting the set RF attenuation (RF Att) from the displayed noise level. 174 is to be added to the result to obtain the R&S FSMR noise figure.*

Phase Noise Measurement

Menu MKR FCTN:

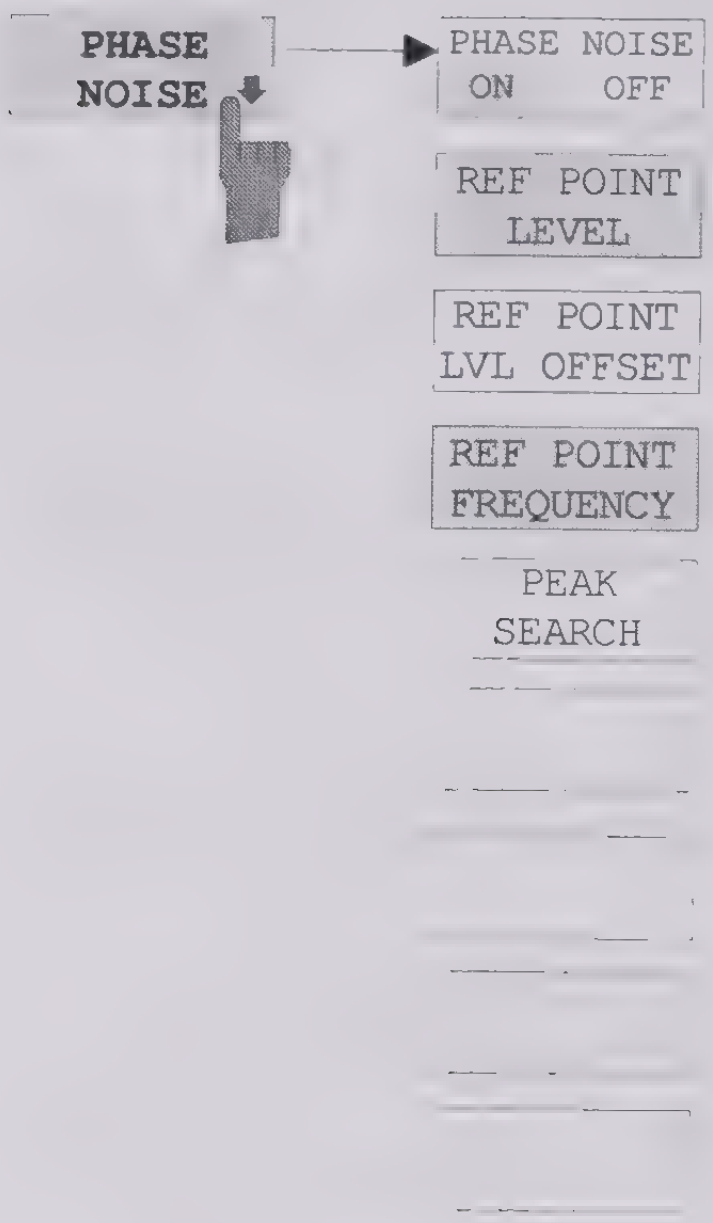

The *PHASE NOISE* softkey switches the *PHASE NOISE* function on/off. Additionally, the softkey opens the submenu for manually setting the reference point. The phase noise measurement can be switched off in the submenu.

MARKER 1 (= reference marker) is used as a reference for the phase noise measurement. The frequency and level of the reference marker are used as fixed reference values, i.e. the *REFERENCE FIXED* function is activated. After switching on the phase noise measurement the reference level or the center frequency can thus be set in a way that the carrier is outside the displayed frequency range, or, for example, a notch filter is switched on to suppress the carrier.
A noise power density measurement is carried out with the delta marker or delta markers. This measurement corresponds to the NOISE function in the *MARKER* menu (MKR). The result of the phase noise measurement is the difference in level between the reference point and the noise power density.

The following possibilities can be selected on switching on *PHASE NOISE*:

1. No marker enabled:

[**MKR FCTN**]	*MARKER 1* is enabled and set to peak.
[*PHASE NOISE*]	*MARKER 1* becomes the reference marker, *MARKER 2* the delta marker; frequency = frequency of the reference marker. The delta marker is the active marker, i.e. it can be moved with the rollkey or adjusted by entering numerals. The *PHASE NOISE* function is switched on and the measured value is output.

2. Markers are enabled:

[**MKR FCTN**]	The previous marker configuration remains unchanged.
[*PHASE NOISE*]	*MARKER 1* becomes the reference marker. If other markers are enabled, they become delta markers and measure the phase noise at their respective positions.

If further markers are enabled during the phase noise measurement, they automatically become delta markers and measure the phase noise at their respective positions.

When the phase noise measurement is switched off, the marker configuration remains unchanged and the delta markers measure the relative level to the reference marker (*MARKER 1*).

The *PHASE NOISE* function measures the noise power at the delta markers referred to 1 Hz bandwidth. The sample detector is automatically used and the video bandwidth set to 0.1 times the resolution bandwidth (RBW). The two settings are taken into account in the correction values used for the noise power measurement.
To obtain stable results, two pixels on the right and the left of the respective delta marker position are taken for the measurement. The procedure for determining the noise power is identical to the method used for the noise power measurement (see NOISE softkey). The measured noise level referred to 1 Hz bandwidth is subtracted from the carrier level at the reference marker (*MARKER 1*). The measured values are displayed in the delta marker field in dBc/Hz (= spacing in dB of the noise power from the carrier level in 1 Hz bandwidth).

If several delta markers are enabled, only the value read by the active marker is shown in the marker field. If several delta markers are active, their measurement results are shown in the marker info field.

The reference value for the phase noise measurement can be defined with *REF POINT LEVEL*, *REF POINT FREQUENCY* and *REF POINT LVL OFFSET* to differ from that of the reference marker.

IEC/IEEE-bus command: --



The *PH NOISE ON/OFF* softkey switches on/off the phase noise measurement. Switching on is performed by means of the *PHASE NOISE* softkey and is only necessary when the phase noise measurement has been switched off in the submenu.

IEC/IEEE-bus command: `CALC:DELT1:FUNC:PNO ON`
`CALC:DELT1:FUNC:PNO:RES?`



The *REF POINT LEVEL* softkey activates an entry box for the input of a reference level other than the reference marker level. The function is identical to that of the softkey with the same name in the marker menu (MKR).

IEC/IEEE-bus command:
`CALC:DELT1:FUNC:FIX:RPO:Y -10dB`



The *REF POINT LVL OFFSET* softkey activates an entry box for the input of an additional level offset for the phase noise calculation.

This level offset is set to 0 dB on when the *REFERENCE FIXED* or *PHASE NOISE* function is enabled.

IEC/IEEE-bus command:
`CALC:DELT:FUNC:FIX:RPO:Y:OFFS 10dB`

REF POINT FREQUENCY

The *REF POINT FREQUENCY* softkey activates an entry box for the manual input of a reference frequency for the *REFERENCE FIXED* or *PHASE NOISE* function.

IEC/IEEE-bus command:

```
CALC:DELT1:FUNC:FIX:RPO:X 10.7MHz
```

PEAK SEARCH

The *PEAK SEARCH* sets the reference point level for delta marker 2 in the selected measurement window to the peak of the selected trace.

IEC/IEEE-bus command:

```
CALC:DELT:FUNC:FIX:RPO:MAX
```

Measurement example:

The phase noise of a CW signal at 100 MHz with 0 dBm level is to be measured at 800 kHz from the carrier

[**PRESET**]	The R&S FSMR is set to the default setting.
[**CENTER**: 100 **MHz**]	The center frequency is set to 100 MHz.
[**SPAN**: 2 **MHz**]	The span is set to 2 MHz.
[**AMPT**: 0 **dBm**]	The reference level is set to 0 dBm.
[**MKR FCTN**]	*MARKER 1* is switched on and positioned at the maximum of the displayed trace.
[*PHASE NOISE*: 800 **kHz**]	The phase noise measurement is switched on. The delta marker is positioned on the main marker and the measured phase noise value is displayed in the marker info field. The sample detector is used and the video bandwidth is set to 3 x RBW. When the phase noise measurement function is enabled, the entry of the delta marker frequency is activated. It can be entered directly.

Measurement of the Filter or Signal Bandwidth

Menu *MKR FCTN*:

N dB DOWN

The *N dB DOWN* softkey activates the temporary markers T1 and T2 which are n dB below the active reference marker. Marker T1 is placed to the left and marker T2 at the right of the reference marker. The value n can be input in a window.

The default setting is 3 dB.

Span > 0: The frequency spacing of the two temporary markers is indicated in the marker info field.
Span = 0: The pulse width between the two temporary markers is indicated in the marker info field.
If, for example, it is not possible to form the frequency spacing for the n dB value because of the noise display, dashes are indicated instead of a measured value.
IEC/IEEE-bus command:

```
CALC:MARK1:FUNC:NDBD:STAT ON
CALC:MARK1:FUNC:NDBD 3dB
CALC:MARK1:FUNC:NDBD:RES?
CALC:MARK1:FUNC:NDBD:FREQ? 'Span > 0
CALC:MARK1:FUNC:NDBD:TIME? 'Span = 0
```

Measurement of a Peak List

Menu *MKR FCTN*:

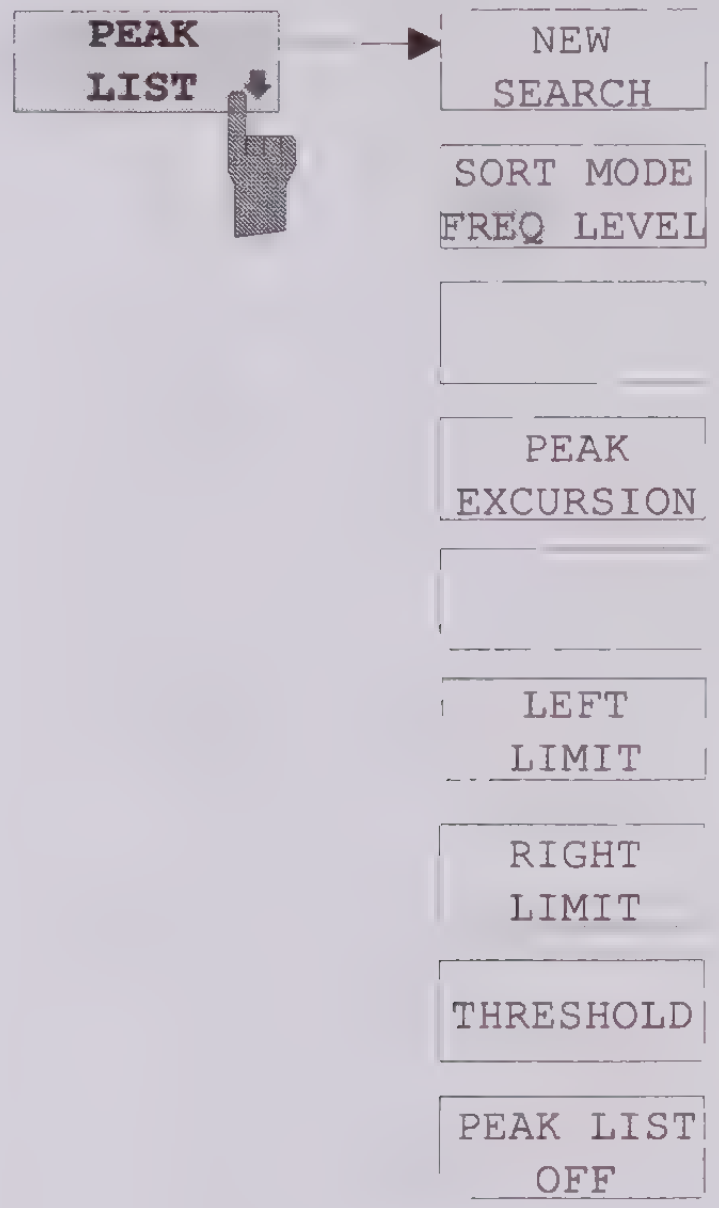

The *PEAK LIST* softkey allows the peak values of the trace to be determined and entered in a list with 50 entries max. The order of the entries is defined by the *SORT MODE*:

FREQ	sorting in ascending order of frequency values (see screenshot); if span = 0, the entries are sorted in ascending order of time values
LEVEL	sorting according to level

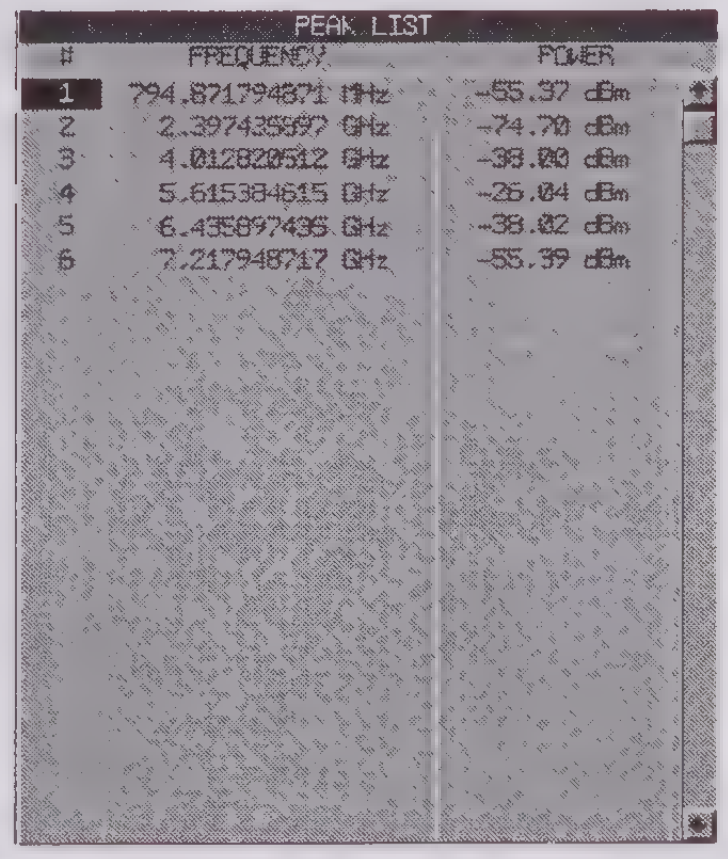

PEAK LIST

#	FREQUENCY	POWER
1	794.871794871 MHz	-55.37 dBm
2	2.397435897 GHz	-74.70 dBm
3	4.012820512 GHz	-38.00 dBm
4	5.615384615 GHz	-26.04 dBm
5	6.435897436 GHz	-38.02 dBm
6	7.217948717 GHz	-55.39 dBm

The search range can be restricted by means of the *LEFT LIMIT, RIGHT LIMIT* and *THRESHOLD* softkeys. The definition of the peak values can be modified using the *PEAK EXCURSION* softkey. The *MKR->TRACE* softkey in the main menu is used to select the trace for searching peak values.

Opening the list performs a single search at the end of the sweep. The *NEW SEARCH* softkey triggers a new sweep, determines the peak values of the trace at the end of the sweep and enters them in the list.

Use the *PEAK LIST OFF* key to delete the list from the screen.

IEC/IEEE-bus commands:

```
INIT:CONT OFF;
CALC:MARK:TRAC 1;
CALC:MARK:FUNC:FPE:SORT X;
INIT;*WAI;
CALC:MARK:FUNC:FPE 10;
CALC:MARK:FUNC:FPE:COUN?;
CALC:MARK:FUNC:FPE:Y?;
CALC:MARK:FUNC:FPE:X?
```

NEW SEARCH

The *NEW SEARCH* softkey starts a new peak search and enters the results in the peak list.

IEC/IEEE-bus commands:

```
INIT;*WAI;
CALC:MARK:FUNC:FPE 10;
CALC:MARK:FUNC:FPE:COUN?;
CALC:MARK:FUNC:FPE:Y?;
CALC:MARK:FUNC:FPE:X?
```

SORT MODE FREQ LEVEL

The *SORT MODE FREQ/LEVEL* softkey defines the position of the peak values in the list:

FREQ	sorting in ascending order of frequency values (time values if span = 0)
LEVEL	sorting according to level

IEC/IEEE-bus command:

```
CALC:MARK:FUNC:FPE:SORT X;
```

PEAK EXCURSION

With level measurements, the *PEAK EXCURSION* softkey allows the minimum amount to be entered by which a signal must decrease or increase in order to be recognized as a maximum by the peak search function.

Values between 0 dB and 80 dB may be entered, the resolution being 0.1 dB

IEC/IEEE-bus command:

```
CALC:MARK:PEXC 6dB
```

LEFT LIMIT

RIGHT LIMIT

The *LEFT LIMIT* and *RIGHT LIMIT* softkeys define the vertical lines F1/F2 in the frequency domain (span > 0) and T1/T2 in the time domain (span = 0) between which the search is carried out.
If only one line is active, the F1/T1 line is used as the lower limit; the upper limit is the stop frequency. If F2/T2 is also active, it defines the upper limit.

IEC/IEEE-bus commands:

```
CALC:MARK:X:SLIM:LEFT 1MHZ
CALC:MARK:X:SLIM:RIGH 10MHZ
CALC:MARK:X:SLIM ON
```

THRESHOLD

The *THRESHOLD* softkey defines a horizontal threshold line which represents the lower limit of the peak search level range.

IEC/IEEE-bus command:

```
CALC:THR -20dBm
CALC:THR ON
```

PEAK LIST OFF

The *PEAK LIST OFF* softkey switches off the table with the search results.

IEC/IEEE-bus command: –

AF Demodulation

The R&S FSMR provides demodulators for AM and FM signals. With these demodulators, a displayed signal can be identified acoustically through the use of the internal loudspeaker or with headphones. The frequency at which the demodulation is enabled is coupled to the markers. The sweep stops at the frequency determined by the active marker for the selected time and the RF signal is demodulated. During a measurement in the time domain (span = 0 Hz) the demodulation is continuously on.
The threshold line (*MKR->SEARCH LIMITS:THRESHOLD*) performs a squelch function in the demodulator. If the threshold is set, the R&S FSMR LF demodulation is switched on only when the signal to be demodulated exceeds the set threshold.

Menu *MKR FCTN*:

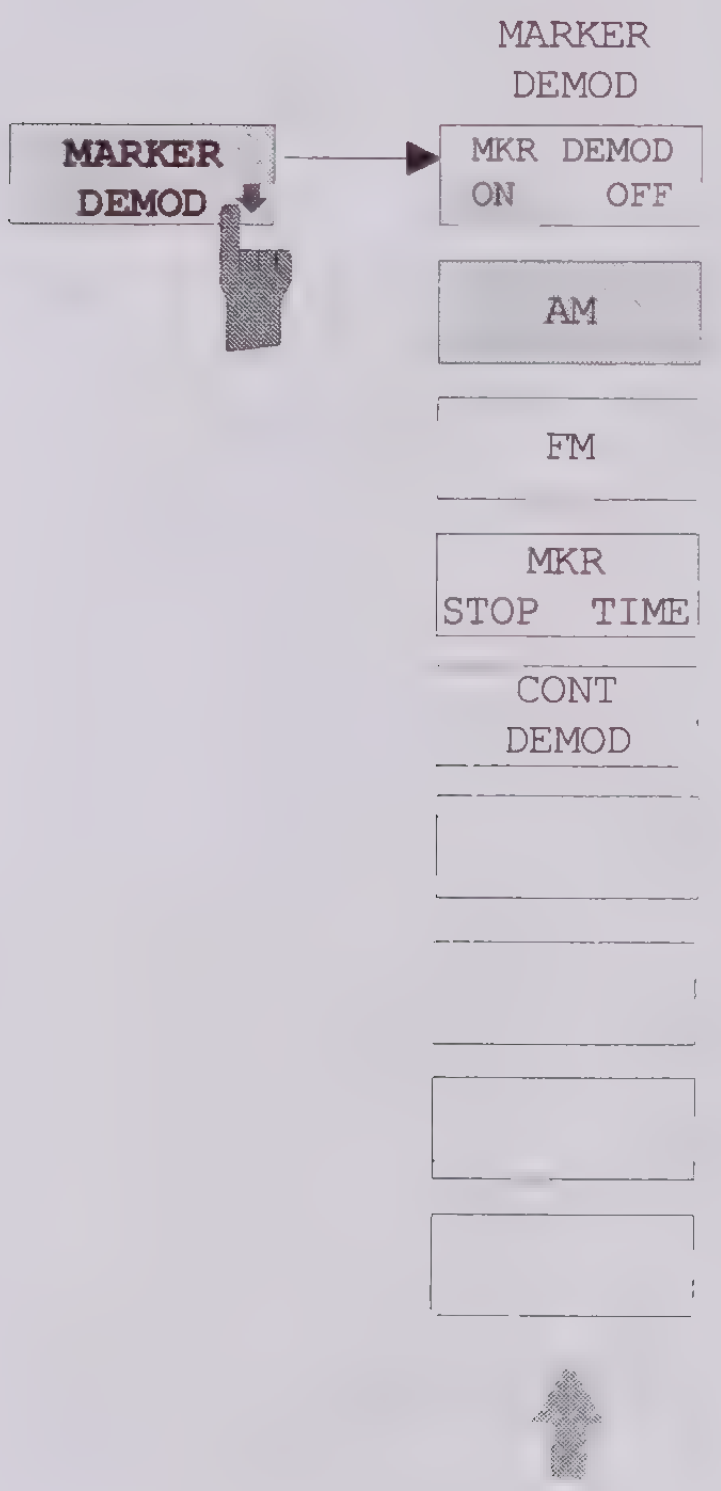

The *MARKER DEMOD* softkey switches on the audio demodulator and calls a submenu in which the demodulation mode and the duration of the demodulation can be selected.

IEC/IEEE-bus command: `CALC:MARK1:FUNC:DEM ON`

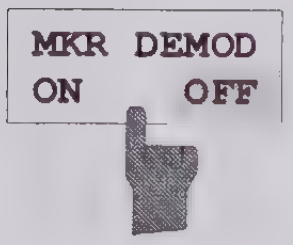

The *MKR DEMOD ON/OFF* softkey switches the demodulation on/off.

In the frequency range (span >0), the frequency scan is stopped at the frequency of the active marker with demodulation switched on – provided that the level is above the threshold line - and the signal is demodulated during the given stop time.
In the time domain (span = 0) demodulation is continuous, i.e. not only active at the marker position.

IEC/IEEE-bus command: `CALC:MARK1:FUNC:DEM ON`

AM

FM

The softkeys *AM and FM* are selector switches one of which only may be active at a time. They set the desired demodulation mode FM or AM. Default setting is AM.

IEC/IEEE-bus command: `CALC:MARK1:FUNC:DEM:SEL AM`
`CALC:MARK1:FUNC:DEM:SEL FM`

MKR STOP TIME

The *MKR STOP TIME* softkey defines the stop time for demodulation at the marker(s).
The R&S FSMR interrupts the frequency sweep at the marker position and activates the demodulation for the duration of the stop time (see also *MKR DEMOD ON/OFF*).
In the time domain (span = 0) the demodulation is continuously active irrespective of the stop time set.

IEC/IEEE-bus command: `CALC:MARK1:FUNC:DEM:HOLD 3s`

CONT DEMOD

The *CONT DEMOD* softkey switches on the continuous demodulation in the frequency domain. If the sweep time is long enough, the set frequency range can be monitored acoustically.

IEC/IEEE-bus command: `CALC:MARK1:FUNC:DEM:CONT ON`

Selecting the Trace

Menu *MKR FCTN*:

MRK→TRACE

The *MKR→TRACE* softkey sets the active marker to different traces. Only those traces can be selected which are visible on the screen in the same window.

The function of the softkey is identical to that of the softkey with the same name in the MKR-> menu.

Example:
Three traces are displayed on the screen. The marker is always on Trace 1 on switching on.

[*MKR ->TRACE*] "1"<ENTER>	The marker jumps to Trace 2, but remains at the previous frequency or time.
[*MKR ->TRACE*] "3"<ENTER>	The marker jumps to Trace 3.

IEC/IEEE-bus command: `CALC:MARK:TRAC 2`

Change of Settings via Markers – MKR ⇒ Key

The *MKR* → menu offers functions through which instrument parameters can be changed with the aid of the currently active marker. The functions can be used on markers and delta markers.

On opening the menu, the entry for the last active marker is activated; if no marker was enabled, *MARKER 1* is activated and a peak search is performed.

MKR → menu

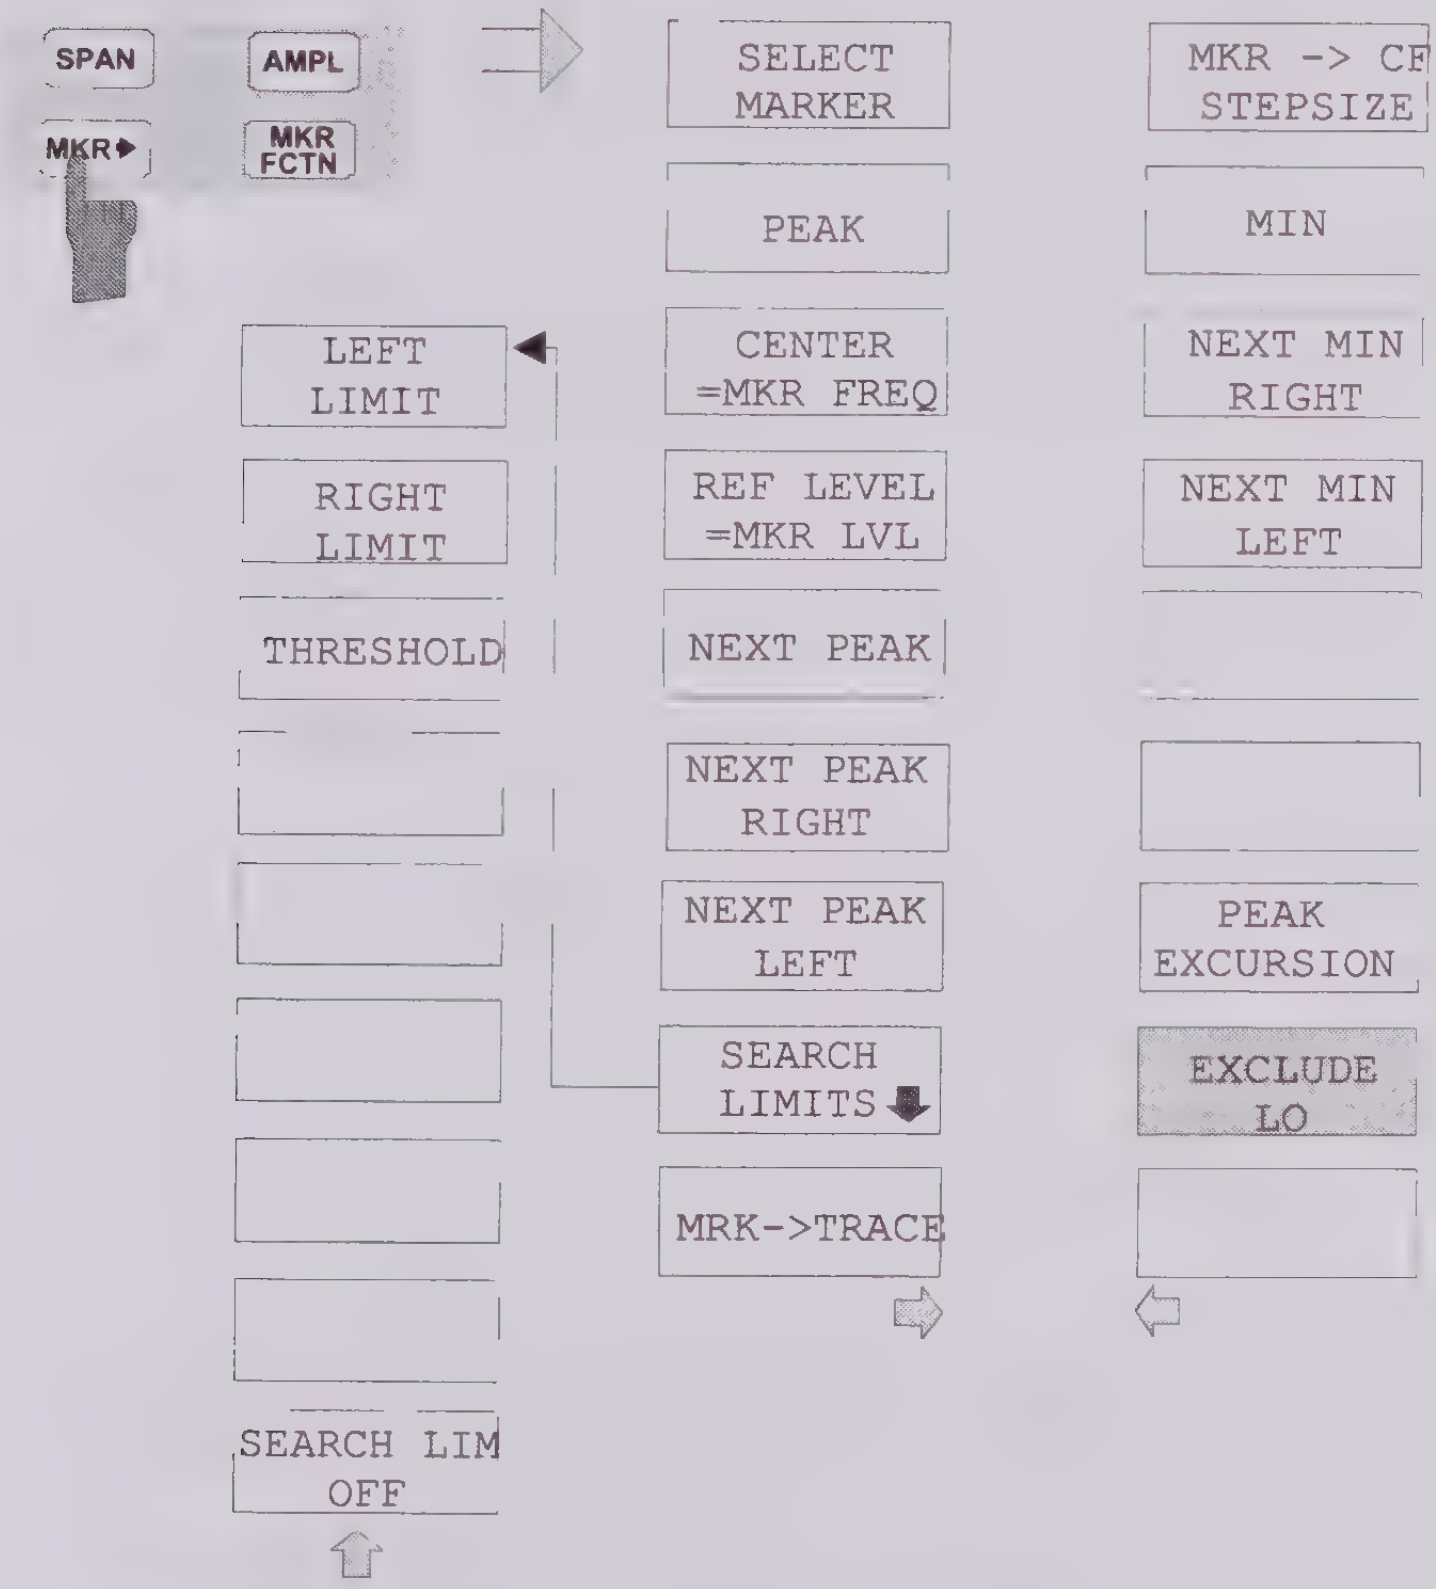

The *SELECT MARKER* softkey activates the numerical selection of the marker in the data entry field. Delta marker 1 is selected by input of ' 0 '.

IEC/IEEE-bus commands: `CALC:MARK1 ON;`
`CALC:MARK1:X <value>;`
`CALC:MARK1:Y?`

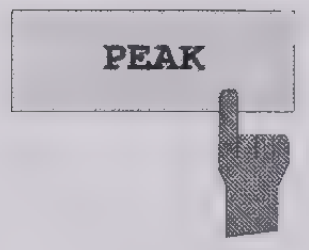

The *PEAK* softkey sets the active marker/delta marker to the peak of the trace.
If no marker is active when **MKR->** menu is called, *MARKER 1* is automatically switched on and the peak search is performed.

IEC/IEEE-bus commands: `CALC:MARK:MAX`
`CALC:DELT:MAX`

CENTER =MKR FREQ

The *CENTER = MKR FREQ* softkey sets the center frequency to the current marker or delta marker frequency.
A signal can thus be set to the center of the frequency display range, for example, so that it can then be examined in detail with a smaller span.

The softkey is not available in the time domain (zero span).

IEC/IEEE-bus command: `CALC:MARK:FUNC:CENT`

Example:

A spectrum is displayed with a large span after PRESET. A signal off the center is to be examined in detail:

[**PRESET**]	R&S FSMR is set to the default setting.
[**MKR->**]	*MARKER 1* is switched on and automatically jumps to the largest signal of the trace.
[*CENTER =MKR FREQ*]	The center frequency is set to the marker frequency. The span is adapted in such a way that the minimum frequency (= 0 Hz) or the maximum frequency is not exceeded.
[*SPAN*]	The span can, for example, be reduced using the rollkey.

REF LEVEL =MKR LVL

The *REF LEVEL = MKR LVL* softkey sets the reference level to the current marker level.

IEC/IEEE-bus command: `CALC:MARK:FUNC:REF`

Example:

A spectrum is displayed with a large span after PRESET. A signal off the center is to be examined in detail:

[**PRESET**]	R&S FSMR is set to the default setting.
[**MKR->**]	*MARKER 1* is switched on and automatically jumps to the largest signal of the trace.
[*CENTER =MKR FREQ*]	The center frequency is set to the marker frequency. The span is adapted in such a way that the minimum frequency (= 0 Hz) or the maximum frequency is not exceeded.
[*REF LEVEL = MKR LVL*]	The reference level is set to the measured marker level.
[**SPAN**]	The span can, for example, be reduced using the rollkey.

NEXT PEAK

The *NEXT PEAK* softkey sets the active marker/delta marker to the next lower maximum of the selected trace.

IEC/IEEE-bus commands: `CALC:MARK:MAX:NEXT`
`CALC:DELT:MAX:NEXT`

NEXT PEAK RIGHT

The *NEXT PEAK RIGHT* softkey sets the active marker/delta marker to the next lower maximum right of the current marker position on the selected trace.

IEC/IEEE-bus commands: `CALC:MARK:MAX:RIGH`
`CALC:DELT:MAX:RIGH`

NEXT PEAK LEFT

The *NEXT PEAK LEFT* softkey sets the active marker/delta marker to the next lower maximum left of the current marker position the selected trace.

IEC/IEEE-bus commands:

```
CALC:MARK:MAX:LEFT
CALC:DELT:MAX:LEFT
```

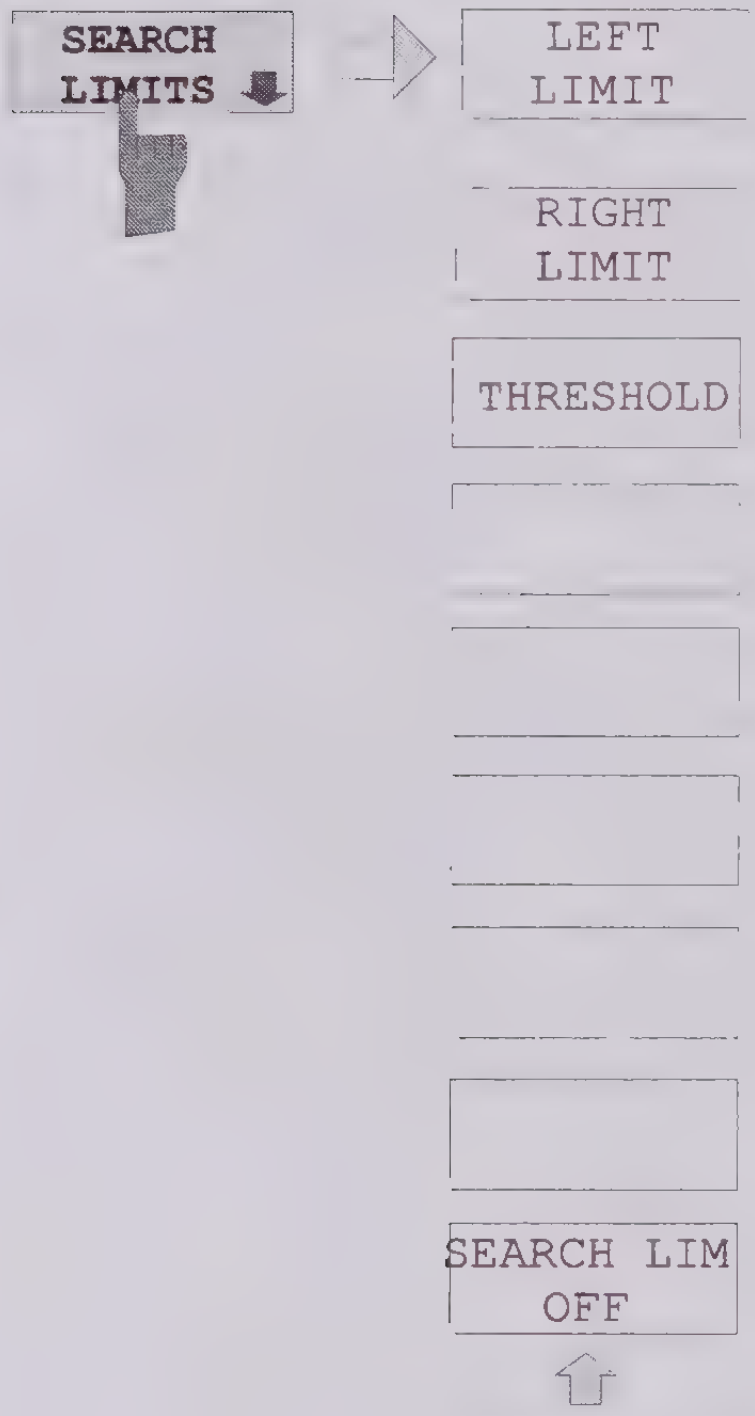

The *SEARCH LIMITS* softkey limits the search range for maximum or minimum search. The softkey switches to a submenu in which the search range limits can be set in the x and y direction.

LEFT LIMIT

RIGHT LIMIT

The *LEFT LIMIT* und *RIGHT LIMIT* softkeys define the two vertical lines F1 and F2 in the frequency domain (span > 0) and T1 / T2 in the time domain (span = 0). The search is performed between these lines in the frequency and time domain

If only *LEFT LIMIT* is enabled, line F1/T1 is the lower limit and the upper limit corresponds to the stop frequency. If *RIGHT LIMIT* is also enabled, it determines the upper limit.

IEC/IEEE-bus commands:

```
CALC:MARK:X:SLIM:LEFT 1MHZ
CALC:MARK:X:SLIM:RIGH 10MHZ
CALC:MARK:X:SLIM ON
```

THRESHOLD

The *THRESHOLD* softkey defines the threshold line.

The threshold line represents a limit for the level range of the max. search at the lower end and that of the min. search at the upper end.

IEC/IEEE-bus commands:

```
CALC:THR -20dBm
CALC:THR ON
```



The *SEARCH LIMIT OFF* softkey disables all limits of the search range.

IEC/IEEE-bus commands:`CALC:MARK:X:SLIM OFF`
`CALC:THR OFF`

The *MKR→TRACE* softkey sets the active marker to a new trace. If only one trace is available on the screen, the softkey does not appear. If several traces are available on the screen, only these are offered.

IEC/IEEE-bus command: `CALC:MARK:TRAC 2`

Example:

Three traces are displayed on the screen. The marker is always on Trace 1 after switching on.

[*MKR ->TRACE]* "2" <*ENTER*>	The marker jumps to Trace 2 but remains at the previous frequency or time.
[*MKR ->TRACE*] "3" <*ENTER*>	The marker jumps to Trace 3.

The *MKR→CF STEPSIZE* softkey sets the step size for the center frequency variation to the current marker frequency, and also sets step size adaptation to *MANUAL*. *CF STEPSIZE* remains at this value until the center frequency entry mode in the STEP menu is switched from *MANUAL* to *AUTO* again.

The *MKR→CF STEPSIZE* function is, above all, useful in the measurement of harmonics with large dynamic range (narrow bandwidth and narrow span).

The softkey is not available in the time domain (span = 0 Hz).

IEC/IEEE-bus command: `CALC:MARK:FUNC:CST`

Example:

The harmonics levels of a CW carrier are to be measured at 100 MHz.

[**PRESET**]	R&S FSMR is set to the default setting.
[**CENTER**: 100 **MHz**]	R&S FSMR sets the center frequency to 100 MHz. The span is set to 200 MHz.
[**SPAN**: 1 **MHz**]	The span is set to 100 MHz.
[**MKR->**]	*MARKER 1* is switched on and set to the maximum value of the signal.
[**NEXT**]	R&S FSMR switches to the submenu.
[*MKR->CF STEPSIZE*]	The step size of the center frequency setting equals the marker frequency (100 MHz).
[**CENTER**]	The center frequency entry mode is activated.
[**Right key**]	The center frequency is set to 200 MHz. The first harmonic of the test signal is displayed.
[**MKR->**: *PEAK*]	The marker is set to the harmonic and the level of the latter is output in the marker info field.

MIN

The *MIN* softkey sets the active marker/delta marker to the minimum of the selected trace.

IEC/IEEE-bus commands: `CALC:MARK:MIN`
`CALC:DELT:MIN`

NEXT MIN

The *NEXT MIN* softkey sets the active marker/delta marker to the next higher minimum of the selected trace. The search direction is defined in the *NEXT MODE* submenu (see above).

IEC/IEEE-bus commands: `CALC:MARK:MIN:NEXT`
`CALC:DELT:MIN:NEXT`

NEXT MIN RIGHT

The *NEXT MIN RIGHT* softkey sets the active marker/delta marker to the next higher minimum right of the current marker position on the selected trace.

IEC/IEEE-bus commands: `CALC:MARK:MIN:RIGH`
`CALC:DELT:MIN:RIGH`

NEXT MIN LEFT

The *NEXT MIN LEFT* softkey sets the active marker/delta marker to the next higher minimum left of the current marker position on the selected trace.

IEC/IEEE-bus commands: `CALC:MARK:MIN:LEFT`
`CALC:DELT:MIN:LEFT`

PEAK EXCURSION

The *PEAK EXCURSION* softkey enables – for level measurements – the entry of a minimum level value by which a signal must rise or fall so that it will be identified as a maximum or a minimum by the *NEXT PEAK* and *NEXT MIN* search functions.

Valid entries are from 0 dB to 80 dB; the resolution is 0.1 dB.

IEC/IEEE-bus command: `CALC:MARK:PEXC 10dB`

The default setting for the peak excursion is 6 dB. This value is sufficient for the *NEXT PEAK* and *NEXT MIN* functions since, in this mode, the next lower maximum or next higher minimum will always be detected.

If *NEXT PEAK LEFT* or *NEXT PEAK RIGHT* is selected, these functions search for the next relative maximum left or right of the current marker position irrespective of the current signal amplitude. *Relative maximum* is understood to mean a decrease of the signal amplitude by a defined value – i.e. the peak excursion – right and left of the amplitude peak.
The 6 dB level change set as a default value may be attained already by the inherent noise of the instrument. In such a case, the R&S R&S FSMR would identify noise peaks as maxima or minima. The value entered for the *PEAK EXCURSION* should therefore be higher than the difference between the highest and the lowest value measured for the displayed inherent noise.

The following example illustrates the effect of different settings of the *PEAK EXCURSION*.

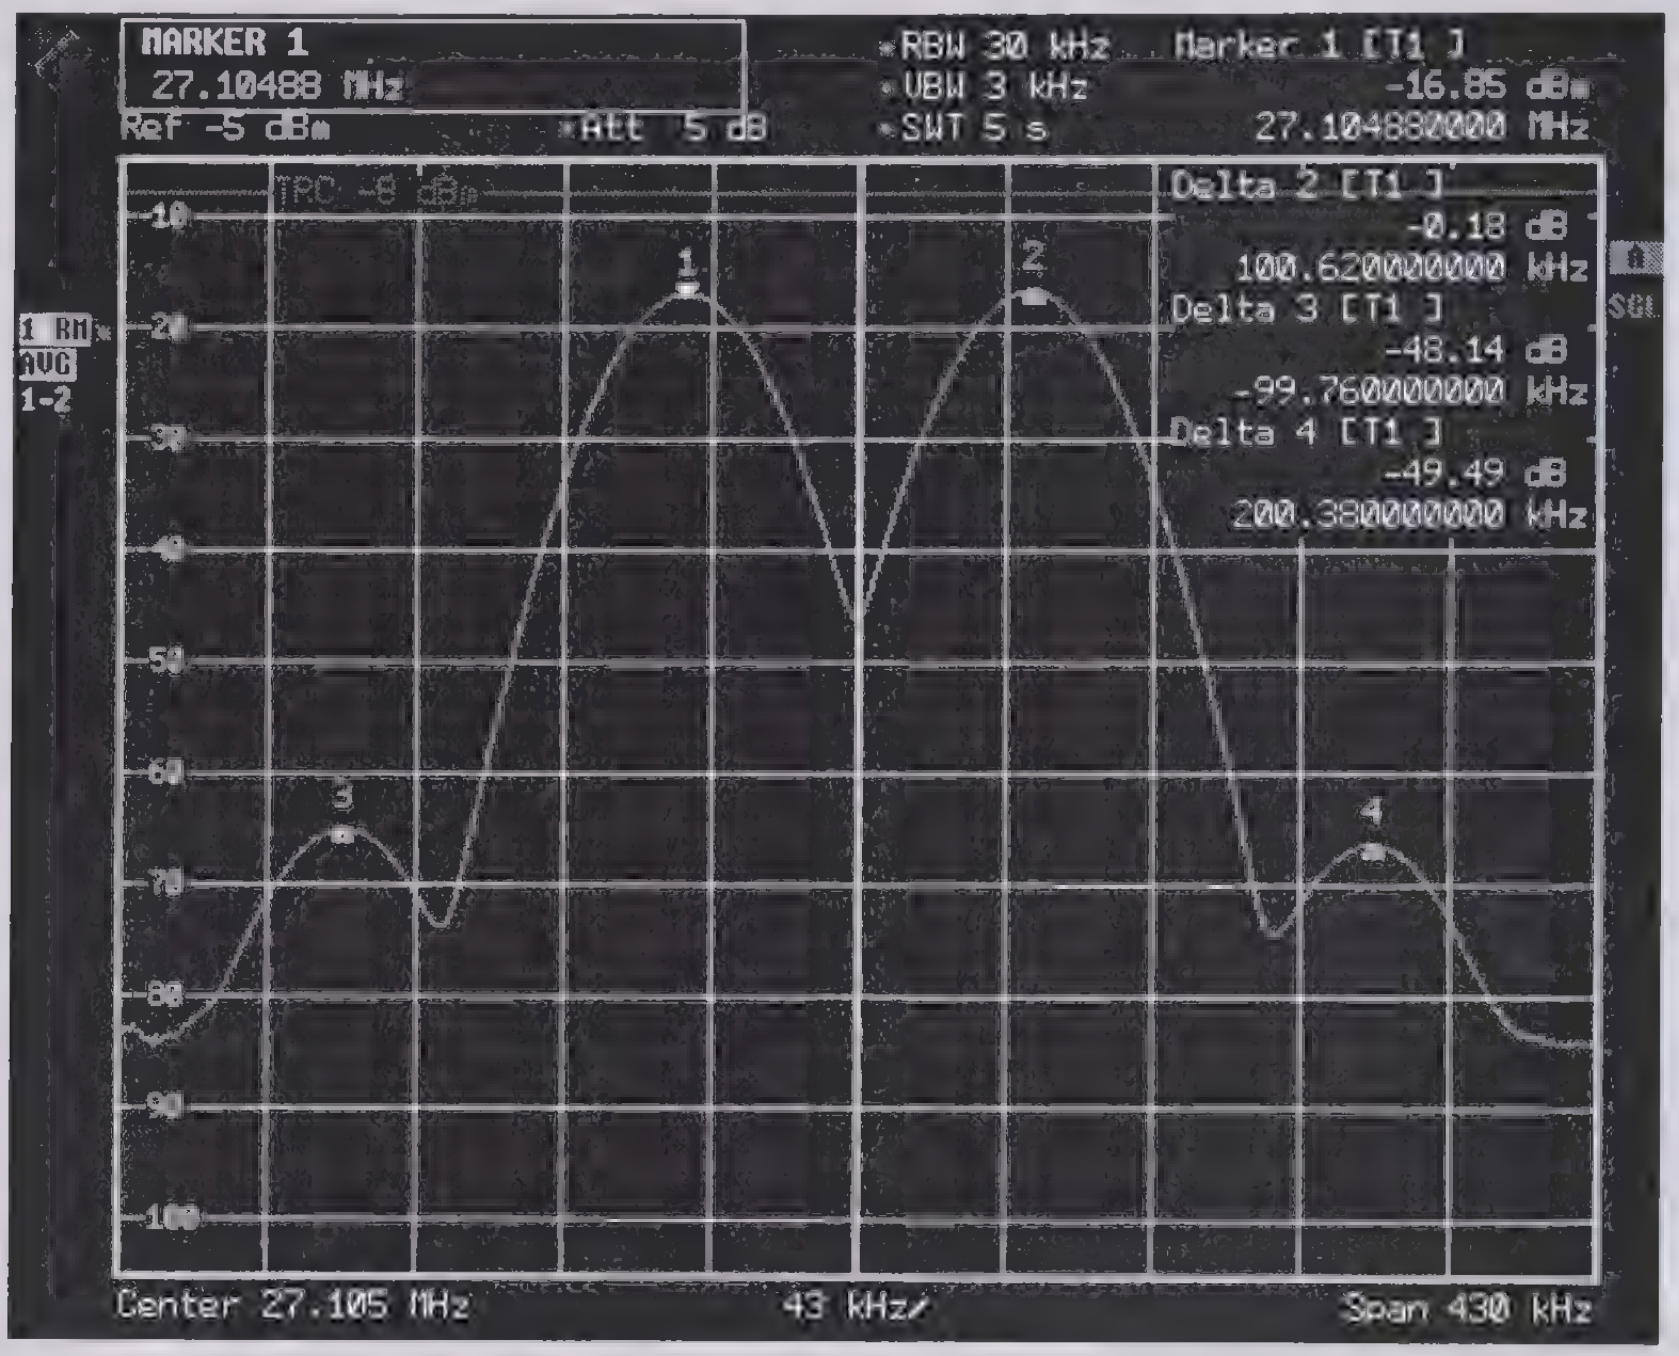
```
MARKER 1                        *RBW 30 kHz   Marker 1 [T1 ]
 27.10488 MHz                   *VBW 3 kHz         -16.85 dBm
Ref -5 dBm          *Att 5 dB   *SWT 5 s      27.104880000 MHz
                                              Delta 2 [T1 ]
                                                    -0.18 dB
                                              100.620000000 kHz
                                              Delta 3 [T1 ]
                                                   -48.14 dB
                                              -99.760000000 kHz
                                              Delta 4 [T1 ]
                                                   -49.49 dB
                                              200.380000000 kHz
Center 27.105 MHz               43 kHz/              Span 430 kHz
```

Fig. 14-1 Examples of level measurement with different settings of *PEAK EXCURSION*

The following table lists the signals as indicated by marker numbers in the diagram above, as well as the minimum of the amplitude decrease to both sides of the signal:

signal #	min. amplitude decrease to both sides of the signal
1	30 dB
2	29.85 dB
3	7 dB
4	7 dB

With **40 dB peak excursion**, NEXT PEAK, NEXT PEAK RIGHT and NEXT PEAK LEFT will not find any signal, as the signal level does not decrease by more than 30 dB to either side of any signal.

Order of signals detected:

PEAK:	signal 1
NEXT PEAK:	signal 1 (no further signal detected)

or

PEAK:	signal 1
NEXT PEAK LEFT:	signal 1 (no further signal detected)
NEXT PEAK RIGHT:	signal 1 (no further signal detected)

With **20 dB peak excursion**, NEXT PEAK and NEXT PEAK RIGHT will also detect signal 2, as the signal level decreases at least by 29.85 dB to either side of this signal, which is now greater than the peak excursion.

Order of signals detected:

PEAK: Signal 1
NEXT PEAK: Signal 2
NEXT PEAK: Signal 2 (no further signal detected)

or

PEAK: Signal 1
NEXT PEAK LEFT: Signal 1 (no further signal detected)
NEXT PEAK RIGHT: Signal 2
NEXT PEAK RIGHT: Signal 2 (no further signal detected)

With **6 dB peak excursion**, all signals will be detected with NEXT PEAK and NEXT PEAK RIGHT / NEXT PEAK LEFT.
Order of signals detected:

Order of signals detected:

PEAK: Signal 1
NEXT PEAK: Signal 2
NEXT PEAK: Signal 3
NEXT PEAK: Signal 4

or

PEAK: Signal 1
NEXT PEAK LEFT: Signal 3
NEXT PEAK RIGHT: Signal 1
NEXT PEAK RIGHT: Signal 2
NEXT PEAK RIGHT. Signal 4

EXCLUDE LO

The *EXCLUDE LO* softkey limits the frequency range for the marker search functions or disables the limit.

activated	Because of the feedthrough of the first local oscillator to the first intermediate frequency at the input mixer, the LO is represented as a signal at 0 Hz. To avoid the marker jumping to the LO at 0 Hz with the peak function when setting the display range, this frequency is excluded. The minimum frequency to which the marker jumps, is ≥ 6 × resolution bandwidth (RBW).
deactivated	No restriction to the search range. The frequency 0 Hz is included in the marker search functions.

IEC/IEEE-bus command: `CALC:MARK:LOEX ON`

Power Measurements – Hardkey *MEAS*

With its power measurement functions the R&S FSMR is able to measure all the necessary parameters with high accuracy in a wide dynamic range.

A modulated carrier is almost always used (except e.g. SSB-AM) for high-frequency transmission of information. Due to the information modulated upon the carrier, the latter covers a spectrum which is defined by the modulation, the transmission data rate and the signal filtering. Within a transmission band each carrier is assigned a channel taking into account these parameters. In order to ensure error-free transmission, each transmitter must be conforming to the specified parameters. These include among others:

- the output power,
- the occupied bandwidth, i.e. the bandwidth which must contain a defined percentage of the power and
- the power dissipation allowed in the adjacent channels.

Additionally the menu contains functions to determine the modulation depth of AM modulated signals and to measure the 3rd order intercept point.

The measurements and the corresponding settings are selected in the *MEAS* menu.

MEAS menu:

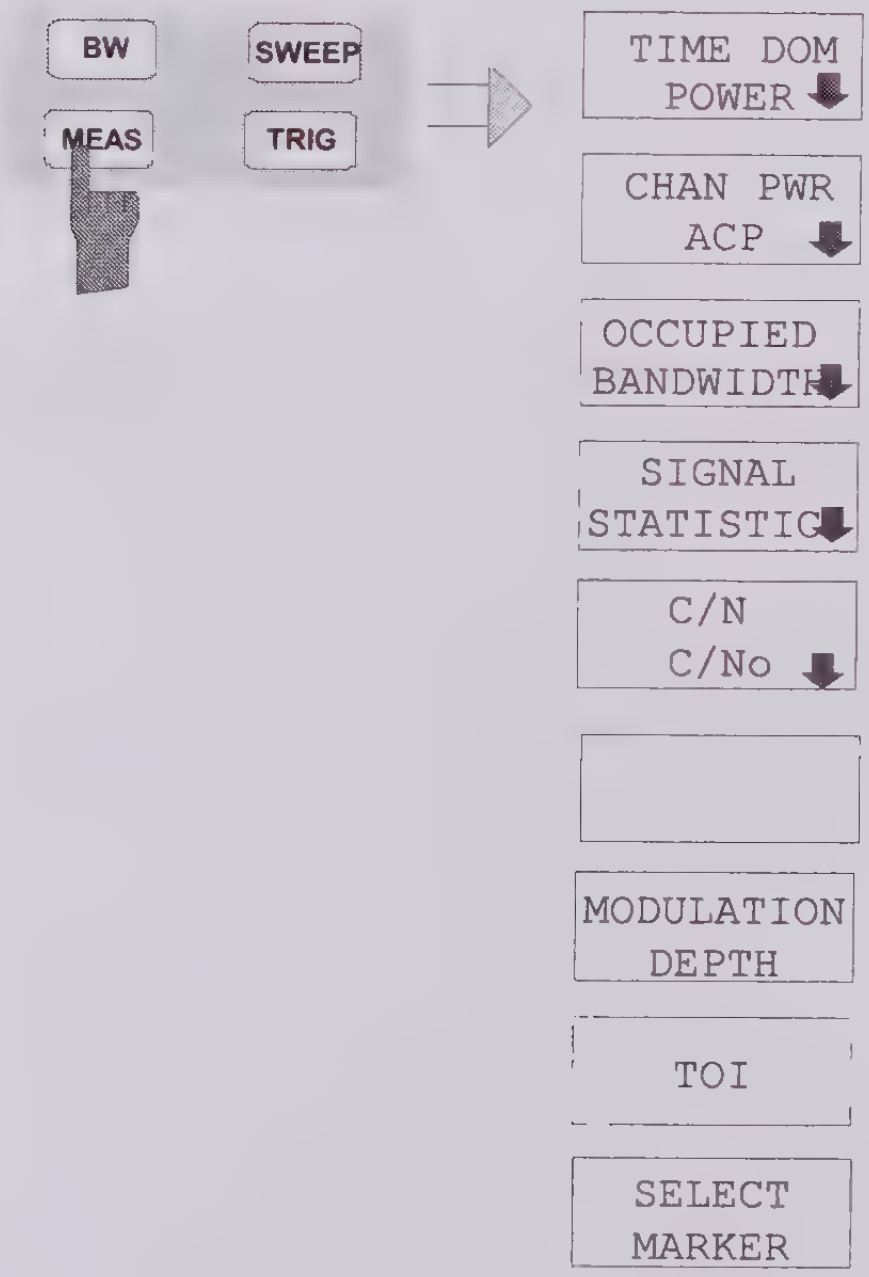

The *MEAS* key opens the menu to select and set the power measurement.

The following measurements can be selected:

- Power in the time domain (*TIME DOM POWER*)
- Channel power and adjacent-channel power in the frequency domain with a single carrier (*CHAN PWR ACP*)
- Channel power and adjacent-channel power in the frequency domain with several carriers (*MULT CARR ACP*)
- Occupied bandwidth (*OCCUPIED BANDWIDTH*)
- Carrier-to-noise ratio (*C/N, C/No*)
- Amplitude probability distribution (*SIGNAL STATISTICS*)
- Modulation depth (*MODULATION DEPTH*)
- 3rd order intercept (*TOI*)

The above measurements are carried out alternatively.

Power Measurement in Time Domain

With the aid of the power measurement function, the R&S FSMR determines the power of the signal in the time domain (SPAN = 0 Hz) by summing up the power at the individual pixels and dividing the result by the number of pixels. In this way it is possible to measure for example the power of TDMA signals during transmission or during the muting phase. Both the mean power and the rms power can be measured by means of the individual power values.
The result is displayed in the marker info field.

The measured values are updated after each sweep or averaged over a user-defined number of sweeps (*AVERAGE ON/OFF* and *NUMBER OF SWEEPS*) in order to determine e.g. the mean power over several bursts. For determination of the peak value (*MAX HOLD ON*) the maximum value from several sweeps is displayed.

Example:
Marker info field for: *MEAN* selected, *AVERAGE ON* and *MAX HOLD ON*:

```
MEAN HOLD      -2.33 dBm
MEAN AV        -2.39 dBm
```

If both the on and off phase of a burst signal are displayed, the measurement range can be limited to the transmission or to the muting phase with the aid of vertical lines. The ratio between signal and noise power of a TDMA signal for instance can be measured by using a measurement as a reference value and after that varying the measurement range.

Upon switching on power measurement the sample detector is activated (*TRACE-DETECTOR-SAMPLE).*

Submenu *MEAS - TIME DOM POWER*:

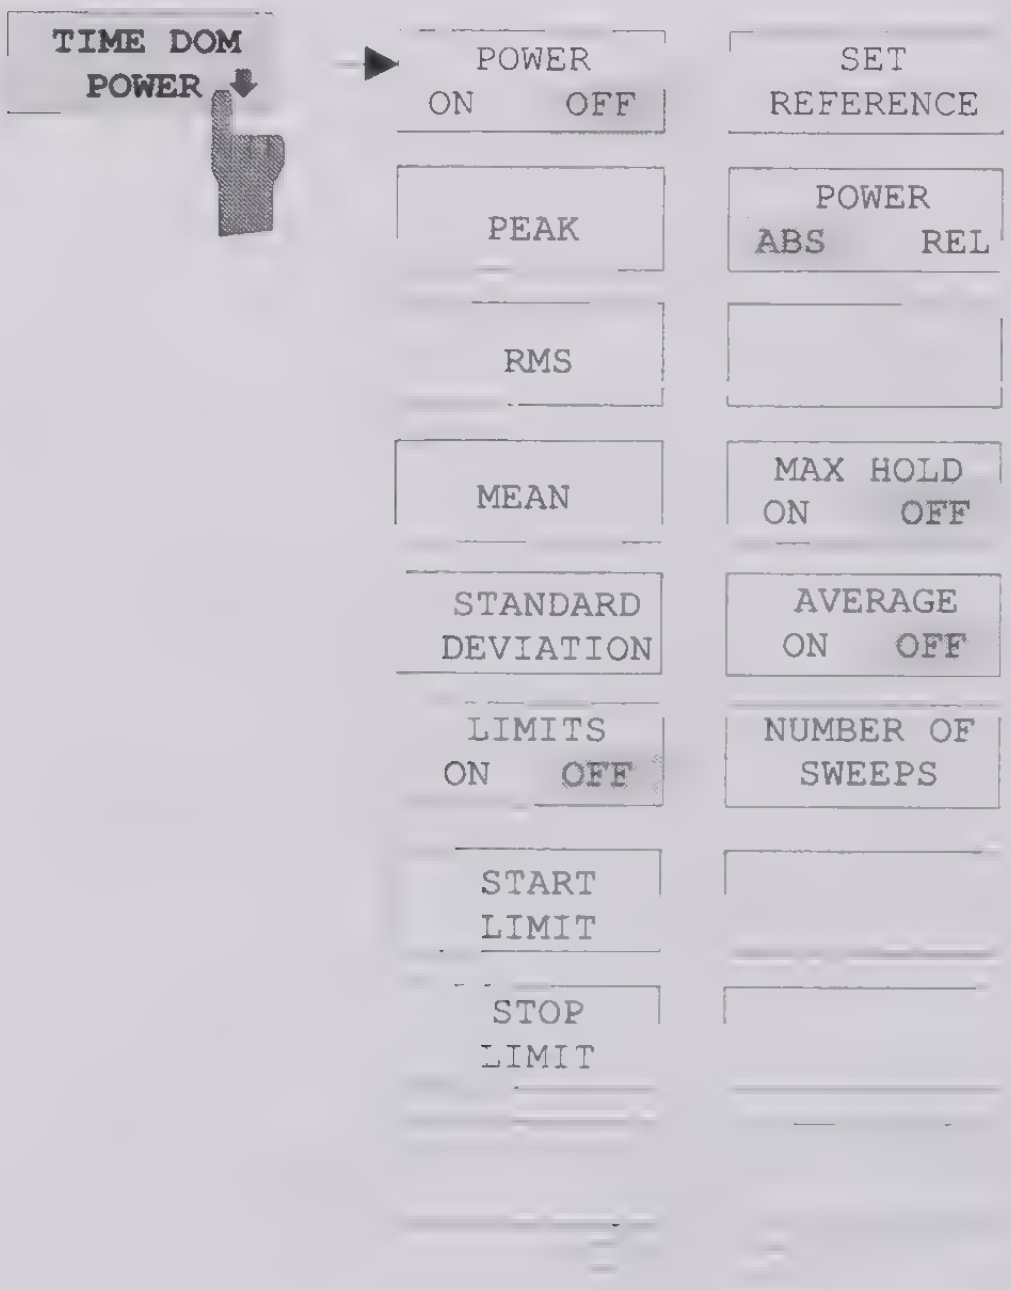

The *TIME DOM POWER* softkey activates the power measurement in the time domain and opens a submenu for configuration of the power measurement.

The submenu allows selection of the type of power measurement (rms or mean power), the settings for max hold and averaging as well as the definition of limits.

The power evaluation range can be limited by input of limit values.

Note: *This softkey is only available in time domain (SPAN = 0).*

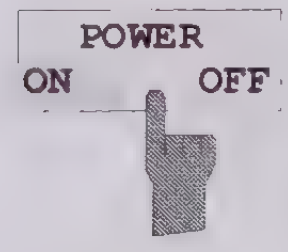

The *POWER ON/OFF* softkey switches the power measurement on and off. When entering the submenu it is *ON* since the power measurement is already switched on with the *TIME DOM POWER* softkey in the main menu.

Note: *The measurement is performed on the trace on which marker 1 is placed. To evaluate another trace, marker 1 should be set on another trace using the SELECT TRACE softkey in menu MKR.*

IEC/IEEE-bus command:

```
CALC:MARK:FUNC:SUMM:PPE ON
CALC:MARK:FUNC:SUMM:PPE:RES?
CALC:MARK:FUNC:SUMM:RMS ON
CALC:MARK:FUNC:SUMM:RMS:RES?
CALC:MARK:FUNC:SUMM:MEAN ON
CALC:MARK:FUNC:SUMM:MEAN:RES?
CALC:MARK:FUNC:SUMM:SDEV ON
CALC:MARK:FUNC:SUMM:SDEV:RES?
```

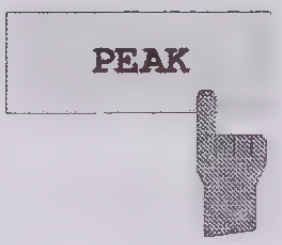

The *PEAK* softkey switches on the calculation of the peak value from the points of the displayed trace or a segment thereof.

For the maximum peak, the largest peak value obtained since the activation of *MAX HOLD ON* is displayed.

With *AVERAGE ON*, the peak values of a trace are averaged over several sweeps and displayed.

The number of sweeps over which the average or the maximum value is calculated is set with the *NUMBER OF SWEEPS* softkey.

IEC/IEEE-bus command:

```
CALC:MARK:FUNC:SUMM:PPE ON
CALC:MARK:FUNC:SUMM:PPE:RES?
```

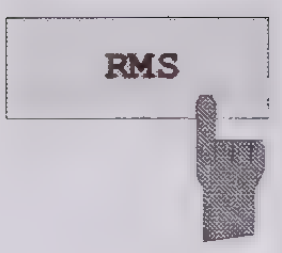

The *RMS* softkey switches on the calculation of the rms value from the points of the displayed trace or a segment of it.

For the maximum peak, the largest rms value obtained since the activation of *MAX HOLD ON* is displayed.

With *AVERAGE ON*, the rms values of a trace are averaged over several sweeps and displayed.

The number of sweeps over which the average or the maximum value is calculated is set with the *NUMBER OF SWEEPS* softkey.

IEC/IEEE-bus command:

```
CALC:MARK:FUNC:SUMM:RMS ON
CALC:MARK:FUNC:SUMM:RMS:RES?
```



The *MEAN* softkey switches on the calculation of the mean value from the points of the displayed trace or a segment of it. The linear mean value of the equivalent voltages is calculated.

This can be used for instance to measure the mean power during a GSM burst.

For the maximum peak, the largest mean value obtained since the activation of *MAX HOLD ON* is displayed.

With *AVERAGE ON*, the mean values of a trace are averaged over several sweeps and displayed.

The number of sweeps over which the average or the maximum value is calculated is set with the *NUMBER OF SWEEPS* softkey.

IEC/IEEE-bus command: `CALC:MARK:FUNC:SUMM:MEAN ON`
`CALC:MARK:FUNC:SUMM:MEAN:RES?`

The *STANDARD DEVIATION* softkey switches on the calculation of the standard deviation of trace points from the mean value and outputs them as measured value. The measurement of the mean power is automatically switched on at the same time.

For the maximum peak, the largest standard deviation obtained since the activation of *MAX HOLD ON* is displayed.

With *AVERAGE ON*, the standard deviations of a trace are averaged over several sweeps and displayed.

The number of sweeps over which the average or the maximum value is calculated is set with the *NUMBER OF SWEEPS* softkey.

IEC/IEEE-bus command: `CALC:MARK:FUNC:SUMM:SDEV ON`
`CALC:MARK:FUNC:SUMM:SDEV:RES?`

The *LIMIT ON/OFF* softkey selects the limited (*ON*) or non-limited (*OFF*) evaluation range.

The evaluation range is defined by the *START LIMIT* and *STOP LIMIT* softkeys. If *LIMIT = ON*, signals are only searched between the two lines.

If only one limit line is switched on, time line 1 is the lower limit and the upper limit corresponds to the stop frequency. If time line 2 is also switched on, it defines the upper limit.

If no limit line is switched on, the evaluation range is not limited.

The default setting is *LIMIT = OFF*.

IEC/IEEE-bus command: `CALC:MARK:X:SLIM OFF`

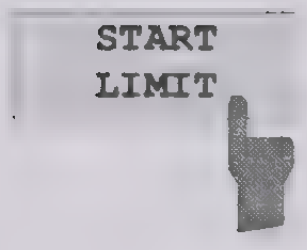

The *START LIMIT* softkey activates the entry of the lower limit of the evaluation range.

IEC/IEEE-bus command: `CALC:MARK:X:SLIM:LEFT <value>`

STOP LIMIT

The *STOP LIMIT* softkey activates the entry of the upper limit of the evaluation range.

IEC/IEEE-bus command:
```
CALC:MARK:X:SLIM:RIGH <value>
```

SET REFERENCE

The *SET REFERENCE* softkey sets the power values currently measured as reference values for the calculation of the mean value (*MEAN)* and the rms value (*RMS*). The reference values are used to perform relative measurements.

If the calculation of the mean value (*MEAN)* and rms value (*RMS)* is not switched on, 0 dBm is used as a reference value.

If the average value (*AVERAGE)* or maximum value (*MAX HOLD*) is calculated over several sweeps, the current value is the measured value summed up at the actual time.

IEC/IEEE-bus command:
```
CALC:MARK:FUNC:SUMM:REF:AUTO ONCE
```

POWER ABS REL

The *POWER ABS/REL* softkey selects the absolute power measurement (default setting) or relative power measurement. The reference value for the relative power is defined by *SET REFERENCE.*

The value 0 dBm is used if the reference value is not defined.

IEC/IEEE-bus command:
```
CALC:MARK:FUNC:SUMM:MODE ABS
```

MAX HOLD ON OFF

The *MAX HOLD ON/OFF* softkey switches the display of the maximum peak obtained from measurements at successive sweeps on and off.

The displayed maximum peak is only updated at the end of a sweep if a higher value has occurred.

The maximum value can be reset by switching the *MAX HOLD ON / OFF* softkey off and on again.

IEC/IEEE-bus command:
```
CALC:MARK:FUNC:SUMM:PHOL ON
CALC:MARK:FUNC:SUMM:PPE:PHOL:RES?
CALC:MARK:FUNC:SUMM:RMS:PHOL:RES?
CALC:MARK:FUNC:SUMM:MEAN:PHOL:RES?
CALC:MARK:FUNC:SUMM:SDEV:PHOL:RES?
```

AVERAGE ON OFF

The *AVERAGE ON/OFF* softkey switches averaging over successive sweep measurements on and off.

The measured values can be reset by switching the *AVERAGE ON / OFF* softkey off and on again.

IEC/IEEE-bus command:
```
CALC:MARK:FUNC:SUMM:AVER ON
CALC:MARK:FUNC:SUMM:PPE:AVER:RES?
CALC:MARK:FUNC:SUMM:RMS:AVER:RES?
CALC:MARK:FUNC:SUMM:MEAN:AVER:RES?
CALC:MARK:FUNC:SUMM:SDEV:AVER:RES?
```

NUMBER OF SWEEPS

The *NUMBER OF SWEEPS* softkey activates the entry of the number of sweeps for maximum or average value calculation.

SINGLE SWEEP mode	The R&S FSMR performs sweeps until the selected number of sweeps is reached and stops then.
CONTINUOUS SWEEP mode	Averaging is carried out until the selected number of sweeps is reached. After that, averaging is performed in continuous mode. and is then continued as running averaging. Calculation of the maximum peak (*MAX HOLD*) is performed continuously irrespective of the selected number of sweeps.

The valid range values is 0 to 32767.

Depending on the specified number of sweeps, averaging is carried out according to the following rules:

NUMBER OF SWEEPS = 0	Continuous averaging is carried out over 10 measured values.
NUMBER OF SWEEPS = 1	No averaging is carried out.
NUMBER OF SWEEPS > 1	Averaging is carried out over the set number of measured values.

Note: *This setting is equivalent to the setting of the sweep count in the TRACE menu.*

IEC/IEEE-bus command: `SWE:COUN <value>`

Example:

The mean power of a GSM burst with 0 dBm nominal power at 800 MHz is to be measured.

[**PRESET**]	Set the R&S FSMR to the default setting.
[**FREQ:** *CENTER*: 800 **MHz**]	Set the center frequency to 800 MHz.
[**SPAN**: *ZERO SPAN*]	Select time domain display (span = 0 Hz).
[**AMPT**: 0 **dBm**]	Set the reference level to 0 dBm.
[**BW**: *RES BW MANUAL*: 30 **kHz**]	Set the resolution bandwidth to 30 kHz in line with the requirements of the GSM standard.
[**SWEEP**: *SWEEPTIME MANUAL* 600 µs]	Set the sweep time to 600 µs.
[**TRIG**: *VIDEO*: 50 **%**]	Use the video signal as trigger source.
[**MEAS**]	Call the menu for the measurement functions.
[*TIME DOM POWER*]	Select power measurement in the time domain. The R&S FSMR calculates the mean power from the points of the whole trace. The submenu for configuration of the power measurement is opened. *MEAN* is already switched on.
[*LIMITS ON*]	Activate the limitation of the time domain of the power measurement .
[*START LIMIT*: 250 **µs**]	Set the start of the power measurement at 250 µs.
[*STOP LIMIT*: 500 **µs**]	Set the end of the power measurement at 500 µs.

Channel and Adjacent-Channel Power Measurements

For all channel and adjacent-channel power measurements a specified channel configuration is assumed which is for instance based on a specific radiocommunication system.
This configuration is defined by the nominal channel frequency (= center frequency of the R&S FSMR if only one carrier is active), the channel bandwidth, the channel spacing, the adjacent-channel bandwidth and the adjacent-channel spacing. The R&S FSMR is able to simultaneously measure the power in up to four transmission channels and up to three adjacent channels (10 channels: 4 transmission channels, 3 lower and 3 upper adjacent channels).
It offers two methods for channel and adjacent-channel power measurement:

- The integrated bandwidth method (IBW method), i.e. the integration of trace pixels within the bandwidth of the channel to be measured to the total power of the channel,
- The measurement in time domain (Fast ACP) by means of steep resolution filters simulating the channel.

The two measurements yield the same results. The measurement in time domain can be performed much faster since the complete signal is measured within a channel at the same time. With the IBW method, the channel is divided into subspectra. This is done by means of a bandwidth which is small compared to the channel bandwidth. These subspectra are then combined by integration of the trace pixels.

With the IBW method, the transmission channels or adjacent channels are marked by vertical lines at a distance of half the channel bandwidth to the left and to the right of the corresponding channel center frequency(see Fig. 4.16-1).
With the time-domain method, the power versus time is shown for each channel. The boundaries of the channels are marked by vertical lines (see Fig. 4.16-2).

For both methods, the results are listed in tables in the lower half of the screen.
The R&S FSMR offers predefined standard settings which can be selected from a table for the common mobile radio standards. Thus, channel configuration is performed automatically without the need to enter the corresponding parameters manually.
For some standards, the channel power and the adjacent-channel power are to be weighted by means of a root-raised cosine filter corresponding to a receive filter. This type of filtering is switched on automatically for both methods on selecting the standard (e.g. NADC, TETRA or 3GPP W-CDMA).

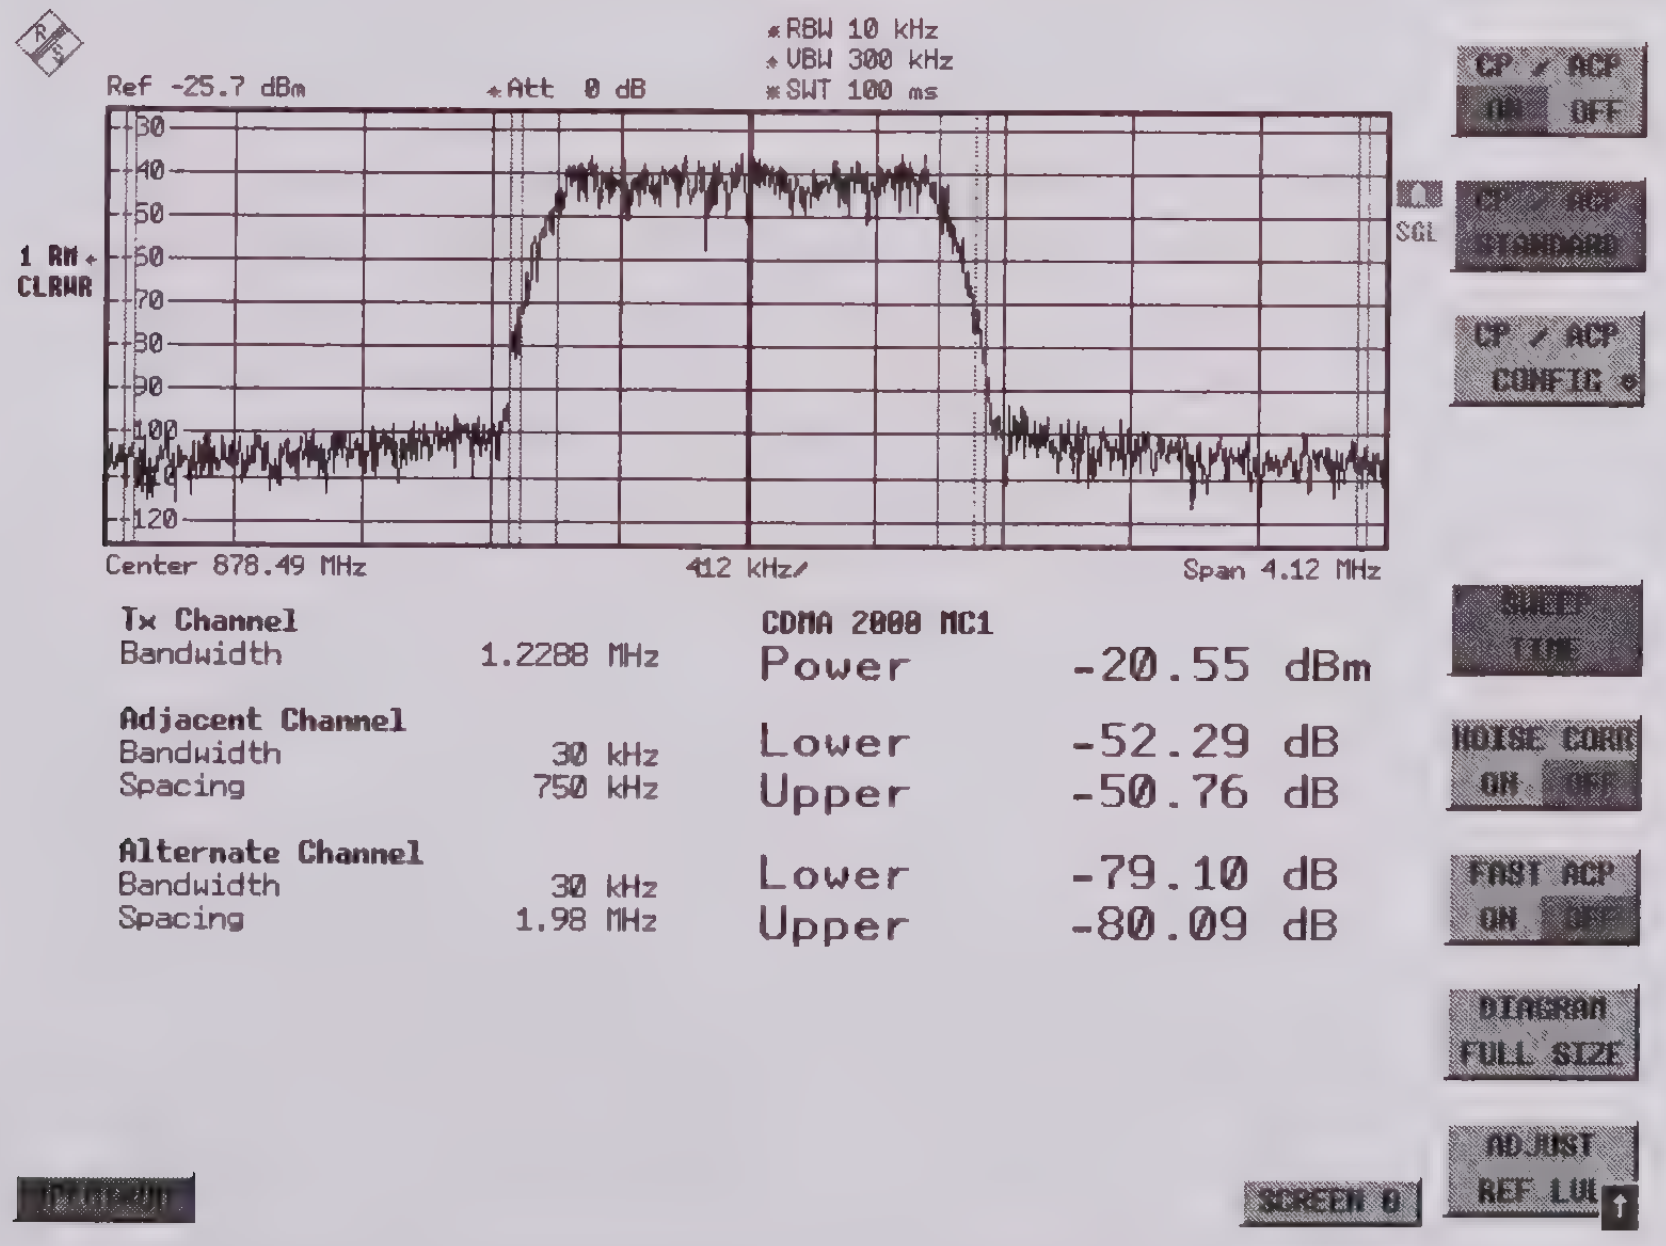

```
Tx Channel                          CDMA 2000 MC1
Bandwidth            1.2288 MHz     Power     -20.55 dBm

Adjacent Channel
Bandwidth                30 kHz     Lower     -52.29 dB
Spacing                 750 kHz     Upper     -50.76 dB

Alternate Channel
Bandwidth                30 kHz     Lower     -79.10 dB
Spacing                1.98 MHz     Upper     -80.09 dB
```

Fig. 4.16-1 Screen display of adjacent-channel power measurement using the IBW method

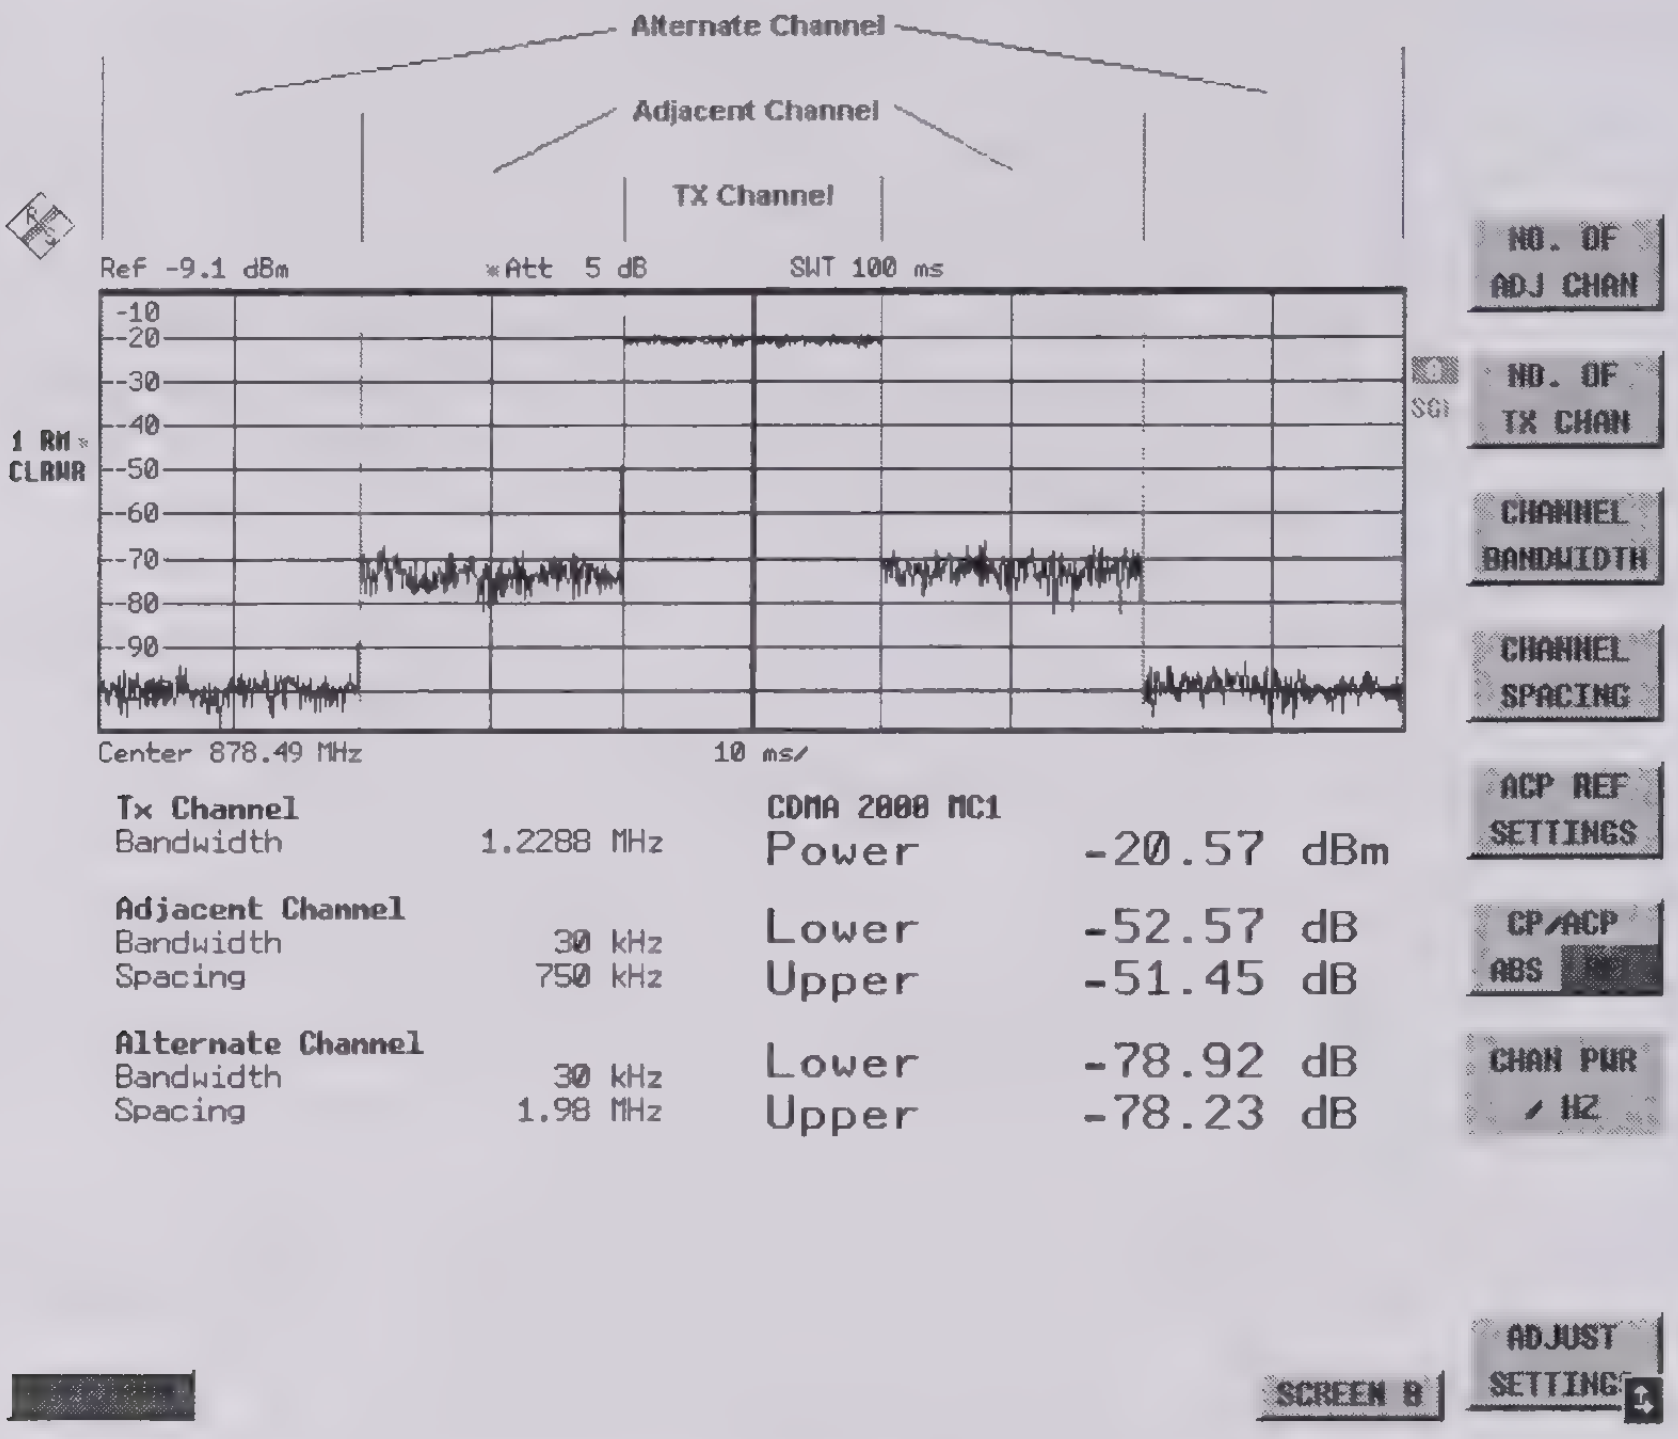

```
Tx Channel                      CDMA 2000 MC1
Bandwidth         1.2288 MHz    Power        -20.57 dBm

Adjacent Channel
Bandwidth             30 kHz    Lower        -52.57 dB
Spacing              750 kHz    Upper        -51.45 dB

Alternate Channel
Bandwidth             30 kHz    Lower        -78.92 dB
Spacing             1.98 MHz    Upper        -78.23 dB
```

Fig. 4.16-2 Screen display of adjacent-channel power measurement using the time-domain method

Limit values for the adjacent-channel power can be defined for the measurement. If limit checking is switched on, a pass/fail information indicating that the power has been exceeded is displayed during the measurement in the table in the lower half of the screen.

Note: *With the CP/ACP measurement switched on the functions SPLIT SCREEN and FULL SCREEN are inhibited.*

The channel configuration is defined in the *MEAS - CHAN PWR ACP or the MEAS - MULT CARR ACP* menu.

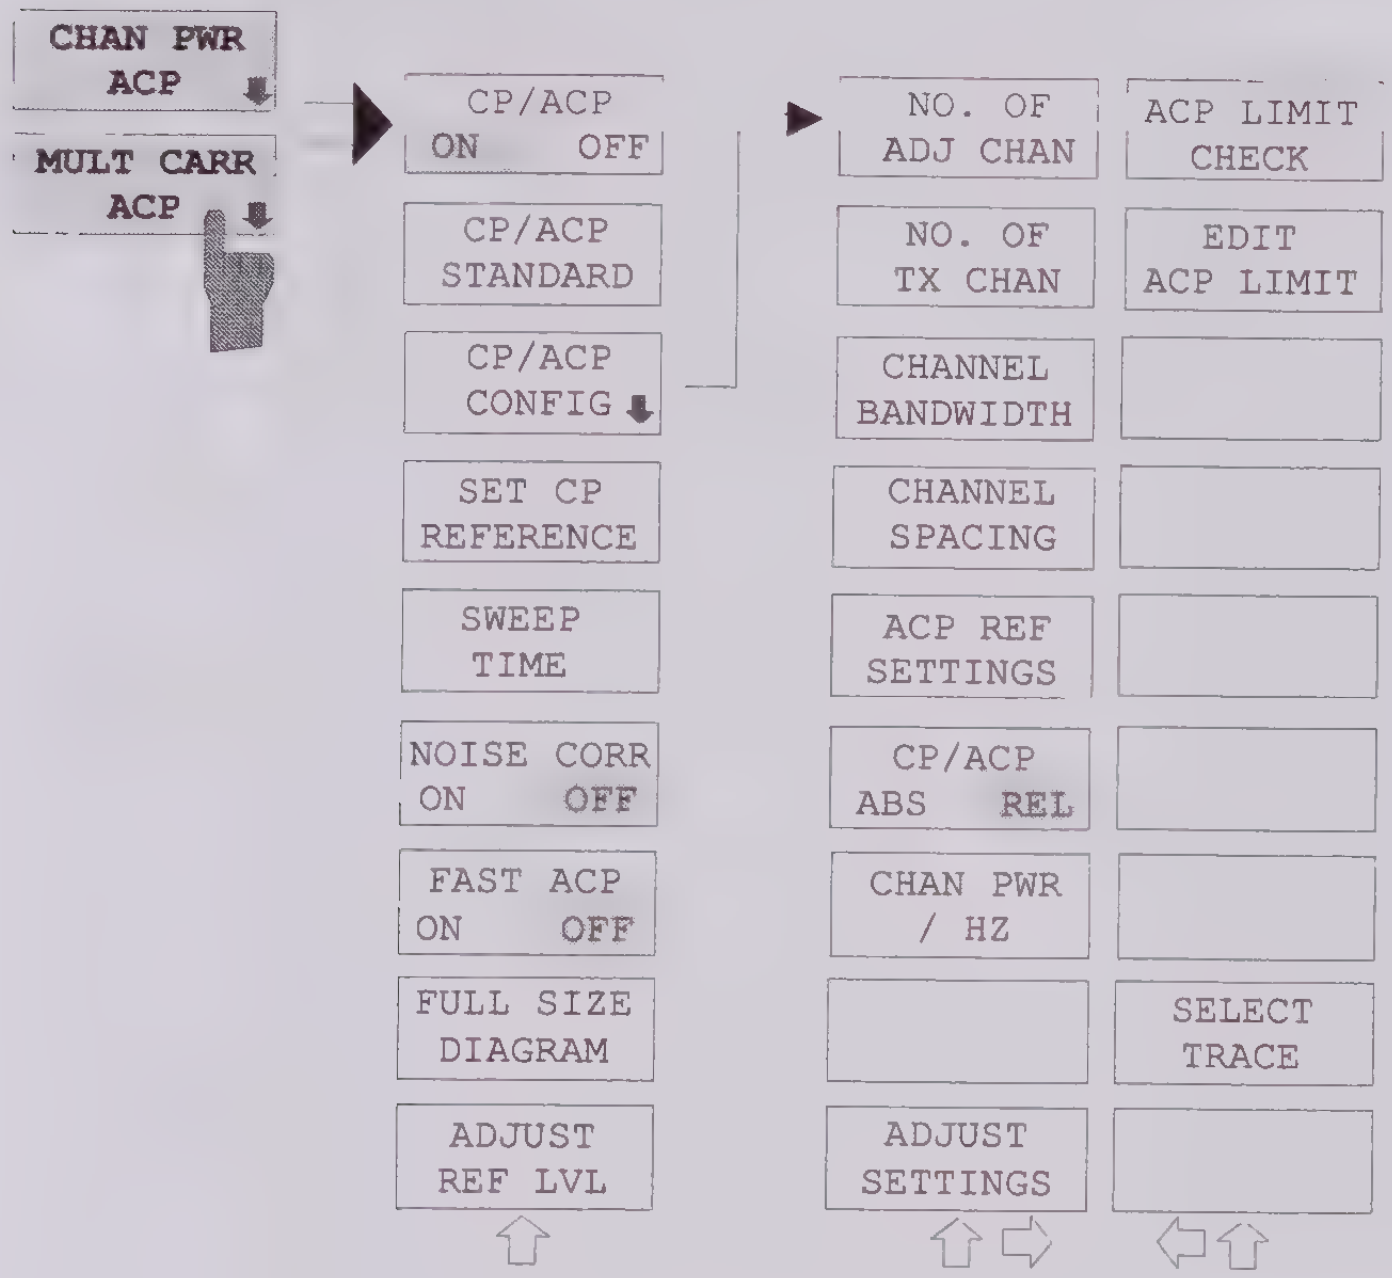

The *CHAN PWR ACP* and *MULT CARR ACP softkeys* activate channel or adjacent-channel power measurement either for a single carrier signal (*CHAN PWR ACP*) or for several carrier signals (*MULT CARR ACP*), depending on the current measurement configuration. In addition, they open a submenu for defining the parameters for channel power measurement. The softkey selected is shown in colour to indicate that a channel or adjacent-channel power measurement is active.

Note: *The softkeys are available only for measurements in the frequency domain (span > 0).*

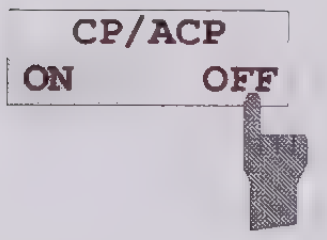

The *CP/ACP ON/OFF* softkey switches calculation of the channel power or adjacent-channel power on and off.

With default settings the measurement is performed by integrating the powers at the display points within the specified channels (IBW method).

The powers of the adjacent channels are measured either as absolute values or as relative values referenced to the power of a transmission channel. The default setting is relative-value measurement (see *CP/ACP ABS/REL* softkey).

When multicarrier ACP measurement is activated, the number of test points is increased to ensure that adjacent-channel powers are measured with adequate accuracy.

IEC/IEEE-bus commands:

```
CALC:MARK:FUNC:POW:SEL CPOW|ACP|MCAC
CALC:MARK:FUNC:POW:RES? CPOW|ACP|MCAC
CALC:MARK:FUNC:POW OFF
```

CP/ACP STANDARD

The *CP/ACP STANDARD* softkey opens a table for the selection of the settings according to predefined standards. The test parameters for the channel and adjacent-channel measurements are set according to the mobile radio standard.

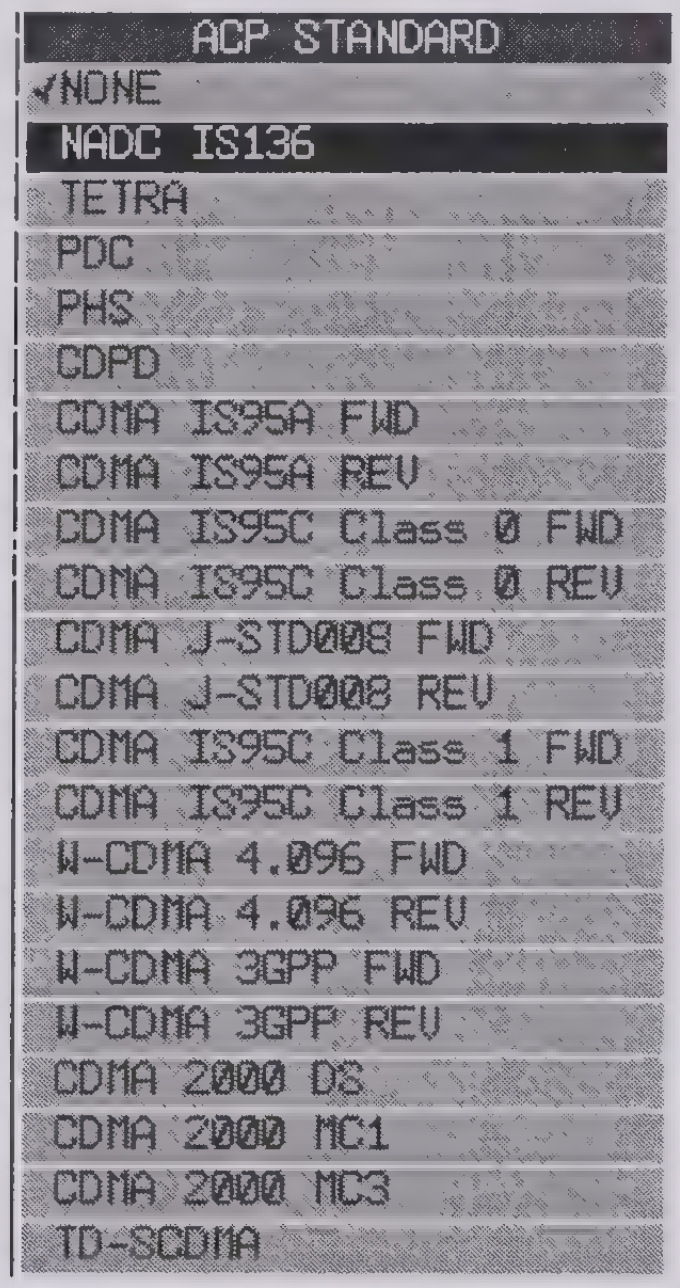

ACP STANDARD
- ✓NONE
- NADC IS136
- TETRA
- PDC
- PHS
- CDPD
- CDMA IS95A FWD
- CDMA IS95A REV
- CDMA IS95C Class 0 FWD
- CDMA IS95C Class 0 REV
- CDMA J-STD008 FWD
- CDMA J-STD008 REV
- CDMA IS95C Class 1 FWD
- CDMA IS95C Class 1 REV
- W-CDMA 4.096 FWD
- W-CDMA 4.096 REV
- W-CDMA 3GPP FWD
- W-CDMA 3GPP REV
- CDMA 2000 DS
- CDMA 2000 MC1
- CDMA 2000 MC3
- TD-SCDMA

The standards available are listed in the table on the left.

Note: *For the R&S FSMR, the channel spacing is defined as the distance between the center frequency of the adjacent channel and the center frequency of the transmission channel. The definition of the adjacent-channel spacing in standards IS95 B and C, IS97 B and C and IS98 B and C is different. These standards define the adjacent-channel spacing from the center of the transmission channel to the closest border of the adjacent channel. This definition is also used for the R&S FSMR when the following standard settings are selected:*
CDMA IS95 Class 0 FWD
CDMA IS95 Class 0 REV
CDMA IS95 Class 1 FWD
CDMA IS95 Class 1 REV

The selection of the standard influences the following parameters:
- channel spacing and adjacent-channel spacing
- channel bandwidth, adjacent-channel bandwidth, and type of filtering
- resolution bandwidth
- video bandwidth
- detector
- # of adjacent channels

Trace mathematics and trace averaging are switched off.
The reference level is not influenced by the selection of a standard. To achieve an optimum dynamic range, the reference level has to be set in a way that places the signal maximum close to the reference level without forcing an overload message.

The default setting is *CP/ACP STANDARD NONE.*

IEC/IEEE-bus command: `CALC:MARK:FUNC:POW:PRES <standard>`



See following section "Setting the Channel Configuration"

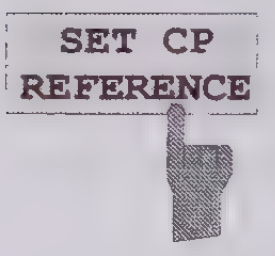

With channel power measurement activated, the *SET CP REFERENCE* softkey defines the currently measured channel power as the reference value. The reference value is displayed in the *CH PWR REF* field; the default value is 0 dBm.

In adjacent-channel power measurement with one or several carrier signals, the power is always referenced to a transmission channel, i.e. no value is displayed for *CH PWR REF*.

IEC/IEEE-bus command: `POW:ACH:REF:AUTO ONCE`

The *SWEEP TIME* softkey activates the entry of the sweep time. With the RMS detector, a longer sweep time increases the stability of the measurement results.
The function of the softkey is identical to the softkey *SWEEP TIME MANUAL* in the menu *BW*.

IEC/IEEE-bus command: `SWE:TIM <value>`



If the *NOISE CORR ON/OFF* softkey is activated, the results will be corrected by the instrument's inherent noise, which increases the dynamic range.
When the function is switched on, a reference measurement of the instrument's inherent noise is carried out. The noise power measured is then subtracted from the power in the channel that is being examined.
The inherent noise of the instrument depends on the selected center frequency, resolution bandwidth and level setting. Therefore, the correction function is disabled whenever one of these parameters is changed. A disable message is displayed on the screen.
To enable the correction function in conjunction with the changed setting, press the softkey once more. A new reference measurement is carried out.

IEC/IEEE-bus command: `SENS:POW:NCOR ON`

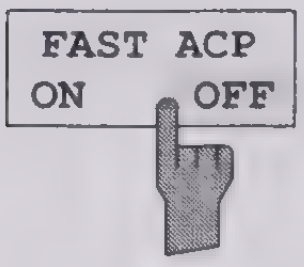

The *FAST ACP* softkey switches between the IBW method (*FAST ACP OFF*) and the time domain method (*FAST ACP ON*).

With *FAST ACP ON* the power measurement is performed in the different channels in the time domain. The R&S FSMR sets the center frequency consecutively to the different channel center frequencies and measures the power with the selected measurement time (= sweep time/number of channels). The RBW filters suitable for the selected standard and frequency offset are automatically used (e.g. root raised cos with IS 136). The list of available channel filters is included in section "Setting of Bandwidths and Sweep Time – *BW key"*.

The RMS detector is used for obtaining correct power measurement results. Therefore this requires no software correction factors.

Measured values are output as a list. The powers of the transmission channels are output in dBm, the powers of the adjacent channels in dBm *(CP/ACP ABS)* or dB *(CP/ACP REL)*.

The sweep time is selected depending on the desired reproducibility of results. Reproducibility increases with sweep time since power measurement is then performed over a longer time period.

As a general approach, it can be assumed that approx. 500 non-correlated measured values are required for a reproducibility of 0.5 dB (99% of the measurements are within 0.5 dB of the true measured value). This holds true for white noise. The measured values are considered as non-correlated when their time interval corresponds to the reciprocal of the measured bandwidth.

With IS 136 the measurement bandwidth is approx. 25 kHz, i.e. measured values at an interval of 40 µs are considered as noncorrelated. A measurement time of 20 ms is thus required per channel for 1000 measured values. This is the default sweep time which the R&S FSMR sets in coupled mode. Approx. 5000 measured values are required for a reproducibility of 0.1 dB (99%), i.e. the measurement time is to be increased to 200 ms.

IEC/IEEE-bus command `SENS:POW:HSP ON`

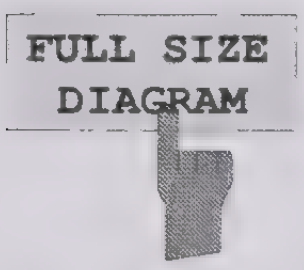

The *FULL SIZE DIAGRAM* softkey switches the diagram to full screen size.

IEC/IEEE-bus command: `DISP:WIND1:SIZE LARG|SMAL`

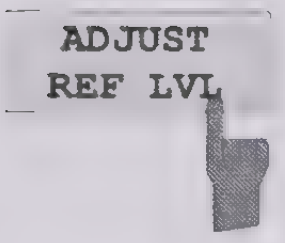

The *ADJUST REF LVL* softkey adjusts the reference level of the R&S FSMR to the measured channel power. This ensures that the settings of the RF attenuation and the reference level are optimally adjusted to the signal level without overloading the R&S FSMR or limiting the dynamic range by a too small S/N ratio.
Since the measurement bandwidth for channel power measurements is significantly lower than the signal bandwidth, the signal path may be overloaded although the trace is still significantly below the reference level.

IEC/IEEE-bus command: `SENS:POW:ACH:PRES:RLEV`

For manual setting of the test parameters different from the settings made with *ADJUST SETTINGS* the following should be observed:

Frequency span	The frequency span must at least cover the channels to be measured plus a measurement margin of 10%. For channel power measurement, the span is 1.1 x channel bandwidth. ***Note:*** *If the frequency span is large in comparison with the channel bandwidth (or the adjacent-channel bandwidths) being examined, only a few points*

on the trace are available per channel. This reduces the accuracy of the waveform calculation for the channel filter used, which has a negative effect on the measurement accuracy.
We therefore strongly recommend that the formulas mentioned be taken into consideration when selecting the frequency span.

Resolution bandwidth (RBW)

To ensure both an acceptable measurement speed and the required selection (to suppress spectral components outside the channel to be measured, especially of the adjacent channels), the resolution bandwidth must not be selected too small or too large. As a general approach, the resolution bandwidth is to be set to values between 1% and 4% of the channel bandwidth.
A larger resolution bandwidth can be selected if the spectrum within the channel to be measured and around it has a flat characteristic. In the standard setting, e.g. for standard IS95A REV at an adjacent channel bandwidth of 30 kHz, a resolution bandwidth of 30 kHz is used. This yields correct results since the spectrum in the neighbourhood of the adjacent channels normally has a constant level. For standard NADC/IS136 this is not possible for example, since the spectrum of the transmit signal penetrates into the adjacent channels and a too large resolution bandwidth causes a too low selection of the channel filter. The adjacent-channel power would thus be measured too high.

With the exception of the IS95 CDMA standards, the *ADJUST SETTINGS* softkey sets the resolution bandwidth (RBW) as a function of the channel bandwidth:

RBW $\leq$ 1/40 of channel bandwidth.

The maximum possible resolution bandwidth (with respect to the requirement RBW $\leq$ 1/40) resulting from the available RBW steps (1, 3) is selected .

Video bandwidth (VBW)

For a correct power measurement, the video signal must not be limited in bandwidth. A restricted bandwidth of the logarithmic video signal would cause signal averaging and thus result in a too low indication of the power (-2.51 dB at very low video bandwidths). The video bandwidth should therefore be selected at least three times the resolution bandwidth.

The *ADJUST SETTINGS* softkey sets the video bandwidth (VBW) as a function of the channel bandwidth as follows:

VBW $\geq 3 \times$ RBW.

The smallest possible VBW with regard to the available step size will be selected.

Detector

The *ADJUST SETTINGS* softkey selects the RMS detector.
The RMS detector is selected since it correctly indicates the power irrespective of the characteristics of the signal to be measured. In principle, the sample detector would be possible as well. Due to the limited number of trace pixels used to calculate the power in the channel, the sample detector would yield less stable results. Averaging, which is often performed to stabilize the measurement results, leads to a too low level indication and should therefore be avoided. The reduction in the displayed power depends on the number of averages and the signal characteristics in the channel to be measured.

Setting the Channel Configuration

MEAS - CP/ACP CONFIG submenu:

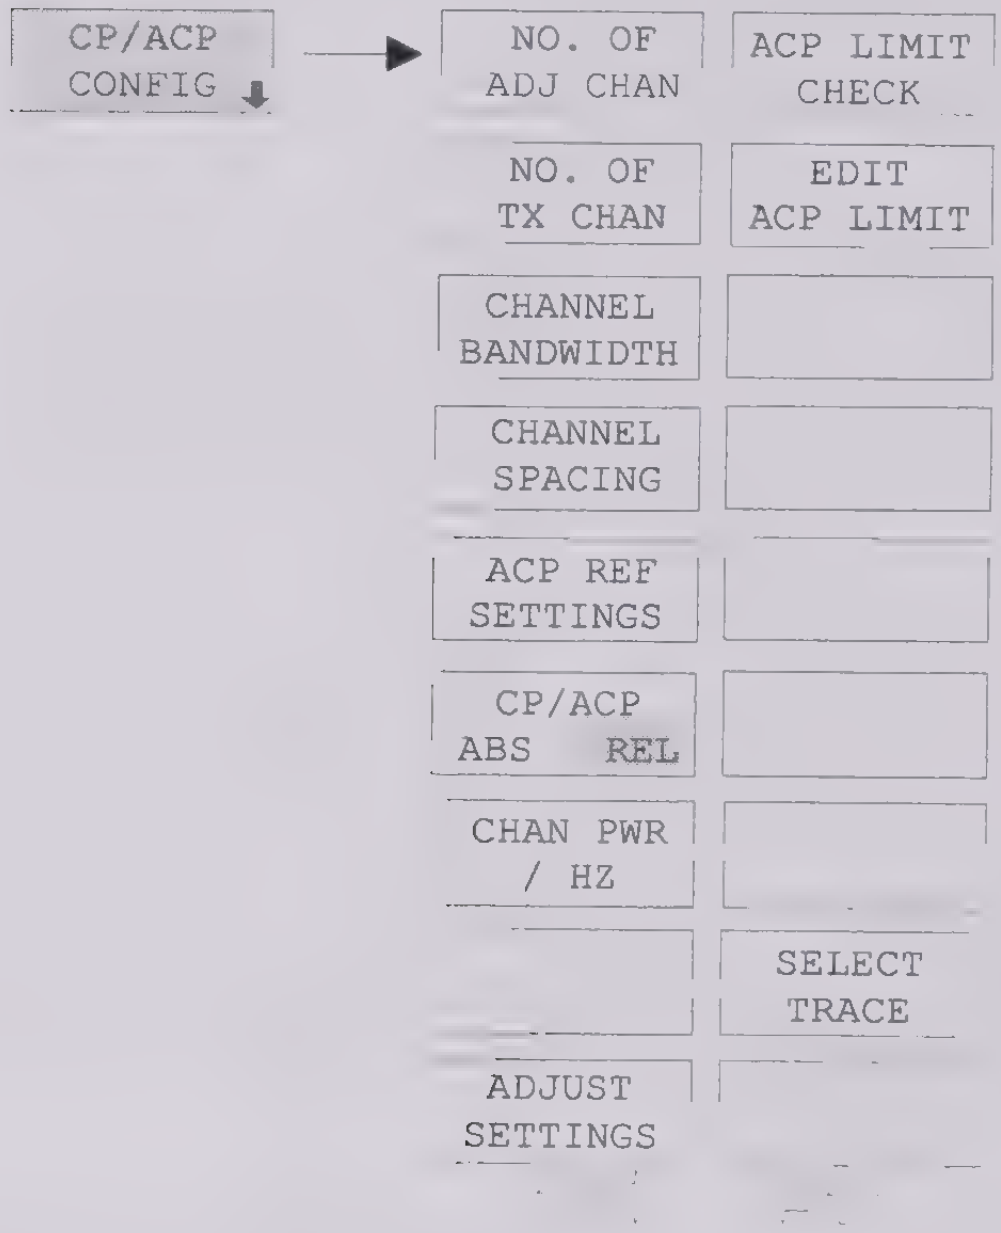

The *CP/ACP CONFIG* softkey opens a submenu for configuration of the channel power and adjacent channel power measurement independently of the offered standards.

The channel configuration includes the number of channels to be measured, the channel bandwidths (*CHANNEL BANDWIDTH*), and the channel spacings (*CHANNEL SPACING*).

Limit values can additionally be specified for the adjacent-channel power (*ACP LIMIT CHECK* and *EDIT ACP LIMITS*) which are checked for compliance during the measurement.

The *NO. OF ADJ CHAN* softkey activates the entry of the number ±n of adjacent channels to be considered in the adjacent-channel power measurement.
Numbers from 0 to 3 can be entered.

The following measurements are performed depending on the number of the channels.

0 Only the channel powers are measured.

1 The channel powers and the power of the upper and lower adjacent channel are measured.

2 The channel powers, the power of the upper and lower adjacent channel and of the next higher and lower channel (alternate channel 1) are measured.

3 The channel power, the power of the upper and lower adjacent channel, the power of the next higher and lower channel (alternate channel 1) and of the next but one higher and lower adjacent channel (alternate channel 2) are measured.

IEC/IEEE-bus command: `POW:ACH:ACP 1`

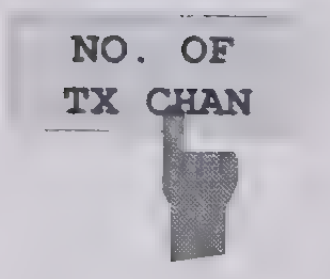

The *NO. OF TX CHAN* softkey enables the entry of the number of carrier signals to be considered in channel and adjacent-channel power measurements.

Numbers from 1 to 12 can be entered.

The softkey is available only for multicarrier ACP measurements.

IEC/IEEE-bus command: `SENS:POW:ACH:TXCH:COUN 4`

The *CHANNEL BANDWIDTH* softkey opens a table for defining the channel bandwidths for the transmission channels and the adjacent channels.

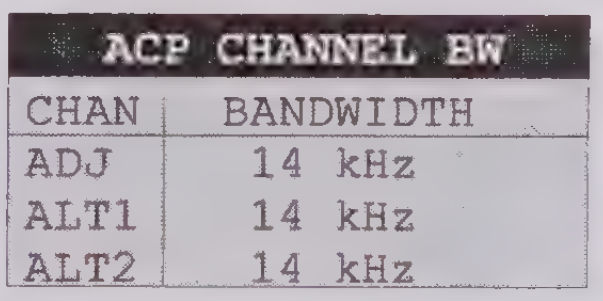

ACP CHANNEL BW	
CHAN	BANDWIDTH
ADJ	14 kHz
ALT1	14 kHz
ALT2	14 kHz

The transmission-channel bandwidth is normally defined by the transmission standard. The correct bandwidth is set automatically for the selected standard (see *CP/ACP STANDARD* softkey).

With the IBW method *(FAST ACP OFF)*, the channel bandwidth limits are marked by two vertical lines right and left of the channel center frequency. It can in this way be visually checked whether the entire power of the signal under test is within the selected channel bandwidth.

Measurements in the time domain *(FAST ACP ON)* are performed in the zero span mode. The channel limits are indicated by vertical lines. For measurements requiring channel bandwidths deviating from those defined in the selected standard the IBW method is to be used.
Refer to section "Setting of Bandwidths and Sweep Time – *BW* key" for a list of available channel filters.

When measuring according to the IBW method (FAST ACP OFF) the bandwidths of the different adjacent channels are to be entered numerically. Since all adjacent channels often have the same bandwidth, the other channels Alt1 and Alt2 are set to the bandwidth of the adjacent channel on entering the adjacent-channel bandwidth (ADJ). Thus only one value needs to be entered in case of equal adjacent channel bandwidths. The same holds true for the ALT2 channels (alternate channels 2) when the bandwidth of the ALT1 channel (alternate channel 1) is entered.

Note: *The channel spacings can be set separately by overwriting the table from top to bottom.*

IEC/IEEE-bus command:

```
SENS:POW:ACH:BWID:CHAN 14kHz
SENS:POW:ACH:BWID:ACH 1kHz
SENS:POW:ACH:BWID:ALT1 14kHz
SENS:POW:ACH:BWID:ALT2 14kHz
```

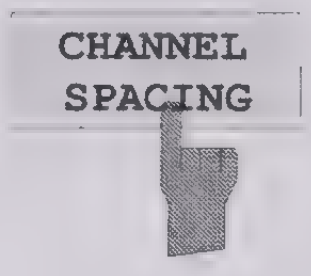

The *CHANNEL SPACING* softkey opens a table for defining the channel spacings.

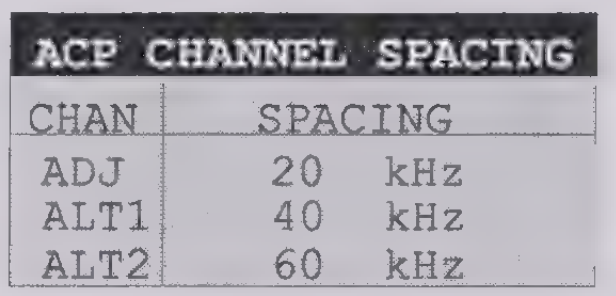

ACP CHANNEL SPACING

CHAN	SPACING
ADJ	20 kHz
ALT1	40 kHz
ALT2	60 kHz

Since all the adjacent channels often have the same distance to each other, the entry of the adjacent-channel spacing (ADJ) causes channel spacing ALT1 to be set to twice and channel spacing ALT2 to three times the adjacent-channel spacing. Thus only one value needs to be entered in case of equal channel spacing. The same holds true for the ALT2 channels when the bandwidth of the ALT1 channel is entered.

Note: *The channel spacings can be set separately by overwriting the table from top to bottom. The entry "TX" is only available for the multicarrier ACP measurement.*

IEC/IEEE-bus command:

```
SENS:POW:ACH:SPAC:CHAN 20kHz
SENS:POW:ACH:SPAC:ACH 20kHz
SENS:POW:ACH:SPAC:ALT1 40kHz
SENS:POW:ACH:SPAC:ALT2 60kHz
```

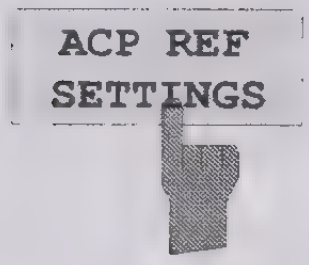

The *ACP REF SETTINGS* softkey opens a table for selecting the transmission channel to which the adjacent-channel relative power values should be referenced.

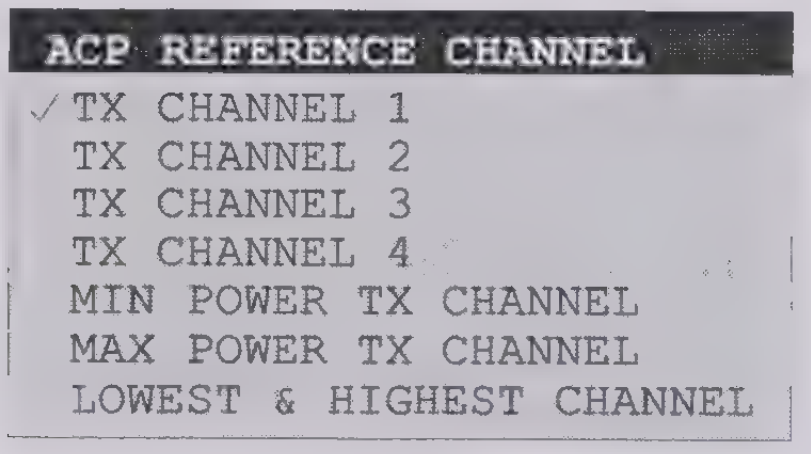

ACP REFERENCE CHANNEL

✓ TX CHANNEL 1
TX CHANNEL 2
TX CHANNEL 3
TX CHANNEL 4
MIN POWER TX CHANNEL
MAX POWER TX CHANNEL
LOWEST & HIGHEST CHANNEL

TX CHANNEL 1 - 4	Selection of one of channels 1 to 4.
MIN POWER TX CHANNEL	The transmission channel with the lowest power is used as a reference channel.
MAX POWER TX CHANNEL	The transmission channel with the highest power is used as a reference channel.
LOWEST & HIGHEST CHANNEL	The outer lefthand transmission channel is the reference channel for the lower adjacent channels, the outer righthand transmission channel that for the upper adjacent channels.

Note: *The softkey is only available for the multicarrier ACP measurement.*

IEC/IEEE-bus command:

```
SENS:POW:ACH:REF:TXCH:MAN 1
SENS:POW:ACH:REF:TXCH:AUTO MIN
```

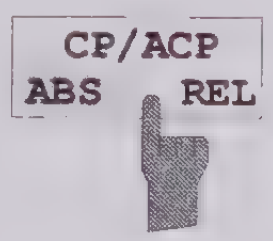

The *CP/ACP ABS/REL* softkey (channel power absolute/relative) switches between absolute and relative power measurement in the channel.

CP/ACP ABS The absolute power in the transmission channel and in the adjacent channels is displayed in the unit of the Y axis, e.g. in dBm, dBμV.

CP/ACP REL For adjacent-channel power measurements (*NO. OF ADJ CHAN* > 0), the level of the adjacent channels is displayed relative to the level of the transmission channel in dBc.

For channel power measurements (*NO. OF ADJ CHAN* = 0) with a single carrier, the power of the transmission channel is displayed relative to the power of a reference channel defined by *SET CP REFERENCE*. This means:

1. Declare the power of the currently measured channel as the reference value, using the *SET CP REFERENCE* softkey.
2. Select the channel of interest by varying the channel frequency (R&S FSMR center frequency).

With linear scaling of the Y axis, the power of the new channel relative to the reference channel (CP/CP_{ref}) is displayed. With dB scaling, the logarithmic ratio $10\lg(CP/CP_{ref})$ is displayed.

The relative channel power measurement can thus also be used for universal adjacent-channel power measurements. Each channel can be measured individually.

IEC/IEEE-bus command: `SENS:POW:ACH:MODE ABS`

The *CHAN PWR / HZ* softkey toggles between the measurement of the total channel power and the measurement of the channel power referenced to a 1-Hz bandwidth.

The conversion factor is $10 \cdot \lg \frac{1}{\text{Channel} \cdot \text{Bandwidth}}$.

By means of this function it is possible e.g. to measure the signal/noise power density or use the additional functions *CP/ACP REL* and *SET CP REFERENCE* to obtain the signal to noise ratio.

IEC/IEEE-bus command: `CALC:MARK:FUNC:POW:RES:PHZ ON|OFF`

ADJUST SETTINGS

The *ADJUST SETTINGS* softkey automatically optimizes the instrument settings for the selected power measurement (see below).
All instrument settings relevant for a power measurement within a specific frequency range (channel bandwidth) are optimized for the selected channel configuration (channel bandwidth, channel spacing):

- Frequency span:

  The frequency span should cover at least all channels to be considered in a measurement.

  For channel power measurements, the frequency span is set as follows:

  (No. of transmission channels - 1) × transmission channel spacing + 2 x transmission channel bandwidth + measurement margin

  For adjacent-channel power measurements, the frequency span is set as a function of the number of transmission channels, the transmission channel spacing, the adjacent-channel spacing, and the bandwidth of one of adjacent-channels ADJ, ALT1 or ALT2, whichever is furthest away from the transmission channels:

  (No. of transmission channels - 1) × transmission channel spacing + 2 × (adjacent-channel spacing + adjacent-channel bandwidth) + measurement margin

  The measurement margin is approx. 10% of the value obtained by adding the channel spacing and the channel bandwidth.

• Resolution bandwidth	RBW ≤ 1/40 of channel bandwidth
• Video bandwidth	VBW ≥ 3 × RBW
• Detector	RMS detector

Trace math and trace averaging functions are switched off.
The reference level is not influenced by *ADJUST SETTINGS*. It can be separately adjusted with *ADJUST REF LVL*.

The adjustment is carried out only once; if necessary, the instrument settings can be changed later.

IEC/IEEE-bus command:

```
SENS:POW:ACH:PRES ACP|CPOW|MCAC|OBW
```

ACP LIMIT CHECK

The *ACP LIMIT CHECK* softkey switches the limit check for the ACP measurement on and off.

IEC/IEEE-bus command:

```
CALC:LIM:ACP ON
CALC:LIM:ACP:ACH:RES?
CALC:LIM:ACP:ALT:RES?
```

EDIT ACP LIMITS

The *EDIT ACP LIMITS* softkey opens a table for defining the limits for the ACP measurement.

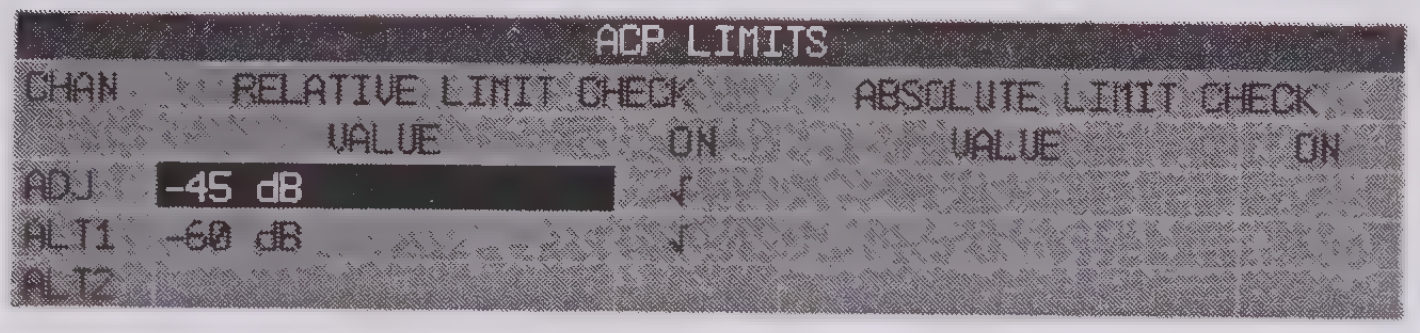

ACP LIMITS

CHAN	RELATIVE LIMIT CHECK VALUE	ON	ABSOLUTE LIMIT CHECK VALUE	ON
ADJ	-45 dB	√		
ALT1	-60 dB	√		
ALT2				

The following rules apply for the limits:

- A separate limit can be defined for each adjacent channel. The limit applies to both the upper and the lower adjacent channel.
- A relative and/or absolute limit can be defined. The check of both limit values can be activated independently.
- The R&S FSMR checks adherence to the limits irrespective of whether the limits are absolute or relative or whether the measurement is carried out with absolute or relative levels. If both limits are active and if the higher of both limit values is exceeded, the measured value is marked accordingly.

Note: *Measured values exceeding the limit are marked by a preceding asterisk.*

IEC/IEEE-bus command:

```
CALC:LIM:ACP ON
CALC:LIM:ACP:ACH 0dB,0dB
CALC:LIM:ACP:ACH:STAT ON
CALC:LIM:ACP:ACH:ABS -10dBm,-10dBm
CALC:LIM:ACP:ACH:ABS:STAT ON
CALC:LIM:ACP:ALT1 0dB,0dB
CALC:LIM:ACP:ALT1:STAT ON
CALC:LIM:ACP:ALT1:ABS -10dBm,-10dBm
CALC:LIM:ACP:ALT1:ABS:STAT ON
CALC:LIM:ACP:ALT2 0dB,0dB
CALC:LIM:ACP:ALT2:STAT ON
CALC:LIM:ACP:ALT2:ABS -10dBm,-10dBm
CALC:LIM:ACP:ALT2:ABS:STAT ON
```

SELECT TRACE

The *SELECT TRACE* softkey selects the trace on which the CP/ACP measurement is to be performed. Only activated traces can be selected, i.e. traces not set to BLANK.

IEC/IEEE-bus command:

```
SENS:POW:TRAC 1
```

Examples:

1. Measurement of adjacent-channel power for a specific standard:

The adjacent-channel power is to be measured for a signal at 800 MHz with 0 dBm level in line with IS136.

[**PRESET**]	Set the R&S FSMR to the default setting.
[**FREQ**: *CENTER*: 800 **MHz**]	Set the center frequency to 800 MHz.
[**AMPT**: 0 **dBm**]	Set the reference level to 0 dBm.
[**MEAS**]	Call the menu for the measurement functions.
[*CHAN PWR / ACP*]	Select the channel and adjacent-channel power measurement function. The measurement is performed with the default settings or a previously defined setting. The submenu for setting the desired new configuration is opened.
[*CP/ACP STANDARD*: select IS136: **ENTER**]	Select the NADC (IS136) standard.
[*CP/ACP CONFIG*]	Call the submenu for configuration of the adjacent-channel power measurement.
[*NO. OF ADJ CHAN*: 2 **ENTER**]	Select two adjacent channels for the measurement, i.e. the adjacent channel and the alternate channel are measured.
[*ADJUST SETTINGS*]	Set the optimum span, resolution bandwidth (RBW), video bandwidth (VBW) and detector automatically for the measurement. The absolute channel power and the relative power of the adjacent channels are displayed on the screen.
PREV	Change to the main menu for channel power measurement.
[*ADJUST REF LVL*]	Set the reference level equal to the channel power measured.

2. Measurement with user-specific channel configuration:

Measurement of the adjacent-channel power ratio (ACPR) of an IS95 CDMA signal at 800 MHz, level 0 dBm. Similar to example 1, the setting can be simplified by using *CP/ACP STANDARD*.

[**PRESET**]	Set the R&S FSMR to the default setting.
[**FREQ:** *CENTER*: 800 **MHz**]	Set the center frequency to 800 MHz.
[**AMPT**: 0 **dBm**]	Set the reference level to 0 dBm.
[**MEAS**]	Call the menu for the measurement functions.
[*CHAN PWR / ACP*]	Select the channel and adjacent-channel power measurement function. The measurement is carried out with the default settings or a previously defined setting. The submenu for setting the desired new configuration is opened.
[*CP/ACP CONFIG*]	Call the submenu for defining the channel configuration.
[*NO. OF ADJ CHAN*: 2 **ENTER**]	Select two adjacent channels for the measurement, i.e. the adjacent channel and the alternate channel are measured.
[*CHANNEL BANDWIDTH*: 1.23 **MHz**: ⇩: 30 **kHz**]	Set the channel bandwidth to 1.23 MHz in accordance with IS 95. Set the adjacent-channel bandwidth to 30 kHz.

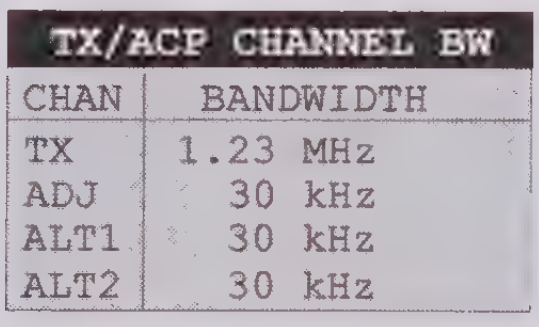

TX/ACP CHANNEL BW

CHAN	BANDWIDTH
TX	1.23 MHz
ADJ	30 kHz
ALT1	30 kHz
ALT2	30 kHz

Upon entry of 30 kHz for the adjacent channel the alternate channels are also set to 30 kHz.

[*CHAN SPACING*: 1.25 **MHz**:⇩ 885 **kHz:** ⇩: -1.98 **MHz**] ⇩: 2.97 **MHz**]	Open the list for entering the channel spacings.

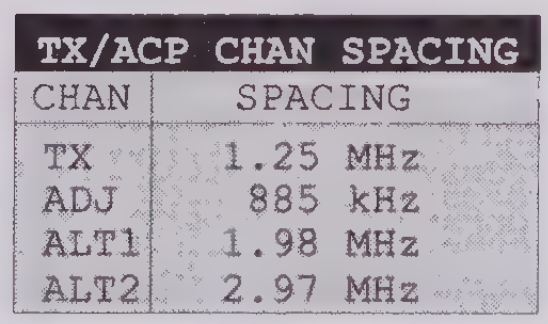

TX/ACP CHAN SPACING

CHAN	SPACING
TX	1.25 MHz
ADJ	885 kHz
ALT1	1.98 MHz
ALT2	2.97 MHz

Upon entry of 885 kHz for the adjacent channel the channels ALT1 and ALT2 are set to 1770 kHz and 2655 kHz. Upon entry of 1.98 MHz for the alternate channel 1 the alternate channel 2 is set to 2.97 MHz.

[*ADJUST SETTINGS*]	Automatically set the optimum span (= 5 MHz), resolution bandwidth (RBW = 30 kHz), video bandwidth (VBW = 300 kHz) and detector (RMS) for the measurement. The absolute channel power and the relative power of the adjacent channels and alternate channels are displayed on the screen.
PREV	Go to the main menu for channel power measurement.
[*ADJUST REF LVL*]	Set the reference level equal to the channel power measured.

3. Measurement of signal/noise power density (C/No) of an IS95 CDMA signal (frequency 800 MHz, level 0 dBm)

[**PRESET**]	Set the R&S FSMR to the default setting.
[**FREQ:** *CENTER*: 800 **MHz**]	Set the center frequency to 800 MHz.
[**AMPT**: 0 **dBm**]	Set the reference level to 0 dBm.
MEAS]	Call the menu for the measurement functions.
[*CHAN PWR / ACP*]	Select the channel and adjacent-channel power measurement. The measurement is performed with the default setting or a previously defined setting. The submenu for setting the desired new configuration is opened.
[*CP/ACP CONFIG*]	Call the submenu for defining the channel configuration.
[*NO. OF ADJ CHAN*: 0 **ENTER**]	Do not select an adjacent channel for the measurement, i.e. the measurement is carried out in one channel only.
[*CHANNEL BANDWIDTH*: 1.23 **MHz**]	Set the channel bandwidth to 1.23 MHz in line with IS95.
[*ADJUST SETTINGS*]	Set the optimum span (= 5 MHz), resolution bandwidth (RBW = 30 kHz), video bandwidth (VBW = 300 kHz) and detector (RMS) for the measurement automatically. The absolute channel power and the relative power of the adjacent channels and alternate channels are displayed on the screen.
PREV	Go to the main menu for channel power measurement
[*ADJUST REF LVL*]	Set the reference level equal to the channel power measured.
[*SET CP REFERENCE*]	Set the measured channel power as a reference for the subsequent measurements.
[*CP/ACP ABS / REL*]	Select relative measurement related to the reference power set with *SET REFERENCE* (result 0 dB).
[*CHAN PWR / HZ*]	Select power measurement related to 1 Hz bandwidth (result -60.9 dB).
[**FREQ:** *CENTER*: 805 **MHz**]	Set the center frequency to 805 MHz. The R&S FSMR measures the channel power at 1.23 MHz bandwidth and outputs the result in dB relative to the reference power and 1 Hz bandwidth.

Measurement of Occupied Bandwidth

An important characteristics of a modulated signal is its occupied bandwidth. In a radio communications system for instance the occupied bandwidth must be limited to enable distortion-free transmission in adjacent channels. The occupied bandwidth is defined as the bandwidth containing a defined percentage of the total transmitted power. A percentage between 10% and 99.9% can be set on the R&S FSMR.

MEAS OCCUPIED BANDWIDTH menu:

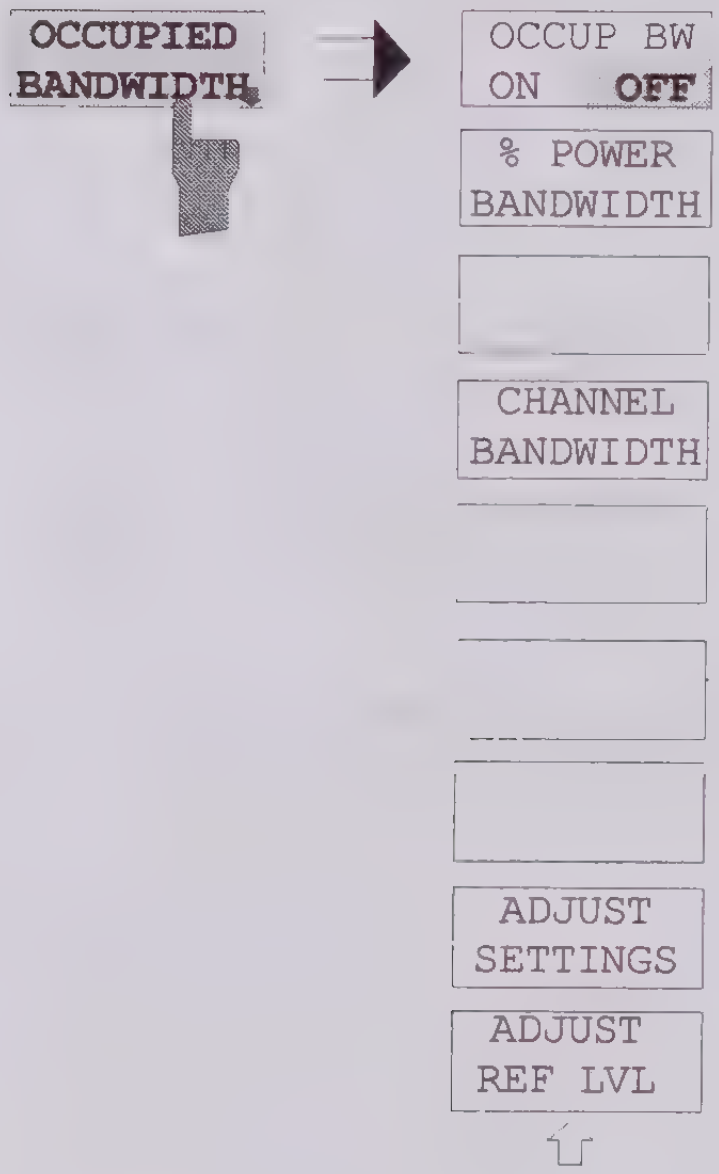

The *OCCUPIED BANDWIDTH* softkey activates measurement of the occupied bandwidth according to the current configuration and opens the submenu for configuring the measurement. The softkey is available only in frequency domain (span > 0) and is highlighted when the measurement is switched on.

In the spectrum display mode, this measurement determines the bandwidth that contains a predefined percentage of the power of the displayed frequency range (*% POWER BANDWIDTH* softkey*)*. The occupied bandwidth is output in the marker display field and marked on the trace by temporary markers.

Note:
- *The softkey is only available in the frequency domain (span > 0).*
- *The measurement is performed on the trace with marker 1. In order to evaluate another trace, marker 1 must be placed on another trace by means of SELECT TRACE in the MKR menu*

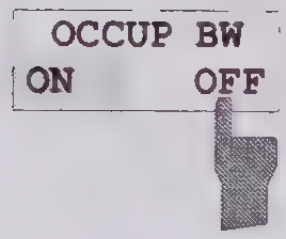

The *OCCUP BW ON/OFF* softkey switches measurement of the occupied bandwidth on or off.

IEC/IEEE-bus command:
```
CALC:MARK:FUNC:POW:SEL OBW
CALC:MARK:FUNC:POW:RES? OBW
CALC:MARK:FUNC:POW OFF
```

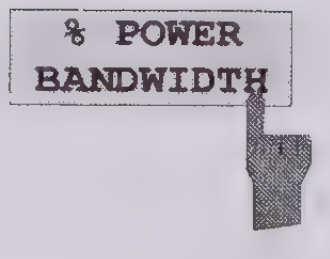

The *% POWER BANDWIDTH* softkey opens the entry of the percentage of power related to the total power in the displayed frequency range which defines the occupied bandwidth (percentage of total power).
The valid range of values is 10% to 99.9%.

IEC/IEEE-bus command: `SENS:POW:BWID 99PCT`

The *CHANNEL BANDWIDTH* softkey opens an input window for defining the channel bandwidth for the transmission channel. For measurements in line with a specific transmission standard, the bandwidth specified by the standard for the transmission channel must be entered.
The default setting is 14 kHz.
The specified channel bandwidth is used for optimization of the test parameters of the R&S FSMR with *ADJUST SETTINGS.*

IEC/IEEE-bus command: `SENS:POW:ACH:BWID 14kHz`

ADJUST REF LVL

The *ADJUST REF LVL* softkey adjusts the reference level of the R&S FSMR to the measured total power of the signal. The softkey is activated after the first sweep with the measurement of the occupied bandwidth has been completed and the total power of the signal is thus known.

Adjusting the reference level ensures that the signal path of the R&S FSMR will not be overloaded and the dynamic range not limited by too low a reference level.

Since the measurement bandwidth for channel power measurements is significantly lower than the signal bandwidth, the signal path may be overloaded although the trace is distinctly below the reference level. If the measured channel power is equal to the reference level, the signal path cannot be overloaded.

IEC/IEEE-bus command: `SENS:POW:ACH:PRES:RLEV`

ADJUST SETTINGS

The *ADJUST SETTINGS* softkey optimizes the instrument settings for the measurement of the occupied bandwidth according to the specified channel bandwidth.

All instrument settings relevant for power measurement within a specific frequency range, such as

• frequency span	3 x channel bandwidth
• resolution bandwidth	RBW ≤ 1/40 of channel bandwidth
• video bandwidth	VBW ≥ 3 × RBW
• detector	RMS

are optimized.

The reference level is not influenced by *ADJUST SETTINGS*. For an optimum dynamic range it should be selected in a way that the signal maximum is close to the reference level.

The adjustment is carried out only once; if necessary, the instrument settings may be changed later.

IEC/IEEE-bus command: `SENS:POW:PRES OBW`

Measurement principle:

For example, the bandwidth containing 99% of the signal power is to be determined. The routine first calculates the total power of all displayed points of the trace. In the next step, the points from the right edge of the trace are summed up until 0.5% of the total power is reached. Auxiliary marker 1 is positioned at the corresponding frequency. Then the R&S FSMR sums up the points from the left edge of the trace until 0.5% of the power is reached. Auxiliary marker 2 is positioned at this point. 99% of the power is now between the two markers. The distance between the two frequency markers is the occupied bandwidth which is displayed in the marker info field.
A prerequisite for correct measurement is that only the signal to be measured is visible on the screen of the R&S FSMR. An additional signal would invalidate the measurement.

To ensure correct power measurement especially for noise signals and to obtain the correct occupied bandwidth, the following settings should be selected:

RBW	<< occupied bandwidth (approx. 1/20 of occupied bandwidth, for voice communication type. 300 Hz or 1 kHz)
VBW	≥ 3 x RBW
Detector	RMS or sample
Span	≥2 to 3 x occupied bandwidth

Some of the measurement specifications (e.g. PDC, RCR STD-27B) require measurement of the occupied bandwidth using a peak detector. The detector setting of the R&S FSMR has to be changed accordingly then.

Example:
Measurement of occupied bandwidth of a PDC signal at 800 MHz, level 0 dBm

[**PRESET**]	Set the R&S FSMR to the default setting.
[**FREQ**: *CENTER*: 800 MHz]	Set the center frequency to 800 MHz.
[**AMPT**: 0 dBm]	Set the reference level to 0 dBm.
[**MEAS**]	Call the menu for the measurement functions.
[*OCCUPIED BANDWIDTH*]	Select measurement of the occupied bandwidth and open the submenu for configuring the measurement.
[% POWER BANDWIDTH: 99 **%**]	Select 99% for the bandwidth to be measured.
[*CHANNEL BANDWIDTH*: 21 **kHz**]	Enter the channel bandwidth of 21 kHz specified by PDC.
[*ADJUST SETTINGS*]	Optimize the measurement parameters for the specified channel bandwidth. Allow for a complete frequency sweep so that the R&S FSMR can determine the total signal power.
[*ADJUST REF LVL*]	Adjust the reference level to the measured signal power.
[**TRACE**: *DETECTOR*: *DETECTOR MAX PEAK*]	PDC requires measurement of the occupied bandwidth using a peak detector. Therefore, switch on the peak detector instead of the RMS detector selected by *ADJUST SETTINGS*.

Measurement of Signal Amplitude Statistics

Digital modulated signals are similar to white noise within the transmit channel, but are different in their amplitude distribution. In order to transmit the modulated signal without distortion all amplitudes of the signal have to be transmitted linearly, e. g. from the output power amplifier. Most critical are the peak amplitude values, of course.

Degradation in transmit quality caused by a transmitter two port network is dependent on the amplitude of the peak values as well as on their probability.

The probability of amplitude values can be measured with the APD function (Amplitude Probability Distribution). During a selectable measurement time all occurring amplitude values are assigned to an amplitude range. The number of amplitude values in the specific ranges is counted and the result is displayed as a histogram. Each bar of the histogram represents the percentage of measured amplitudes within the specific amplitude range.

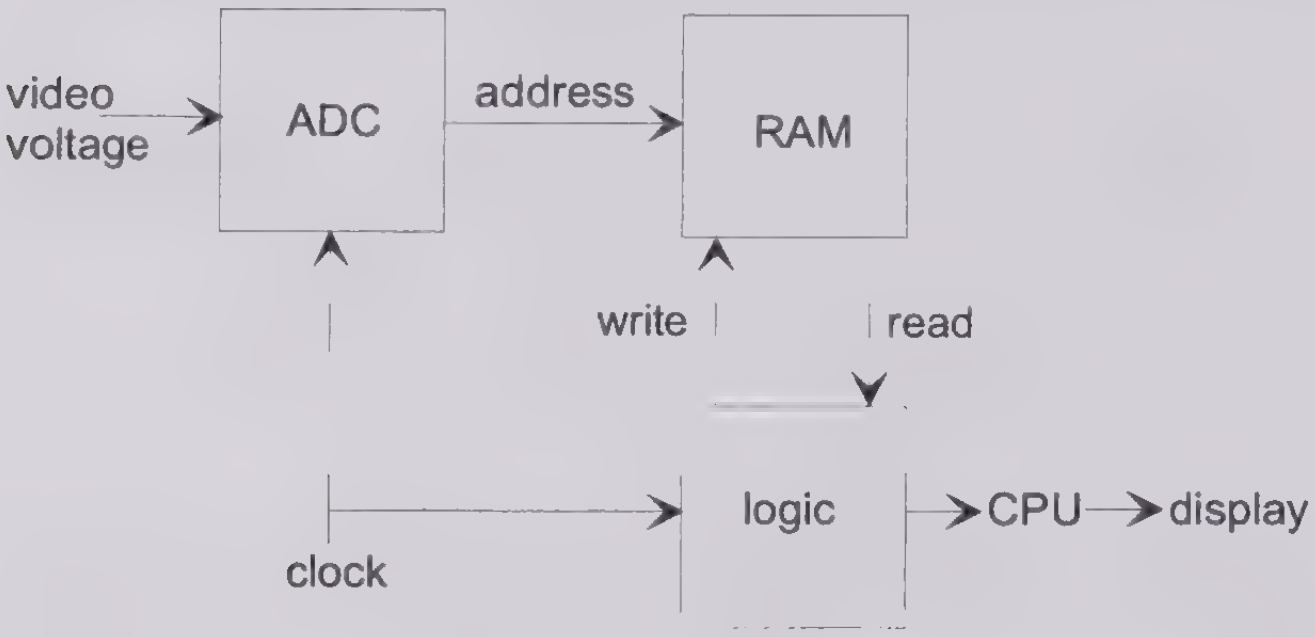

Fig. 4.16-3 Simplified block diagram for APD measurement

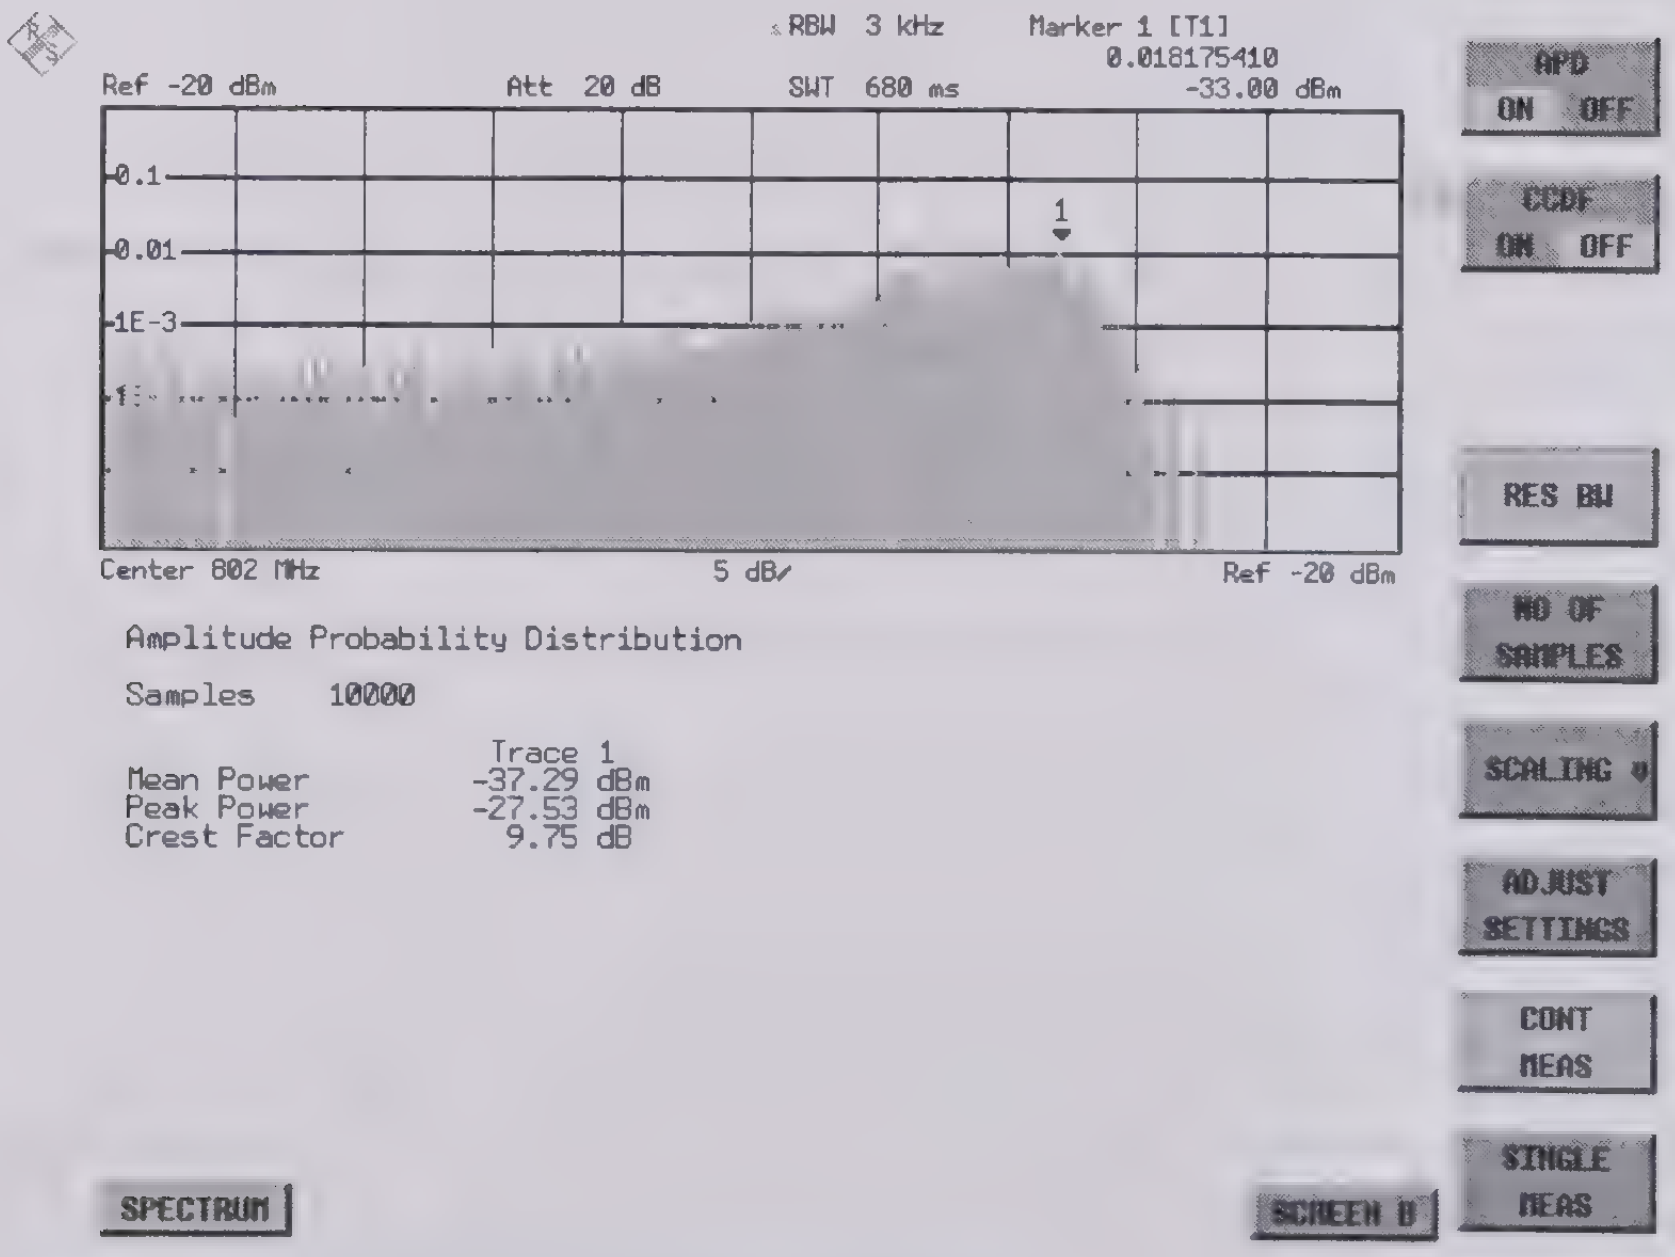

```
Amplitude Probability Distribution
Samples     10000

                      Trace 1
Mean Power          -37.29 dBm
Peak Power          -27.53 dBm
Crest Factor          9.75 dB
```

Fig. 4.16-4 Display of the amplitude probability distribution

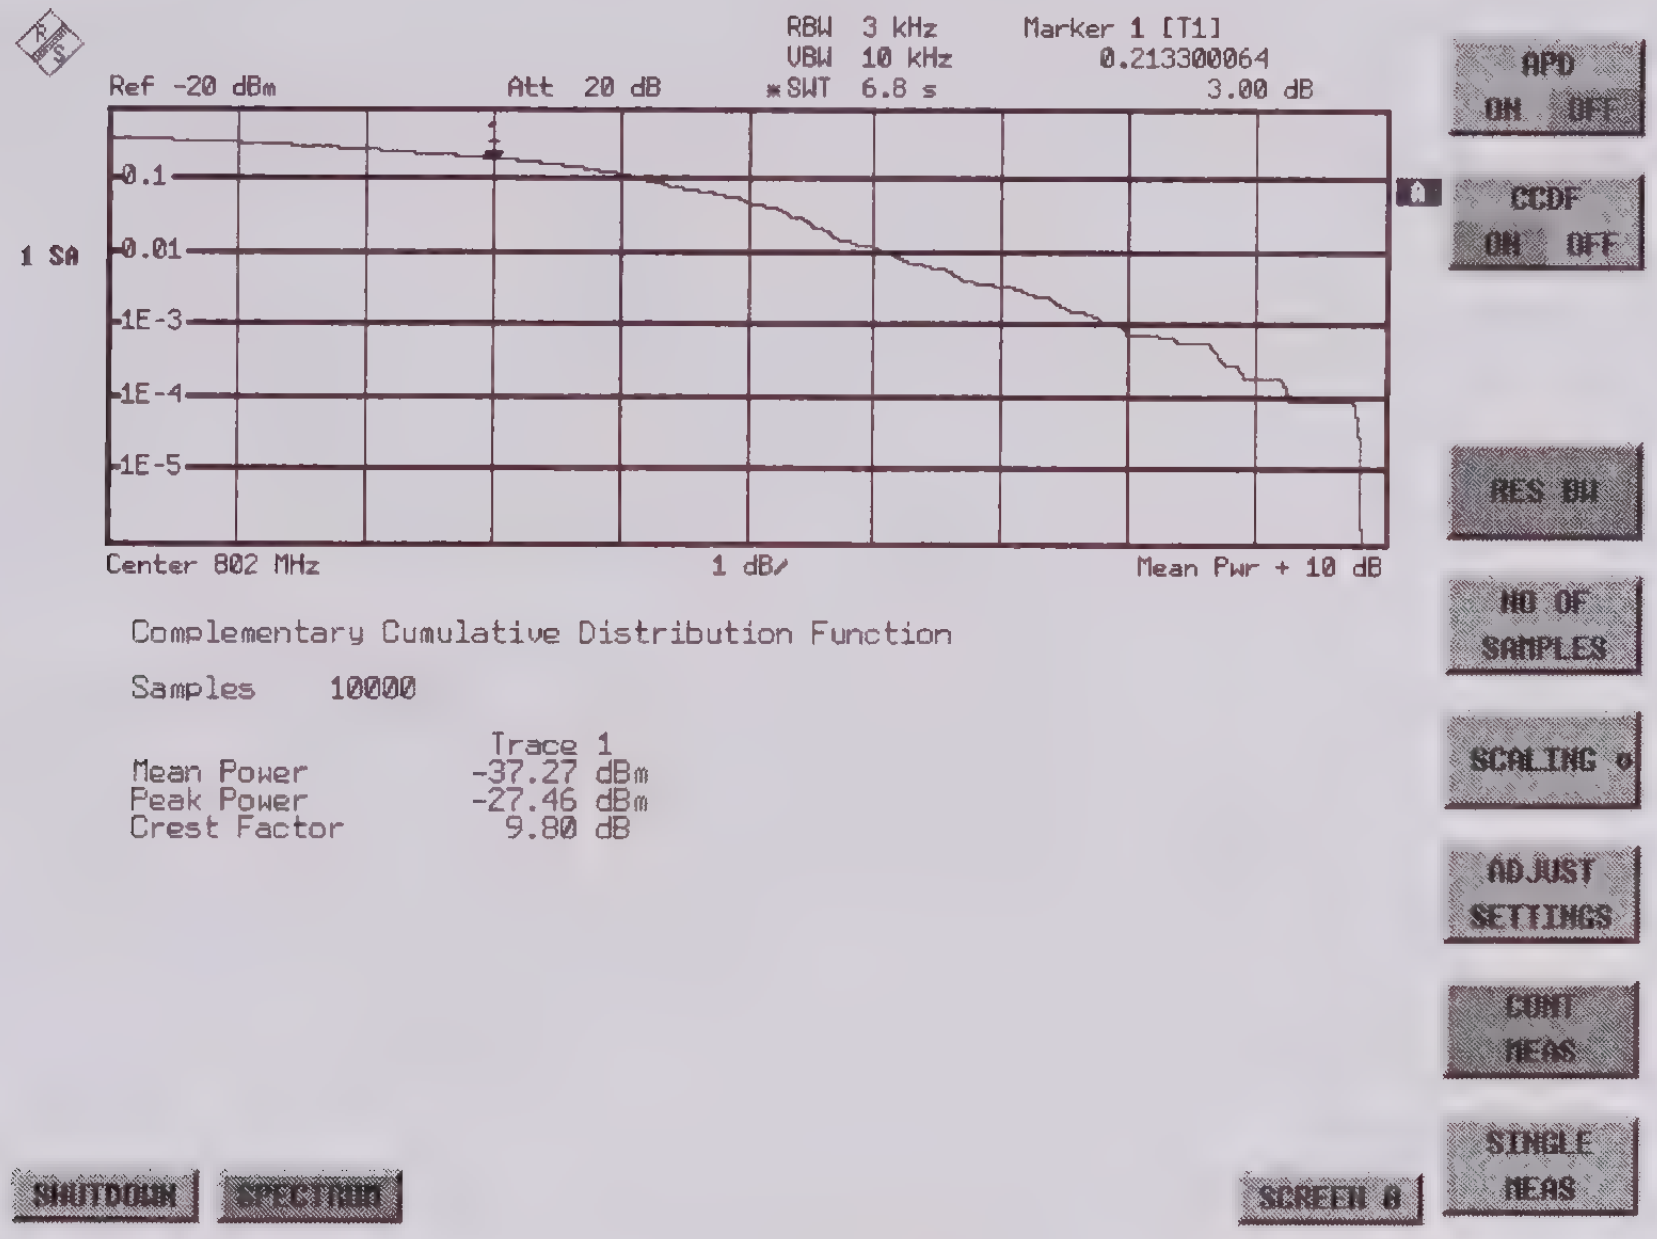

```
                                   RBW  3 kHz     Marker 1 [T1]
                                   VBW  10 kHz         0.213300064
Ref -20 dBm          Att  20 dB   *SWT  6.8 s                3.00 dB

Center 802 MHz                    1 dB/              Mean Pwr + 10 dB

Complementary Cumulative Distribution Function

Samples     10000

                    Trace 1
Mean Power         -37.27 dBm
Peak Power         -27.46 dBm
Crest Factor         9.80 dB
```

Fig. 4.16-5 Display of the complementary cumulative distribution function (CCDF)

Alternate to the histogram display of the APD the Complementary Cumulative Distribution Function (CCDF) can be displayed. It shows the probability of an amplitude exceeding a specific value.
For the APD function the x-axis is scaled in absolute values in dBm, whereas for the CCDF function the x-axis is scaled relative to the MEAN POWER measured.

Definitions:
Crest factor = peak voltage to rms
CCDF = complementary cumulative distribution function

Note: *During an active statistic measurement the functions FULL SCREEN, SPLIT SCREEN and selection of the active diagram via SCREEN A / SCREEN B are disabled.*

MEAS SIGNAL STATISTIC submenu :

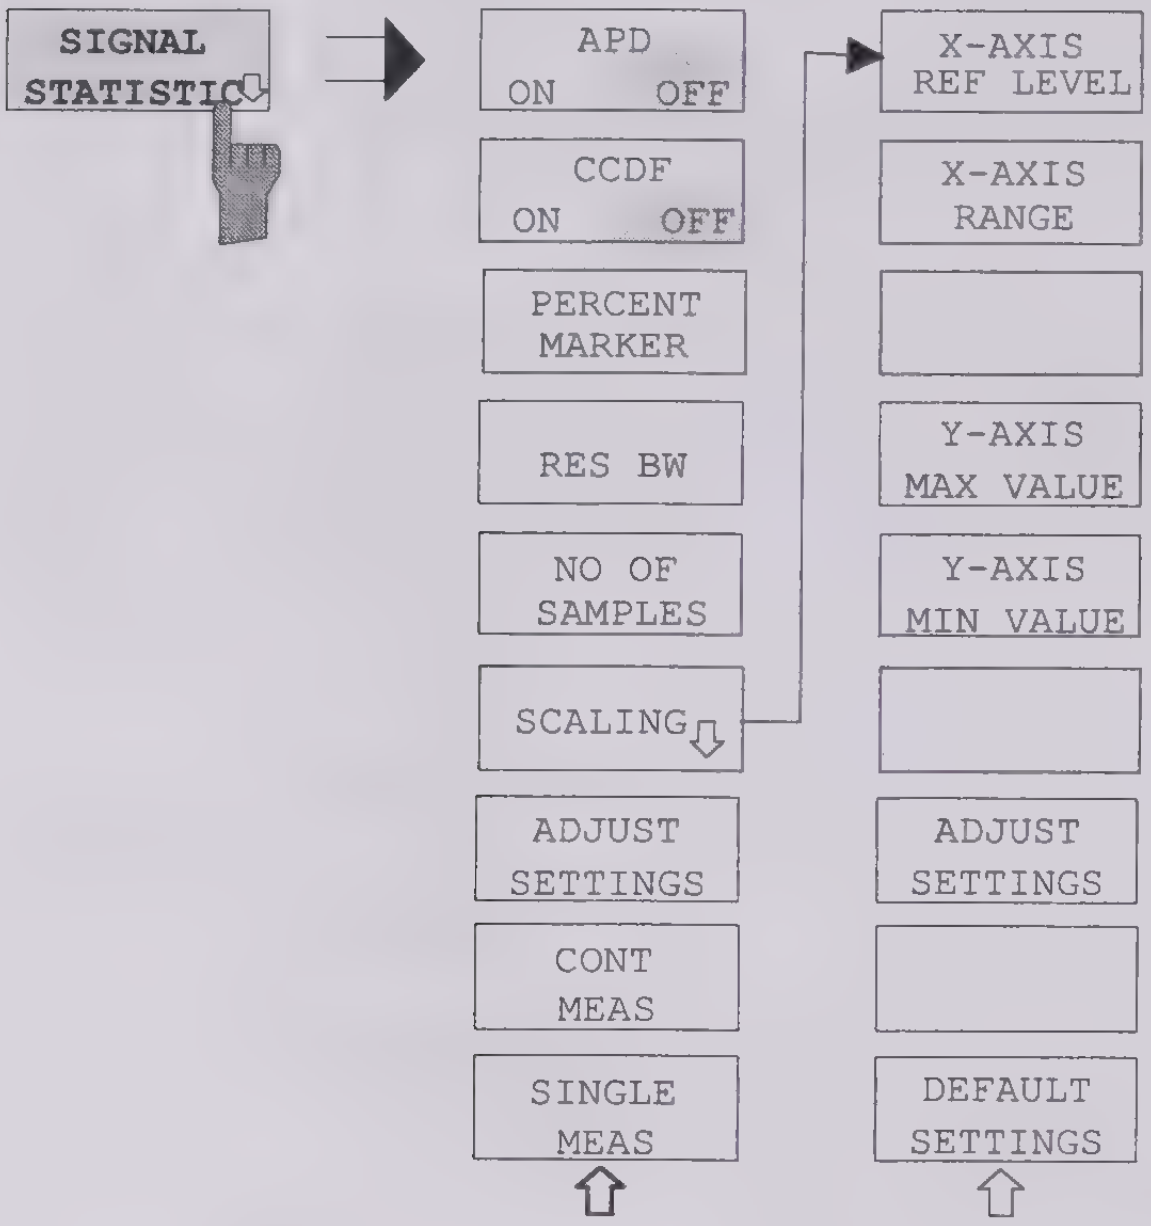

The *SIGNAL STATISTIC* softkey opens a submenu for measurement of signal statistics.
In the submenu measurement of amplitude probability density (*APD*) and complementary cumulative distribution (*CCDF*) can be selected alternately. Only one of the signal statistic functions can be switched on at a time.

In default mode all statistic functions are switched off.
With a statistic function switched on the R&S FSMR is set into zero span mode automatically.

The R&S FSMR measures the statistics of the signal applied to the RF input with the resolution bandwidth set. In order not to influence the peak amplitudes the video bandwidth is automatically set to 10 times the resolution bandwidth. The sample detector is used for detecting the video voltage.



The *APD ON/OFF* softkey switches on or off the amplitude probability distribution function.
When the APD function is switched on, the CCDF function is switched off automatically.

IEC/IEEE-bus command: `CALC:STAT:APD ON`

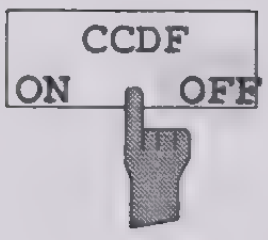

The *CCDF ON/OFF* softkey switches on or off the complementary cumulative distribution function.
When the CCDF function is switched on, the APD function is switched off automatically.

IEC/IEEE-bus command: `CALC:STAT:CCDF ON`

If the CCDF function is active, the *PERCENT MARKER* softkey allows to position marker 1 by entering a probability value. Thus, the power which is exceeded with a given probability can be determined very easily.
If marker 1 is in the switched-off state, it will be switched on automatically.

IEC/IEEE-bus command: `CALC:MARK:Y:PERC 0...100%`

RES BW

The *RES BW* softkey sets the resolution bandwidth in the menu *STATISTIC FUNCTION* directly without switching to the corresponding menu (BW). The function of the softkey is identical to the softkey *RES BW MANUAL* in the menu *BW*.

For correct measurement of the signal statistics the resolution bandwidth has to be wider than the signal bandwidth in order to transmit the actual peaks of the signal amplitude correctly. Video bandwidth is set to 10 MHz automatically with a statistic function switched on.

IEC/IEEE-bus command: `BAND 3 MHz`

NO OF SAMPLES

The *NO OF SAMPLES* softkey sets the number of power measurements taken into account for the statistics.

Please note that the overall measurement time is influenced by the number of samples selected as well as by the resolution bandwidth set up for the measurement as the resolution bandwidth directly influences the sampling rate.

IEC/IEEE-bus command: `CALC:STAT:NSAM <value>`

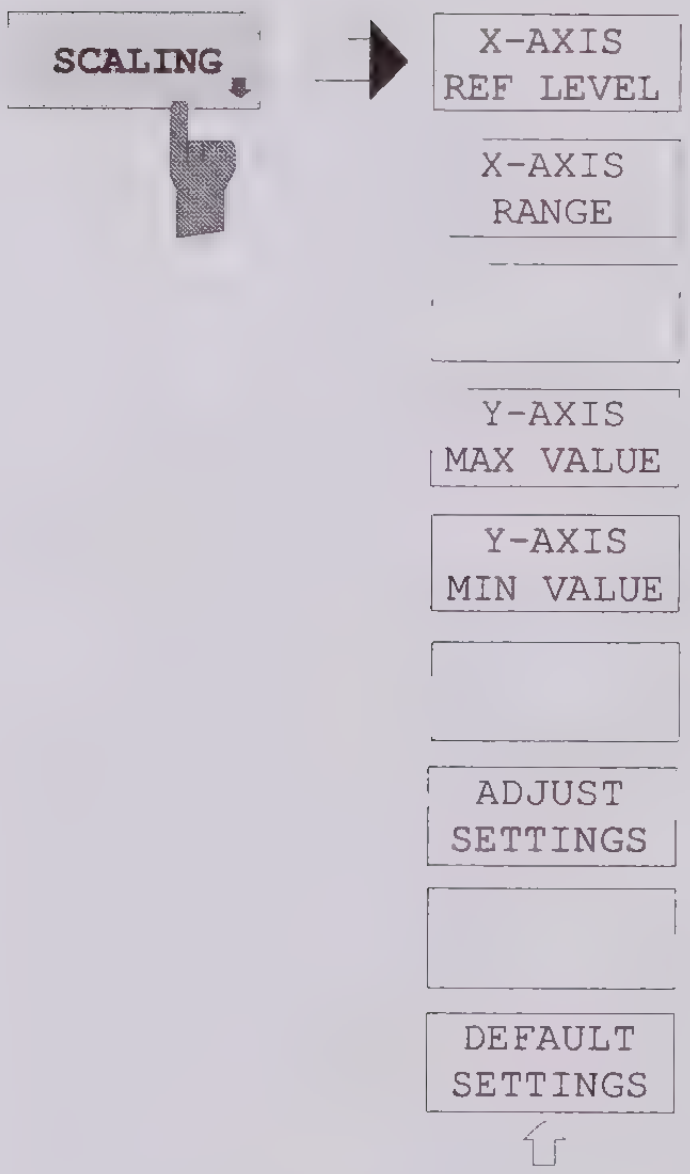

The *SCALING* softkey opens a sub menu that allows changing the scaling parameters for both the x- and the y-axis.

X-AXIS REF LEVEL

The *X-AXIS REF LEVEL* softkey changes the level settings of the instrument and sets the maximum power to be measured.

The function is identical to softkey *REF LEVEL* in menu *AMPT*.

For the *APD* function this value is mapped to the right diagram border. For the *CCDF* function there is no direct representation of this value on the diagram as the x-axis is scaled relatively to the *MEAN POWER* measured.

IEC/IEEE command: `CALC:STAT:SCAL:X:RLEV <value>`

X-AXIS RANGE

The *X-AXIS RANGE* softkey changes the level range to be covered by the statistics measurement selected.
The function is identical to softkey *RANGE LOG MANUAL* in menu *AMPT*.

IEC/IEEE command: `CALC:STAT:SCAL:X:RANG <value>`

Y-AXIS MAX VALUE

The *Y-AXIS MAX VALUE* softkey defines the upper limit of the displayed probability range.
Values on the y-axis are normalized which means that the maximum value is 1.0. As the y-axis scaling has a logarithmic axis the distance between max and min value must be at least one decade.

IEC/IEEE command: `CALC:STAT:SCAL:Y:UPP <value>`

Y-AXIS MIN VALUE

The *Y-AXIS MIN VALUE* softkey defines the lower limit of the displayed probability range.
As the y-axis scaling has a logarithmic axis the distance between max and min value must be at least one decade. Valid values are in the range 0 < value < 1.

IEC/IEEE command: `CALC:STAT:SCAL:Y:LOW <value>`

ADJUST SETTINGS

see below

DEFAULT SETTINGS

The *DEFAULT SETTINGS* softkey resets the x- and y-axis scalings to their PRESET values.

x-axis ref level:	-20 dBm
x-axis range APD:	100 dB
x-axis range CCDF:	20 dB
y-axis upper limit:	1.0
y-axis lower limit:	1E-6

IEC/IEEE-bus command: `CALC:STAT:PRES`

ADJUST SETTINGS

The *ADJUST SETTINGS* softkey optimizes the level settings of the R&S FSMR according to the measured peak power in order to gain maximum sensitivity of the instrument.
The level range is adjusted according to the measured difference between peak and minimum power for APD measurement and peak and mean power for CCDF measurement in order to obtain maximum power resolution.
Additionally the probability scale is adapted to the selected number of samples.

IEC/IEEE-bus command: `CALC:STAT:SCAL:AUTO ONCE`

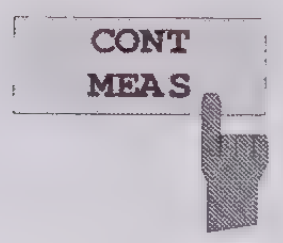

The *CONT MEAS* softkey starts collecting a new sequence of sample data and calculating the APD or CCDF curve depending on the selected measurement. The next measurement is started automatically as soon as the indicated number of samples has been reached ("CONTinuous MEASurement").

IEC/IEEE-bus command: `INIT:CONT ON;`
`INIT:IMM`



The *SINGLE MEAS* softkey starts collecting a new sequence of sample data and calculating the APD or CCDF curve depending on the selected measurement. At the beginning of the measurement previously obtained measurement results are discarded.

IEC/IEEE-bus command: `INIT:CONT OFF;`
`INIT:IMM`

Hint for usage of the marker functions with measurement of signal statistics:

With the signal statistic measurement level always is displayed on x-axis. Y-axis always is a normalized value between 0 and 1. In contrary to use of marker in frequency or time domain marker is input in level values and the output is in percentage values.

Example:

Measurement of CCDF of a IS95 BTS signal, level 0 dBm, frequency 800 MHz

[**PRESET**]	Switch on preset settings.
[**FREQ**: *CENTER*: 800 MHz]	Set center frequency to 800 MHz.
[**AMPT**: 10 dBm]	Set reference level to 10 dBm.
[**BW**: 3 MHz]	Set resolution bandwidth to 3 MHz (resolution bandwidth shall be wider then signal bandwidth (1.25 MHz) in order to have the complete signal within the resolution bandwidth).
[**MEAS**]	Call the menu for measurement functions.
[*SIGNAL STATISTIC*]	Call the menu for signal statistics measurement.
[*CCDF ON /OFF*]	Switch on measurement of the complementary cumulative distribution function. The R&S FSMR switches to zero span mode. The power of the signal and the CCDF is calculated for the number of samples selected. With the CCDF function sample detector and video bandwidth are set automatically.
[NO OF SAMPLES: 10000]	Set the number of measurement samples to 10000.
[SINGLE MEAS]	Start the measurement sequence. At the end the resulting trace will display the CCDF for the measured 10000 samples.

Measurement of Carrier/Noise Ratio C/N and C/N_o

Using the carrier/noise measurement function, the FSP determines the C/N ratio which can also be shown normalized to a 1 Hz bandwidth (function *C/N_o*).

To determine the noise power, a channel at the set center frequency is examined. The bandwidth of the channel is fixed by means of the *CHANNEL BANDWIDTH* function.

The largest signal in the frequency span is the carrier. It is searched when the function is activated and is marked by means of the *REFERENCE FIXED* marker. The noise power of the channel is subtracted from the signal level obtained (*C/N*), and in the case of a *C/N_o* measurement it is referred to a 1 Hz bandwidth.

There are two methods for measuring the carrier/noise ratio:

1. The carrier is outside the channel examined:

In this case, it is sufficient to switch on the desired measurement function and to set the channel bandwidth. The carrier/noise ratio is displayed on the screen.

2. The carrier is inside the channel examined:

In this case, the measurement must be performed in two steps. First, the reference measurement is performed with the carrier being active. This is done by switching on either the C/N or the C/N_o measurement and waiting for the end of the next measurement run . Then, the carrier is switched off so that only the noise of the test setup is active in the channel. The carrier/noise ratio is displayed after the subsequent measurement has been completed.

The *ADJUST SETTINGS* function facilitates the selection of the frequency span appropriate for the channel bandwidth: it automatically sets the *SPAN* to approx. 4 x channel bandwidth.

The RMS detector is enabled when the power measurement is switched on (*TRACE-DETECTOR-RMS)*.

Submenu *MEAS – C/N, C/N_o*:

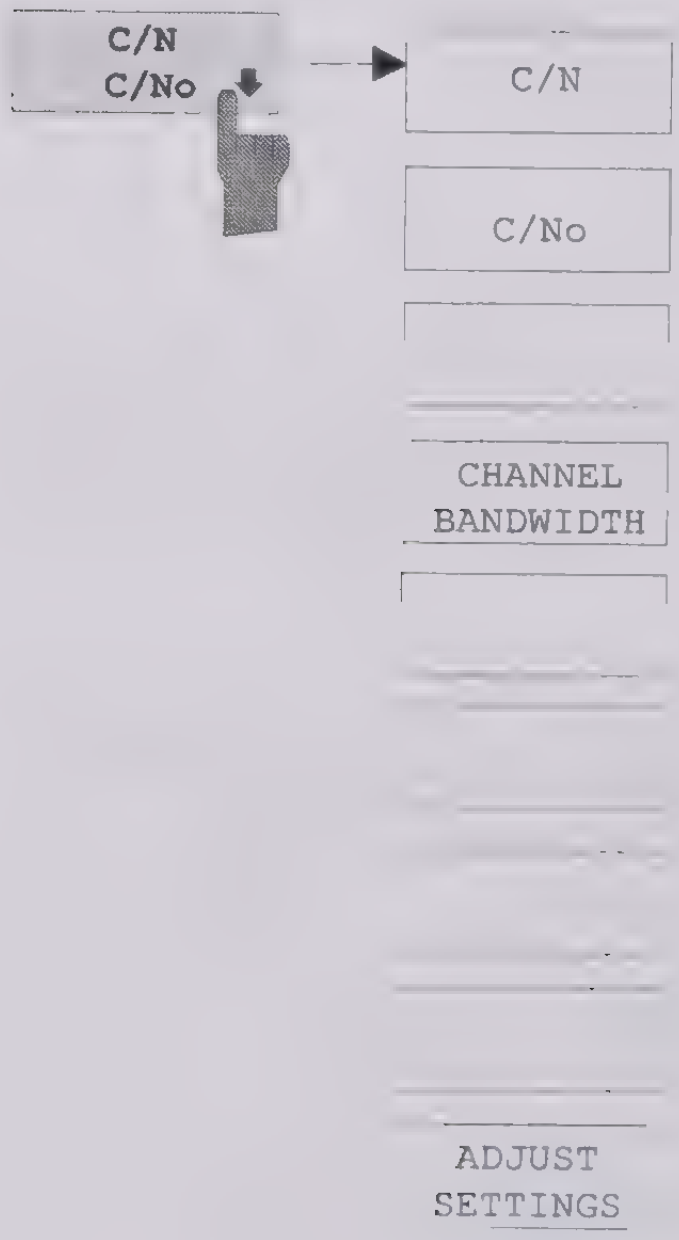

The *C/N, C/No* softkey opens the submenu for configuring the carrier/noise ratio measurement.

The user can choose between measurement without (C/N) and measurement with reference to the bandwidth (C/No). In addition, it is possible to select the bandwidth of the channel and to adapt the span.

Note:
The measurements are only available in the frequency domain (span >0).

C/N

C/No

The *C/N* and *C/No* softkeys enable and disable the measurement of the carrier/noise ratio, the *C/No* measurement also being referred to a 1 Hz bandwidth.
The maximum value of the current trace is determined when the function is activated and is marked by means of the *REFERENCE FIXED* marker.

Note: *The measurement is performed on the trace where MARKER 1 is located. To measure another trace, MARKER 1 has to be shifted to the trace in question using the SELECT TRACE softkey in the MKR menu.*
If no marker is active, MARKER 1 is activated when the function is switched on.

IEC/IEEE-bus command:

```
CALC:MARK:FUNC:POW:SEL CN
CALC:MARK:FUNC:POW:RES? CN
CALC:MARK:FUNC:POW:SEL CN0
CALC:MARK:FUNC:POW:RES? CN0
CALC:MARK:FUNC:POW OFF
```

CHANNEL BANDWIDTH

The *CHANNEL BANDWIDTH* softkey opens a window for selecting the measurement channel bandwidth.
The default setting is 14 kHz.
The specified channel bandwidth allows the optimal setting of the measurement parameters of the FSP using *ADJUST SETTINGS*.

IEC/IEEE-bus command:

```
SENS:POW:ACH:BWID 14kHz
```

ADJUST SETTINGS

The *ADJUST SETTINGS* softkey adapts the span to the channel bandwidth selected.
For the carrier/noise ratio measurement, the span is set to:

4 x channel bandwidth + measurement margin

The adjustment is performed once; if necessary, the setting can be changed later on.

IEC/IEEE-bus command:

```
SENS:POW:ACH:PRES CN | CN0
```

Measurement of the AM Modulation Depth

MODULATION DEPTH

The *MODULATION DEPTH* softkey switches on the measurement of the AM modulation depth. An AM-modulated carrier is required on the screen for ensuring correct operation.
The level value of *MARKER 1* is taken as the carrier level. When this function is activated, *MARKER 2* and *MARKER 3* are automatically set symmetrically to the carrier on the adjacent peak values of the trace as delta markers and *MARKER 2* is activated for the entry.
When the position of *MARKER 2* (delta) is changed, *MARKER 3* (delta) is moved symmetrically with respect to the reference marker (*MARKER 1*).
If the data entry is activated for *MARKER 3* (*MARKER 1 2 3 4* softkey), the latter can be moved for fine adjustment irrespective of *MARKER 2*.

The R&S FSMR calculates the power at the marker positions from the measured levels. The AM modulation depth is calculated from the ratio between the power values at the reference marker and at the delta markers. When the powers of the two AM side bands are unequal, the mean value of the two power values is used for AM modulation depth calculation.

Measurement example:

The AM modulation depth of a carrier modulated with 1 kHz is to be measured at 100 MHz.

[**PRESET**]	The R&S FSMR is set to the default setting.
[**CENTER**: 100 **MHz**]	The center frequency is set to 100 MHz.
[**SPAN**: 5 **kHz**]	The span is set to 5 kHz.
[**AMPT**: 0 **dBm**]	The reference level is set to 0 dBm.
[**MKR FCTN**]	*MARKER 1* is switched on and positioned at the maximum of the displayed trace.
[*MODULATION DEPTH*: 1 **kHz**]	The measurement of the AM modulation depth is switched on. *MARKERS 2* and *3* (delta markers) are set to the adjacent peak values of the trace and are activated for the frequency entry. The AM modulation depth is output in % in the marker info field. When 1 kHz is entered, *MARKER 2* can be exactly positioned on 1 kHz and *MARKER 3* at -1 kHz from the reference marker.

IEC/IEEE-bus command:

```
CALC:MARK:FUNC:MDEP ON;
CALC:MARK:FUNC:MDEP:RES?
```

Measurement of the Third Order Intercept (TOI)

If several signals are applied to a transmission twoport device with nonlinear characteristic, intermodulation products appear at its output by the sums and differences of the signals. The nonlinear characteristic produces harmonics of the useful signals which intermodulate at the characteristic. The intermodulation products of lower order have a special effect since their level is largest and they are near the useful signals. The intermodulation product of third order causes the highest interference. It is the intermodulation product generated from one of the useful signals and the 2nd harmonic of the second useful signal in case of two-tone modulation.

The frequencies of the intermodulation products are above and below the useful signals. Fig. 4.16-6 shows intermodulation products P_{I1} and P_{I2} generated by the two useful signals P_{U1} and P_{U2}.

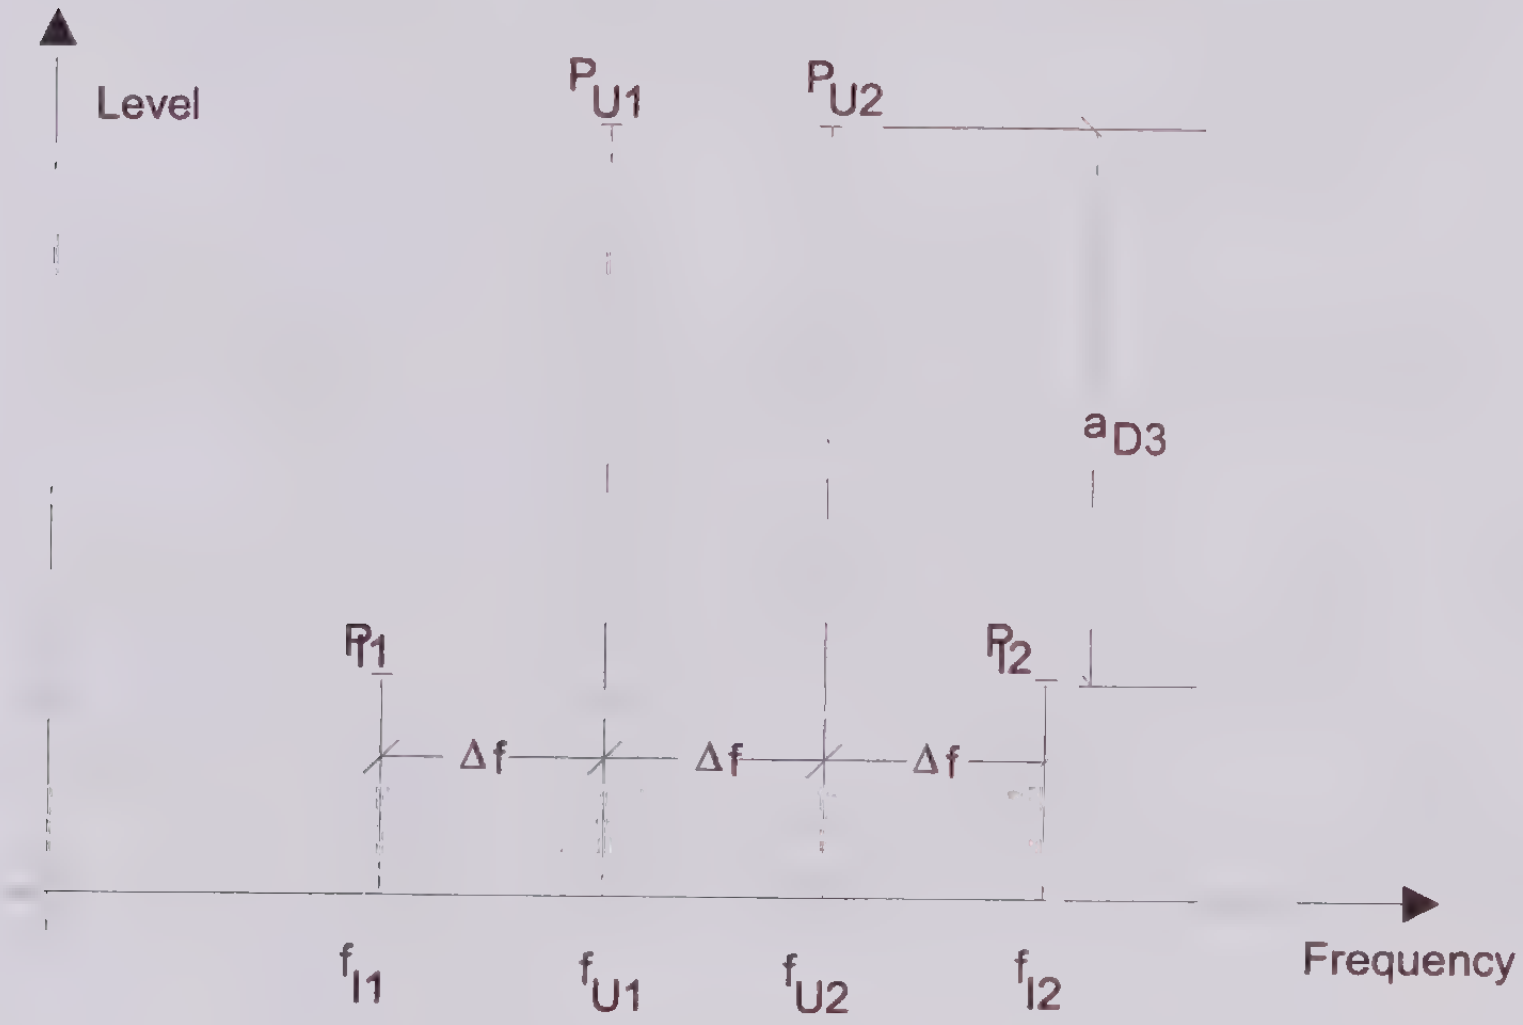

Fig. 4.16-6 Intermodulation products P_{U1} and P_{U2}

The intermodulation product at f_{I2} is generated by mixing the 2nd harmonic of useful signal P_{U2} and signal P_{U1}, the intermodulation product at f_{I1} by mixing the 2nd harmonic of useful signal P_{U1} and signal P_{U2}.

$f_{I1} = 2 \times f_{u1} - f_{u2}$ (1)

$f_{I2} = 2 \times f_{u2} - f_{u1}$ (2)

The level of the intermodulation products depends on the level of the useful signals. If the two useful signals are increased by 1 dB, the level of the intermodulation products increases by 3 dB, which means that spacing a_{D3} between intermodulation signals and useful signals is reduced by 2 dB. This is illustrated in Fig. 4.16-7.

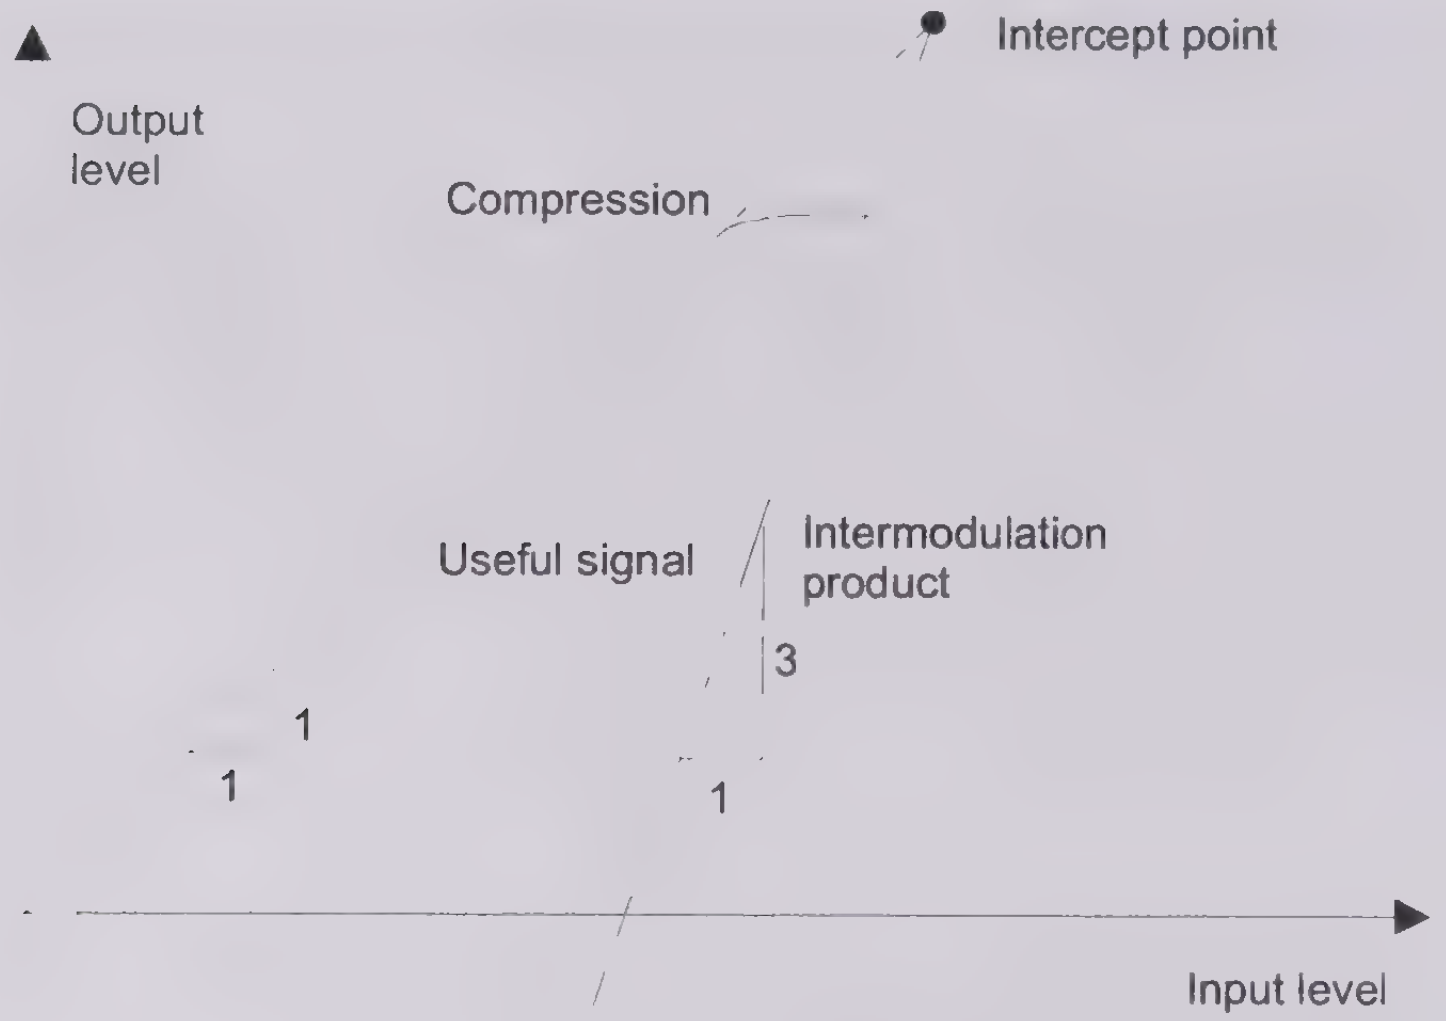

Fig. 4.16-7 Dependence of intermodulation level on useful signal level

The useful signals at the twoport output increase proportionally with the input level as long as the twoport is in the linear range. A level change of 1 dB at the input causes a level change of 1 dB at the output. Beyond a certain input level, the twoport goes into compression and the output level stops increasing. The intermodulation products of the third order increase three times as much as the useful signals. The intercept point is the fictitious level where the two lines intersect. It cannot be measured directly since the useful level is previously limited by the maximum twoport output power.
It can be calculated from the known line slopes and the measured spacing a_{D3} at a given level according to the following formula.

$$IP3 = \frac{a_{D3}}{2} + P_N \qquad (3)$$

The 3rd order intercept point (TOI), for example, is calculated for an intermodulation of 60 dB and an input level P_U of -20 dBm according to the following formula:

$$IP3 = \frac{60}{2} + (-20dBm) = 10dBm. \qquad (4)$$

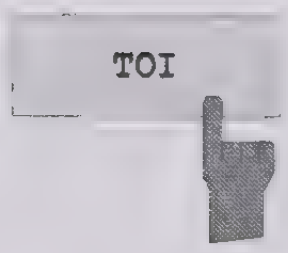

The *TOI* softkey enables the measurement of the 3rd order intercept point.
A two-tone signal with equal carrier levels is expected at the R&S FSMR input. *MARKER 1* and *MARKER 2* (both normal markers) are set to the maximum of the two signals. *MARKER 3* and *MARKER 4* (both delta markers) are placed on the intermodulation products. When the function is enabled, the frequency entry is activated for the delta markers. They can be set manually.
The R&S FSMR calculates the third order intercept from the level spacing between normal markers and delta markers and outputs it in the marker info field.

IEC/IEEE-bus command:

```
CALC:MARK:FUNC:TOI ON;
CALC:MARK:FUNC:TOI:RES?
```

Example:
A two-tone signal with frequencies of 100 MHz and 101 MHz is applied to the RF input of the R&S FSMR. The level of the two signals is -10 dBm.

[**PRESET**]	The R&S FSMR is set to the default setting.
[**CENTER**: 100.5 **MHz**]	The center frequency is set to 100.5 MHz.
[**SPAN**: 3 **MHz**]	The span is set to 3 MHz.
[**AMPT**: -10 **dBm**]	The reference level is set to -10 dBm.
[*MKR FCTN*]	*MARKER 1* is switched on and set to the signal peak.
[*TOI*]	The R&S FSMR sets the 4 markers to the useful signals and the intermodulation products and calculates the third order intercept. The result is output in the marker info field.

SELECT MARKER

The *SELECT MARKER* softkey activates the selection of a marker for functions *MODULATION DEPTH* and *TOI*. Thus, the markers can be fine-adjusted for these functions.
The markers are numerically selected in a data entry field. Delta marker 1 is selected by entering '0'.
If the marker is in the switch-off state, it will be switched on and can thus be shifted.

IEC/IEEE-bus command:

```
CALC:MARK1 ON;
CALC:MARK1:X <value>;
CALC:MARK1:Y?
```

Setup of Limit Lines and Display Lines – LINES Key

Limit lines are used to define amplitude curves or spectral distribution boundaries on the display screen which are not to be exceeded. They indicate, for example, the upper limits for interference radiation or spurious waves which are allowed from a unit under test (UUT). For transmission of information in TDMA (e.g. GSM), the amplitude of the bursts in a timeslot must adhere to a curve which must fall within a specified tolerance band. The lower and upper limits may each be specified by a limit line. Then, the amplitude curve can be controlled either visually or automatically for any violations of the upper or lower limits (GO/NOGO test).
The instrument supports limit lines with a maximum of 50 data points. 8 of the limit lines stored in the instrument can be used simultaneously and activated in the split-screen mode either in Screen A, Screen B or in the two windows. The number of limit lines stored in the instrument is only limited by the capacity of the flashdisk used.

For each limit line, the following characteristics must be defined:

- The name of the limit line. The limit line data are stored under this name and can be examined in the table *LIMIT LINES.*
- The domain in which the limit line is to be used. Here, a distinction is made between the time domain (span = 0 Hz) and the frequency domain (span > 0 Hz).
- The reference of the interpolation points to the X axis. The limit line may be specified either for absolute frequencies or times or for frequencies which are related to the set center frequency and times related to the time on the left edge of the diagram.
- The reference of the interpolation points to the Y axis. The limit line can be selected either for absolute levels or voltages or referred to the set maximum level (Ref Lvl). The position on the display depends on the *REF LEVEL POSITION.*
- With relative reference values for the Y axis, it is possible to enter an absolute threshold (THRESHOLD) which lowers the relative limit values (see below).
- The type of limit line (upper or lower limit). With this information and the active limit checking function (Table *LIMIT LINES*, *LIMIT CHECK ON*, the R&S FSMR checks for compliance with each limit.
- The limit line units to be used. The units of the limit line must be compatible with the level axis in the active measurement window.
- The measurement curve (trace) to which the limit line is assigned. For the R&S FSMR, this defines the curve to which the limit is to be applied when several traces are simultaneously displayed.
- For each limit line, a margin can be defined which serves as a threshold for automatic evaluation.
- In addition, commentary can be written for each limit line, e.g. a description of the application.

Display lines are exclusively used to optically mark relevant frequencies or points in time (span = 0) as well as constant level values. It is not possible to check automatically whether the marked level values have been underranged or exceeded.

Selection of Limit Lines

The *LINES* key opens the menu for fixing the limit lines and the display lines.

LINES menu

LINES

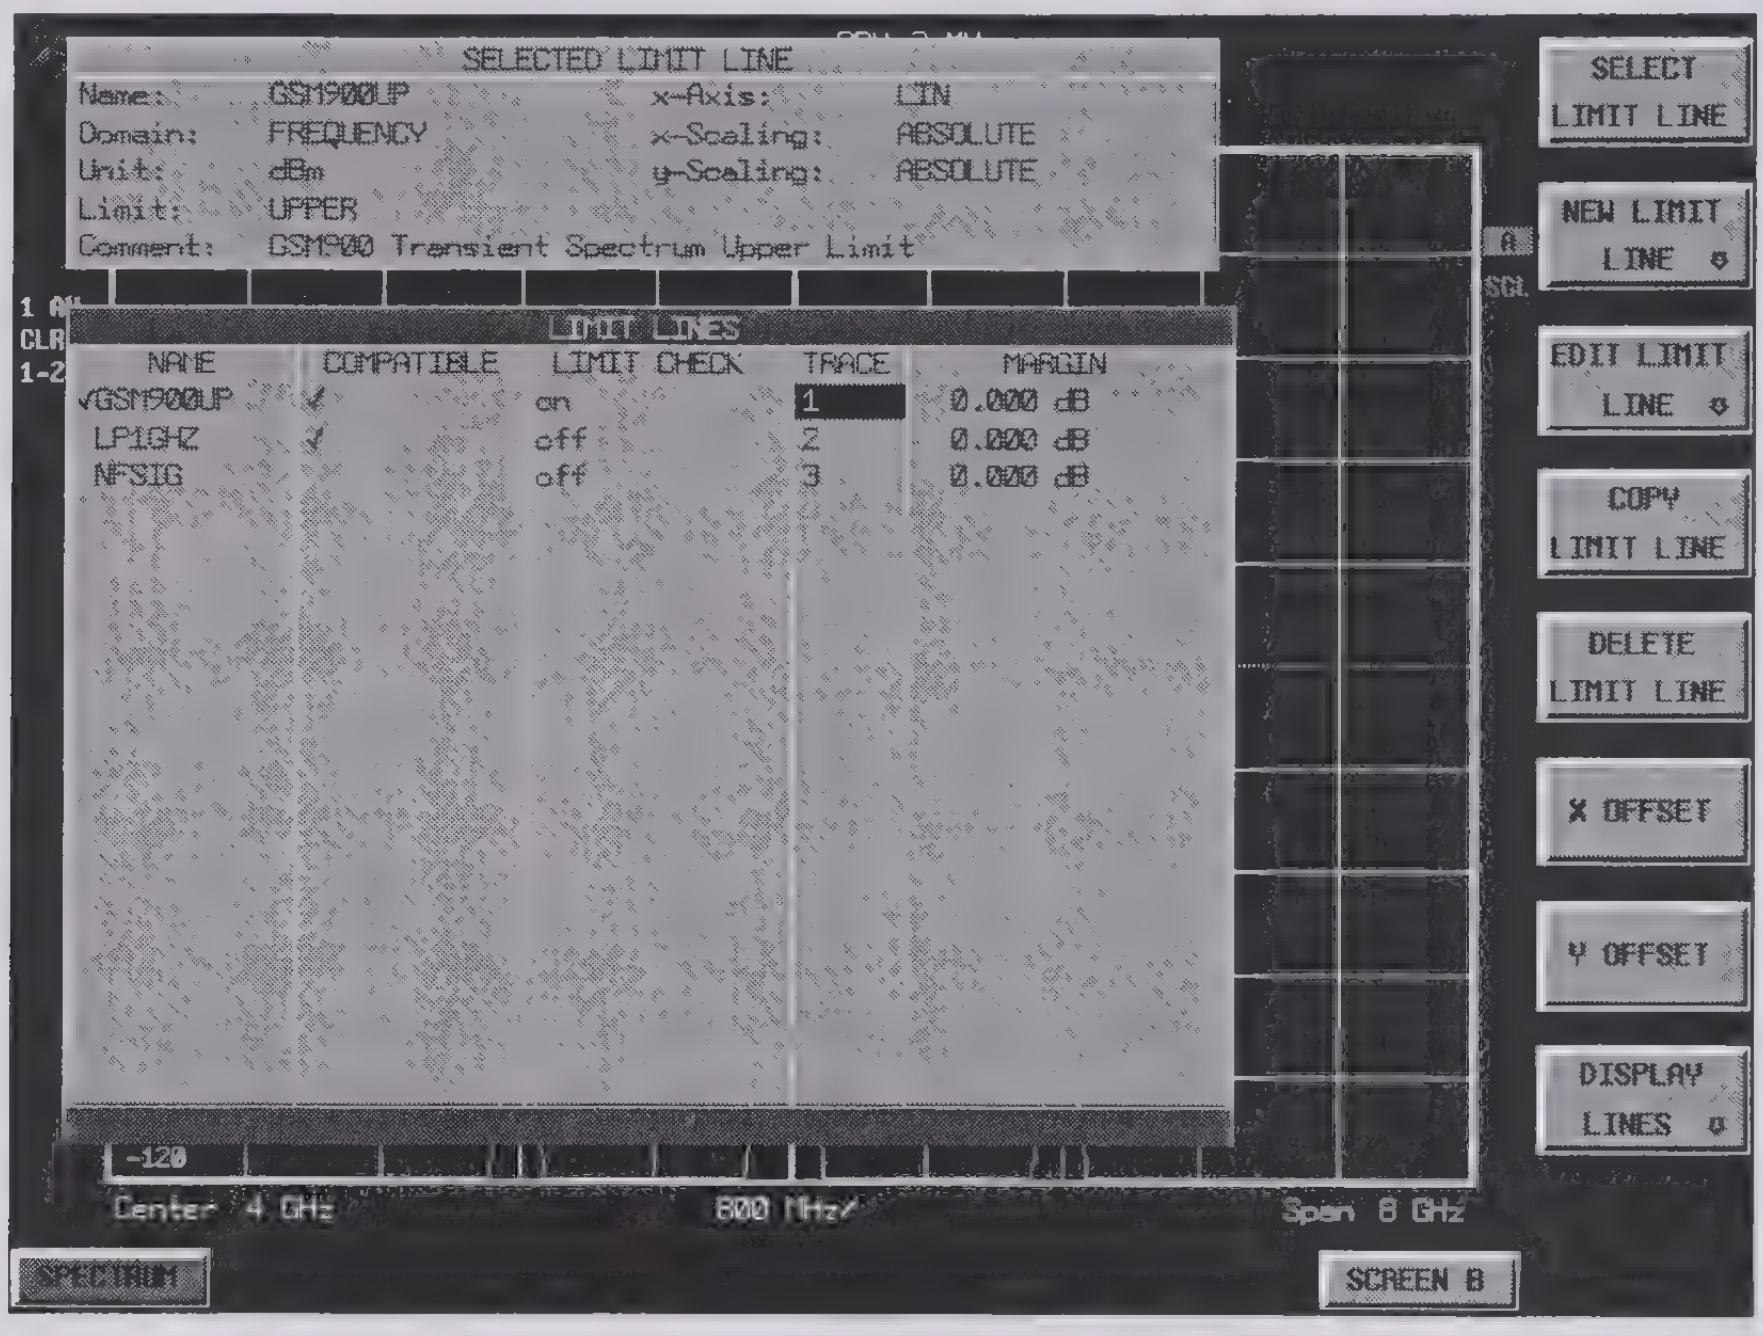

SELECTED LIMIT LINE

Name: GSM900UP
Domain: FREQUENCY
Unit: dBm
Limit: UPPER
Comment: GSM900 Transient Spectrum Upper Limit
x-Axis: LIN
x-Scaling: ABSOLUTE
y-Scaling: ABSOLUTE

LIMIT LINES

NAME	COMPATIBLE	LIMIT CHECK	TRACE	MARGIN
✓GSM900UP	✓	on	1	0.000 dB
LP1GHZ	✓	off	2	0.000 dB
NFSIG		off	3	0.000 dB

The *SELECTED LIMIT LINE* display field provides information concerning the characteristics of the marked limit lines.

In the *LIMIT LINES* table, the limit lines compatible to the settings of the active screen can be enabled.

New limit lines can be specified and edited in the *NEW LIMIT LINE and EDIT LIMIT LINE* sub-menus, respectively.

The horizontal and vertical lines of the *DISPLAY LINES* submenu mark individual levels or frequencies (span > 0) or times (span = 0) in the diagram.

The *SELECTED LIMIT LINE* table provides information about the characteristics of the marked limit line :

Name	name
Domain	frequency or time
Unit	vertical scale
X-Axis	interpolation
Limit	upper/lower limit
X-Scaling	absolute or relative frequencies/times
Y-Scaling	absolute or relative Y units
Threshold	absolute limit with relative Y units
Comment	commentary

The characteristics of the limit line are set in the *EDIT LIMIT LINE (=NEW LIMIT LINE)* sub-menu.

SELECT LIMIT LINE

The *SELECT LIMIT LINE* softkey activates the *LIMIT LINES* table and the selection bar jumps to the uppermost name in the table.

The following information is offered in the columns of the table:

Name	Enable the limit line.
Compatible	Indicates if the limit line is compatible with the measurement window of the given trace.
Limit Check	Activate automatic violation check for upper/lower limits.
Trace	Select the measurement curve to which the limit is assigned.
Margin	Define margin.

Name and Compatible - Enabling limit lines

A maximum of 8 limit lines can be enabled at any one time. In split screen mode, they may be assigned to screen A, screen B or to both screens. A check mark at the left edge of a cell indicates that this limit line is enabled.
A limit line can only be enabled when it has a check mark in the *Compatible* column, i.e. only when the horizontal display (time or frequency) and vertical scales are ***identical*** to those of the display in the measurement window.
Lines with the unit dB are compatible to all dB(..) settings of the Y axis.

If the scale of the y axis or the domain (frequency or time axis) are changed, all non-compatible limit lines are automatically switched off in order to avoid misinterpretation. The limit lines must be enabled anew when the original display is re-displayed.

IEC/IEEE-bus command:

```
CALC:LIM3:NAME "GSM1"
CALC:LIM3:UPP:STAT ON
CALC:LIM4:LOW:STAT ON
```

Limit Check - Activate automatic limit violation check

When *LIMIT CHECK ON* is activated, a GO/NOGO test is performed in the active screen. In the center of the diagram, a display window appears which indicates the results of the limit check test:

LIMIT CHECK: PASSED	No violations of active limits.
LIMIT CHECK: FAILED	One or more active limit lines were violated. The message contains the names of the limit lines which were violated or whose margins were not complied with.
LIMIT CHECK: MARGIN	The margin of at least one active limit lines was not complied with, however, no limit line was violated. The message contains the names of the limit lines whose margins were not complied with.

The following example shows two active limit lines:



```
LIMIT CHECK: FAILED

LINE VHF_MASK: Failed
LINE UHF2MASK: Margin
```

A check for violations of limit lines takes place only if the limit line of the assigned measurement curve (trace) is enabled.
If *LIM CHECK* is set to *OFF* for all active limit lines, then the limit line check is not executed and the display window is activated.

IEC/IEEE-bus command:

```
CALC:LIM:STAT ON
INIT;*WAI
CALC:LIM:FAIL?
```

Trace - Select the measurement curve to which the limit line is assigned.

The selection of the measurement curve (trace) takes place in an entry window. Allowed are the integer entries 1, 2 or 3. The default setting is trace 1. If the selected limit line is not compatible with the assigned measurement curve, then the limit line is disabled (display and limit check).

IEC/IEEE-bus command: `CALC:LIM:TRAC 1`

NEW LIMIT LINE

See following Section "Entry and Editing of Limit Lines".

EDIT LIMIT LINE

COPY LIMIT LINE

The *COPY LIMIT LINE* softkey copies the data file describing the marked limit line and saves it under a new name. In this way, a new limit line can be easily generated by parallel translation or editing of an existing limit line. The name can be arbitrarily chosen and input via an entry window (max. of 8 characters).

IEC/IEEE-bus command: `CALC:LIM3:COPY 2` or
`CALC:LIM3:COPY "GSM2"`

DELETE LIMIT LINE

The *DELETE LIMIT LINE* softkey erases the selected limit line. Before deletion, a message appears requesting confirmation.

IEC/IEEE-bus command: `CALC:LIM3:DEL`

X OFFSET

The *X OFFSET* softkey horizontally shifts a limit line, which has been specified for relative frequencies or times (X axis). The softkey opens an entry window, where the value for shifting may be entered numerically or via the rollkey.

Note: *This softkey does not have any effect on limit lines that represent absolute values for the X axis.*

IEC/IEEE-bus command: `CALC:LIM3:CONT:OFFS 10kHz`

Y OFFSET

The *Y OFFSET* softkey vertically shifts a limit line, which has relative values for the Y axis (levels or linear units such as volt). The softkey opens an entry window where the value for shifting may be entered numerically or via the rollkey.

Note: *This softkey does not have any effect on limit lines that represent absolute values for the Y axis.*

IEC/IEEE-bus command: `CALC:LIM3:LOW:OFFS 3dB`
`CALC:LIM3:UPP:OFFS 3dB`

Entry and Editing of Limit Lines

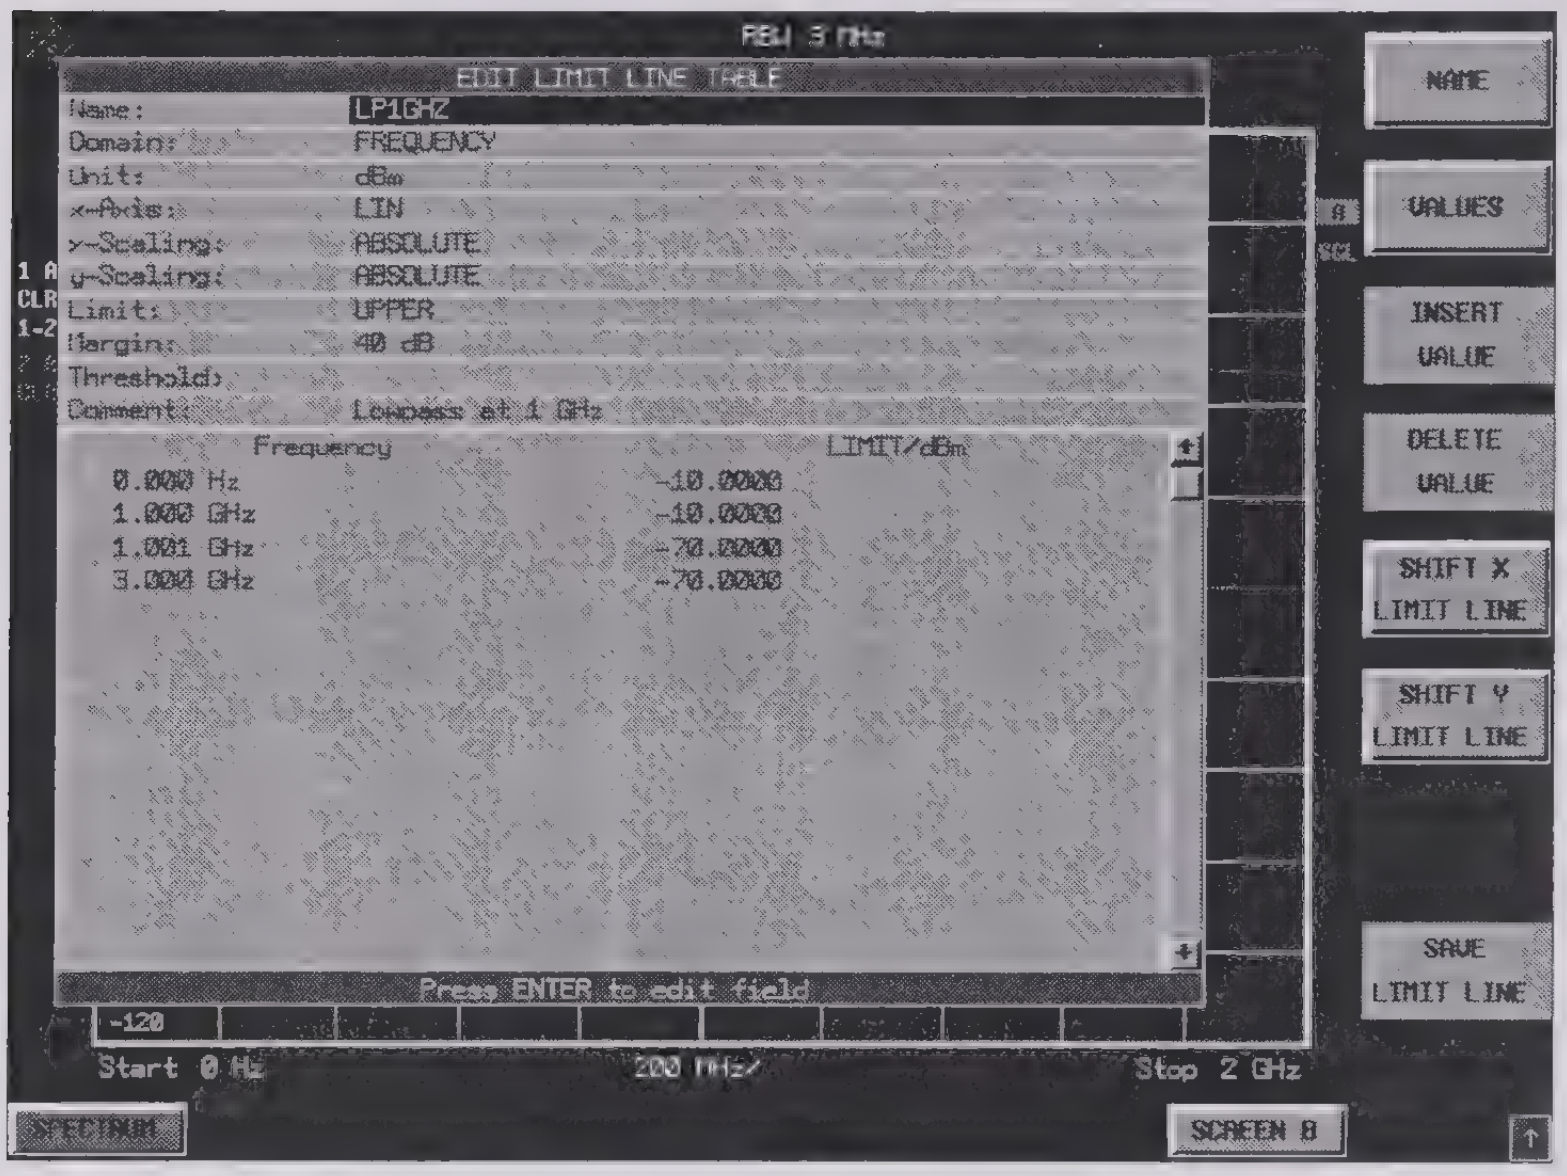

EDIT LIMIT LINE TABLE

Name: LP1GHZ
Domain: FREQUENCY
Unit: dBm
x-Axis: LIN
x-Scaling: ABSOLUTE
y-Scaling: ABSOLUTE
Limit: UPPER
Margin: 40 dB
Threshold:
Comment: Lowpass at 1 GHz

Frequency	LIMIT/dBm
0.000 Hz	-10.0000
1.000 GHz	-10.0000
1.001 GHz	-70.0000
3.000 GHz	-70.0000

Press ENTER to edit field

A limit line is characterized by

- its name
- the assignment of domain (frequency or time)
- the scaling in absolute or relative times or frequencies
- the vertical unit
- the interpolation
- the vertical scaling
- the vertical threshold (only with relative vertical scaling)
- the margin
- the definition of the limit line as either upper or lower limit.
- the data points for frequency/time and level

At the time of entry, the R&S FSMR immediately checks that all limit lines are in accordance with certain guidelines. These guidelines must be observed if specified operation is to be guaranteed.

- The frequencies/times for each data point must be entered in ascending order, however, for any single frequency/time, two data points may be input (vertical segment of a limit line).

  The data points are allocated in order of ascending frequency/time. Gaps are not allowed. If gaps are desired, two separate limit lines must be defined and then both enabled.

- The entered frequencies/times need not necessarily be selectable in R&S FSMR. A limit line may also exceed the specified frequency or time domains. The minimum frequency for a data point is -200 GHz, the maximum frequency is 200 GHz. For the time domain representation, negative times may also be entered. The valid range is -1000 s to +1000 s.
- The minimum/maximum value for a limit line is -200 dB to +200 dB for the logarithmic or 10^{-20} to 10^{+20} or -99.9% to + 999.9% for the linear amplitude scales.

LINES - EDIT LIMIT LINE menu

EDIT LIMIT LINE

NEW LIMIT LINE

The *EDIT LIMIT LINE* and *NEW LIMIT LINE* softkeys both call the *EDIT LIMIT LINE* sub-menu used for editing limit lines. In the table heading, the characteristics of the limit line can be entered. The data points for frequency/time and level values are entered in the columns.

Name	Enter name.
Domain	Select domain.
Unit	Select units.
X-Axis	Select interpolation
Limit	Select upper and lower limit value.
X-Scaling	Entry of absolute or relative values for the X axis
Y-Scaling	Entry of absolute or relative values for the Y axis
Margin	Entry of margin.
Threshold	Entry of vertical threshold (only with relative vertical scaling)
Comment	Enter comments.
Time/Frequency	Enter time/frequency for the data points.
Limit/dBm	Enter magnitudes for the data points.

Note: *Domain, unit, X scaling and Y scaling cannot be modified as soon as reference values have been entered in the data section of the table.*

NAME

The *NAME* softkey enables the entry of characteristics in the table heading.

Name **- Enter name**

A maximum of 8 characters is permitted for each name. All names must be compatible with the MS DOS conventions for file names. The instrument stores all limit lines with the .LIM extension.

IEC/IEEE-bus command: `CALC:LIM3:NAME "GSM1"`

Domain **- Select time or frequency domain**

The default setting is frequency.

Note: *A change in domain (frequency/time) is only permitted when the data point table is empty.*

IEC/IEEE-bus command: `CALC:LIM3:CONT:DOM FREQ`

X Axis - Select interpolation

Linear or logarithmic interpolation can be carried out between the frequency reference points of the table. The ENTER key toggles between LIN and LOG selection.

IEC/IEEE-bus commands

```
CALC:LIM3:CONT:SPAC LIN
CALC:LIM3:UPP:SPAC LIN
CALC:LIM3:LOW:SPAC LIN
```

Scaling - selection of absolute or relative scaling

The limit line can either be scaled in absolute (frequency or time) or relative units. Any of the unit keys may be used to toggle between *ABSOLUTE* and *RELATIVE*, the cursor must be positioned in the X *Scaling* or the *Y Scaling* line.

X-Scaling ABSOLUTE	The frequencies or times are interpreted as absolute physical units.
X-Scaling RELATIVE	In the data point table, the frequencies are referred to the currently set center frequency. In time domain mode, the left boundary of the diagram constitutes the reference.
Y-Scaling ABSOLUTE	The limit values refer to absolute levels or voltages.
Y-Scaling RELATIVE	The limit values refer to the reference level (Ref Level) or, in case a reference line is set, to the reference line. Limit values with the unit dB are always relative values.

The *RELATIVE* scaling is always suitable, if masks for bursts are to be defined in the time domain, or if masks for modulated signals are required in the frequency domain.
An X offset with half the sweep time may be entered in order to shift the mask in the time domain into the center of screen.

IEC/IEEE-bus command:

```
CALC:LIM3:CONT:MODE ABS
CALC:LIM3:UPP:MODE ABS
CALC:LIM3:LOW:MODE ABS
```

Unit - Select the vertical scale units for the limit line

The selection of units takes place in a selection box. The default setting is dBm.

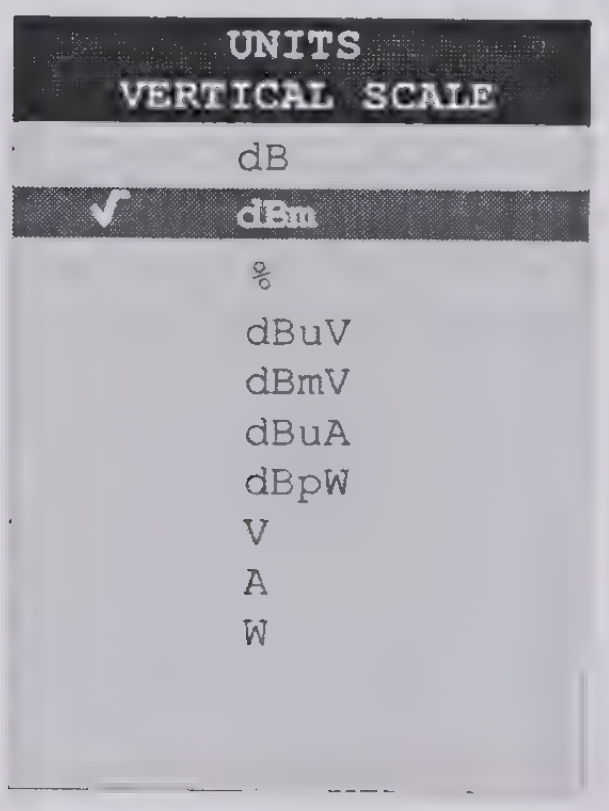

IEC/IEEE-bus command:

```
CALC:LIM3:UNIT DBM
```

Limit - Select upper/lower limit

A limit line can be defined as either an upper or lower limit.

IEC/IEEE-bus command: --

```
(defined by key words :UPPer or :LOWer)
```

Margin - Setting a margin.

The margin is defined as the signal-level distance to the limit line . When the limit line is defined as an upper limit, the margin means that the level is below the limit line. When the limit line is defined as a lower limit, the margin means that the level is above the limit line. The default setting is 0 dB (i.e. no margin).

IEC/IEEE-bus command:

```
CALC:LIM3:UPP:MARG 10dB
CALC:LIM3:LOW:MARG 10dB
```

Threshold – Selection of the threshold value with relative Y scaling

With relative Y scaling, an absolute threshold value can be defined which lowers the relative limit values. The function is useful especially for mobile radio applications provided the limit values are defined in relation to the carrier power as long as they are above an absolute limit value.

Example:

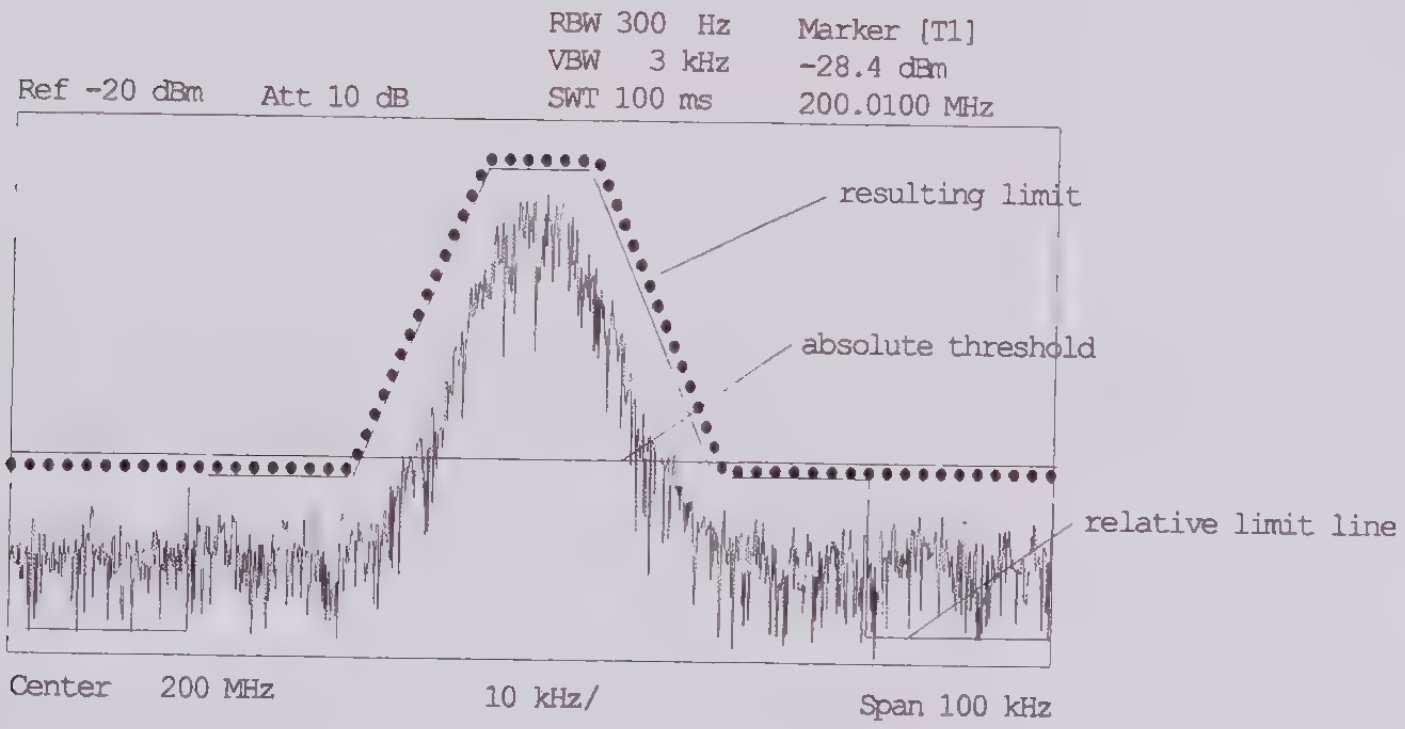

The preset value is at -200 dBm. The field is displayed if the value RELATIVE is entered in the field Y-SCALING.

IEC/IEEE-bus command:

```
CALC:LIM3:UPP:THR -30 dBm
or
CALC:LIM3:LOW:THR -30 dBm
```

Comment - Enter comments

Comments are arbitrary, however, they must be less than 41 characters long.

IEC/IEEE-bus command:

```
CALC:LIM3:COMM "Upper limit"
```

VALUES

The *VALUES* softkey activates the entry of the data points in the table columns *Time/Frequency* and *Limit/dB*. Which table columns appear depends upon the *Domain* selection in the table heading.

The desired frequency/time data points are entered in ascending order (two repeated frequencies/time values are permitted).

IEC/IEEE-bus command:

```
CALC:LIM3:CONT:DATA 1MHz,3MHz,30MHz
CALC:LIM3:UPP:DATA -10,0,0
CALC:LIM3:LOW:DATA -30,-40,-40
```

INSERT VALUE

The *INSERT VALUE* softkey creates an empty line above the current cursor position where a new data point may be entered. However, during the entry of new values, it is necessary to observe an ascending order for frequency/time.

IEC/IEEE-bus command: --

DELETE VALUE

The *DELETE VALUE* softkey erases the data point (complete line) at the cursor position. All succeeding data points are shifted down accordingly.

IEC/IEEE-bus command: --

SHIFT X LIMIT LINE

The *SHIFT X LIMIT LINE* softkey calls an entry window where the complete limit line may be shifted parallel in the horizontal direction.

The shift takes place according to the horizontal scale:

- in the frequency domain in Hz, kHz, MHz or GHz
- in the time domain in ns, µs, ms or s

In this manner, a new limit line can be easily generated based upon an existing limit line which has been shifted horizontally and stored (*SAVE LIMIT LINE* softkey) under a new name (*NAME* softkey).

IEC/IEEE-bus command:

```
CALC:LIM3:CONT:SHIF 50KHz
```

SHIFT Y LIMIT LINE

The *SHIFT Y LIMIT LINE* softkey calls an entry window where the complete limit line may be shifted parallel in the vertical direction.

The shift takes place according to the vertical scale:

- for logarithmic units, relative, in dB
- for linear units, as a factor

In this manner, a new limit line can be easily generated based upon an existing limit line which has been shifted vertically and stored (*SAVE LIMIT LINE* softkey) under a new name (*NAME* softkey).

IEC/IEEE-bus command:

```
CALC:LIM3:CONT:UPP:SHIF 20dB
CALC:LIM3:CONT:LOW:SHIF 20dB
```

SAVE LIMIT LINE

The *SAVE LIMIT LINE* softkey stores the currently edited limit line . The name can be entered in an input window (max. 8 characters)

IEC/IEEE-bus command: --

Display Lines

Display lines help to evaluate a trace – as do markers. The function of a display line is comparable to that of a ruler that can be shifted on the trace in order to mark absolute values.

The R&S FSMR provides two different types of display lines :

- two horizontal level lines for marking levels – Display Line 1/2,
- two vertical frequency or time lines for marking frequencies or points in time – Frequency/Time Line 1/2.

Each line is identified by one of the following abbreviations:

D1	Display Line 1
D2	Display Line 2
F1	Frequency Line 1
F2	Frequency Line 2
T1	Time Line 1
T2	Time Line 2

The level lines are continuous horizontal lines across the entire width of a diagram and can be shifted in y direction.

The frequency or time lines are continuous vertical lines across the entire height of the diagram and can be shifted in x direction.

The *DISPLAY LINES* submenu for activating and setting the display lines appears different depending on the display mode set in the active measurement window (frequency or time domain).

If the spectrum is shown (span ≠ 0) the *TIME LINE 1* and *TIME LINE 2* softkeys are disabled, whereas in the time domain (span = 0) the *FREQUENCY LINE 1* and *FREQUENCY LINE 2* softkeys are not available.

The softkeys for setting and switching the display lines on/off work like triple switches:
Initial situation: The line is off (softkey with gray background)

1st press:	*The line is switched on (softkey with red background) and the data input function is activated. The position of the display line can be selected by means of the rollkey, the step keys or a numerical entry in the appropriate field. The data input function is disabled if another function is activated. The line, however, remains switched on (softkey with green background).*
2nd press:	*The line is switched off (softkey with gray background).*

Initial situation: The line is on (softkey with green background)

1st press:	*The data input function is activated (softkey with red background). The position of the display line can be selected by means of the rollkey, the step keys or a numerical entry in the appropriate field. The data input function is disabled if another function is activated. The line, however, remains switched on (softkey with green background).*
2nd press:	*The line is switched off (softkey with gray background).*

LINES menu

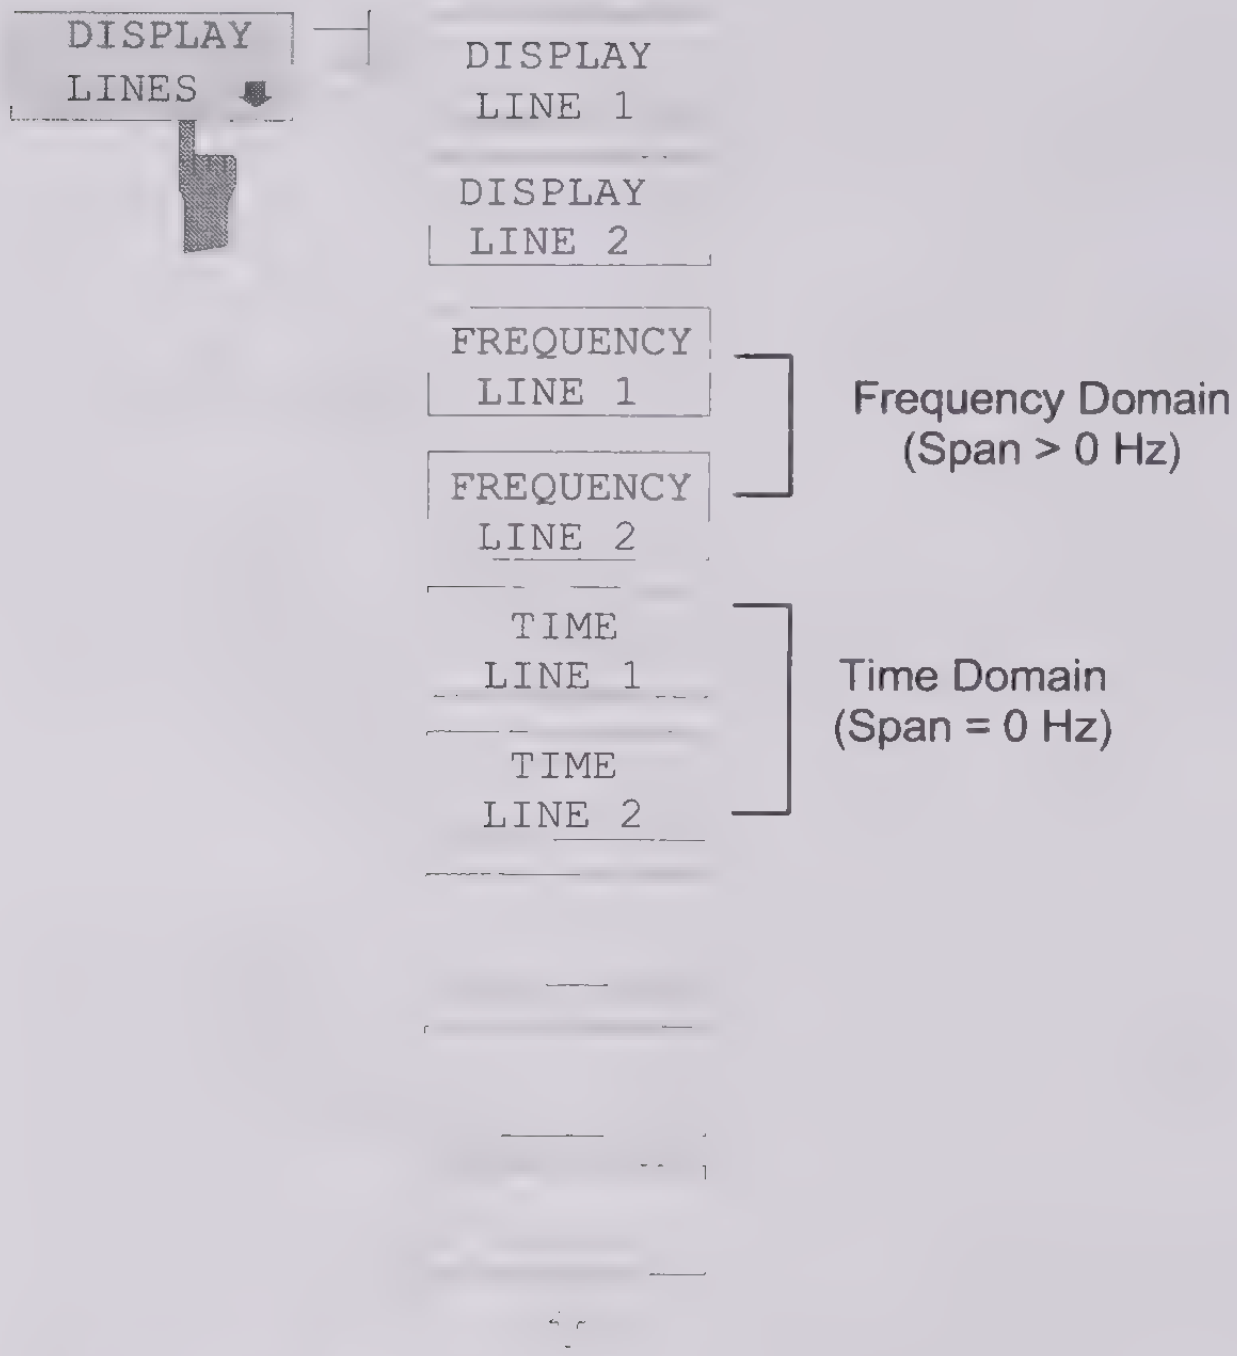

DISPLAY LINE 1

DISPLAY LINE 2

The *DISPLAY LINE 1/2* softkeys enable or disable the level lines and allow the user to enter the position of the lines.

The level lines mark the selected level in the measurement window.

IEC/IEEE-bus command: `CALC:DLIN:STAT ON`
`CALC:DLIN -20dBm`

FREQUENCY LINE 1

FREQUENCY LINE 2

The *FREQUENCY LINE 1/2* softkeys enable or disable the frequency lines 1/2 and allow the user to enter the position of the lines.

The frequency lines mark the selected frequencies in the measurement window.

Note: *The two softkeys cannot be used in the time domain (span = 0).*

IEC/IEEE-bus command: `CALC:FLIN:STAT ON`
`CALC:FLIN 120MHz`

TIME LINE 1

TIME LINE 2

The *TIME LINE 1/2* softkeys enable or disable the time lines 1/ and allow the user to enter the position of the lines.

The time lines mark the selected times or define search ranges (see section "Marker Functions ").

Note: *The two softkeys cannot be used in the frequency domain (span > 0).*

IEC/IEEE-bus command: `CALC:TLIN:STAT ON`
`CALC:TLIN 10ms`

Configuration of Screen Display – DISP Key

The *DISPLAY* menu allows the configuration of the diagram display on the screen and also the selection of the display elements and colors. The *POWER SAVE* mode is also configured in this menu for the display.

The test results are displayed on the screen of the R&S FSMR either in a full-screen window or in two overlapping windows. The two windows are called diagram A and diagram B.

In the default setting, the two windows are completely decoupled from each other, ie they behave like two separate instruments. This is very useful, for example with harmonics measurements or measurements on frequency-converting DUTs, since the input signal and the output signal lie in different frequency ranges.

However, specific settings of the two windows (reference level, center frequency) can be coupled, if required, so that with *CENTER B = MARKER A* for example, the shift of the marker in diagram A causes the frequency range (zoomed in some cases) to be shifted along diagram B.

New setttings are performed in the diagram selected via hotkey SCREEN A or SCREEN B. If only one window is displayed, it is the diagram in which the measurements are performed; the diagram not displayed is not active for measurements.

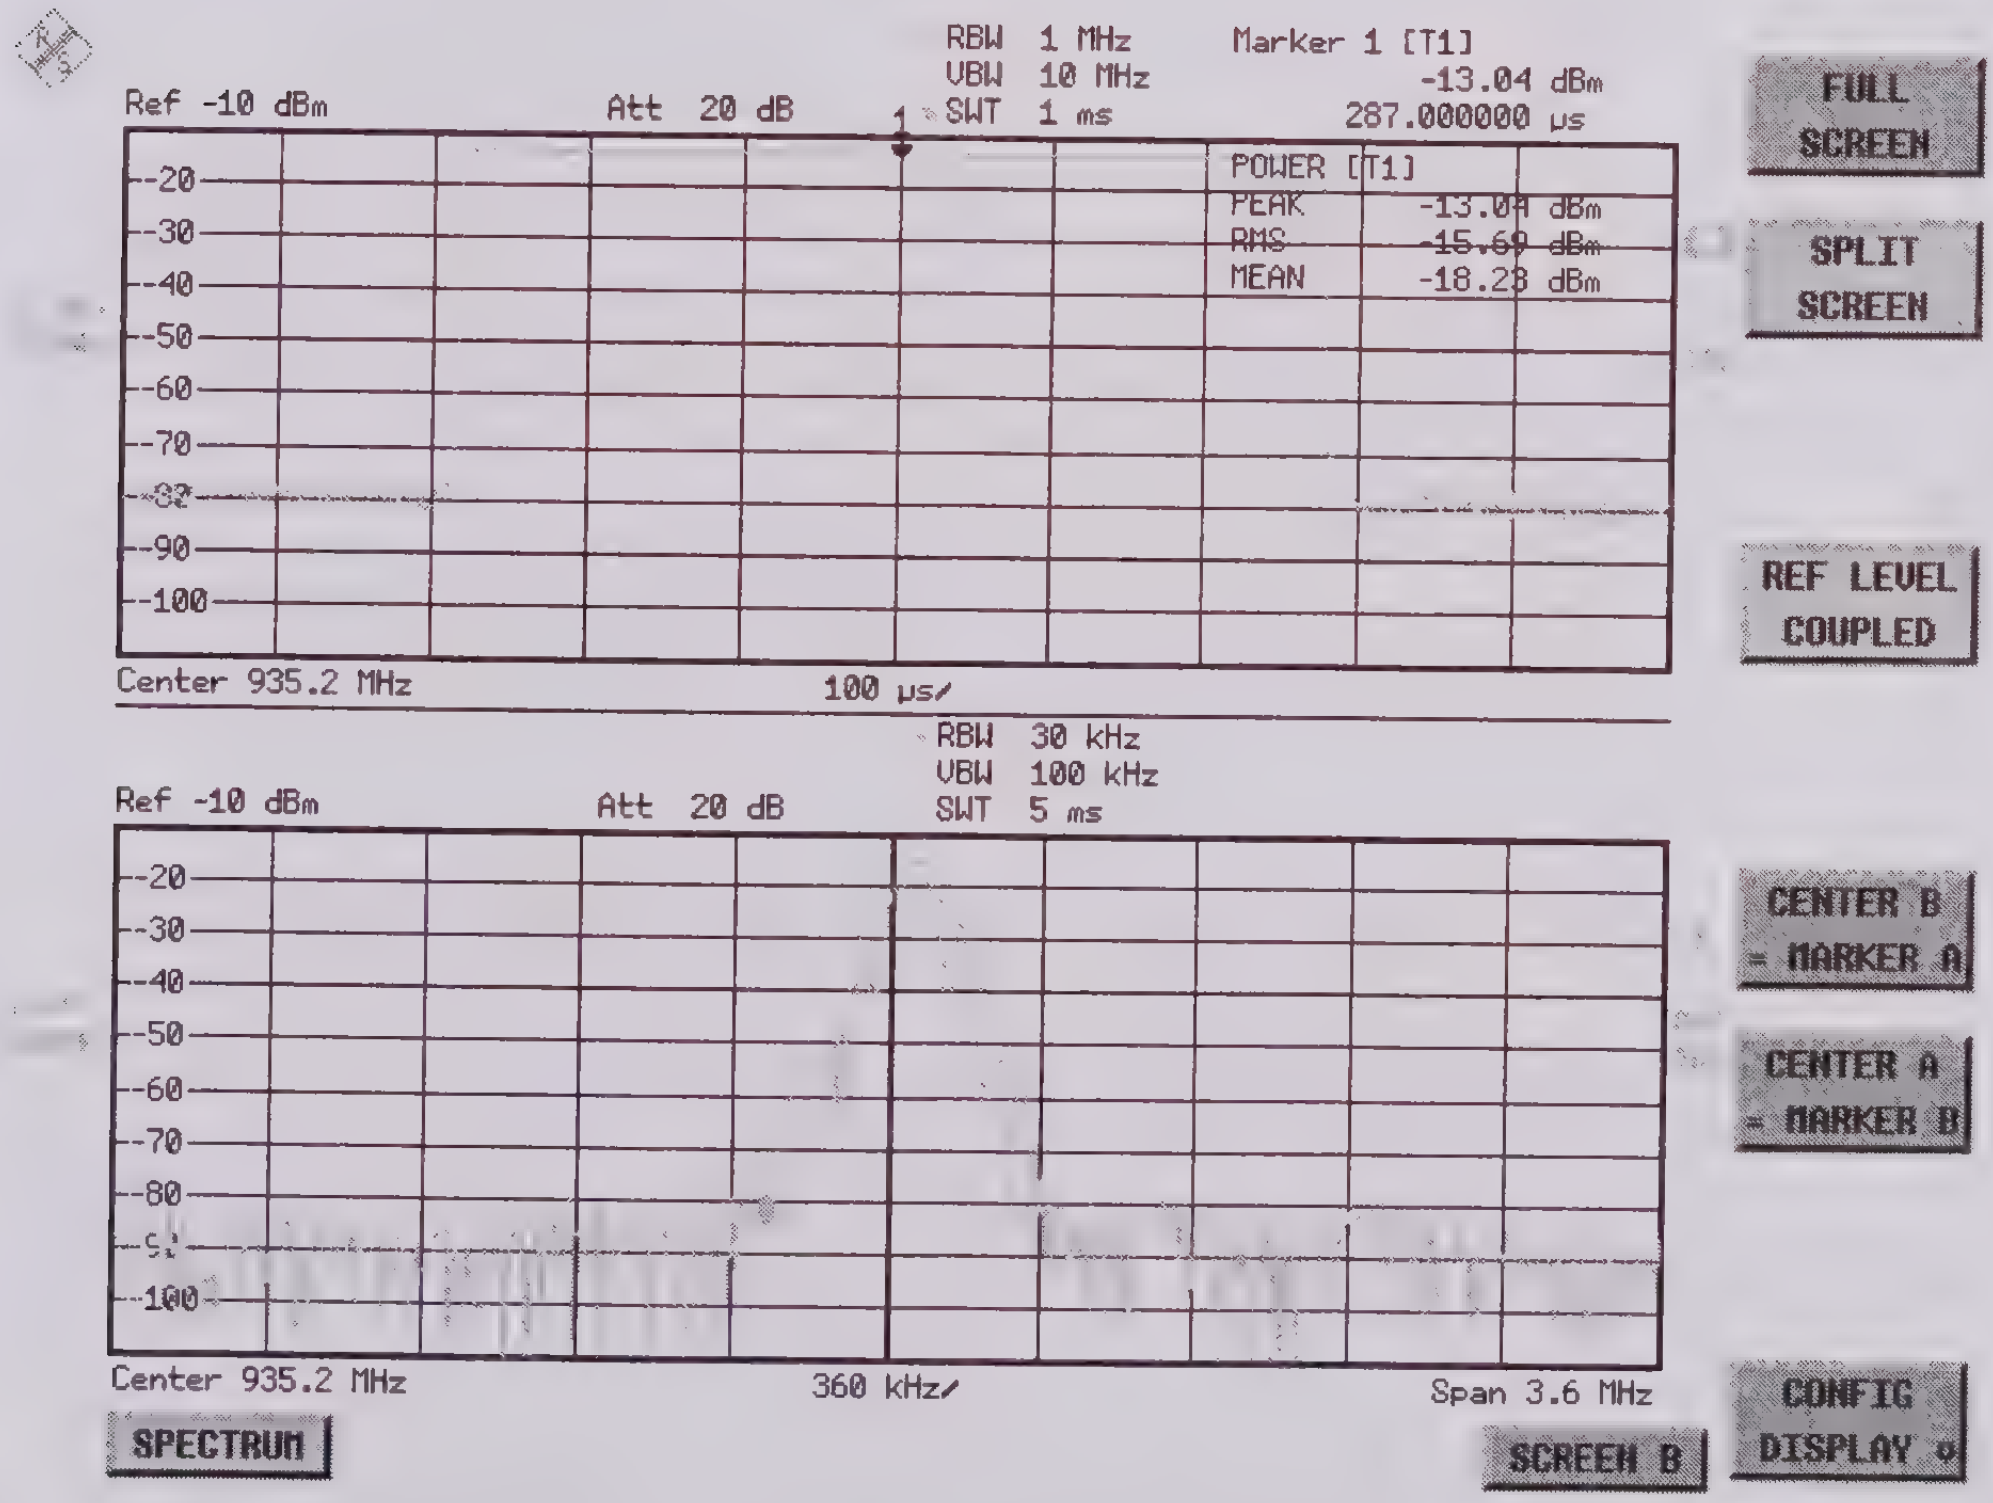

Ref -10 dBm Att 20 dB RBW 1 MHz VBW 10 MHz SWT 1 ms

Marker 1 [T1] -13.04 dBm 287.000000 µs

POWER [T1]
PEAK -13.04 dBm
RMS -15.69 dBm
MEAN -18.28 dBm

Center 935.2 MHz 100 µs/

Ref -10 dBm Att 20 dB RBW 30 kHz VBW 100 kHz SWT 5 ms

Center 935.2 MHz 360 kHz/ Span 3.6 MHz

Fig. 4.18-1 Typical split-screen display, settings are uncoupled

The *DISP* key opens the menu for configuring the screen display and selecting the active diagram in SPLIT SCREEN mode.

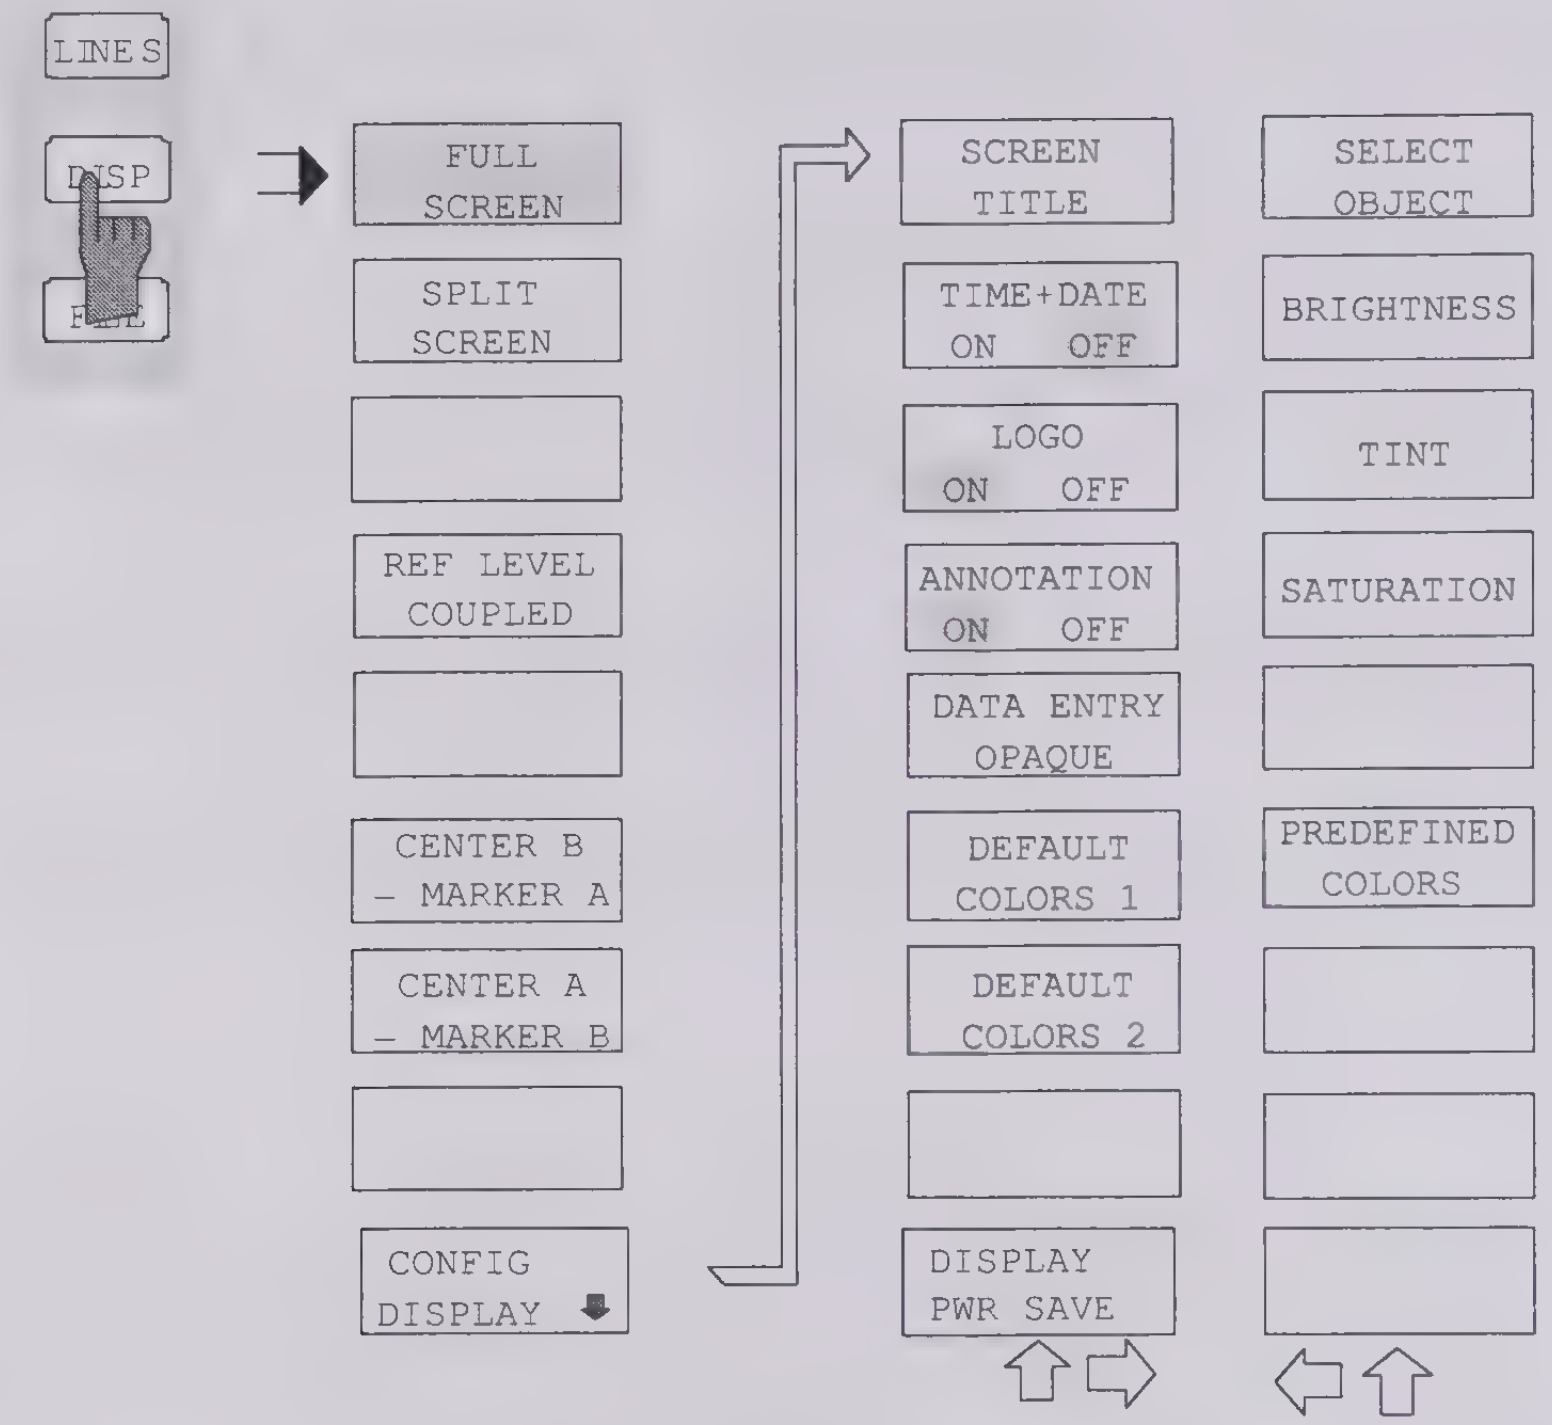



The *FULL SCREEN* softkey selects the display of one diagram. This corresponds to the default setting of R&S FSMR.

In the *FULL SCREEN* mode it is possible to switch between two different device settings by selecting the active window (screen A or screen B). Switching between *SCREEN A* and *SCREEN B* is performed by means of the corresponding key in the *HOTKEY bar*.



It should be noted that the measurements in the FULL SCREEN mode are performed only in the visible (active) window.

The active window is marked by A or B on the right of the diagram.

IEC/IEEE-bus command: `DISP:FORM SING`
`DISP:WIND<1|2>:SEL`

The *SPLIT SCREEN* softkey selects the display of two diagrams. The upper diagram is designated *SCREEN A*, the lower diagram *SCREEN B*.

Switching between *SCREEN A* and *SCREEN B* is performed via the corresponding key in the *HOTKEY* bar. The active window is marked by highlighting fields A and B on the right of the diagram.

IEC/IEEE-bus command: `DISP:FORM SPL`

The *REF LEVEL COUPLED* softkey switches the coupling of the reference level on and off. In addition to the reference level, the mixer level and input attenuation are coupled with one another.

For the level measurement, the same reference level and input attenuation must be set for the two diagrams.

IEC/IEEE-bus command `INST:COUP RLEV`

The *CENTER B = MARKER A and CENTER A = MARKER B* softkeys couple the center frequency in diagram B with the frequency of marker 1 in diagram A and the center frequency in diagram B with the frequency of marker 1 in diagram B. The two softkeys are mutually exclusive.

This coupling is useful, eg for viewing the signal at the marker position in diagram A with higher frequency resolution or in the time domain in diagram B.

If marker 1 is off, it is switched on and set to the maximum of the trace in the active diagram.

IEC/IEEE-bus command:

```
INST:COUP CF_B
INST:COUP CF_A
```

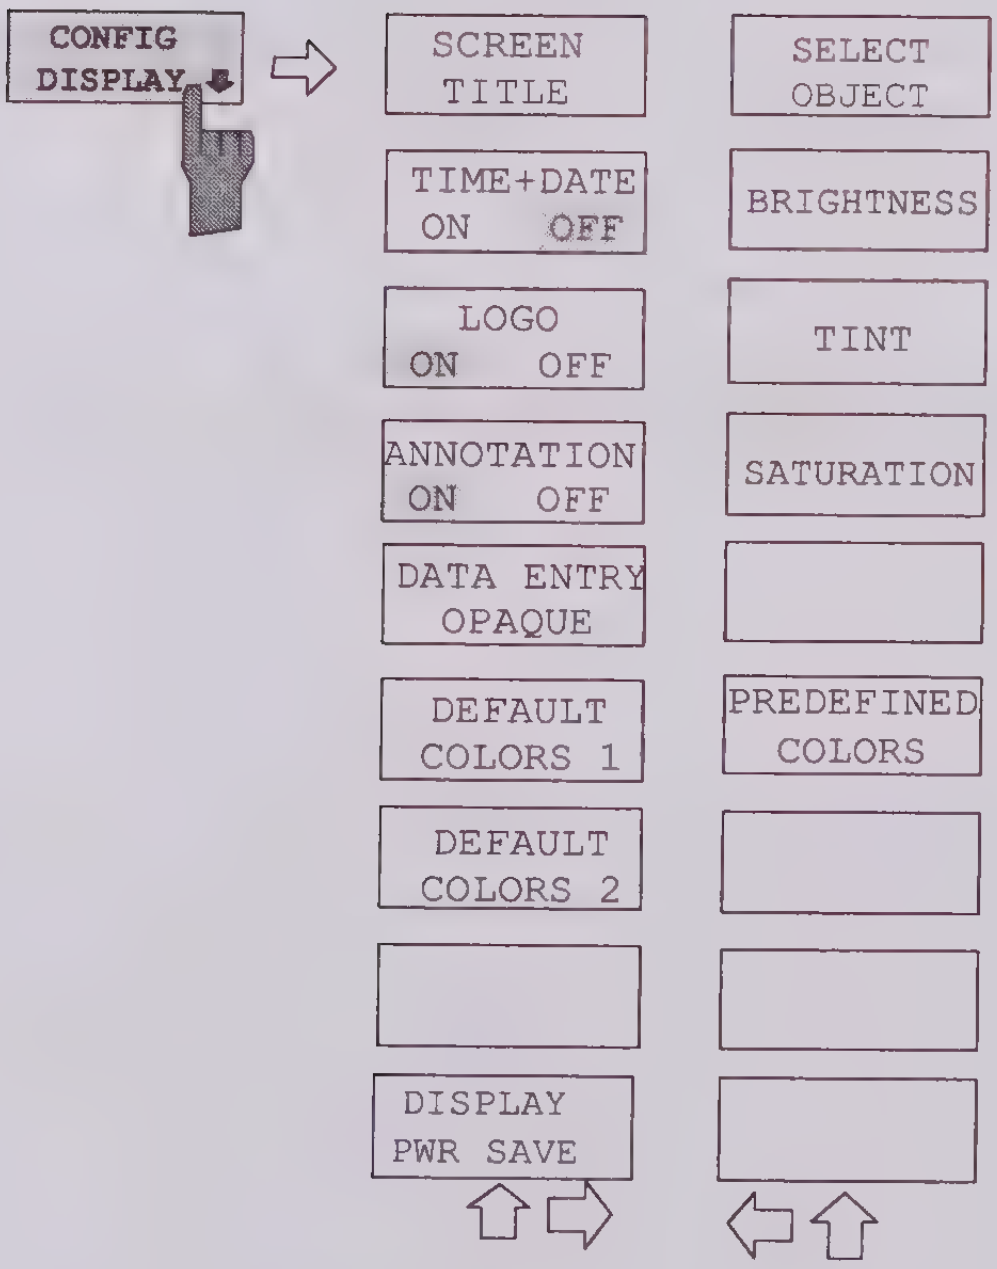

The CONFIG DISPLAY softkey opens a submenu allowing additional display items to be added to the screen. In addition, the display power-save mode (*DISPLAY PWR SAVE*) and the colors of the display elements can be set here.



The *SCREEN TITLE* softkey activates the entry of a title for the active diagram A or B. It switches on or off a title that is already input. The length of the title is limited to max. 20 characters.

IEC/IEEE-bus command: `DISP:WIND1:TEXT 'Noise Meas'`
`DISP:WIND1:TEXT:STATe ON`



The *TIME+DATE ON/OFF* softkey switches on or off the display of date and time above the diagram.

IEC/IEEE-bus command: `DISP:TIME OFF`



The *LOGO ON/OFF* softkey switches the Rohde & Schwarz company logo displayed in the upper left corner of the display screen on or off.

IEC/IEEE-bus command: `DISP:LOGO ON`

The *ANNOTATION ON/OFF* softkey switches the displaying of frequency information on the screen on and off.

ON Frequency information is displayed.

OFF Frequency information is not outputted to the display. This can be used for example to protect confidential data.

IEC/IEEE-bus command: `DISP:ANN:FREQ ON`



The *DATAENTRY OPAQUE* softkey sets the data entry windows to opaque. This means that entry windows are underlayed with the background color for tables.

IEC/IEEE-bus command: --



The *DEFAULT COLORS 1 and 2* softkey restores the default settings for brightness, color tint and color saturation for all display screen elements.
The color schemes have been selected to give optimum visibility of all picture elements at an angle of vision from above or below. *DEFAULT COLORS 1* is active in the default setting of the instrument.

IEC/IEEE-bus command: `DISP:CMAP:DEF1`
`DISP:CMAP:DEF2`

DISPLAY PWR SAVE

The *DISPLAY PWR SAVE* softkey is used to switch on/off the power-save mode for the display and to enter the time for the power-save fuction to respond. After the elapse of this time the display is completely switched off, ie including backlighting.

Note: *This mode is recommended for saving the TFT display especially when the instrument is exclusively operated in remote control.*

The power-save mode is configured as follows:

- The first keystroke activates the power-save mode and opens the editor for the response time (*POWER SAVE TIMEOUT*). The response time is entered in minutes between 1 and 6 minutes and is confirmed by *ENTER*.
- The power-save mode is deactivated by pressing the key again.

On leaving the menu with the power-save mode in the activated state, the softkey is highlighted in color on returning to the menu and opens again the editor for the response time. Pressing again the key switches off the power-save mode.

IEC/IEEE-bus command:
```
DISP:PSAV ON
DISP:PSAV:HOLD 15
```

SELECT OBJECT

The *SELECT OBJECT* softkey activates the *SELECT DISPLAY* OBJECT table, with which a graphics element can be selected. After selection, the brightness, tint and saturation of the selected element can be changed using the softkeys of the same name. The color changes by means of the *PREDEFINED COLORS* softkey can be seen immediately on the display screen.

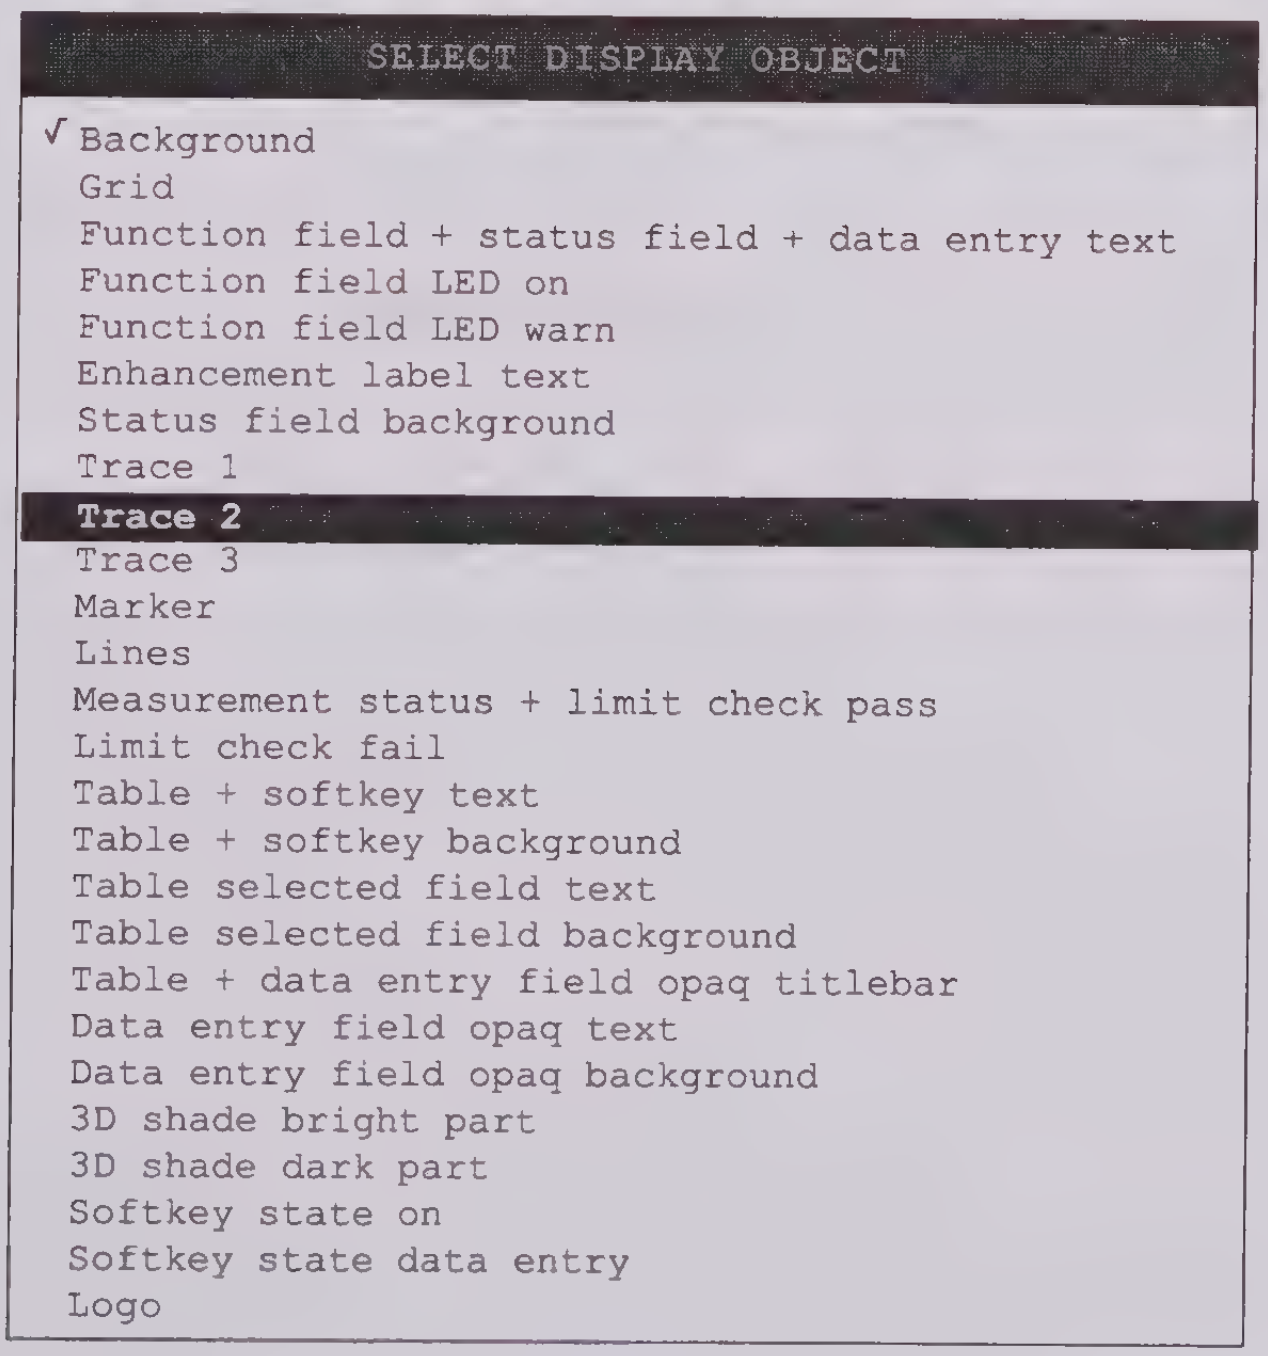

SELECT DISPLAY OBJECT

- √ Background
- Grid
- Function field + status field + data entry text
- Function field LED on
- Function field LED warn
- Enhancement label text
- Status field background
- Trace 1
- **Trace 2**
- Trace 3
- Marker
- Lines
- Measurement status + limit check pass
- Limit check fail
- Table + softkey text
- Table + softkey background
- Table selected field text
- Table selected field background
- Table + data entry field opaq titlebar
- Data entry field opaq text
- Data entry field opaq background
- 3D shade bright part
- 3D shade dark part
- Softkey state on
- Softkey state data entry
- Logo

BRIGHTNESS

The *BRIGHTNESS* softkey activates entry of the brightness of the selected graphics element.

Values between 0 and 100% can be entered.

IEC/IEEE-bus: `DISP:CMAP3:HSL< hue>,<sat>,<lum>`

TINT

The *TINT* softkey activates the entry of the color tint of the selected element. The entered value is related to a continuous color spectrum ranging from red (0%) to blue (100%).

IEC/IEEE-bus: `DISP:CMAP3:HSL <hue>,<sat>,<lum>`

SATURATION

The *SATURATION* softkey activates the entry of the color saturation for the selected element.

The range of inputs is from 0 to 100%.

IEC/IEEE-bus: `DISP:CMAP3:HSL <hue>,<sat>,<lum>`

PREDEFINED COLORS

The *PREDEFINED COLORS* softkey activates a table, with which the predefined colors for the diplay screen elements can be selected.

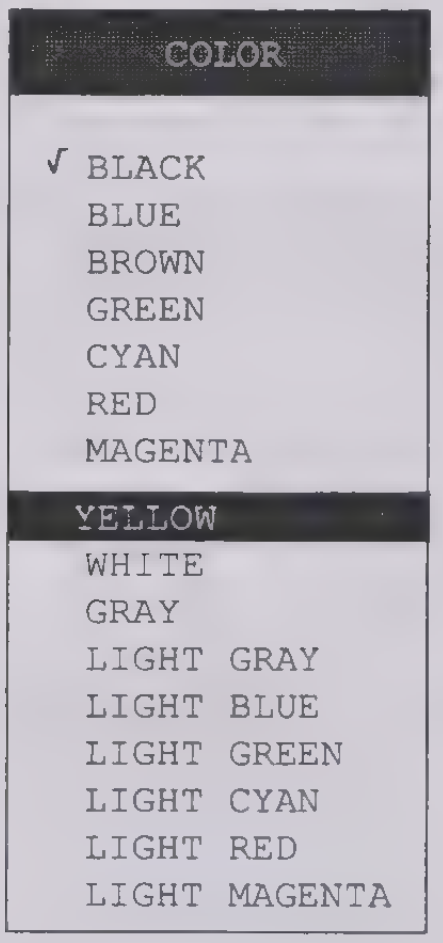

COLOR

✓ BLACK
BLUE
BROWN
GREEN
CYAN
RED
MAGENTA
YELLOW
WHITE
GRAY
LIGHT GRAY
LIGHT BLUE
LIGHT GREEN
LIGHT CYAN
LIGHT RED
LIGHT MAGENTA

IEC/IEEE-bus command: `DISP:CMAP1 to 26:PDEF <color>`

Instrument Setup and Interface Configuration – *SETUP* Key

The *SETUP* key opens the menu for configuration of the R&S FSMR:

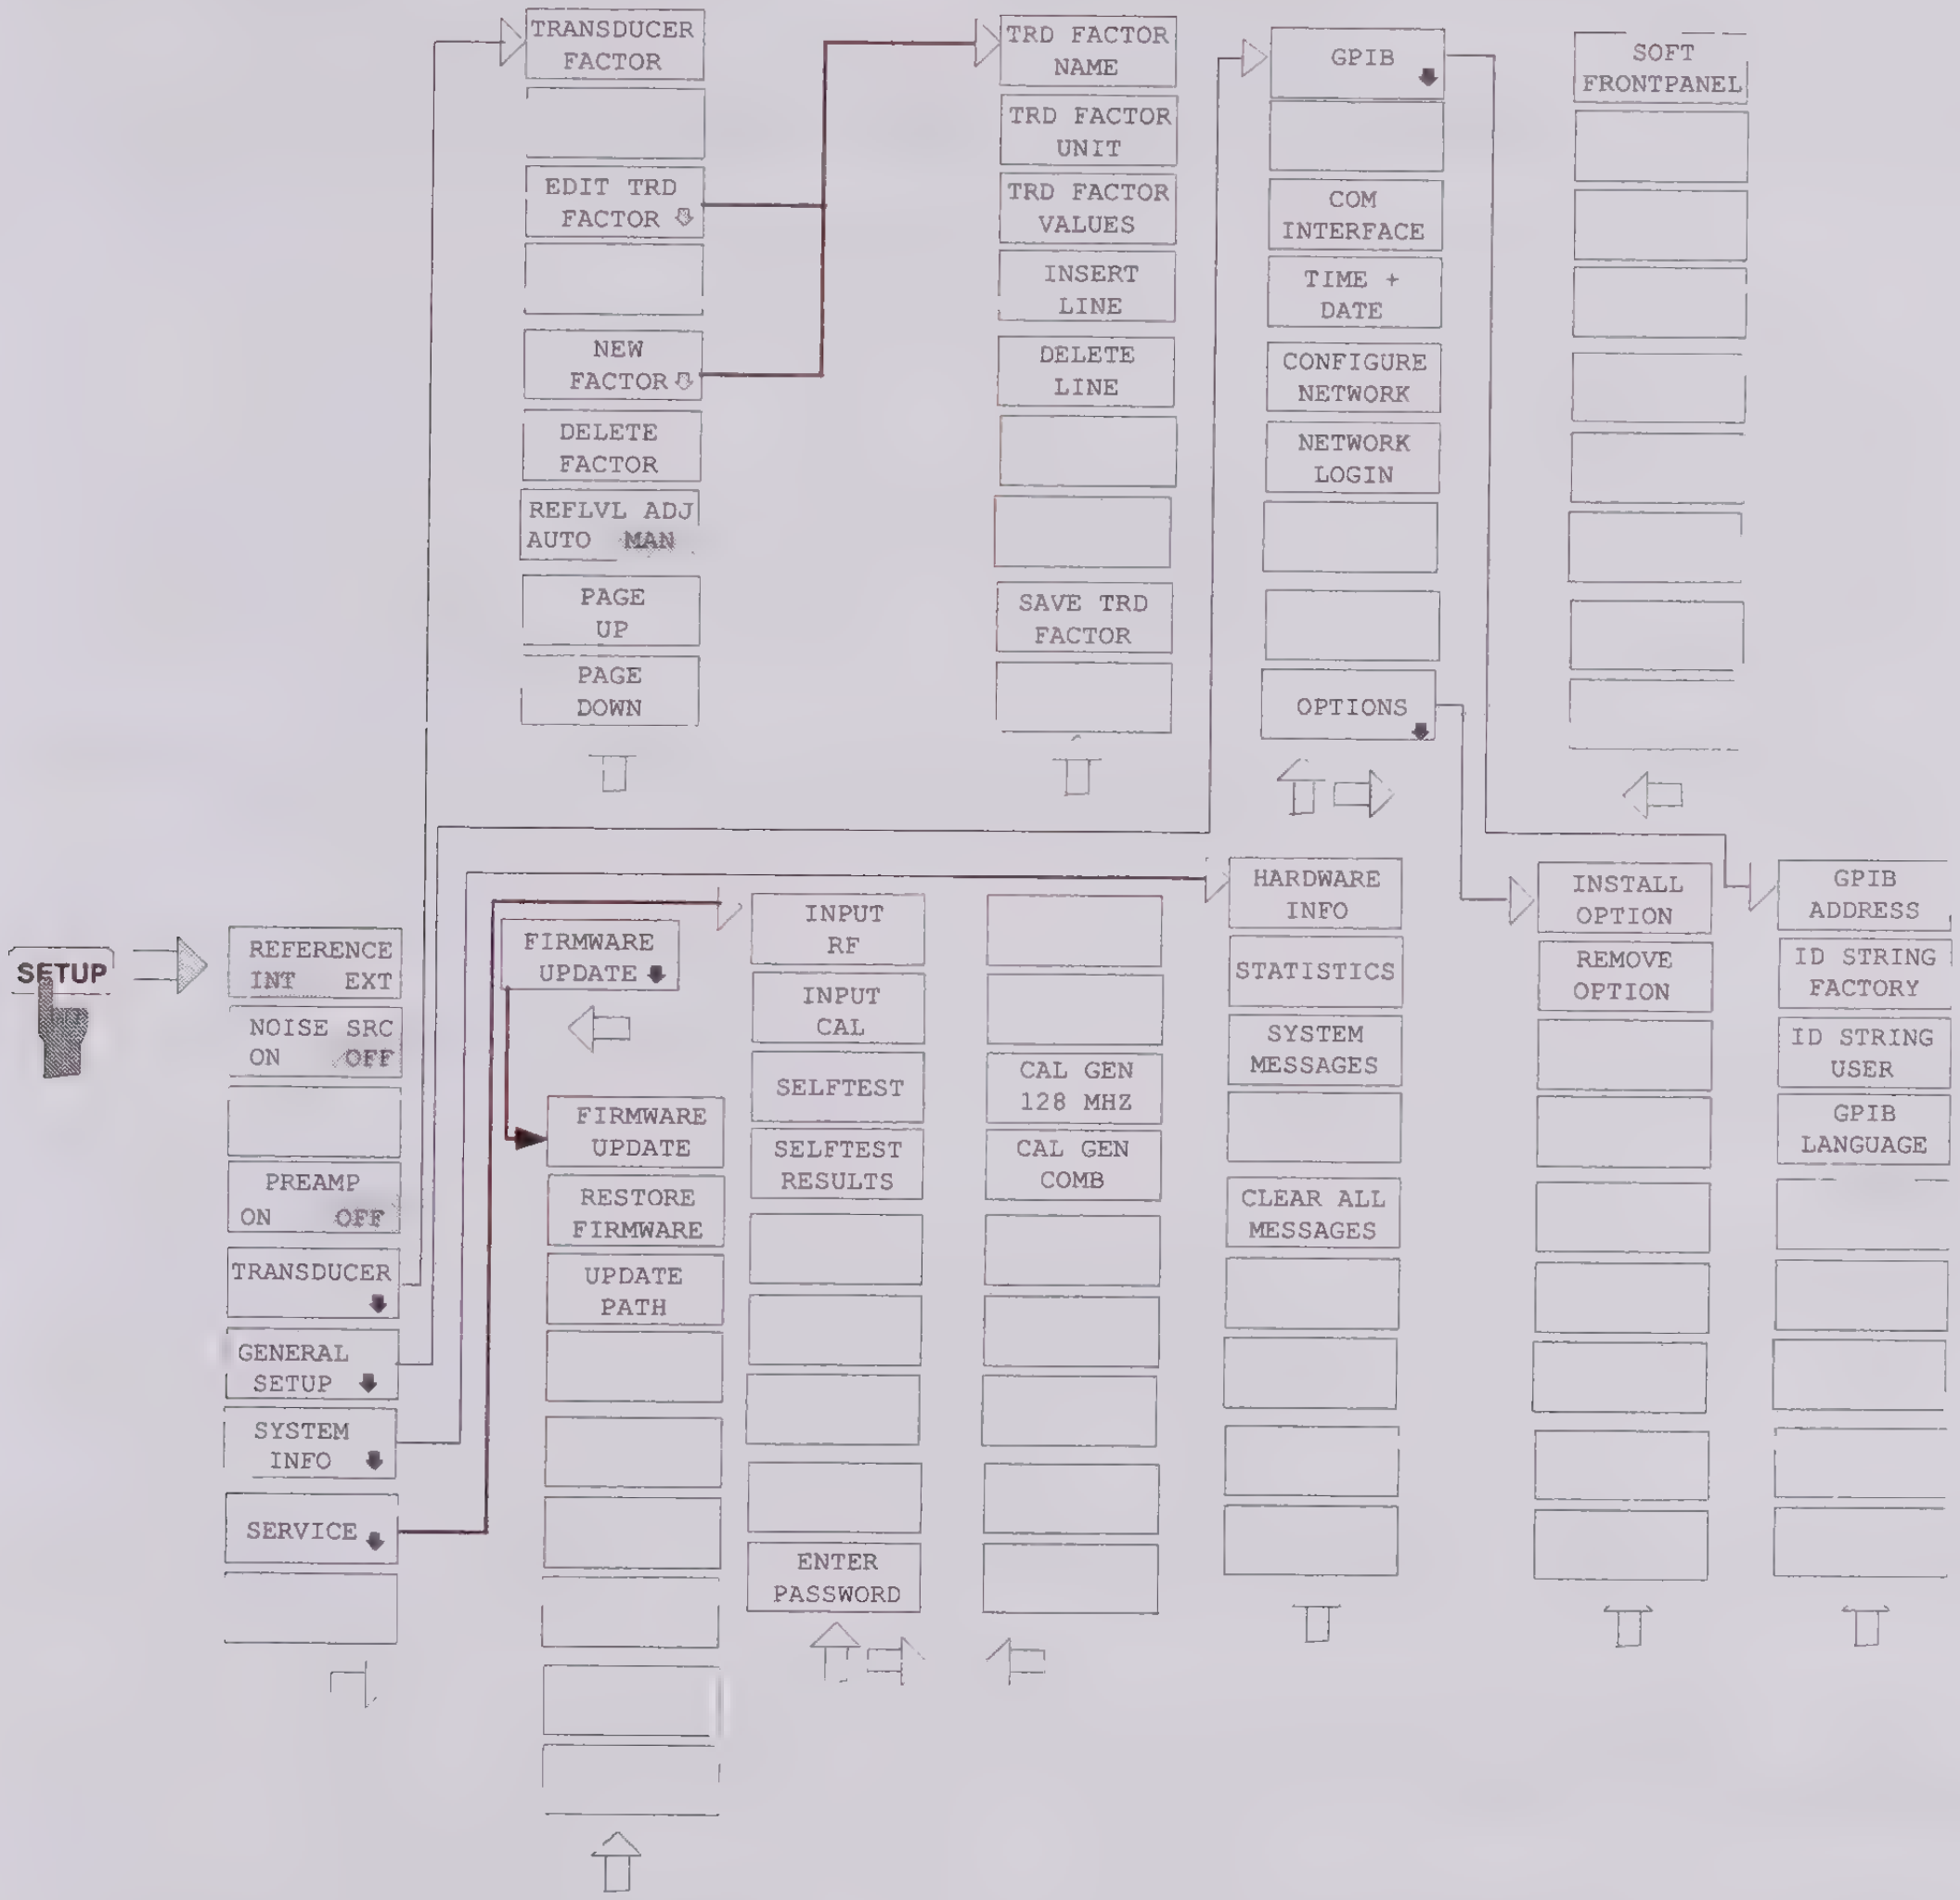

The following settings can be modified here:

- The *REFERENCE INT/EXT* softkey determines the source of the reference
- The *NOISE SRC ON/OFF* softkey switches on and off the voltage supply for an external noise source.
- The *PREAMP* softkey switches on the RF preamplifier gain. This softkey is only available with option EL. ATTENUATOR (B25).
- The *TRANSDUCER* softkey opens a submenu for entering the correction characteristics for transducers.
- The *GENERAL SETUP* softkey opens a submenu for all the general settings such as IEC/IEEE-bus address, date and time as well as the configuration of the device interfaces. *FIRMWARE OPTIONS* can be installed under this menu item.

- The *SYSTEM INFO* softkey opens a submenu for displaying the hardware configuration of the instrument, the switching cycle statistics and system messages.
- The *SERVICE* softkey opens a submenu in which special device functions and system information can be selected for servicing. The password required for service functions can be entered in this submenu.
- The *SERVICE FUNCTIONS* softkey enables additional special settings for servicing and troubleshooting. It is available after entering the corresponding password under the *SERVICE* softkey.

External Reference

The R&S FSMR can use the internal reference source or an external reference source as frequency standard from which all internal oscillators are derived. A 10 MHz crystal oscillator is used as internal reference source. In the default setting (internal reference), this frequency is available as output signal at rear-panel connector REF OUT, e.g. to synchronize other instruments to the reference of the R&S FSMR.
In the setting *REFERENCE EXT*, the connector REF IN is used as input connector for an external frequency standard. In this case all internal oscillators of the R&S FSMR are synchronized to the external reference frequency (also 10 MHz).

SETUP menu:



The *REFERENCE INT / EXT* softkey switches between the internal and external reference.

Note: *If the reference signal is missing when switching to external reference, the message "EXREF" appears after a while to indicate that there is no synchronization.*
On switching to internal reference please ensure that the external reference signal is de-activated to avoid interactions with the internal reference signal.

IEC/IEEE-bus command: `ROSC:SOUR INT`

External Noise Source

SETUP menu:



The *NOISE SRC ON/OFF* softkey switches on or off the supply voltage for an external noise source which is connected to the *NOISE SOURCE* connector on the rear panel of the instrument.

IEC/IEEE-bus command: `DIAG:SERV:NSO ON`

RF Preamplifier

To improve the noise figure, a low-noise preamplifier with variable gain at the RF input can be switched into the signal path.
SETUP menu:

The *PREAMP* softkey switches the preamplifier on and activates the entry of the preamplifier gain. The preamplifier is switched off by pressing the softkey again.
The only possible value with option el. attenuator is 20 dB.

IEC/IEEE-bus command: `INP:GAIN 0DB`

Note: *The PREAMP softkey is only available with option EL. ATTENUATOR (R&S FSU-B25) .*

Transducer

Activating Transducer Factors

The *TRANSDUCER* softkey opens a submenu enabling the user to activate or deactivate defined transducer factors, to generate new transducer factors or to edit existing ones. A table with the transducer factors defined is displayed.

As soon as a transducer is activated, the unit of the transducer is automatically used for all the level settings and outputs. The unit cannot be changed in the *AMPT* menu since the R&S FSMR and the transducer used are regarded as one measuring instrument. Only if the transducer has the unit dB, will the unit originally set on the R&S FSMR be maintained and can be changed.

If a transducer factor is active, the remark TDF appears in the Enhancement Labels column.
After all transducers have been switched off, the R&S FSMR returns to the unit that was used before a transducer was activated.

In the analyzer mode, an active transducer for a sweep is calculated once in advance for every point displayed and is added to the result of the level measurement during the sweep. If the sweep range changes, the correction values are calculated again. If several measured values are combined, only one value is taken into consideration.

If the active transducer factor is not defined for the entire sweep range, the values missing are replaced by zeroes.

SETUP menu:

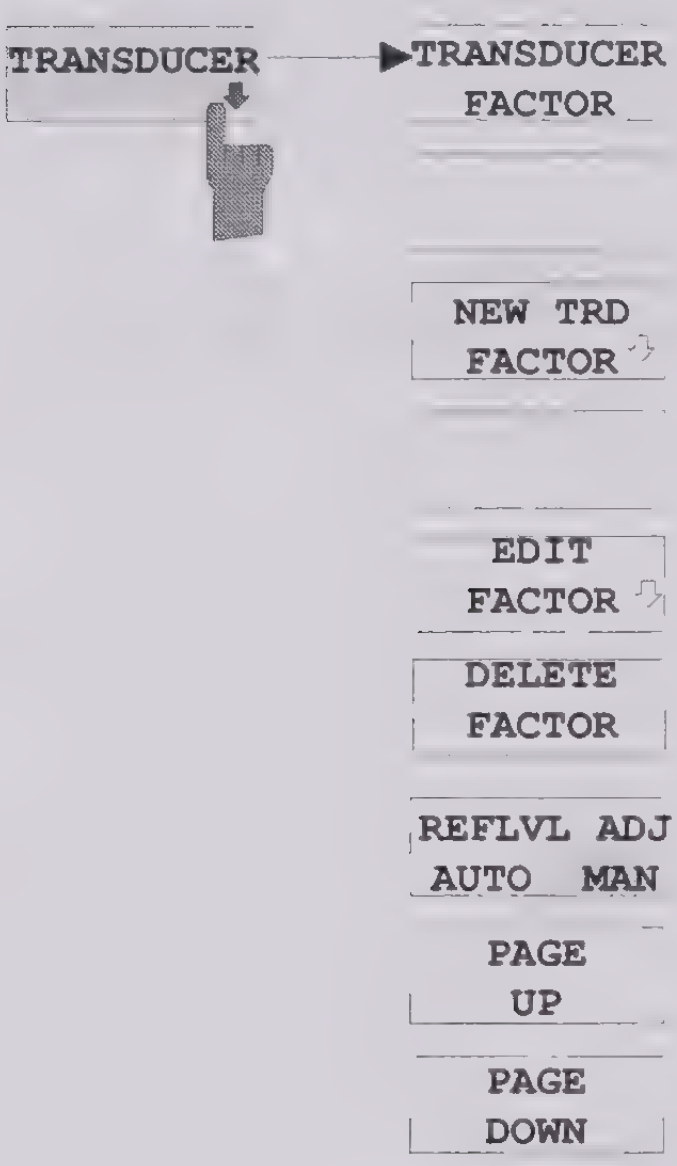

The *TRANSDUCER* softkey opens a submenu where defined transducer factors can be edited or new transducer factors can be entered. A table with the available factors is displayed, and the active transducer can be selected from this list.

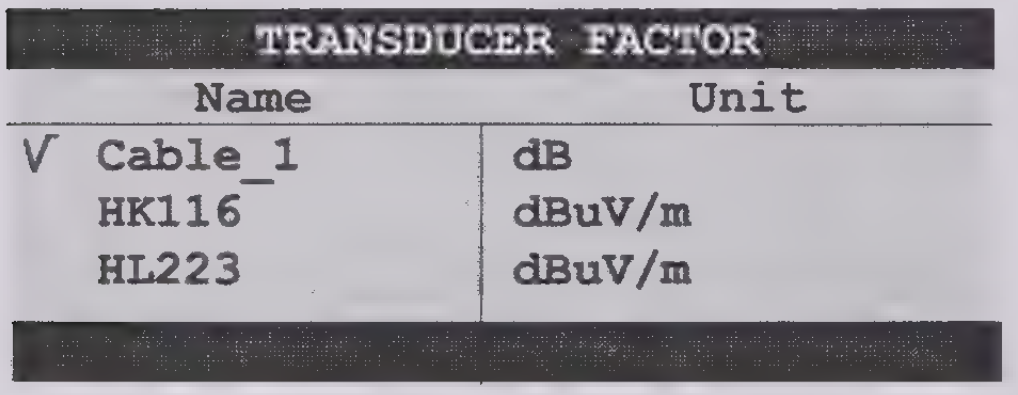

TRANSDUCER FACTOR

	Name	Unit
√	Cable_1	dB
	HK116	dBuV/m
	HL223	dBuV/m

The *TRANSDUCER FACTOR* table contains all the defined factors with name and unit. If the number of transducer factors defined exceeds the number of lines available in the table, the user has to scroll through the table.

Only one factor at a time can be activated. A tick next to the name indicates that the transducer is active.

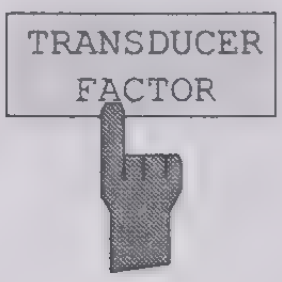

The *TRANSDUCER FACTOR* softkey places the scrollbar on the position of the active transducer factor.
If a transducer factor is not active, the scrollbar is placed on the first line of the table.

IEC/IEEE-bus command: `CORR:TRAN:SEL <name>`
`CORR:TRAN ON | OFF`

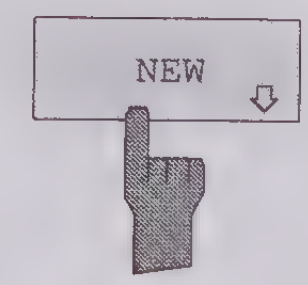

The *NEW* and *EDIT* softkeys give access to the submenu for editing and generating transducer factors.

The *DELETE* softkey deletes the factor that is marked. To prevent inadvertent deleting, the instrument outputs a confirmation query.

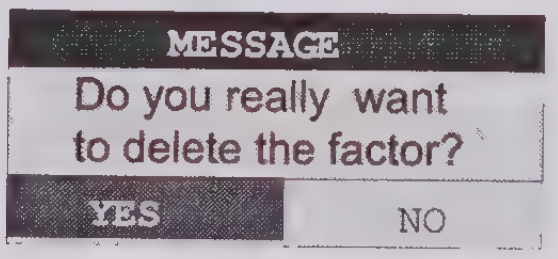
MESSAGE
Do you really want
to delete the factor?

IEC/IEEE-bus command: `CORR:TRAN DEL`

When a transducer factor is used, the trace is moved by a calculated shift. However, an upward shift reduces the dynamic range for the displayed values. With the softkey REFLVL ADJ an automatic reference level offset adaptation allows to restore the original dynamic range by also shifting the reference level by the maximum value of the transducer factor.

IEC/IEEE-bus command:
CORR:TRAN:ADJ:RLEV ON | OFF

Note: *Command* `CORR:TRAN:SEL` *has to be sent prior to this command*

The *PAGE UP* and *PAGE DOWN* softkeys are used to scroll through large tables that cannot completely be displayed on the screen.

Entry and Editing of Transducer Factors

A transducer factor is characterized by the following:

- Reference values with frequency and factor (*Values*)
- Unit of the factor (*Unit*) and
- Name (*Name*) to distinguish the various factors.

During entry the R&S FSMR checks the transducer factor for compliance with specific rules that must be met to ensure correct operation.

- The frequencies for the reference values must always be entered in ascending order. Otherwise the entry will not be accepted and the following message will appear.

Frequency Sequence!

- The frequencies entered may exceed the frequency range of the R&S FSMR since only the set frequency range is taken into account for measurements. The minimum frequency of a reference value is 0 Hz, the maximum frequency 200 GHz.

- The value range for the transducer factor is ±200 dB. If the minimum or maximum value is exceeded, the R&S FSMR outputs the following message:

Min Level -200 dB or
Max Level 200 dB.

- Gain has to be entered as a negative value, and attenuation as a positive value.

Note: *The softkeys in the "UNIT" submenu of the AMPT key cannot be operated if the transducer is on.*

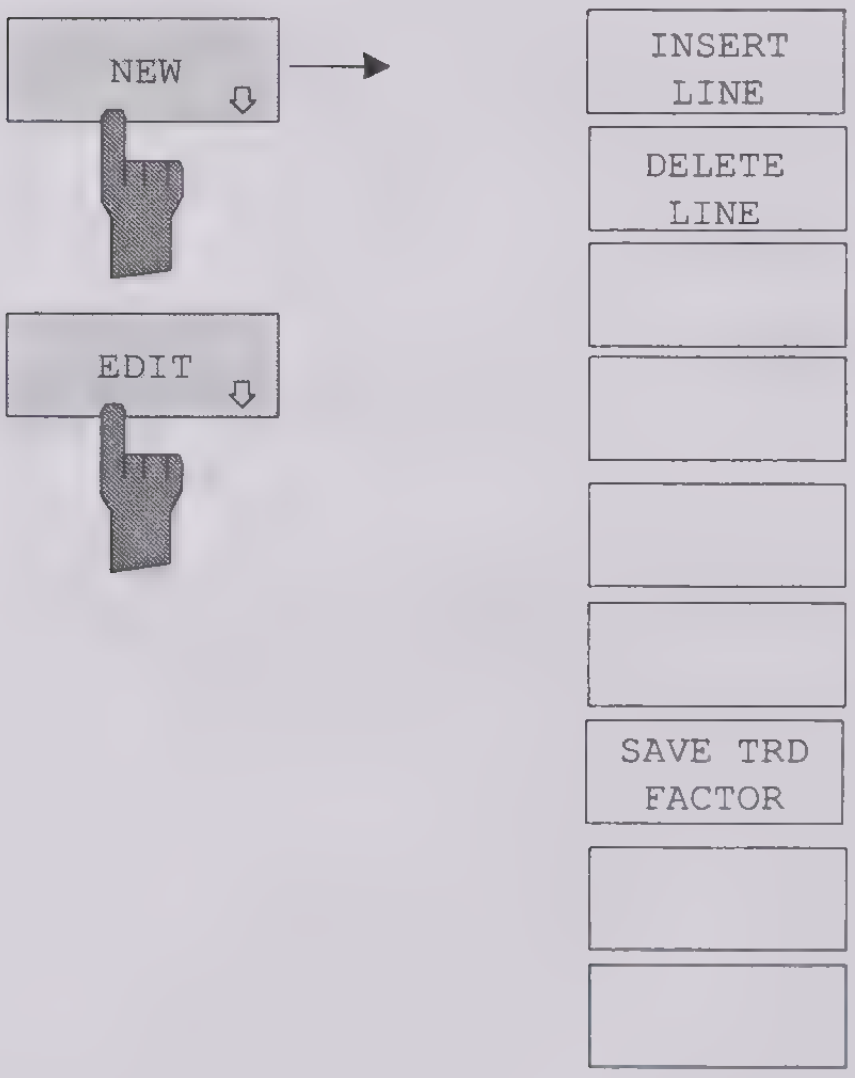

The *NEW* and *EDIT* softkeys give access to the submenu for editing and generating transducer factors.

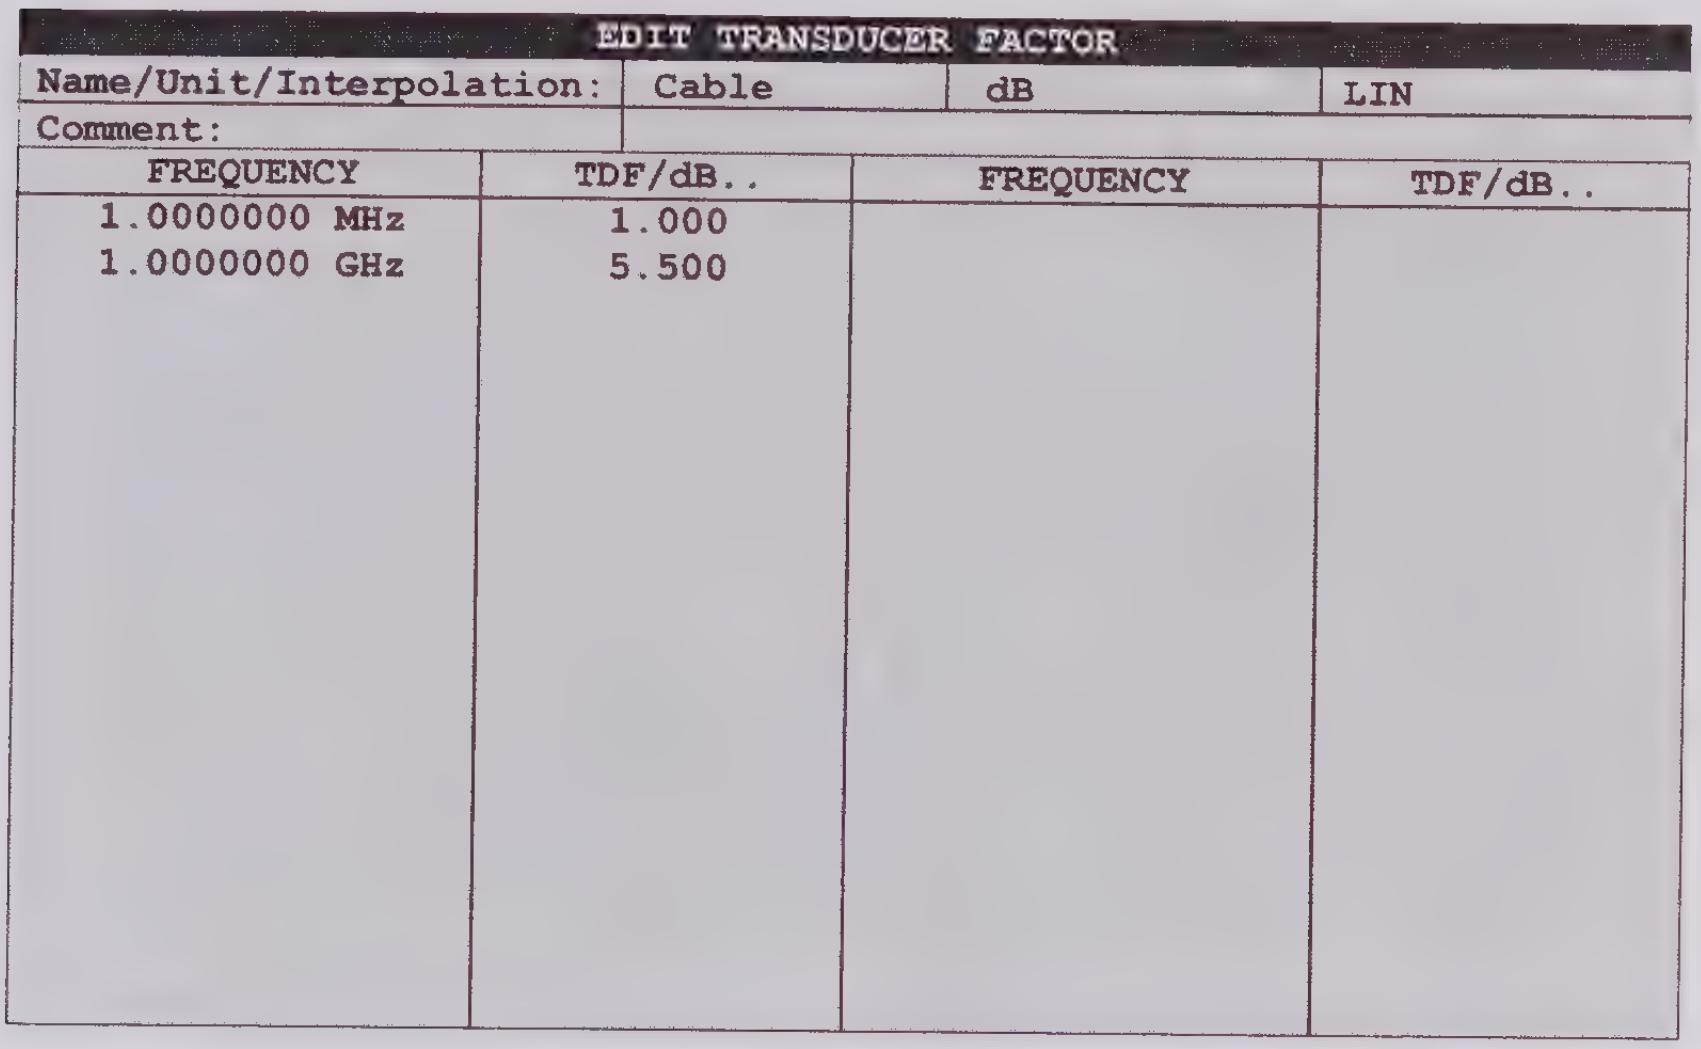

EDIT TRANSDUCER FACTOR

Name/Unit/Interpolation:	Cable	dB	LIN
Comment:			
FREQUENCY	TDF/dB..	FREQUENCY	TDF/dB..
1.0000000 MHz	1.000		
1.0000000 GHz	5.500		

Depending on the softkey selected, either the table with the data of the factor marked (softkey *EDIT*) or an empty table (softkey *NEW*) appears. This table is empty except for the following entries:

Unit:	dB
Interpolation:	LIN for linear frequency scaling
	LOG for logarithmic frequency scaling

The features of the factor are entered in the header of the table, and the frequency and the transducer factor are entered in the columns.

Name	Entry of name
Unit	Selection of unit
Interpolation	Selection of interpolation
Comment	Entry of comment
FREQUENCY	Entry of frequency of reference values
TDF/dB	Entry of transducer factor.

During editing, a transducer factor remains stored in the background until the factor edited is saved with the *SAVE TRD FACTOR* softkey or until the table is closed. A factor that was edited by mistake can be restored by leaving the entry function.

Name – Entry of name

The name may consist of a maximum of 8 characters that have to comply with the conventions for DOS file names. The instrument automatically adds the extension .TDF to all transducer factors that are saved.

If an existing name is changed, the factor stored under the previous name is maintained and is not automatically overwritten by the new version. The old factor can be deleted later on using the *DELETE* function. This makes it possible to copy factors.

IEC/IEEE-bus command `CORR:TRAN:SEL <name>`

Unit **- Selection of unit**

The unit of the transducer factor is selected from a box that is activated by pressing ENTER.

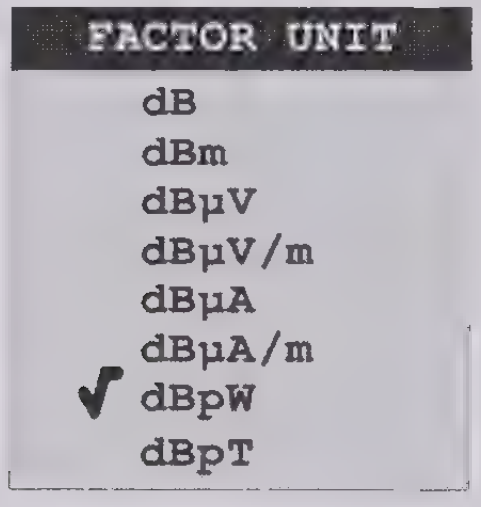

The default setting is dB.

IEC/IEEE-bus command `CORR:TRAN:UNIT <string>`

Interpolation **- Selection of interpolation**

Linear or logarithmic interpolation can be performed between the frequency reference values of the table. The ENTER key allows the user to select LIN or LOG (toggle function).

IEC/IEEE-bus command `CORR:TRAN:SCAL LIN|LOG`

The following diagrams show the effect that interpolation has on the calculated trace:

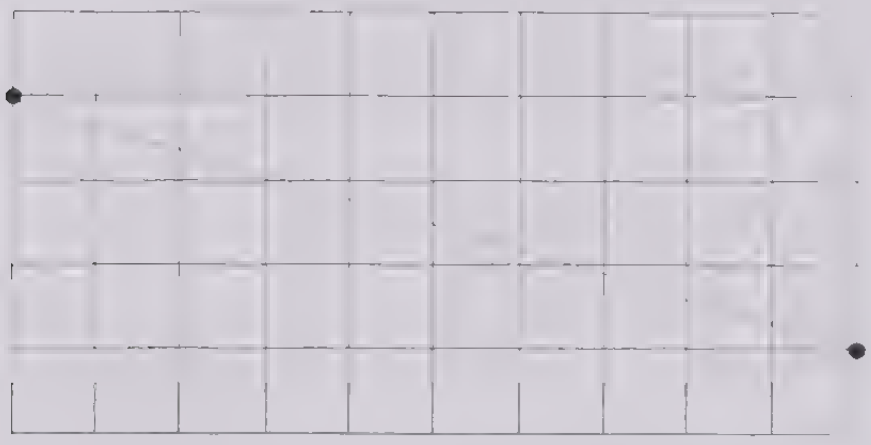

Fig. 4.19-1 Linear frequency axis and linear interpolation

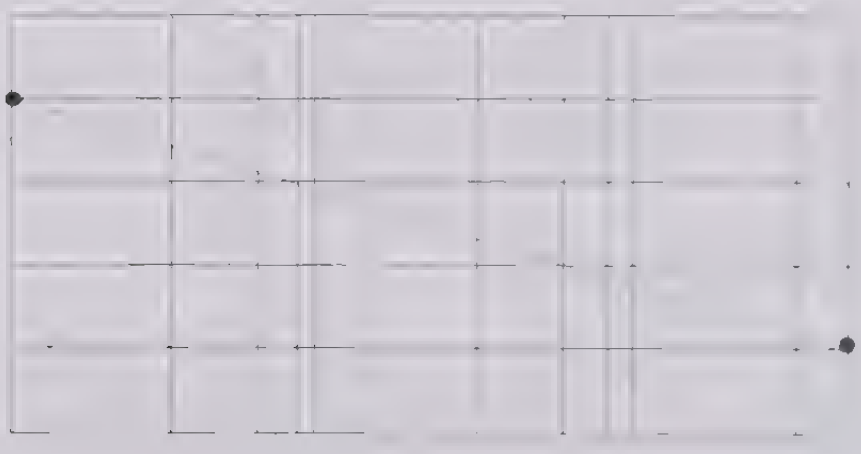

Fig. 4.19-2 Logarithmic frequency axis and interpolation

Comment **-** Entry of comment

Any comment with a maximum length of 50 characters can be entered.

IEC/IEEE-bus command `CORR:TRAN:COMM <string>`

FREQUENCY, TDF/dB – Entry of values

The scrollbar marks the first reference value. The desired reference values must be entered in ascending order of frequencies. After the frequency has been entered, the scrollbar automatically goes to the associated level value.

The table can be edited after entry of the first value using the *INSERT LINE* and *DELETE LINE* softkeys. To change individual values later on, the value has to be selected and a new one entered.

IEC/IEEE-bus command `CORR:TRAN:DATA <freq>,<level>.`

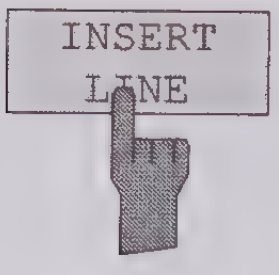

The *INSERT LINE* softkey inserts an empty line above the marked reference value. When entering a new reference value in the line, the ascending order of frequencies must be taken into consideration, however.

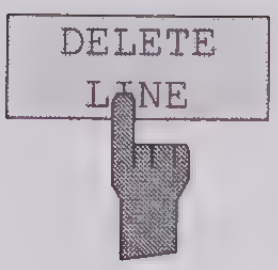

The *DELETE LINE* softkey deletes the marked reference value (complete line). The reference values that follow move one line up.

IEC/IEEE-bus command --

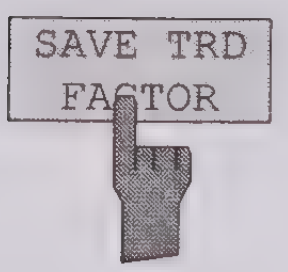

The *SAVE TRD FACTOR* softkey saves the changed table in a file on the internal hard disk.
If there is already a transducer factor that has the same name, a confirmation query is output.
If the new factor is active, the new values become immediately valid.

IEC/IEEE-bus command - (With IEC/IEEE bus operation, the save operation is performed automatically after the definition of the reference values)

Programming the Interface Configuration and Time Setup

The *GENERAL SETUP* softkey opens a submenu in which the general instrument parameters can be set up. In addition to the configuration of the digital interfaces (*IECBUS, COM*), the date and time may be entered.

The current settings are displayed in tabular form on the display screen where they may be edited.

SETUP - GENERAL SETUP submenu:

GENERAL SETUP

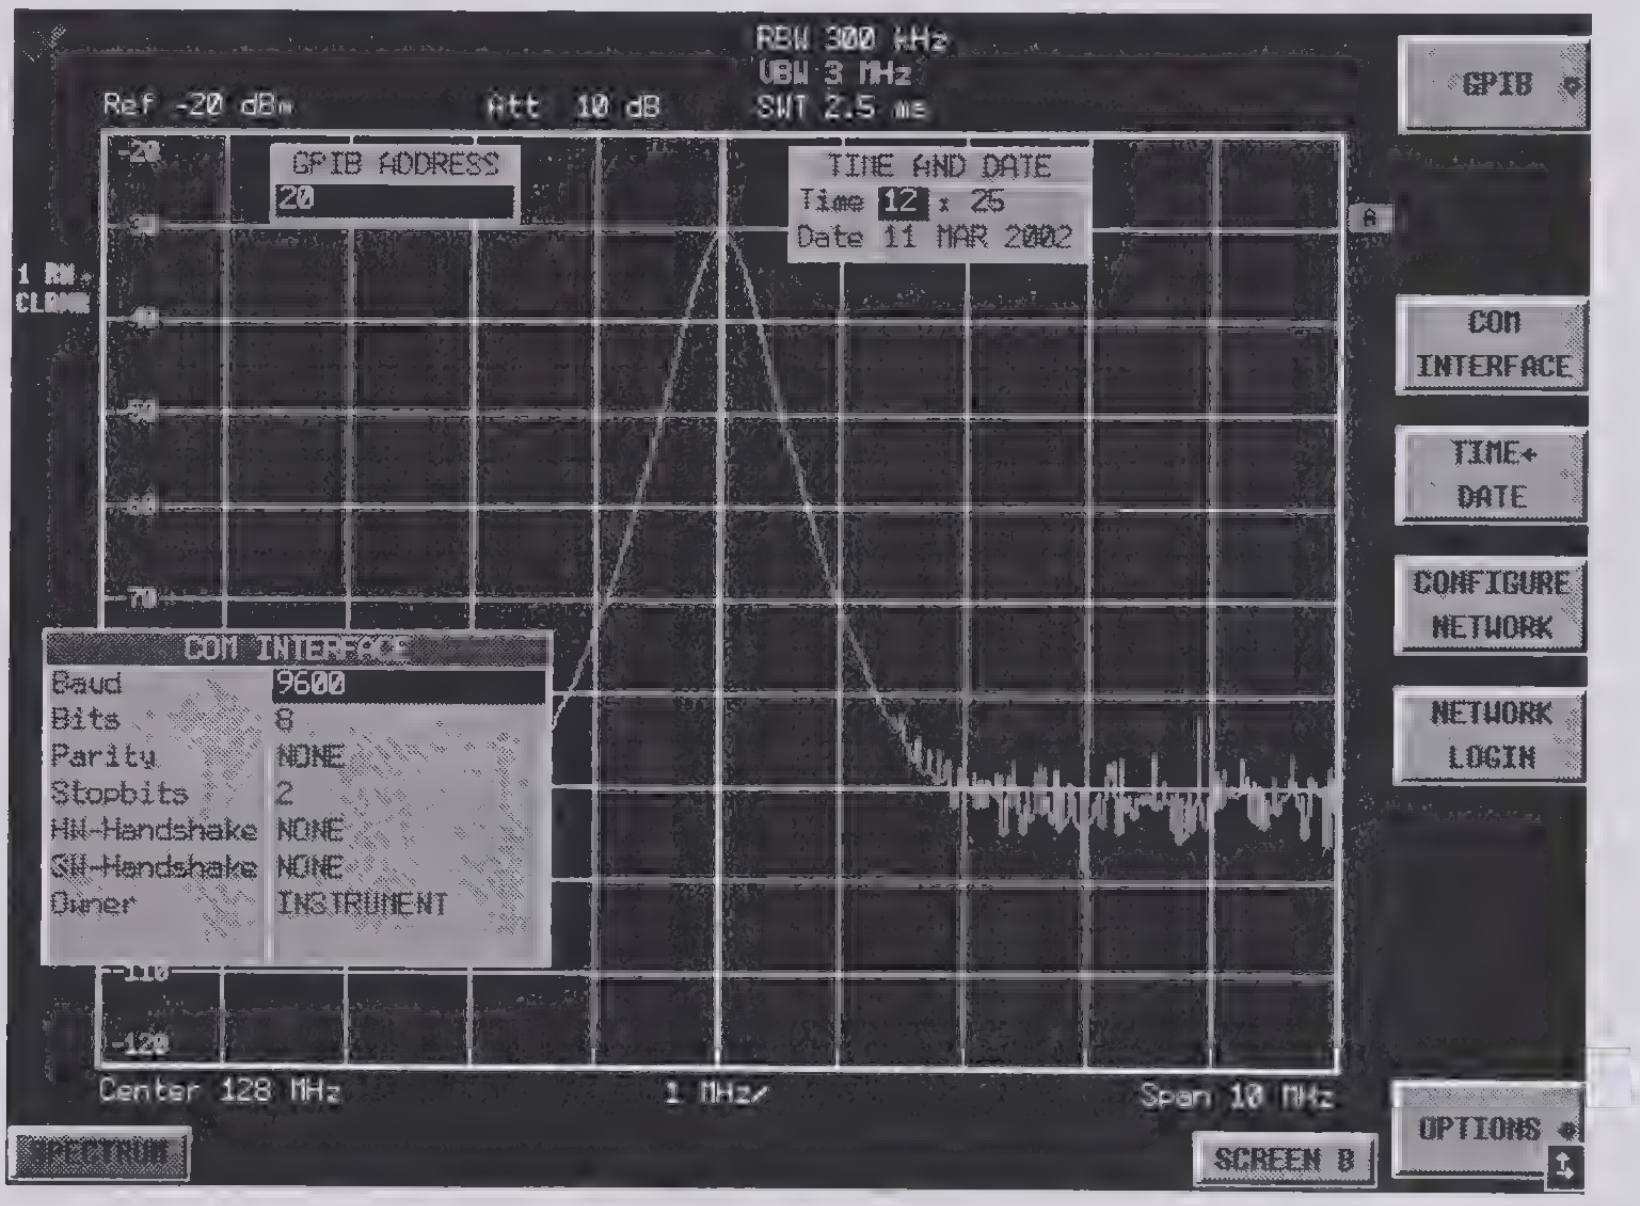

GPIB ADDRESS
20

TIME AND DATE
Time 12 : 25
Date 11 MAR 2002

COM INTERFACE

Baud	9600
Bits	8
Parity	NONE
Stopbits	2
HW-Handshake	NONE
SW-Handshake	NONE
Owner	INSTRUMENT

Selecting the IEC/IEEE-Bus Address

SETUP - GENERAL SETUP menu:

GPIB

The *GPIB* softkey opens a submenu for setting the parameters of the remote-control interface.

IEC/IEEE-bus command: --

GPIB ADDRESS

The *GPIB ADDRESS* softkey enables the entry of the IEC/IEEE-bus address.

Valid addresses are 0 through 30. The default address is 20.

IEC/IEEE-bus command: `SYST:COMM:GPIB:ADDR 20`

ID STRING FACTORY

The *ID STRING FACTORY* softkey selects the default response to the *IDN? query.

IEC/IEEE-bus command: --

ID STRING USER

The *ID STRING USER* softkey opens an editor for entering a user-defined response to the *IDN? query.
Max. length of output string: 36 characters

IEC/IEEE-bus command: --

GPIB LANGUAGE

The *GPIB LANGUAGE* softkey opens a list of selectable remote-control languages:

- SCPI
- 8560E
- 8561E
- 8562E
- 8563E
- 8564E
- 8565E
- 8566A
- 8566B
- 8568A
- 8568B
- 8594E

Note:
For 8566A/B, 8568A/B and 8594E, command sets A and B are available. Command sets A and B differ in the rules regarding the command structure.

On switching between remote-control languages, the following settings or changes will be made:

SCPI:
➢ *The instrument will perform a PRESET.*

8566A/B, 8568A/B, 8594E:
➢ *The instrument will perform a PRESET.*
➢ *The following instrument settings will then be changed:*

Model	# of Trace Points	Start Freq.	Stop Freq.	Ref Level	Input Coupling
8566A/B	1001	2 GHz	22 GHz	0 dBm	DC (FSU/FSQ) AC (FSP)
8568A/B	1001	0 Hz	1.5 GHz	0 dBm	AC
8560E	601	0 Hz	2.9 GHz	0 dBm	AC
8561E	601	0 Hz	6.5 GHz	0 dBm	AC
8562E	601	0 Hz	13.2 GHz	0 dBm	AC
8563E	601	0 Hz	26.5 GHz	0 dBm	AC
8564E	601	0 Hz	40 GHz	0 dBm	AC
8565E	601	0 Hz	50 GHz	0 dBm	AC
8594E	401	0 Hz	3 GHz	0 dBm	AC

- *Switchover of the "# of Trace Points" will not take place until the instrument is switched to the REMOTE mode. For manual operation (selected with LOCAL softkey), the number of sweep points (trace points) will always be set to 1251.*
- *The stop frequency indicated in the table may be limited to the corresponding frequency of the R&S R&S FSMR, if required.*

IEC/IEEE-bus command:

```
SYST:LANG "SCPI" | "8560E" | "8561E" |
          "8562E" | "8563E" | "8564E" |
          "8565E" | "8566A" | "8566B" |
          "8568A" | "8568B" | "8594E"
```

Serial Interface Configuration

SETUP-GENERAL SETUP submenu:

The *COM INTERFACE* softkey activates the *COM INTERFACE* table for entry of the serial interface parameters.

The following parameters can be configured in the table:

Baud rate	data transmission rate
Bits	number of data bits
Parity	bit parity check
Stop bits	number of stop bits
HW-Handshake	hardware handshake protocol
SW-Handshake	software handshake protocol
Owner	assignment to the measuring instrument or computer

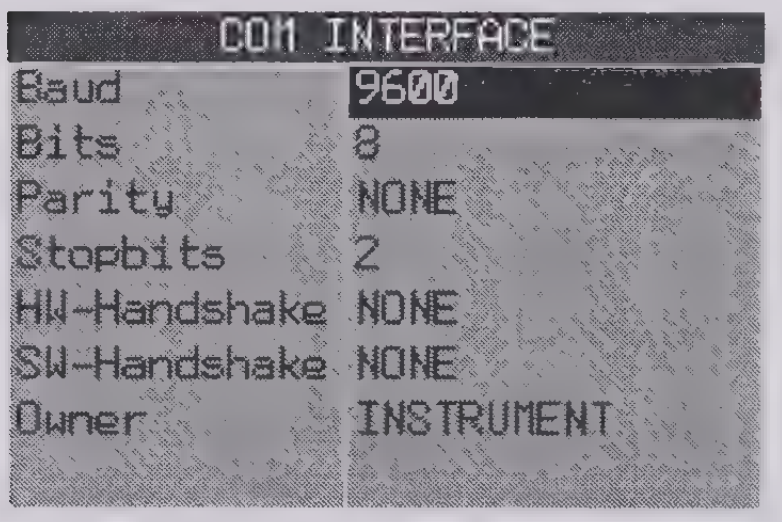

COM INTERFACE	
Baud	9600
Bits	8
Parity	NONE
Stopbits	2
HW-Handshake	NONE
SW-Handshake	NONE
Owner	INSTRUMENT

Baud – Data transmission rate

The R&S FSMR supports baud rates between 110 and 19200 baud. The default setting is 9600 baud.

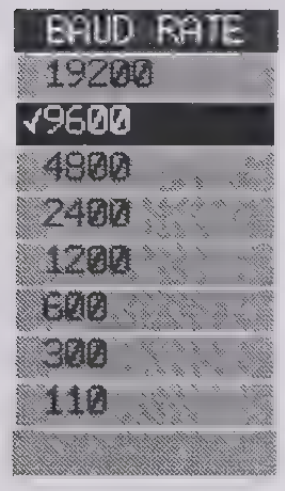

BAUD RATE
19200
✓9600
4800
2400
1200
600
300
110

IEC/IEEE-bus command: `SYST:COMM:SER:BAUD 9600`

Bits – Number of data bits per word

For the transmission of text without special characters, 7 bits are adequate. For binary data as well as for text with special characters, 8 bits must be selected (default setting).



BITS
7
✓8

IEC/IEEE-bus command: `SYST:COMM:SER:BITS 7`

Parity – Bit parity check

NONE	no parity check (default setting)
EVEN	even parity check
ODD	odd parity check

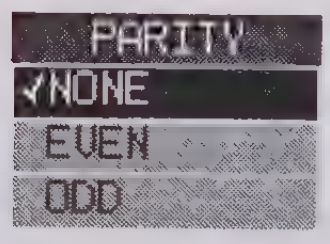

IEC/IEEE-bus command: `SYST:COMM:SER:PAR NONE`

Stop bits – Number of stop bits

Available are 1 and 2. The default setting is 1 stop bit.



IEC/IEEE-bus command: `SYST:COMM:SER:SBIT 1`

HW-Handshake – Hardware handshake protocol

The integrity of data transmission can be improved by the use of a hardware handshake mechanism, which effectively prevents uncontrolled transmission of data and the resulting loss of data bytes. For hardware handshake additional interface lines are used to transmit acknowledge signals with which the data transmission can be controlled and, if necessary, stopped until the receiver is ready to receive data again.

A prerequisite for using hardware handshaking is, however, that the interface lines (DTR and RTS) are connected on both transmitter and receiver. For a simple 3-wire connection, this is not the case and hardware handshake cannot be used here.

Default setting is *NONE*.



IEC/IEEE-bus command: `SYST:COMM:SER:CONT:DTR OFF`
`SYST:COMM:SER:CONT:RTS OFF`

SW-Handshake – Software handshake protocol

Besides the hardware handshake mechanism using interface lines, it is also possible to achieve the same effect by using a software handshake protocol. Here, control bytes are transmitted in addition to the normal data bytes. These control bytes can be used, as necessary, to stop data transmission until the receiver is ready to receive data again.

In contrast to hardware handshaking, software handshaking can be realized even for a simple 3-wire connection.

One limitation is, however, that software handshaking cannot be used for the transmission of binary data, since the control characters XON and XOFF require bit combinations that are also used for binary data transmission.

Default setting is *NONE*.



IEC/IEEE-bus command: `SYST:COMM:SER:PACE NONE`

Owner – Assignment of the interface

The serial interface can be assigned alternatively to the measuring instrument section or to the computer section

If the interface is assigned to one section of the instrument, it is not available to the other section.

INSTRUMENT	The interface is assigned to the measuring instrument section. Outputs to the interface from the computer section are not possible will get lost.
OS	The interface is assigned to the computer section. It cannot be used by the measuring instrument section. This means that remote control of the instrument via the interface is not possible.

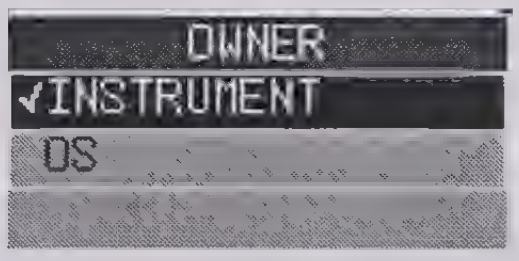

IEC/IEEE-bus command: --

Setting Date and Time

SETUP-GENERAL SETUP submenu:



The *TIME+DATE* softkey activates the entry of time and date for the internal realtime clock.


TIME AND DATE
Time 12 : 30
Date 11 MAR 2002

Time - Input of time

In the corresponding dialog box, the time is partitioned into two input fields so that hours and minutes can be entered independently.


TIME
TIME 21 : 59

IEC/IEEE-bus command: `SYST:TIME 21,59`

Date - Input of Date

In the corresponding dialog box, the date is partitioned into 3 input fields so that day, month and year can be input separately.


DATE
DATE 01 Oct 1999

For the selection of the month, pressing a unit key opens a list of abbreviations wherein the desired month can be selected.

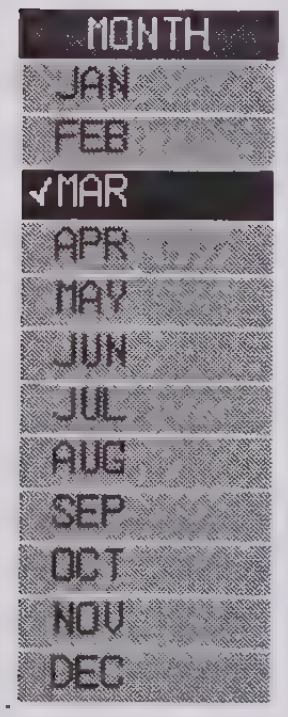
MONTH
JAN
FEB
✓MAR
APR
MAY
JUN
JUL
AUG
SEP
OCT
NOV
DEC

IEC/IEEE-bus command: `SYST:DATE 1999,10,01`

Configuration of Network Settings FSU

The instrument can be connected to an Ethernet LAN (local area network) by means of the LAN Interface FSU. This allows data transmission via the network and the use of network printers. The network card is able to handle both 10 MHz Ethernet IEEE 802.3 and 100 MHz Ethernet IEEE 802.3u. For more details see section 'LAN Interface FSU'.

SETUP - GENERAL SETUP - menu:

CONFIGURE NETWORK

The *CONFIGURE NETWORK* softkey opens the dialog box with the network settings.

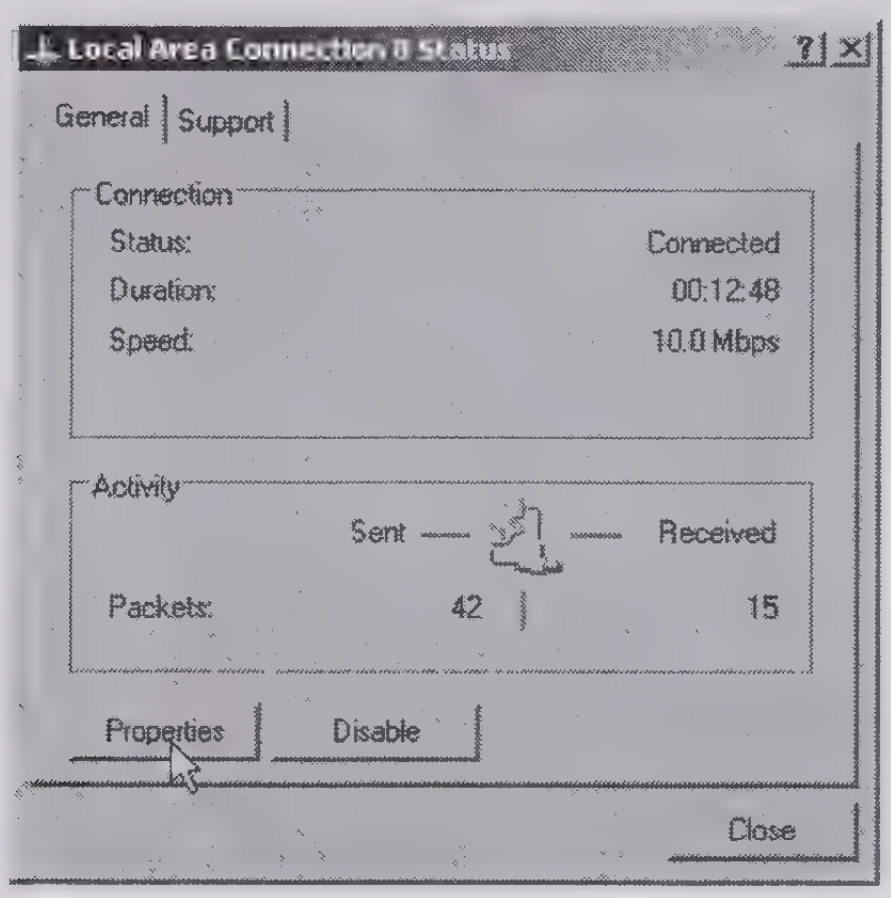

Status: Connected
Duration: 00:12:48
Speed: 10.0 Mbps
Packets: 42 | 15

The softkey is used to modify an existing network configuration after the corresponding tabs are selected (see subsection "Configuration of Already Installed Network Protocols" in the section "Option FSP-B16 – LAN Interface").

Notes:

- *A PC keyboard with trackball (or mouse instead) is required for the installation/configuration of the network support.*
- *The softkey is only available with built-in LAN interface FSU*

IEC/IEEE-bus command: –

NETWORK LOGIN

The *NETWORK LOGIN* softkey opens the dialog box with the auto login settings.

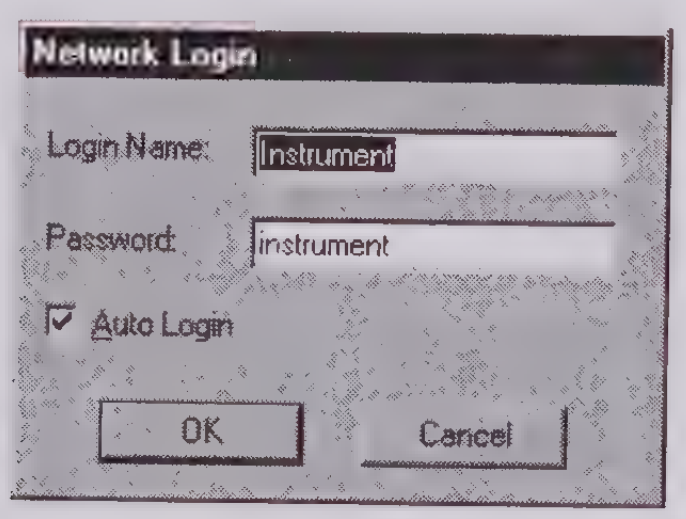

Network Login

Login Name: Instrument

Password: instrument

☑ Auto Login

When a network is installed, the preset user name 'Instrument' and the password 'instrument' can be adapted to a new user (see section 'Defining Users' in the LAN interface manual).
With the 'Auto Login' option active, an automatic registration is performed during booting with the specified user name and password. Otherwise the Windows XP login request is displayed during booting.

Notes:
- *A PC keyboard with trackball (or additional mouse instead) is required for the installation/configuration of the network support.*
- *The softkey is only available with built-in LAN interface FSU.*

IEC/IEEE-bus command: –

Enabling Firmware Options

The *OPTIONS* softkey opens a submenu that allows license keys for firmware options to be entered. Previously installed options are displayed in a table that opens automatically.

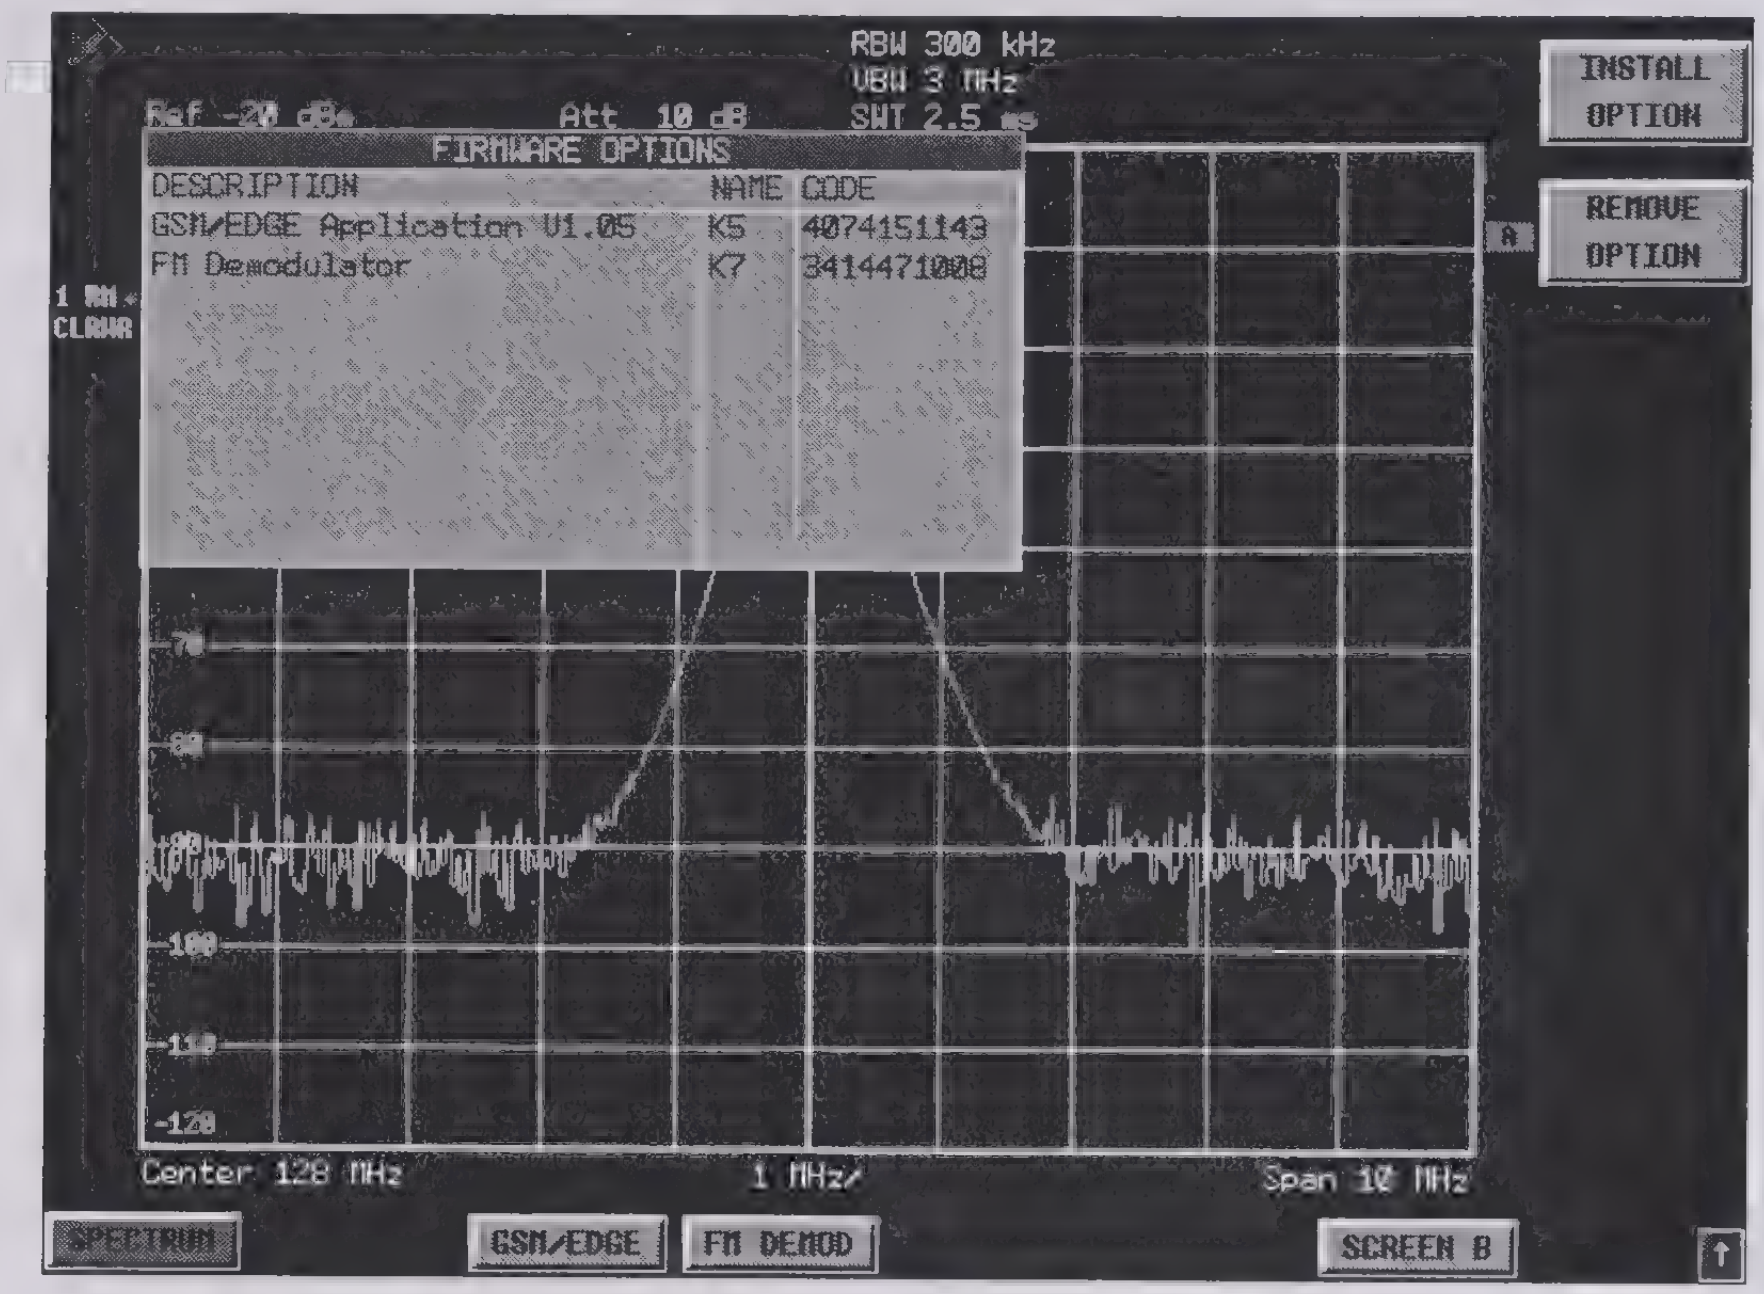

FIRMWARE OPTIONS

DESCRIPTION	NAME	CODE
GSM/EDGE Application V1.05	K5	4074151143
FM Demodulator	K7	3414471008

Softkey *INSTALL OPTION* opens the data entry for the license keycode of a firmware option.

On entry of a valid license key the message *OPTION KEY OK* is displayed in the status line and the firmware option appears in table *FIRMWARE OPTIONS* .

On entry of an invalid license key the message *OPTION KEY INVALID* is displayed in the status line.

IEC/IEEE-bus command: --

Softkey *REMOVE OPTION* removes all firmware options from the instruments. Execution of this function must be confirmed in a message box in order to avoid removal of the firmware options by mistake.

IEC/IEEE-bus command: --

Emulation of the Instrument Front Panel

SETUP - GENERAL SETUP – NEXT menu:

SOFT FRONTPANEL

The *SOFT FRONTPANEL* softkey switches the display of the front-panel keys on and off.

When the front-panel keys are displayed on the screen, the instrument can be controlled by clicking the respective button with the mouse. This is especially useful when the instrument in a different site is controlled via a remote-control program, such as, for instance, the remote desktop of Windows XP, and the screen contents are transferred to the controller via remote link (see the section "LAN Interface - Remote Desktop under Windows XP).

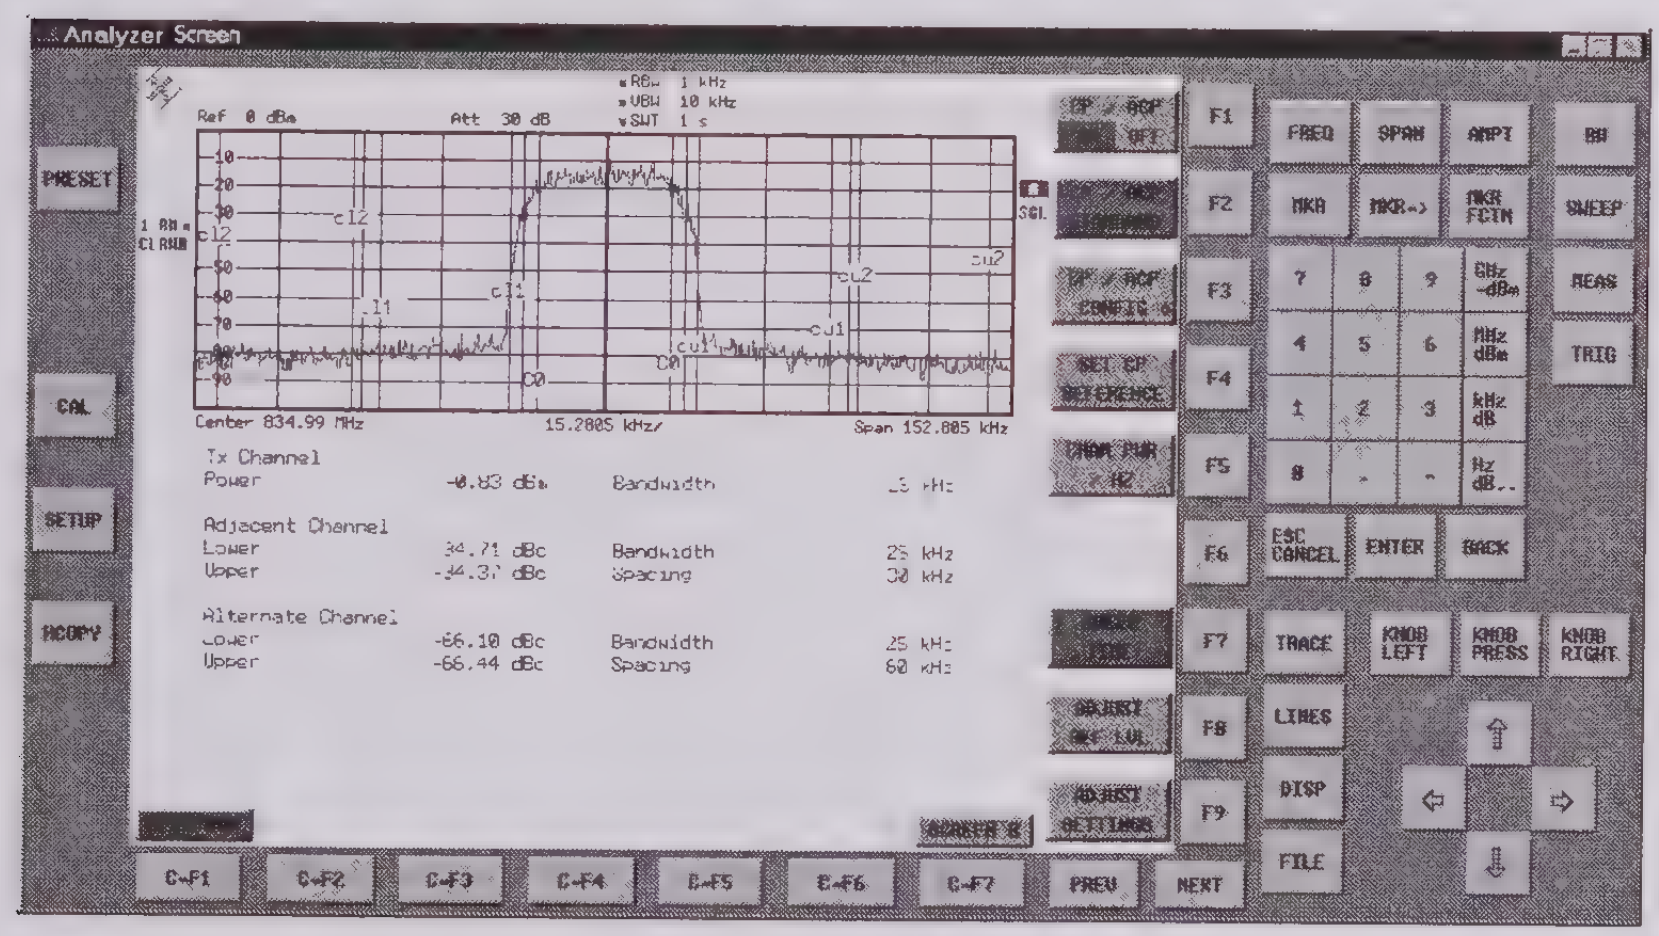

```
Tx Channel
Power                -0.83 dBm      Bandwidth        25 kHz

Adjacent Channel
Lower                34.71 dBc      Bandwidth        25 kHz
Upper               -34.37 dBc      Spacing          30 kHz

Alternate Channel
Lower               -66.10 dBc      Bandwidth        25 kHz
Upper               -66.44 dBc      Spacing          60 kHz
```

Note:

Display resolution:

When the display of the front-panel keys is switched on, the screen resolution of the instrument changes to 1024x768 pixels. Only a section of the total screen is then displayed on the LC display, which will automatically be shifted on mouse moves.

In order to obtain a complete display of the user interface, an external monitor is to be plugged into the corresponding connector at the rear panel. Prior to performing the resolution change the user is prompted for confirmation whether the required monitor is connected.

Switching off the front-panel display restores the original screen resolution.

Key assignment:

Button labels largely correspond to those of the front-panel keys. The rotation function of the rotary knob is assigned to the 'KNOB LEFT' and 'KNOB RIGHT' buttons, the press function (<ENTER>) to 'KNOB PRESS'.

The labels of the softkey buttons (F1 to F9) and of the hotkey buttons (C-F1 to C-F7) indicate that the keys can be operated directly by means of the corresponding function keys F1 to F9 or <CTRL>F1 to <CTRL>F7 of a PS/2 keyboard.

IEC/IEEE-bus command: `SYST:DISP:FPAN ON`

System Information

The *SYSTEM INFO* softkey opens a submenu in which detailed information on module data, device statistics and system messages is displayed.

SETUP menu:

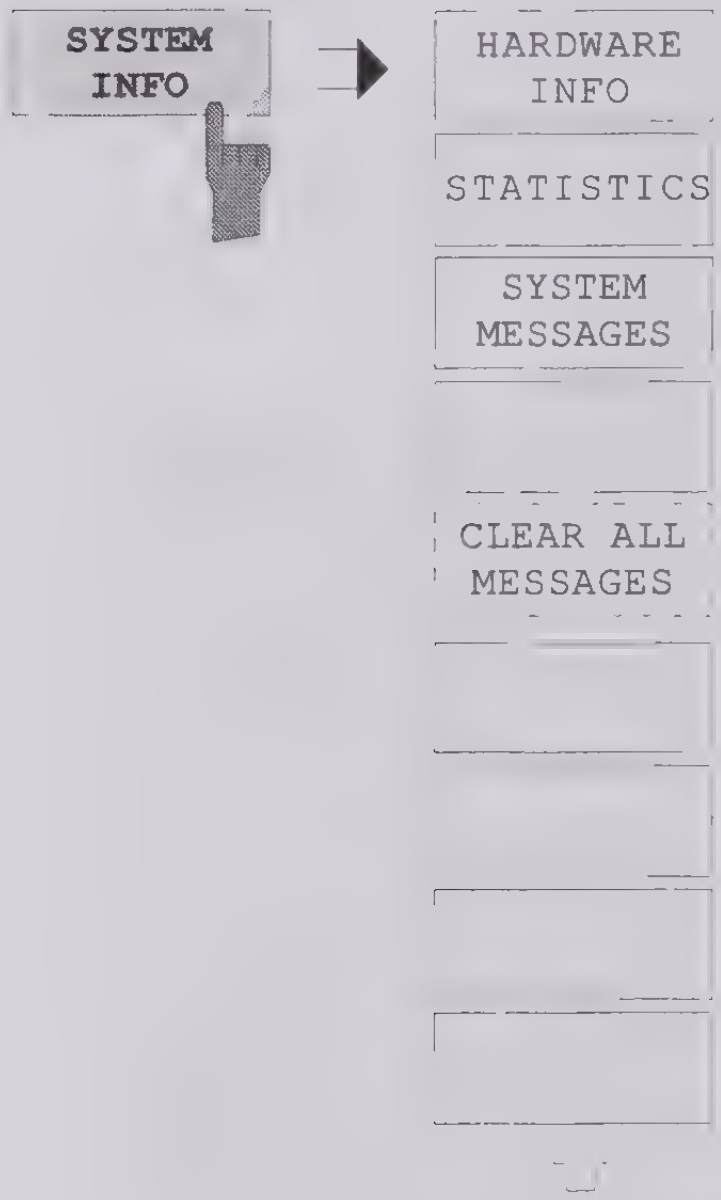

Display of Module Data

SETUP SYSTEM INFO submenu:

The *HARDWARE INFO* softkey opens a table in which the modules (INSTALLED COMPONENTS) installed in the instrument are listed together with the corresponding hardware revisions.

Table *HARDWARE INFO* consists of six columns:

SERIAL #	serial number
COMPONENT	name of module
ORDER #	order number
MODEL	model number of the module
REV	main modification index of the module
SUB REV	secondary modification index of the module

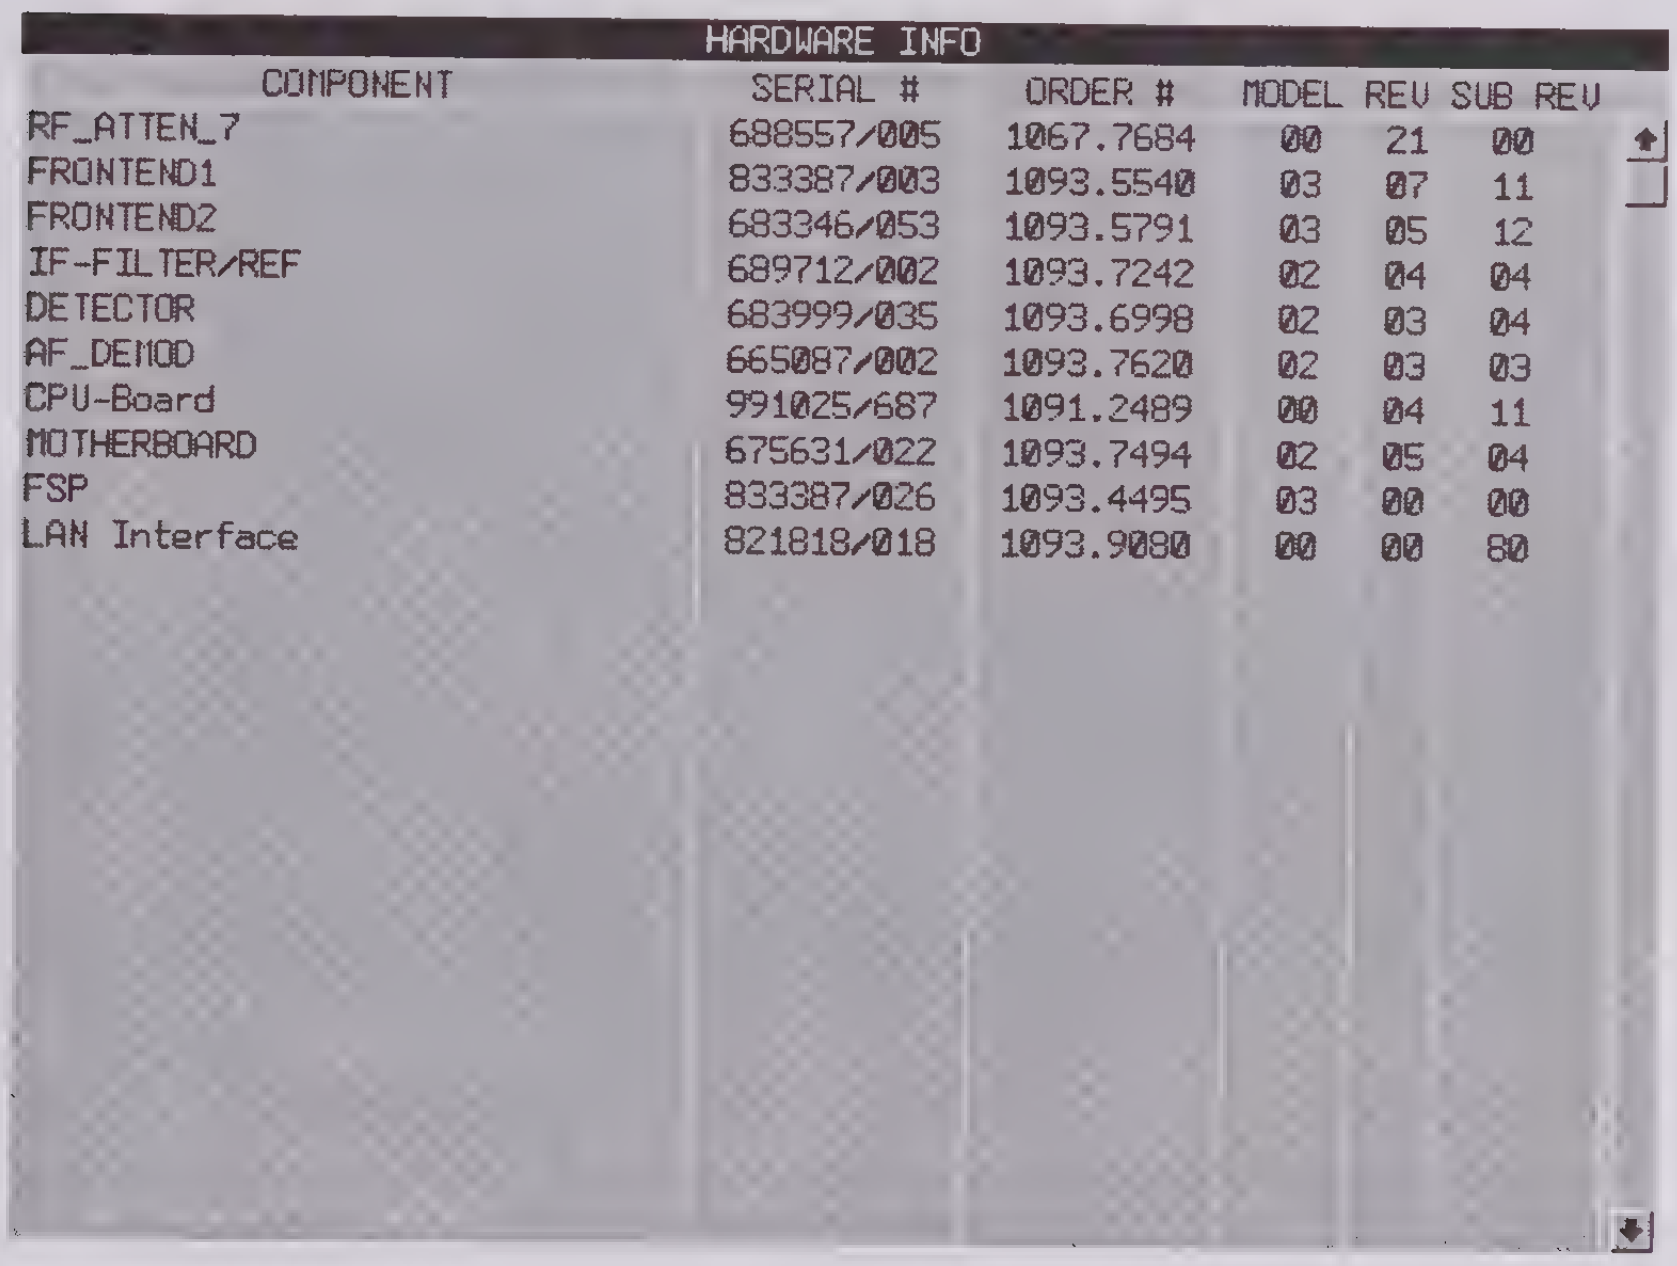

HARDWARE INFO

COMPONENT	SERIAL #	ORDER #	MODEL	REV	SUB REV
RF_ATTEN_7	688557/005	1067.7684	00	21	00
FRONTEND1	833387/003	1093.5540	03	07	11
FRONTEND2	683346/053	1093.5791	03	05	12
IF-FILTER/REF	689712/002	1093.7242	02	04	04
DETECTOR	683999/035	1093.6998	02	03	04
AF_DEMOD	665087/002	1093.7620	02	03	03
CPU-Board	991025/687	1091.2489	00	04	11
MOTHERBOARD	675631/022	1093.7494	02	05	04
FSP	833387/026	1093.4495	03	00	00
LAN Interface	821818/018	1093.9080	00	00	80

Display of Device Statistics

SETUP SYSTEM INFO submenu:

STATISTICS

The *STATISTICS* softkey opens the table *STATISTICS*. This table contains the model information, serial number and firmware version, and a list in which the operating time of the instrument, the power-on cycles as well as attenuator switching cycles are displayed.

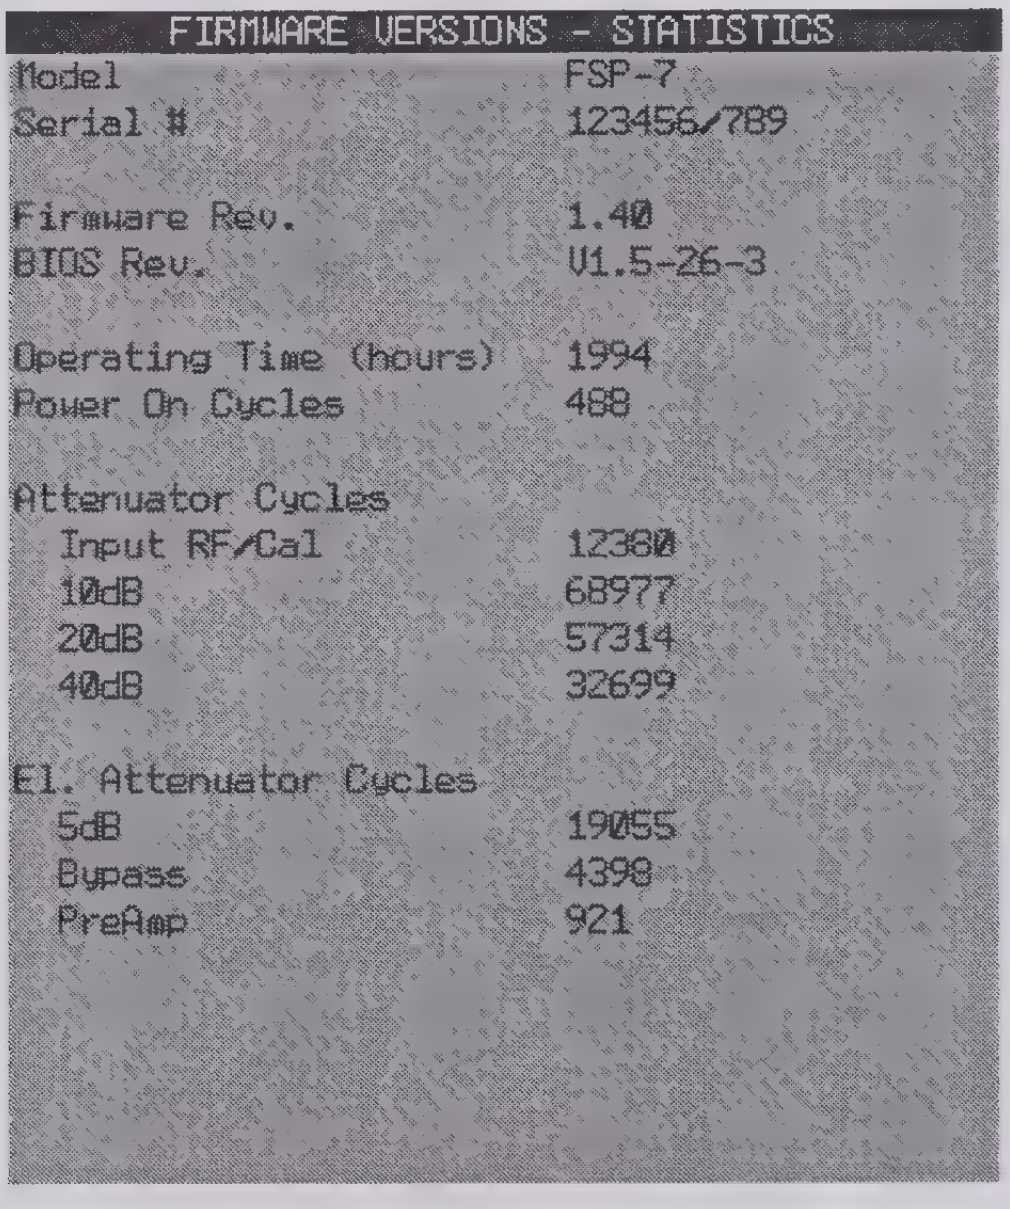

```
FIRMWARE VERSIONS - STATISTICS
Model                     FSP-7
Serial #                  123456/789

Firmware Rev.             1.40
BIOS Rev.                 V1.5-26-3

Operating Time (hours)    1994
Power On Cycles           488

Attenuator Cycles
  Input RF/Cal            12380
  10dB                    68977
  20dB                    57314
  40dB                    32699

El. Attenuator Cycles
  5dB                     19055
  Bypass                  4398
  PreAmp                  921
```

IEC/IEEE-bus command: --

Display of System Messages

SETUP SYSTEM INFO submenu:

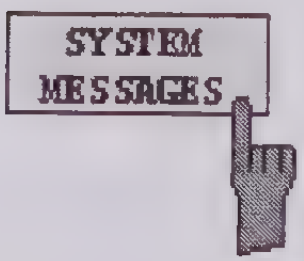

The *SYSTEM MESSAGES* softkey opens a submenu including a table in which the generated system messages are displayed in the order of their occurrence. The most recent messages are placed at the top of the list.
The following information is available:

No	Device-specific error code
MESSAGE	Brief description of the message
COMPONENT	On hardware messages: name of the affected module On software messages: if needed, the name of the affected software components
DATE/TIME	Date and time of the occurrence of the message

Messages that have occurred since the last call to the *SYSTEM MESSAGES* menu are marked with an asterisk '*'.
The CLEAR ALL MESSAGES softkey is activated and allows clearing of the error buffer.

If the number of error messages exceeds the capacity of the error buffer, the message appearing first is "Message buffer overflow".

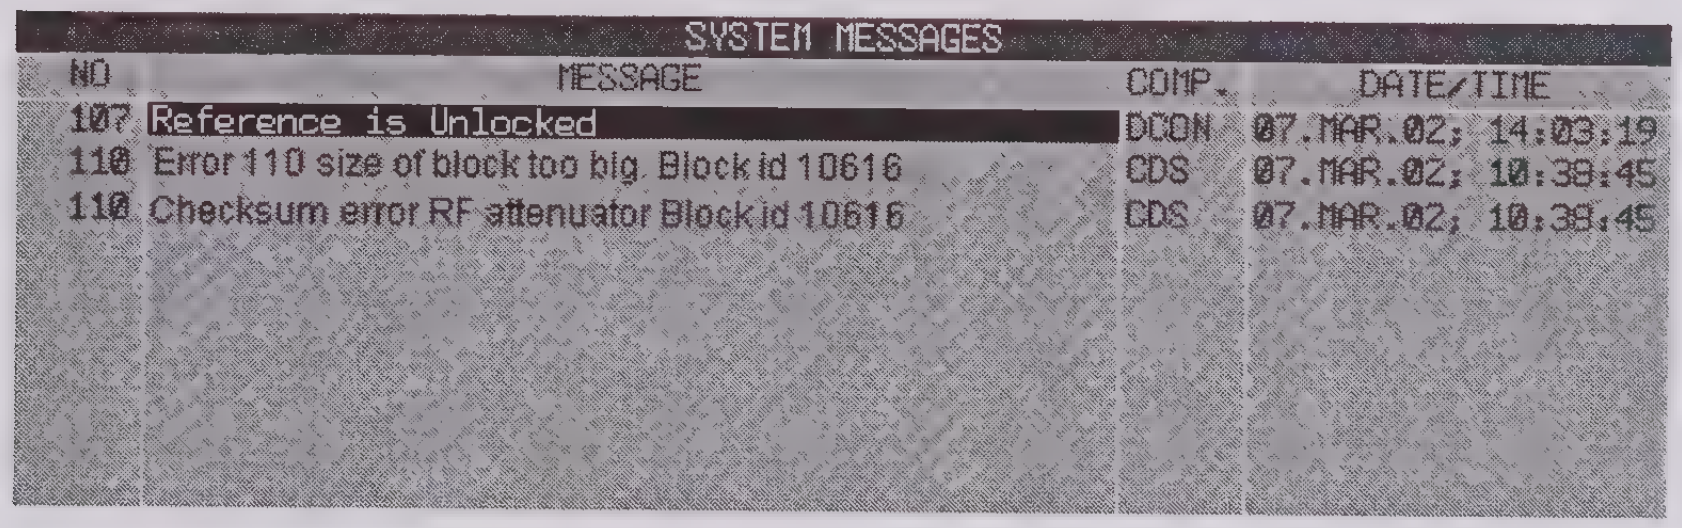

SYSTEM MESSAGES

NO	MESSAGE	COMP.	DATE/TIME
107	Reference is Unlocked	DCON	07.MAR.02; 14:03:19
110	Error 110 size of block too big. Block id 10616	CDS	07.MAR.02; 10:38:45
110	Checksum error RF attenuator Block id 10616	CDS	07.MAR.02; 10:38:45

IEC/IEEE-bus command: `SYST:ERR?`

The *CLEAR ALL MESSAGES* softkey deletes all messages in the table.
The softkey is only available when table *SYSTEM INFO* is active.

IEC/IEEE-bus command: `SYST:ERR?`

Service Menu

The service menu offers a variety of additional functions which are used for maintenance and/or trouble shooting.

Caution:

The service functions are not necessary for normal measurement operation. However, incorrect use can affect correct operation and/or data integrity of the R&S FSMR. Therefore, many of the functions can only be used after entering a password. They are described in the instrument service manual.

SETUP menu:

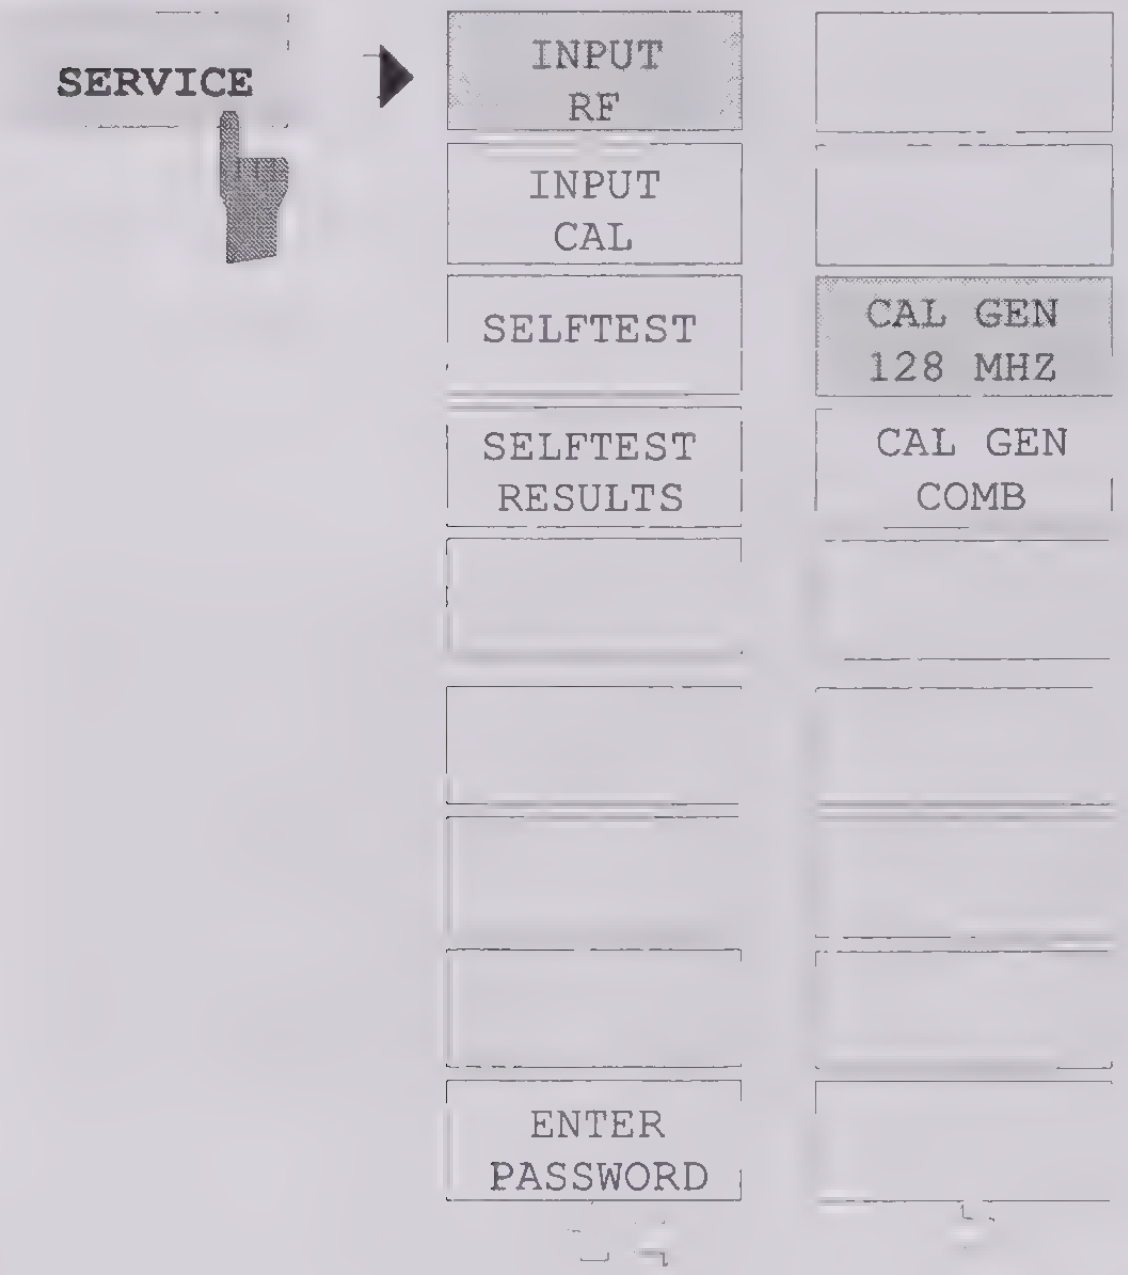

The *SERVICE* softkey opens a submenu for selection of the service function.

The *INPUT RF* and *INPUT CAL* softkeys are mutually exclusive selection switches. Only one switch can be active at any one time.

General Service Functions

SETUP SERVICE submenu:

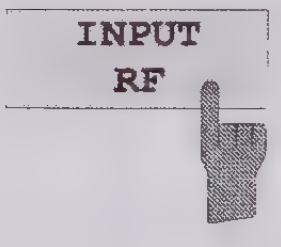

The *INPUT RF* softkey switches the input of the R&S FSMR to the input connector (normal position).

After *PRESET*, *RECALL* or R&S FSMR power on, the *INPUT RF* is always selected.

IEC/IEEE-bus command: `DIAG:SERV:INP RF`



The *INPUT CAL* softkey switches the RF input of the R&S FSMR to the internal calibration source (128 MHz) and activates the data entry of the output level of the calibration source. Possible values are 0 dB and –30 dB.

IEC/IEEE-bus command:

```
DIAG:SERV:INP CAL;
DIAG:SERV:INP:CSO 0 DBM
```

The *ENTER PASSWORD* softkey allows the entry of a password.

The R&S FSMR contains a variety of service functions which, if incorrectly used, can affect correct operation of the analyzer. These functions are normally not accessible and are only usable after the entry of a password (see instrument service manual).

IEC/IEEE-bus command: `SYST:PASS "Password"`

SETUP SERVICE NEXT submenu:

The CAL GEN 128 MHZ softkey selects a sinusoidal signal at 128 MHz as output signal for the internal calibration source. The internal pulse generator will be switched off.

Note:
The softkey is only available if the optional Broadband Calibration Source FSP-B15 is fitted.
IEC/IEEE-bus command: `DIAG:SERV:INP:PULS OFF`



The *CAL GEN COMB* softkey switches the internal pulse generator on and allows the pulse frequency to be entered.
For model FSP40 the pulse frequency 640 MHz is selected.
With option FSP-B15 the selectable pulse frequencies are 10 kHz and 62.5 kHz.

IEC/IEEE-bus command

```
DIAG:SERV:INP:PULS ON;
  DIAG:SERV:INP:PRAT 62.5KHZ
```

Selftest

SETUP SERVICE submenu:

The *SELFTEST* softkey initiates the selftest of the instrument modules.

With this function the instrument is capable of identifying a defective module in case of failure. During the selftest a message box appears in which the current test and its result is shown. The test sequence can be aborted by pressing ENTER ABORT. All modules are checked consecutively and the test result (selftest PASSED or FAILED) is output in the message box.

IEC/IEEE-bus command: `*TST?`

The *SELFTEST RESULTS* softkey calls the *SELFTEST* table in which the results of the module test are displayed. In case of failure a short description of the failed test, the defective module, the associated value range and the corresponding test results are indicated.

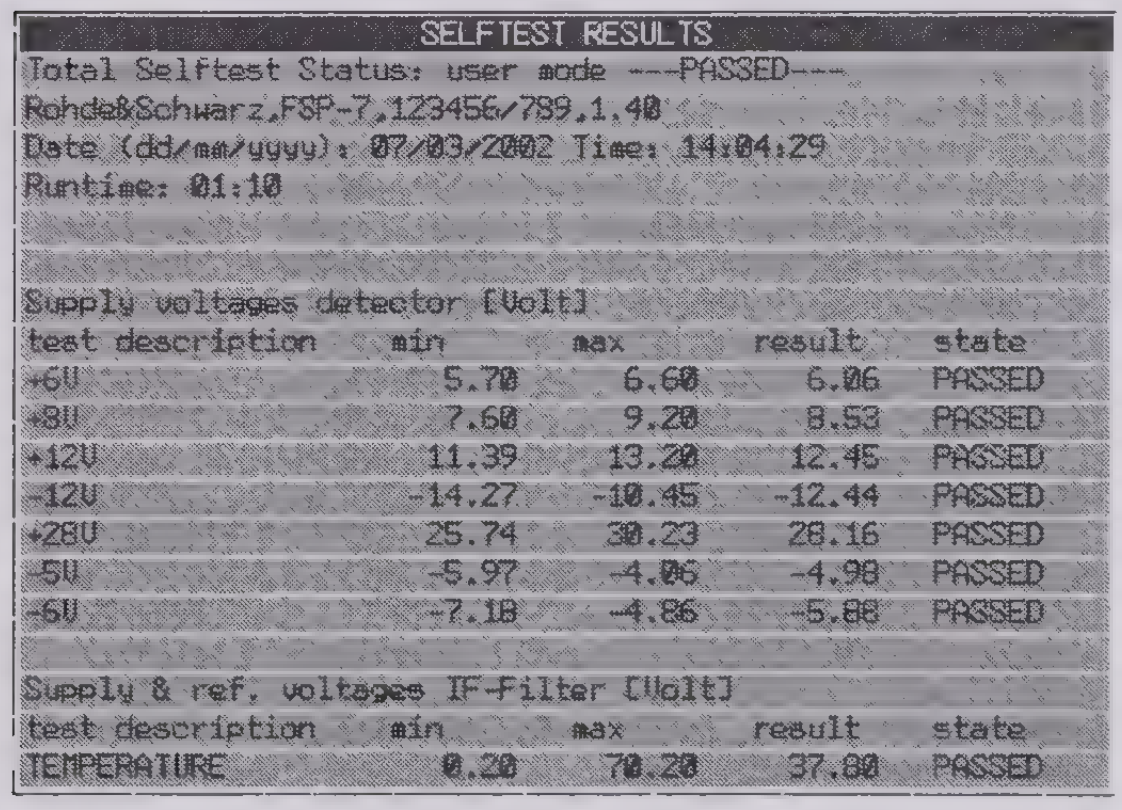

```
                    SELFTEST RESULTS
Total Selftest Status: user mode ---PASSED---
Rohde&Schwarz,FSP-7,123456/789,1.40
Date (dd/mm/yyyy): 07/03/2002 Time: 14:04:29
Runtime: 01:10


Supply voltages detector [Volt]
test description    min        max       result    state
+6V                     5.70       6.60      6.06  PASSED
+8V                     7.60       9.20      8.53  PASSED
+12V                   11.39      13.20     12.45  PASSED
-12V                  -14.27     -10.45    -12.44  PASSED
+28V                   25.74      30.23     28.16  PASSED
-5V                    -5.97      -4.06     -4.98  PASSED
-6V                    -7.18      -4.86     -5.88  PASSED

Supply & ref. voltages IF-Filter [Volt]
test description    min        max       result    state
TEMPERATURE             0.20      70.20     37.80  PASSED
```

IEC/IEEE-bus command: `DIAG:SERV:STE:RES?`



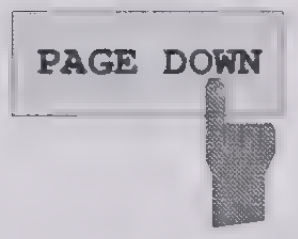

The *PAGE UP* or *PAGE DOWN* softkey sets the *SELFTEST RESULTS* table to the next or previous page.

IEC/IEEE-bus command --

Hardware Adjustment

Some of the R&S FSMR modules can be realigned. This realignment can become necessary after calibration due to temperature drift or aging of components (see service manual instrument).

Caution:

The realignment should be carried out by qualified personnel since the changes considerably influence the measurement accuracy of the instrument. This is the reason why the softkeys REF FREQUENCY, CAL SIGNAL POWER and SAVE CHANGES can only be accessed after entering a password.

Firmware Update

The installation of a new firmware version can be performed using the built-in diskette drive. The firmware update kit contains several diskettes.
The installation program is called in the *SETUP* menu.

SETUP side menu:

The *FIRMWARE UPDATE* softkey opens the subdirectory for installing/deinstalling new firmware versions.

IEC/IEEE-bus command: --

The *FIRMWARE UPDATE* softkey starts the installation program and leads the user through the remaining steps of the update

IEC/IEEE-bus command: --

The firmware update is started as follows:

Insert disk 1 into the floppy drive.

Call *SETUP* side menu via ***[SETUP][NEXT]***

Start the update via ***[FIRMWARE UPDATE]***

The *RESTORE FIRMWARE* softkey restores the previous firmware version

IEC/IEEE-bus command: --

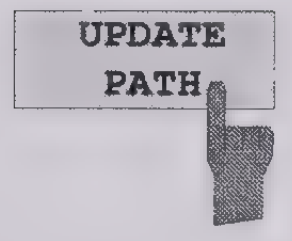

The *UPDATE PATH* softkey is used to select the drive and directories under which the archive files for the firmware update are stored.

The firmware update can thus also be performed via network drives or USB memory sticks/USB-CD-ROM drives.

IEC/IEEE-bus command:

```
"SYST:FIRM:UPD 'D:\USER\FWUPDATE'"
```

Saving and Recalling Data Sets – *FILE* Key

Overview

The *FILE* key calls the following functions:

- Storage/loading functions for storing (*SAVE*) instrument settings such as instrument configurations (measurement/display settings, etc) and measurement results from working memory to permanent storage media, or to load (*RECALL*) stored data into working memory.
- Functions for management of storage media (*FILE MANAGER*). Included are among others functions for listing files, formatting storage media, copying, and deleting/renaming files.

The R&S FSMR is capable of internally storing complete instrument settings with instrument configurations and measurement data in the form of data sets. The respective data are stored on the internal hard disk or, if selected, on a floppy. The hard-disk and floppy-disk drives have the following names:

floppy disk	A:
hard disk	D: (hard disk C: is reserved for instrument software)

The configuration of the softkeys in the menu is shown in the following figure:

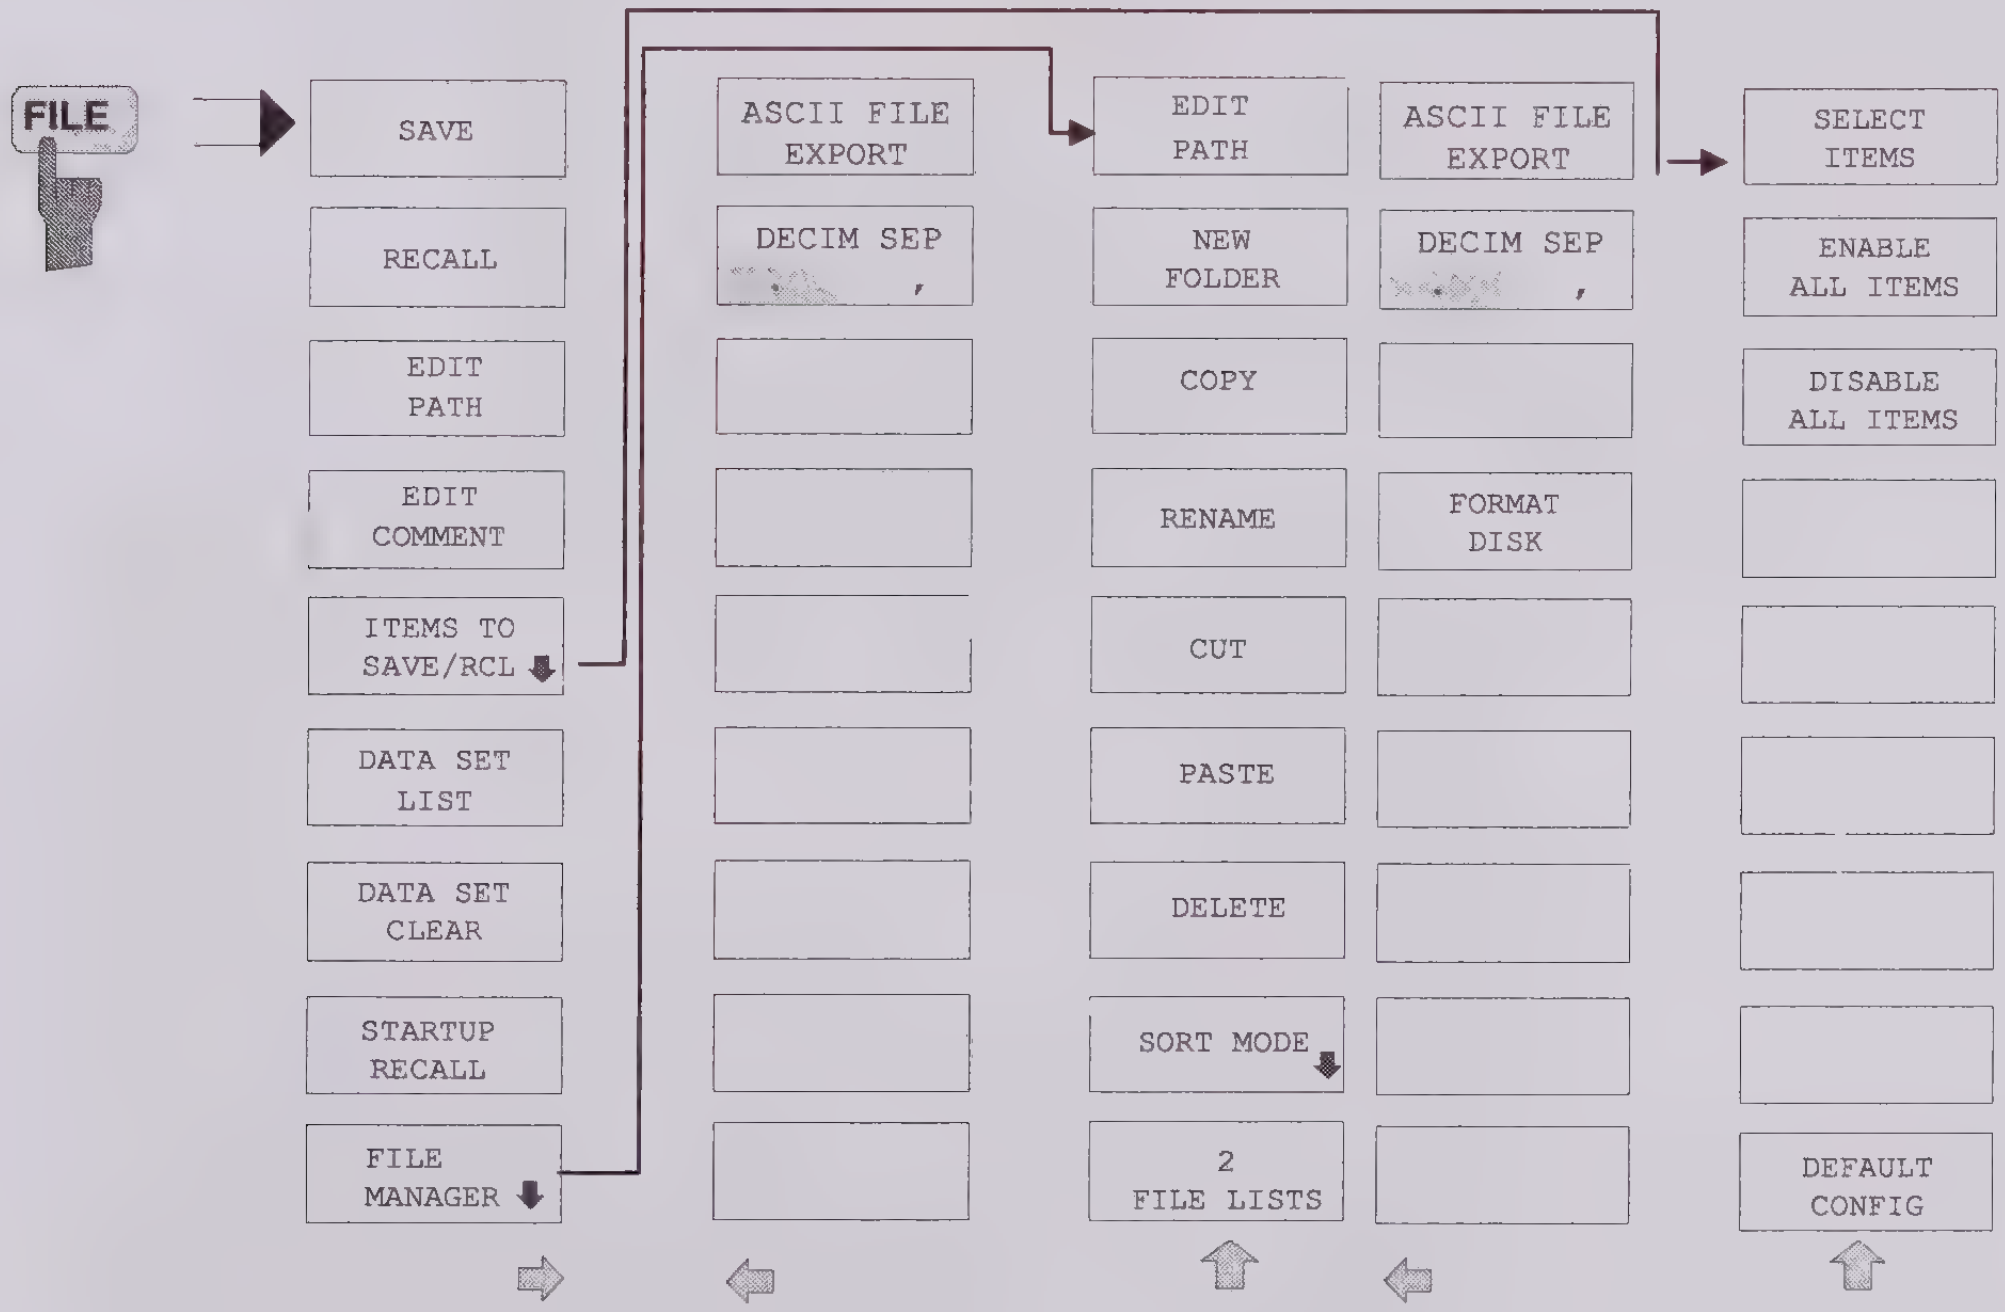

Storing a Device Configuration

Storing a Complete Device Configuration

The following steps are required to store a complete device configuration:

- Press the *FILE* key and then press the *SAVE softkey*.
  The selection box for the device configuration will be opened:

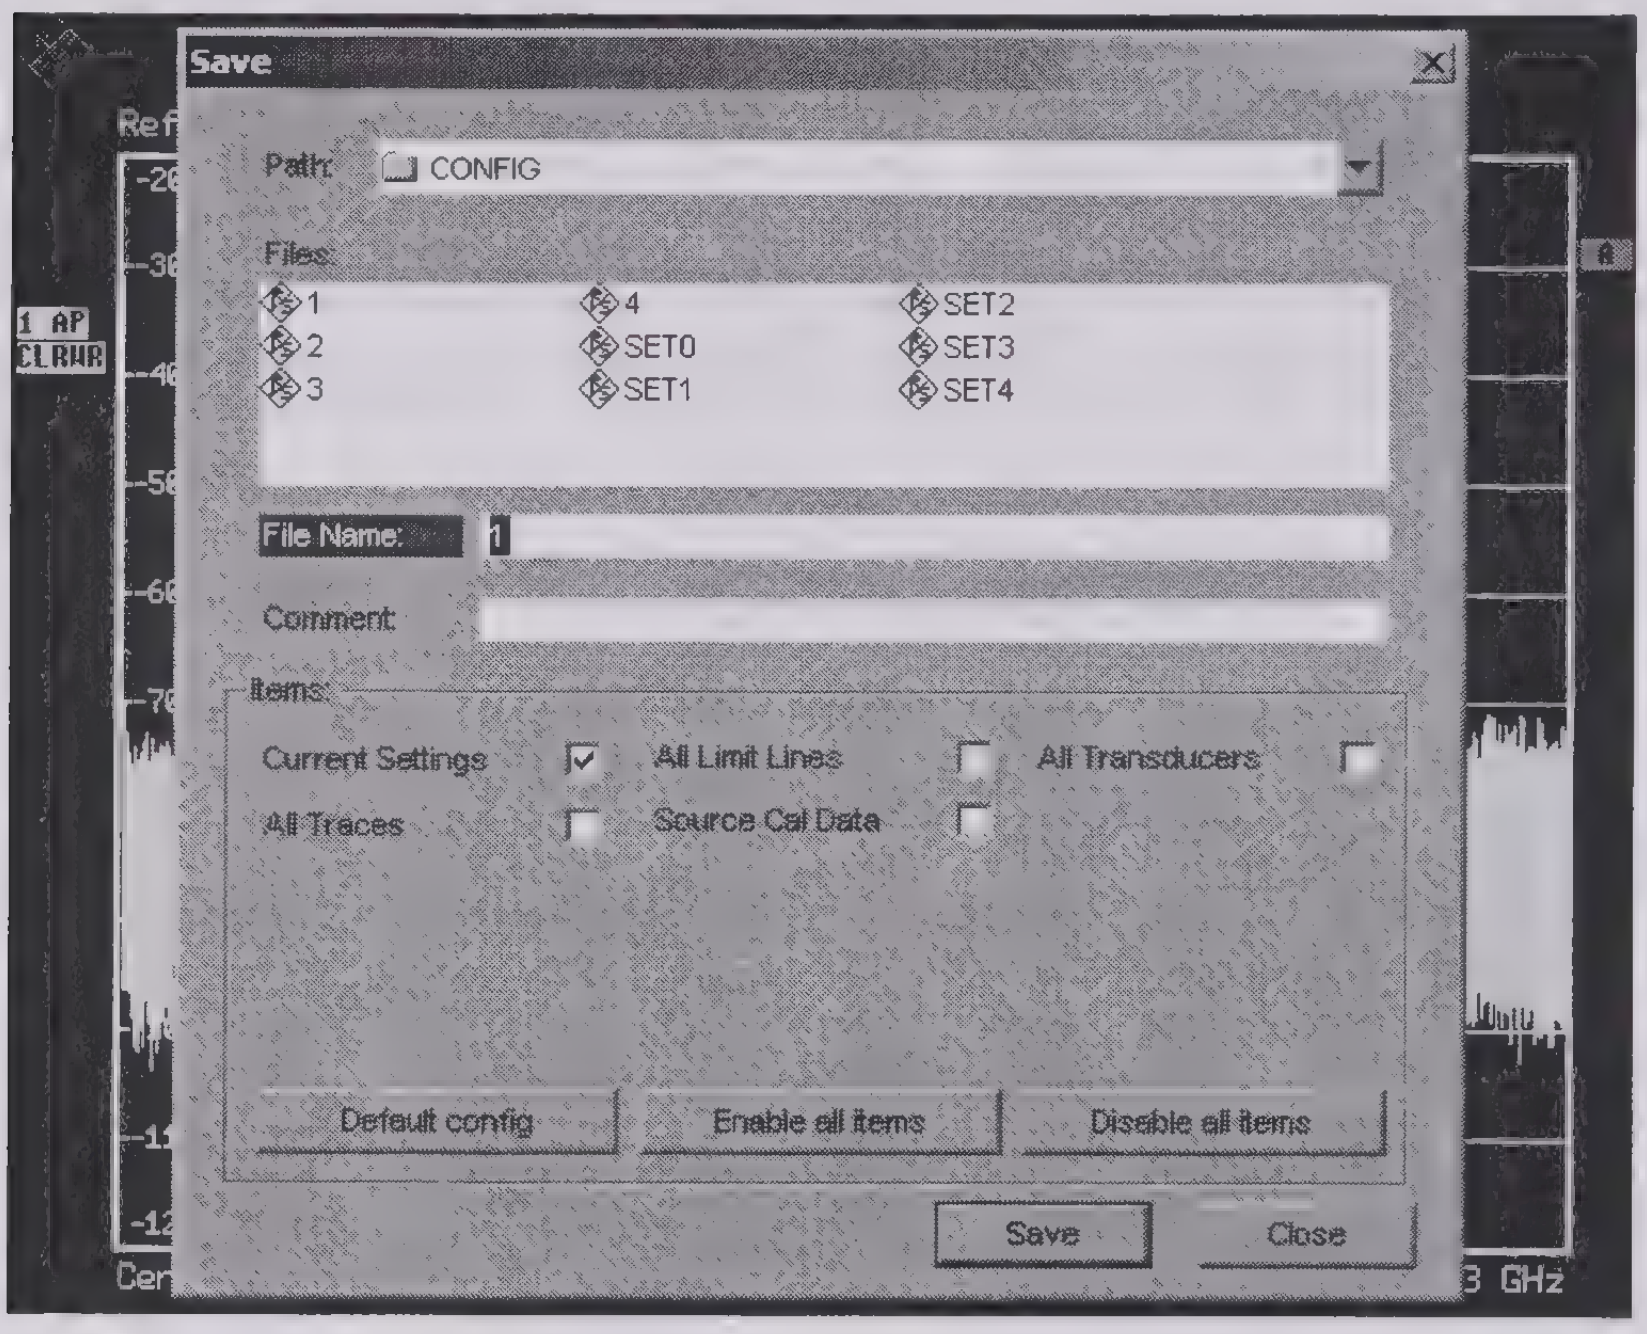

Save

Path: CONFIG

Files:

1	4	SET2
2	SET0	SET3
3	SET1	SET4

File Name: 1

Comment:

Items:

Current Settings ☑ All Limit Lines ☐ All Transducers ☐

All Traces ☐ Source Cal Data ☐

- Enter the name of the data set to be stored (in the simplest case, a digit from 0 to 9) and press *ENTER*. The data set will be stored and the dialog window closed.
  The name of the data set may comprise letters and digits; if required, the desired directory may precede the name of the data set (the directory will then automatically be used for further SAVE and RECALL processes).
  The help line editor, which can be opened by pressing the *Cursor Down* key, is available for entering file names via the front-panel keypad.
  For further information on the operation of this editor, see section "Entering Text using the Help Line Editor".

How to enter comments, change the path for the file to be stored and select the data set from a list is described under the associated softkeys *EDIT COMMENT, EDIT PATH* and *DATA SET LIST.*

The default path for the device configuration is D:\USER\CONFIG. The file names of the data sets have the extension .R&S FSMR.

Storing Parts of a Device Configuration

To store part of a data set (e.g. "All Transducers"), the partial data set has to be selected beforehand. The following steps are required:

- Press the FILE key and then the SAVE softkey.
- Press the ITEMS TO SAVE/RCL softkey. The entry focus moves to the first entry in the Items field.
- Use the spinwheel to move the entry focus to the desired entry in the Items field and select the partial data set by pressing the spinwheel or ENTER. The selection of already highlighted partial data sets

can be cancelled by pressing the spinwheel / ENTER again.
Softkeys *ENABLE ALL ITEMS / DISABLE ALL ITEMS* are also available to select all partial data sets or to cancel the selection.

- ➢ Move the entry focus to the field *File Name* using the spinwheel and activate the text entry by pressing the spinwheel.
- ➢ Enter file names and store the data set with *ENTER*.

Loading a Data Set:

A data set may be loaded in two different ways:

1. **Direct entry of data set name:**
   - ➢ Press the *FILE* key and then press the *RECALL* softkey.
   - ➢ Enter the name of the data set to be stored (in the simplest case, a digit from 0 to 9) and press *ENTER*. The data set will be loaded.

   The name of the data set may comprise letters and digits; if required, the desired directory may precede the name of the data set (the directory will then automatically be used for further SAVE and RECALL processes).
   The help line editor, which can be opened by pressing the *Cursor Down* ⇩ key, is available for entering file names via the front-panel keypad.

   For further information on the operation of this editor, see section "Entering Text using the Help Line Editor".

2. **Selection of data set via a selection list:**
   - ➢ Press the *FILE* key and then press the *RECALL* softkey.
   - ➢ Press the *ITEMS TO SAVE/RCL* softkey.
     The list of available data sets will be selected:

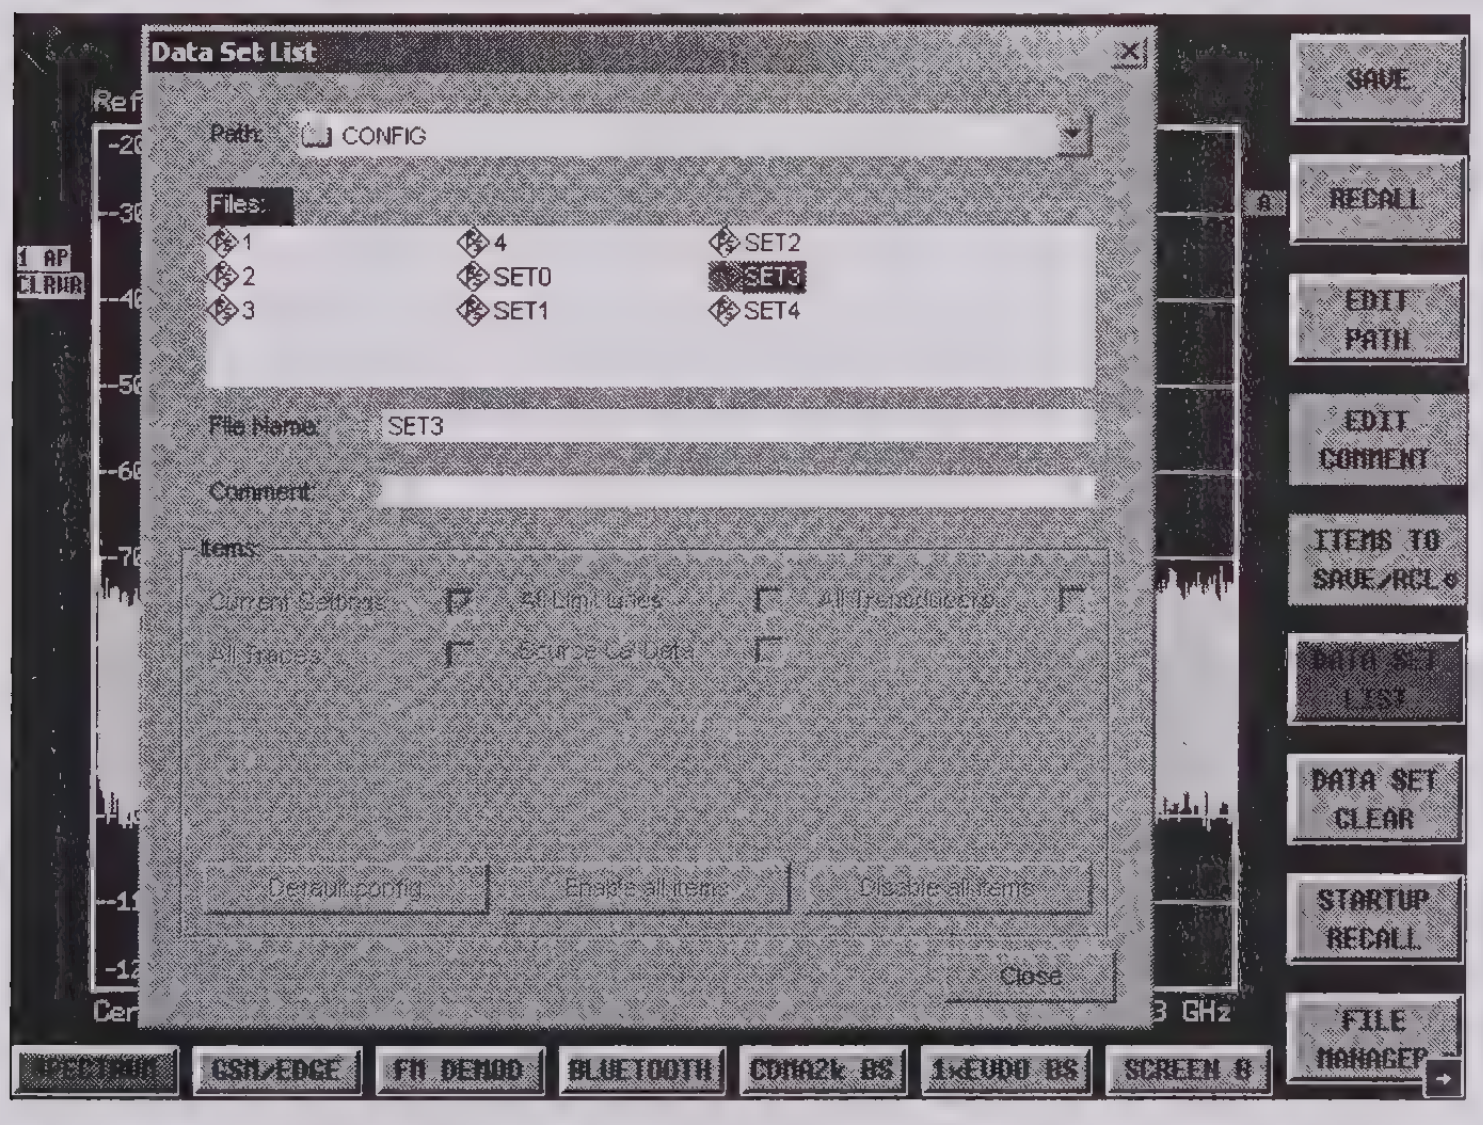

Data Set List

Path: CONFIG

Files:

1
2
3
4
SET0
SET1
SET2
SET3
SET4

File Name: SET3

Comment:

Items:

Current Settings ☑
All Limit Lines ☐
All Transducers ☐
All Traces ☐
Source Cal Data ☐

   - ➢ Select the data set to be loaded with the spinwheel and confirm twice with *ENTER*. The data set will be loaded.

If the path for the device configuration is to be changed, this is done via the *EDIT PATH* softkey.
When loading device data, the settings of the unloaded partial data sets will remain unchanged. The R&S R&S FSMR recognizes which parts the loaded data set has and ignores selected but unavailable partial data sets.

Automatic Loading of a Data Set during Booting

When the R&S R&S FSMR is delivered, it will load the device setting last activated when the unit was switched off (provided that the unit was switched off via the *STANDBY* switch at the front panel, see section 1 "Putting the Device Into Operation").

Moreover, the R&S R&S FSMR is also able to automatically load a user-defined data set. The following operating steps are required:

- ➢ Press the FILE key and then press the RECALL softkey.
- ➢ Press the STARTUP RECALL softkey.
  The list of available data sets will be selected:

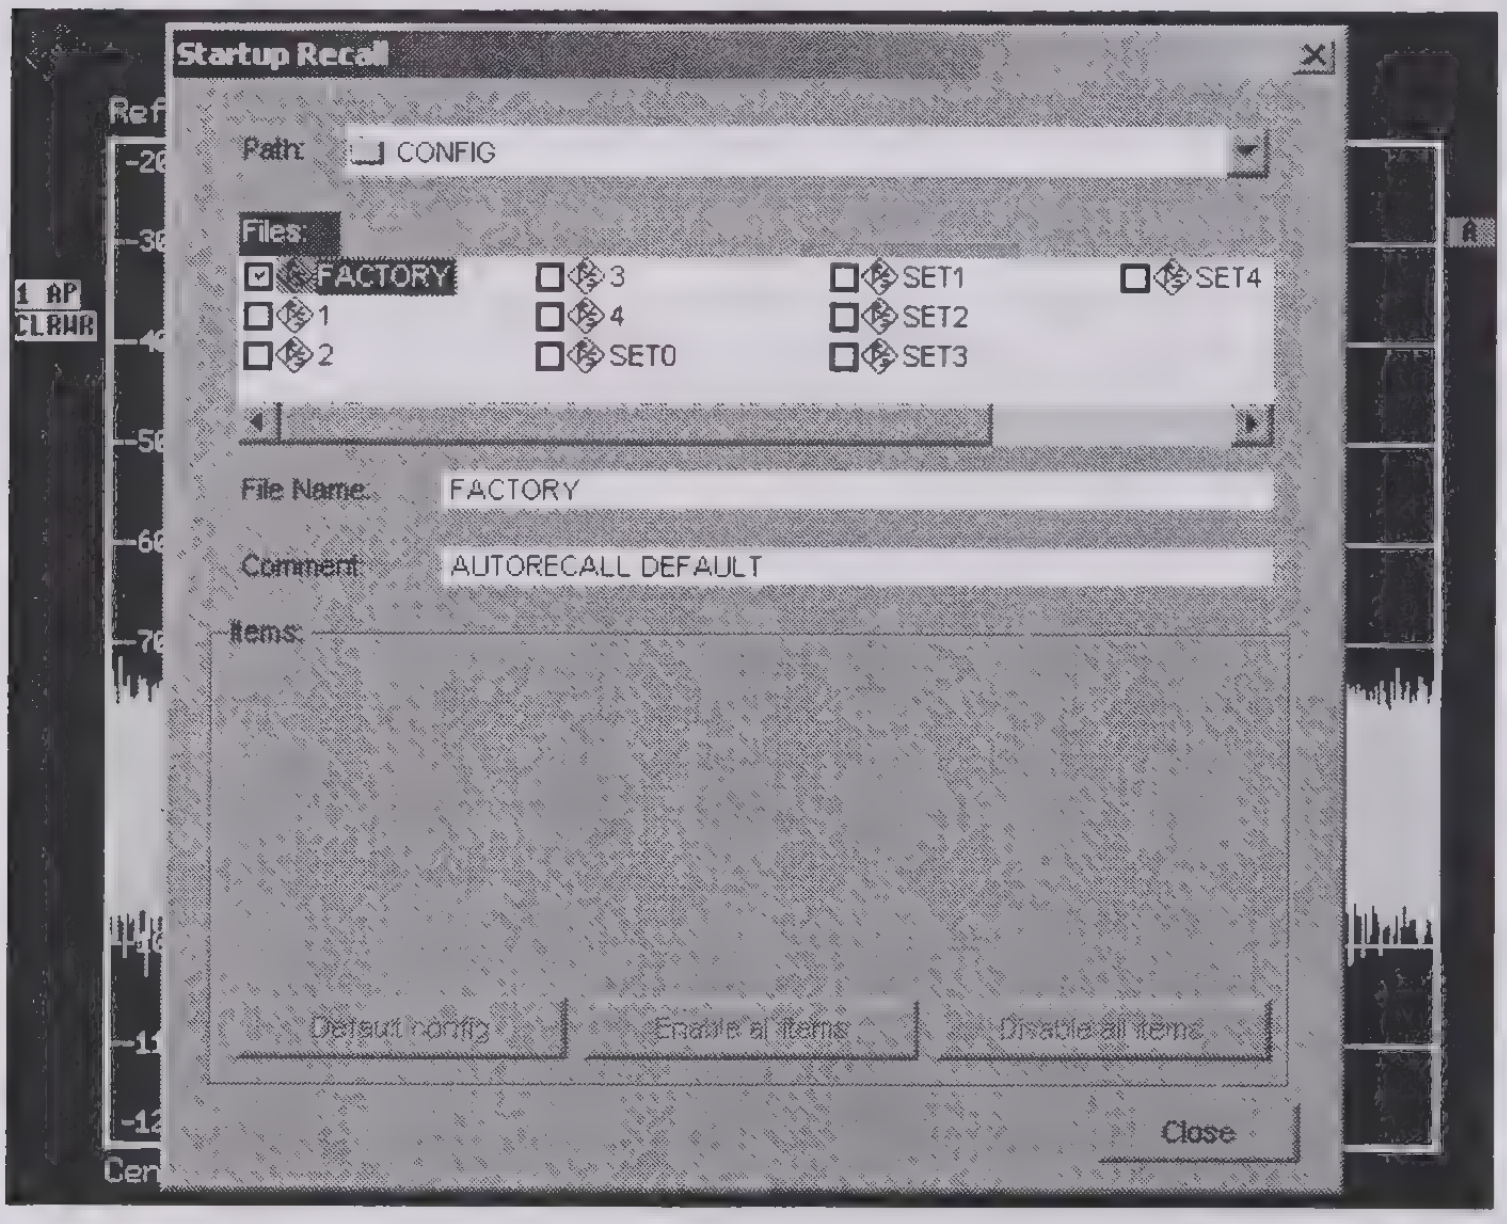

Path: CONFIG

File Name: FACTORY

Comment: AUTORECALL DEFAULT

- ➢ Select the data set to be loaded using the spinwheel and mark with *ENTER*.

Notes:
1. *The selected data set will also be loaded when pressing the PRESET key.*
2. *The entry FACTORY will load the last setting that was activated prior to switch-off when the unit is started after delivery.*

- ➢ Close the dialog window by pressing *ESC* twice.

If the path is to be changed for the device configuration, this is done via the *EDIT PATH* softkey.

Copying Data Sets to Disk

The saved files of the data sets can be copied from one storage medium (e.g. drive D:) to another storage medium (e.g. drive A:) or to another directory using the functions found in the *FILE MANAGER* submenu. The file extension .R&S FSMR must not be changed.

EnteringText with the Help Line Editor

The help line editor is opened as soon as the *CURSOR DOWN* ⇩ key is pressed on a text entry field (*File Name, Comment)*:

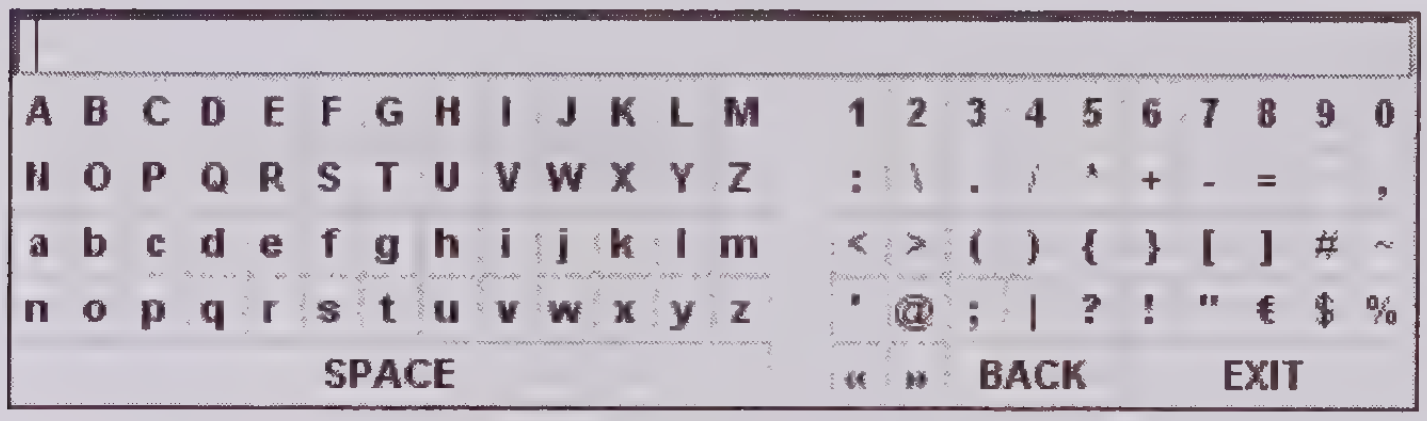
A B C D E F G H I J K L M 1 2 3 4 5 6 7 8 9 0
N O P Q R S T U V W X Y Z : \ . / * + - = ,
a b c d e f g h i j k l m < > ( ) { } [ ] # ~
n o p q r s t u v w x y z ' @ ; | ? ! " € $ %
SPACE
« »
BACK
EXIT

The entry range consists of two parts:

- editing line
- character selection field

Die *CURSOR DOWN* ⇩ key is used to move from the editing line to the character selection field.

The navigation in the character selection field is by means of the spinwheel or the cursor keys ⇧, ⇩, ⇨ and ⇦.

The desired characters are transferred to the editing line by pressing the spinwheel or by pressing the *ENTER* key:

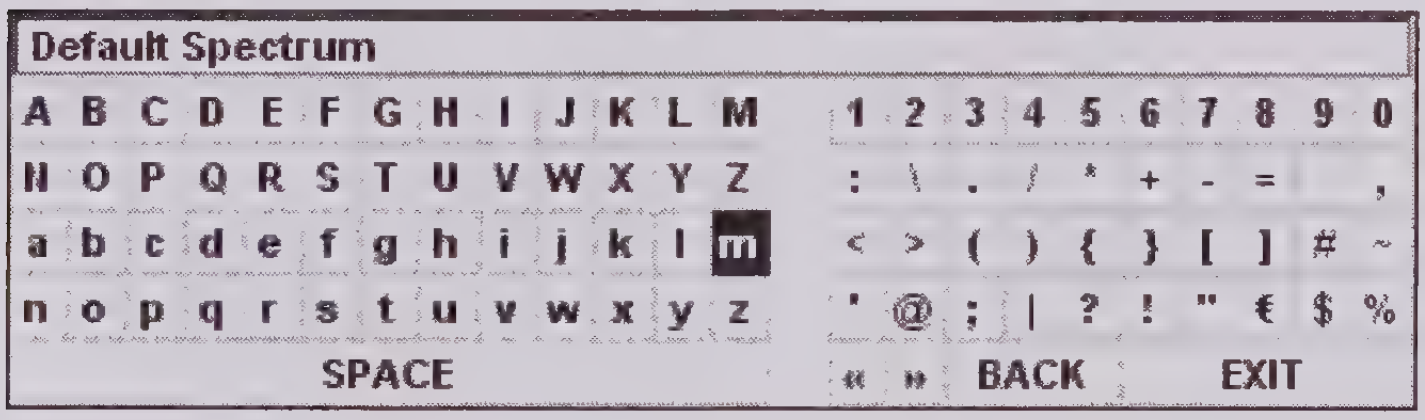
Default Spectrum
A B C D E F G H I J K L M 1 2 3 4 5 6 7 8 9 0
N O P Q R S T U V W X Y Z : \ . / * + - = ,
a b c d e f g h i j k l m < > ( ) { } [ ] # ~
n o p q r s t u v w x y z ' @ ; | ? ! " € $ %
SPACE
« »
BACK
EXIT

The fields of the last line of the character selection field have special functions:

SPACE	adds a space to the editing line
<<	moves the cursor in the editing line by one character towards the left
>>	moves the cursor in the editing line by one character towards the right
BACK	deletes the character in front of the cursor
EXIT	stores the contents of the editing line and closes the help line editor

A return to the editing line is possible via the *CURSOR UP* ⇧ key (return from the top line of the character selection field).
Within the editing line, navigation is also performed by means of the spinwheel or the cursor keys ⇨ and ⇦.

Digits, decimal points and signs are directly entered into the editing line via the keys of the numeric block provided at the front panel. With a PC keyboard connected, letters and special characters can also be entered directly.

Editing is terminated via *ENTER* if the text is to be stored and via *ESC* if the text is to be discarded. The help line editor will be closed in both cases.

Description of the Individual Softkeys



The *SAVE* softkey opens the dialog window for entering the data set to be stored.

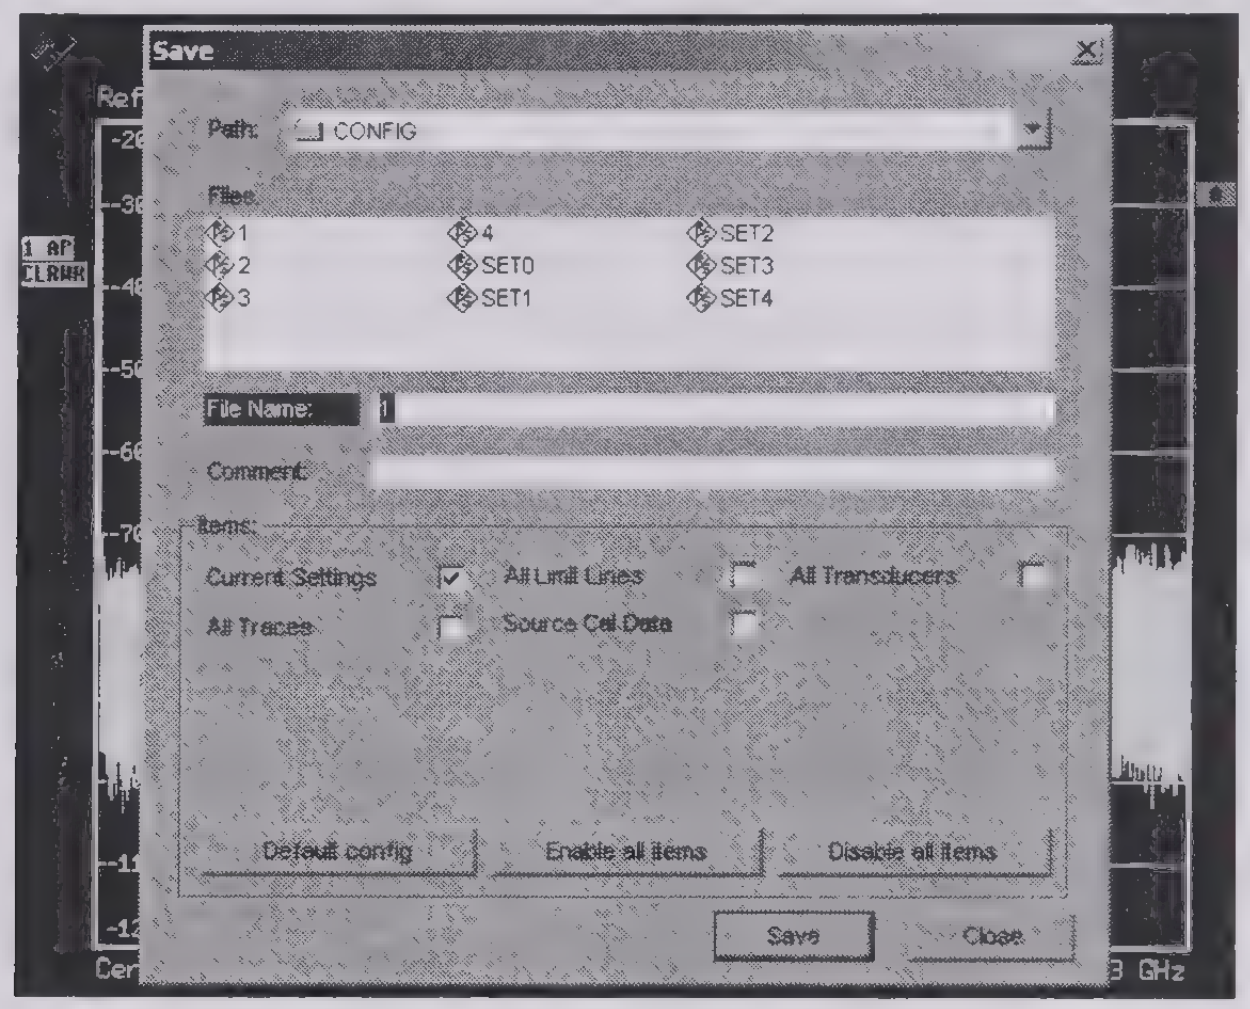

Path: CONFIG

Files:
1
2
3
4
SET0
SET1
SET2
SET3
SET4

File Name:

Comment:

Items:
Current Settings ☑
All Limit Lines ☐
All Transducers ☐
All Traces ☐
Source Cal Data ☐

The *SAVE* table contains the entry fields for editing the data set:

Path	Directory in which the data set is stored.
Files	List of data sets already stored.
File Name	Name of data set. The name can be entered with or without drive name and directory; the drive name and directory, if available, will then appear in the PATH field. The extension of the data name is ignored.
Comment	Comment regarding the data set.
Items	Selection of settings to be stored.

IEC/IEEE command: `MMEM:STOR:STAT 1,"a:\test02"`

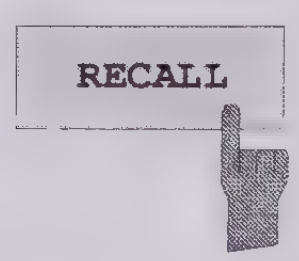

The *RECALL* softkey activates the dialog window to enter the data set to be loaded.

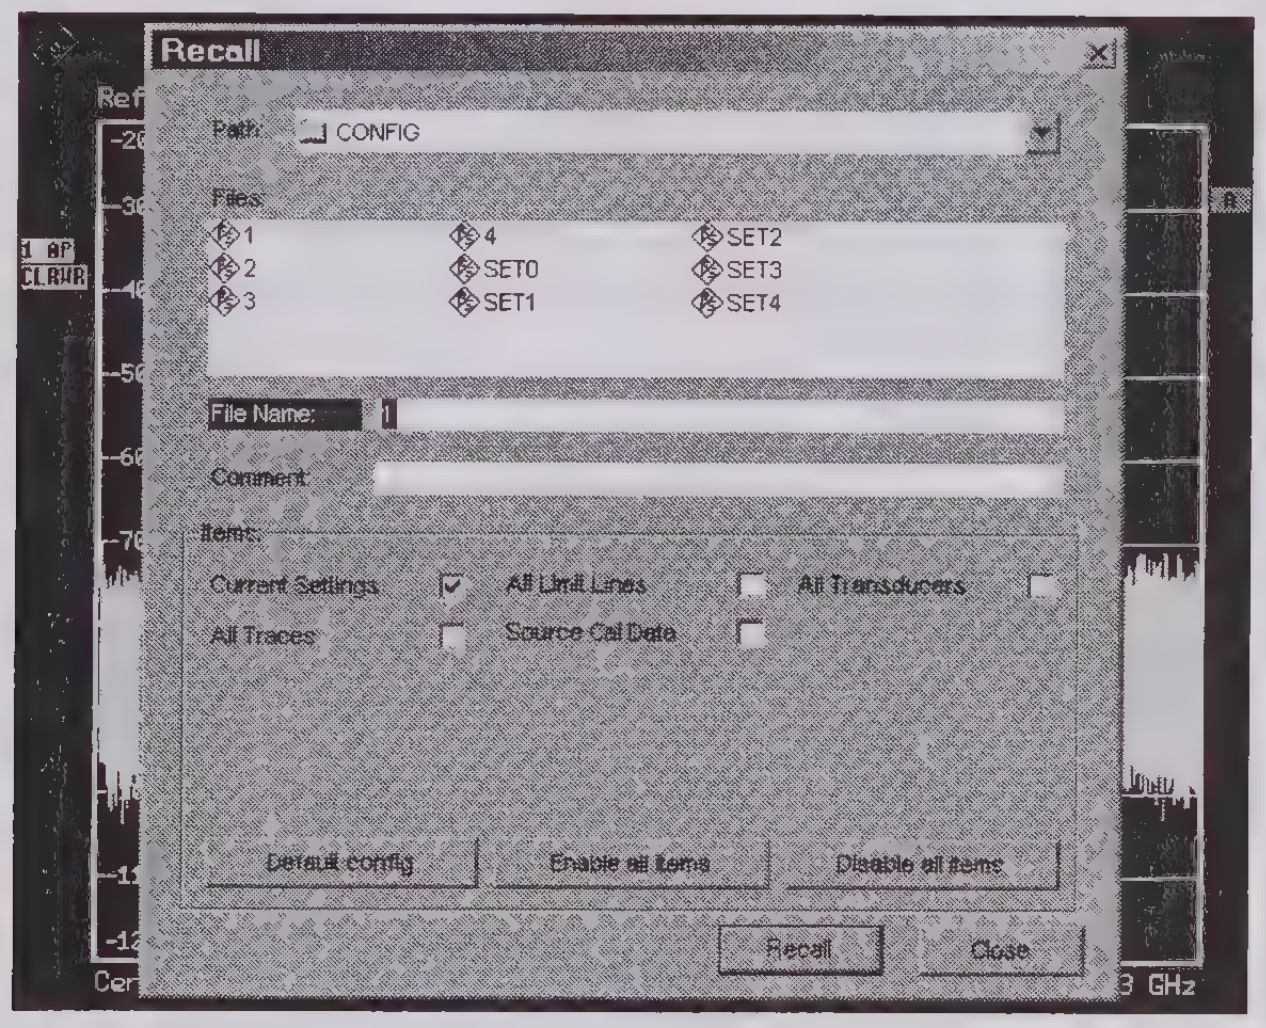
Recall

Path: CONFIG

Files:
1
2
3
4
SET0
SET1
SET2
SET3
SET4

File Name: 1

Comment:

Items:
Current Settings ☑
All Limit Lines ☐
All Transducers ☐
All Traces ☐
Source Cal Data ☐

The *RECALL* table shows the current settings regarding the data set:

Path	Directory in which the data set is stored.
Files	List of stored data sets
File Name	Name of data set. The name can be entered with or without drive name and directory. The drive name and directory will then appear in the Path field. A potential extension of the file name is ignored.
Comment	Comment regarding data set.

IEC/IEEE command: `MMEM:LOAD:STAT 1,"a:\test02"`

EDIT PATH

The *EDIT PATH* softkey activates the entry of a path name for the device configuration to be stored/to be loaded:

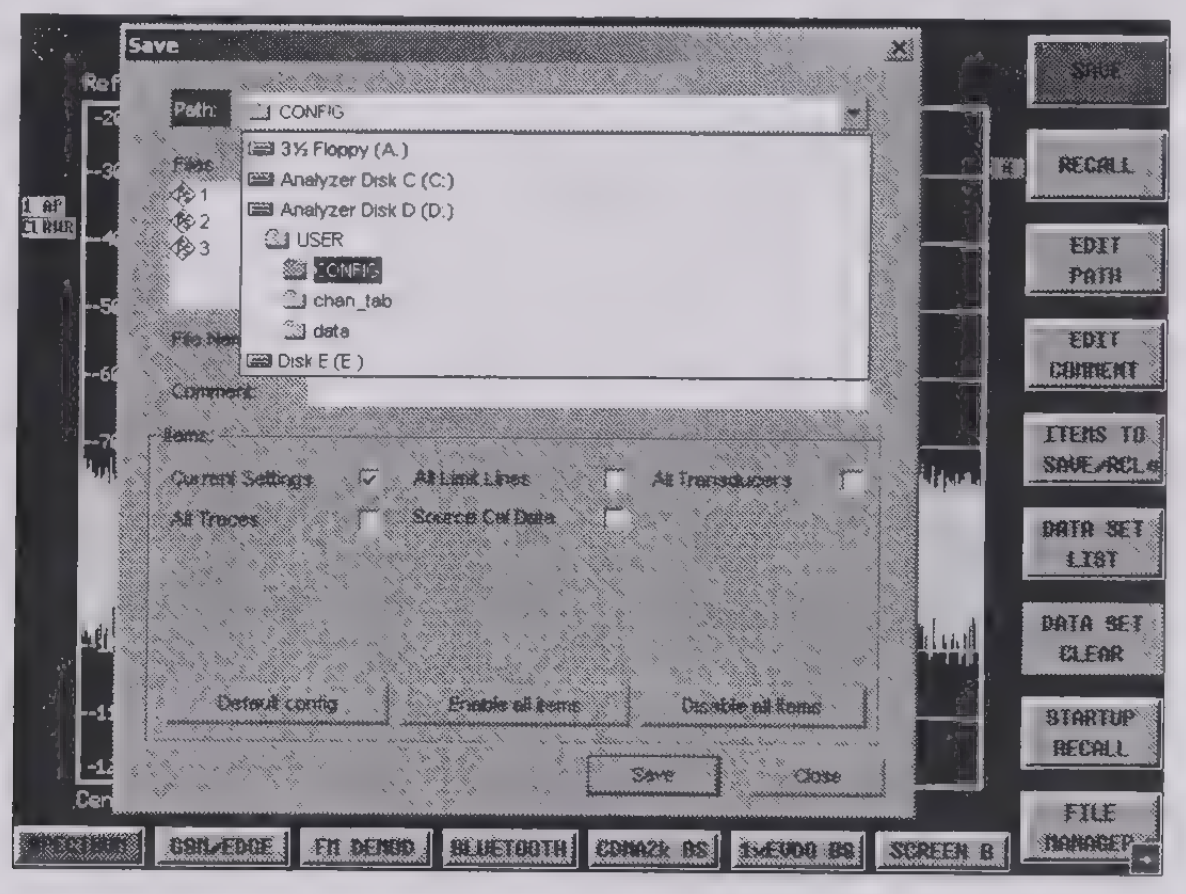

Path: CONFIG

- 3½ Floppy (A:)
- Analyzer Disk C (C:)
- Analyzer Disk D (D:)
  - USER
    - CONFIG
    - chan_tab
    - data
- Disk E (E:)

Current Settings ☑ All Limit Lines ☐ All Transducers ☐

All Traces ☐ Source Cal Data ☐

The desired directory is selected with the spinwheel or the *CURSOR UP / DOWN* key and is confirmed by pressing the spinwheel or the *ENTER* key.

Subdirectories are opened by the *CURSOR RIGHT* ⇨ key and closed with the *CURSOR LEFT* ⇦ key.

IEC/IEEE-bus command –

EDIT COMMENT

The *EDIT COMMENT* softkey activates the entry of commentary concerning the current data set. The help line editor is opened with *CURSOR DOWN*. A total of 60 characters are available for this purpose.

> **Note:**
> *For further information on how to enter the comment text via the front panel of the unit, see the section* ""Entering Text using the Help Line Editor".

IEC/IEEE command: `MMEM:COMM "Setup fuer GSM Messung"`

The *SEL ITEMS TO SAVE/RCL* softkey opens a submenu for selecting the data subsets.

FILE - ITEMS TO SAVE/RCL submenu:



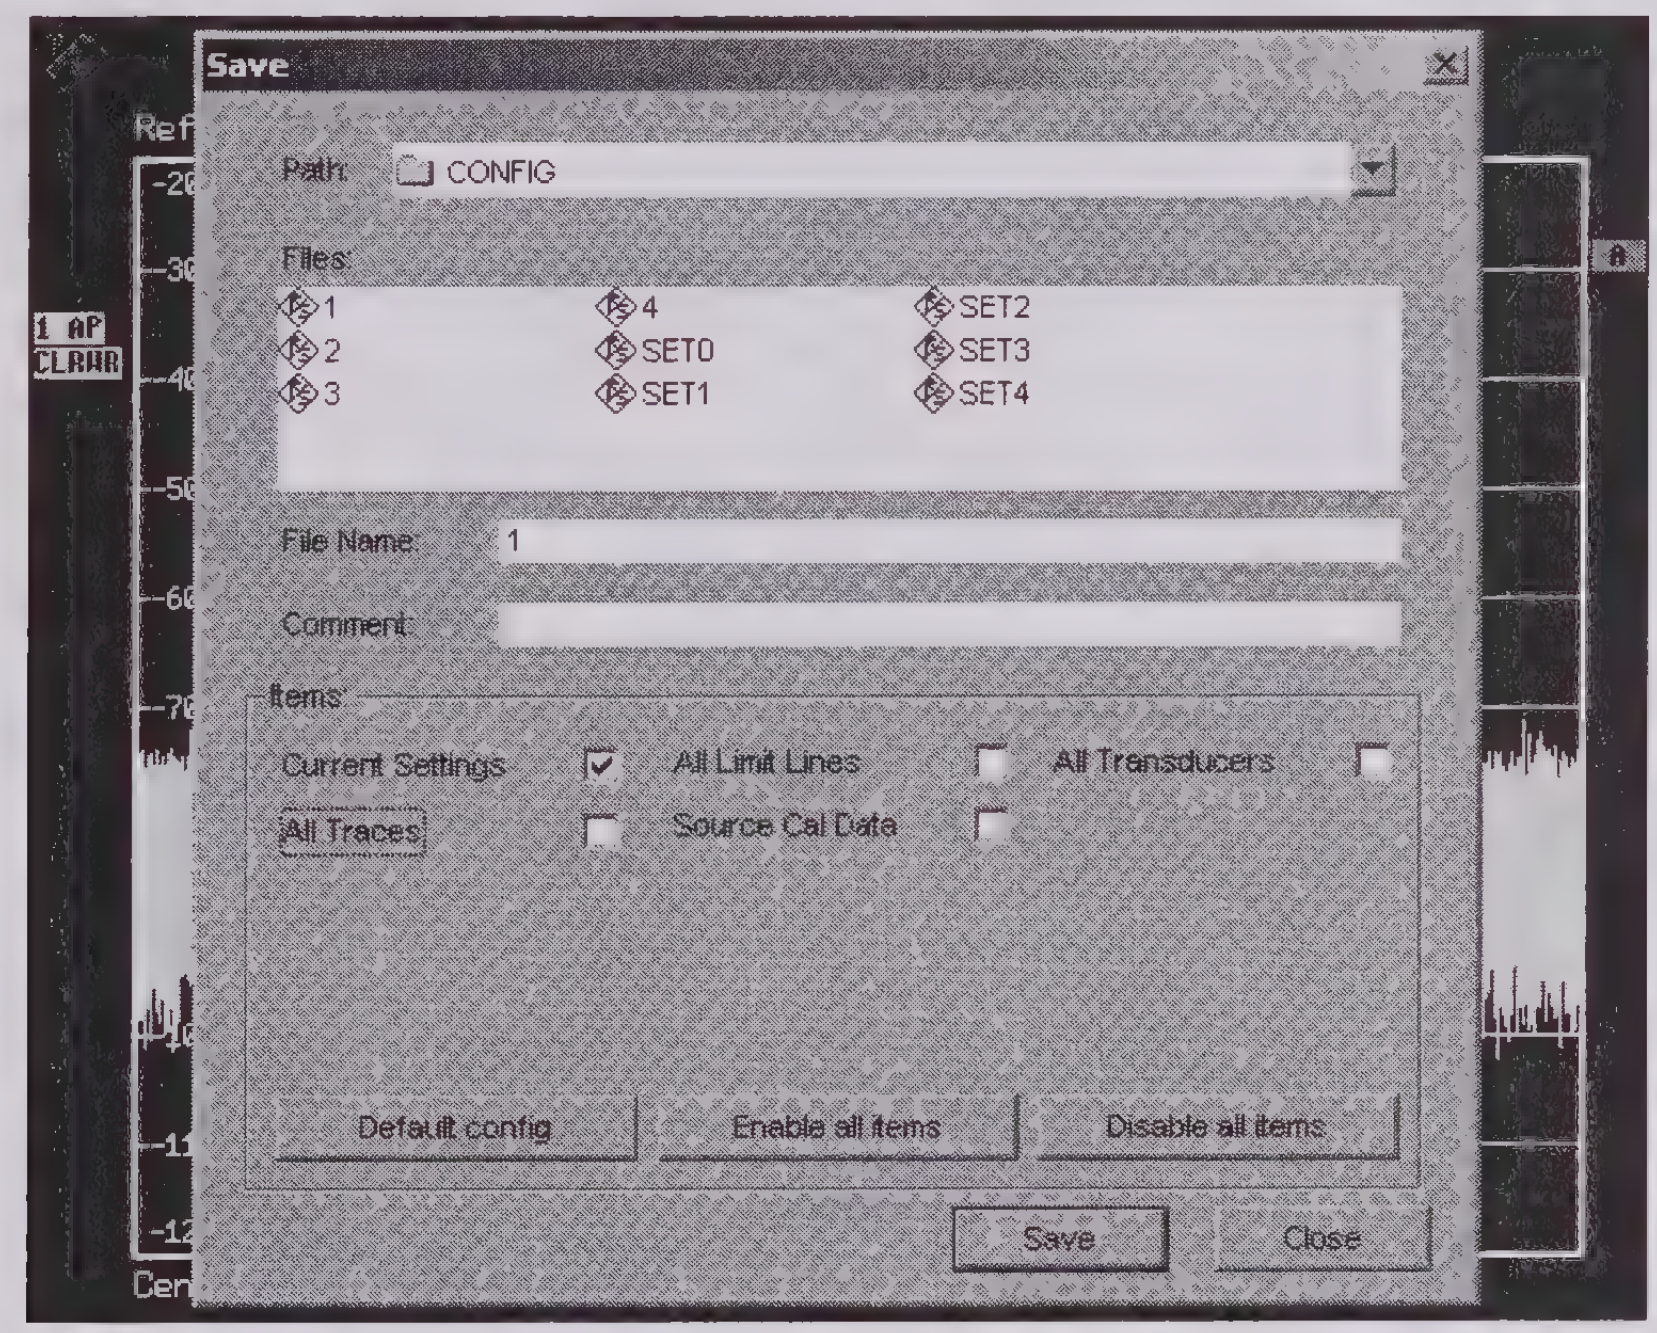

Path: CONFIG

Files:
1, 2, 3, 4, SET0, SET1, SET2, SET3, SET4

File Name: 1

Comment:

Items:
- Current Settings ☑
- All Limit Lines ☐
- All Transducers ☐
- All Traces ☐
- Source Cal Data ☐

The Dialog *SaveL* table offers the following selectable data subsets in the *Items* field:

Current Settings	These settings include: • current configuration of general instrument parameters • current measurement hardware settings • active limit lines: A data set may contain maximum 8 limit lines for each window. It always contain the activated limit lines and the de-activated limit lines used last, if any. Consequently, the combination of the restored de-activated limit lines depends on the sequence of use with command `MMEM:LOAD`. • the activated transducer factor • user-defined colour settings • configuration for hardcopy output • settings of tracking generator (only with option tracking generator) • settings of tracking generator (only with option)
All Limit Lines	all limit lines
All Transducer	all transducer factors
All Traces	all traces which are not blanked
Source Cal Data	correction data for tracking generator (only with options B9 / B10)

SELECT ITEMS

The *SELECT ITEMS* softkey moves the selection bar to the first line, left column of the *Items* field. An entry is selected. Position the entry focus to the corresponding partial data set using the cursor keys and then press the *ENTER* key in the desired line. The selection is cleared by pressing the key again.

IEC/IEEE command:
Current Settings: `MMEM:SEL:HWS ON`
All Limit Lines: `MMEM:SEL:LIN:ALL ON`
All Traces: `MMEM:SEL:TRAC ON`
Source Cal Data: `MMEM:SEL:SCD ON`

ENABLE ALL ITEMS

The *ENABLE ALL ITEMS* softkey marks all partial data sets.

IEC/IEEE command: `MMEM:SEL:ALL`

ENABLE ALL ITEMS

The *ENABLE ALL ITEMS* softkey marks all partial data sets.

IEC/IEEE-bus command `MMEM:SEL:ALL`

DEFAULT CONFIG

The *DEFAULT CONFIG* softkey establishes the default selection of the data subset to be saved and outputs *DEFAULT* in the *ITEMS* field of the *SAVE/RECALL DATA SET* table.

IEC/IEEE command: `MMEM:SEL:DEF`

DATA SET LIST

The *DATA SET LIST* softkey sets the entry focus to the list *Files* of all available data sets. In addition, the *DATA SET CLEAR* softkey are displayed.

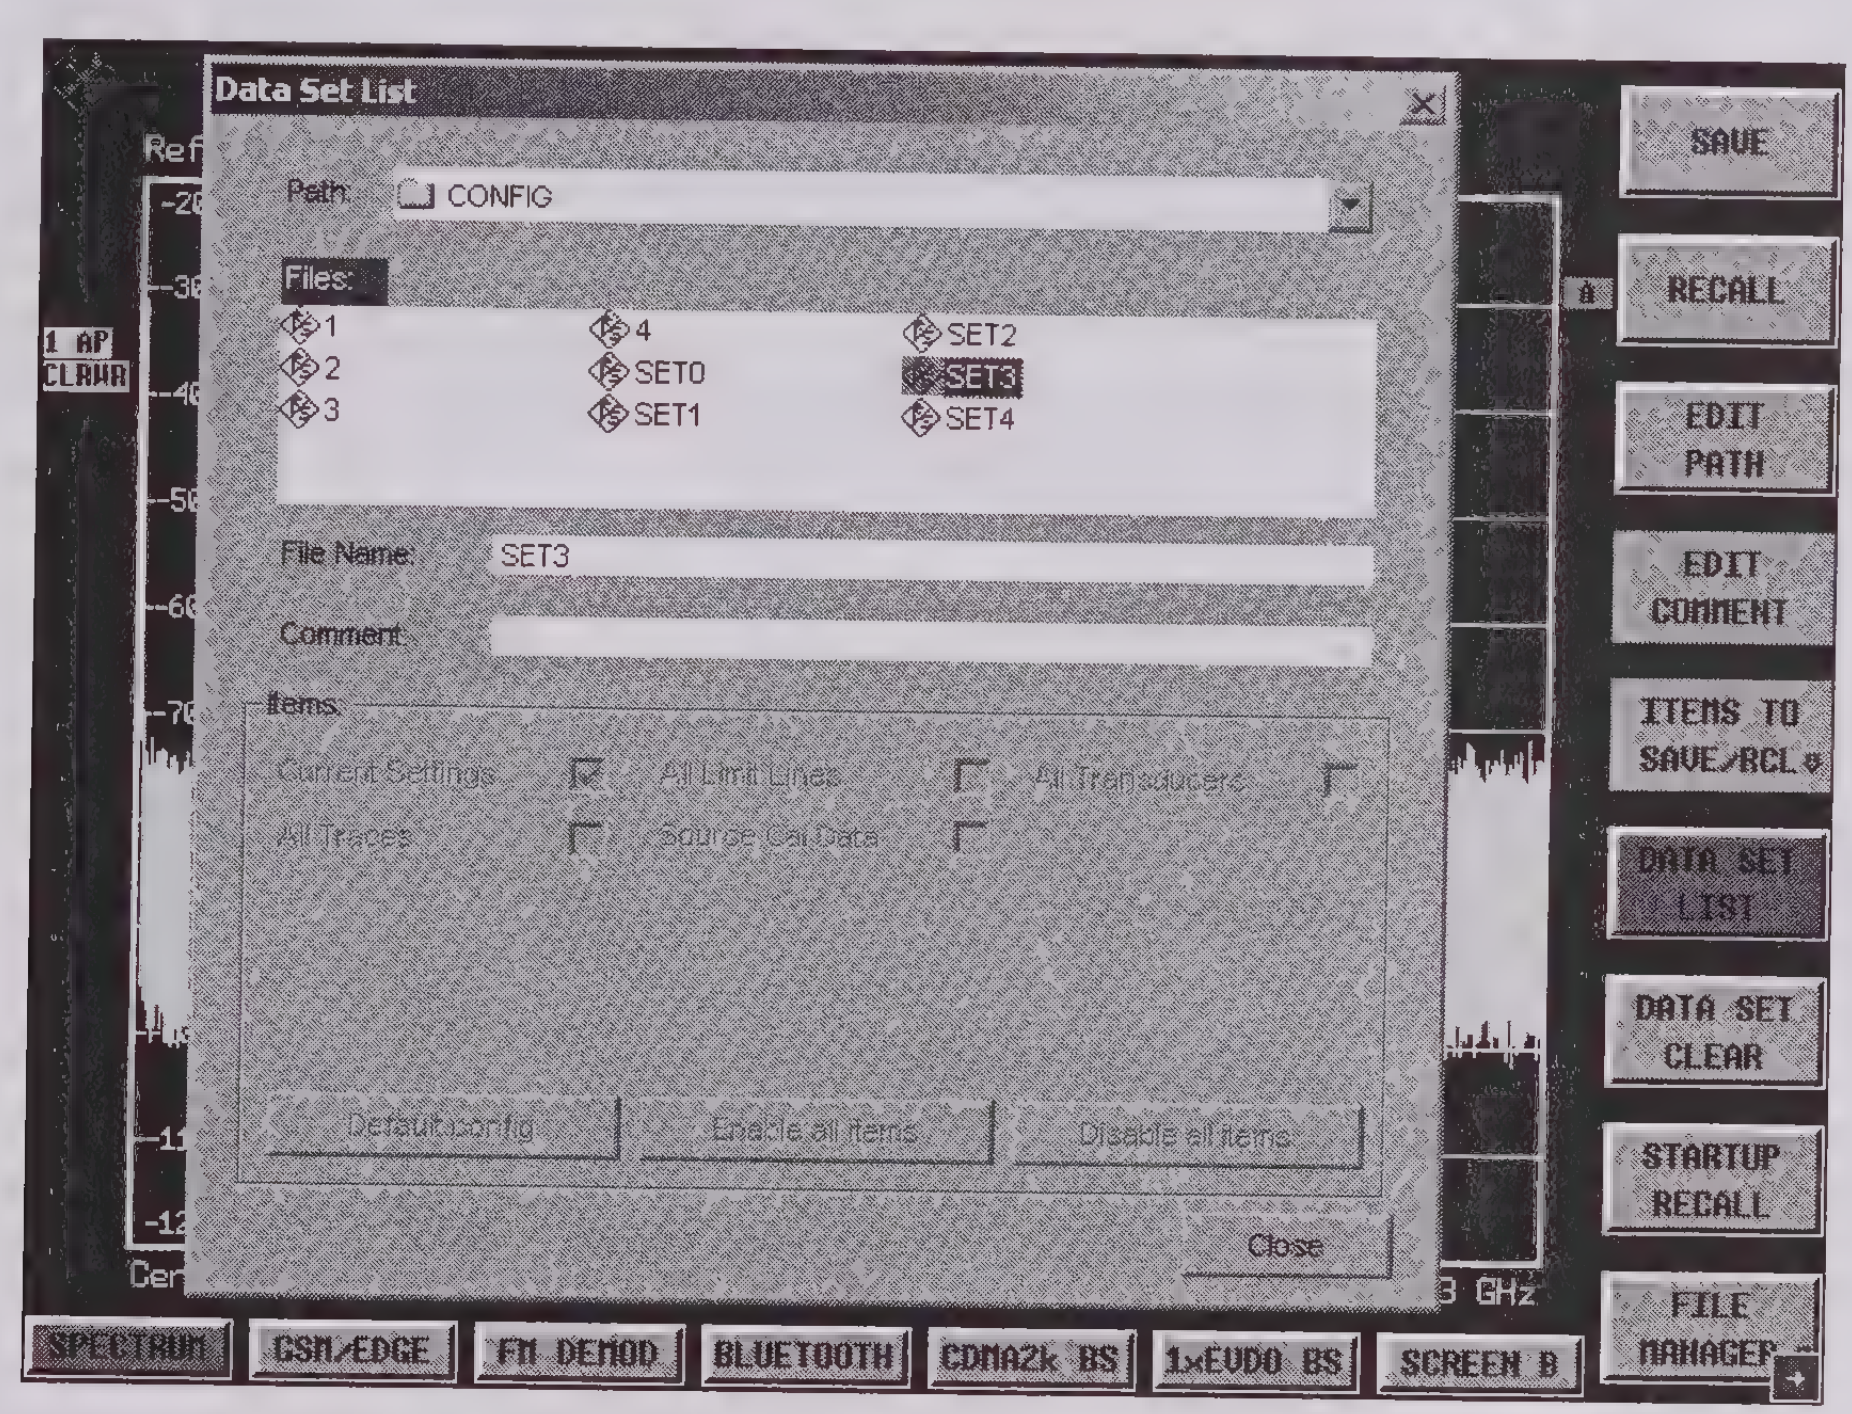

Path: CONFIG

Files: 1, 2, 3, 4, SET0, SET1, SET2, SET3, SET4

File Name: SET3

Comment:

Items:

Current Settings ☑ All Limit Lines ☐ All Transducers ☐

All Traces ☐ Source Cal Data ☐

The list *Files* lists all data sets which are stored in the selected directory.

The *Comment* and *Items* fields in the *DATA SET CONTENTS* column indicate the saved data subsets and the comment for the currently selected data set.

IEC/IEEE command: ---

DATA SET CLEAR

The *DATA SET CLEAR* softkey deletes the selected data set

IEC/IEEE command: `MMEM:CLE:STAT 1, "test03"`

STARTUP RECALL

The *STARTUP RECALL* softkey activates the selection of a data set which is automatically loaded when the instrument is powered on and after *PRESET*. For this purpose the Dialog *Startup Recall* is opened (analogously to *DATA SET LIST).*

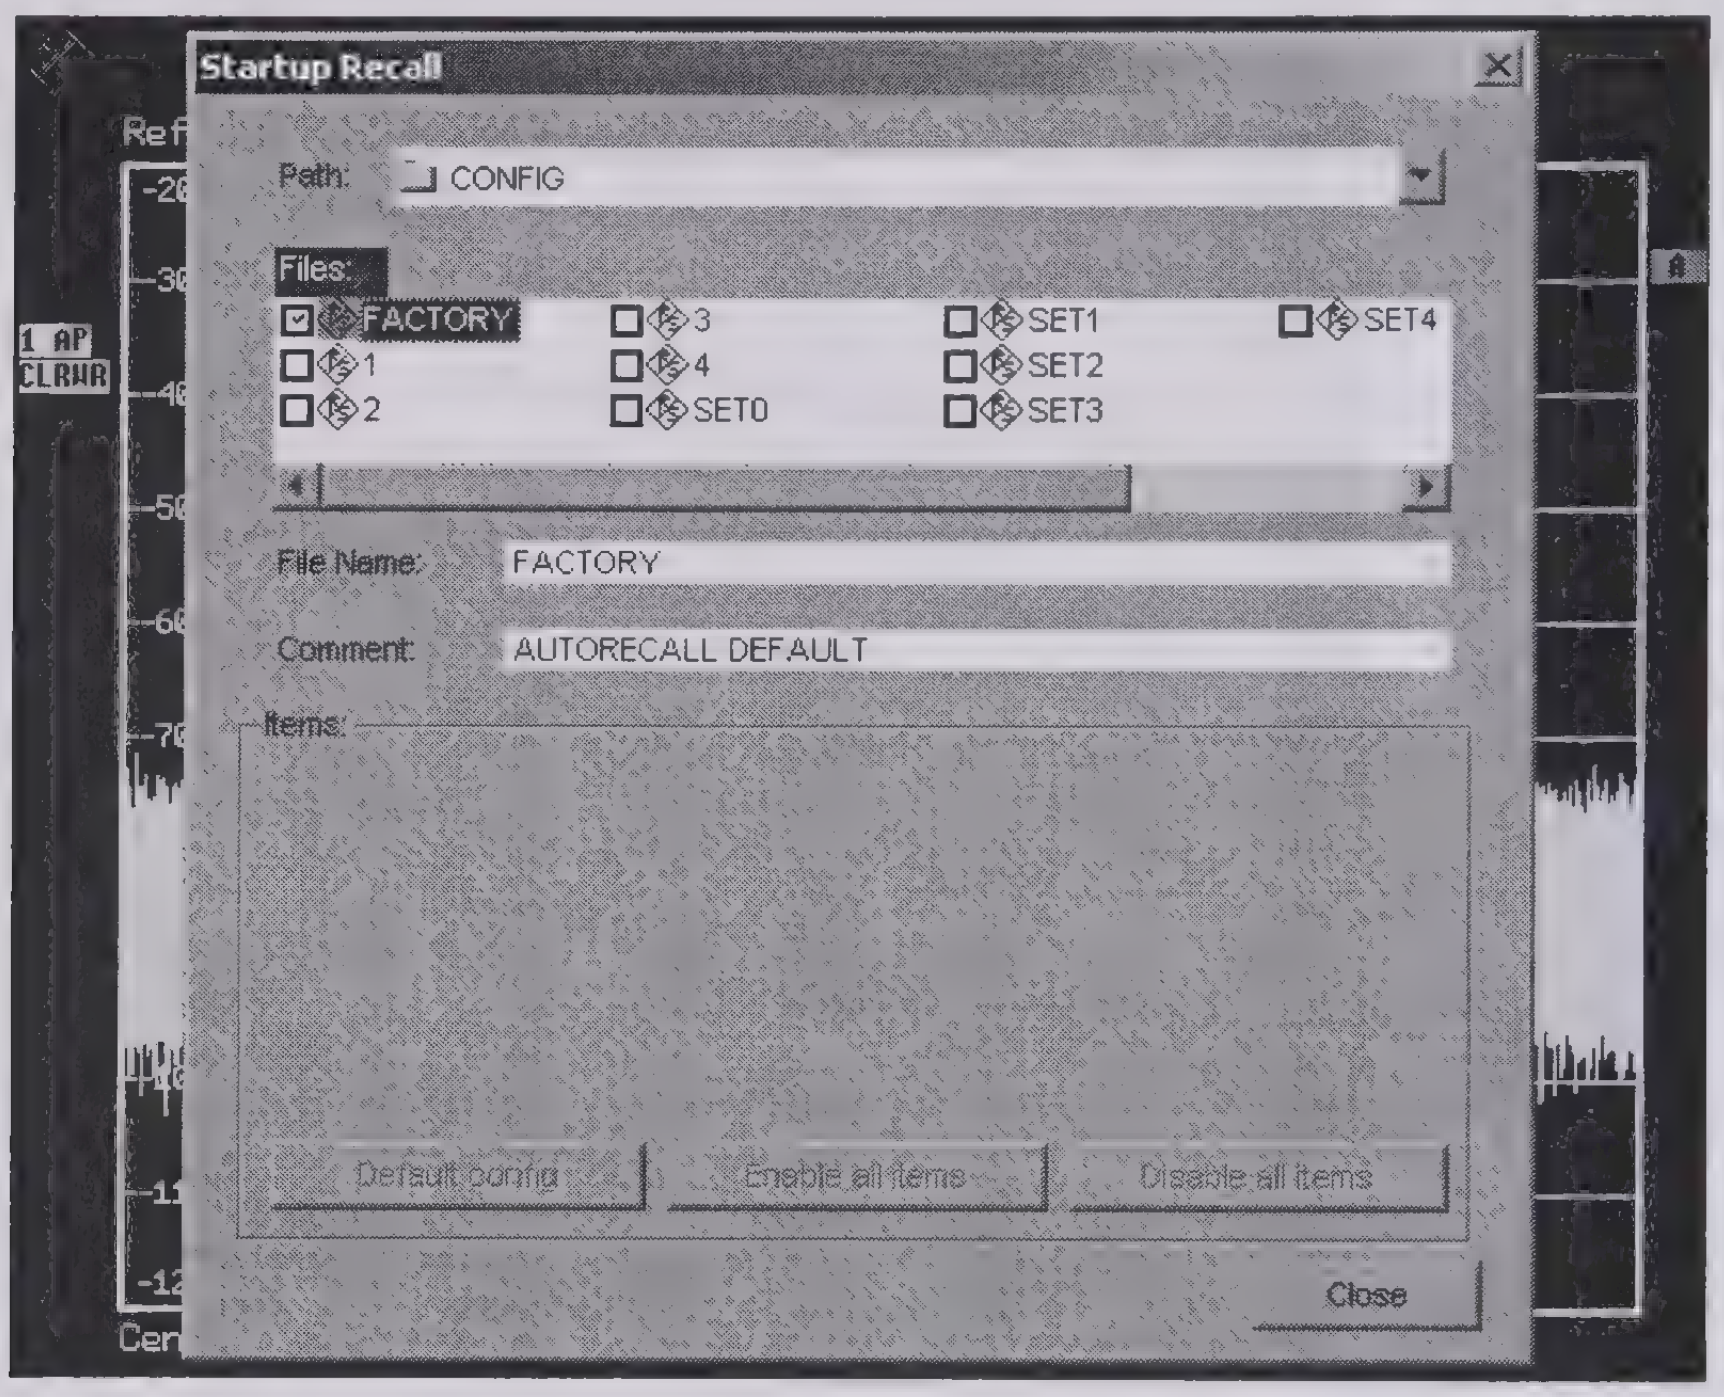
Startup Recall

Path: CONFIG

Files:

☑ FACTORY	☐ 3	☐ SET1	☐ SET4
☐ 1	☐ 4	☐ SET2	
☐ 2	☐ SET0	☐ SET3	

File Name: FACTORY

Comment: AUTORECALL DEFAULT

The field *Files* lists all data sets stored in the selected directory. The currently selected data set is checked.
In addition to the data sets stored by the user, the data set *FACTORY*, which specifies the settings of the instrument before it was last switched off (Standby), is always present (when unit is delivered).

To select a data set, the entry focus is set to the corresponding entry by means of the spinwheel and the data set is activated by pressing the spinwheel or the *ENTER* key.

If a data set other than *FACTORY* is chosen, this data set will be loaded when the unit is switched on or after pressing the *PRESET* key. Any settings can be assigned to the *PRESET* key.

IEC/IEEE command: `MMEM:LOAD:AUTO 1,"D:\user\config\test02"`

Operating Concept of File Managers

The *FILE MANAGER* softkey opens a menu for managing storage media and files.

FILE - FILE MANAGER submenu:

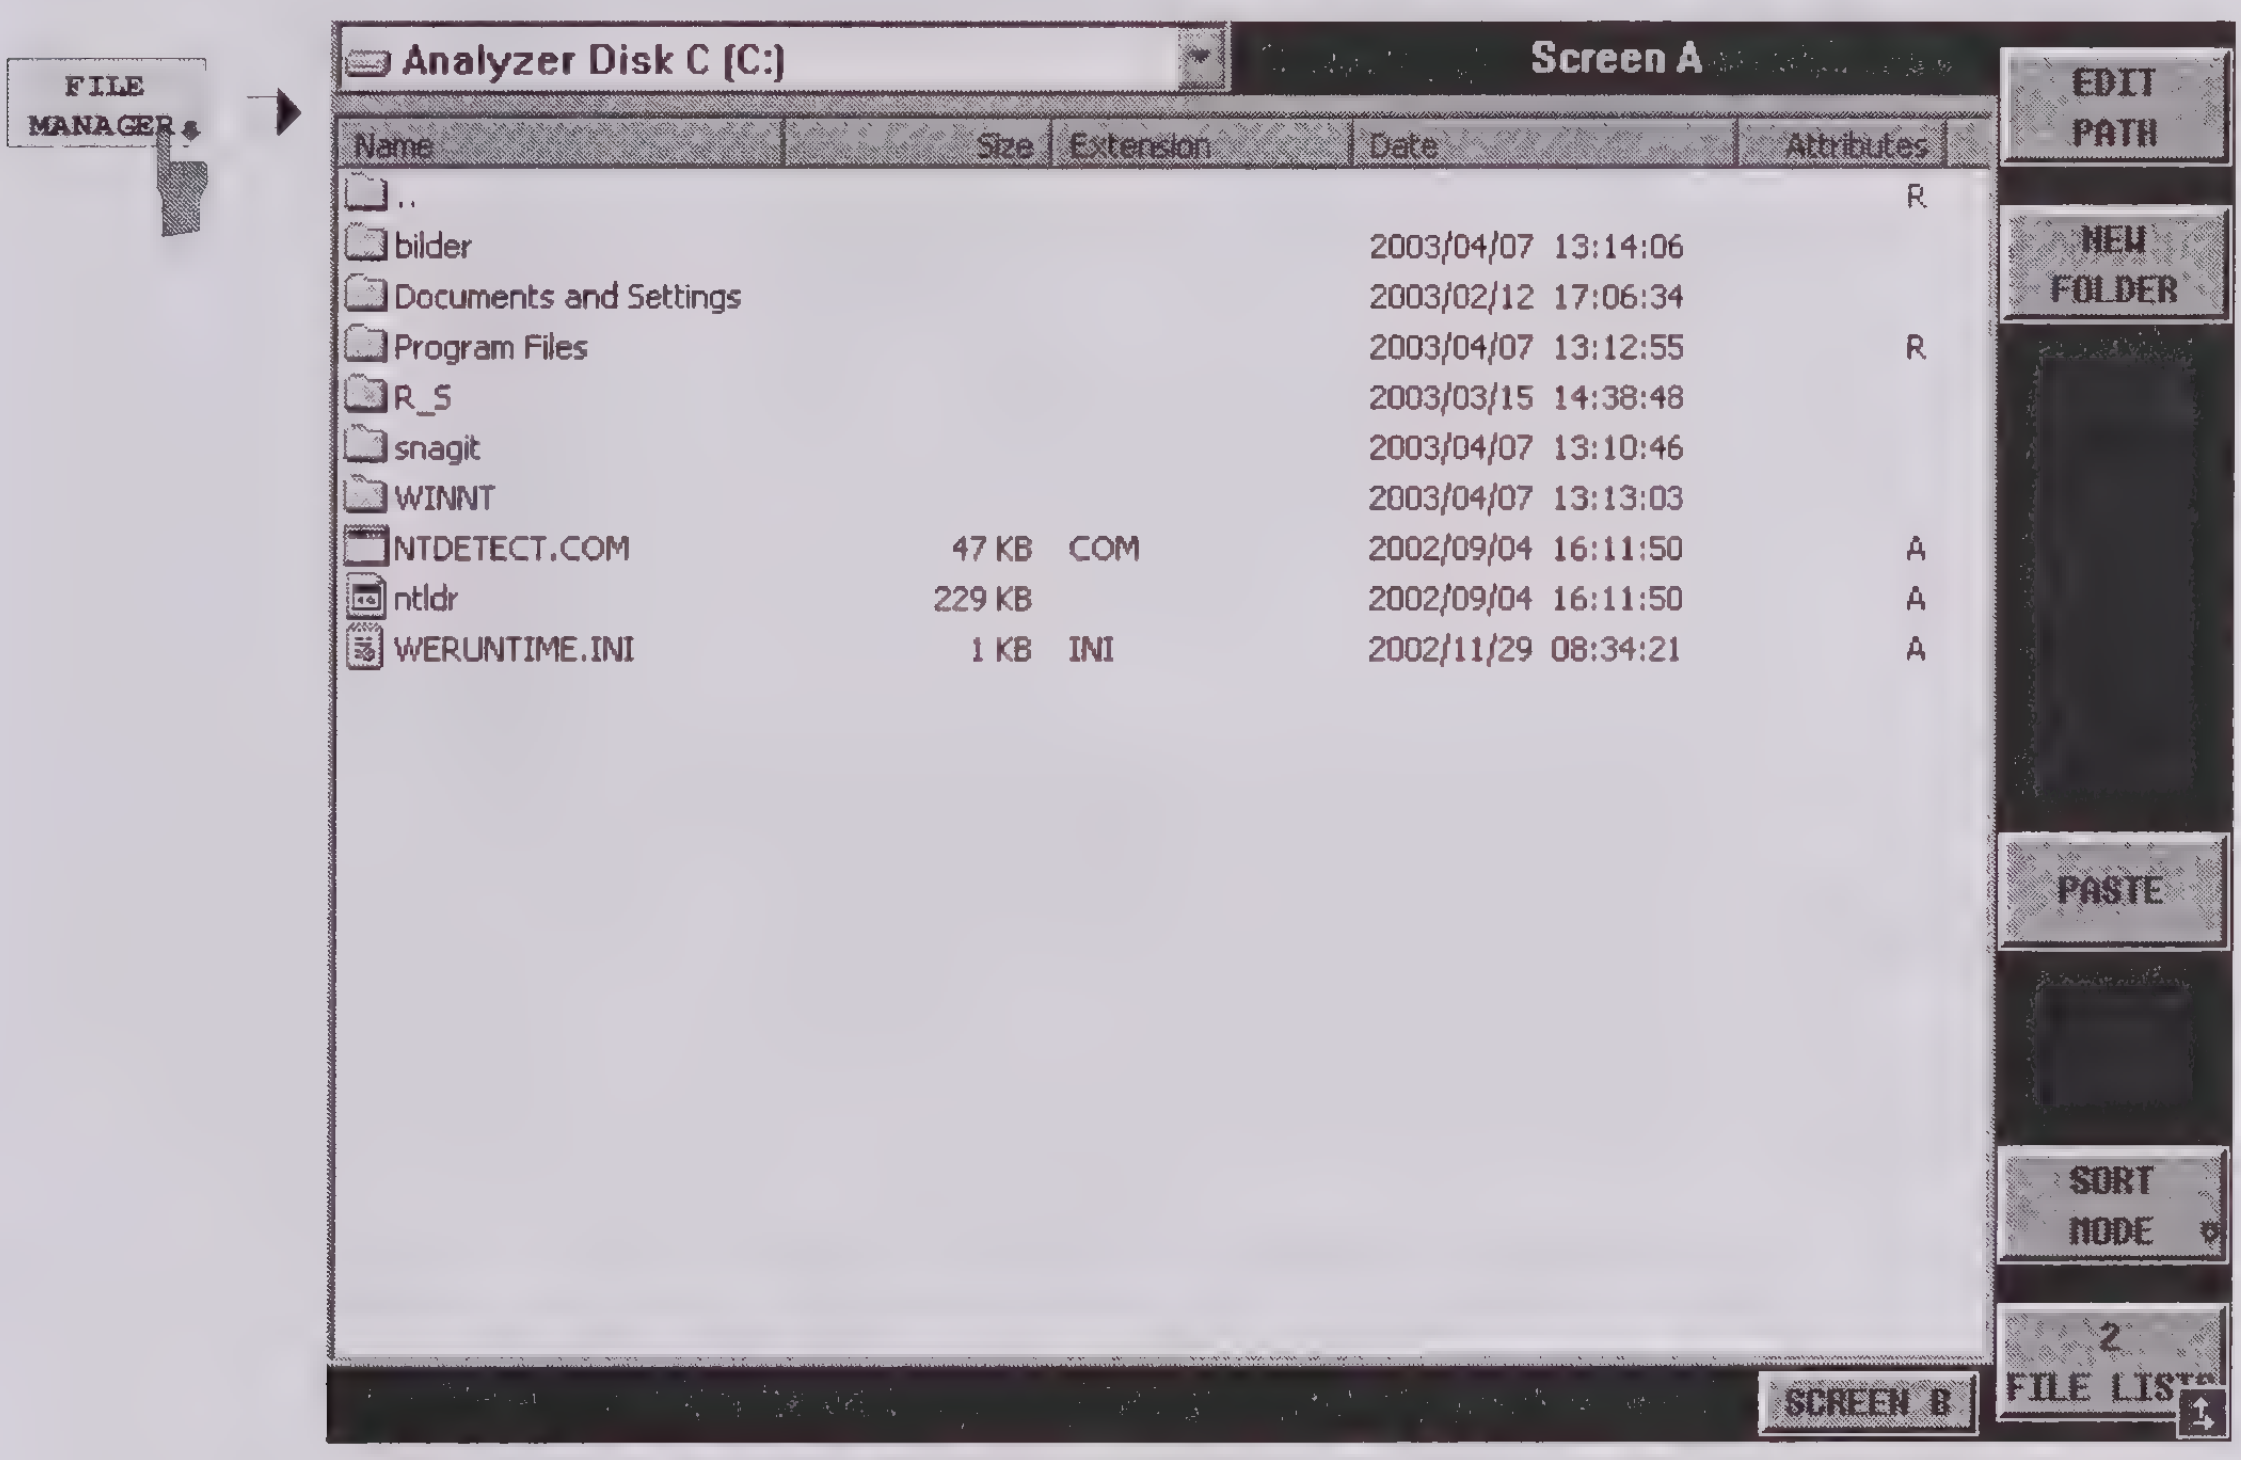

Name	Size	Extension	Date	Attributes
..				R
bilder			2003/04/07 13:14:06	
Documents and Settings			2003/02/12 17:06:34	
Program Files			2003/04/07 13:12:55	R
R_S			2003/03/15 14:38:48	
snagit			2003/04/07 13:10:46	
WINNT			2003/04/07 13:13:03	
NTDETECT.COM	47 KB	COM	2002/09/04 16:11:50	A
ntldr	229 KB		2002/09/04 16:11:50	A
WERUNTIME.INI	1 KB	INI	2002/11/29 08:34:21	A

The designation and the letter of the current drive are displayed in the upper left corner of the File Manager dialog.

The table below shows the files of the current directory and potential subdirectories.

A file or a directory in the table is selected via cursor keys. The *ENTER* key is used to switch from one subdirectory to another.
The softkeys *COPY, RENAME, CUT and DELETE* are only visible if the entry focus is set to a file and not to a directory.

The dots ".." open up the next higher directory.

EDIT PATH

The *EDIT PATH* softkey activates the input of the directory which will be used in subsequent file operations.

The new path is included in the *FILE MANAGEMENT* table.

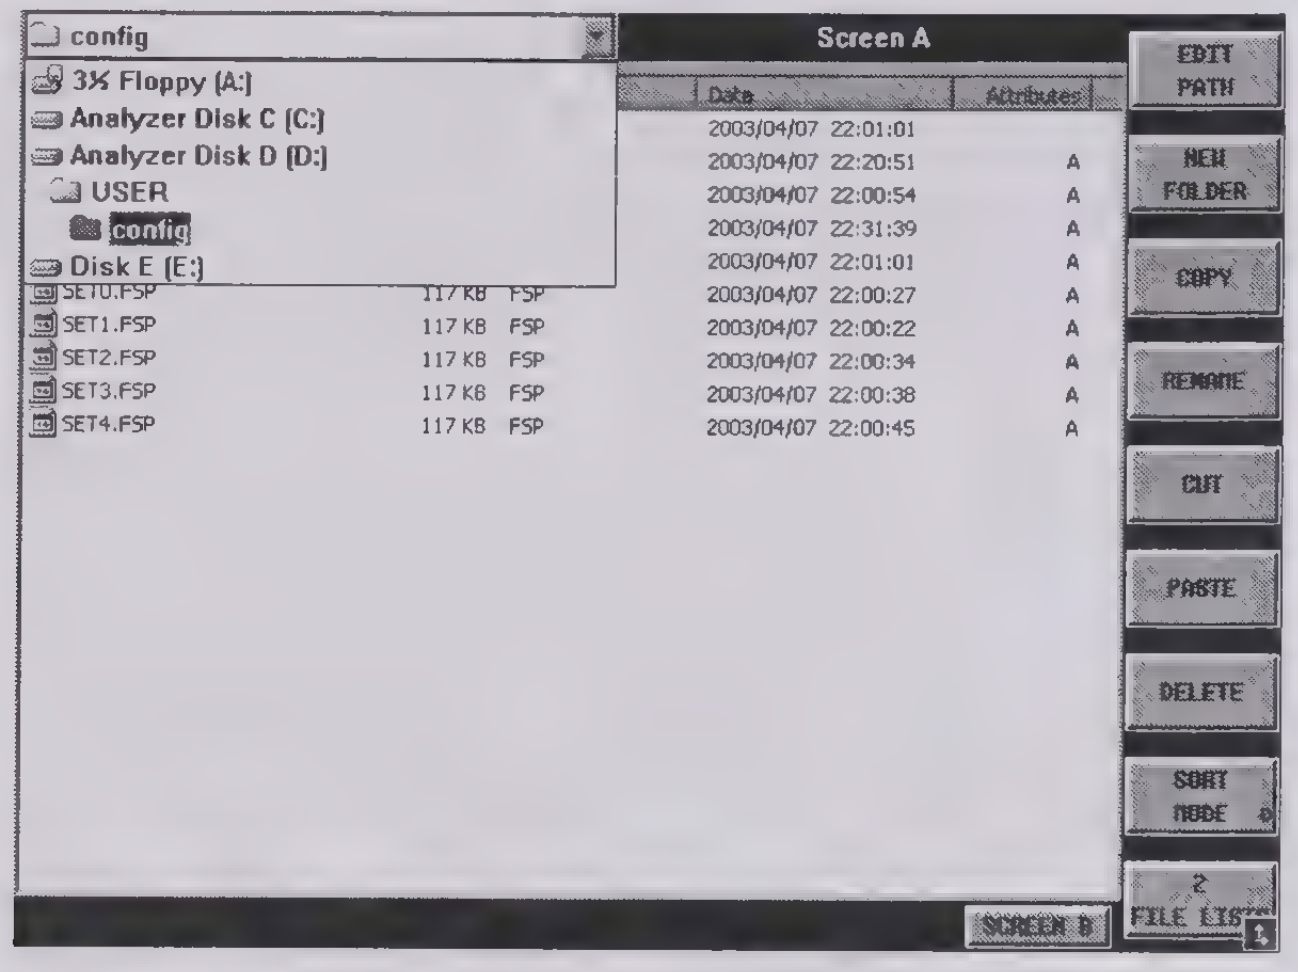

```
config
3½ Floppy (A:)
Analyzer Disk C (C:)
Analyzer Disk D (D:)
  USER
    config
Disk E (E:)
                                 Date                 Attributes
                                 2003/04/07  22:01:01
                                 2003/04/07  22:20:51     A
                                 2003/04/07  22:00:54     A
                                 2003/04/07  22:31:39     A
                                 2003/04/07  22:01:01     A
SET0.FSP       117 KB   FSP      2003/04/07  22:00:27     A
SET1.FSP       117 KB   FSP      2003/04/07  22:00:22     A
SET2.FSP       117 KB   FSP      2003/04/07  22:00:34     A
SET3.FSP       117 KB   FSP      2003/04/07  22:00:38     A
SET4.FSP       117 KB   FSP      2003/04/07  22:00:45     A
```

Use *CURSOR UP / DOWN* to select a drive and confirm your selection with *ENTER*.
Open subdirectories by using *CURSOR RIGHT*, and use *CURSOR LEFT* to close them again.
When you have found the subdirectory you looked for, mark it with *ENTER*.

IEC/IEEE command: `MMEM:MSIS "a:"`
`MMEM:CDIR "D:\user "`

NEW FOLDER

The *NEW FOLDER* softkey creates subdirectories.

The entry of an absolute path name (e.g. "\USER\MEAS") as well as the path relative to the current directory (e.g. "..\MEAS") is possible.

IEC/IEEE command: `MMEM:MDIR "D:\user\test"`

COPY

The *COPY* softkey opens the help line editor to enter the target directory for a copying process. The file is also copied into the clipboard and can be copied into a different directory at a later time by means of *PASTE*.

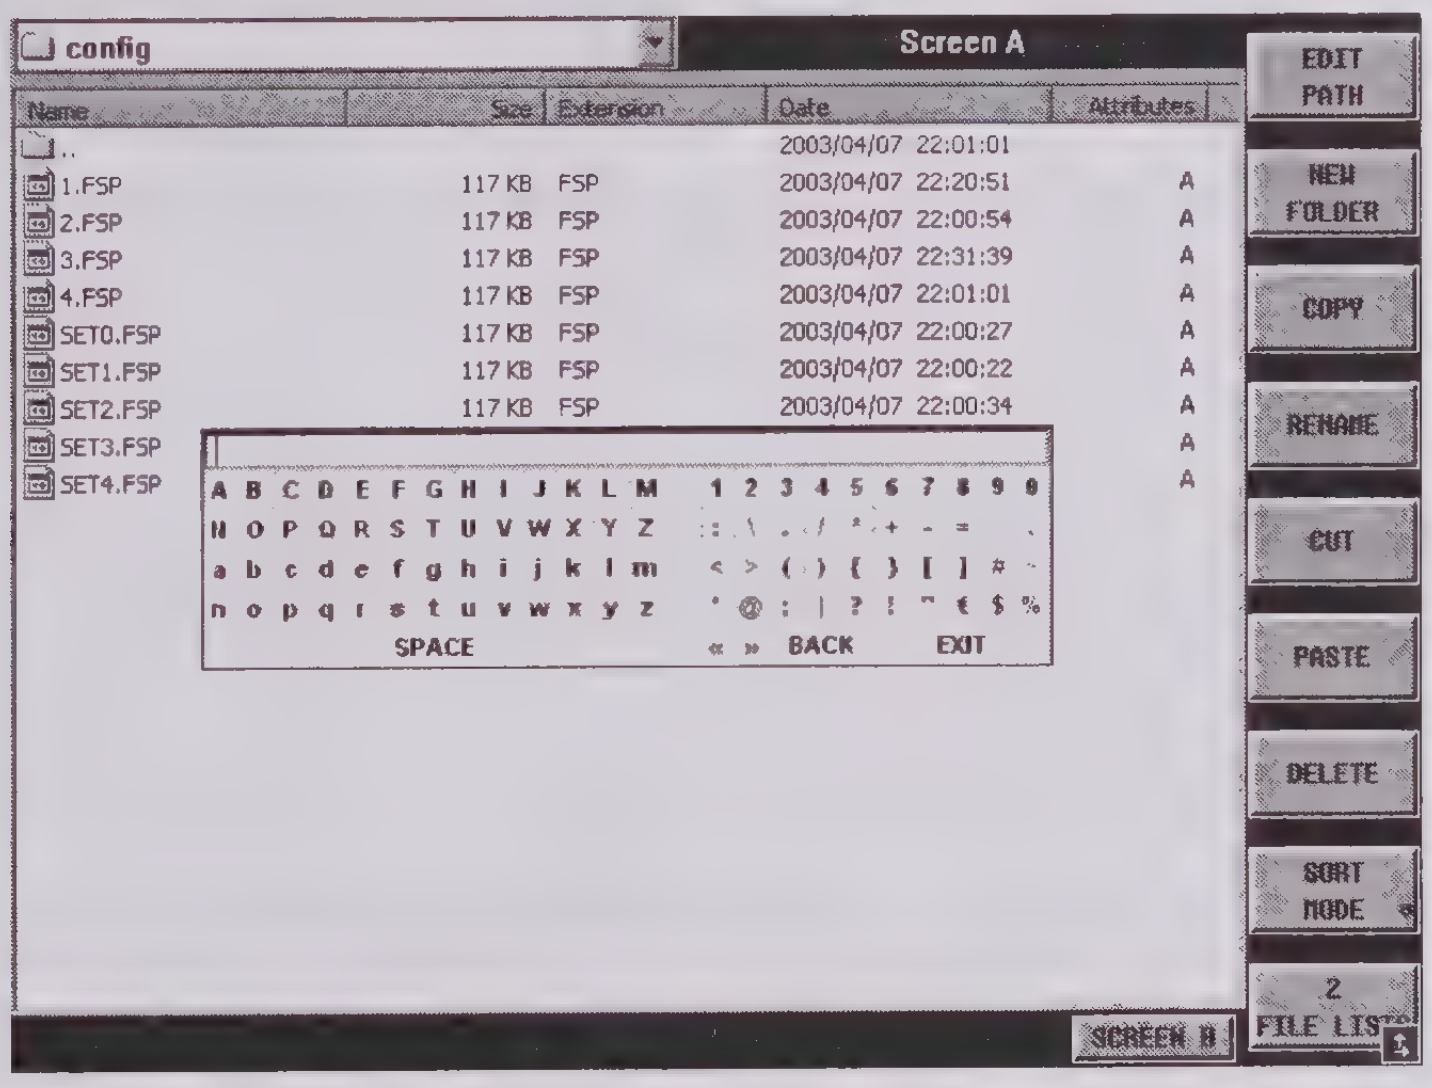

config

Name	Size	Extension	Date	Attributes
..			2003/04/07 22:01:01	
1.FSP	117 KB	FSP	2003/04/07 22:20:51	A
2.FSP	117 KB	FSP	2003/04/07 22:00:54	A
3.FSP	117 KB	FSP	2003/04/07 22:31:39	A
4.FSP	117 KB	FSP	2003/04/07 22:01:01	A
SET0.FSP	117 KB	FSP	2003/04/07 22:00:27	A
SET1.FSP	117 KB	FSP	2003/04/07 22:00:22	A
SET2.FSP	117 KB	FSP	2003/04/07 22:00:34	A
SET3.FSP				A
SET4.FSP				A

Screen A
A B C D E F G H I J K L M 1 2 3 4 5 6 7 8 9 0
N O P Q R S T U V W X Y Z
a b c d e f g h i j k l m
n o p q r s t u v w x y z
SPACE
« » BACK EXIT
EDIT PATH
NEW FOLDER
COPY
RENAME
CUT
PASTE
DELETE
SORT MODE
2 FILE LISTS
SCREEN B

Files can also be copied to a different storage medium by indicating a certain drive letter (e.g. D:). The selected files or directories will be copied after terminating the entry with the ENTER key.

IEC/IEEE-bus command `MMEM:COPY "D:\user\set.cfg","a:"`

RENAME

The *RENAME* softkey opens the help line editor to rename a file or a directory (analogously to the *COPY* softkey).

IEC/IEEE command: `MMEM:MOVE "test02.cfg","set2.cfg"`

CUT

The *CUT* softkey shifts the selected file into the clipboard from where it can be copied into a different directory at a later time by means of *PASTE*.

Note:
The file in the output directory will only be deleted if the *PASTE* softkey has been pressed.

IEC/IEEE-bus command –

PASTE

The *PASTE* softkey copies files from the clipboard to the current directory. The directory is changed by means of the cursor keys and subsequent pressing of *ENTER* or via the *EDIT PATH* softkey.

IEC/IEEE-bus command –

DELETE

The *DELETE* softkey deletes the selected file.
A confirmation query is displayed to avoid unintentional deletion of files.

IEC/IEEE-bus command

```
MMEM:DEL "test01.hcp"
MMEM:RDIR "D:\user\test"
```

SORT MODE

The *SORT MODE* softkey opens the submenu to select the sorting mode for the displayed files.

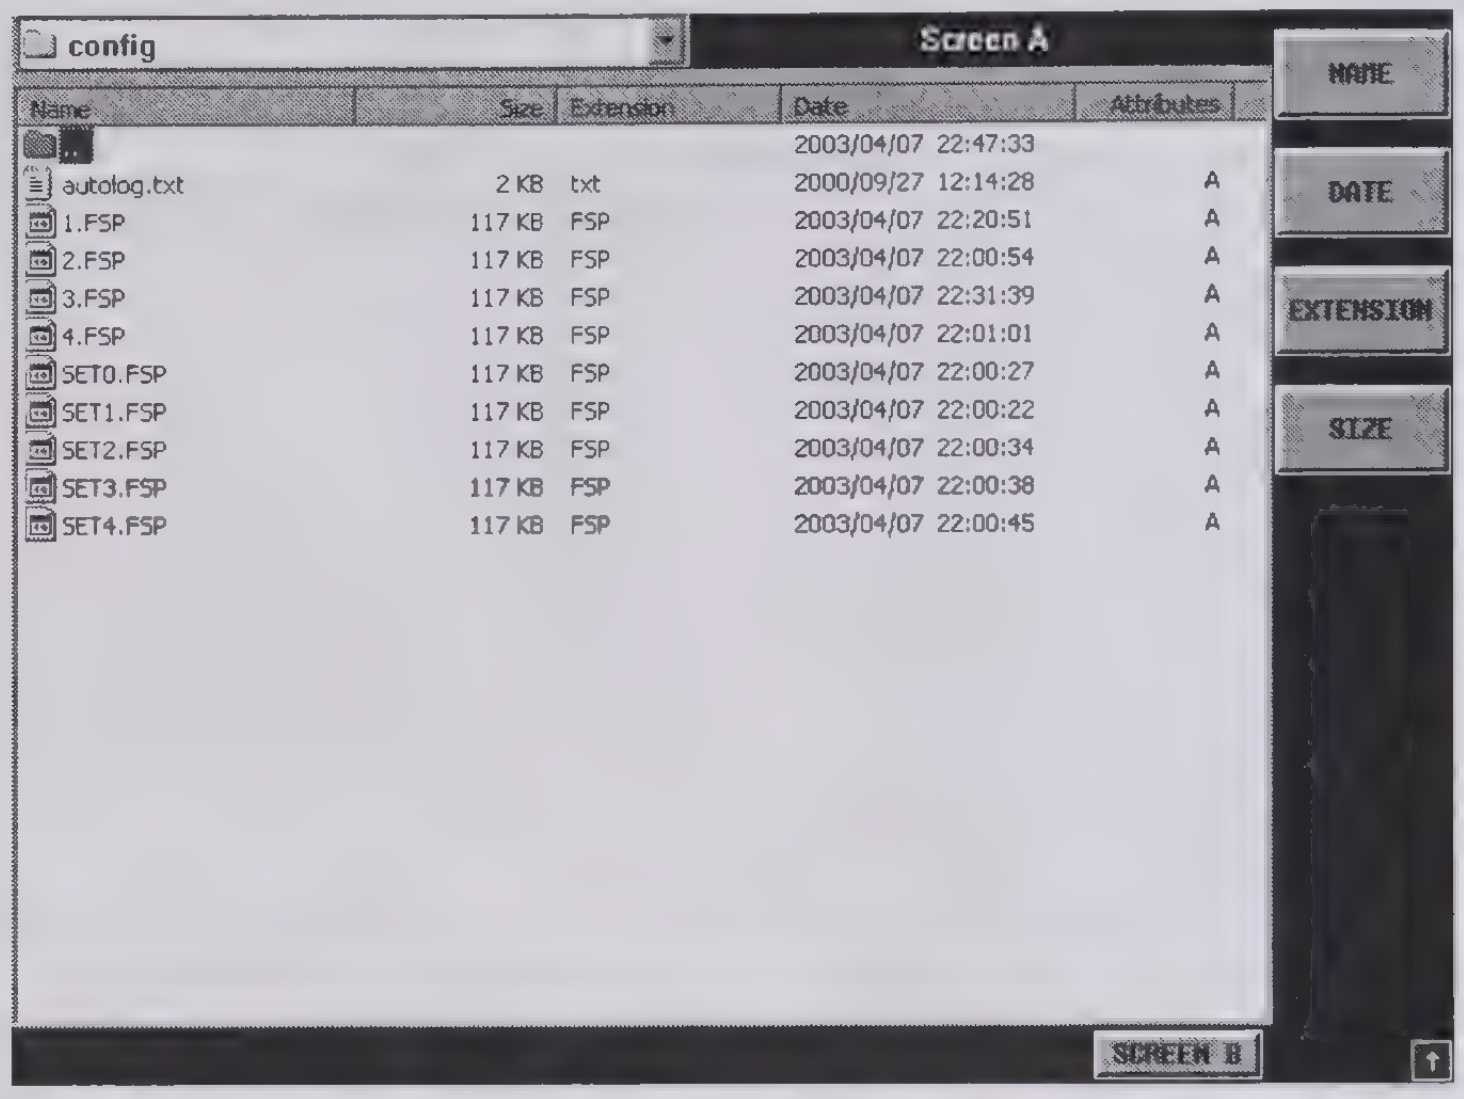

Name	Size	Extension	Date	Attributes
..			2003/04/07 22:47:33	
autolog.txt	2 KB	txt	2000/09/27 12:14:28	A
1.FSP	117 KB	FSP	2003/04/07 22:20:51	A
2.FSP	117 KB	FSP	2003/04/07 22:00:54	A
3.FSP	117 KB	FSP	2003/04/07 22:31:39	A
4.FSP	117 KB	FSP	2003/04/07 22:01:01	A
SET0.FSP	117 KB	FSP	2003/04/07 22:00:27	A
SET1.FSP	117 KB	FSP	2003/04/07 22:00:22	A
SET2.FSP	117 KB	FSP	2003/04/07 22:00:34	A
SET3.FSP	117 KB	FSP	2003/04/07 22:00:38	A
SET4.FSP	117 KB	FSP	2003/04/07 22:00:45	A

Directory names are located at the top of the list after the entry for the next higher directory level ("..").

IEC/IEEE command: --

2
FILE LISTS

The *2 FILE LISTS* softkey opens a second window for the File Manager. The entry focus can be moved between the two windows by means of hotkeys *SCREEN A* and *SCREEN B.*
Files can thus very easily be copied and shifted from one directory to the other.

Note:
The second file list can also be opened in the Full Screen mode via hotkey *SCREEN B or SCREEN A.*

IEC/IEEE-bus command –

FILE - NEXT menu:

ASCII FILE EXPORT

The *ASCII FILE EXPORT* softkey stores the active trace in ASCII format to a disk.

IEC/IEEE-bus command: `FORM ASC;`
`MMEM:STOR:TRAC 1,'TRACE.DAT'`

The file consists of a header, which contains important scaling parameters, and a data section, which contains the trace data.

The file header data comes in three columns separated by semicolons (;).
It has the following contents:
parameter name; numerical value; default unit

The data section starts with the keyword "Trace <n>", where <n> designates the number of the trace to be stored. This is followed by the measured data in columns separated by semicolons (;).

This format can be read by spreadsheet programs such as MS Excel. A semicolon (;) is to be defined as a separator between the cells of a table.

Note: *Analysis programs may come in different language versions that require different notations of the decimal point. By means of the DECIM SEP softkey, a decimal point (.) or a comma (,) can be selected as decimal-point notation.*

For a detailed description of the ASCII file format, refer to section "Selection and Setting of Traces – TRACE Key", ASCII FILE EXPORT softkey.

DECIM SEP

By means of the *DECIM SEP* softkey, one can select between a decimal point (.) and a comma (,) as decimal-point notation for the ASCII FILE EXPORT function.
Due to the possibility of selecting between different decimal-point notations, different language versions of analysis programs (such as MS Excel) can be supported.

IEC/IEEE-bus command: `FORM:DEXP:DSEP POIN`

FORMAT DISK

The *FORMAT DISK* softkey formats disks located in drive A:.
To prevent accidental destruction of disk data, confirmation by the user is requested.

IEC/IEEE command: `MMEM:INIT "a:"`

Measurement Documentation – *HCOPY* Key

Note: *The installation of additional printers is described together with the INSTALL PRINTER softkey.*

HCOPY menu:

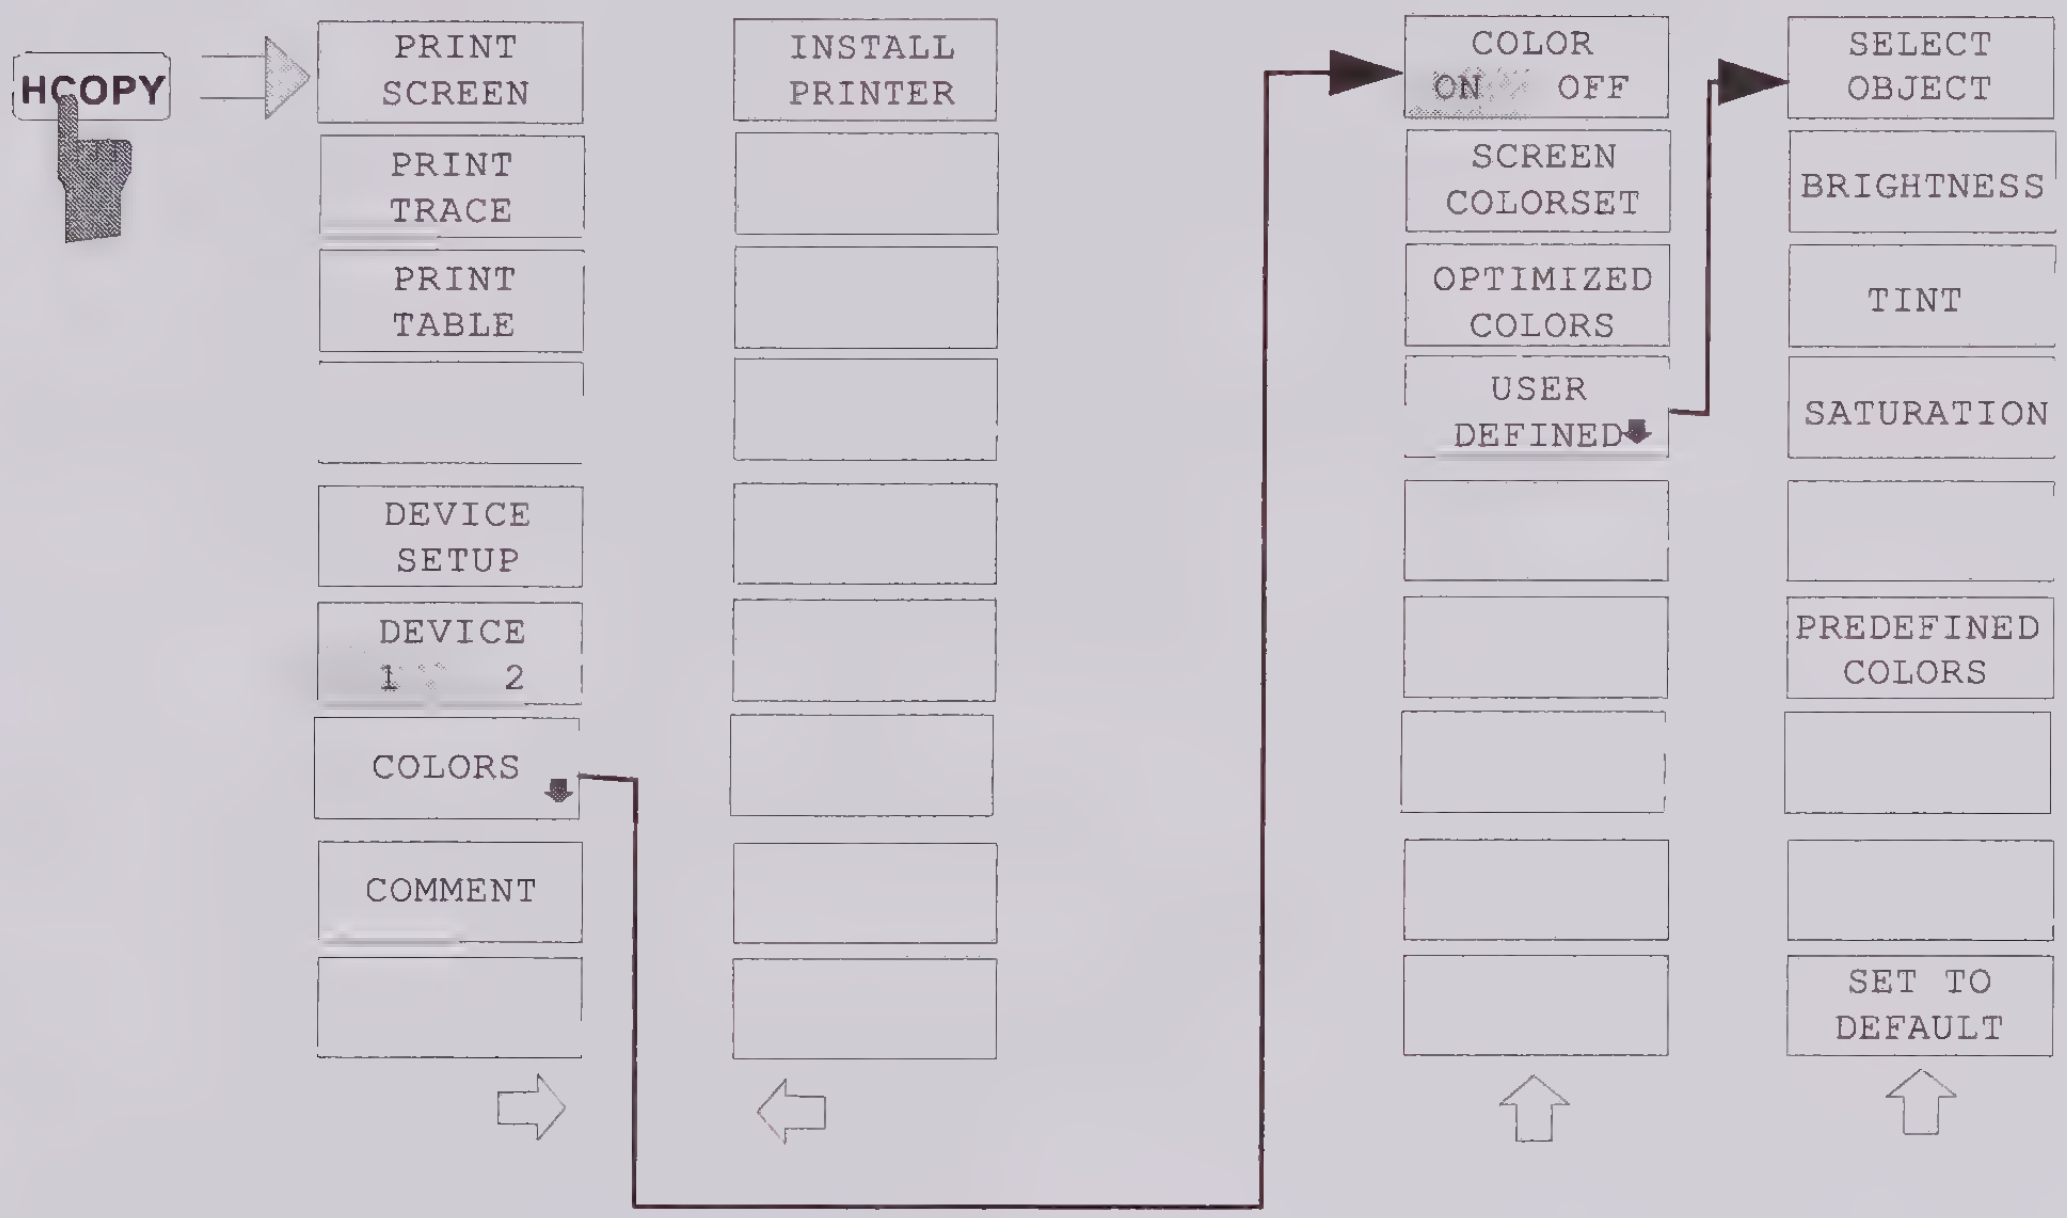

Pressing one of the softkeys *PRINT, SCREEN, PRINT TRACE or PRINT TABL*E in the *HCOPY* menu initiates the print job. The printer parameters defined in the *DEVICE SETTINGS* menu are used for setting up the printer configuration. All of the display items to be printed are written to the printer buffer. Since the printer runs in the background, the instrument may be operated immediately after pressing the *PRINT...* softkey.
With *PRINT SCREEN* selected, all the diagrams with traces and status displays are printed as they occur on the screen. Softkeys, open tables and data entry fields are not printed.

The *PRINT TRACE* function allows individual traces to be printed. With *PRINT TABLE,* tables can be printed.

The DEVICE 1 and 2 softkeys are used for selecting and configuring the output interface.

If the *PRINT TO FILE* option in the *DEVICE SETTINGS* table is selected, the printout is directed to a file. Upon pressing one of the *PRINT...* softkeys, the file name to which the output data is to be written is requested. An entry field is then opened for entering the file name.

The *COLORS* submenu allows switchover between black-and-white and colour printouts (default), provided that the printer connected can produce colour printouts. In addition, the colours are set in this submenu.

• SCREEN	Output in screen colours.
• OPTIMIZED (default)	Instead of light colours, dark colours are used for traces and markers: trace 1 blue, trace 1 black, trace 3 green, markers turquoise.
• USER DEFINED	This option enables the user to change the colours at will. It provides the same setting functions as the *DISPLAY – CONFIG DISPLAY – NEXT* menu.

Notes:
1. *With SCREEN and OPTIMIZED selected, the background will always be white and the grid black. With USER DEFINED, these colours can be selected, too.*
2. *Upon activation of the submenu, the colour display is switched over to the selected printout colours. When the menu is quit, the original colour setting is restored.*

The *COMMENT SCREEN A* and *COMMENT SCREEN B* softkeys allow text to be added to the printout (date and time are inserted automatically).

Use the *INSTALL PRINTER* softkey to install additional printer drivers.

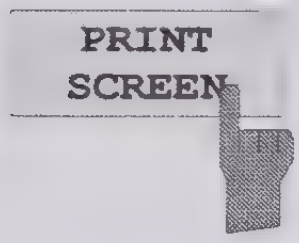

The *PRINT SCREEN* softkey starts the output of test results.

All the diagrams, traces, markers, marker lists, limit lines etc are printed out as long as they are displayed on the screen. All the softkeys, tables and open data entry fields are not printed out. Moreover, comments, title, date, and time are output at the bottom margin of the printout .

IEC/IEEE-bus command:

```
HCOP:ITEM:ALL
HCOP:IMM
```

The *PRINT TRACE* softkey starts the output of all curves visible on the display screen without auxiliary information. Specifically, no markers or display lines are printed.

IEC/IEEE-bus command:

```
HCOP:ITEM:WIND:TRAC:STAT ON
HCOP:IMM
```

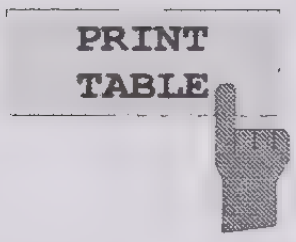

The *PRINT TABLE* softkey starts the output of all tables and info lists visible on the display screen without the measurement diagrams and other information lying behind.

IEC/IEEE-bus command:

```
HCOP:ITEM:WIND:TABL:STAT ON
HCOP:IMM
```

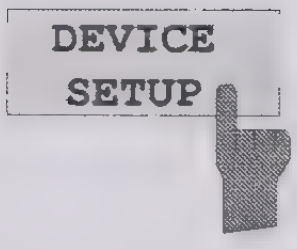

The *DEVICE SETUP* softkey opens the dialog where the file format and the printer can be selected (see section "Selecting Printer, Clipboard and File Formats").

IEC/IEEE-bus commands:

```
HCOP:DEV:LANG GDI;
SYST:COMM:PRIN:ENUM:FIRS?;
SYST:COMM:PRIN:ENUM:NEXT?;
SYST:COMM:PRIN:SEL <Printer>;
HCOP:PAGE:ORI PORT;
HCOP:DEST "SYST:COMM:PRIN";
HCOP:DEST "SYST:COMM:MMEM"
```



The analyzer is able to manage two hardcopy settings independently of each other. They are selected via the *DEVICE 1 / 2* softkey, which displays also the associated setting if the *DEVICE SETUP* dialog is open.

IEC/IEEE-bus command: –

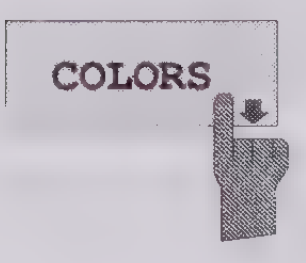

The *COLORS* softkey gives access to the submenu where the colours for the printout can be selected (see section *"Selecting Printer Colours")*.

-

IEC/IEEE-bus command: –

The *COMMENT* softkey opens an entry field in which a comment of two lines (60 characters per line) can be entered for screen A or B.

If the user enters more than 60 characters, the excess characters appear on the second line on the print-out. At any point, a manual line-feed can be forced by entering the @ character.

The comment is printed below the diagram area. The comment text appears on the hardcopy, but not on the display screen.

If a comment should not be printed, it must be cleared.
If the instrument is reset by a click on the PRESET key, all entered comments are cleared.

Note:
The COMMENT softkey opens the auxiliary line editor where the desired letters can be entered in the text field by means of spinwheel and cursor keys.

After clicking the *COMMENT* softkey, the auxiliary line editor can be reached with the ⇩ key. Pressing the spinwheel or the *ENTER* key inserts the selected characters in the text line.

After editing is completed, return to the text line with the ⇧ key and confirm the comment text with *ENTER*.

If the entered comment should be aborted, quit the auxiliary line editor with *ESC*.

Important:
Only after the auxiliary line editor has been closed with *ESC* can the softkeys and hardkeys be operated again.

A detailed description of the auxiliary line editor can be found in section " Entering a Text with the Auxiliary Line Editor ".

IEC/IEEE-bus command: `HCOP:ITEM:WIND2:TEXT 'Comment'`

HCOPY NEXT menu:

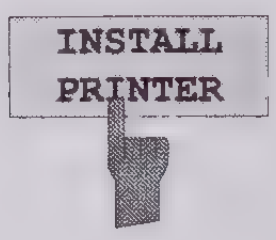

A certain number of printer drivers is already installed on the R&S FSMR.
The *INSTALL PRINTER* softkey opens the *Printers and Faxes* dialog where more printer drivers can be installed.
For details refer to sections "Installation of Plug&Play Printers" and "Installation of Non-Plug&Play Printers".

IEC/IEC-bus command: –

Selecting Printer, Clipboard and File Formats

DEVICE SETUP

The *DEVICE SETUP* softkey opens the selection dialog for file format and printer.

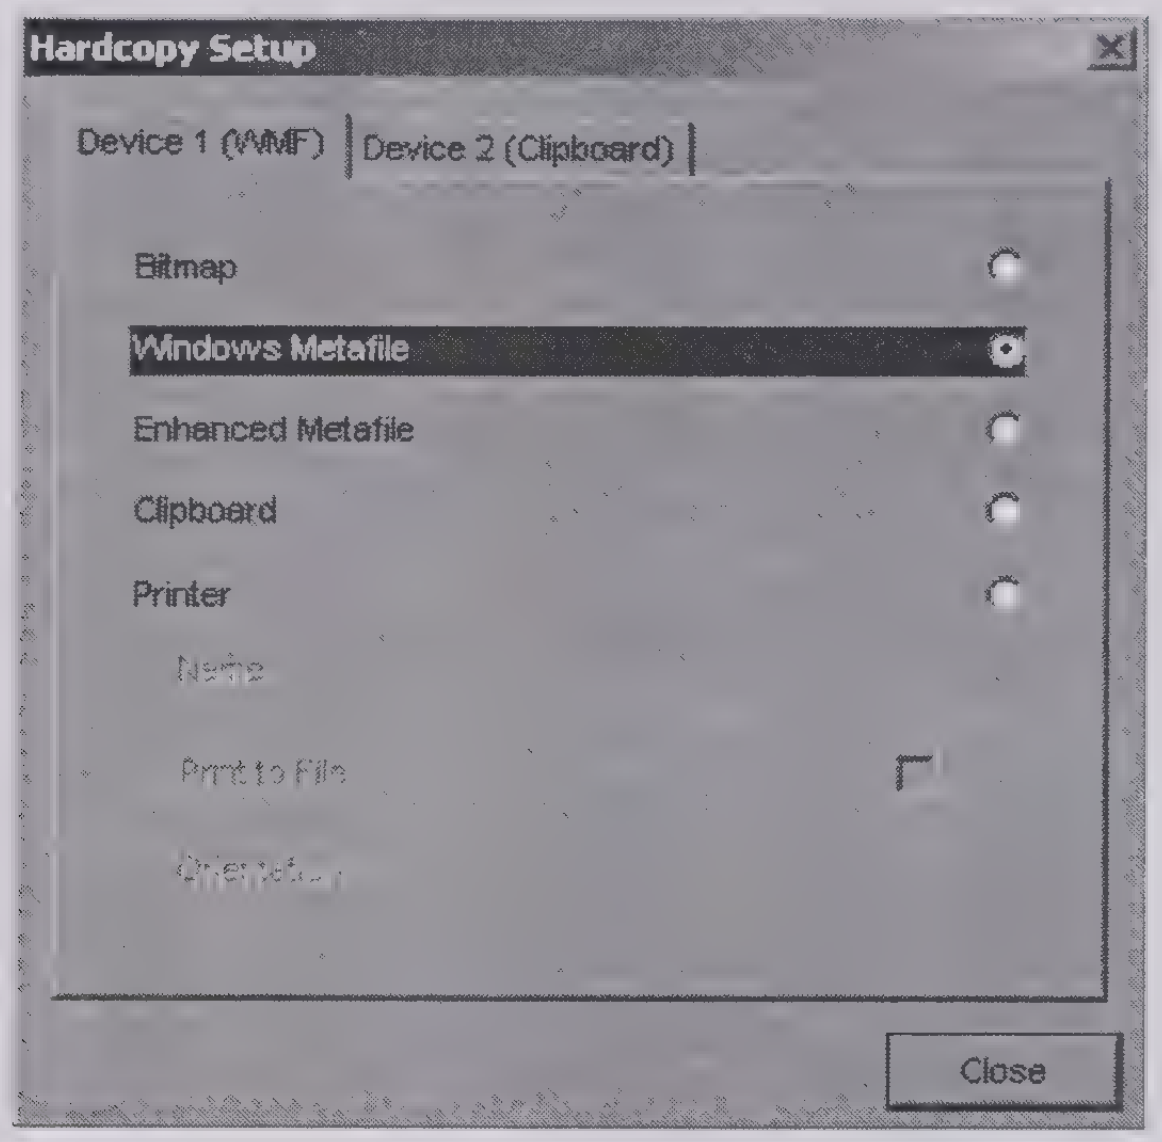

Bitmap ○
Windows Metafile ●
Enhanced Metafile ○
Clipboard ○
Printer ○
Name
Print to File ☐
Orientation...

Navigation in the dialog is possible by turning the spinwheel; selection of an item is confirmed by pressing the spinwheel or the *ENTER* key.

The dialog is closed with ESC (alternatively, the *Close* button can be selected with the spinwheel and the dialog can be closed by pressing the spinwheel or with *ENTER)*.

File formats

A file format is selected by turning the spinwheel and then confirmed by pressing the spinwheel or the *ENTER* key.

The following file formats can be selected:

BITMAP	BMP format (non-compressed)
WINDOWS METAFILE	Vector format, supported as of Windows 3.1
ENHANCED METAFILE	Vector format, supported as of Windows 95/98/ME/NT/XP

When a file format is selected, printing to a file is automatic. The file name is queried when the *PRINT SCREEN, PRINT TRACE* and *PRINT TABLE* softkeys are pressed.

Clipboard

A clipboard is also selected with the spinwheel and then confirmed by pressing the spinwheel or *ENTER* key.

After the *PRINT SCREEN, PRINT TRACE* or *PRINT TABLE* softkey has been pressed, printout is routed to the clipboard. With the aid of the "Process - Insert" function, the information in the clipboard can then be pasted into other programs, e.g. *Paint*, and subsequently processed.

rinter

printer (also a preconfigured network printer) is selected by selecting *Printer* with the spinwheel nd then confirmed by pressing the spinwheel or the *ENTER* key.

fter confirmation, the entries under *Name, Print to File* and *Orientation* are available for selection with e spinwheel.

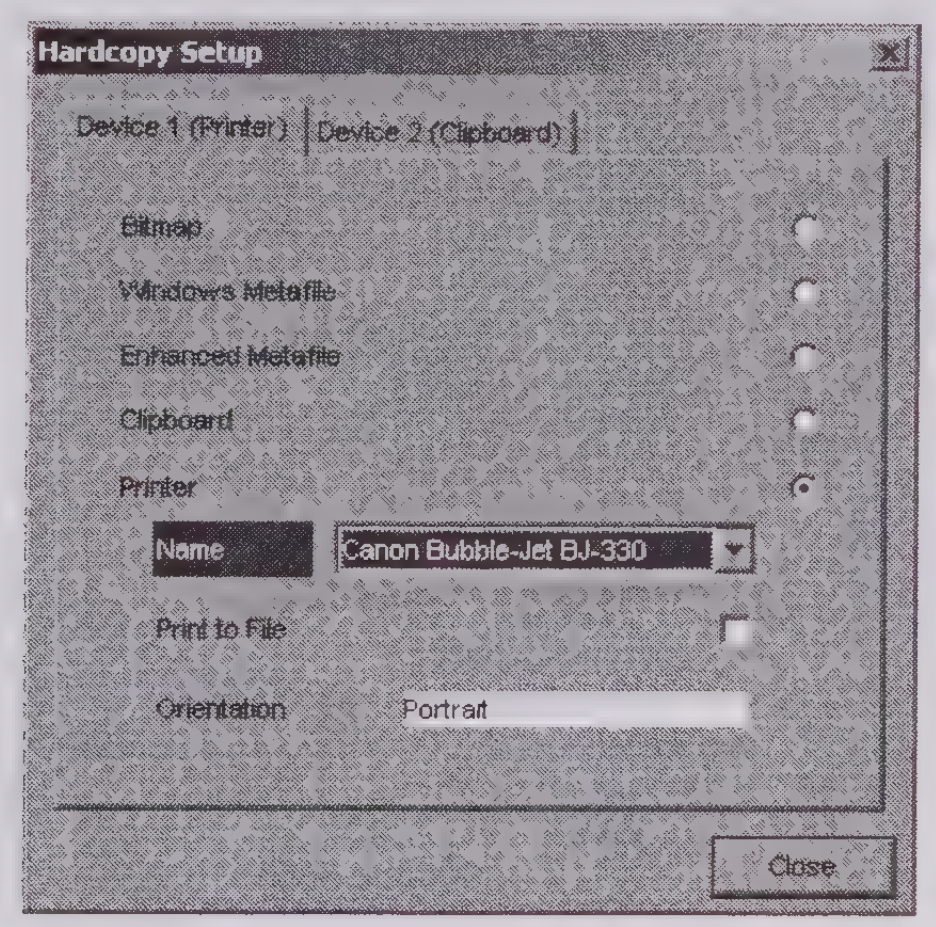

Printer ●

Name: Canon Bubble-Jet BJ-330

Print to File ☐

Orientation: Portrait

o select the printer type, select *Name* and open the selection list by pressing the spinwheel or *ENTER*.

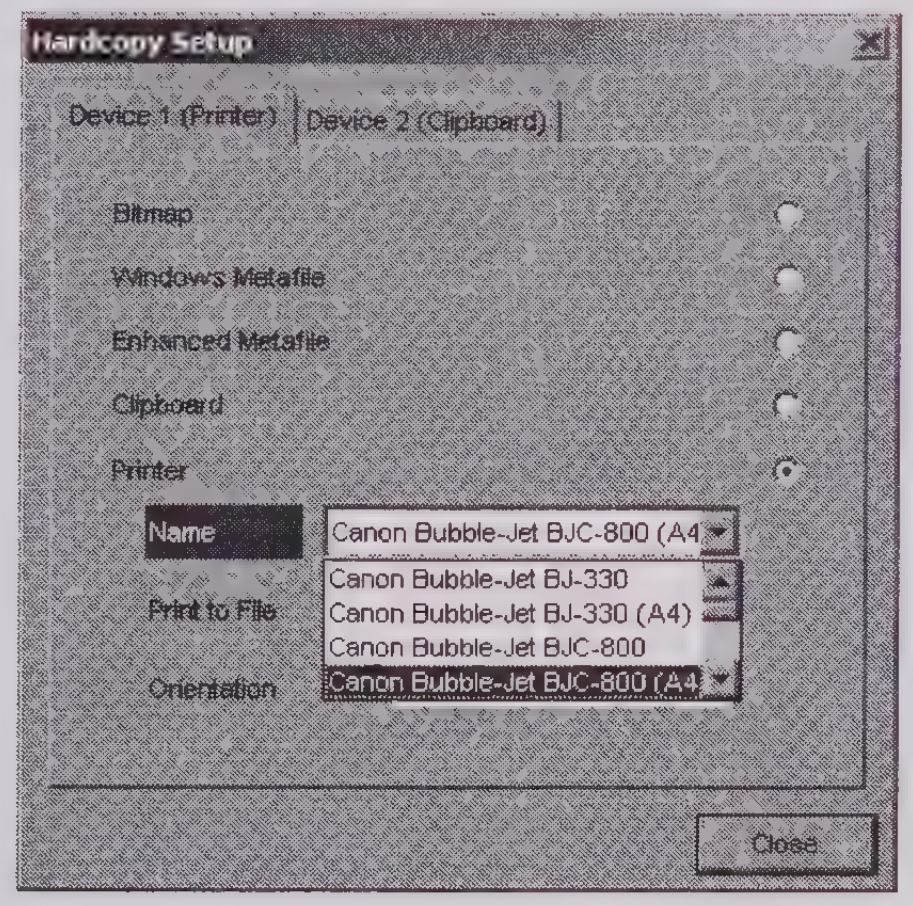

Printer ●

Name: Canon Bubble-Jet BJC-800 (A4

- Canon Bubble-Jet BJ-330
- Canon Bubble-Jet BJ-330 (A4)
- Canon Bubble-Jet BJC-800
- Canon Bubble-Jet BJC-800 (A4

elect the desired printer (in the example "Cannon Bubble-Jet BJC800 (A4") from the list by means of e spinwheel and confirm by pressing the spinwheel or *ENTER*. This closes the list and the cursor is aced on the *Name* field again.

rinting to a file is also possible. In this case select Print to File with the spinwheel and activate or eactivate the associated list by pressing the spinwheel or the *ENTER* key.

ne printing format is selected under *Orientation*. In this case, too, pressing the spinwheel or *ENTER* pens the selection list.

5
6
7
8
9
1

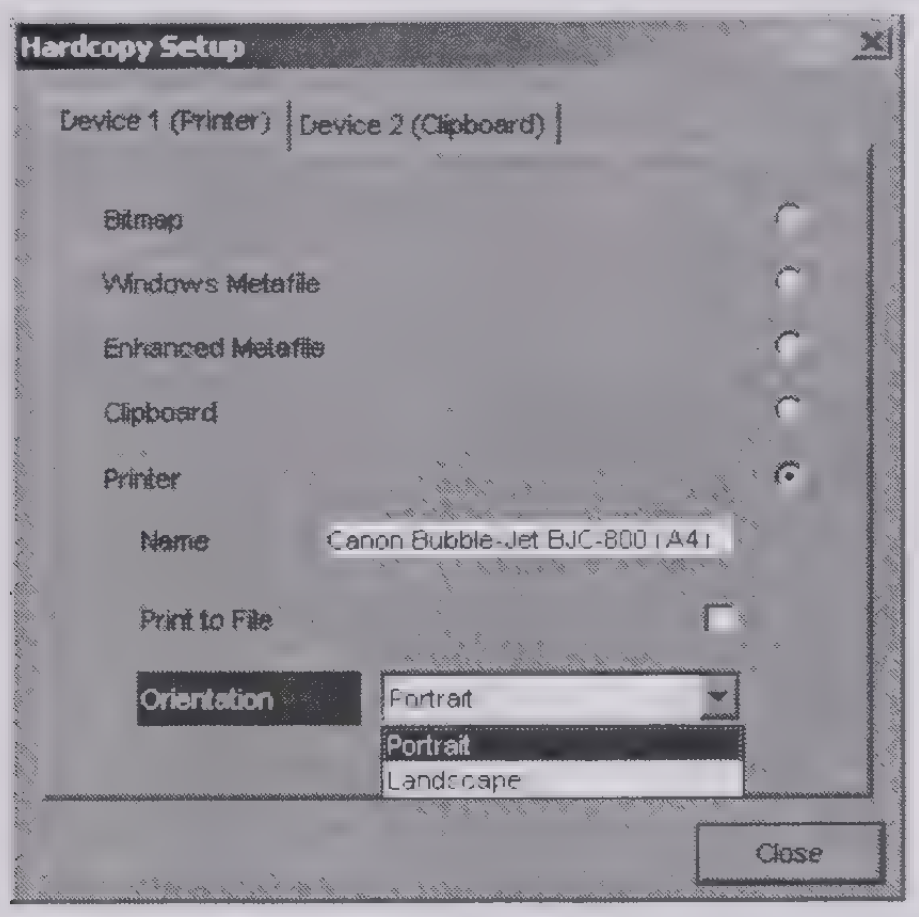

Hardcopy Setup

Device 1 (Printer) | Device 2 (Clipboard)

Bitmap ○

Windows Metafile ○

Enhanced Metafile ○

Clipboard ○

Printer ●

Name: Canon Bubble-Jet BJC-800 (A4)

Print to File ☐

Orientation: Portrait

Portrait

Landscape

Close

The desired format (here *Portrait*) is selected in the list with the spinwheel and confirmed by pressing the spinwheel or *ENTER*. This closes the list and the cursor is placed again on the *Orientation* field.

The dialog is then closed with *ESC* or by clicking the *Close* button.

Note: *The installation of new printer types is described in sections "Local Printer" and "Configuring a Network Printer"*

Selecting Alternative Printer Configurations

The analyzer is capable of managing two independent hardcopy settings. This, for instance, permits fast switchover between printing to a file or by a printer.



A selection is made with the *DEVICE 1 / 2* softkey which also shows settings when the *DEVICE SETUP* dialog is open.

IEC/IEEE-bus command: --

Selecting Printer Colours

The *COLORS* softkey gives access to the submenu where the colours for the printout can be selected. To facilitate colour selection, the selected colour combination is displayed when the menu is entered. The previous colours are restored when the menu is exited.

IEC/IEEE-bus command: –

The *COLOR ON OFF* softkey switches over from colour output to black-and-white output. All colour-highlighted areas are printed in white and all colour lines in black. This improves the contrast on the printout. The default setting is COLOR ON.

IEC/IEEE-bus command: `HCOP:DEV:COL ON`

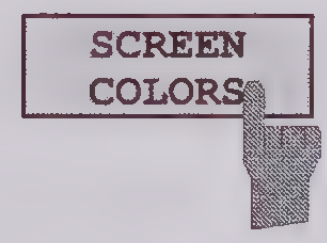

The *SCREEN COLORS* softkey selects the current screen colours for the printout.

Note: *The background is always printed in white and the grid in black.*

IEC/IEEE-bus command: `HCOP:CMAP:DEF1`



The *OPTIMIZED COLORS* softkey selects an optimized colour setting for the printout to improve the visibility of the colours on the hardcopy.
Trace 1 is blue, trace 2 black, trace 3 green, and the markers are turquoise.
The other colours correspond to the display colours of the *DISP – CONFIG DISPLAY -DEFAULT COLORS 1* softkey.

Note: *The background is always printed in white and the grid in black.*

IEC/IEEE-bus command: `HCOP:CMAP:DEF2`

The *USER DEFINED* softkey opens a submenu for user-defined colour selection (see submenu *USER DEFINED COLORS*).

IEC/IEEE-bus command: `HCOP:CMAP:DEF3`

The *SELECT OBJECT* softkey allows picture elements to be selected to change their colour setting. After selection, the *PREDEFINED COLORS*, *BRIGHTNESS*, *TINT* and *SATURATION* softkeys enable the user to change the colours or brightness, the hue and the colour saturation of the element selected.

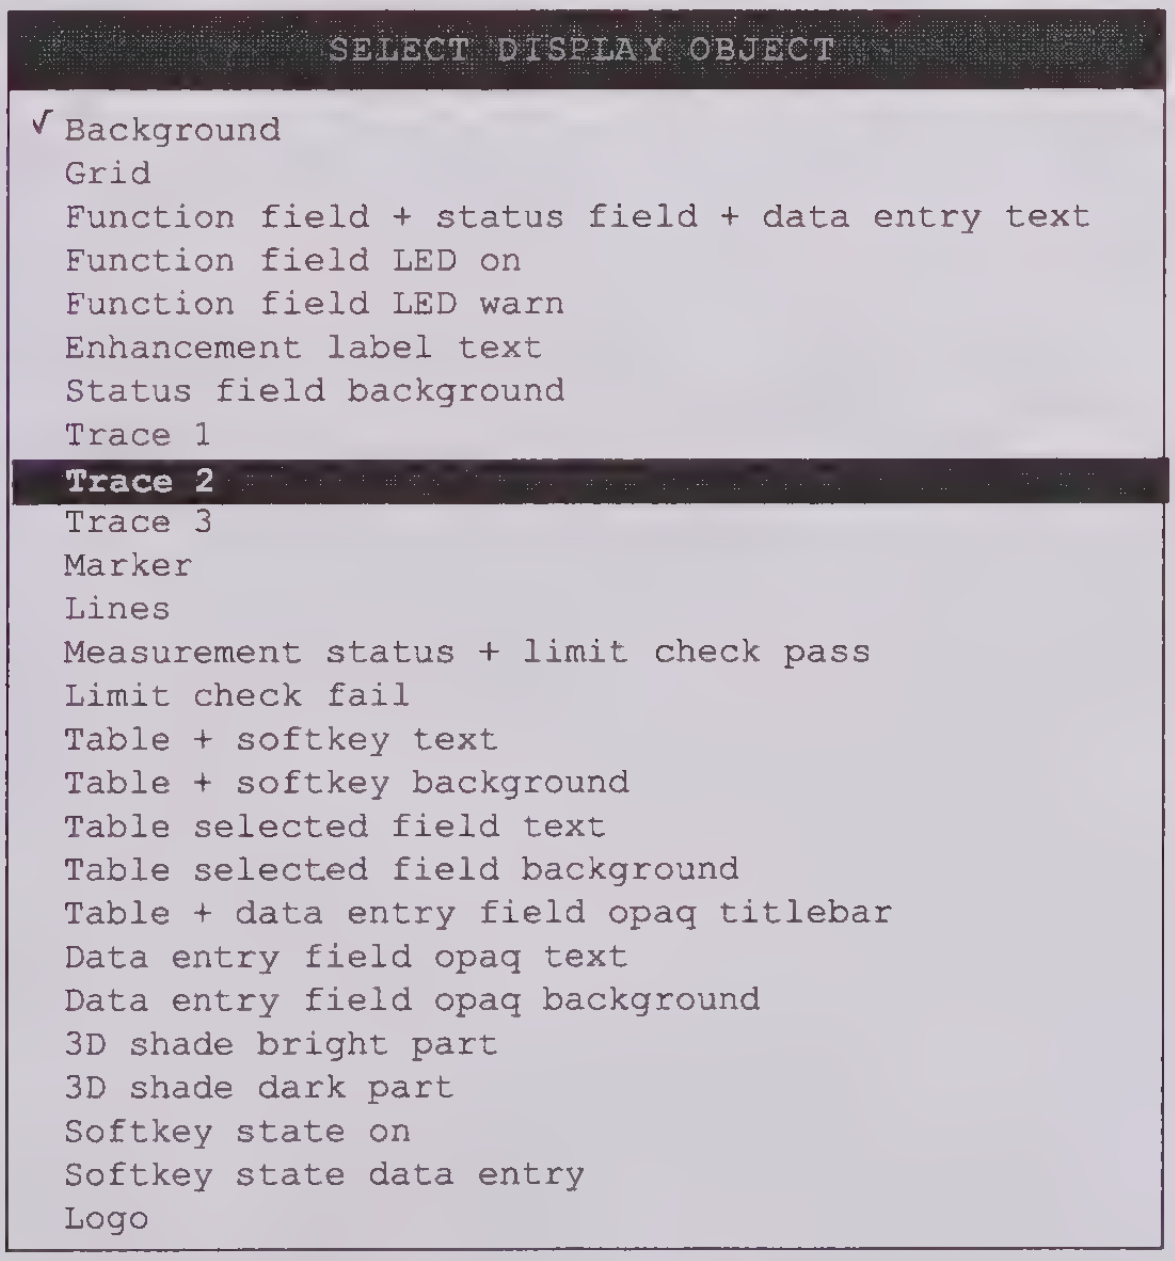

SELECT DISPLAY OBJECT

✓ Background
Grid
Function field + status field + data entry text
Function field LED on
Function field LED warn
Enhancement label text
Status field background
Trace 1
Trace 2
Trace 3
Marker
Lines
Measurement status + limit check pass
Limit check fail
Table + softkey text
Table + softkey background
Table selected field text
Table selected field background
Table + data entry field opaq titlebar
Data entry field opaq text
Data entry field opaq background
3D shade bright part
3D shade dark part
Softkey state on
Softkey state data entry
Logo

IEC/IEEE-bus command: –

BRIGHTNESS

The *BRIGHTNESS* softkey serves for determining the brightness of the graphic element selected.

A value between 0 and 100% can be entered.

IEC/IEEE-bus command:

```
HCOP:CMAP5:HSL <hue>,<sat>,<lum>
```

TINT

The *TINT* softkey serves for determining the hue of the element selected. The percentage entered refers to a continuous colour spectrum from red (0%) to blue (100%).

IEC/IEEE-bus command:

```
HCOP:CMAP5:HSL <hue>,<sat>,<lum>
```

SATURATION

The *SATURATION* softkey serves for determining the saturation of the element selected.

A value between 0 and 100% can be entered.

IEC/IEEE-bus command:

```
HCOP:CMAP5:HSL <hue>,<sat>,<lum>
```

PREDEFINED COLORS

The *PREDEFINED COLORS* softkey opens a list from which predefined colours for the displayed elements can be selected:

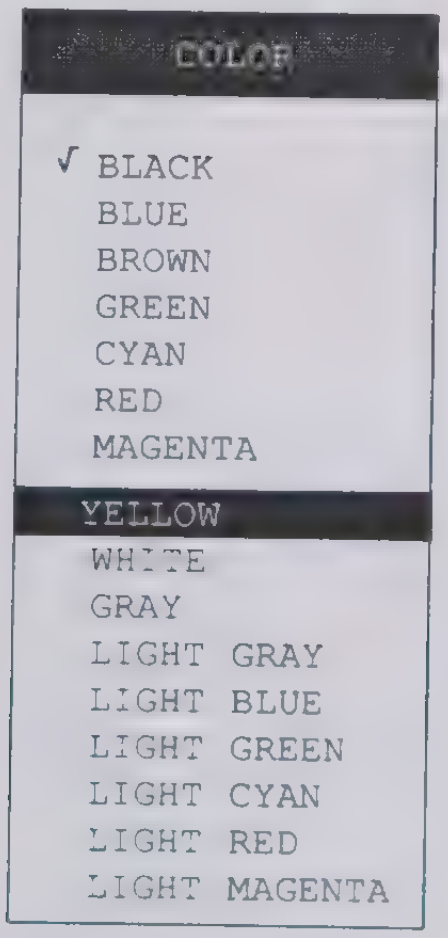

IEC/IEEE-bus command:

```
HCOP:CMAP1 ... 26:PDEF <color>
```

SET TO DEFAULT

The *SET TO DEFAULT* softkey reactivates the default colour setting (= *OPTIMIZED COLORS).*

IEC/IEEE-bus command: –

Entering a Text with the Auxiliary Line Editor

he auxiliary line editor is opened automatically when the *COMMENT* softkey is clicked.

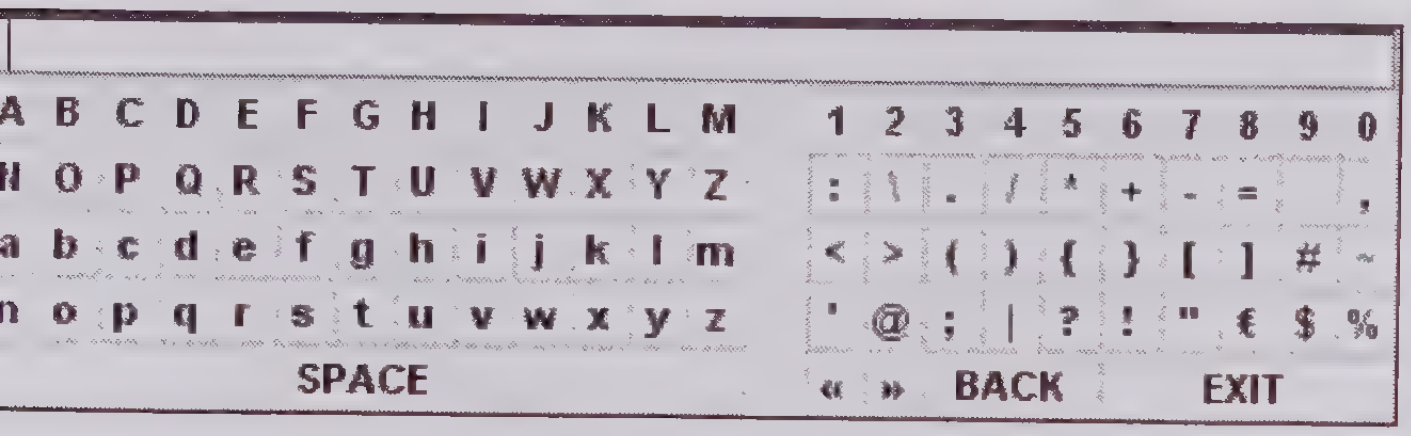
A B C D E F G H I J K L M
1 2 3 4 5 6 7 8 9 0
N O P Q R S T U V W X Y Z
: \ . / * + - = ,
a b c d e f g h i j k l m
< > ( ) { } [ ] # ~
n o p q r s t u v w x y z
' @ ; | ? ! " € $ %
SPACE
« » BACK EXIT

he entry area consists of two parts:

- the editing line
- the character selection field

hangeover from the editing line to the character selection is performed with the *cursor down* ⇩ key.

avigation in the character selection field is possible with the spinwheel or the cursor keys ⇧, ⇩, ⇨ nd ⇦

ressing the spinwheel or the *ENTER* key transfers the desired characters to the editing line.

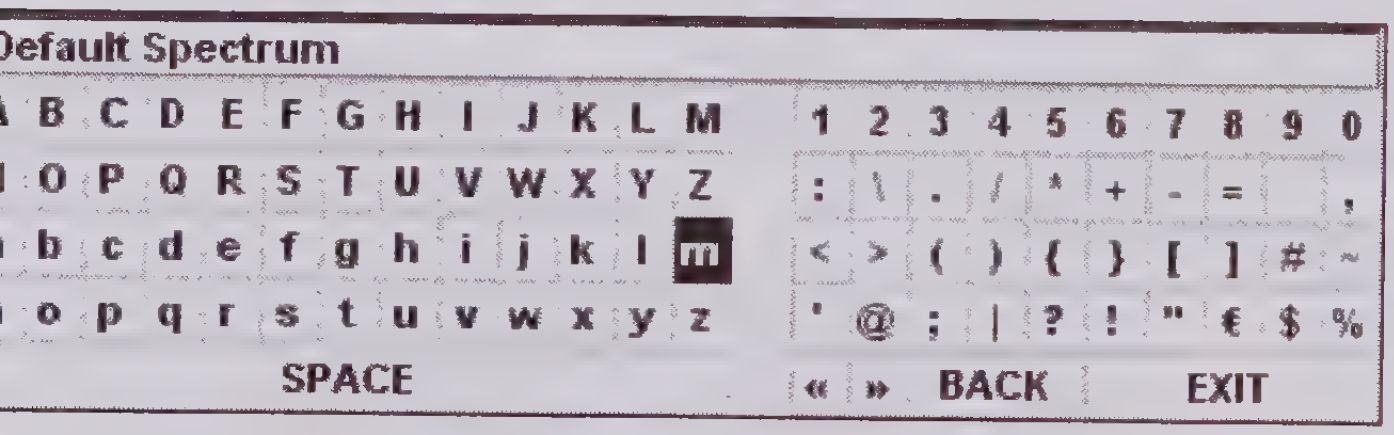
efault Spectrum

e fields in the last line of the character selection field are assigned special functions.

PACE	inserts a space in the editing line
<	shifts the cursor in the editing line by one character to the left
>	shifts the cursor in the editing line by one character to the right
ACK	clears the character before the cursor
XIT	stores the content of the editing line and closes the auxiliary line editor

eturn to the editing line from the first line of the character selection field using the *cursor up* ⇧ key. avigation within the editing line is also performed with the spinwheel or the cursor keys ⇨ and ⇦

gures, decimal points and signs are directly entered in the editing line using the keypad on the front nel. When a PC keyboard is connected, letters and special characters can also be directly entered.

diting is terminated from the editing line with *ENTER* if the text should be stored, and with *ESC* when e entered text should be aborted. In both cases the auxiliary line editor is closed.

Installation of Plug&Play Printers

The installation of Plug&Play printers under Windows XP is quite simple:
After the printer is connected and switched on, Windows XP automatically recognizes it and installs its driver, provided the driver is included in the XP installation.
If the XP printer driver is not found, Windows XP prompts you to enter the path for the corresponding installation files. In addition to pre-installed drivers, a number of other printer drivers can be found in directory D:\I386.

Note: *When installing new printer drivers, you will be prompted to indicate the path of the new driver. This path may be on a disk in drive A. Alternatively, the driver can be loaded via a memory stick or USB CD-ROM drive (see section "Connection of USB Devices").*

Installation of Non-Plug&Play Printers

Note: The dialogs below can be operated either from the front panel or via mouse and keyboard (see sections "Connecting a Mouse" and "Connecting a Keyboard"). *Mouse and PC keyboard are absolutely essential for configuring network printers.*

A new printer is installed via the *INSTALL PRINTER* softkey.

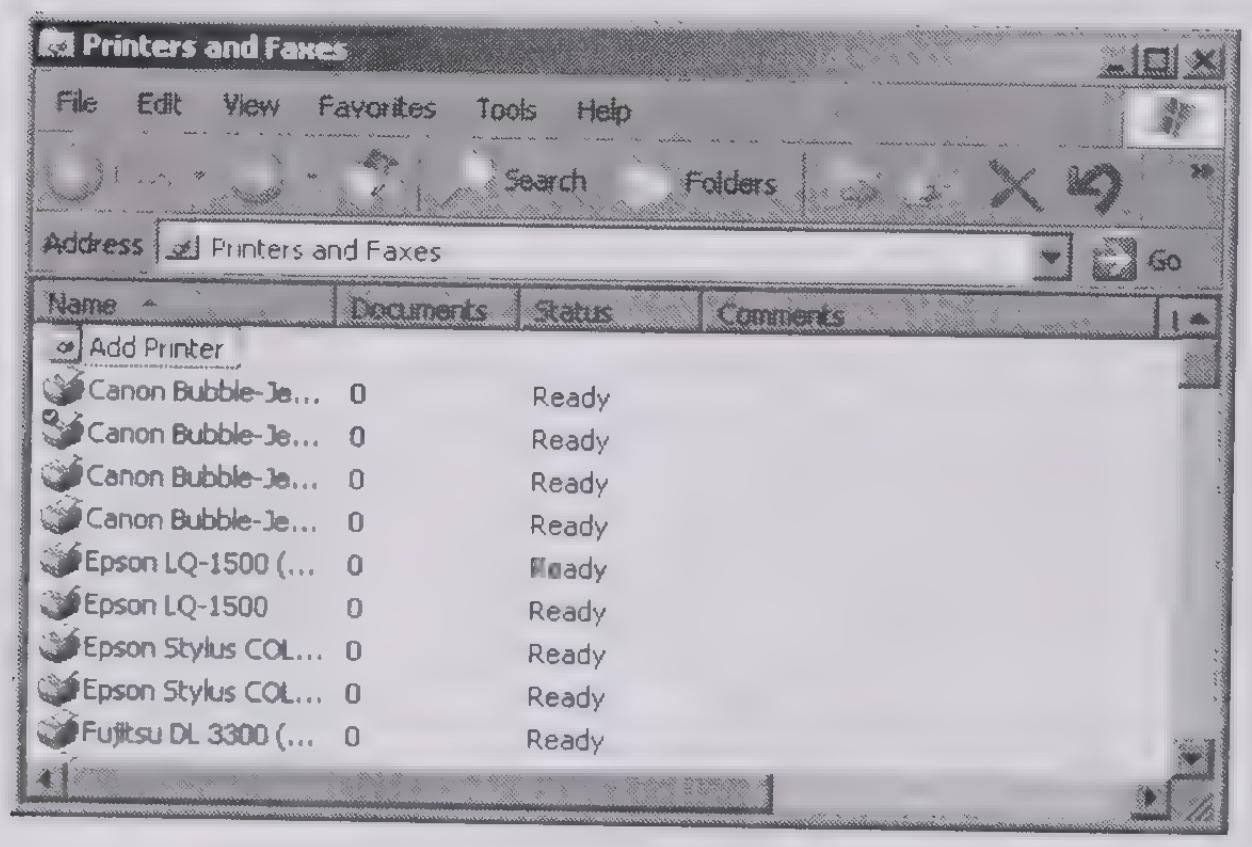
Printers and Faxes
File Edit View Favorites Tools Help
Search Folders
Address Printers and Faxes
Go

Name	Documents	Status	Comments
Add Printer			
Canon Bubble-Je...	0	Ready	
Canon Bubble-Je...	0	Ready	
Canon Bubble-Je...	0	Ready	
Canon Bubble-Je...	0	Ready	
Epson LQ-1500 (...	0	Ready	
Epson LQ-1500	0	Ready	
Epson Stylus COL...	0	Ready	
Epson Stylus COL...	0	Ready	
Fujitsu DL 3300 (...	0	Ready	

- ➢ Select *Add Printer* in the list using the spinwheel.
- ➢ Highlight the selected item with *CURSOR RIGHT* and press *ENTER* or the spinwheel to confirm the selection.

  The *Add Printer Wizard* is displayed.

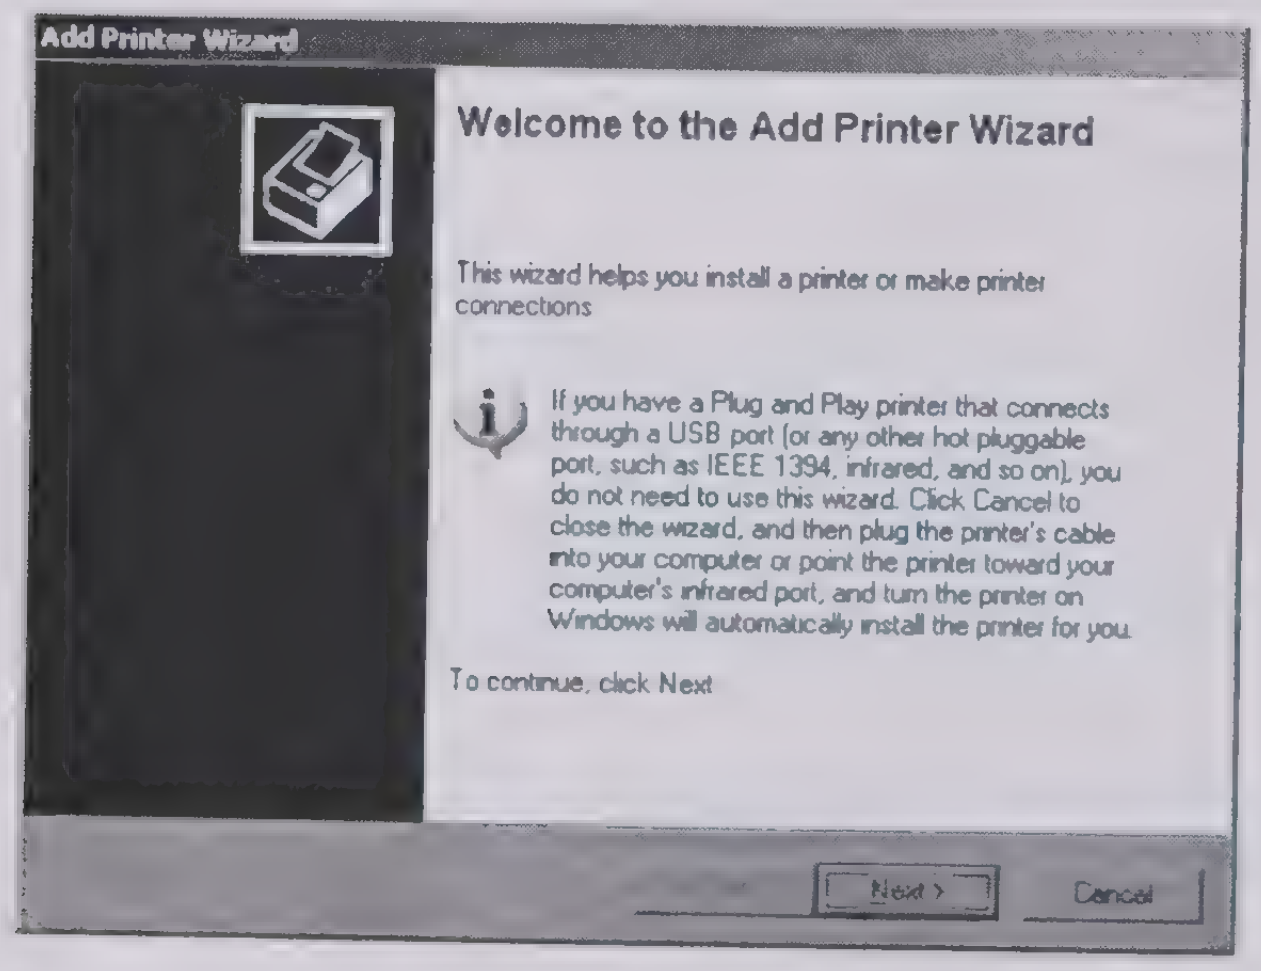

Welcome to the Add Printer Wizard

This wizard helps you install a printer or make printer connections.

If you have a Plug and Play printer that connects through a USB port (or any other hot pluggable port, such as IEEE 1394, infrared, and so on), you do not need to use this wizard. Click Cancel to close the wizard, and then plug the printer's cable into your computer or point the printer toward your computer's infrared port, and turn the printer on. Windows will automatically install the printer for you.

To continue, click Next.

- ➢ Select *NEXT* with the spinwheel and press the spinwheel for confirmation.

  Local or Network Printer can be selected.

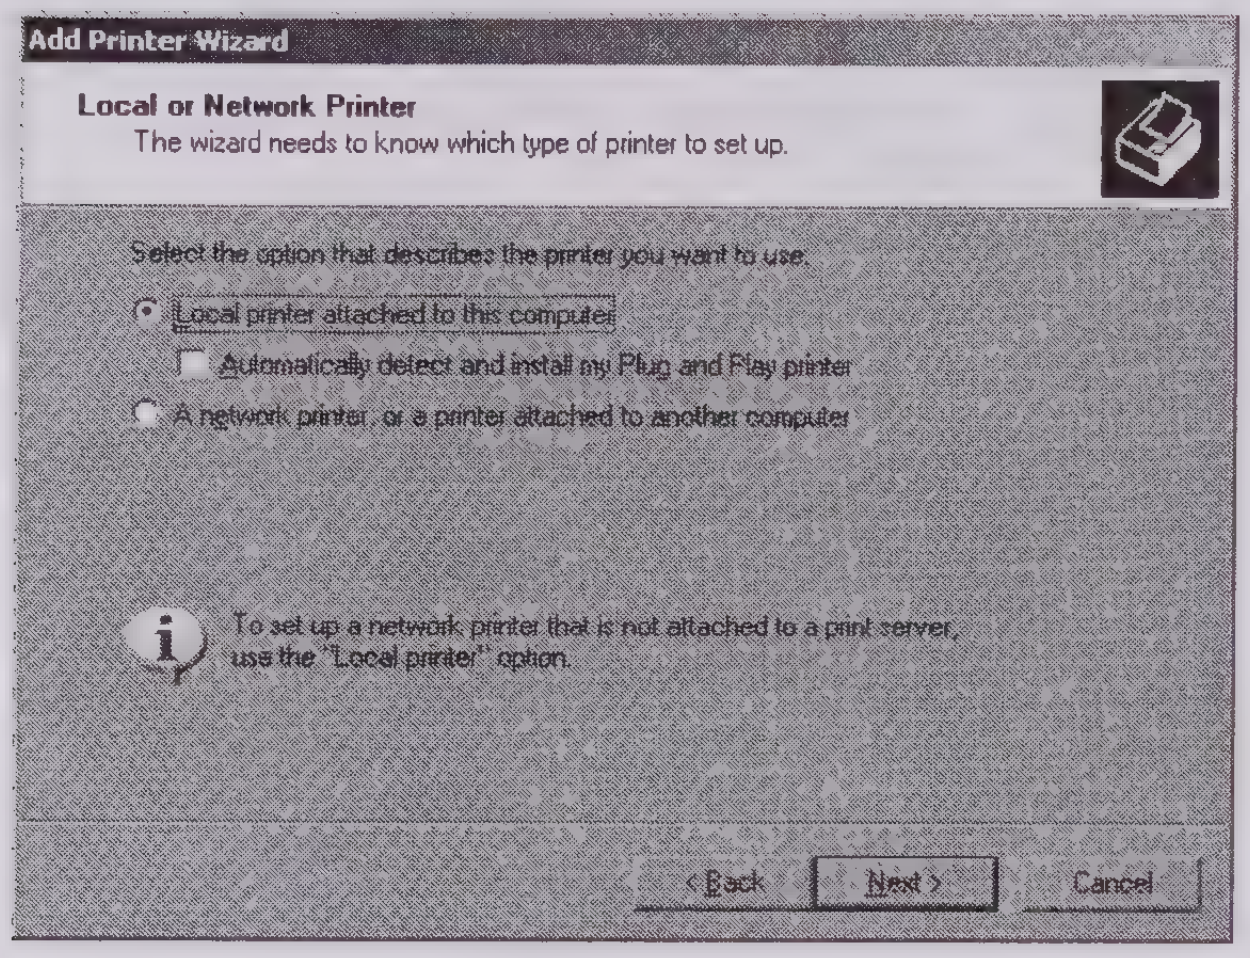

Add Printer Wizard

Local or Network Printer
The wizard needs to know which type of printer to set up.

Select the option that describes the printer you want to use:

● Local printer attached to this computer
☐ Automatically detect and install my Plug and Play printer
○ A network printer, or a printer attached to another computer

To set up a network printer that is not attached to a print server, use the "Local printer" option.

- ➢ To install a local printer, select *Local printer attached to this computer* with the spinwheel. Press the spinwheel for confirmation and continue with the "Local Printer" section.
- ➢ To install a network printer, select *A network printer or a printer attached to another computer.* Press the spinwheel for confirmation and continue with the "Network Printer" section.

Local Printer

In the example below, a Star LC24 printer is installed.

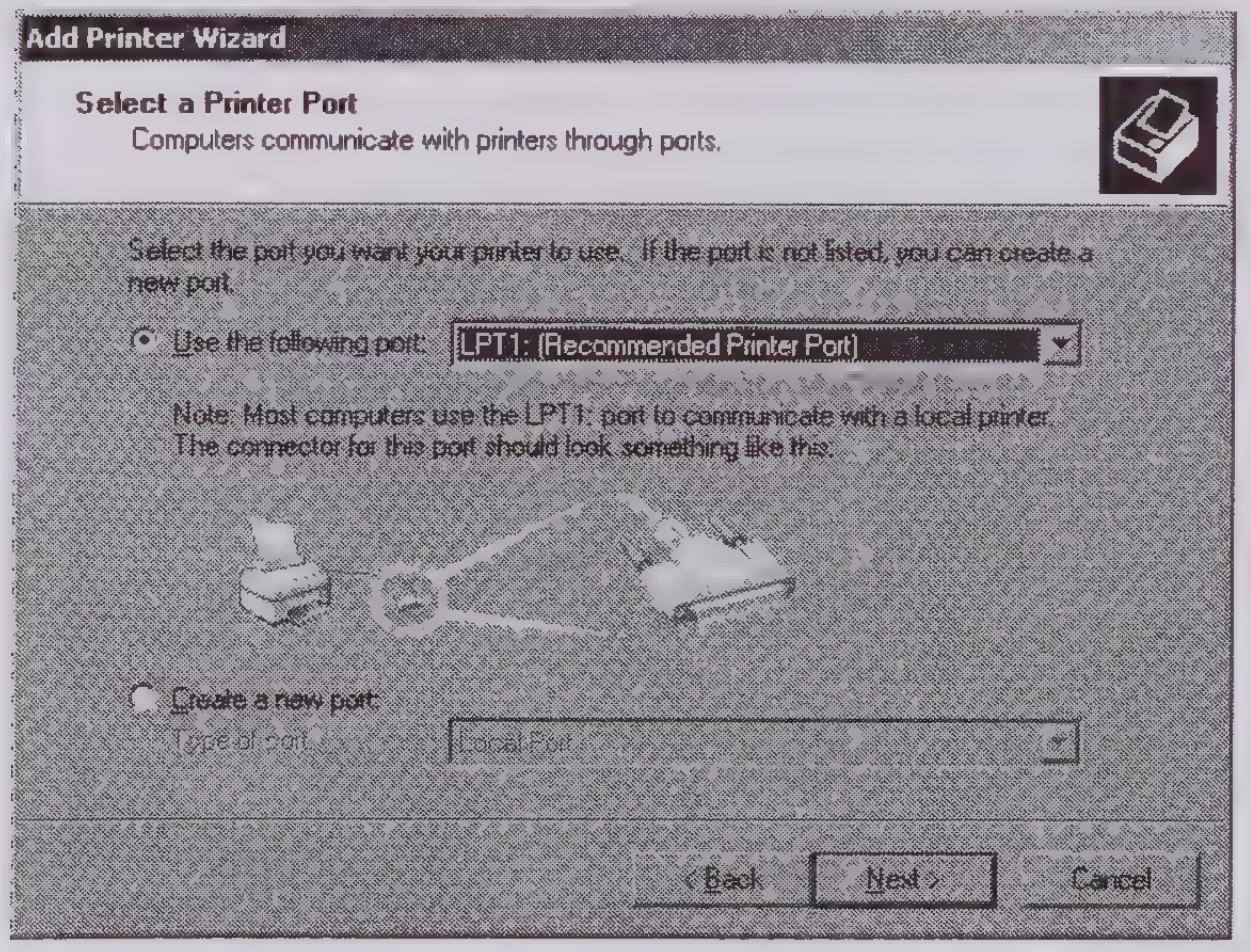

Add Printer Wizard

Select a Printer Port
Computers communicate with printers through ports.

Select the port you want your printer to use. If the port is not listed, you can create a new port.

● Use the following port: LPT1: (Recommended Printer Port)

Note: Most computers use the LPT1: port to communicate with a local printer. The connector for this port should look something like this:

○ Create a new port:
Type of port: Local Port

- ➢ To select the USB interface, open the list of ports by clicking the spinwheel. Select the printer port with spinwheel/arrow keys and confirm by pressing the spinwheel. The selection list is closed again.
- ➢ To select the LPT connector, the selection list need not be opened.
- ➢ Place the cursor on the *Next* button and confirm by pressing the spinwheel.

  The "Install Printer Software" dialog is opened.

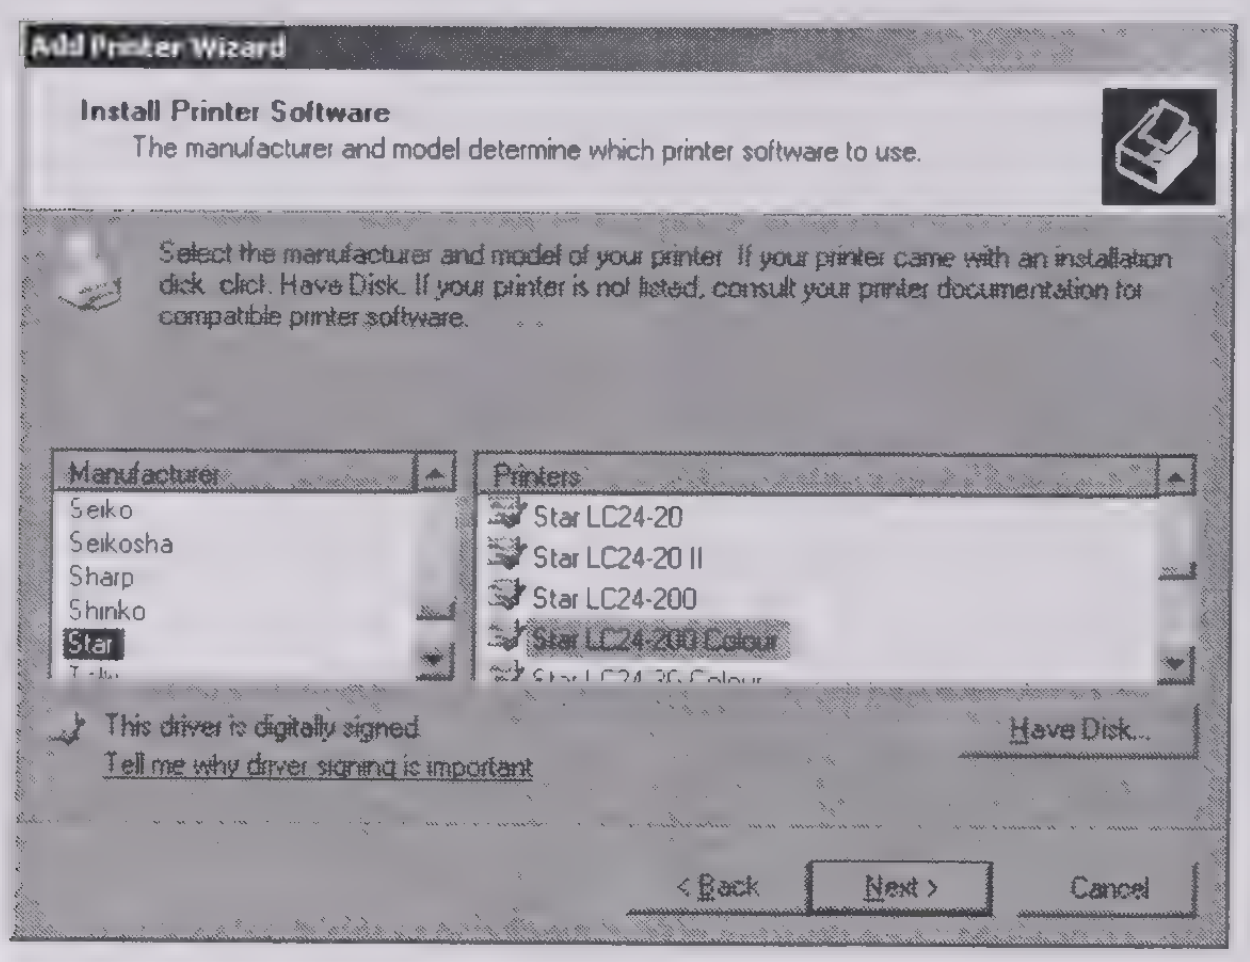

Add Printer Wizard

Install Printer Software

The manufacturer and model determine which printer software to use.

Select the manufacturer and model of your printer. If your printer came with an installation disk, click Have Disk. If your printer is not listed, consult your printer documentation for compatible printer software.

Manufacturer: Star

Printers: Star LC24-200 Colour

This driver is digitally signed.

- ➢ Select the desired manufacturer ("Star") in the Manufacturer table using the up / down keys.

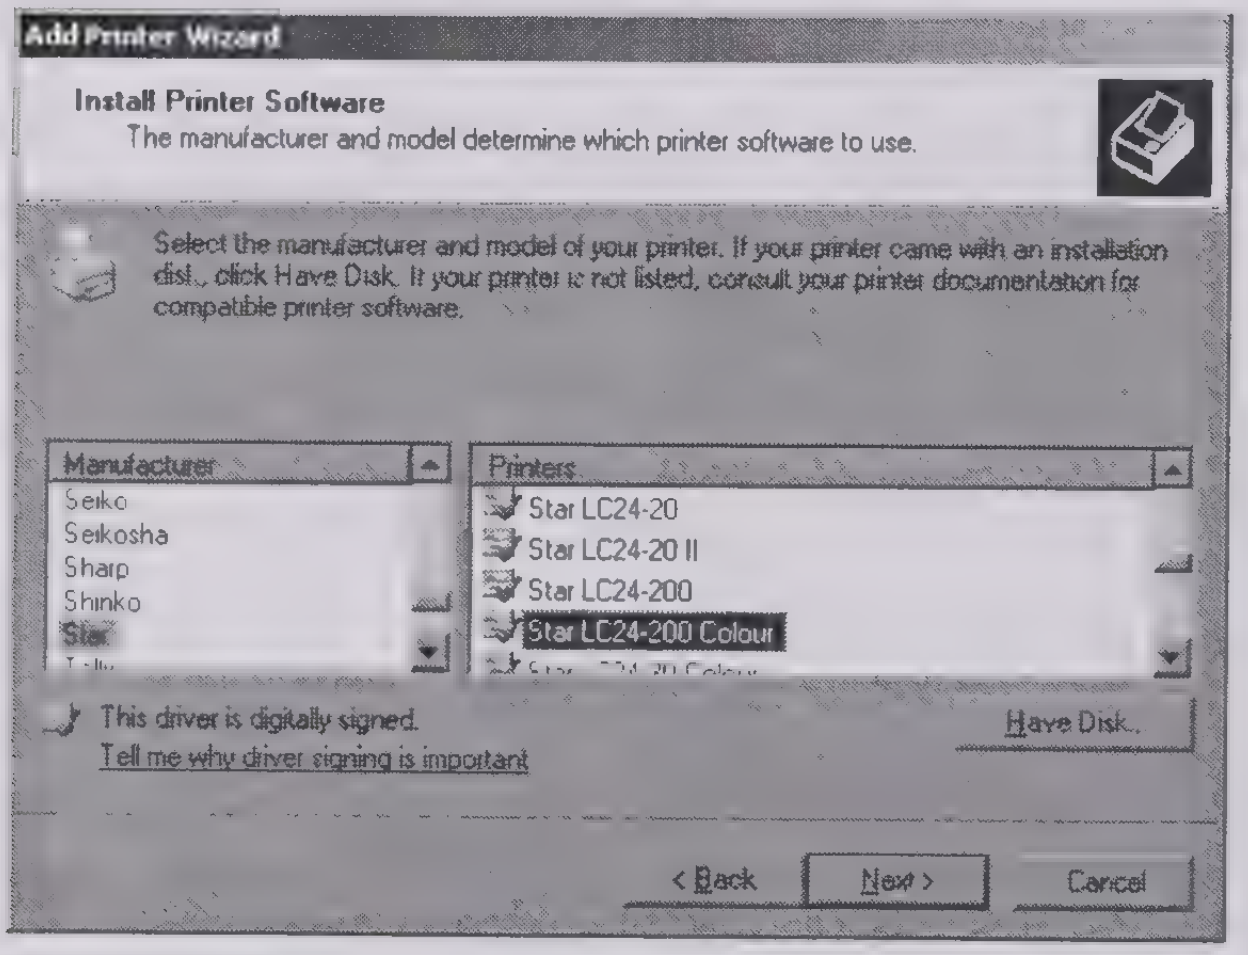

Add Printer Wizard

Install Printer Software

The manufacturer and model determine which printer software to use.

Select the manufacturer and model of your printer. If your printer came with an installation disk, click Have Disk. If your printer is not listed, consult your printer documentation for compatible printer software.

Manufacturer: Star

Printers: Star LC24-200 Colour

This driver is digitally signed.

Go to the *Printers* list with the spinwheel.

- ➢ Select the desired printer type (Star LC24-200 Colour) using the up / down keys and confirm with *ENTER*.

Note:
If the desired printer type is not in the list, the respective driver is not installed yet. In this case click the HAVE DISK button with the mouse key. You will be prompted to insert a disk with the corresponding printer driver. Press OK and select the desired printer driver.

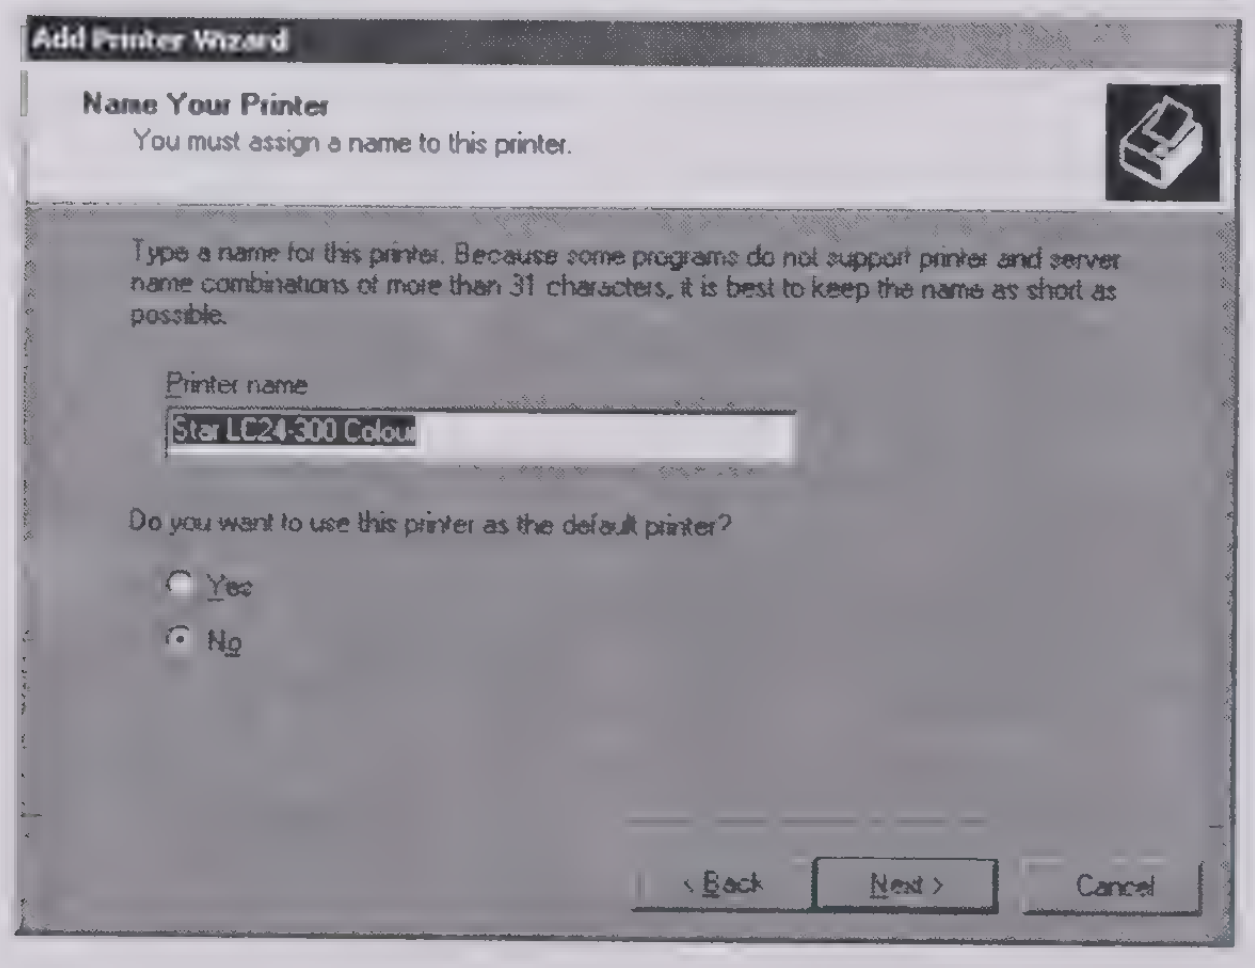

Add Printer Wizard

Name Your Printer

You must assign a name to this printer.

Type a name for this printer. Because some programs do not support printer and server name combinations of more than 31 characters, it is best to keep the name as short as possible.

Printer name: Star LC24-300 Colour

Do you want to use this printer as the default printer?

○ Yes

● No

The printer name can be changed as required in the *Printer name* entry field (max. 60 characters). A PC keyboard is required in this case.

- ➢ Use the spinwheel to select *Yes or No* for the default printer.
- ➢ Choose the desired status with the up /down keys.
- ➢ Confirm with *ENTER*.

The *Printer Sharing* dialog is opened.

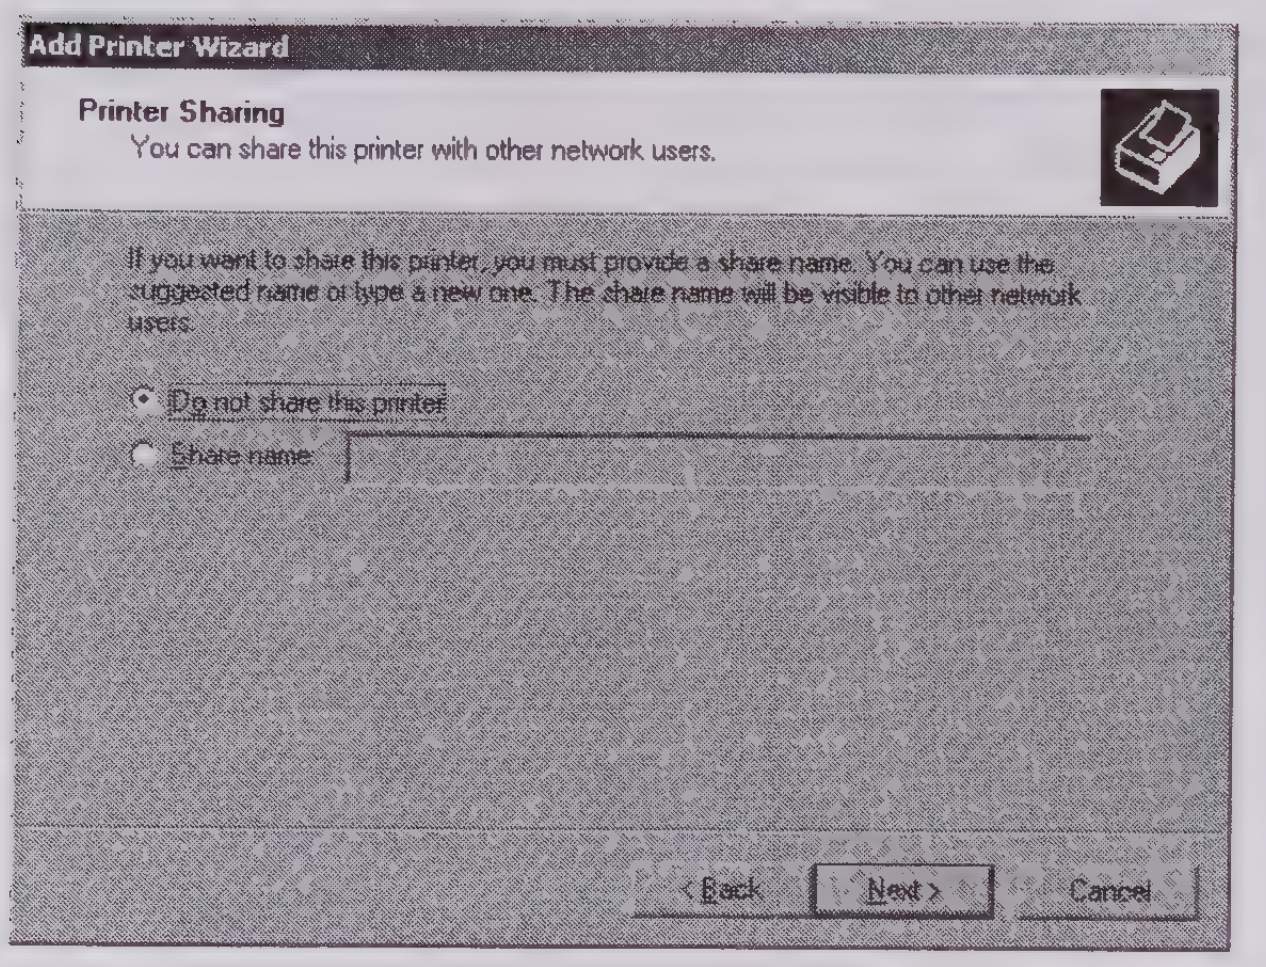

Printer Sharing
You can share this printer with other network users.

If you want to share this printer, you must provide a share name. You can use the suggested name or type a new one. The share name will be visible to other network users.

● Do not share this printer
○ Share name:

- ➢ Exit the dialog with *ENTER*.

  The *Print Test Page* dialog is opened.

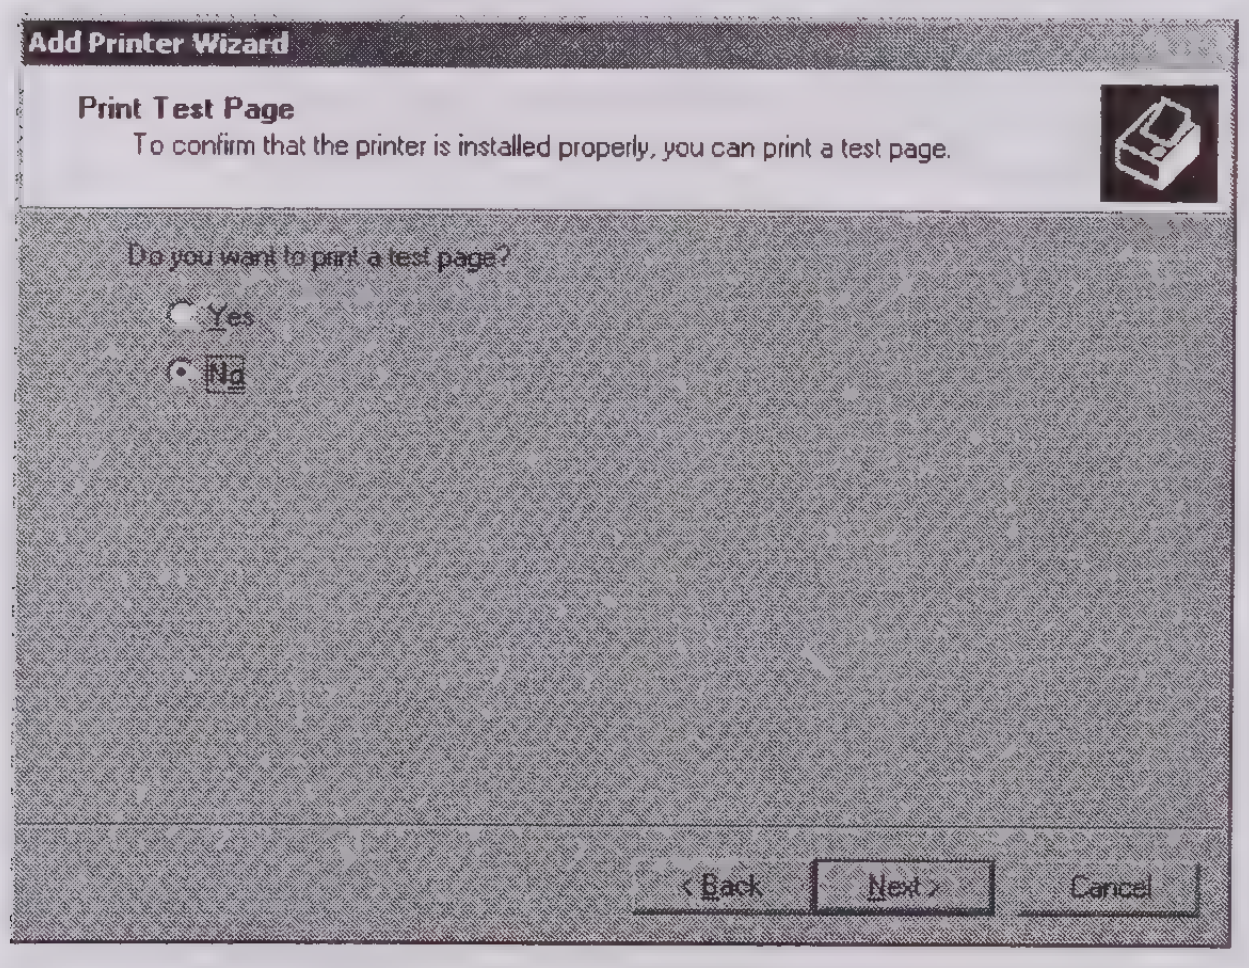

Print Test Page
To confirm that the printer is installed properly, you can print a test page.

Do you want to print a test page?

○ Yes
● No

- ➢ Exit the dialog with *ENTER*.

  The *Completing the Add Printer Wizard* dialog is opened.

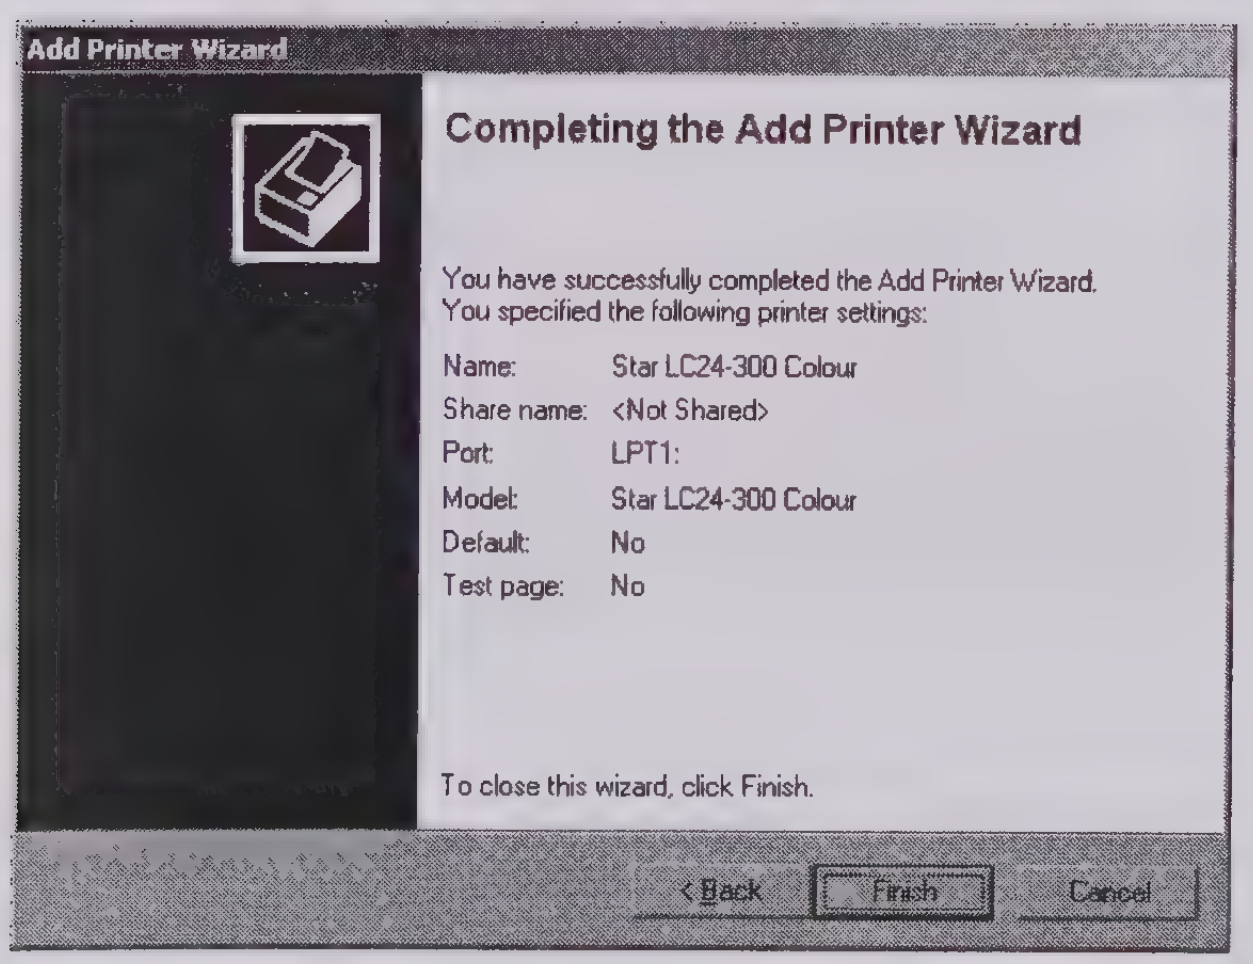

Completing the Add Printer Wizard

You have successfully completed the Add Printer Wizard.
You specified the following printer settings:

Name:	Star LC24-300 Colour
Share name:	<Not Shared>
Port:	LPT1:
Model:	Star LC24-300 Colour
Default:	No
Test page:	No

To close this wizard, click Finish.

- ➢ Check the displayed settings and exit the dialog with *ENTER*.

  The printer is installed. If Windows finds the required driver files, the installation is completed without any further queries.

  If Windows cannot find the required driver files, a dialog is opened where the path for the files can be entered.

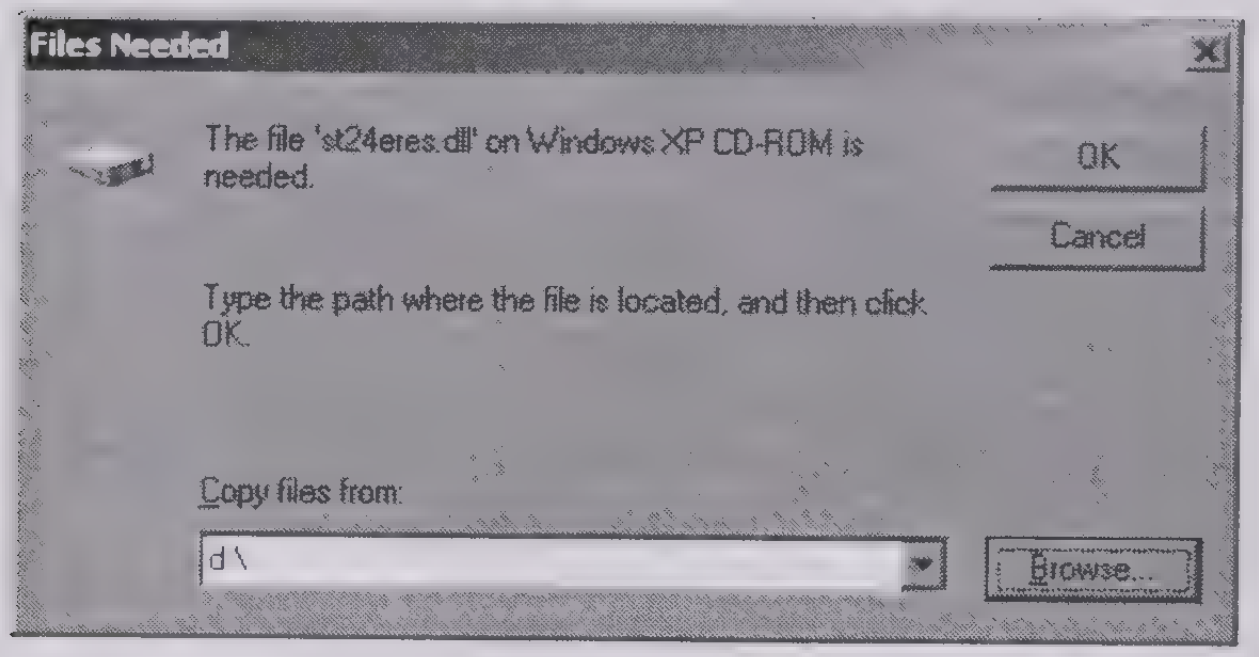

The file 'st24eres.dll' on Windows XP CD-ROM is needed.

Type the path where the file is located, and then click OK.

Copy files from: d:\

- Select the *Browse* button with the spinwheel and confirm with by pressing the spinwheel.

  The *Locate File* dialog is opened.

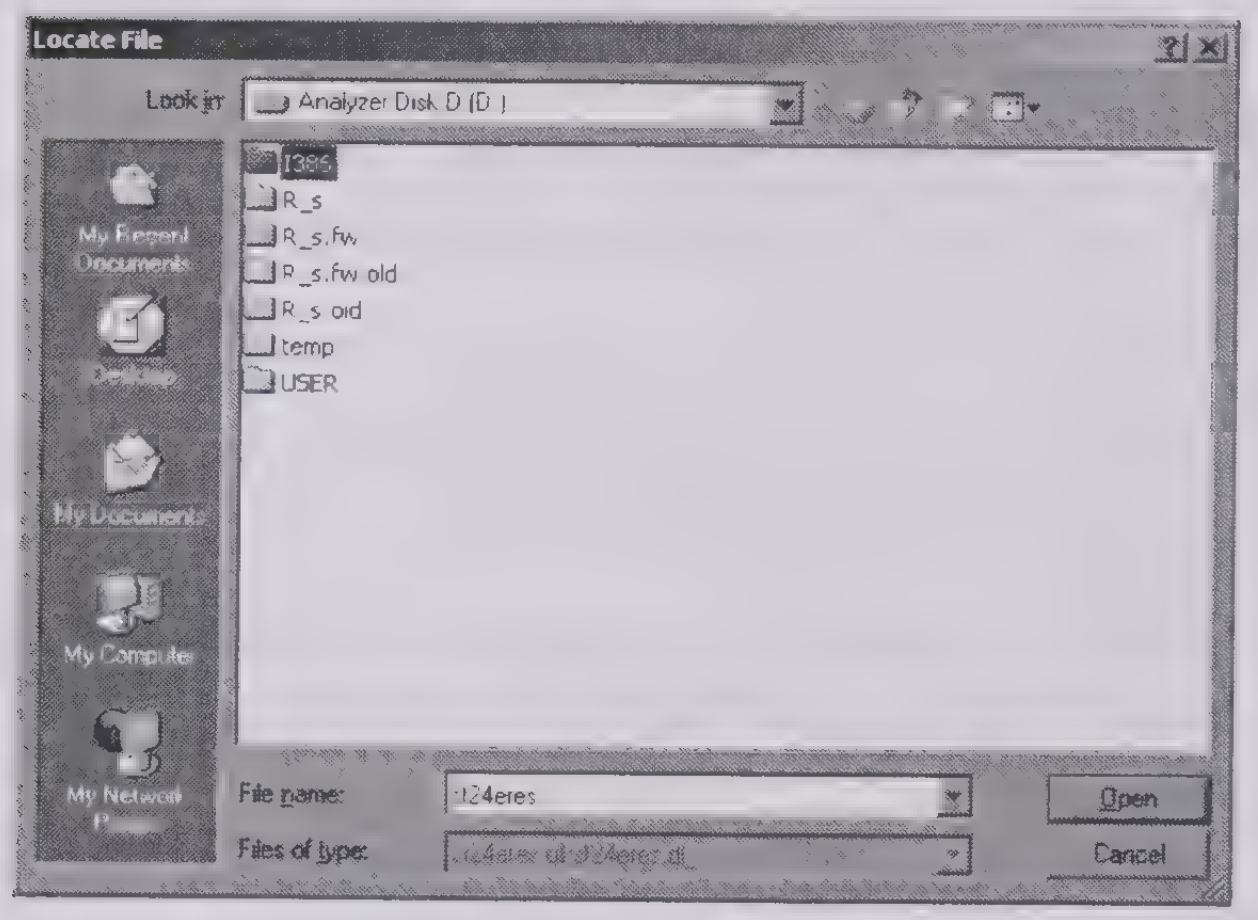

Look in: Analyzer Disk D (D:)

I386
R_s
R_s.fw
R_s.fw.old
R_s.old
temp
USER

File name: st24eres

- Turn the spinwheel to select the directory and path D:\I386 and press it to confirm the selection.

  If the selected item is not printed on a blue background, it must be marked with the cursor up / down keys before it can be activated by pressing the spinwheel.

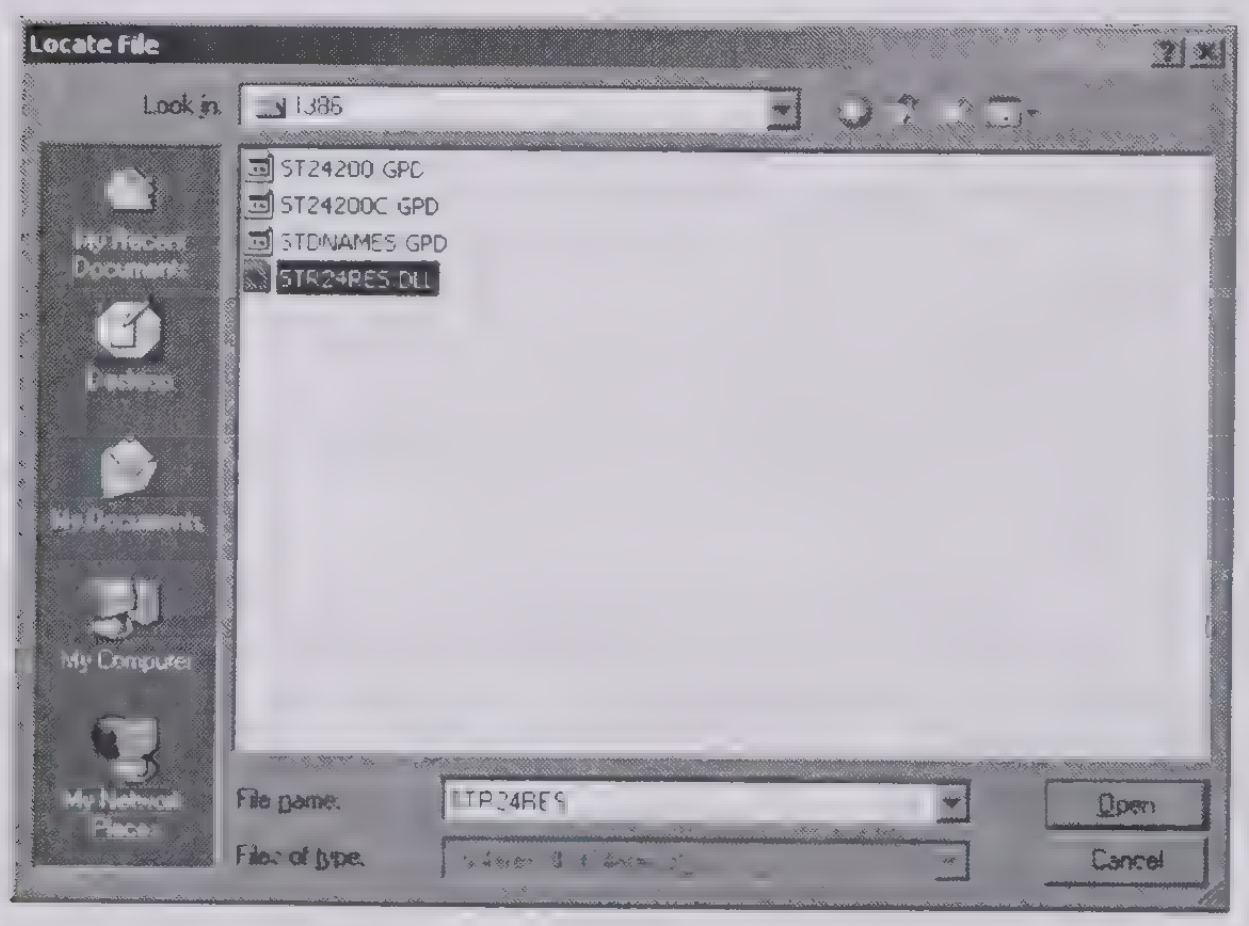

Look in: I386

ST24200.GPC
ST24200C.GPD
STDNAMES.GPD
STR24RES.DLL

File name: STR24RES

- Select the driver file with the spinwheel and confirm by pressing the spinwheel.

  The file is included in the *Files Needed* dialog.

  Note:
  If the desired file is not in the D:\I386 directory, a disk with the driver file is needed. In this case, exit the dialog with ESC and repeat the selection starting from the "Files needed" dialog.

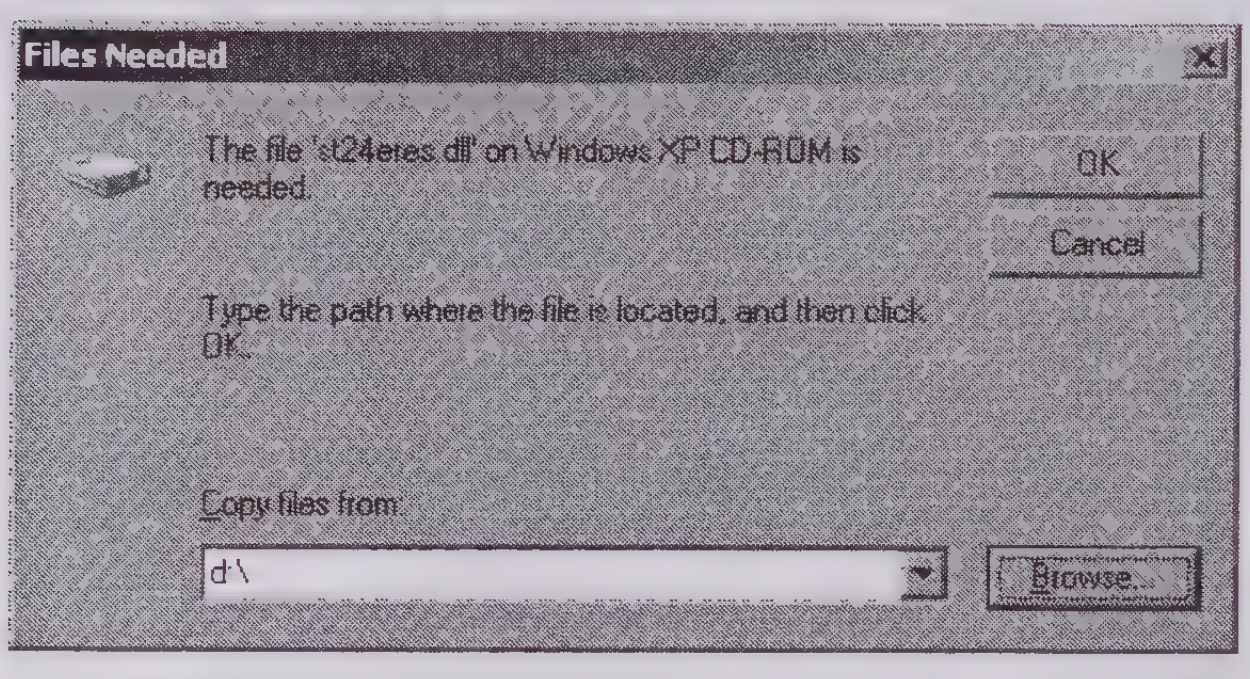

The file 'st24eres.dll' on Windows XP CD-ROM is needed.

Type the path where the file is located, and then click OK.

Copy files from:
d:\

- ➢ Select the *OK* button with the spinwheel and press the spinwheel to confirm.

The installation is completed.

Finally the instrument must be configured for printouts of the measurement screen with this printer. For details please refer to the *DEVICE SETUP* softkey in the hardcopy menu.

Network Printer

Note: *For easy operation of the subsequent dialogs, connection of a PS/2 keyboard with trackball to the front panel is recommended. If no trackball is available, a USB mouse should be connected additionally to the rear panel (see section "Connecting a Mouse" and "Connecting a Keyboard")*

In the example below, a HP Laserjet 5 printer is installed as network printer. The Add Printer Wizard has already been opened as described in section " Starting the Add Printer Wizard "

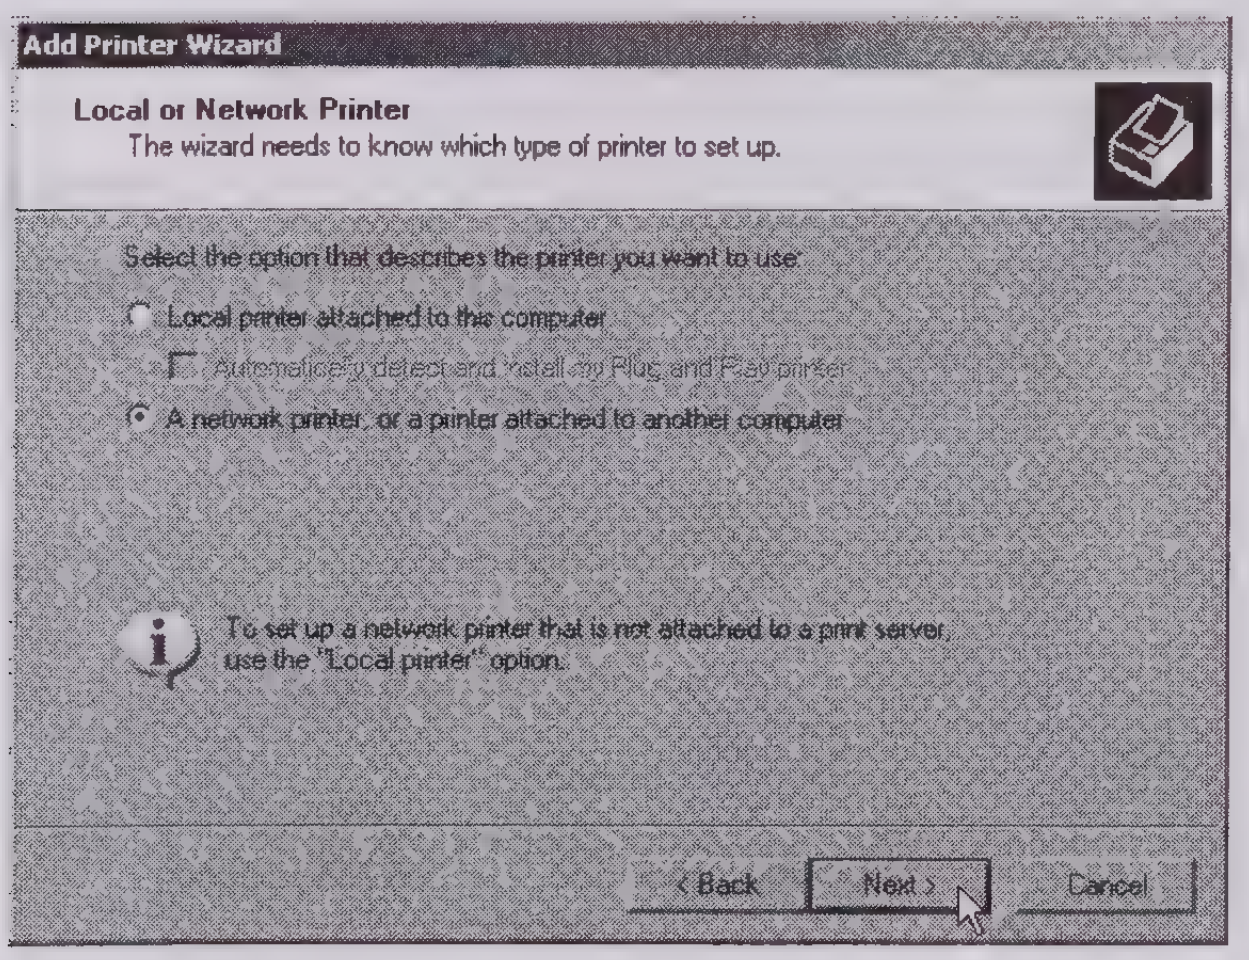

Local or Network Printer
The wizard needs to know which type of printer to set up.

Select the option that describes the printer you want to use:

○ Local printer attached to this computer
☐ Automatically detect and install my Plug and Play printer
● A network printer, or a printer attached to another computer

To set up a network printer that is not attached to a print server, use the "Local printer" option.

- ➢ To select a network printer, click the option "*A network printer or a printer attached to another computer*".

Continue with *Next*.

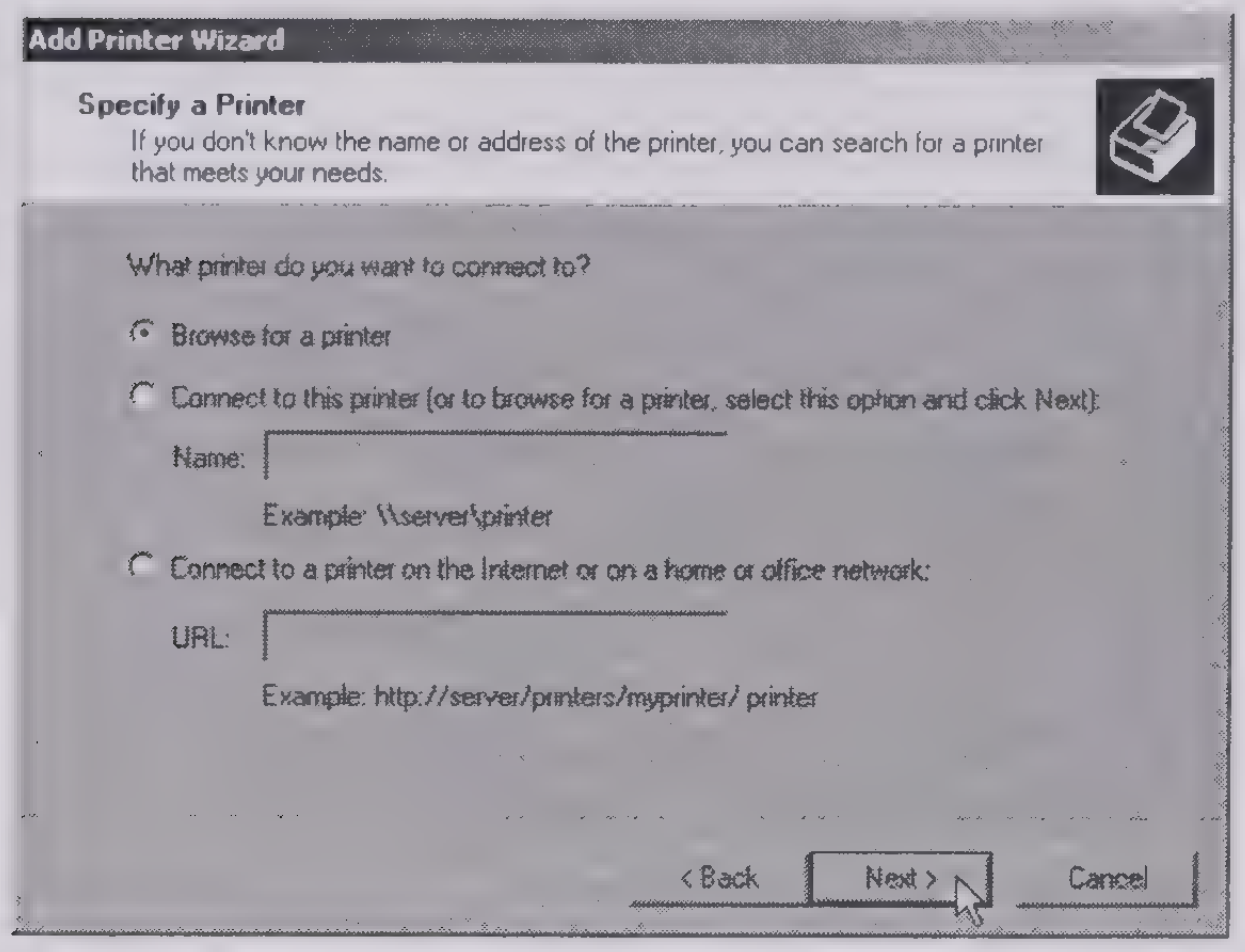

Specify a Printer
If you don't know the name or address of the printer, you can search for a printer that meets your needs.

What printer do you want to connect to?

● Browse for a printer

○ Connect to this printer (or to browse for a printer, select this option and click Next):

Name:

Example: \\server\printer

○ Connect to a printer on the Internet or on a home or office network:

URL:

Example: http://server/printers/myprinter/ printer

- ➢ Click *Browse for a printer* and then *Next.*

  A list of selectable printers is displayed.

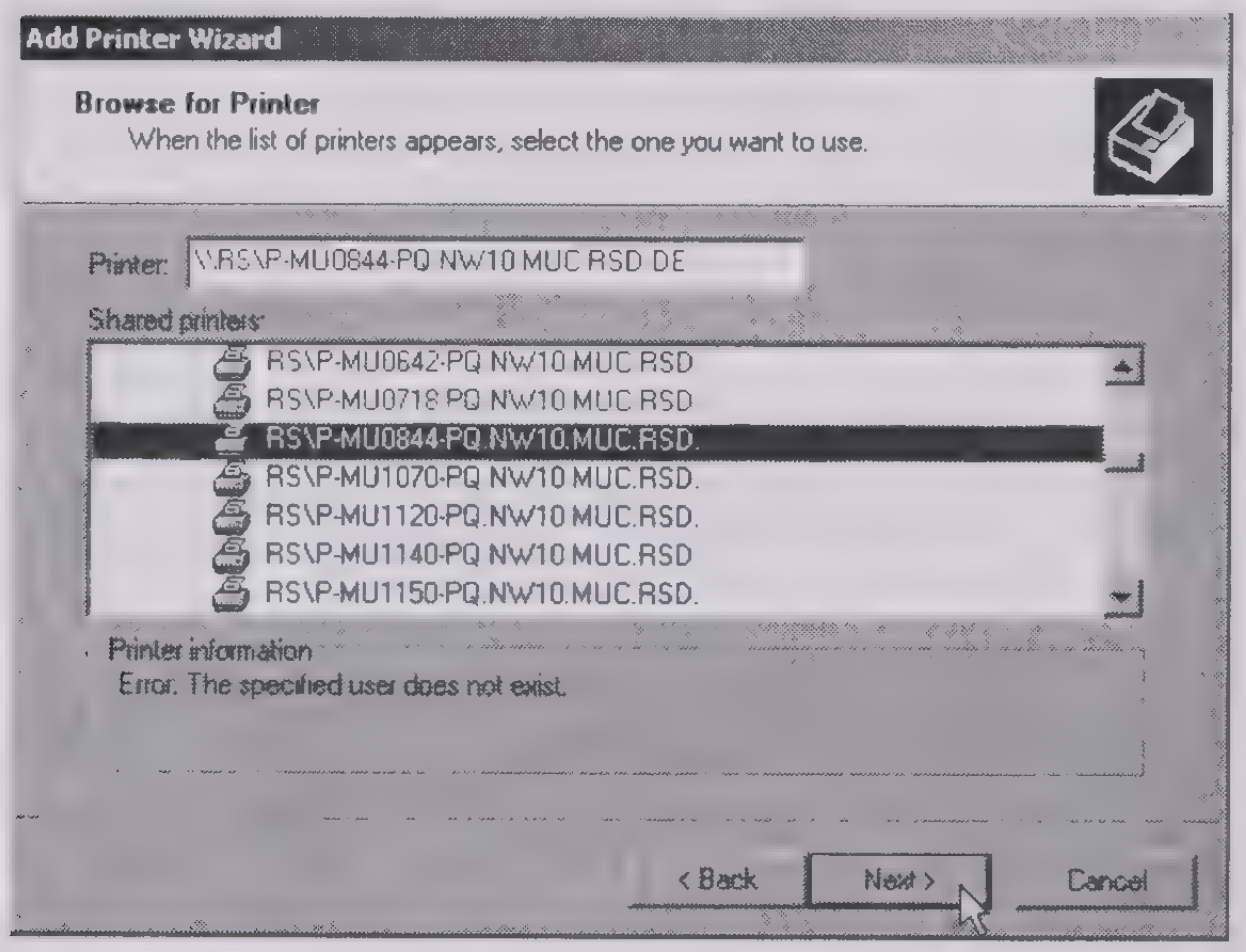

Browse for Printer
When the list of printers appears, select the one you want to use.

Printer: \\RS\P-MU0844-PQ.NW10.MUC.RSD.DE

Shared printers:
RS\P-MU0642-PQ.NW10.MUC.RSD.
RS\P-MU0718-PQ.NW10.MUC.RSD.
RS\P-MU0844-PQ.NW10.MUC.RSD.
RS\P-MU1070-PQ.NW10.MUC.RSD.
RS\P-MU1120-PQ.NW10.MUC.RSD.
RS\P-MU1140-PQ.NW10.MUC.RSD.
RS\P-MU1150-PQ.NW10.MUC.RSD.

Printer information
Error. The specified user does not exist.

- ➢ Mark the desired printer and select it with OK.

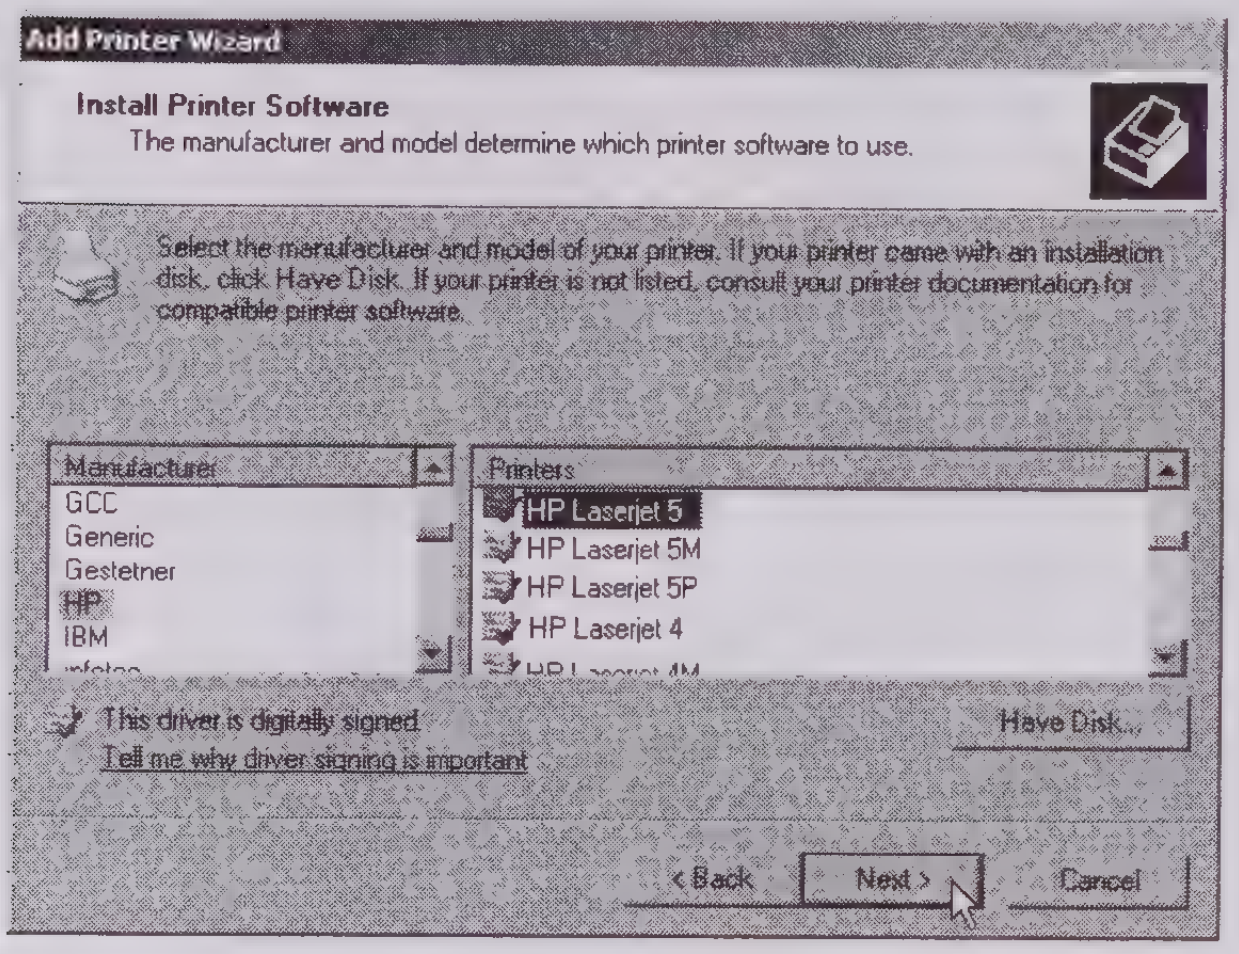

Install Printer Software
The manufacturer and model determine which printer software to use.

Select the manufacturer and model of your printer. If your printer came with an installation disk, click Have Disk. If your printer is not listed, consult your printer documentation for compatible printer software.

Manufacturer	Printers
GCC	HP Laserjet 5
Generic	HP Laserjet 5M
Gestetner	HP Laserjet 5P
HP	HP Laserjet 4
IBM	

This driver is digitally signed.
Tell me why driver signing is important

- ➢ Confirm the subsequent prompt to install a suitable printer driver with "OK". The list of available printer drivers is displayed.
  The manufacturers are listed in the left-hand table, the available printer drivers in the right-hand table.
- ➢ Select the manufacturer from the *Manufacturers* table and then the printer driver from the *Printers* table.

Note:
If the desired type of output device is not shown in the list, the driver has not yet been installed. In this case, click the "HAVE DISK" button. You will be prompted to insert a disk with the corresponding printer driver. Insert the disk, select "OK" and then choose the desired printer driver.

- ➢ Click *Next*.

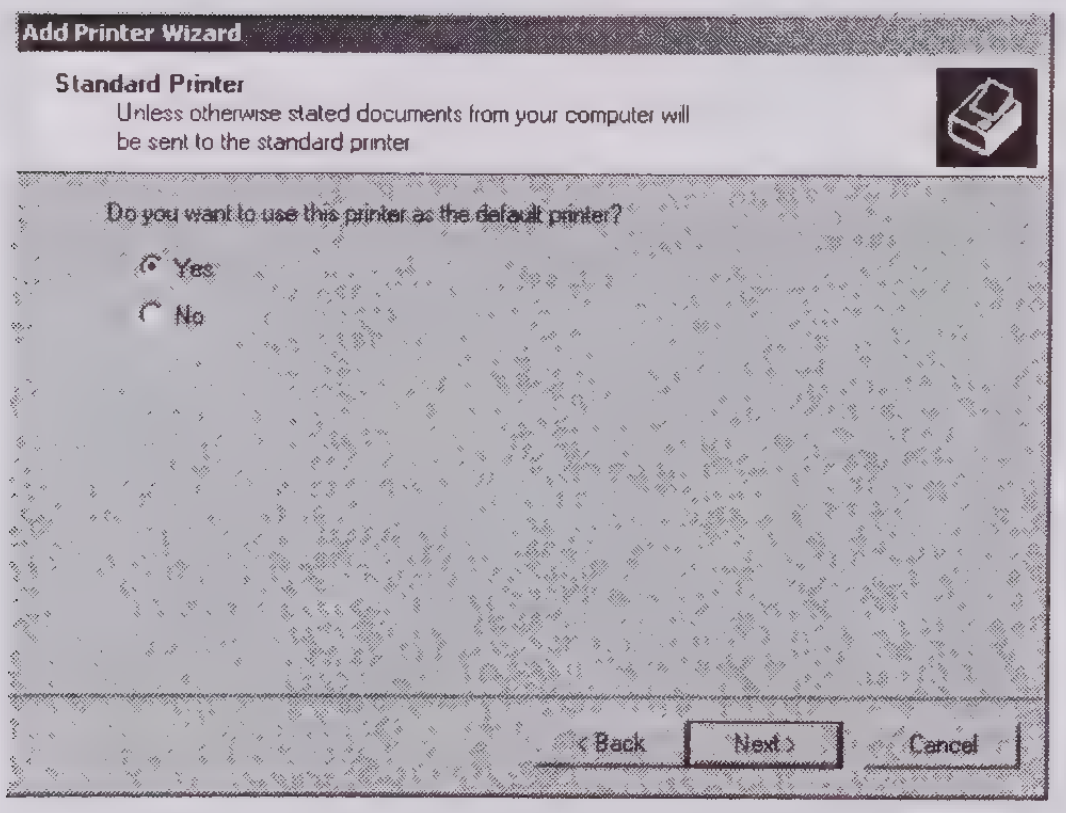

Standard Printer
Unless otherwise stated documents from your computer will be sent to the standard printer

Do you want to use this printer as the default printer?

● Yes
○ No

If one or more printers are already installed, a query is displayed whether the printer just installed should be used as the standard printer for the Windows XP applications. Default setting is *No.*

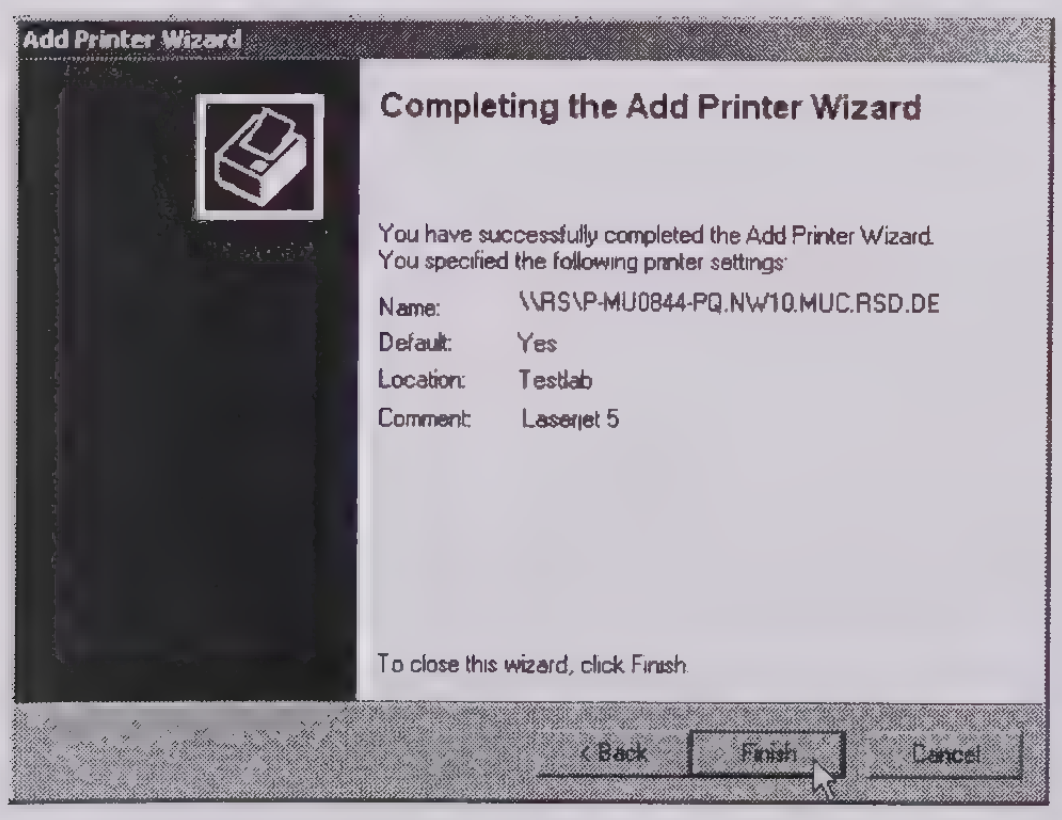

Completing the Add Printer Wizard

You have successfully completed the Add Printer Wizard.
You specified the following printer settings:

Name: \\RS\P-MU0844-PQ.NW10.MUC.RSD.DE
Default: Yes
Location: Testlab
Comment: Laserjet 5

To close this wizard, click Finish.

- ➢ Start the printer driver installation with *Finish*.

Finally, the instrument has to be configured for printout with this printer using the DEVICE SETUP and DEVICE 1/2 softkeys in the hardcopy main menu (see section "Selection of a Printer).

Tracking Generator - Option R&S FSU-B9

During normal operation (without a frequency offset), the tracking generator emits a signal exactly at the input frequency of the R&S FSMR.

For frequency-converting measurements it is possible to set a constant frequency offset of ±200 MHz between the receive frequency of the R&S FSMR and the output signal of the tracking generator. Moreover, an I/Q modulation or AM and FM modulation of the output signal can be provided using two analog input signals.

The output power is level-controlled and can be set in 0.1 dB steps in a range from -30 dBm to +5 dBm (-100 to + 5 dBm with option FSU-B12).

The tracking generator can be used in all operating modes. Acquisition of test setup calibration values (SOURCE CAL) and normalization using these correction values (*NORMALIZE*) is only possible in the *NETWORK* operating mode.

Note: *The RF characteristics of some DUTs is especially sensitive concerning the input VSWR. In such cases insertion of 20 dB attenuation between the DUT and the tracking generator output is highly recommended.*

The tracking generator is activated by means of the NETWORK hotkey in the hotkey bar at the bottom of the screen:



Tracking Generator Settings

The *NETWORK* hotkey opens a menu for selecting the functions of the tracking generator.

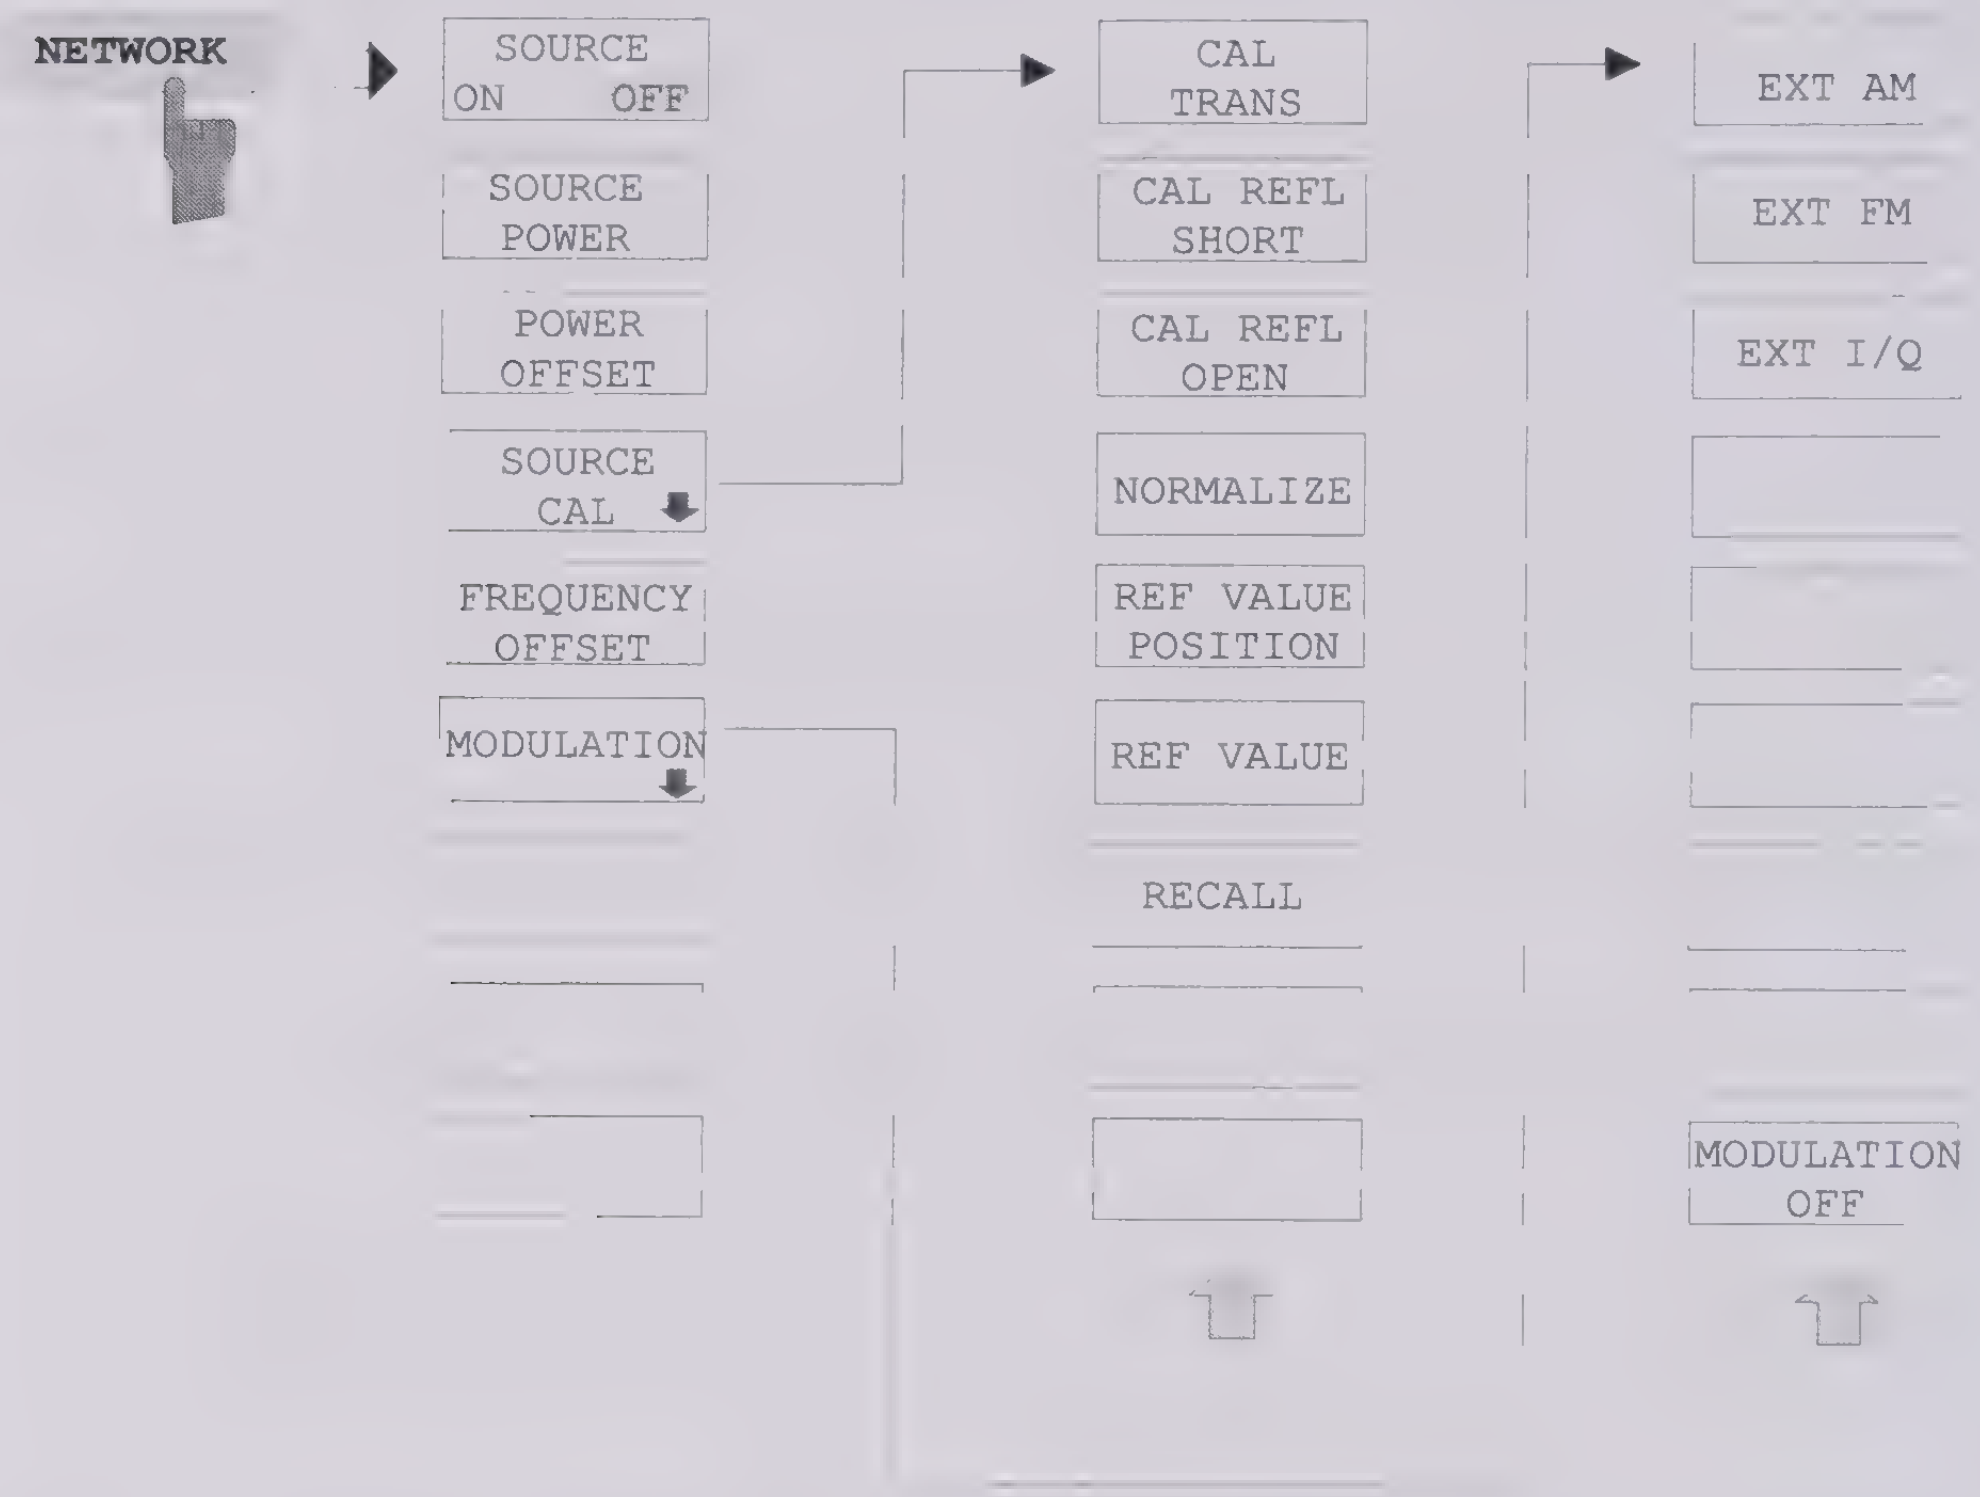

Note: *Additional softkeys are available in the displayed menus for controlling an external generator if option External Generator Control FSP-B10 is fitted. For detailed information see section 'External Generator Control Option FSP-B10'.*



The *SOURCE ON/OFF* softkey switches the tracking generator on or off. Default setting is *OFF*

Note:

- *When the tracking generator is switched on the maximum stop frequency is limited to 3.6 GHz. This upper limit is automatically reduced by a frequency offset set up for the tracking generator.*
- *In order to meet the data sheet accuracy for measurements with active tracing generetor the start frequency must be set to ≥ 3 x Resolution Bandwidth.*
- *The minimum sweeptime for measurements with data sheet accuracy is 100 ms in frequency domain (span > 0 Hz). Selecting a sweeptime below this limit will result in the sweeptime indicator field SWT being supplied with a red asterisc and the message UNCAL being displayed.*
- *FFT filters (FILTER TYPE FFT in BW menu) are not available when the tracking generator is active.*

IEC/IEEE-bus command: `OUTP:STAT ON`



The *SOURCE POWER* softkey allows the tracking generator output power to be selected.
The output power can be set in 0.1 dB steps from -30 dBm to +5 dBm (-100 to + 5 dBm with option FSU-B12).

If the tracking generator is off, it is automatically switched on when an output power value is entered.

The default output power is -20 dBm.

IEC/IEEE-bus command: `SOUR:POW -20dBm`



The *POWER OFFSET* softkey allows selection of a constant level offset for the tracking generator.

With this offset for example attenuators or amplifiers at the output connector of the tracking generator can be taken into account for the displayed output power values on screen or during data entry.

The valid range is -200 dB to +200 dB in 0.1 dB steps. Positive offsets apply to an amplifier and negative offsets to an attenuator subsequent to the tracking generator.
The default setting is 0 dB. Offsets <> 0 will display the enhancement label **LVL**.

IEC/IEEE-bus command: `SOUR:POW:OFFS -10dB`

Transmission Measurement

This measurement will yield the transmission characteristics of a two-port network. The built-in tracking generator serves as a signal source. It is connected to the input connector of the DUT. The input of the R&S FSMR is fed from the output of the DUT.

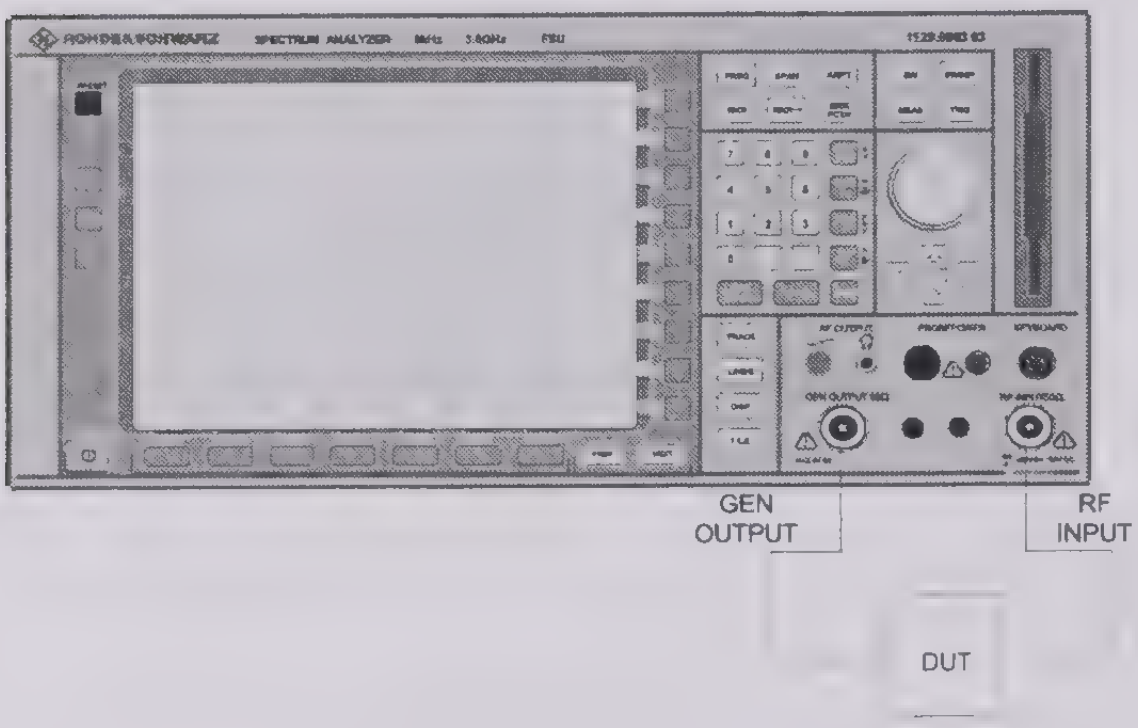

Fig. 4.22-1 Test setup for transmission measurement

A calibration can be carried out to compensate for the effects of the test setup (eg frequency response of connecting cables).

Calibration of Transmission Measurement

NETWORK menu:

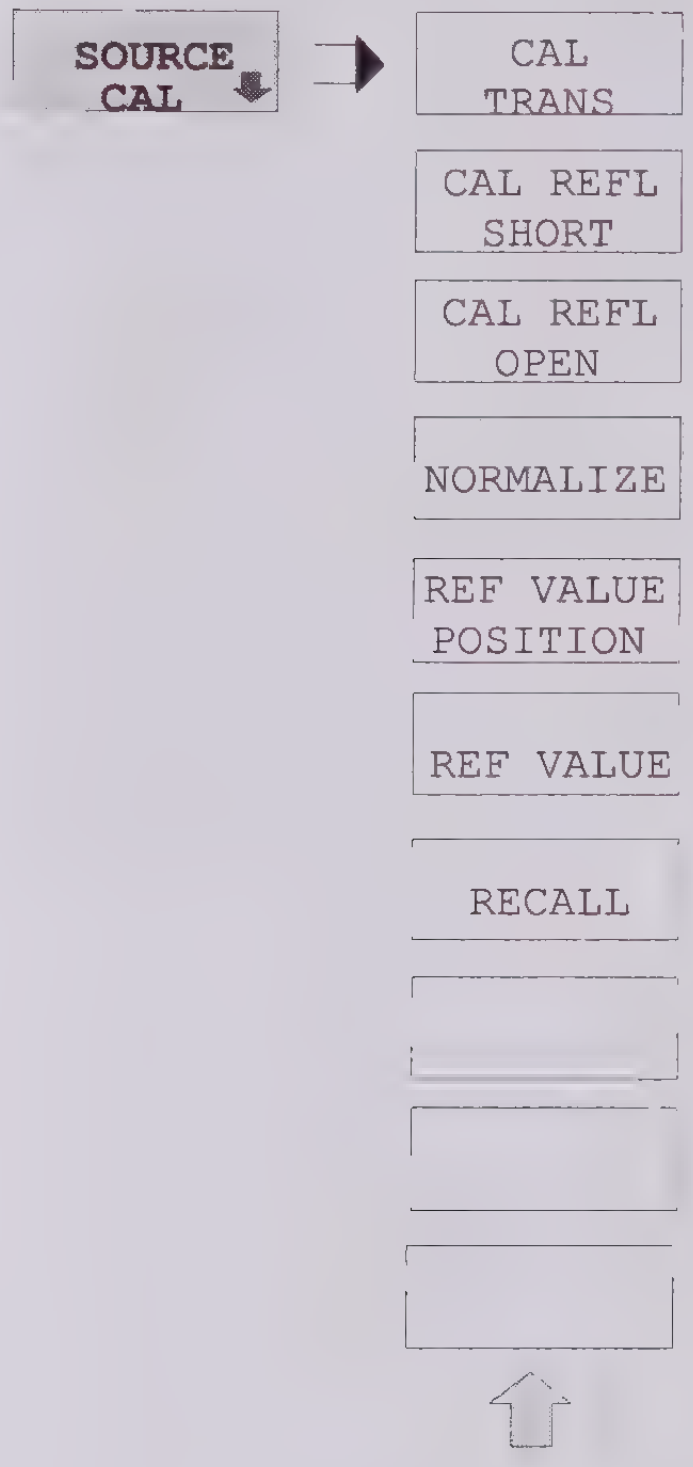

The *SOURCE CAL* softkey opens a submenu comprising of the calibration functions for the transmission and reflection measurement.

The calibration of the reflection measurement (*CAL REFL...*) and its mechanisms are described in separate sections.

To carry out a calibration for transmission measurements the whole test setup is through-connected (THRU).

CAL TRANS

The *CAL TRANS* softkey triggers the calibration of the transmission measurement.

It starts a sweep that records a reference trace. This trace is then used to calculate the difference for the normalized values.

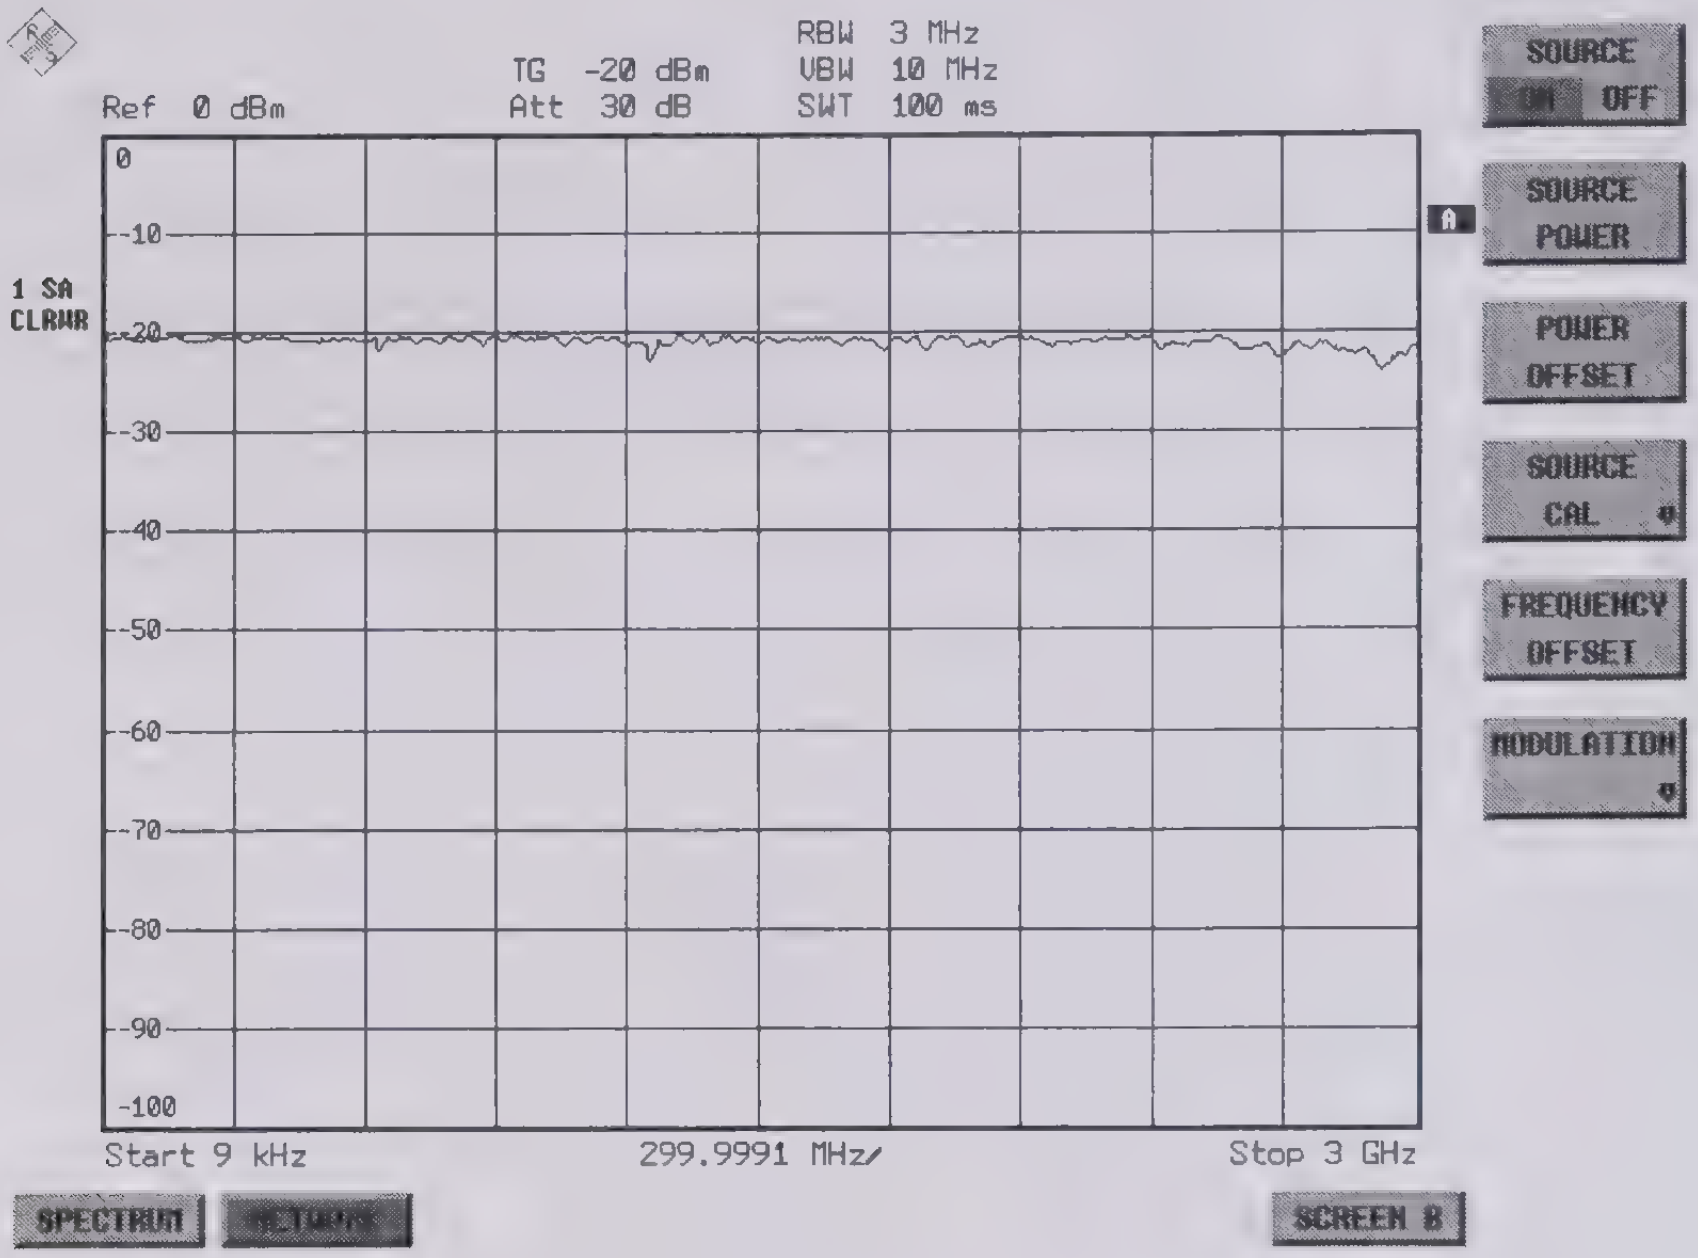

Fig. 4.22-2 Calibration curve for transmission measurement

During the calibration the following message is displayed:



SOURCE CAL
in progress

After the calibration the following message is displayed:



NOTE
calibration complete

This message will be cleared automatically after approx. 3 seconds.

IEC/IEEE-bus command: `CORR:METH TRAN`

Normalization

NETWORK-SOURCE CAL menu:

NORMALIZE

The *NORMALIZE* softkey switches the normalization on or off. The softkey is only available if the memory contains a correction trace.

It is possible to shift the relative reference point within the grid using the *REF VALUE POSITION* softkey. Thus, the trace can be shifted from the upper border of the grid to the vertical center of the grid:

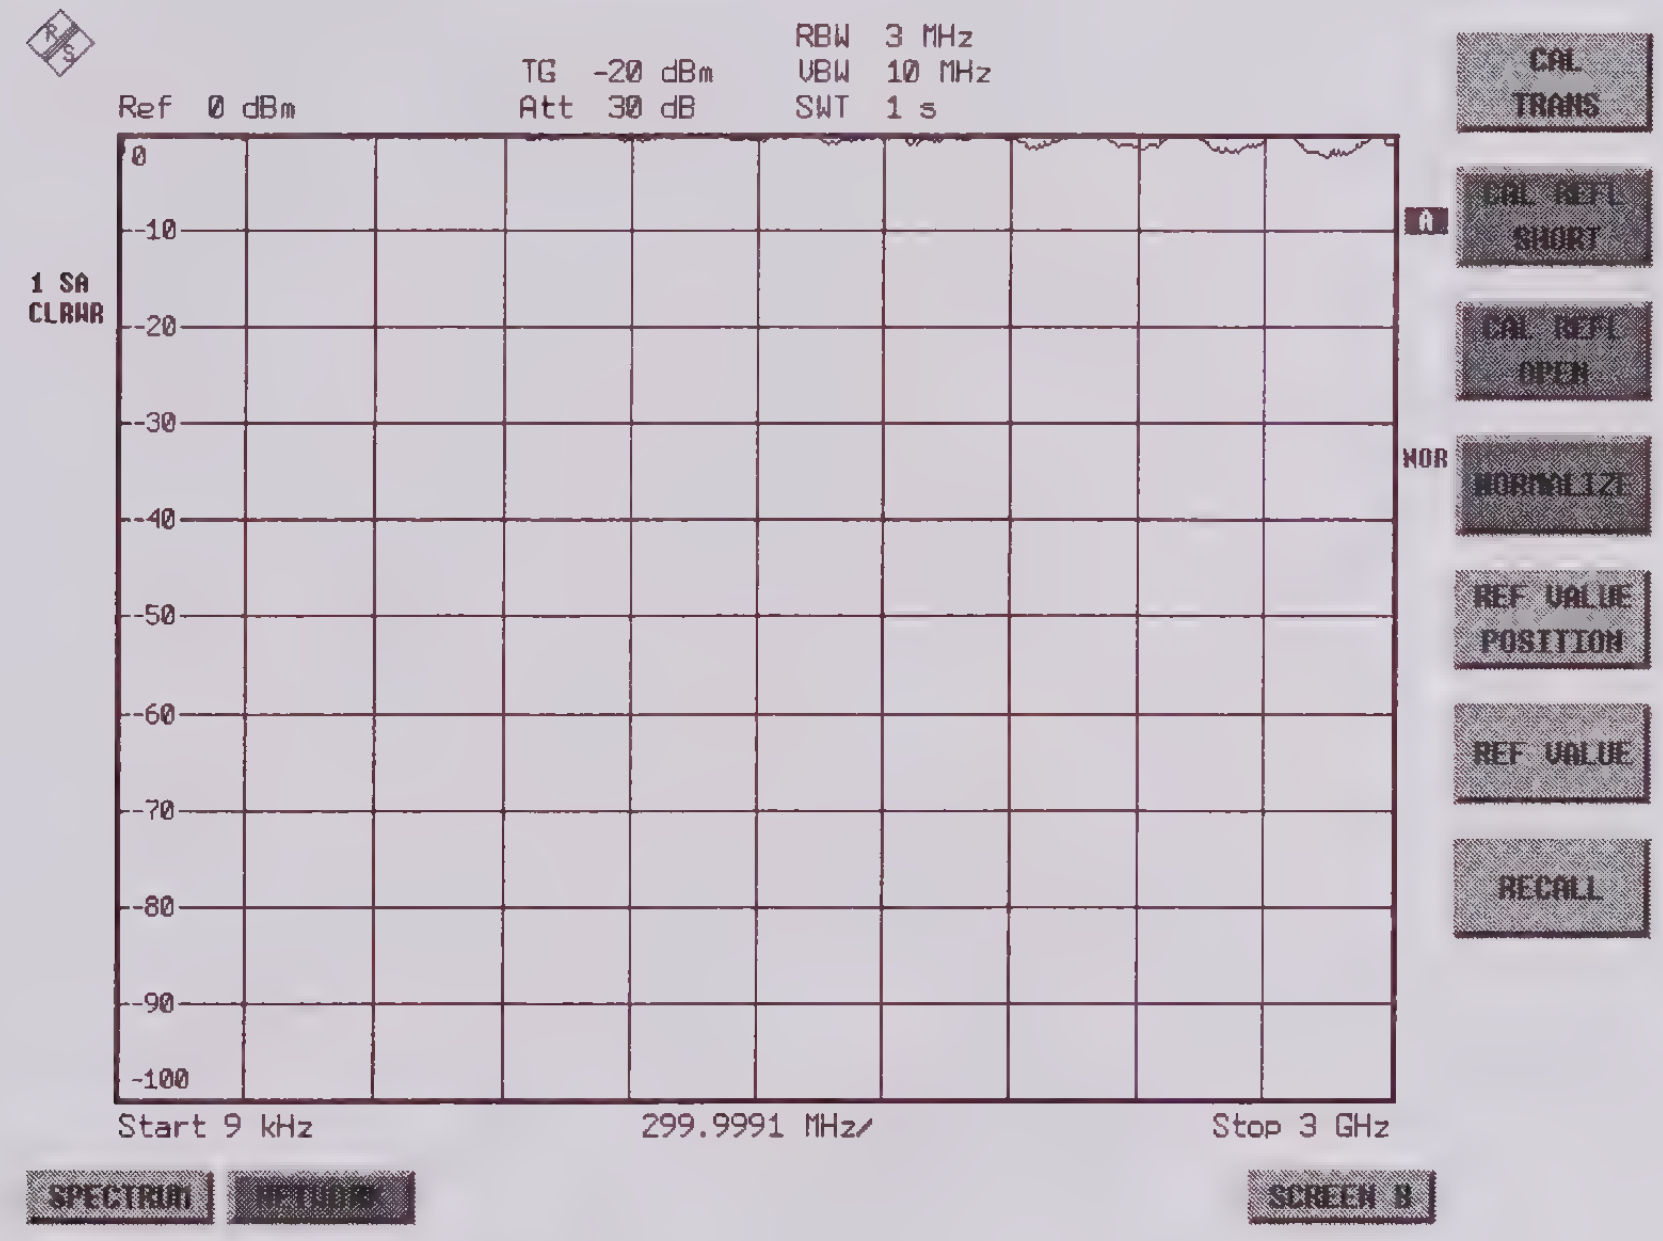

Fig. 4.22-3 Normalized display

In *SPLIT SCREEN* operation, the normalization is switched on in the currently active window. Different types of normalization can be active in the two windows.

Normalization is aborted when the *NETWORK* operating mode is quit.

IEC/IEEE-bus command: `CORR ON`

REF VALUE POSITION

The *REF VALUE POSITION* softkey marks a reference position in the active window at which the normalization result (calculated difference with a reference trace) is displayed.

If no reference line is active, the softkey switches on a reference line and activates the input of its position. The line can be moved within the grid boundaries.
The reference line is switched off by pressing the softkey again.

The function of the reference line is explained in the section "Calibration mechanisms".

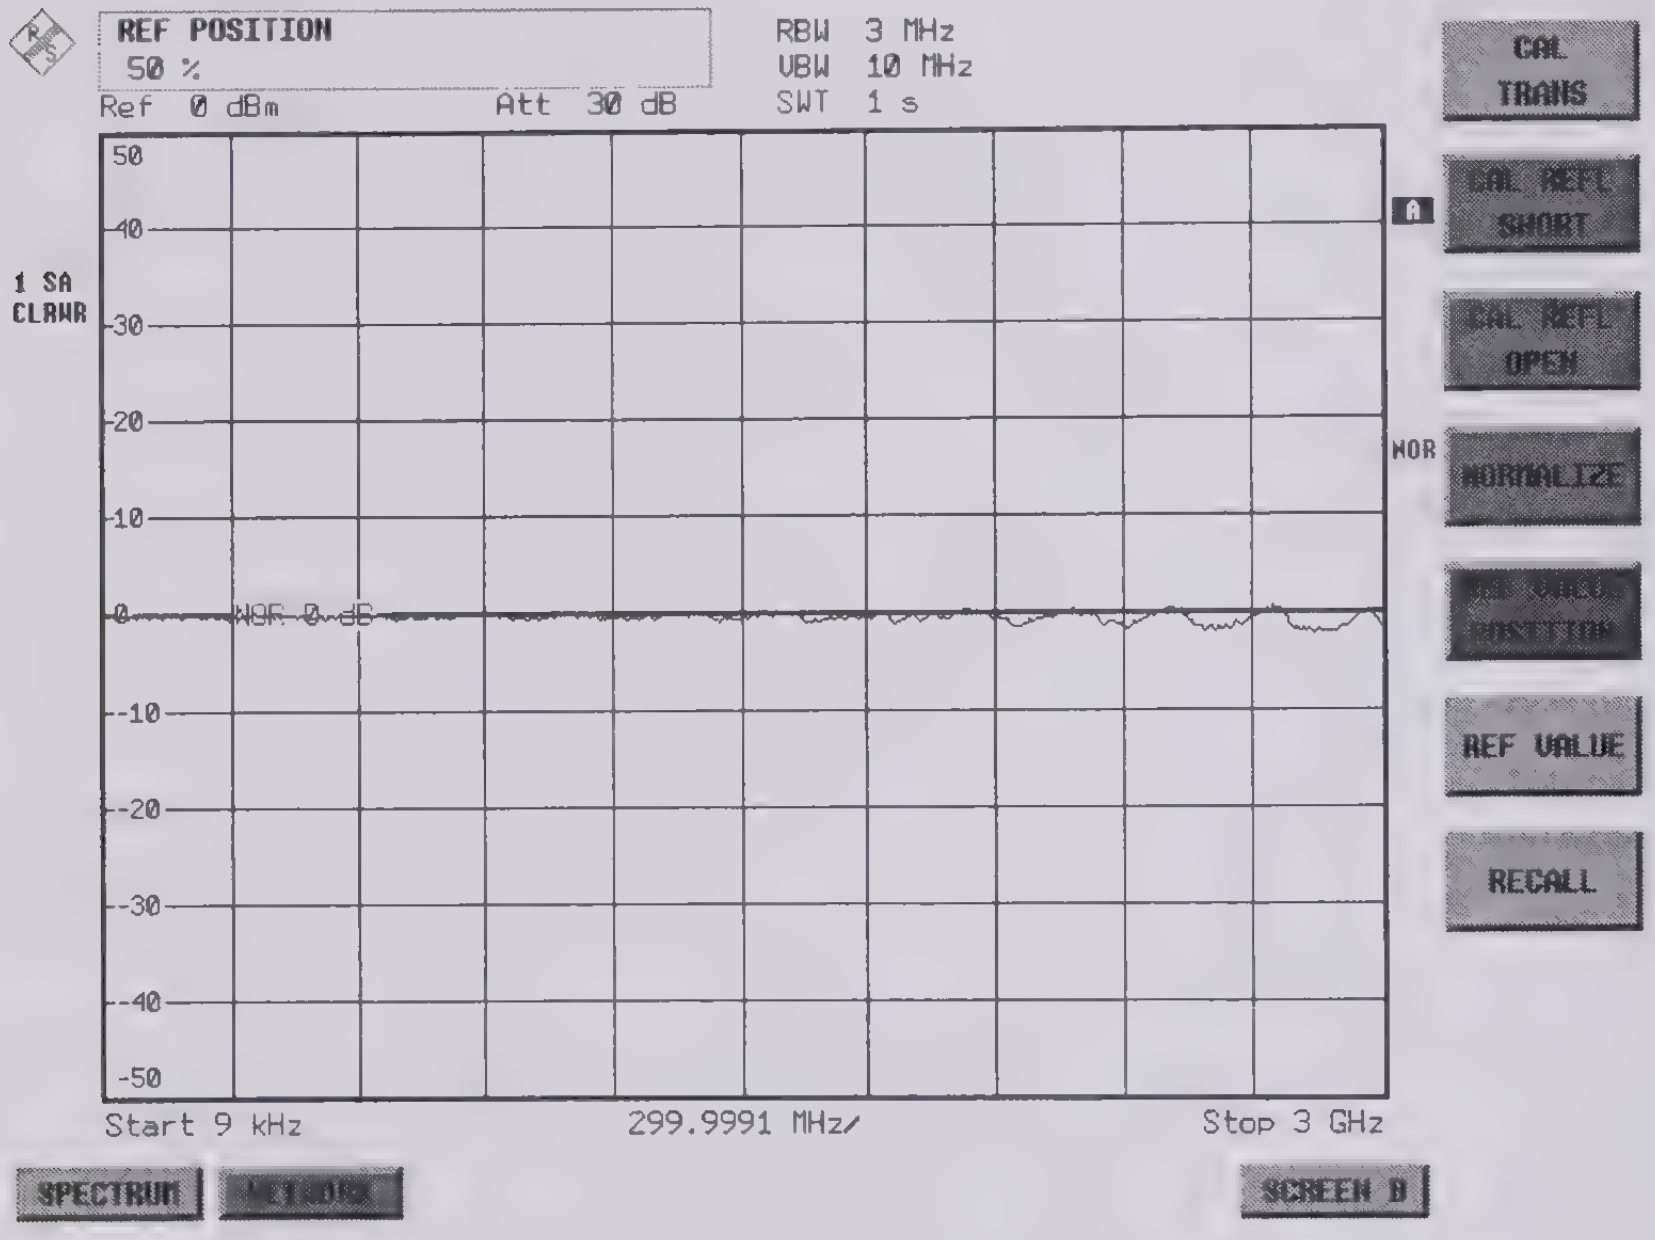

REF POSITION 50 %

Ref 0 dBm Att 30 dB

RBW 3 MHz
VBW 10 MHz
SWT 1 s

Start 9 kHz 299.9991 MHz/ Stop 3 GHz

Fig. 4.22-4 Normalized measurement, shifted with *REF VALUE POSITION* 50 %

IEC/IEEE-bus command: `DISP:WIND:TRAC:Y:RPOS 10PCT`

REF VALUE POSITION

The *REF VALUE* softkey activates the input of a value which is assigned to the reference line.

With default settings the reference line corresponds to a difference of 0 dB between the currently measured trace and the reference trace. Setting the *REF VALUE* to a different value helps to compensate for changes to the level conditions in the signal path after the calibration data have been recorded. If eg after a source calibration a 10 dB attenuation is inserted into the signal path between DUT and R&S FSMR input, the measurement trace will be moved by 10 dB down. Entering a *REF VALUE* of –10 dB will then result in the reference line for difference calculation being moved by 10 dB down as well. This means that the measured trace will be placed on it, as displayed in figure 4-20.

REF VALUE always refers to the active window.

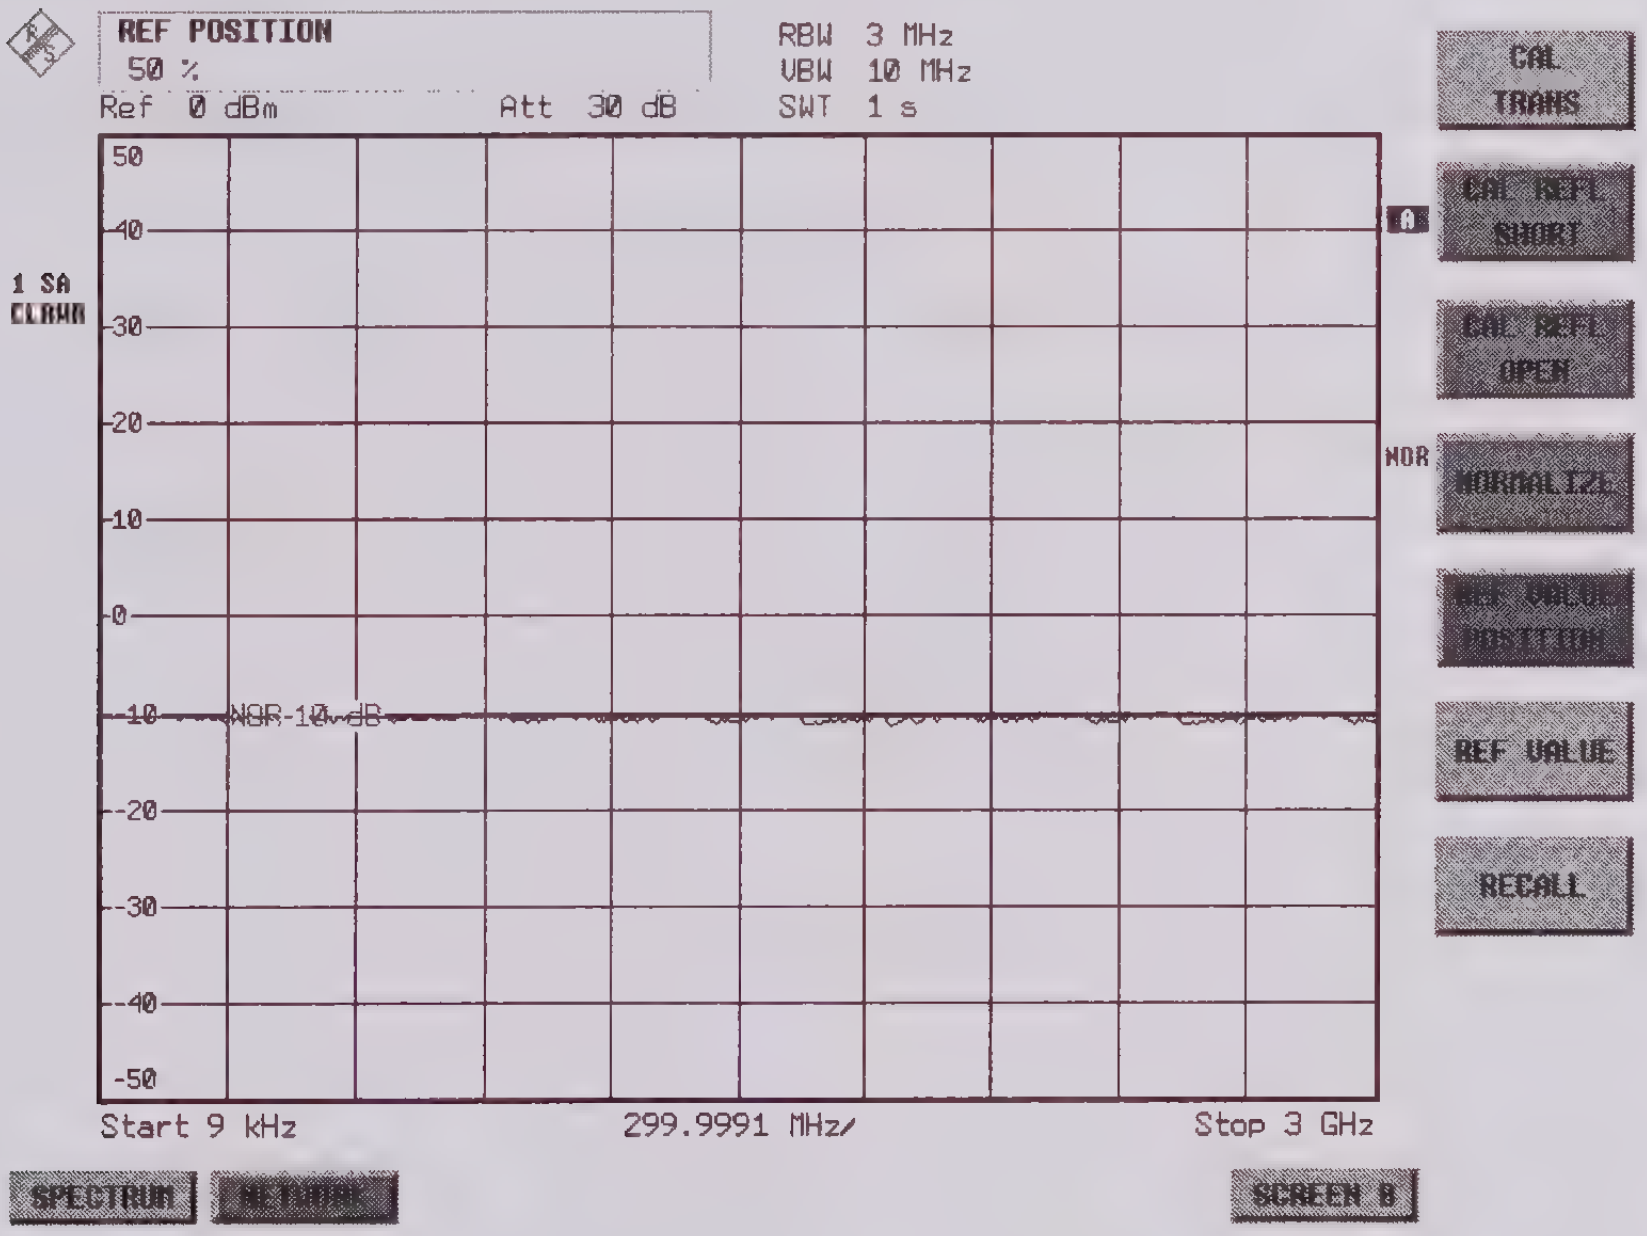

REF POSITION
50 %

RBW 3 MHz
VBW 10 MHz
SWT 1 s

Ref 0 dBm
Att 30 dB

Start 9 kHz
299.9991 MHz/
Stop 3 GHz

Fig. 4.22-5 Measurement with REF VALUE -10 dB and REF VALUE POSITION 50%

After the reference line has been moved by entering a *REF VALUE* of –10 dB the deviation from the nominal power level can be displayed with high resolution (eg 1 dB/div). The power is still displayed in absolute values, which means that in the above example 1 dB below the nominal power (reference line) = 11 dB attenuation.

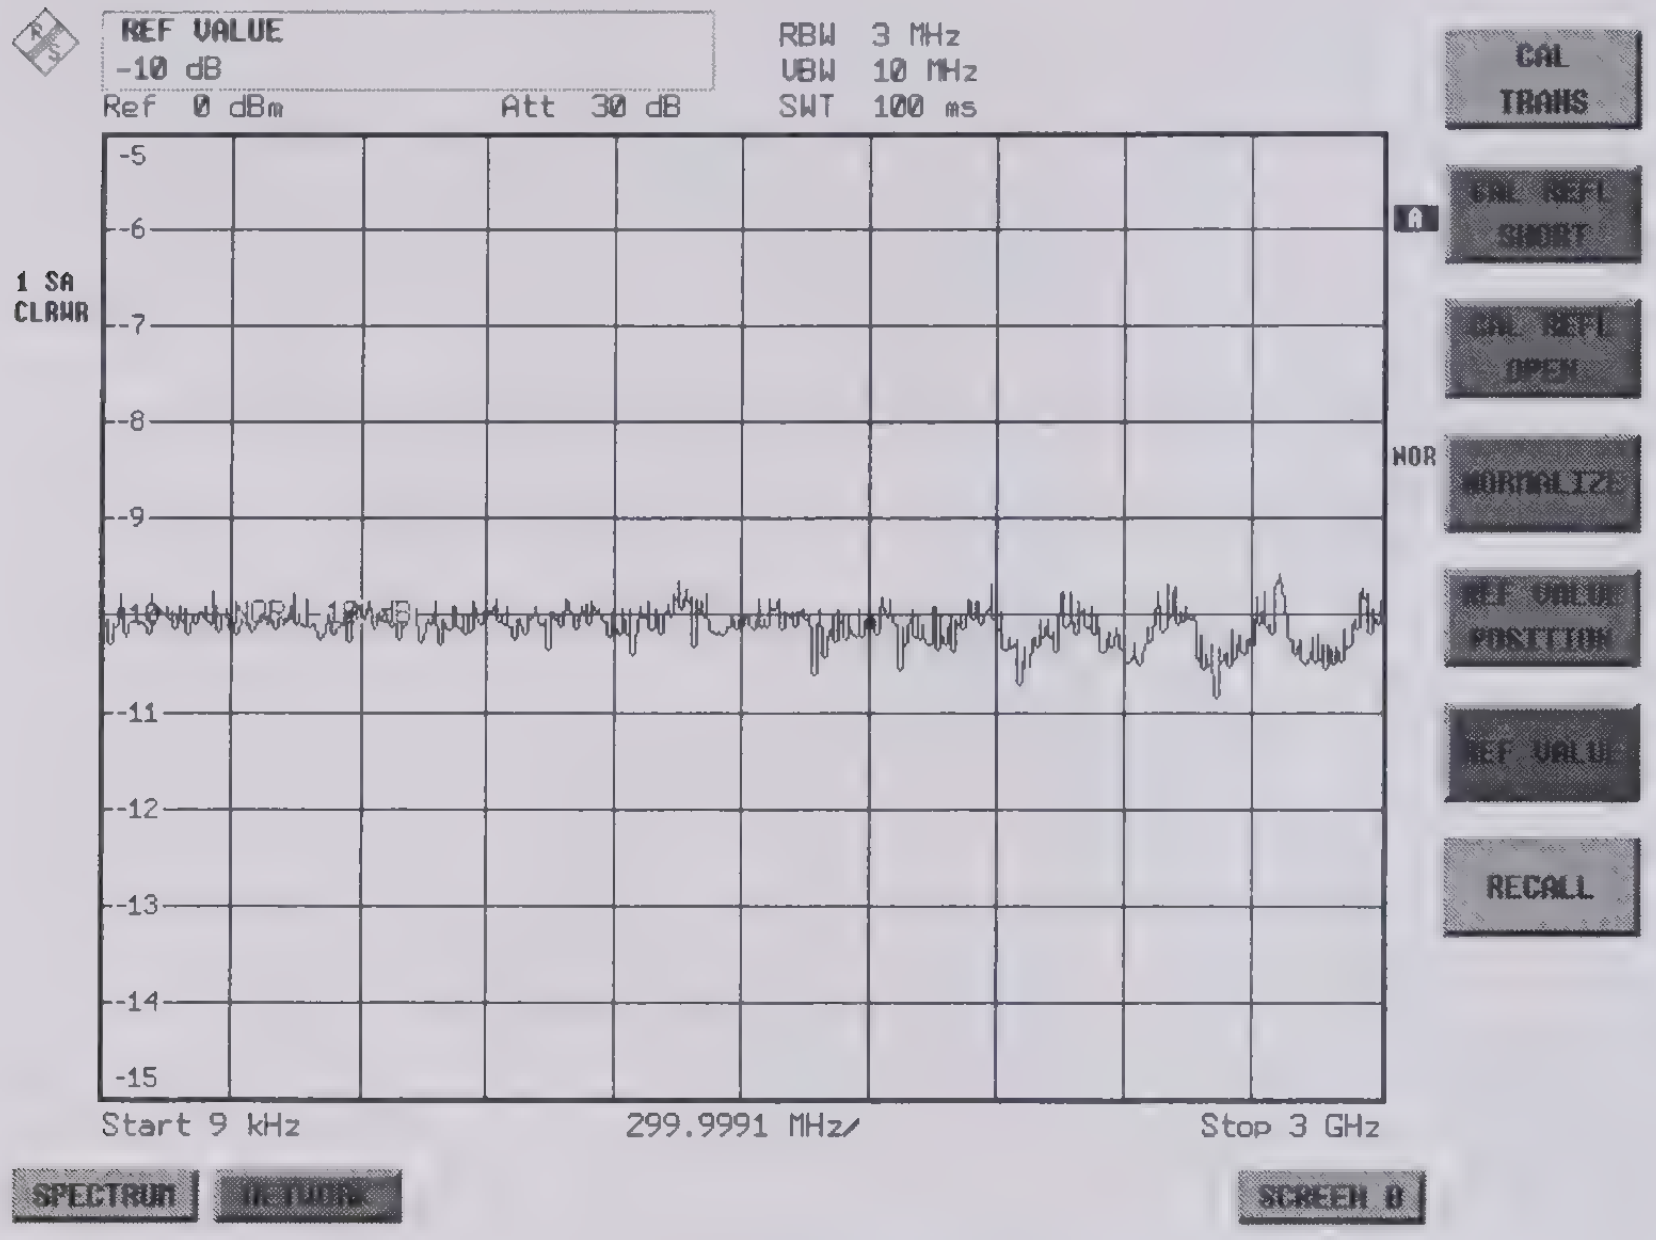
REF VALUE -10 dB
Ref 0 dBm
Att 30 dB
RBW 3 MHz
VBW 10 MHz
SWT 100 ms

Fig. 4.22-6 Measurement of a 10dB attenuator pad with 1dB/DIV

IEC/IEEE-bus command: `DISP:WIND:TRAC:Y:RVAL -10dB`

REF VALUE

The *RECALL* softkey restores the R&S FSMR settings that were used during source calibration.
This can be useful if device settings were changed after calibration (eg center frequency, frequency deviation, reference level, etc).

The softkey is only available if:

- the NETWORK mode has been selected
- the memory contains a calibration dataset.

IEC/IEEE-bus command: `CORR:REC`

Reflection Measurement

Scalar reflection measurements can be carried out by means of a reflection-coefficient measurement bridge.

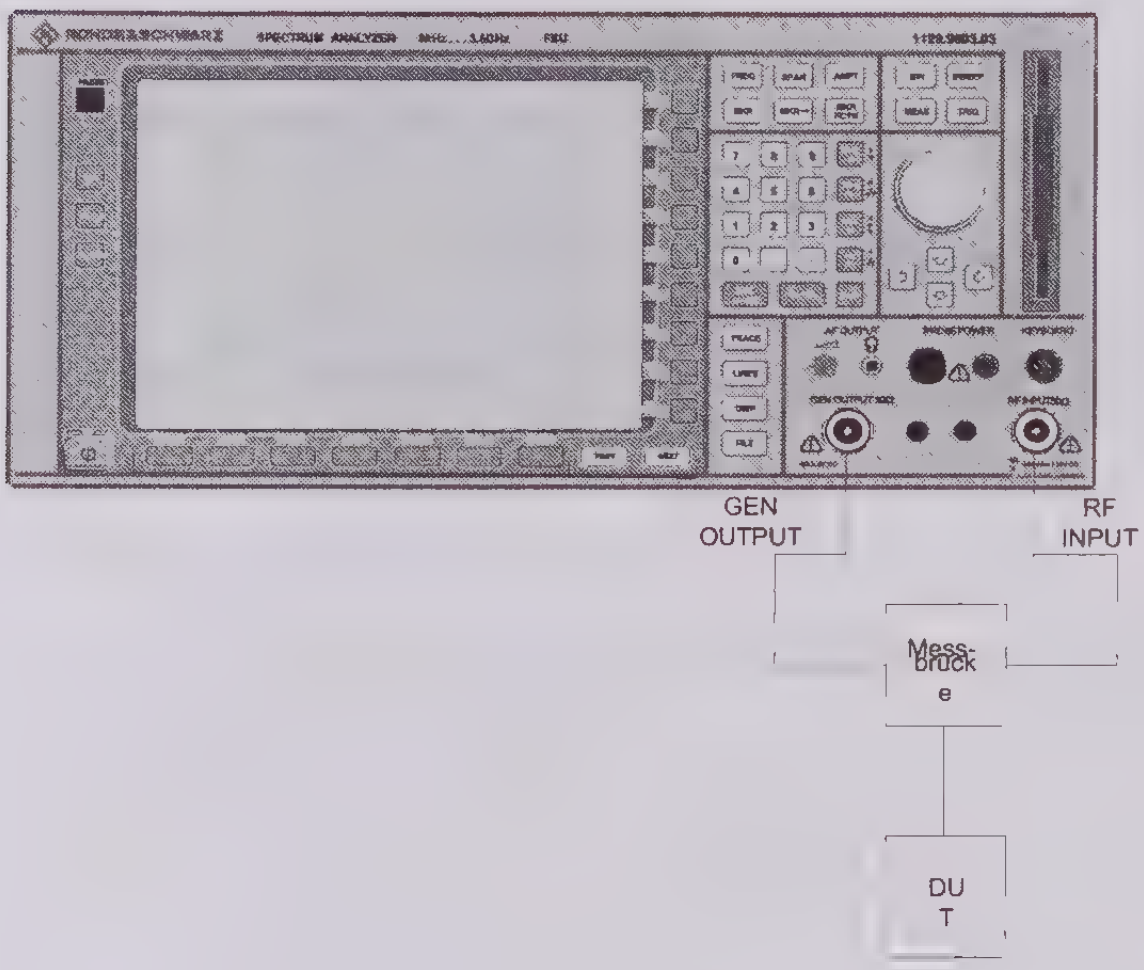

Fig. 4.22-7 Test Setup for Reflection Measurement

Calibration of Reflection Measurement

The calibration mechanism for reflection measurement is basically the same as the one used for transmission measurement.

NETWORK-SOURCE CAL submenu

The *CAL REFL OPEN* softkey starts the open-circuit calibration. During calibration the following message is displayed:


SOURCE CAL

in progress

IEC/IEEE-bus command: `CORR:METH REFL`
`CORR:COLL OPEN`

The *CAL REFL SHORT* softkey starts the short-circuit calibration.

If both calibrations (open circuit, short circuit) are carried out, the calibration curve is calculated by averaging the two measurements and stored in the memory. The order of the two calibration measurements is free.

After the calibration the following message is displayed:


NOTE

calibration complete

The message is cleared after approx. 3 seconds.

IEC/IEEE-bus command: `CORR:METH REFL`

Calibration mechanism

Calibration means a calculation of the difference between the currently measured power and a reference curve, independent of the selected type of measurement (transmission/reflection). The hardware settings used for measuring the reference curve are included in the reference dataset.

Even with normalization switched on, the device settings can be changed in a wide area without stopping the normalization. This reduces the necessity to carry out a new normalization to a minimum.

For this purpose the reference dataset (trace with 625 measured values) is stored internally as a table of 625 points (frequency/level).
Differences in level settings between the reference curve and the current device settings are taken into account automatically. If the span is reduced, a linear interpolation of the intermediate values is applied. If the span increases, the values at the left or right border of the reference dataset are extrapolated to the current start or stop frequency, ie the reference dataset is extended by constant values.
An enhancement label is used to mark the different levels of measurement accuracy. This enhancement label is displayed at the right diagram border when normalization is switched on and a deviation from the reference setting occurs. Three accuracy levels are defined:

Table 4.22-1 Measurement accuracy levels

Accuracy	**Enhancement label**	**Reason/Limitation**
High	NOR	No difference between reference setting and measurement
Medium	APX (approximation)	Change of the following settings: • coupling (RBW, VBW, SWT) • reference level, RF attenuation • start or stop frequency • output level of tracking generator • frequency offset of tracking generator • detector (max. peak, min. peak, sample, etc.) Change of frequency: • max. 625 points within the set sweep limits (corresponds to a doubling of the span)
-	Aborted normalization	• more than 624 extrapolated points within the current sweep limits (in case of span doubling)

Note: *At a reference level (REF LEVEL) of -10 dBm and at a tracking generator output level of the same value the R&S FSMR operates without overrange reserve, ie the R&S FSMR is in danger of being overloaded if a signal is applied whose amplitude is higher than the reference line. In this case, either the message "OVLD" for overload is displayed in the status line or the display range is exceeded (clipping of the trace at the upper diagram border = Overrange).*

Overloading can be avoided as follows:

- *Reducing the output level of the tracking generator (SOURCE POWER, NETWORK menu)*
- *Increasing the reference level (REF LEVEL, AMPT menu)*

Frequency-Converting Measurements

For frequency-converting measurements (eg on converter units) the tracking generator is able to set a constant frequency offset between the output frequency of the tracking generator and the receive frequency of the R&S FSMR.

Up to an output frequency of 200 MHz the measurement can be carried out in both inverted and normal positions.

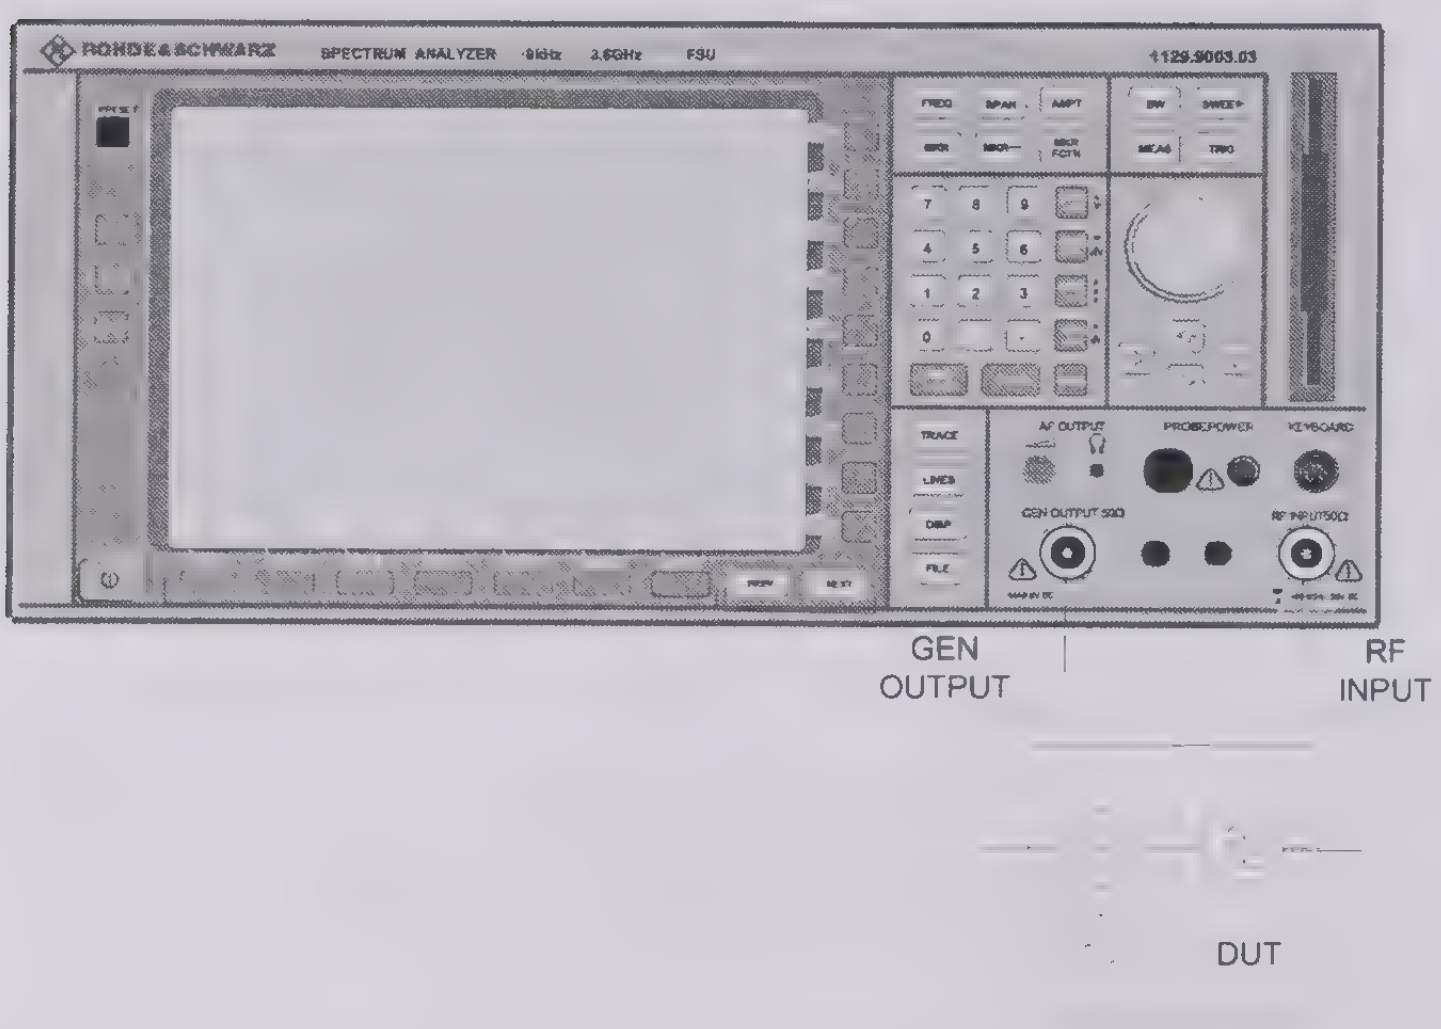

Fig. 4.22-8 Test setup for frequency converting measurements

NETWORK menu

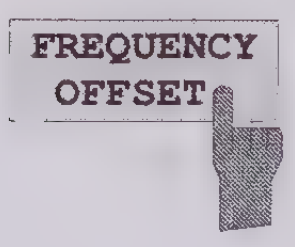

The *FREQUENCY OFFSET* softkey activates the input of the frequency offset between the output signal of the tracking generator and the input frequency of the R&S FSMR. Possible offsets are in a range of ±200 MHz in 0.1 Hz steps.
The default setting is 0 Hz. Offsets <> 0 Hz are marked with the enhancement label **FRQ**.

If a positive frequency offset is entered, the tracking generator generates an output signal above the receive frequency of the R&S FSMR. In case of a negative frequency offset it generates a signal below the receive frequency of the R&S FSMR. The output frequency of the tracking generator is calculated as follows:

Tracking generator frequency = receive frequency + frequency offset.

IEC/IEEE-bus command: `SOUR:FREQ:OFFS 50MHz`

External Modulation of the Tracking Generator

NETWORK menu:

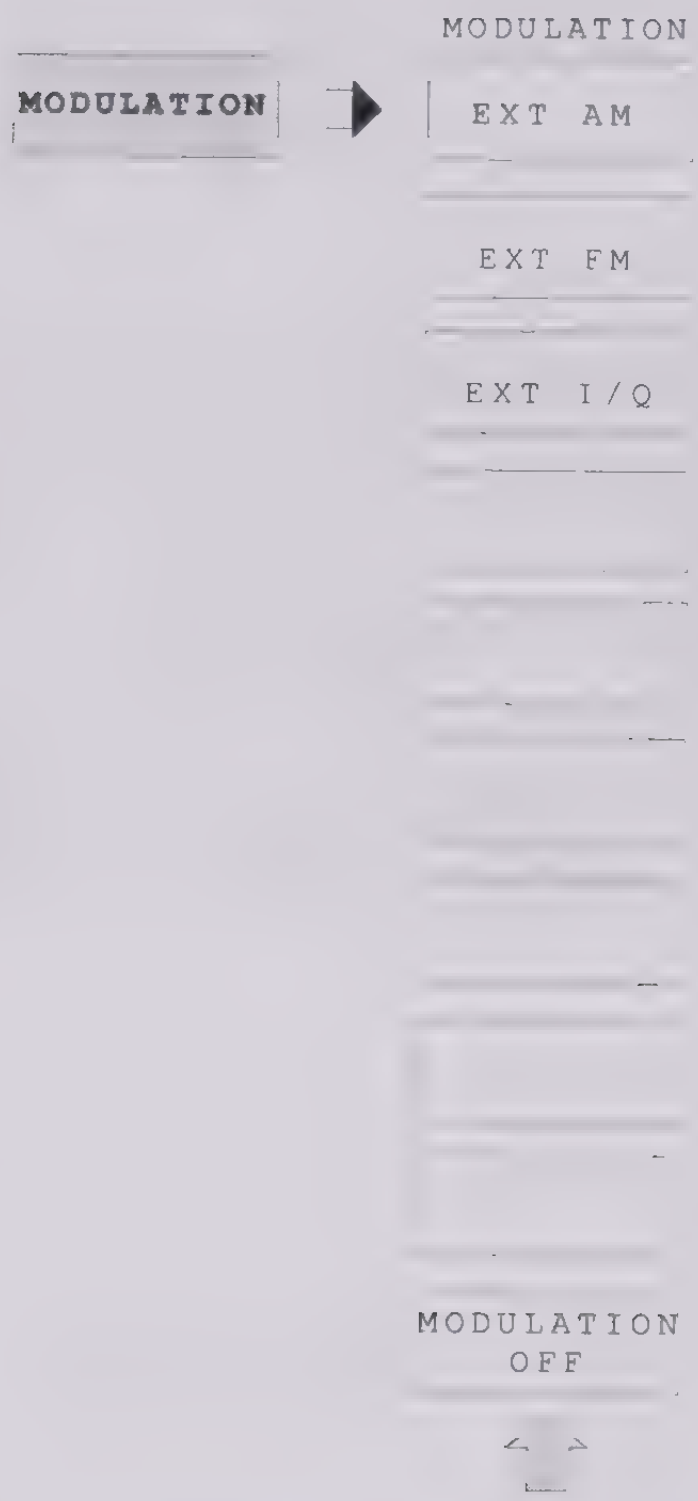

The *MODULATION* softkey opens a submenu for selecting different modulation modes.

The time characteristics of the tracking generator output signal can be influenced by means of external signals (input voltage range -1 V to +1 V).

Two BNC connectors at the rear panel are available as signal inputs. Their function changes depending on the selected modulation:

TG IN I / AM and

TG IN Q / FM

The modulation modes can be combined with each other and with the frequency offset function up to a certain degree. The following table shows which modulation modes are possible at the same time and which ones can be combined with the frequency offset function.

Table 4.22-2 Simultaneous modes of modulation (tracking generator)

Modulation	**Frequency offset**	**EXT AM**	**EXT FM**	**EXT I/Q**
Frequency offset	▨	•	•	•
EXT AM	•	▨	•	
EXT FM	•	•	▨	
EXT I/Q	•			▨

• = can be combined

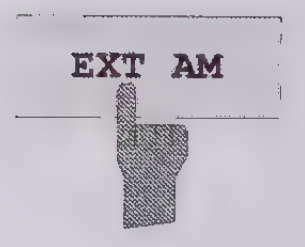

The *EXT AM* softkey activates an AM modulation of the tracking generator output signal.

The modulation signal is applied to the *TG IN I / AM* connector. An input voltage of 1 V corresponds to 100% amplitude modulation.

Switching on an external AM disables the following function:

- active I/Q modulation.

IEC/IEEE-bus command: `SOUR:AM:STAT ON`



The *EXT FM* softkey activates the FM modulation of the tracking generator output signal.

The modulation frequency range is 1 kHz to 100 kHz, the deviation can be set in 1-decade steps in the range of 100 Hz to 10 MHz at an input voltage of 1 V. The phase deviation η should not exceed the value 100.

$$\text{Phase deviation } \eta = \text{deviation / modulation frequency}$$

The modulation signal is applied to the TG IN Q / FM connector.

Switching on an external FM disables the following function:

- active I/Q modulation.

IEC/IEEE-bus command:

```
SOUR:FM:STAT ON
SOUR:FM:DEV  10MHz
```

EXT I/Q

The *EXT I/Q* softkey activates the external I/Q modulation of the tracking generator.

The signals for modulation are applied to the two input connectors *TG IN I* and *TG IN Q* at the rear panel of the unit. The input voltage range is ±1 V into 50 Ω.

Switching on an external I/Q modulation disables the following functions:

- active external AM
- active external FM

Functional description of the quadrature modulator:

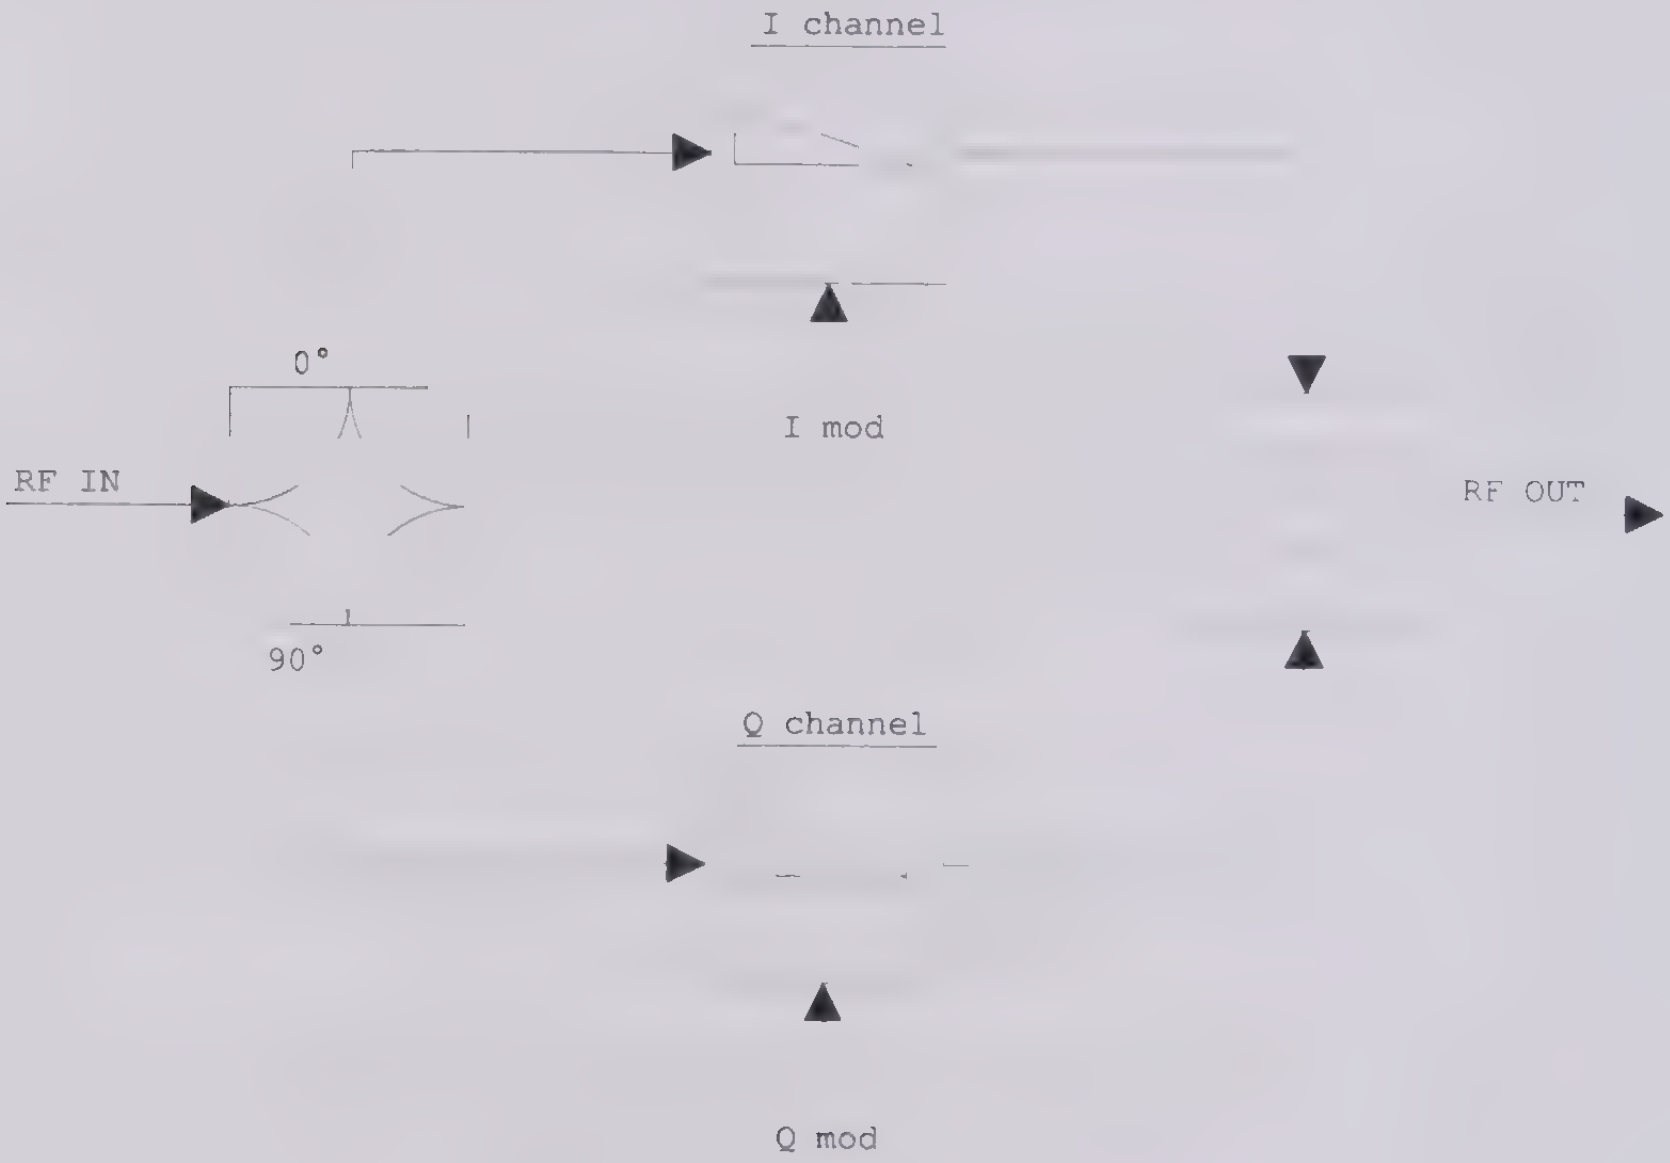

Fig. 4.22-9 I/Q modulation

I/Q modulation is performed by means of the built-in quadrature modulator. The RF signal is divided into two orthogonal I and Q components (inphase and quadrature phase). Amplitude and phase are controlled in each path by the I and Q modulation signal. By adding the two components an RF output signal is generated that can be controlled in amplitude and phase.

IEC/IEEE-bus command: `SOUR:DM:STAT ON`

MODULATION OFF

The *MODULATION OFF* softkey switches off the modulation of the tracking generator.

IEC/IEEE-bus command:

```
SOUR:AM:STAT OFF
SOUR:FM:STAT OFF
SOUR:DM:STAT OFF
```

External Generator Control

The external generator control option permits to operate a number of commercially available generators as tracking generator on the R&S FSMR. Thus, scalar network analysis with the R&S FSMR is also possible outside the frequency range of the internal tracking generator when the appropriate generators are used.

The R&S FSMR also permits to set a frequency offset for frequency-converting measurements when external generators are used. For harmonics measurements or frequency-converting measurements, it is also possible to enter a factor, by which the generator frequency is increased or reduced compared with the receive frequency of the R&S FSMR. Only make sure that the resulting generator frequencies do not exceed the allowed setting range of the generator.

The settable level range also depends on the generator used.
The generator is controlled via the – optional – second IECBUS interface of the R&S FSMR (= IEC2, supplied with the option) and, with some Rohde & Schwarz generators, additionally via the TTL synchronization interface included in the AUX interface of the R&S FSMR.

Note: *The use of the TTL interface enables considerably higher measurement rates as pure IECBUS control, because the frequency stepping of the R&S FSMR is directly coupled with the frequency stepping of the generator.*

Therefore, the frequency sweep differs according to the capabilities of the generator used:

- In the case of generators without TTL interface, the generator frequency is first set for each frequency point via IECBUS, then the setting procedure has to be completed before recording of measured values is possible.

- In the case of generators with TTL interface, a list of the frequencies to be set is entered into the generator before the beginning of the first sweep. Then the sweep is started and the next frequency point selected by means of the TTL handshake line TRIGGER. The recording of measured values is only enabled when the generator signals the end of the setting procedure via the BLANK signal. This method is considerably faster than pure IECBUS control.

With the "SELECT GENERATOR" softkey, a list of the supported generators with the frequency and level range as well as the capabilities used is included.

The external generator can be used in all operating modes. Recording of test setup calibration values (*SOURCE CAL*) and normalization with the correction values (*NORMALIZE*) are only possible in the *NETWORK* mode.

Note: *In order to enhance measurement accuracy a common reference frequency should be used for both the R&S FSMR and the generator. If no independent 10 MHz reference frequency is available, it is recommended to connect the reference output of the generator with the reference input of the R&S FSMR and to enable usage of the external Reference on the R&S FSMR via SETUP – REFERENCE EXT.*

Like the internal tracking generator, the external generator is activated by means of the *NETWORK* hotkey in the hotkey bar at the screen bottom:

External Generator Settings

The *NETWORK* hotkey opens the menu for setting the functions of the external generator.

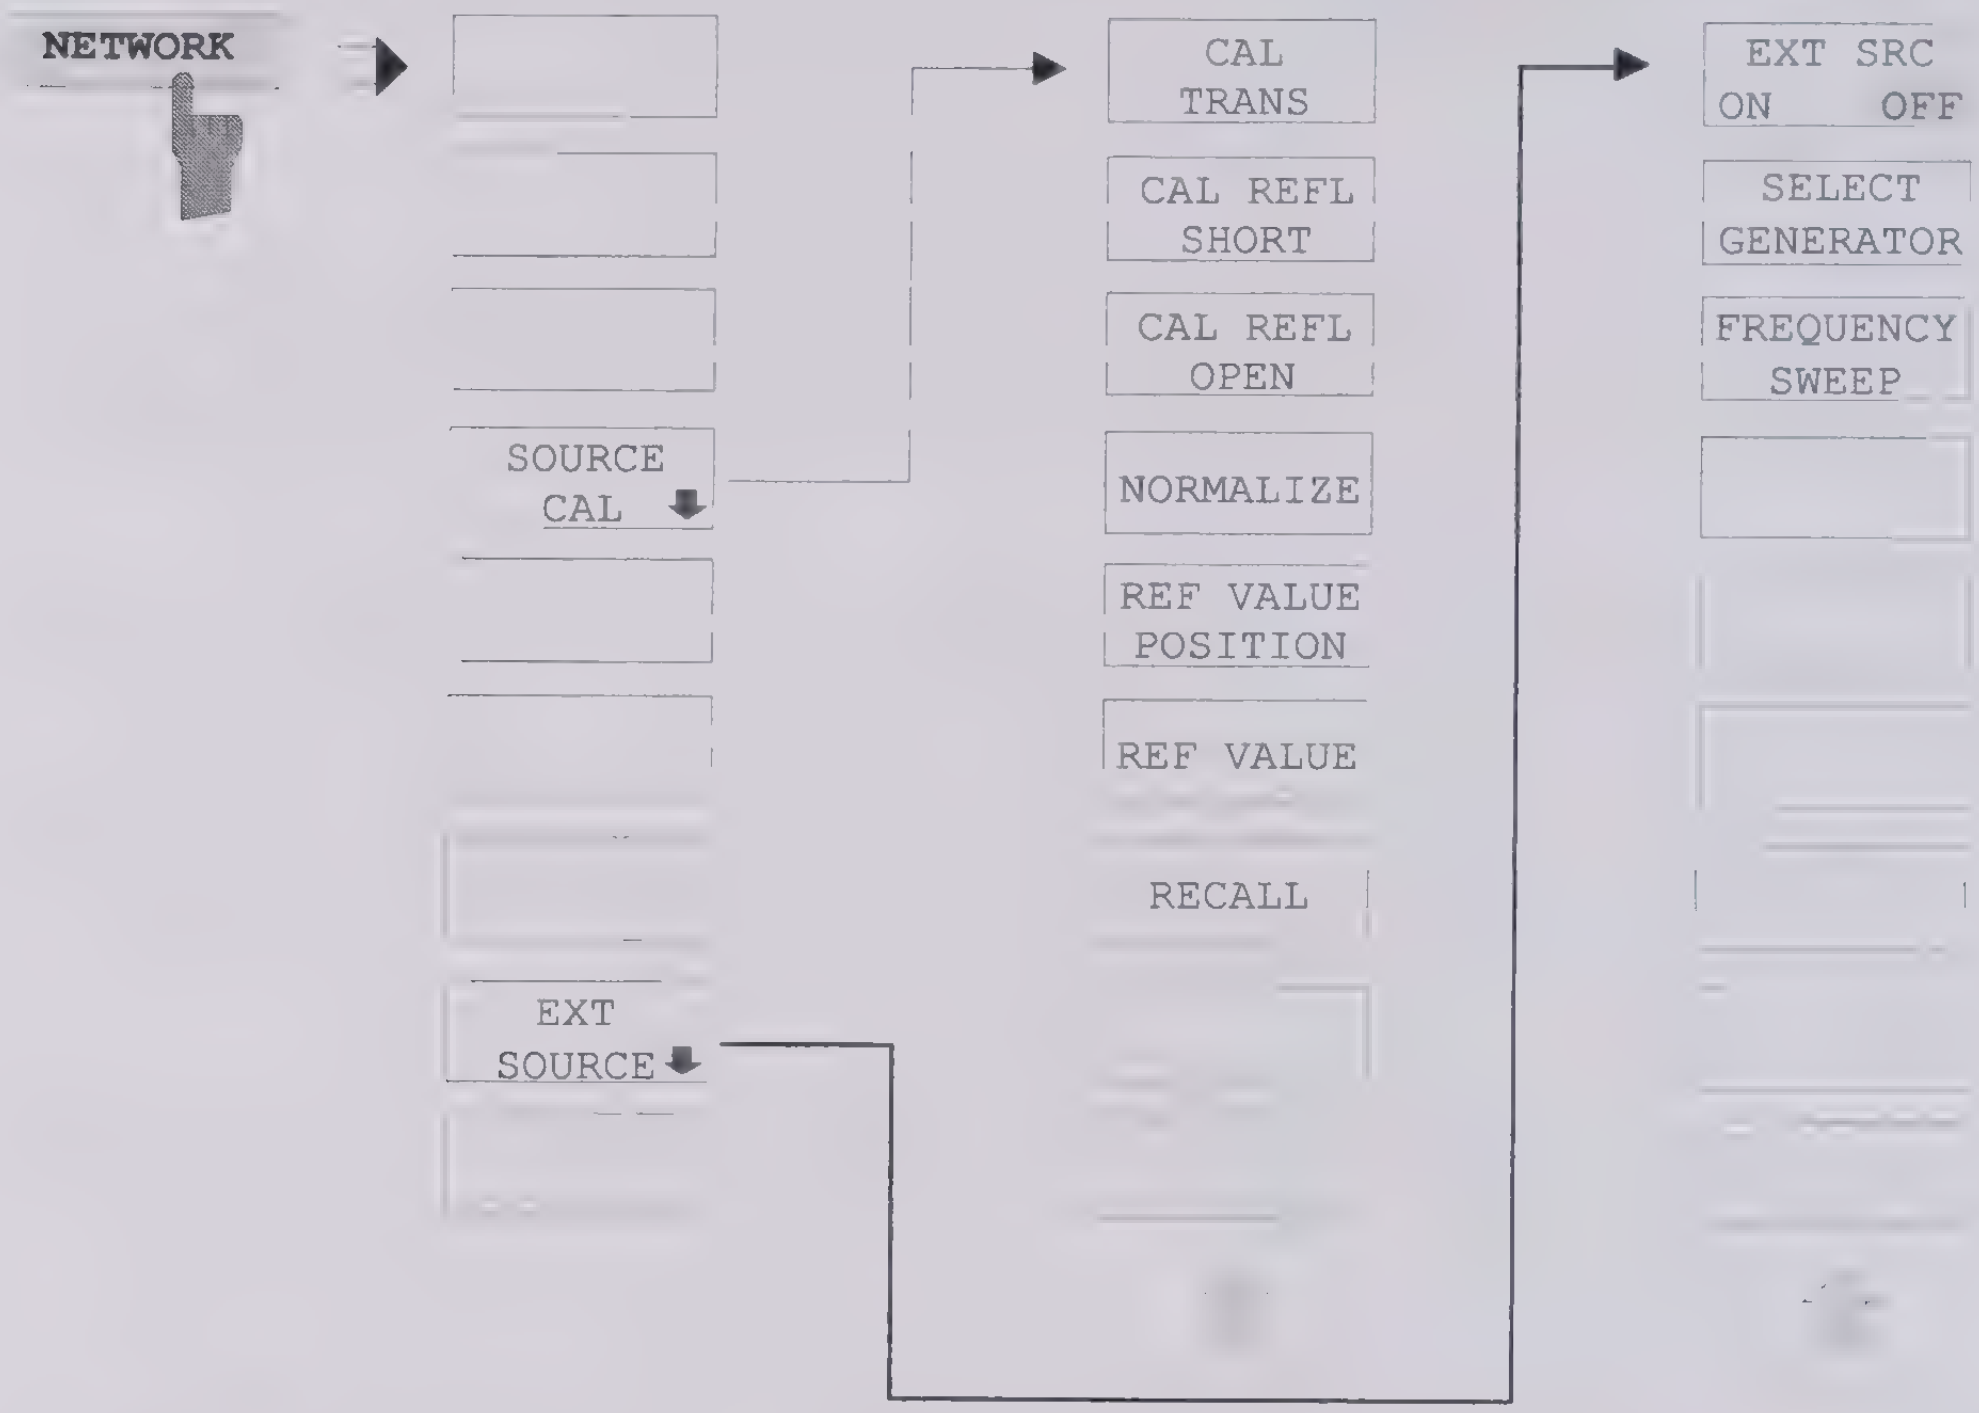

SOURCE POWER

The *SOURCE POWER* softkey activates the entry of the generator output level. The value range depends on the selected generator (See table of chapter "Configuration of the External Generator").

Ist neben der Option *Externe Generatorsteuerung B10* auch die Option *Mitlaufgenerator B9* installiert, so verändert der Softkey wahlweise den Ausgangspegel des internen Mitlaufgenerators oder des externen Generators, je nachdem, welcher Generator gerade eingeschaltet ist.

Die Grundeinstellung des Ausgangspegels ist -20 dBm.
IEC/IEEE-bus command: `SOUR:EXT:POW -20dBm`

POWER OFFSET

The *POWER OFFSET* softkey activates the entry of a constant level offset of the generator. With this offset, attenuator pads or amplifiers connected to the output connector of the generator can be handled during the input and output of output levels.

The permissible setting range is -200 dB to +200 dB in steps of 0.1 dB. Positive offsets handle a subsequent amplifier and negative offsets an attenuator pad.
The default setting is 0 dB; offsets <> 0 are marked by the activated enhancement label **LVL**.

IEC/IEEE-bus command `SOUR:POW:OFFS -10dB`

Transmission Measurement

The transmission characteristic of a two-port network is measured . The external generator serves as a signal source. It is connected to the input connector of the DUT. The input of the analyser is fed from the output of the DUT.

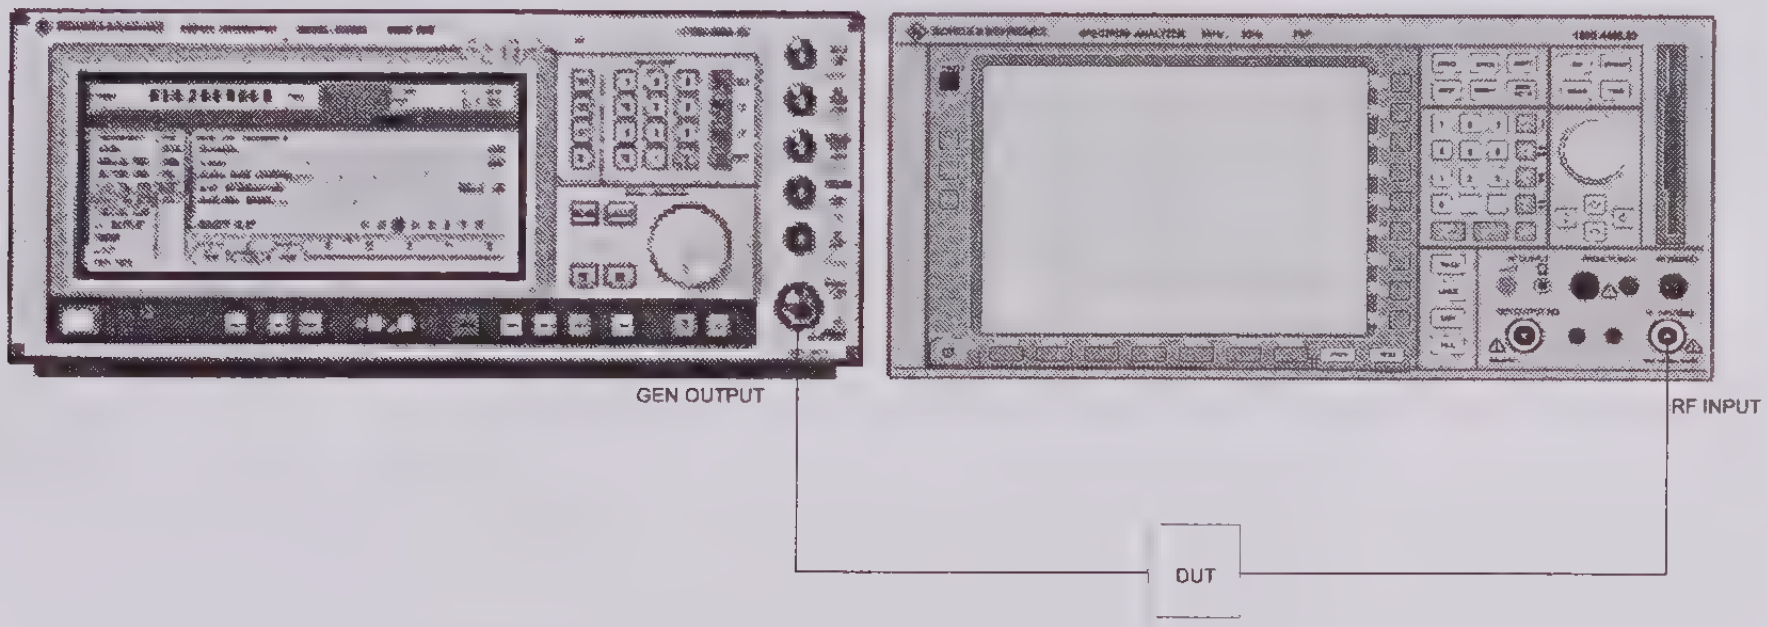

Fig. 4.23-1 Test setup for transmission measurement

A calibration can be carried out to compensate for the effects of the test setup (e.g. frequency response of connecting cables).

Calibration of Transmission Measurement

NETWORK menu:

SOURCE CAL

CAL TRANS

CAL REFL SHORT

CAL REFL OPEN

NORMALIZE

REF VALUE POSITION

REF VALUE

RECALL

The *SOURCE CAL* softkey opens a submenu comprising the calibration functions for the transmission and reflection measurement.

The calibration of the reflection measurement (*CAL REFL...*) and its functioning are described in separate sections.

To carry out a calibration for transmission measurements the whole test setup is through-connected (THRU).

The *CAL TRANS* softkey triggers the calibration of the transmission measurement.

It starts a sweep that records a reference trace. This trace is then used to obtain the differences to the normalized values.

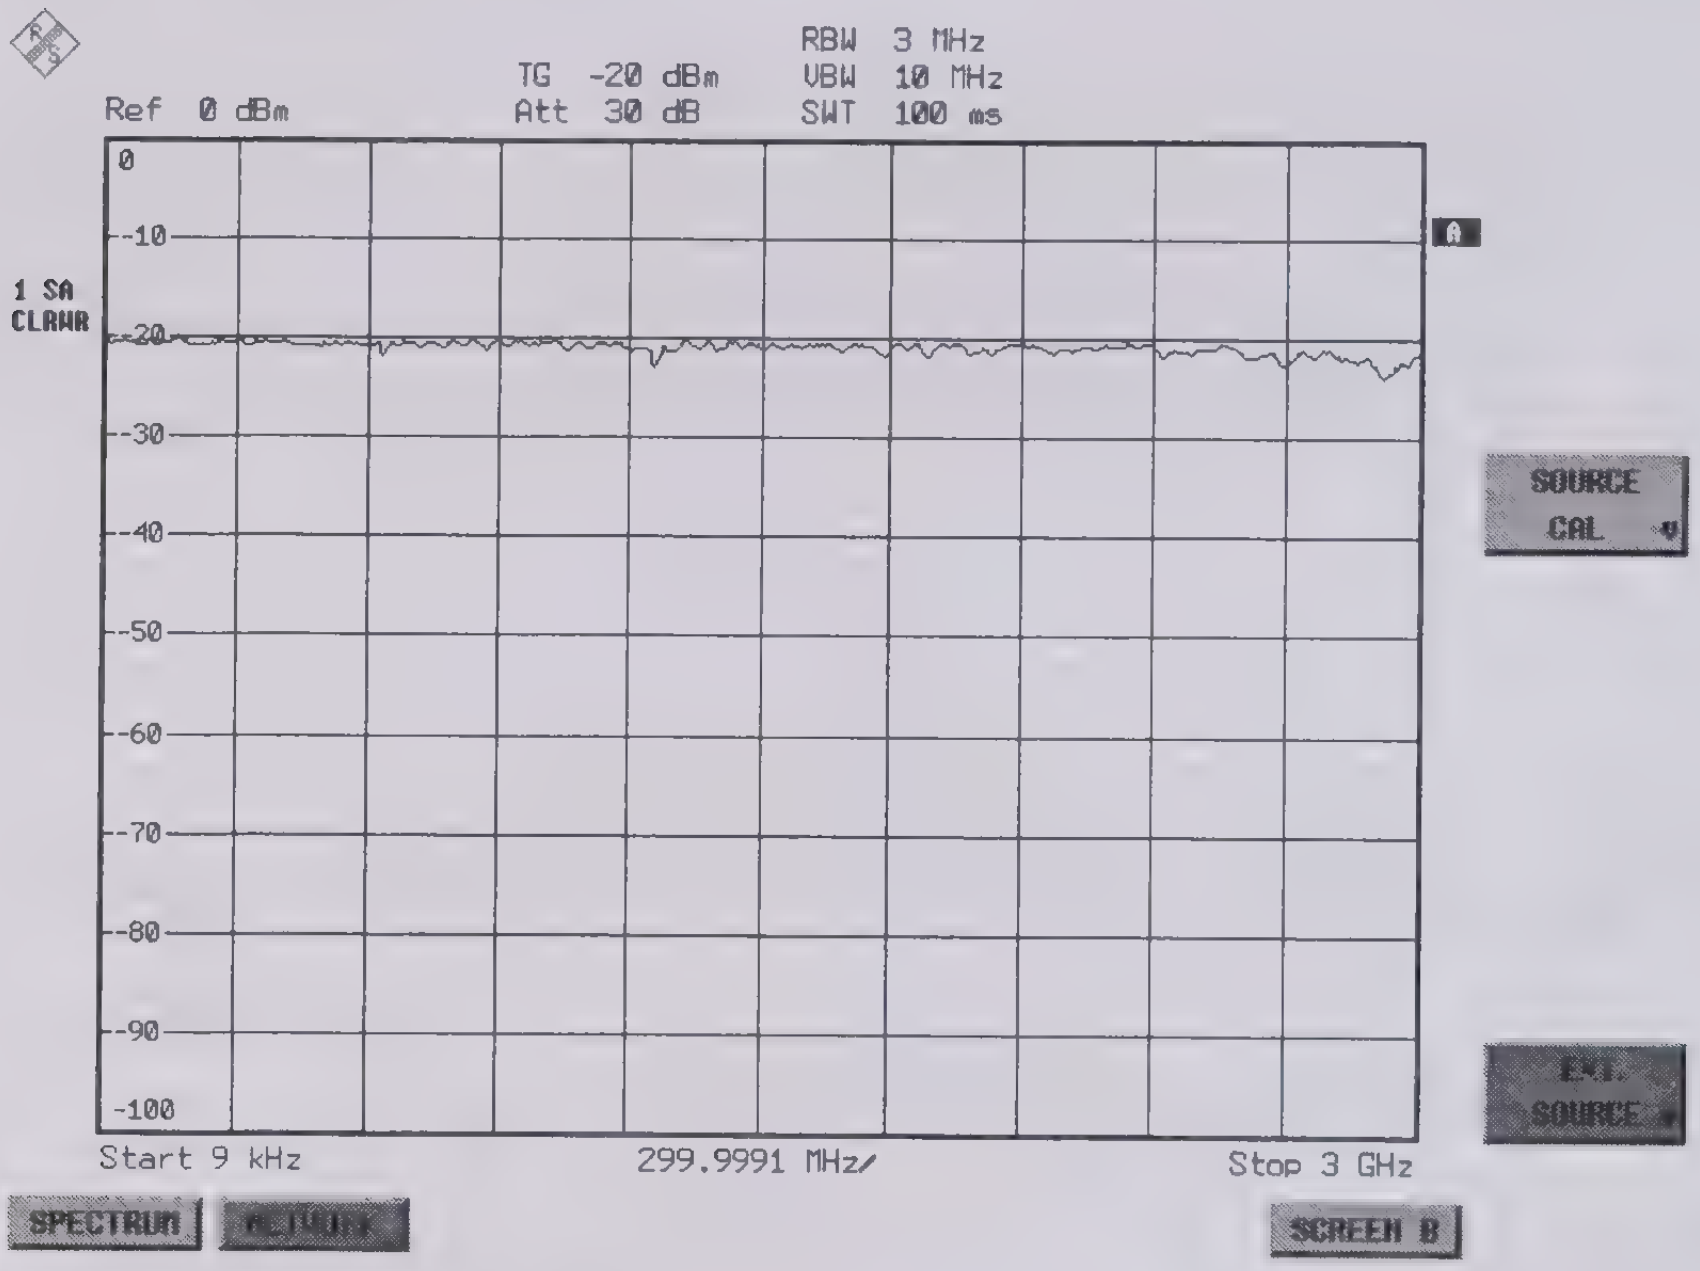

Fig. 4.23-2 Calibration curve for transmission measurement

During the calibration the following message is displayed:



SOURCE CAL
in progress
ABORT

After the calibration sweep the following message is displayed:



NOTE
calibration complete
OK

This message is cleared after approx. 3 seconds.

IEC/IEEE-bus command `CORR:METH TRAN`

Normalization:

NETWORK -SOURCE CAL menu:



The *NORMALIZE* softkey switches normalization on or off. The softkey is only available if the memory contains a correction trace.

It is possible to shift the relative reference point within the grid using the *REF VALUE POSITION* softkey. Thus, the trace can be shifted from the top grid margin to the middle of the grid:

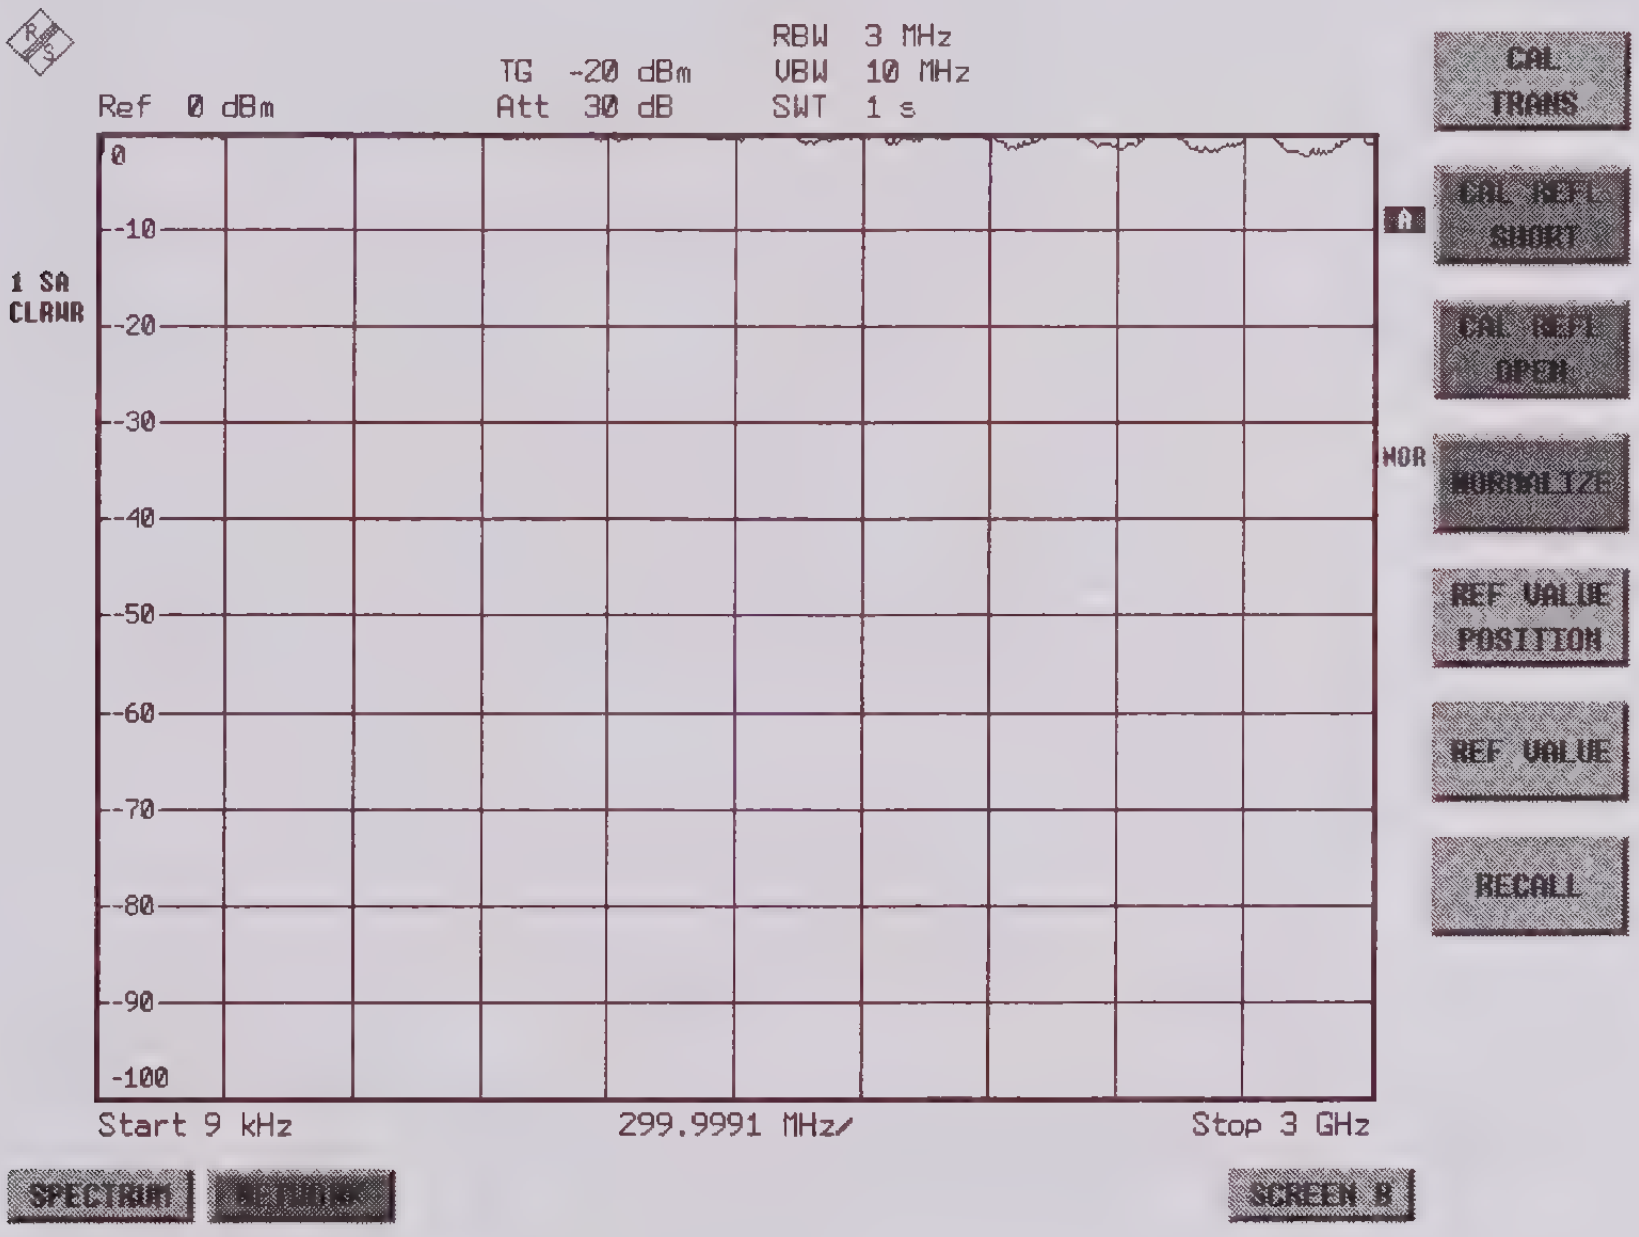

Fig. 4.23-3 Normalized display

In the *SPLIT SCREEN* setting, the normalization is switched on in the current window. Different normalizations can be active in the two windows.

Normalization is aborted when the *NETWORK* mode is quit.

IEC/IEEE-bus command: `CORR ON`

REF VALUE POSITION

The *REF VALUE POSITION* softkey (reference position) marks a reference position in the active window on which the normalization (difference formation with a reference curve) is performed.

When pressed for the first time, the softkey switches on the reference line and activates the input of its position. The line can be shifted within the grid limits.

The reference line is switched off by pressing the softkey again.

The function of the reference line is explained in the section "Functioning of Calibration".

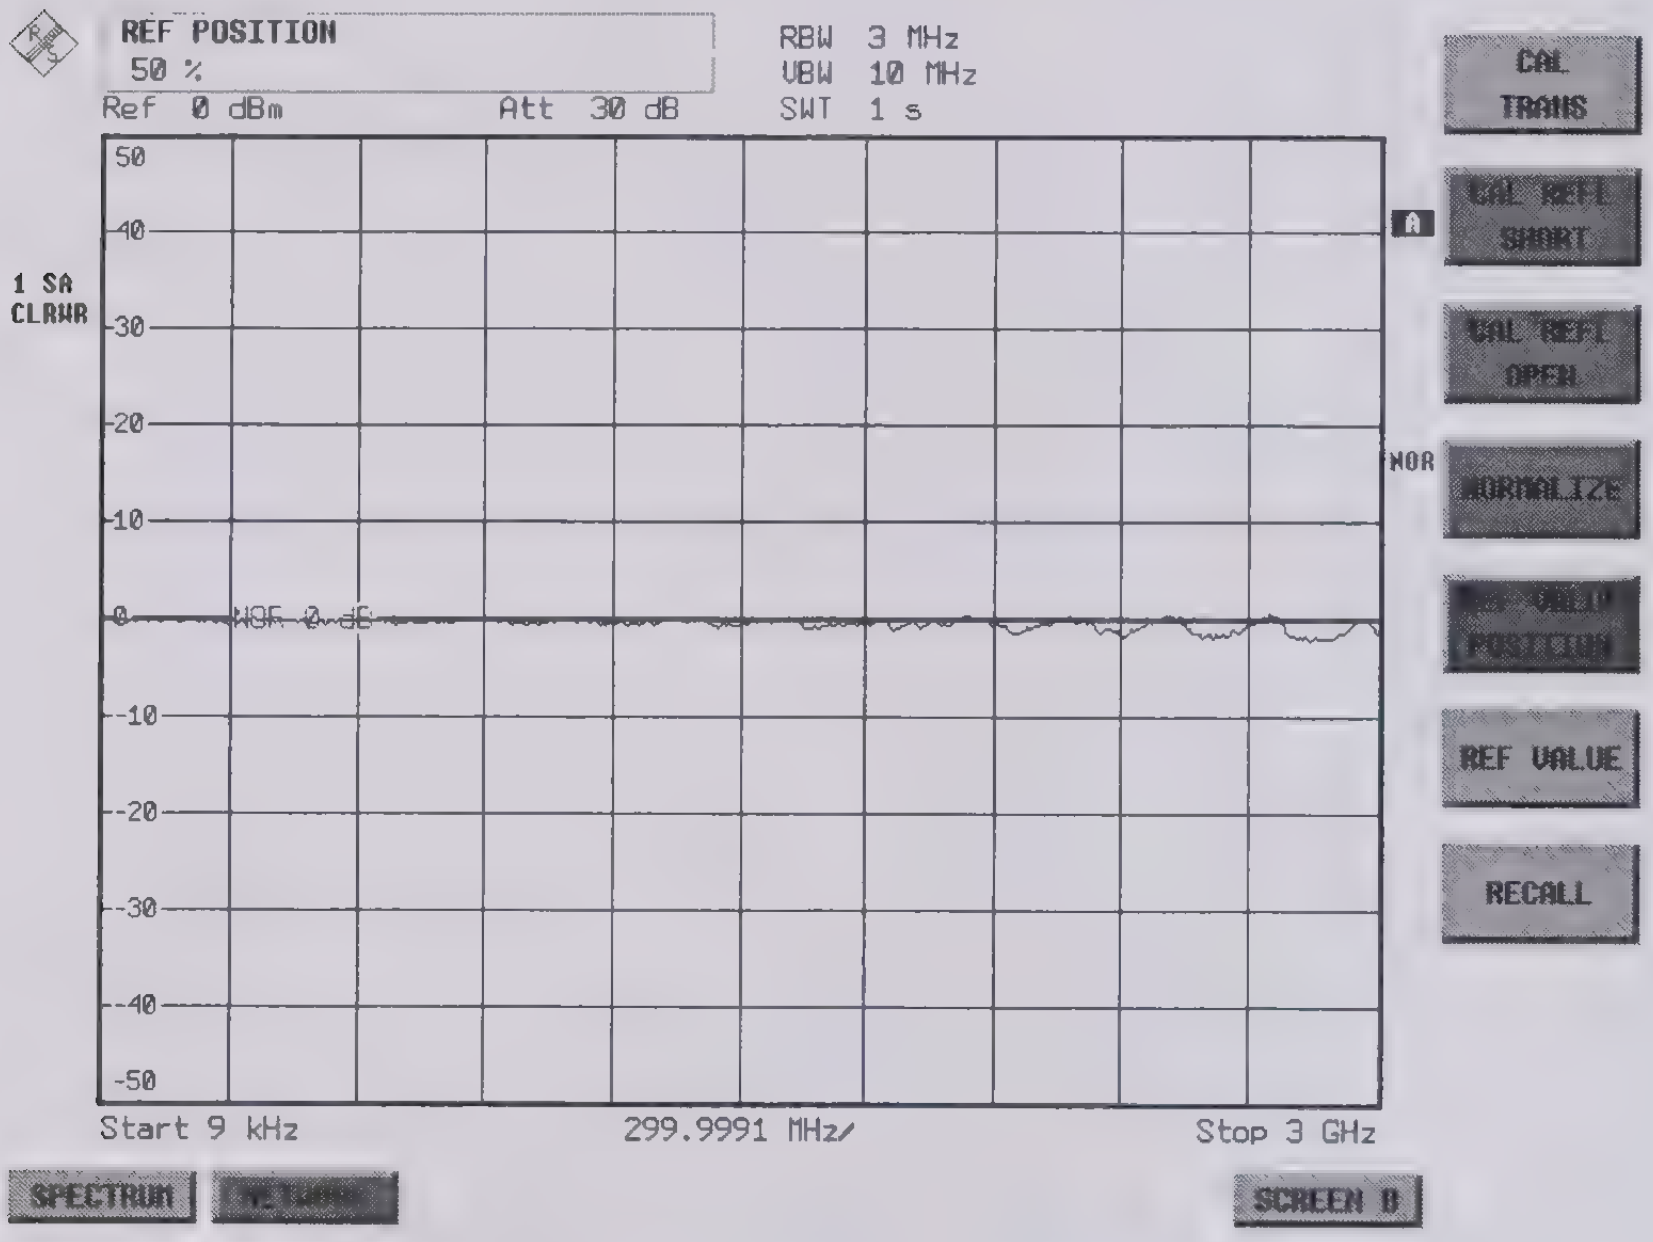

REF POSITION 50 %

RBW 3 MHz
VBW 10 MHz
SWT 1 s

Ref 0 dBm Att 30 dB

Fig. 4.23-4 Normalized measurement, shifted with *REF VALUE POSITION* 50 %

IEC/IEEE-bus command `DISP:WIND:TRAC:Y:RPOS 10PCT`

REF VALUE

The *REF VALUE* softkey activates the input of a level difference which is assigned to the reference line.

In the default setting, the reference line corresponds to a level difference of 0 dB. If e.g. a 10-dB attenuator pad is inserted between DUT and analyzer input between recording of the calibration data and normalization, the trace will be shifted down by 10 dB. By entering a *REF VALUE* of –10 dB the reference line for difference formation can also be shifted down by 10 dB so that it will again coincide with the trace (see Fig. 4.22-5).

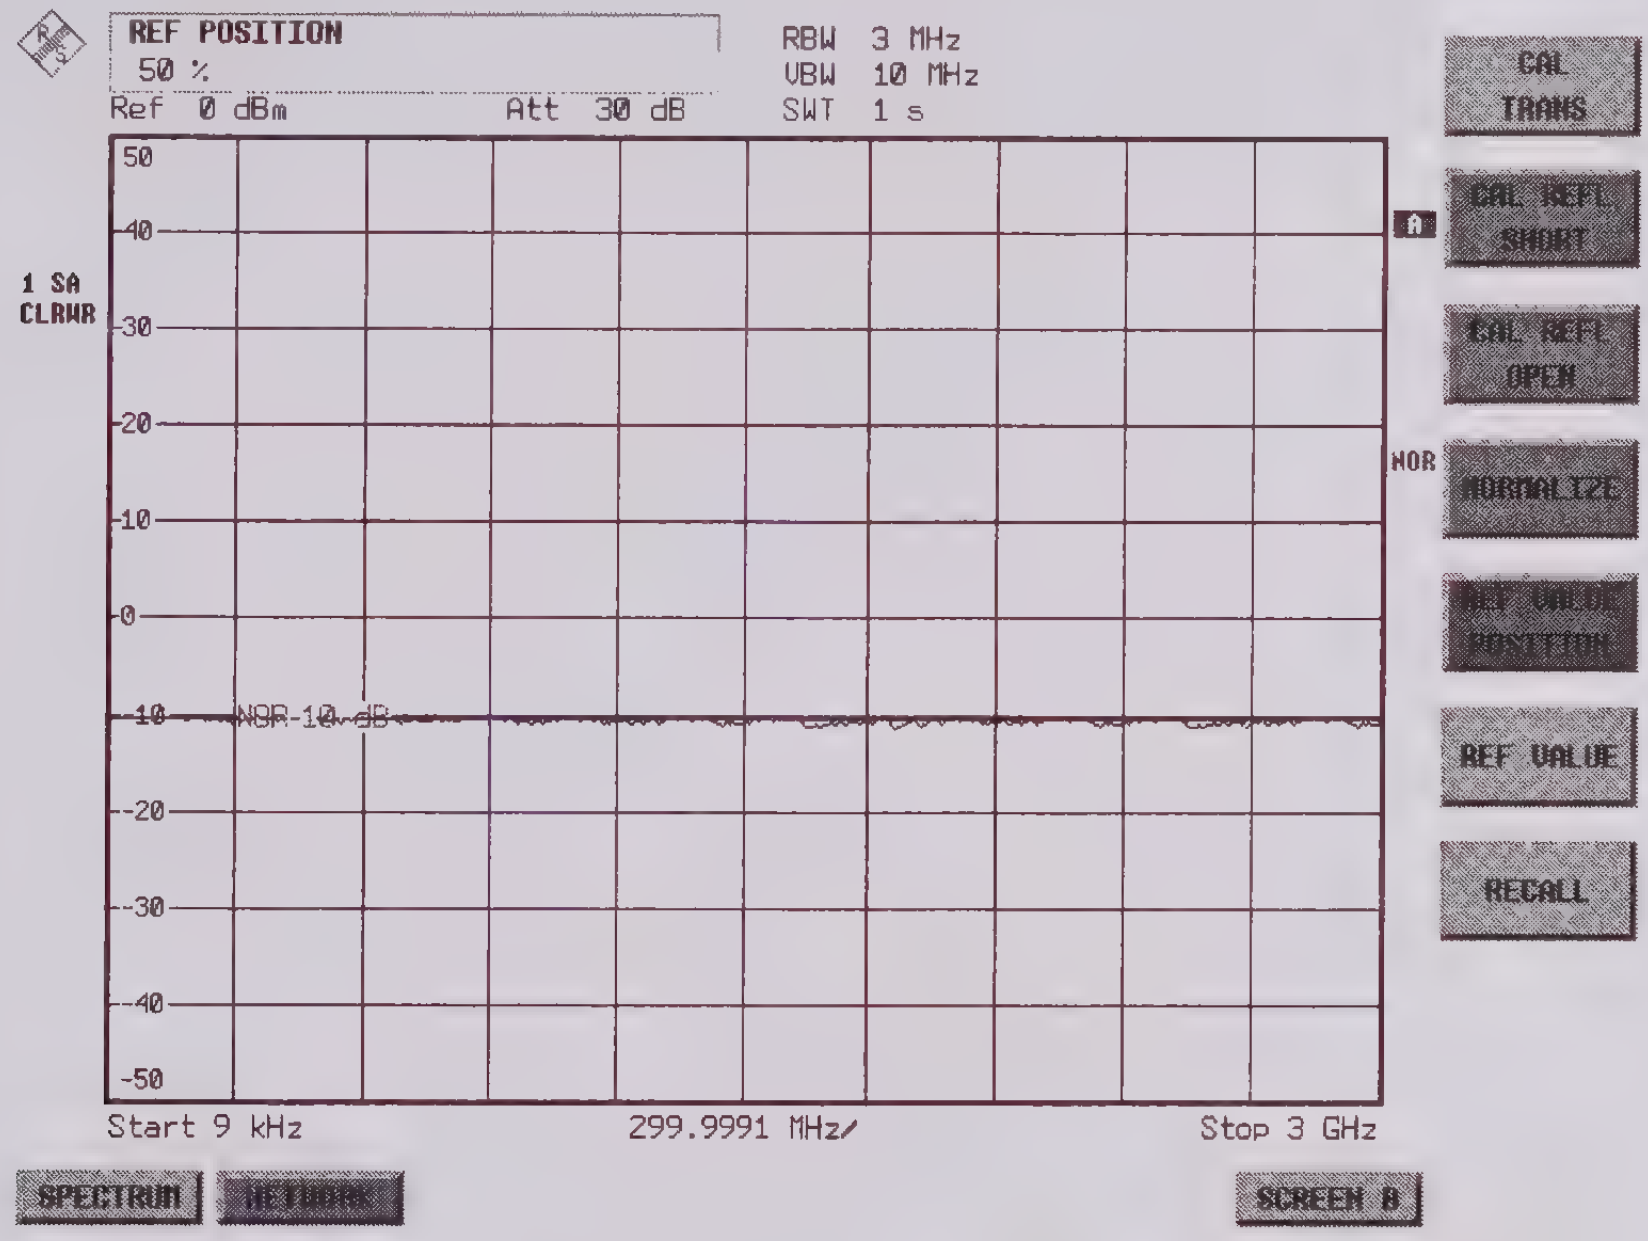
REF POSITION
50 %
RBW 3 MHz
VBW 10 MHz
SWT 1 s
Ref 0 dBm
Att 30 dB

Fig. 4.23-5 Measurement with REF VALUE -10dB and REF VALUE POSITION 50%

After the reference line has been shifted by entering *REF VALUE* –10 dB, departures from the nominal value can be displayed with high resolution (e.g. 1 dB / Div.). The absolute measured values are still displayed, in the above example, 1 dB below nominal value (reference line) = 11 dB attenuation.

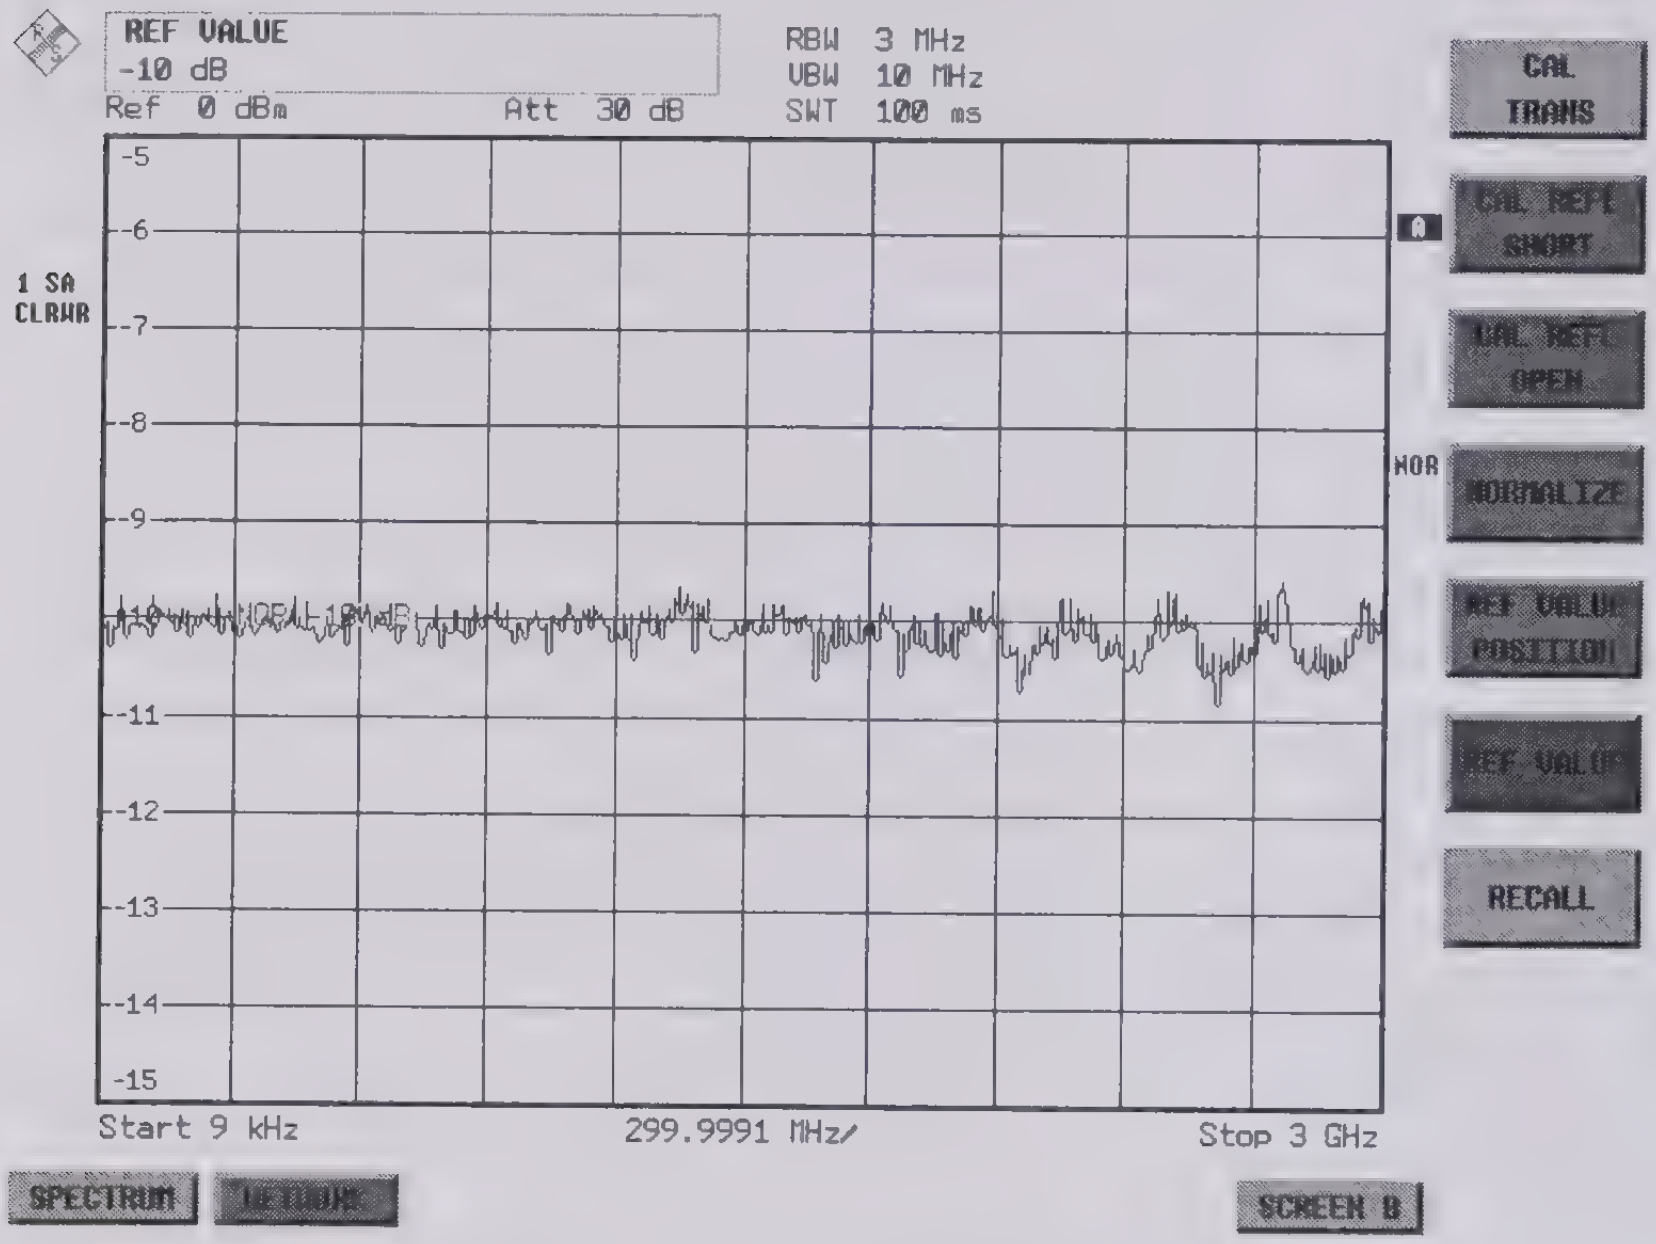

REF VALUE
-10 dB
Ref 0 dBm
Att 30 dB
RBW 3 MHz
VBW 10 MHz
SWT 100 ms
Start 9 kHz
299.9991 MHz/
Stop 3 GHz

Fig. 4.23-6 Measurement of a 10-dB attenuator pad with 1dB/DIV

IEC/IEEE-bus command `DISP:WIND:TRAC:Y:RVAL -10dB`

The *RECALL* softkey restores the instrument setting with which the calibration was carried out.
This can be useful if the device setting was changed after calibration (e.g. center frequency setting, frequency deviation, reference level, etc).

The softkey is only available if:

- the *NETWORK* mode has been selected
- the memory contains a calibration data set.

IEC/IEEE-bus command `CORR:REC`

Reflection Measurement

Scalar reflection measurements can be carried out by means of a reflection-coefficient bridge.

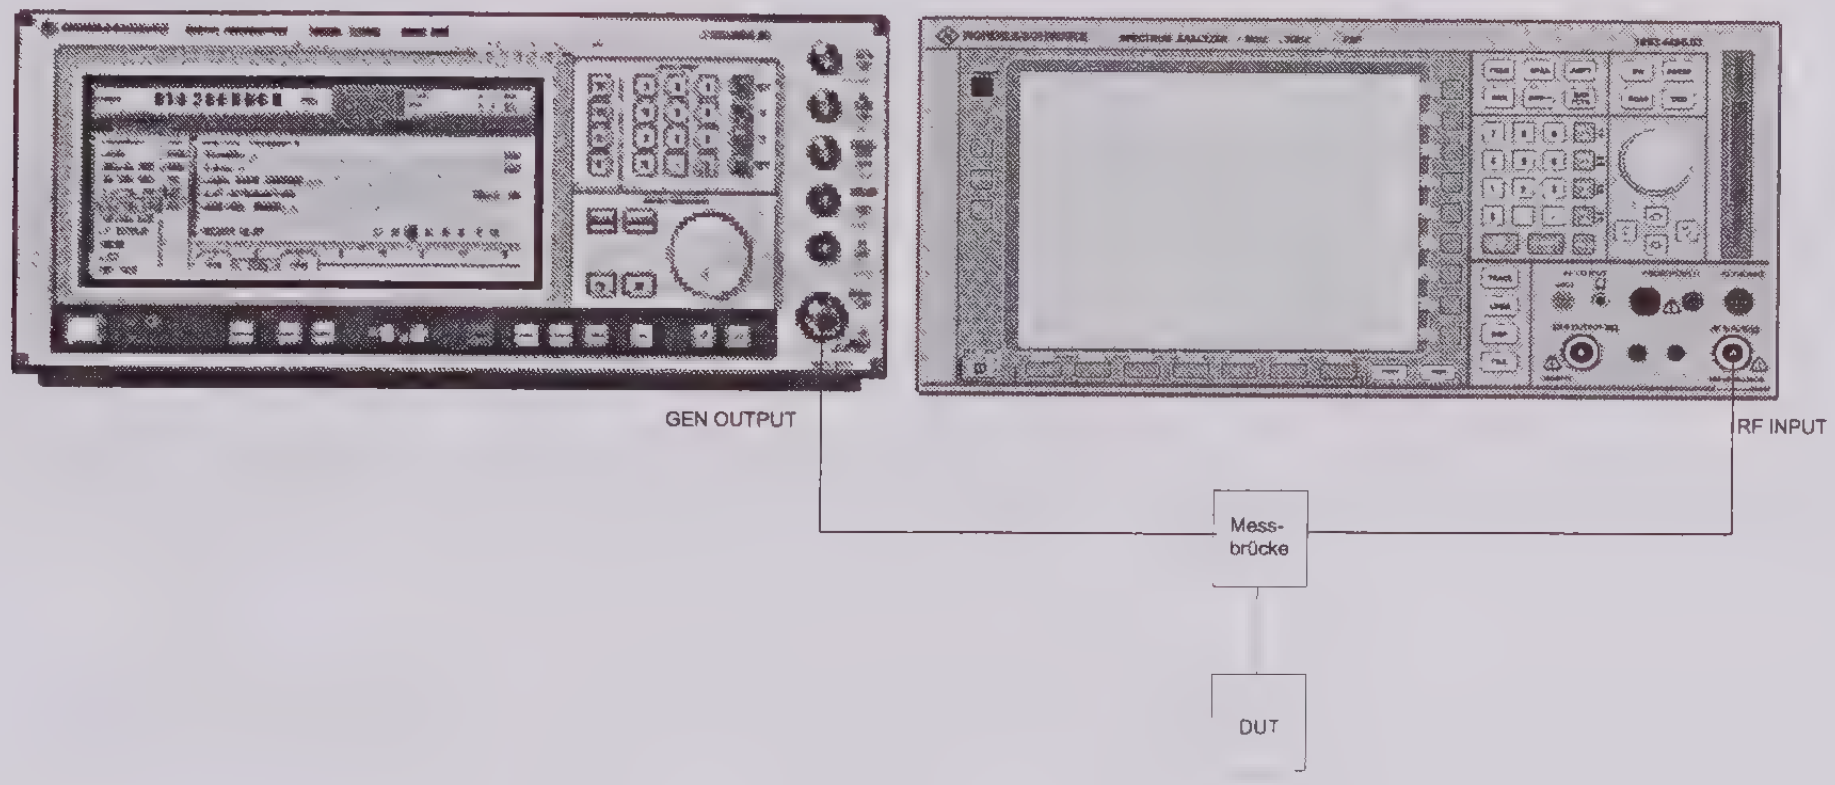

Fig. 4.23-7 Test setup for reflection measurement

Calibration of Reflection Measurement

The calibration mechanism essentially corresponds to that of the transmission measurement.

NETWORK-SOURCE CAL submenu

The *CAL REFL OPEN* softkey starts the open-circuit calibration. During calibration the following message is displayed:



SOURCE CAL
in progress
ABORT

IEC/IEEE-bus command `CORR:METH REFL`
`CORR:COLL OPEN`

The *CAL REFL SHORT* softkey starts the short-circuit calibration.

If both calibrations (open circuit, short circuit) are carried out, the calibration curve is formed by averaging the two measurements and stored in the memory. The order of measurements is optional.

After the calibration the following message is displayed:



NOTE
calibration complete
OK

The display is cleared after approx. 3 seconds.

IEC/IEEE-bus command `CORR:METH REFL`
`CORR:COLL THR`

Calibration mechanism

Calibration means a calculation of the difference between the currently measured power and a reference curve, independent of the selected type of measurement (transmission/reflection). The hardware settings used for measuring the reference curve are included in the reference dataset.

Even with normalization switched on, the device settings can be changed in a wide area without stopping the normalization. This reduces the necessity to carry out a new normalization to a minimum.

For this purpose, the reference dataset (trace with 625 measured values) is stored as a table with 625 points (frequency/level). Differences in level settings between the reference curve and the current device settings are taken into account automatically. If the span is reduced, a linear interpolation of the intermediate values is applied. If the span increases, the values at the left or right border of the reference dataset are extrapolated to the current start or stop frequency, i.e. the reference dataset is extended by constant values.
An enhancement label is used to mark the different levels of measurement accuracy. This enhancement label is displayed at the right diagram border when normalization is switched on and a deviation from the reference setting occurs. Three accuracy levels are defined:

Table 4.23-1 Measurement accuracy levels

Accuracy	**Enhancement label**	**Reason/Limitation**
High	NOR	No difference between reference setting and measurement
Medium	APX (approximation)	Change of the following settings: • coupling (RBW, VBW, SWT) • reference level, RF attenuation • start or stop frequency • output level of tracking generator • frequency offset of tracking generator • detector (max. peak, min. peak, sample, etc.) Change of frequency: • max. 501 points within the set sweep limits (corresponds to a doubling of the span)
-	Aborted normalization	• more than 500 extrapolated points within the current sweep limits (in case of span doubling)

Note: *At a reference level (REF LEVEL) of -10 dBm and at a tracking generator output level of the same value the analyzer operates without overrange reserve, i.e. the analyzer is in danger of being overloaded if a signal is applied whose amplitude is higher than the reference line. In this case, either the message "OVLD" for overload is displayed in the status line or the display range is exceeded (clipping of the trace at the upper diagram border = Overrange).*

Overloading can be avoided as follows:

- *Reducing the output level of the tracking generator (SOURCE POWER, NETWORK menu)*
- *Increasing the reference level (REF LEVEL, AMPT menu)*

Frequency-converting Measurements

For frequency-converting measurements (e.g. on converters) the external generator is able to set a constant frequency offset between the output frequency of the generator and the receive frequency of the analyzer and, in addition, the generator frequency as a multiple of the analyzer.

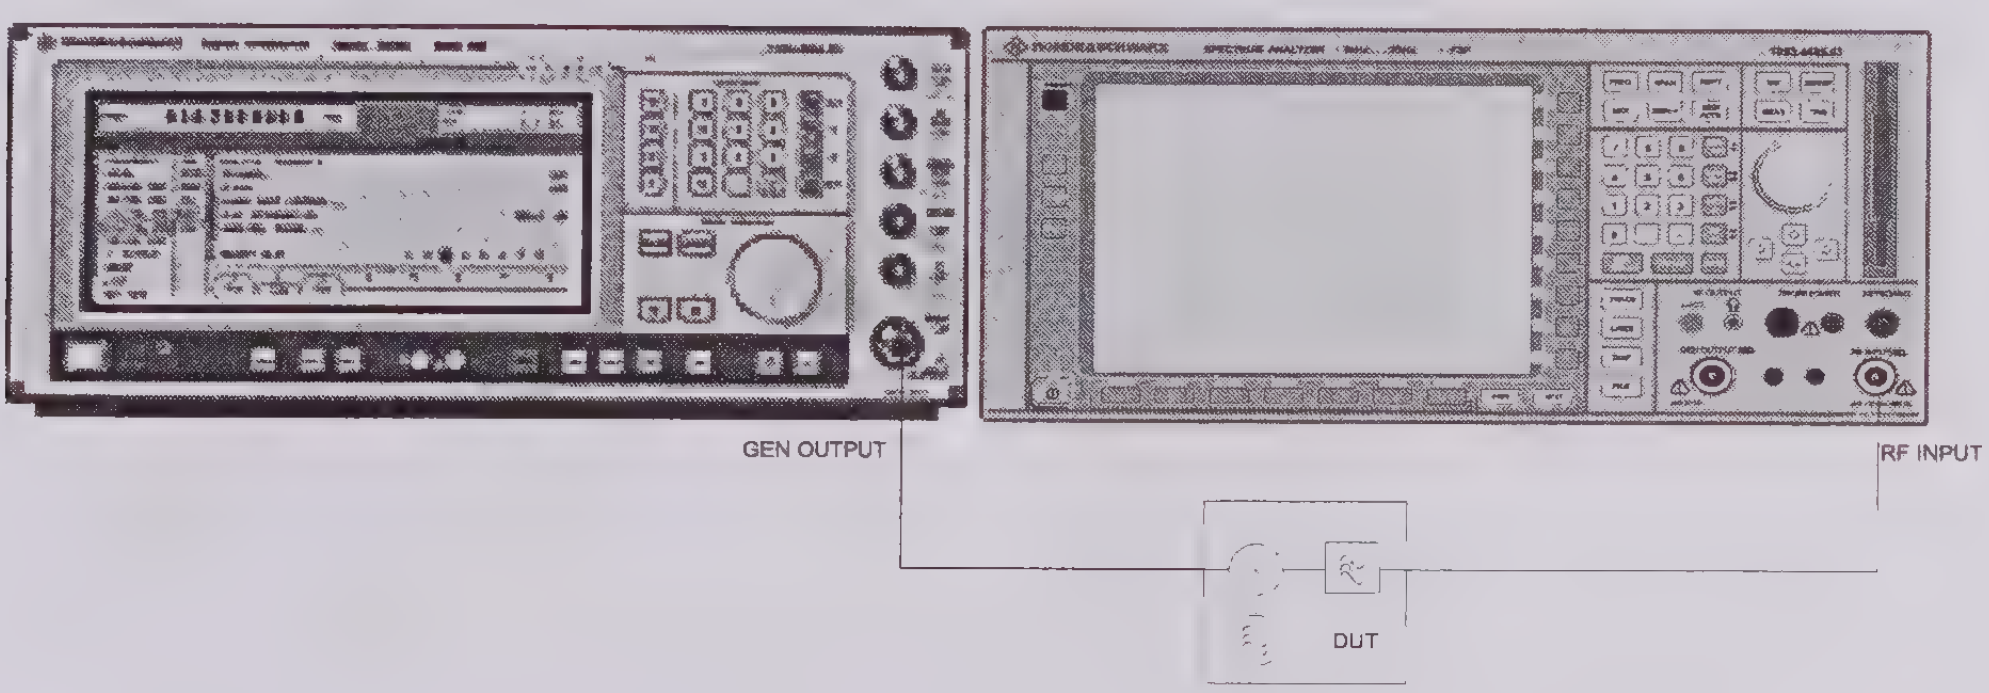

Fig. 4.23-8 Test setup for frequency-converting measurements

NETWORK Menu

FREQUENCY OFFSET

The *FREQUENCY OFFSET* softkey activates the input of the frequency offset between the output signal of the generator and the input frequency of the analyzer. The value range depends on the selected generator.
The default setting is 0 Hz. Offsets <> 0 Hz are marked with the enhancement label **FRQ**.

If a positive frequency offset is entered, the tracking generator generates an output signal above the receive frequency of the "analyzer. In case of a negative frequency offset it generates a signal below the receive frequency of the analyzer. The output frequency of the generator is calculated as follows:

Generator frequency = receive frequency + frequency offset

IEC/IEEE-bus command: `SOUR:EXT:FREQ:OFFS 1GHZ`

Configuration of an External Generator

NETWORK menu:

EXT SOURCE → EXT SRC ON OFF

SELECT GENERATOR

FREQUENCY SWEEP

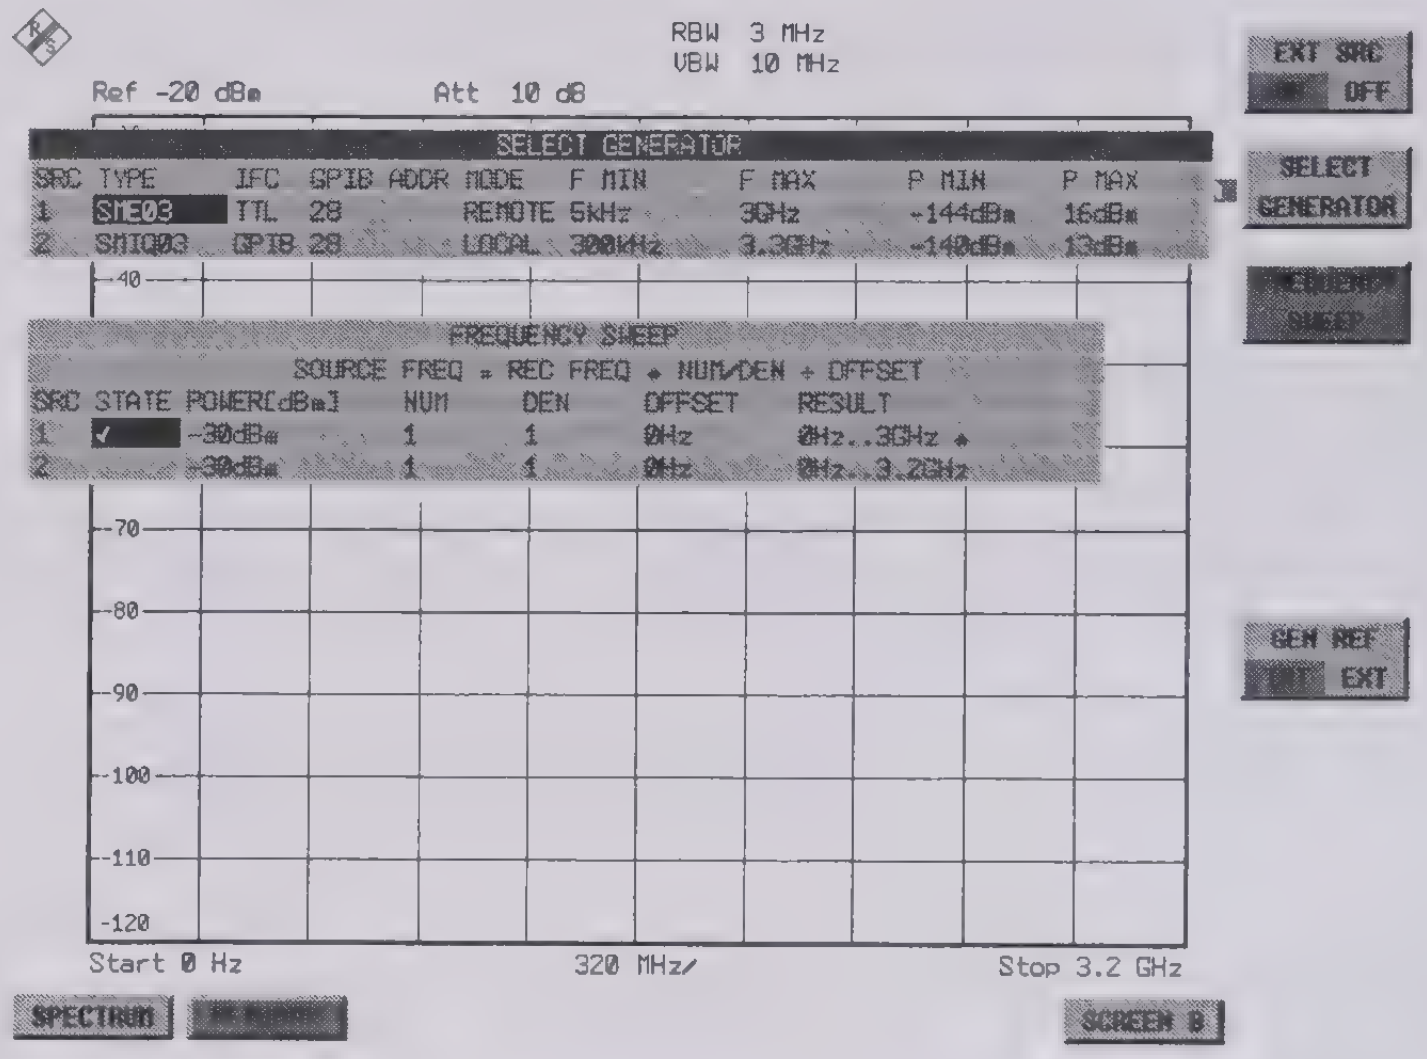

RBW 3 MHz
VBW 10 MHz
Ref -20 dBm Att 10 dB

SELECT GENERATOR

SRC	TYPE	IFC	GPIB ADDR	MODE	F MIN	F MAX	P MIN	P MAX
1	SME03	TTL	28	REMOTE	5kHz	3GHz	-144dBm	16dBm
2	SMIQ03	GPIB	28	LOCAL	300kHz	3.3GHz	-140dBm	13dBm

FREQUENCY SWEEP

SOURCE FREQ = REC FREQ * NUM/DEN + OFFSET

SRC	STATE	POWER[dBm]	NUM	DEN	OFFSET	RESULT
1	✓	-30dBm	1	1	0Hz	0Hz..3GHz *
2		-30dBm	1	1	0Hz	0Hz..3.2GHz

Start 0 Hz 320 MHz/ Stop 3.2 GHz

The *EXT SOURCE* softkey opens a submenu for configuration of the external generator.
The R&S FSMR is able to manage two generators, one of which can be active at the time.

EXT SRC ON OFF

The *EXT SRC ON / OFF* softkey switches the external generator on or off.
It can only be switched on successfully if the generator has been selected by means of *SELECT GENERATOR* and configured correctly by means of *FREQUENCY SWEEP*. If one of these conditions is not fulfilled, an error message will be output.

Notes: *When switching on the external generator by means of EXT SRC ON, the R&S FSMR switches off the internal tracking generator and starts programming the generator settings via the IEC/IEEE-bus interface IEC2.*

Programming requires takeover of the IEC/IEEE-bus control at this interface by the R&S FSMR. To avoid any access conflicts, ensure that no other controller is connected to the IEC2 interface or the external generator when selecting EXT SRC ON.

The maximum stop frequency is limited to the maximum generator frequency. This upper limit is automatically reduced by the set frequency offset of the generator and a set multiplication factor.

With the external generator switched on, the FFT filters (FILTER TYPE FFT in the menu BW) are not available.

If an error occurs on the IEC/IEEE bus when programming the external generator, the generator will automatically be switched off and the following error message will be output:



SYSTEM MESSAGE
IEC2 handshake error!

When the external generator is switched off using EXT SRC OFF, the IEC/IEEE-bus control is handed over again at the IEC2 interface, i.e. a different controller will then take over the control of the signal generator.

IEC/IEEE-bus command: `SOUR:EXT ON`

SELECT GENERATOR

The *SELECT GENERATOR* softkey opens a table for selection of the generator and definition of IECBUS address and control interface.
The table permits configuration of two generators so that switching between two different configurations is easily possible.



SELECT GENERATOR

SRC	TYPE	IFC	GPIB ADDR	MODE	F MIN	F MAX	P MIN	P MAX
1	SME03	TTL	28	REMOTE	5kHz	3GHz	-144dBm	16dBm
2	SMIQ03	GPIB	28	LOCAL	300kHz	3.3GHz	-140dBm	13dBm

The individual fields contain the following settings:

SRC Index of generator selected

TYPE The field opens the list with the available generators:

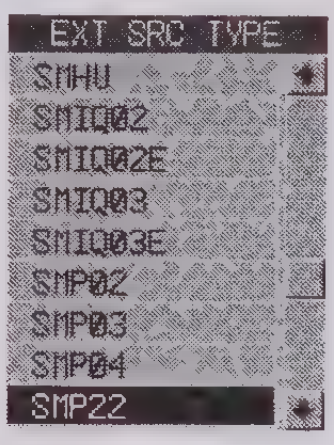

EXT SRC TYPE
SMHU
SMIQ02
SMIQ02E
SMIQ03
SMIQ03E
SMP02
SMP03
SMP04
SMP22

After completion of the selection, the remaining fields of the table are filled with the generator characteristics.
A list of generator types supported by the R&S FSMR is to be found at the end of section "Softkey *SELECT GENERATOR*".

IFC This field selects the interface type of external generator 1 or 2. The following types are available:

GPIB IECBUS only, suitable for all generators of other manufacturers and some Rohde & Schwarz instruments

or

TTL IECBUS and TTL interface for synchronization, for most of the Rohde & Schwarz generators, see table above.

The two operating modes differ in the speed of the control: Whereas, with pure IECBUS operation, each frequency to be set must be individually transferred to the generator, additional use of the TTL interface permits to program a total frequency list at once and subsequently perform the frequency stepping via TTL handshake, which is a big advantage in terms of speed.

Note:
Generators equipped with the TTL interface can also be operated with IECBUS (= GPIB) only.
Only one of the two generators can be operated with TTL interface at a time. The other generator must be configured for IECBUS (GPIB).

GPIB ADDR IECBUS address of the respective generator. Addresses from 0 to 30 are possible.

MODE Operating mode of generator. The generator activated using the FREQUENCY SWEEP softkey is automatically set to remote mode (REMOTE), the other to manual mode (LOCAL).

F MIN
F MAX Frequency range of generator. Select the start and stop frequency of the R&S FSMR in a way that the specified range is not exceeded.
If the start frequency lies below F MIN, the generator is only switched on when F MIN is reached.
If the stop frequency lies above F MAX, it is limited to F MAX when the generator is switched on using the EXT SRC ON/OFF softkey.

P MIN
P MAX Level range of generator. This field defines the allowed input range for the *POWER* column in the *FREQUENCY SWEEP* table.

IEC/IEEE-bus commands

```
SYST:COMM:RDEV:GEN2:TYPE 'SME02'
SYST:COMM:RDEV:GEN:LINK TTL
SYST:COMM:GPIB:RDEV:GEN1:ADDR 28
```

List of Generator Types Supported by the R&S FSMR

Generator	Interface Type	Generator Min Freq	Generator Max Freq	Generator Min Power dBm	Generator Max Power dBm
SME02	TTL	5 kHz	1.5 GHz	-144	+16
SME03	TTL	5 kHz	3.0 GHz	-144	+16
SME06	TTL	5 kHz	6.0 GHz	-144	+16
SMG	GPIB	100 kHz	1.0 GHz	-137	+13
SMGL	GPIB	9 kHz	1.0 GHz	-118	+30
SMGU	GPIB	100 kHz	2.16 GHz	-140	+13
SMH	GPIB	100 kHz	2.0 GHz	-140	+13
SMHU	GPIB	100 kHz	4.32 GHz	-140	+13
SMIQ02B	TTL	300 kHz	2.2 GHz	-144	+13
SMIQ02E	GPIB	300 kHz	2.2 GHz	-144	+13
SMIQ03B	TTL	300 kHz	3.3 GHz	-144	+13
SMIQ03E	GPIB	300 kHz	3.3 GHz	-144	+13
SMIQ04B	TTL	300 kHz	4.4 GHz	-144	+10
SMIQ06B	TTL	300 kHz	6.4 GHz	-144	+10
SML01	GPIB	9 kHz	1.1 GHz	-140	+13
SML02	GPIB	9 kHz	2.2 GHz	-140	+13
SML03	GPIB	9 kHz	3.3 GHz	-140	+13
SMR20	TTL	1 GHz	20 GHz	-130 2)	+11 2)
SMR20B11 1)	TTL	10 MHz	20 GHz	-130 2)	+13 2)
SMR27	TTL	1 GHz	27 GHz	-130 2)	+11 2)
SMR27B11 1)	TTL	10 MHz	27 GHz	-130 2)	+12 2)
SMR30	TTL	1 GHz	30 GHz	-130 2)	+11 2)
SMR30B11 1)	TTL	10 MHz	30 GHz	-130 2)	+12 2)
SMR40	TTL	1 GHz	40 GHz	-130 2)	+9 2)
SMR40B11 1)	TTL	10 MHz	40 GHz	-130 2)	+12 2)
SMR50	TTL	1 GHz	50 GHz	-130 2)	+9 2)
SMR50B11 1)	TTL	10 MHz	50 GHz	-130 2)	+12 2)
SMR60	TTL	1 GHz	60 GHz	-130 2)	+9 2)
SMR60B11 1)	TTL	10 MHz	60 GHz	-130 2)	+12 2)
SMP02	TTL	10 MHz	20 GHz	-130 3)	+17 3)
SMP03	TTL	10 MHz	27 GHz	-130 3)	+13 3)
SMP04	TTL	10 MHz	40 GHz	-130 3)	+12 3)
SMP22	TTL	10 MHz	20 GHz	-130 3)	+20 3)
SMT02	GPIB	5.0 kHz	1.5 GHz	-144	+13
SMT03	GPIB	5.0 kHz	3.0 GHz	-144	+13
SMT06	GPIB	5.0 kHz	6.0 GHz	-144	+13
SMV03	GPIB	9 kHz	3.3 GHz	-140	+13
SMX	GPIB	100 kHz	1.0 GHz	-137	+13
SMY01	GPIB	9 kHz	1.04 GHz	-140	+13
SMY02	GPIB	9 kHz	2.08 GHz	-140	+13
HP8340A	GPIB	10 MHz	26.5 GHz	-110	10
HP8648	GPIB	9 kHz	4 GHz	-136	10

Generator	Interface Type	Generator Min Freq	Generator Max Freq	Generator Min Power dBm	Generator Max Power dBm
HP ESG-A Series 1000A, 2000A, 3000A, 4000A	GPIB	250 kHz	4 GHz	-136	20
HP ESG-D SERIES E4432B	GPIB	250 kHz	3 GHz	-136	+10

[1] Requires the option SMR-B11 to be fitted.

[2] Maximum/minimum power depends on presence of Option SMR-B15/-B17 and set frequency range. For more details see SMR data sheet.

[3] Maximum/minimum power depends on presence of Option SMP-B15/-B17 and set frequency range. For more details see SMP data sheet.

FREQUENCY SWEEP

The *FREQUENCY SWEEP* softkey opens a table for setting the generator level as well as the multiplier and the offset used to derive the generator frequency from the analyzer frequency.

This table also permits configuration of two generators so that switching between two different configurations is easily possible.

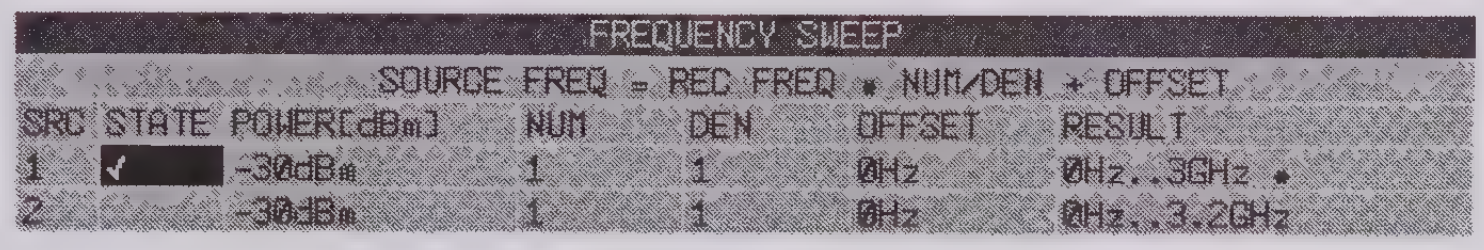

FREQUENCY SWEEP

SOURCE FREQ = REC FREQ * NUM/DEN + OFFSET

SRC	STATE	POWER[dBm]	NUM	DEN	OFFSET	RESULT
1	✓	-30dBm	1	1	0Hz	0Hz..3GHz *
2		-30dBm	1	1	0Hz	0Hz..3.2GHz

SRC	Index of selected generator
STATE	Selects the active generator. Only one generator can be active at a time. The operating mode of the active generator is set to remote control in the SELECT GENERATOR table.
POWER	Permits to enter the generator level within the limits P MIN to P MAX of the *SELECT GENERATOR* table.
NUM	Numerator,
DEN	Denominator,
OFFSET	Offset, used to derive the generator frequency from the current frequency of the R&S FSMR according to the following formula:

$$F_{Generator} = F_{Analyzer} * \frac{Numerator}{Denominator} + F_{Offset}$$

Note that the frequencies resulting from start and stop frequency of the R&S FSMR do not exceed the allowed generator range:

- If the start frequency lies below F MIN, the generator is only switched on when F MIN is reached.
- If the stop frequency lies above F MAX, the generator is switched off. When the generator is subsequently switched on using the *EXT SRC ON/OFF* softkey, the stop frequency is limited to F MAX.
- If the stop frequency lies below F MIN, the generator is switched off and the following error message output:



```
ERROR
GENERATOR RANGES EXEEDED; EXT GEN
SWITCHED OFF.
```

- In the time domain (Span = 0 Hz) the generator frequency is derived from the set receive frequency of the R&S FSMR using the calculation formula.

For the sake of clarity, the formula is also displayed in the table.

RESULT The frequency range of the generator resulting from the calculation formula. An asterisk (*) after the upper limit indicates that the stop frequency of the R&S FSMR must be adapted when the generator is switched on in order not to exceed its maximum frequency. In the following illustration, this is true for the upper generator at a stop frequency of 3.2 GHz of the R&S FSMR, whereas the lower generator does not yet require an adaptation:



```
SOURCE FREQ = REC FREQ * NUM/DEN + OFFSET
     NUM      DEN      OFFSET     RESULT
     1        1        0Hz        0Hz..3GHz *
     1        1        0Hz        0Hz..3.2GHz
```

IEC/IEEE-bus commands

```
SOUR:EXT:POW -30dBm
SOUR:EXT:FREQ:NUM 4
SOUR:EXT:FREQ:DEN 3
SOUR:EXT:FREQ:OFFS 100MHZ
```



The *GEN REF INT / EXT* softkey switches over the reference oscillator of the generator (switchover between internal and external reference source). The internal reference source is selected as the default setting.

IEC/IEEE-bus command: `SOUR:EXT1:ROSC INT`

LAN Interface

Using the LAN Interface, the instrument can be connected to an Ethernet LAN (Local Area Network). Thus it is possible to transfer data via the network and use network printers. In addition, the instrument can be remote-controlled via network. The network card allows both for a 10 MHz Ethernet IEEE 802.3 and a 100 MHz Ethernet IEEE 802.3u.

Connecting the Instrument to the Network

Caution:
Before connecting the instrument to the network it is recommended to contact the network administrator, in particular larger LAN installations are affected. Faults in the connection may have a negative effect on the entire network.

The instrument is connected to a network hub of the desired LAN segment via a commercially-available RJ45 cable (not supplied with the instrument) at the instrument rear panel. Since RJ45 provides no bus but a star network topology, no other precautions need to be taken for the connection.

The connection procedure does not produce any disturbances in the network traffic. Disconnection from the network is easily possible provided that there is no more data traffic from and to the instrument.

Installing the Software

The data transfer in the network takes place in data blocks, called packets. In addition to the useful data, further information on the operation, i.e. protocol data (transmitter, receiver, type of data, sequence), is transferred in the packets. For processing the protocol information, suitable drivers must be installed. For the network services (file transfer, directory services, printing in the network) a network operating system needs to be installed.

Notes:

- *The WINDOWS files required for the installation of network drivers, protocols or services are included in the directory "D:\I386".*
- *A PC keyboard with trackball (or an additional mouse instead) is required for the installation.*

Installation of Drivers for the Network Card

.The network-card drivers do not have to be installed under Windows XP. It is sufficient to connect the network cable to the "LAN-Interface" connector at the rear of the unit. Windows XP will automatically recognize the network link and will activate the required drivers.

Note:
If the original factory setting is required at a later time, i.e. when the unit is to be operated with a different network configuration at a different site, this base configuration can be restored as described below:

- Switch the unit off and on again.
- In the Boot menu, select the entry "Analyzer Firmware Backup" with the cursor keys and confirm with *ENTER* . The device is started from the backup partition and opens a selection window with available device configurations:

```
* * * * * * * * * * * * * * * * * * * * * * * * * * * * * * * *
* INSTUMENT RESTORE PROCEDURE V 1.4     (c) RSD 2002            *
*                                                              *
* Note:                                                        *
* The presence of the LAN-interface requires                   *
* a restore process different from the standard firmware       *
* restore (due to the necessary network drivers).              *
*                                                              *
* The following 3 selections will NOT destroy user defined     *
* limit lines and transducer data                              *
*                                                              *
* Press  1   to perform standard system RESTORE                *
* press  2   to perform system RESTORE with LAN interface      *
* press  3   to ABORT system RESTORE                           *
*                                                              *
* The following selection will DESTROY user defined            *
* limit lines and transducer data                              *
*                                                              *
* Press  4   to perform standard system RESTORE                *
*            (destroys user limit lines and transducers !!!)   *
* press  5   to perform system RESTORE with LAN interface,     *
*            (destroys user limit lines and transducers !!!)   *
*                                                              *
* * * * * * * * * * * * * * * * * * * * * * * * * * * * * * * *
```

- Press 2. Windows XP is newly installed on the analyzer partition of the hard disk with LAN support and device firmware. The device may boot several times. At the end of the installation procedure, the device firmware will be restarted.

The unit is again ready for operation. The configuration of the network protocols then has to be performed according to the following sections.

Configuration of Available Network Protocols (TCP/IP Protocol)

When the unit is delivered, the TCP/IP network protocol is factory-set with the IP address 10.0.0.10 and the subnet mask 255.255.255.0. The steps required to change this configuration and to install further network protocols are described in this and the following sections.

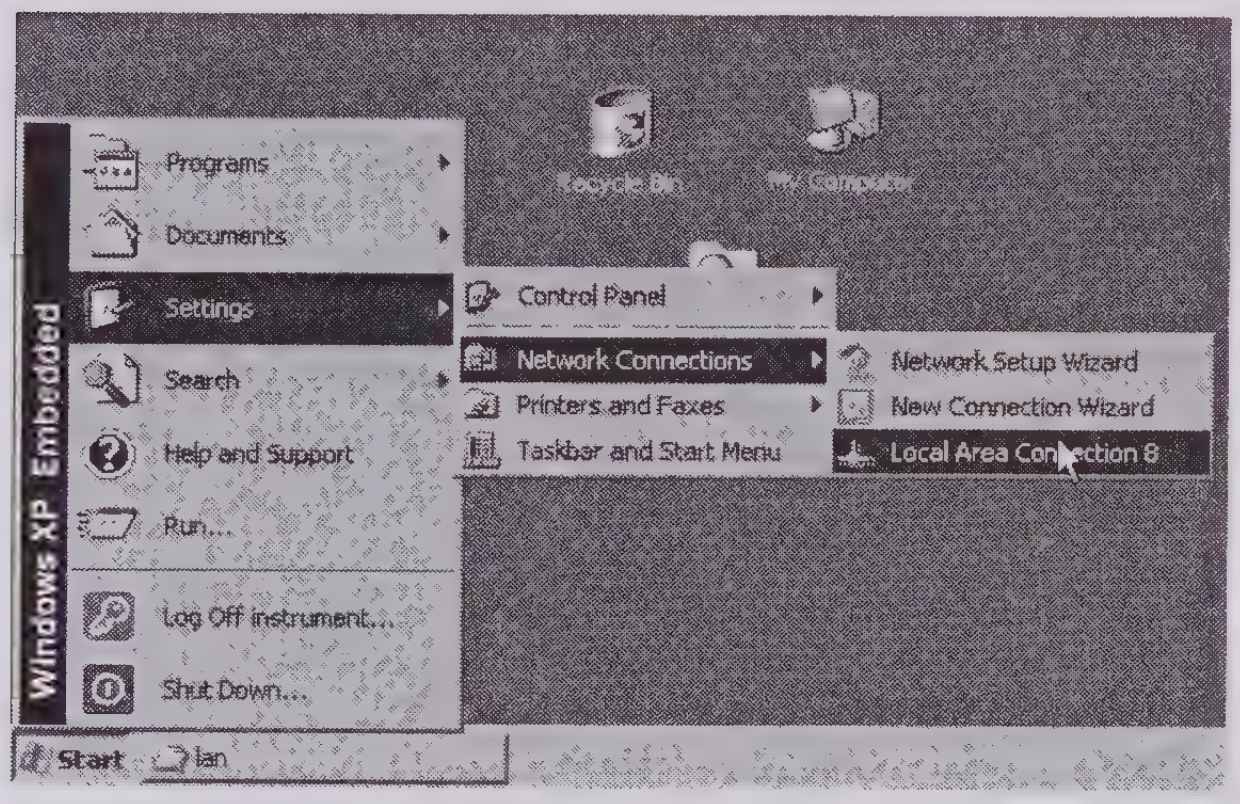

- ➢ Open the Windows XP start menu with the Windows key or *CTRL-ESC*.
- ➢ Click *Settings - Network Connections - Local Area Connection*.

  The *Local Area Connection Status* dialog will be opened.

Note:
Windows XP appends numbers to the name *Local Area Connection Status* (e.g. *Local Area Connection Status 8*) if the configuration is created with the *New Connection Wizard*. These numbers are irrelevant for the following configurations and are therefore not mentioned in the text.

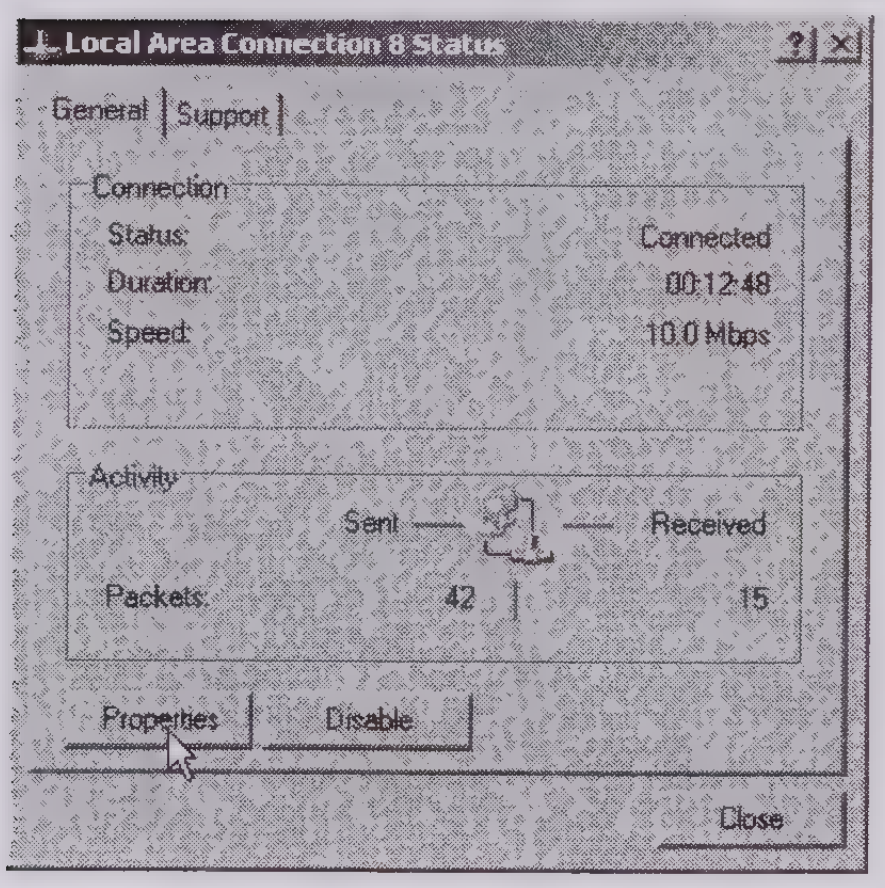

Status: Connected
Duration: 00:12:48
Speed: 10.0 Mbps

	Sent	Received
Packets:	42	15

- ➢ Click the *Properties* button.
  The window with the available network protocols will be opened.

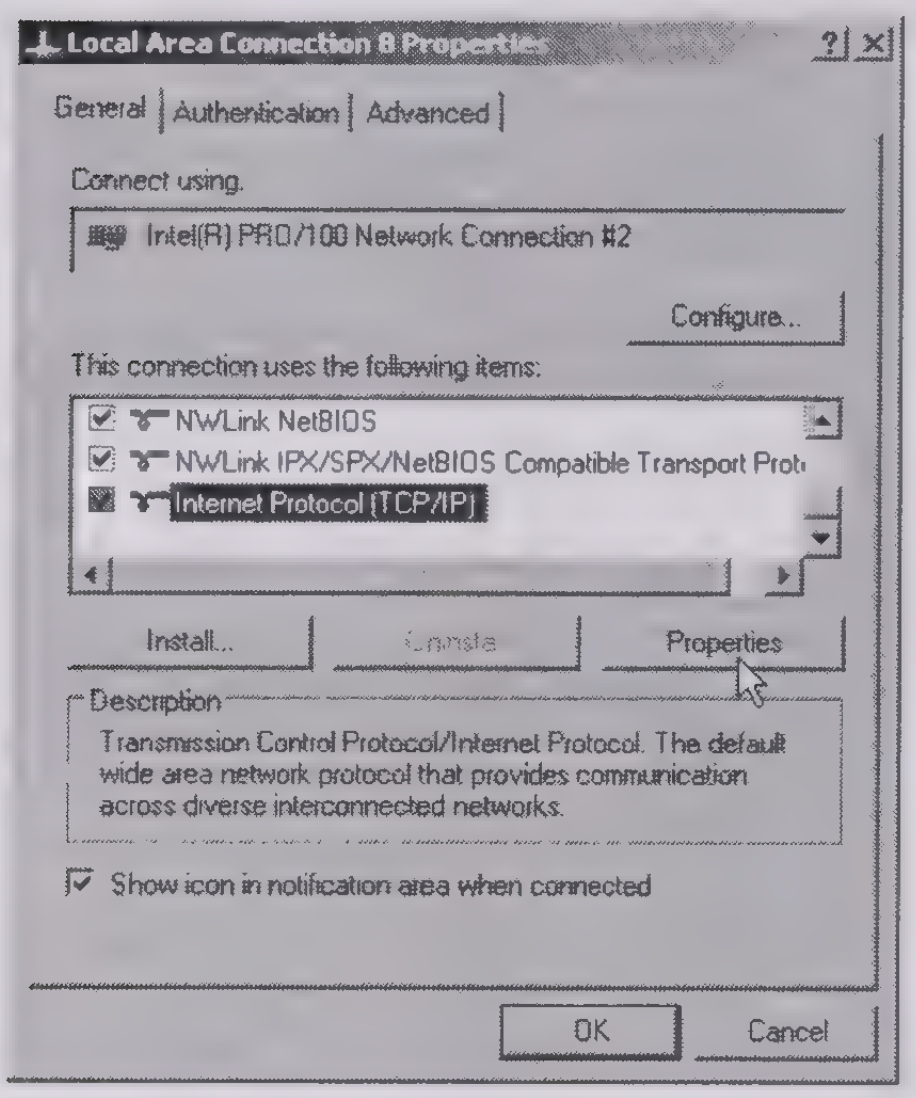

Connect using:

Intel(R) PRO/100 Network Connection #2

This connection uses the following items:

☑ NWLink NetBIOS
☑ NWLink IPX/SPX/NetBIOS Compatible Transport Prot
☑ Internet Protocol (TCP/IP)

Description

Transmission Control Protocol/Internet Protocol. The default wide area network protocol that provides communication across diverse interconnected networks.

☑ Show icon in notification area when connected

- ➢ Click the desired network protocol (in the example: TCP/IP).
- ➢ Click the *Properties* button.

  The dialog with the settings of the selected network protocol will be opened.

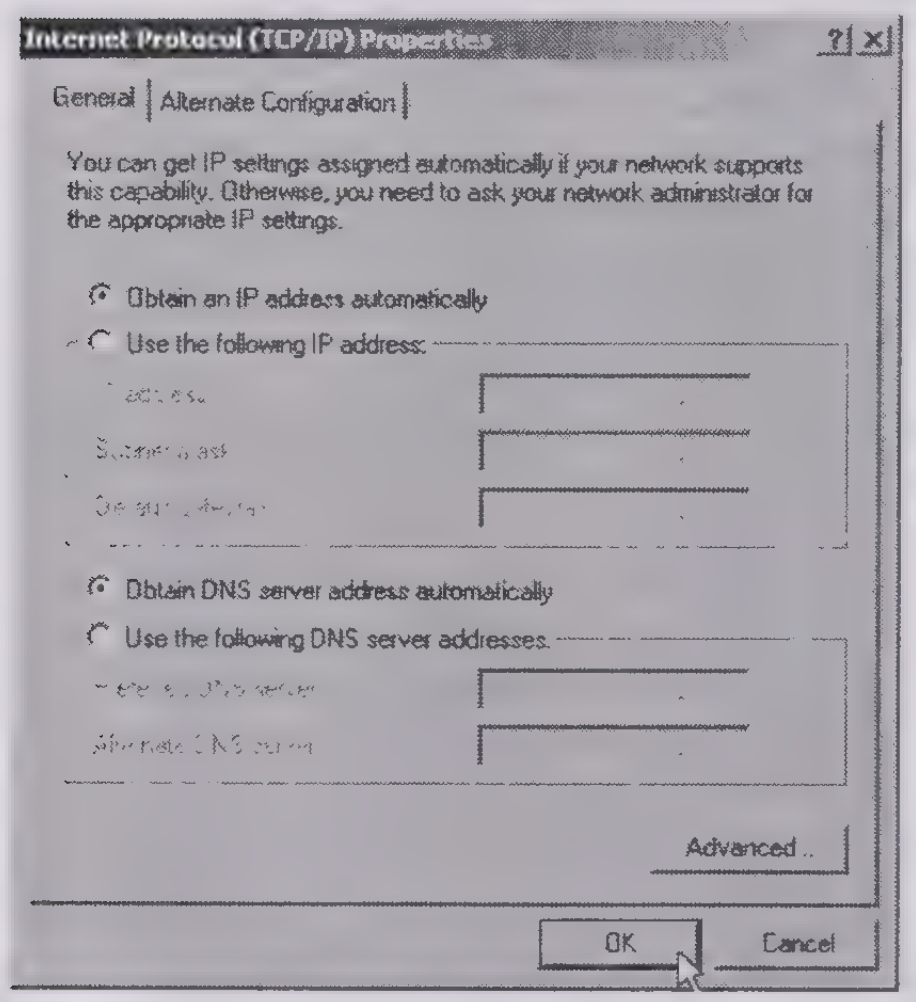

You can get IP settings assigned automatically if your network supports this capability. Otherwise, you need to ask your network administrator for the appropriate IP settings.

● Obtain an IP address automatically
○ Use the following IP address:

● Obtain DNS server address automatically
○ Use the following DNS server addresses:

- ➢ If the IP address is to be automatically requested by a DHCP server, click the entry *Obtain an IP address automatically.*

Note:
Your network administrator knows whether your network has a DHCP server.

- ➢ Click the OK button. Windows will store the configuration.

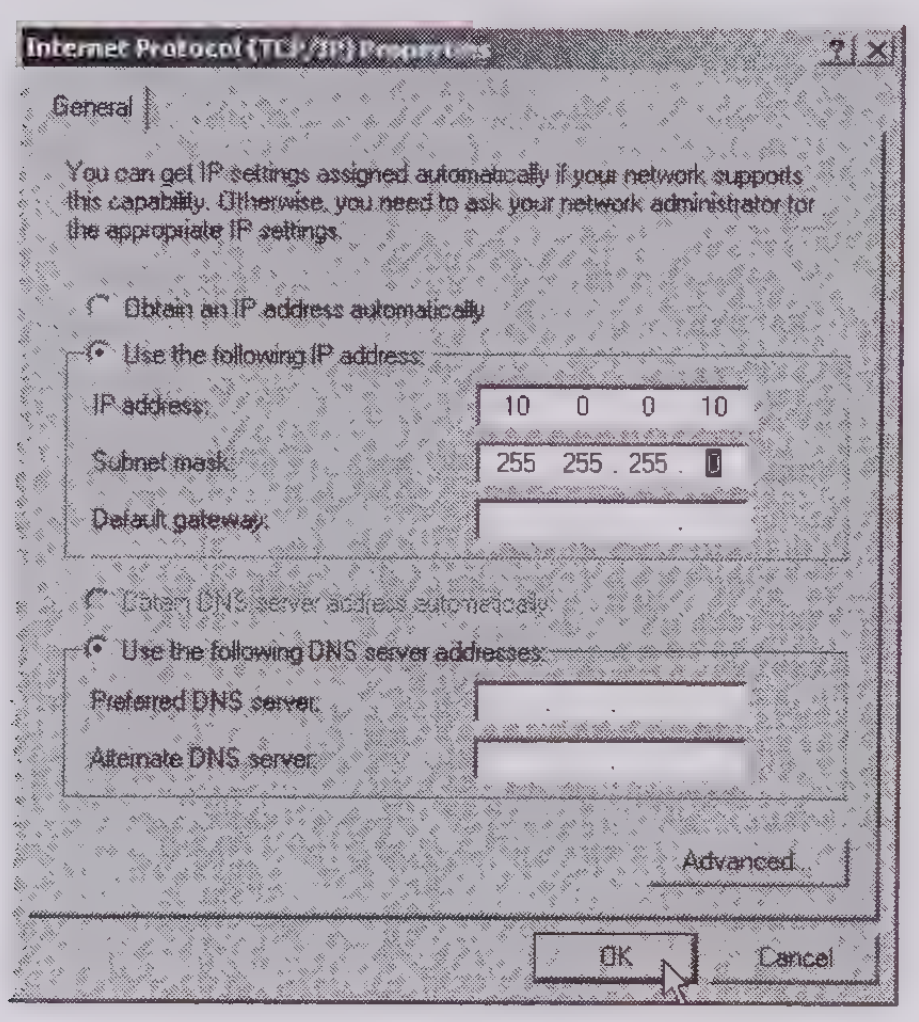

You can get IP settings assigned automatically if your network supports this capability. Otherwise, you need to ask your network administrator for the appropriate IP settings.

○ Obtain an IP address automatically

● Use the following IP address:

IP address: 10 . 0 . 0 . 10

Subnet mask: 255 . 255 . 255 . 0

Default gateway:

○ Obtain DNS server address automatically

● Use the following DNS server addresses:

Preferred DNS server:

Alternate DNS server:

- ➢ If a predefined IP address is to be set (since no DHCP server is available in the network), click the entry *Use the following IP address*.
- ➢ Click the entry *IP address* and enter the IP address.
- ➢ Then click the entry *Subnet mask* and enter the required mask.

Note:
Your network administrator knows which IP addresses and subnet masks are suitable for your network.

- ➢ Click the OK button. Windows checks whether the entered settings are correct and stores the configuration.

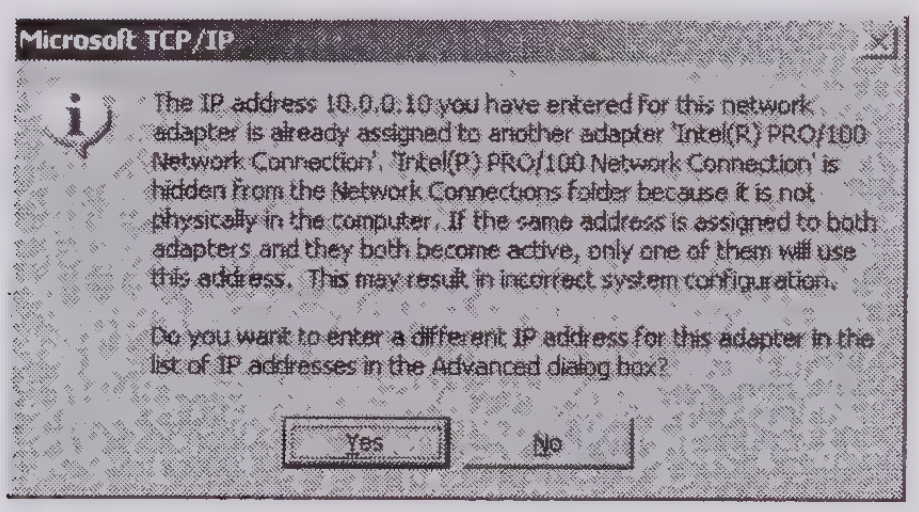

The IP address 10.0.0.10 you have entered for this network adapter is already assigned to another adapter 'Intel(R) PRO/100 Network Connection'. 'Intel(P) PRO/100 Network Connection' is hidden from the Network Connections folder because it is not physically in the computer. If the same address is assigned to both adapters and they both become active, only one of them will use this address. This may result in incorrect system configuration.

Do you want to enter a different IP address for this adapter in the list of IP addresses in the Advanced dialog box?

If an invalid IP address or subnet mask was entered, a corresponding error message will be displayed together with a question as whether a different address or mask is to be entered.

- ➢ Click the Yes button.
  The dialog for entering the TCP/IP parameters will again be opened.

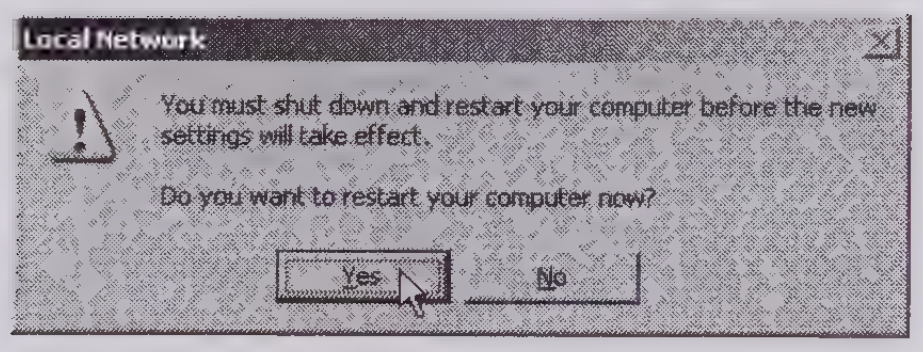

You must shut down and restart your computer before the new settings will take effect.

Do you want to restart your computer now?

If all settings are correct, the request to start the unit again will be displayed depending on the changed settings.

- ➢ Click the Yes button.
  Windows will restart the system.

Installation of Further Network Protocols and Services (e.g. Novell Netware Support)

Note: *The network administrator knows the protocols to be used. The TCP/IP protocol has to be installed for the RSIB protocol and the VXI11 support. The support for the Novell netware is additionally installed in the following example.*

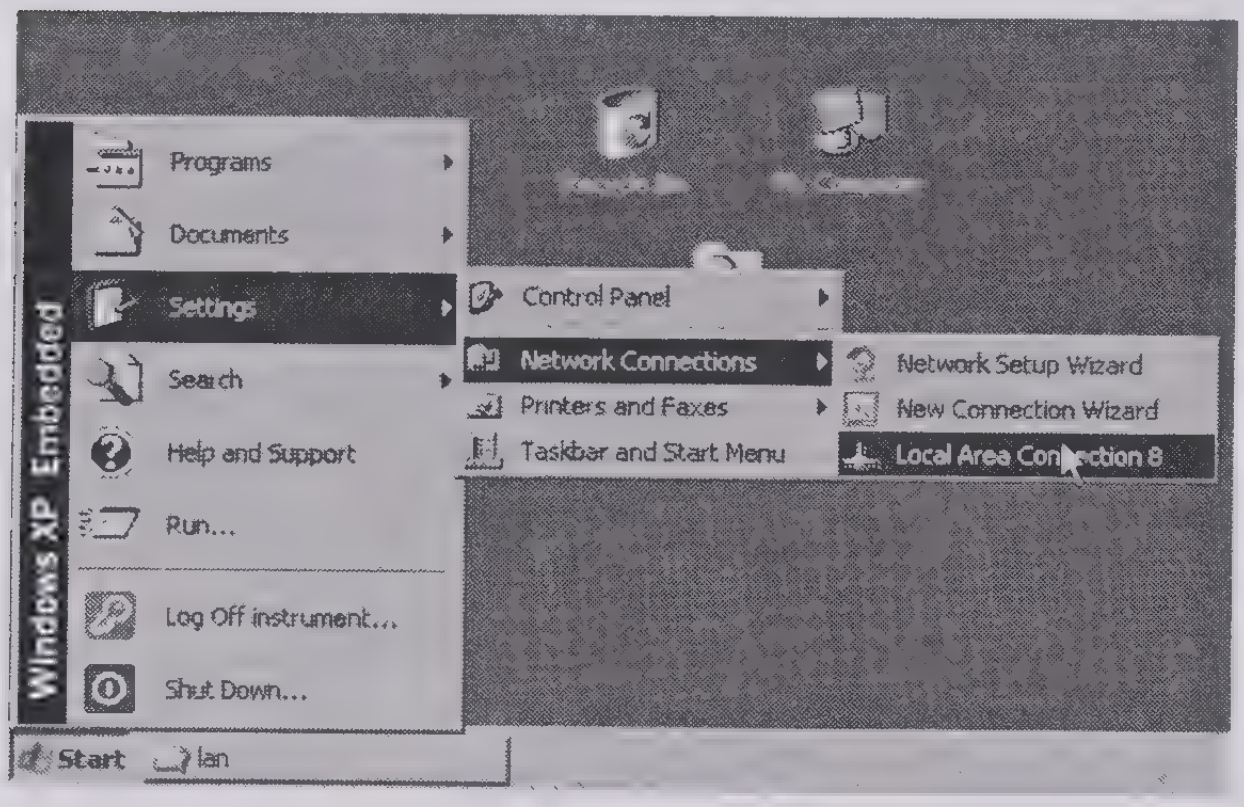

- ➢ Open the Windows XP start menu using the Windows key or *CTRL-ESC*.
- ➢ Click *Settings - Network Connections - Local Area Connection*.

  The *Local Area Connection Status* dialog will be opened.

Note:
Windows XP appends numbers to the name *Local Area Connection Status* (e.g. *Local Area Connection Status 8*) if the configuration is created with the *New Connection Wizard*. These numbers are irrelevant for the following configurations and are therefore not mentioned in the text.

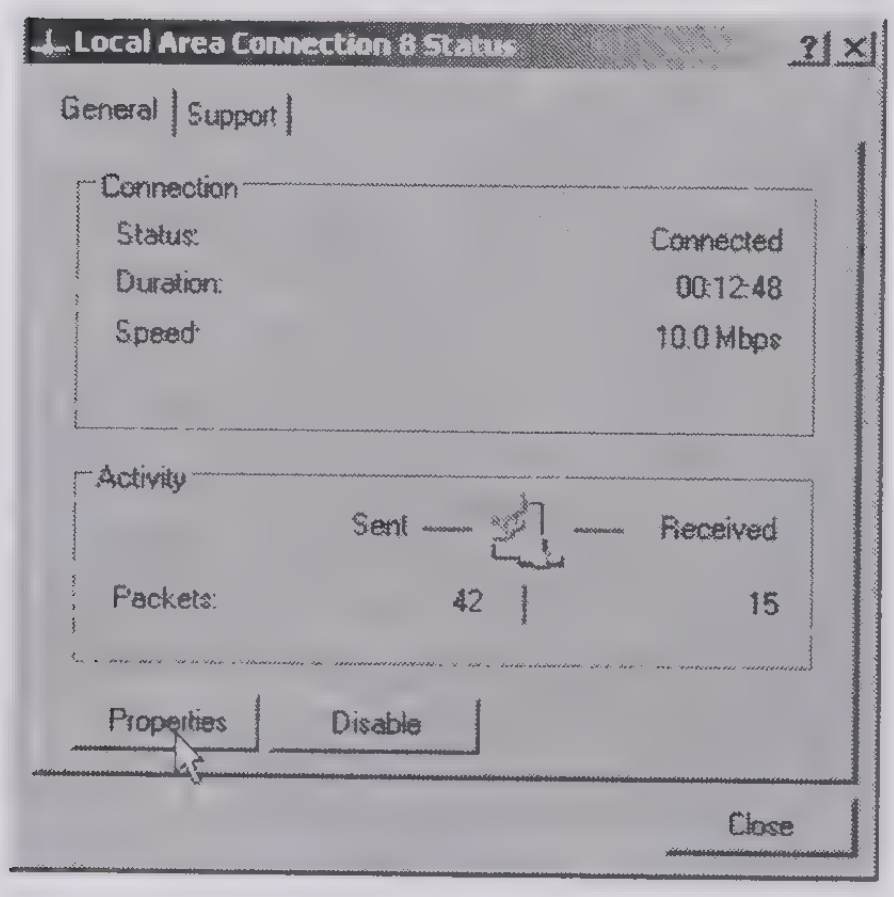

Status: Connected
Duration: 00:12:48
Speed: 10.0 Mbps
Sent — Received
Packets: 42 15

- ➢ Press the *Properties* button.
  The window with the available network protocols will be opened.

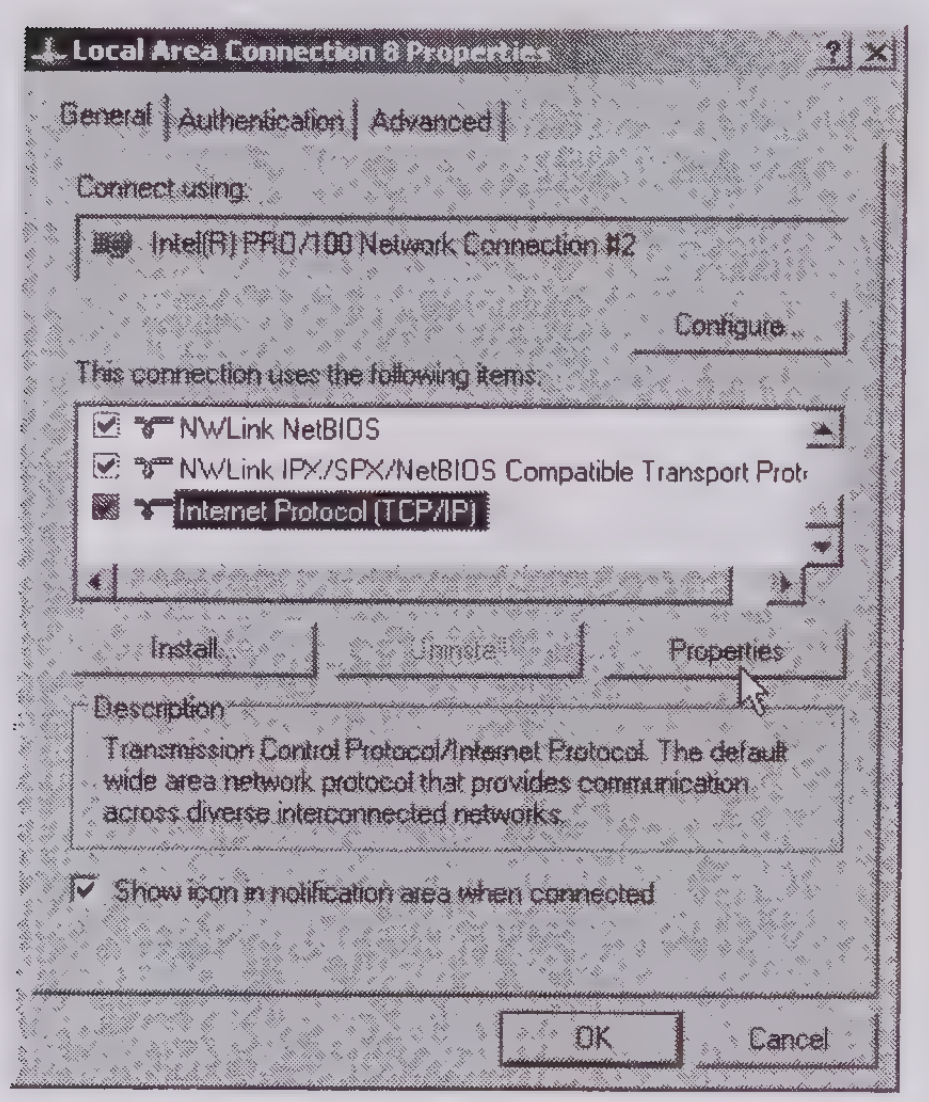

Connect using:

Intel(R) PRO/100 Network Connection #2

This connection uses the following items:

☑ NWLink NetBIOS
☑ NWLink IPX/SPX/NetBIOS Compatible Transport Prot
☑ Internet Protocol (TCP/IP)

Description

Transmission Control Protocol/Internet Protocol. The default wide area network protocol that provides communication across diverse interconnected networks.

☑ Show icon in notification area when connected

- ➢ Click the *Install* button.

  The list of installable network components will be opened.

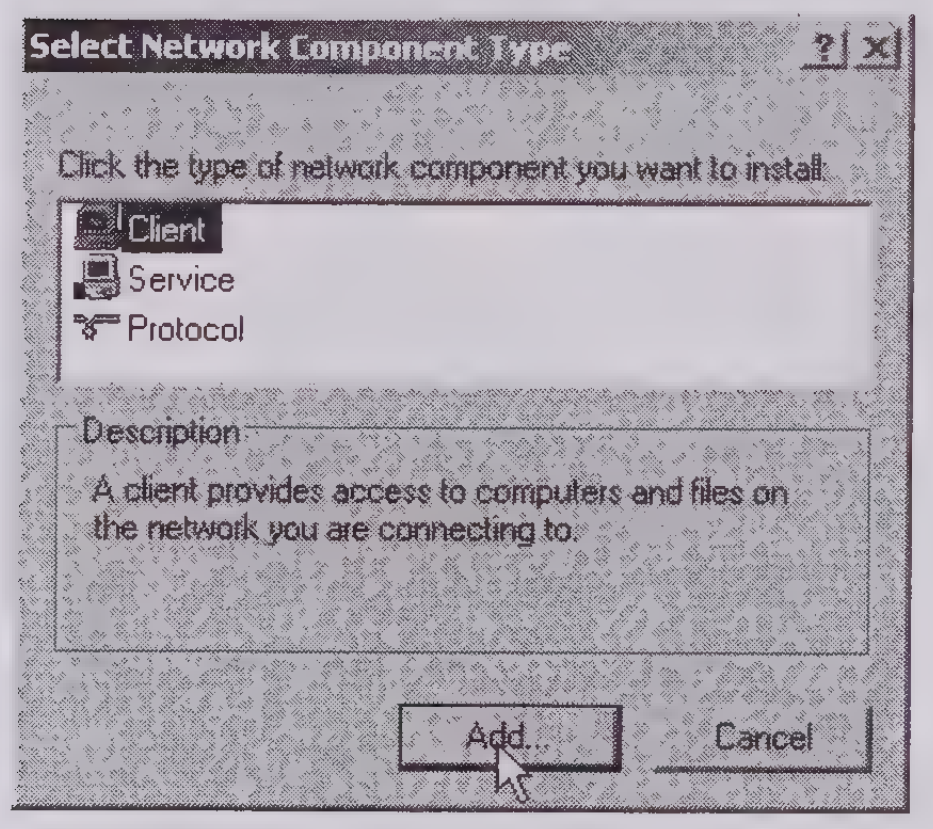

Click the type of network component you want to install:

Client
Service
Protocol

Description

A client provides access to computers and files on the network you are connecting to.

- ➢ Select *Client*.
- ➢ Click the *Add...* button.

  The list of available network protocols will be opened.

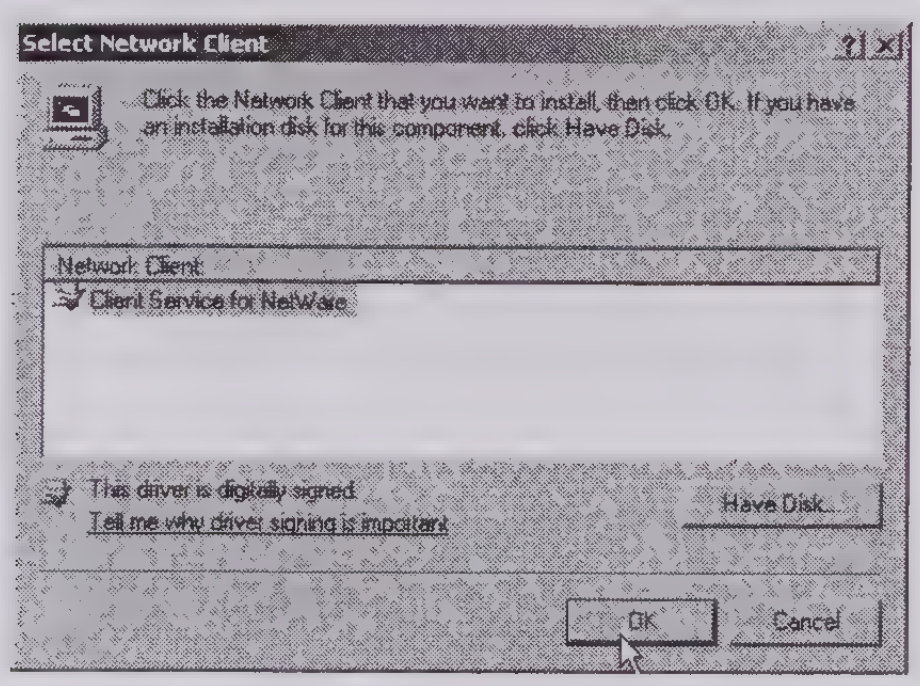

Click the Network Client that you want to install, then click OK. If you have an installation disk for this component, click Have Disk.

Network Client:

Client Service for NetWare

This driver is digitally signed.

Tell me why driver signing is important

- ➢ Select *Client Service for NetWare*.
- ➢ Click the *OK* button.

  The network driver for Novell Netware is installed.

Note:

- Your network administrator knows which clients, services and protocols have to be installed for your network.
- If network components not contained in D:\I386 are to be installed, a corresponding disk including the drivers has to be prepared (or a CD that can be read via a USB CD-ROM drive).

  In this case, click the *Have Disk...* button and indicate the path with the corresponding drivers.

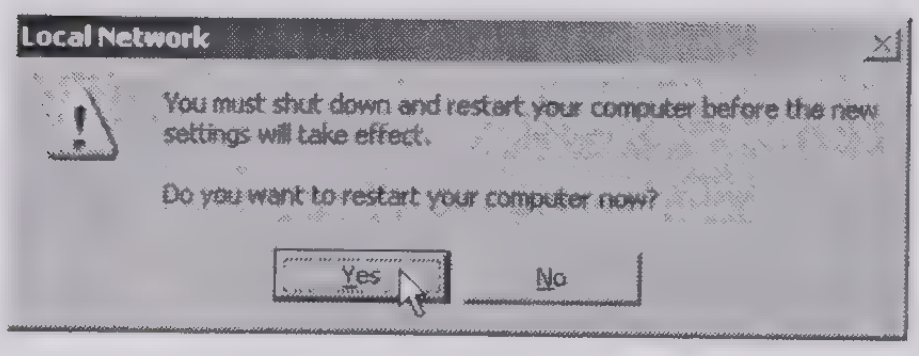

You must shut down and restart your computer before the new settings will take effect.

Do you want to restart your computer now?

After completion of the installation, the user is requested to restart the unit.

➢Click the Yes button.
Windows will restart the system.

Examples of Configurations

Network	Protocols	Services	Notes
NOVELL Netware	NWLink IPX/SPX Compatible Transport	Client Service for NetWare	In folder "Protocols - Properties", the frame type used in the network is to be set.
IP Networks (FTP, TELNET, WWW, GOPHER, etc)	TCP/IP Protocol	Simple TCP/IP Services	In folder "Protocols - Properties", an IP address that is unique in the network is to be set.
MICROSOFT Network	NetBEUI Protocol or TCP/IP Protocol	Workstation Server	In folder "Identification - Computer Name", a name that is unique in the network is to be entered.

Subsequent Changing of the Network Configuration (Computer Name, Domain, Workgroup, etc)

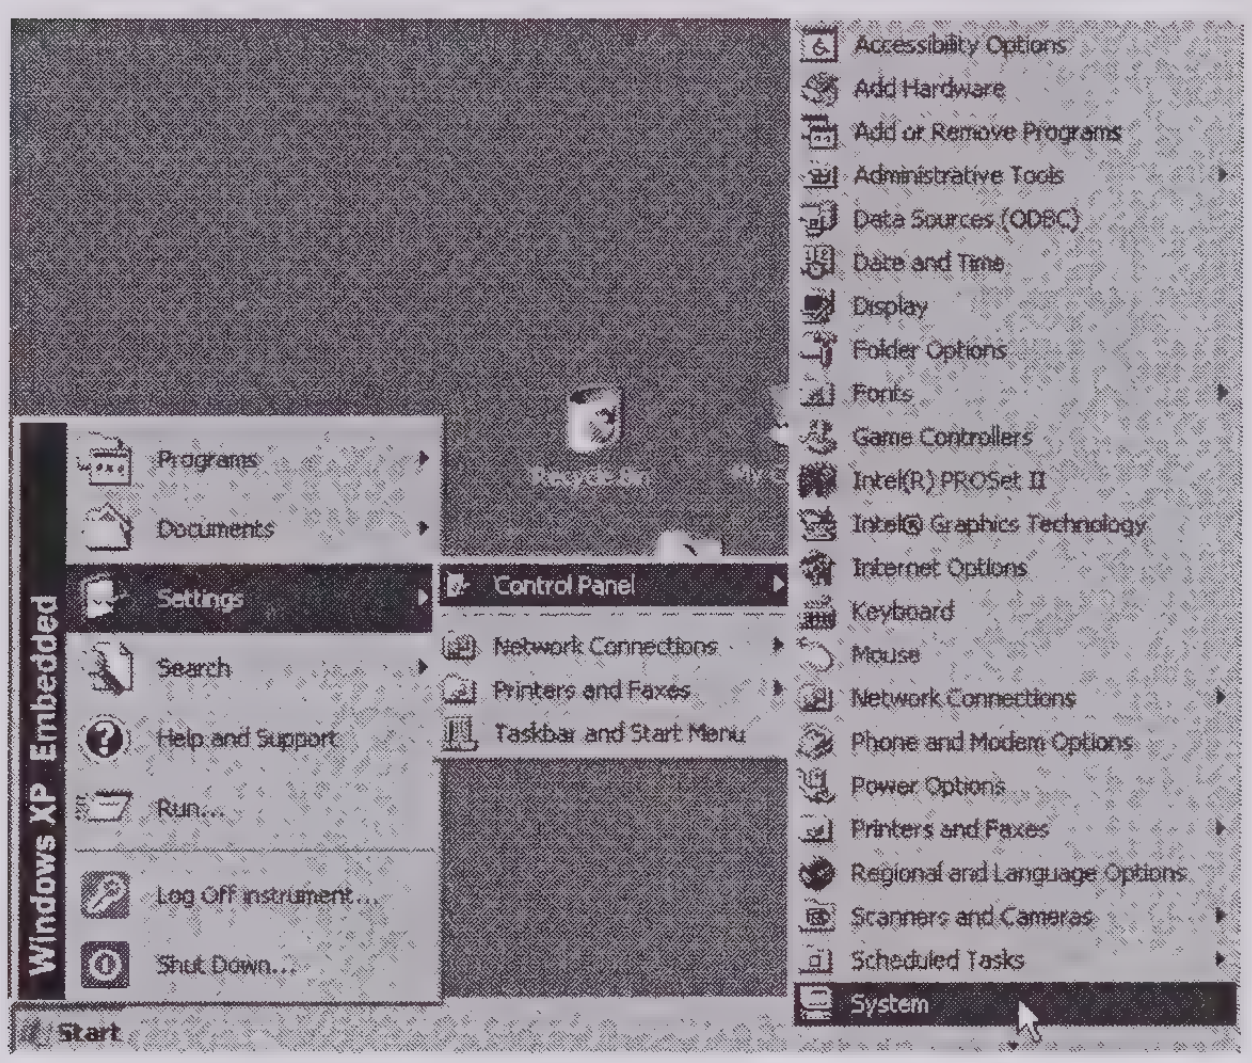

After completion of the installation, the computer name can be adapted as follows:

- ➢ Press the Windows key or <CTRL><ESC>.

  The Windows Start menu will be opened.

- ➢ Select Settings - Control Panel - System.

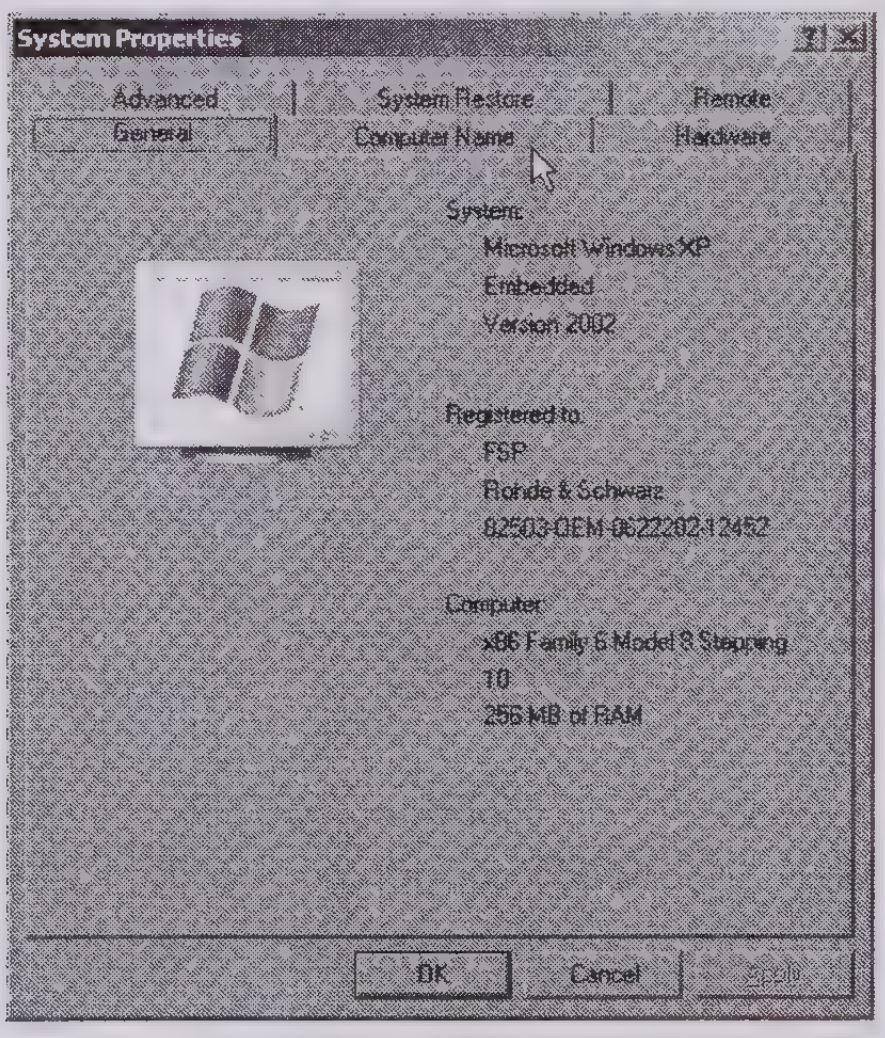

System:
Microsoft Windows XP
Embedded
Version 2002

Registered to:
FSP
Rohde & Schwarz
82503-OEM-0622202-12452

Computer:
x86 Family 6 Model 8 Stepping
10
256 MB of RAM

- ➢ Select the "Computer Name" tab.

Note:
The other settings can be changed after selection of the other tabs. It is strongly recommended to consult the network administrator beforehand.

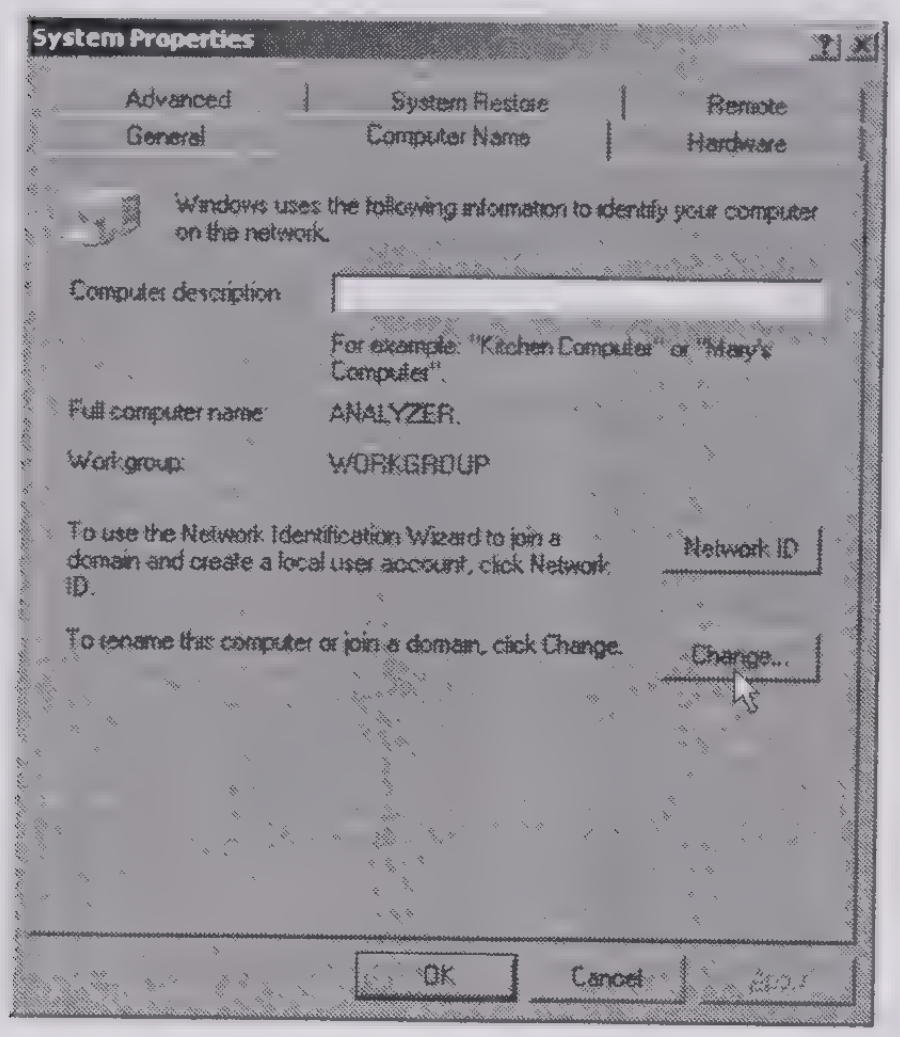

Windows uses the following information to identify your computer on the network.

For example: "Kitchen Computer" or "Mary's Computer".

Full computer name: ANALYZER.

Workgroup: WORKGROUP

To use the Network Identification Wizard to join a domain and create a local user account, click Network ID.

To rename this computer or join a domain, click Change.

➢ Click the *Change* button.

The dialog to change the computer name, the domain and workgroup will be opened.

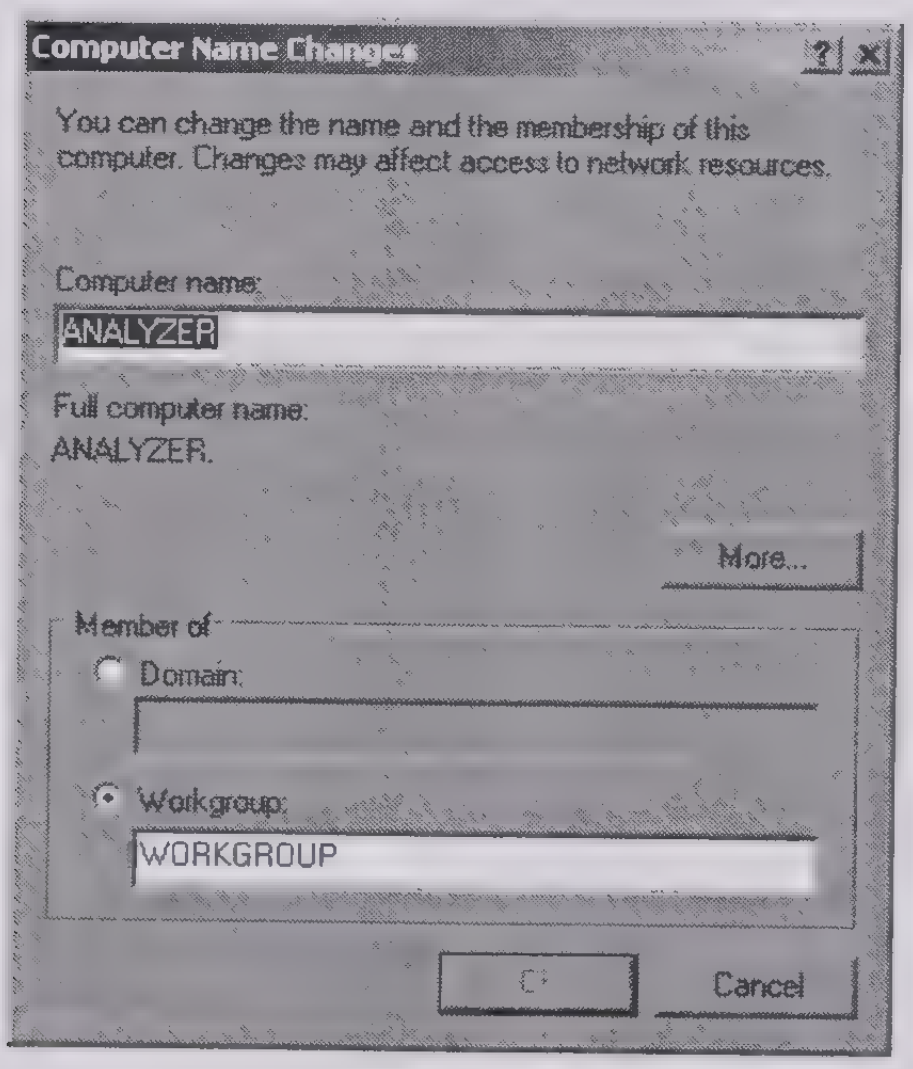

You can change the name and the membership of this computer. Changes may affect access to network resources.

Computer name: ANALYZER

Full computer name: ANALYZER.

Workgroup: WORKGROUP

➢ Enter a new computer name.

➢ If required, enter the desired domain or workgroup.

➢ Confirm the changes with *OK*.

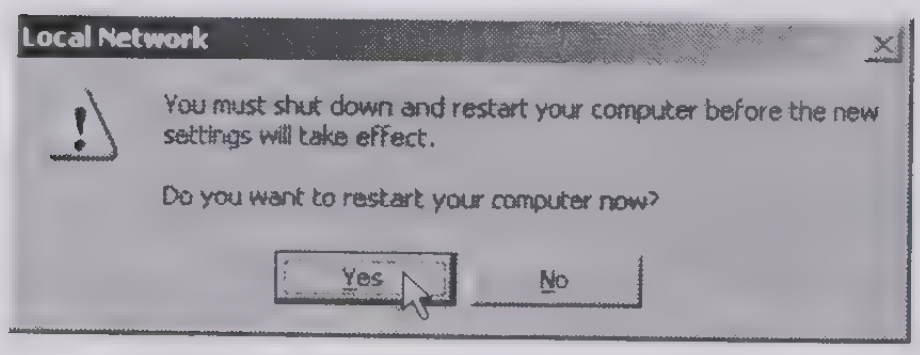

You must shut down and restart your computer before the new settings will take effect.

Do you want to restart your computer now?

If the request to restart the unit is displayed:

➢ Click the Yes button.
Windows will restart the system.

Operating the Instrument without a Network

If the instrument is to be operated without any network connection for a limited or unlimited period of time, or permanently, no special precautions have to be taken in contrast to Windows NT. Windows XP automatically recognizes the interruption of the network connection and will not carry out any setup when the instrument is switched on.

If the user name and the password are not to be queried, proceed as described in section "Reenabling the Autologin Mechanism".

Operating the Instrument on the Network

After the network support has been installed, it is possible to exchange data between the instrument and other computers and to use printers in the network.
A prerequisite to network operation is having the appropriate access rights for the required network resources. Resources may be file directories of other computers or also central printers.
Access rights can be obtained from the network or server administrator. In that respect it is necessary to obtain the network name of the resource as well as the corresponding access rights.
To prevent misuse, the resources are protected by passwords. Normally, every entitled user of the resources is assigned a user name that is also protected by a password. Resources can then be assigned to this user. It is possible to determine the type of data access, i.e. whether data can only be read or also written, as well as shared data access. Depending on the network operating system, different types of usage are possible.

NOVELL Networks

The operating system NETWARE from NOVELL is a server-based system. Data cannot be exchanged between individual workstations; data transfer takes place between the PC and a server. This server provides memory space and the connection to network printers. On a server, data is organized in directories as under DOS and mapped to the workstation as virtual drives. A virtual drive behaves like an additional hard disk on the workstation, and the data can be edited accordingly. Network printers can also be addressed like normal printers.

There are two versions of the NOVELL network operating system: bindary-based (NETWARE 3) and NDS-based (more recent versions of NETWARE). With the older version (NETWARE 3), each server manages its resources on its own and is independent. A user must be managed on each server separately. In the case of NDS-based versions, all resources in the network are managed together in the NDS (NOVELL DIRECTORY SERVICE). The user must log into the network only once and is given access to the resources according to his/her access rights. The individual resources and users are managed as objects in a hierarchical tree (NDS TREE). The position of the object in the tree is referred to as "CONTEXT" with NETWARE and must be known for access to the resources.

MICROSOFT Network

In case of a MICROSOFT network, data can be exchanged both between workstations (peer to peer) and between workstations and servers. The latter can supply access to files and connection to the printers. On a server, data is organized in directories as under DOS and mapped to the workstation as virtual drives. A virtual drive behaves like an additional hard disk on the workstation, and the data can be edited accordingly. Network printers can also be addressed like normal printers. A connection is possible to DOS, WINDOWS FOR WORKGROUPS, WINDOWS95/98/ME, WINDOWS NT/XP.

Defining Users

After the network driver software has been installed, the instrument will output an error message on the next power-on, as there is no user called "Instrument" (= user name for XP autologin) in the network. It is therefore necessary to define a common user for Windows XP, to adapt the password to the network password and the network and to disable the autologin mechanism subsequently.
The definition of new users in the network is done by the network administrator. For definition of a new user on the instrument, the User Account Assistant is required:

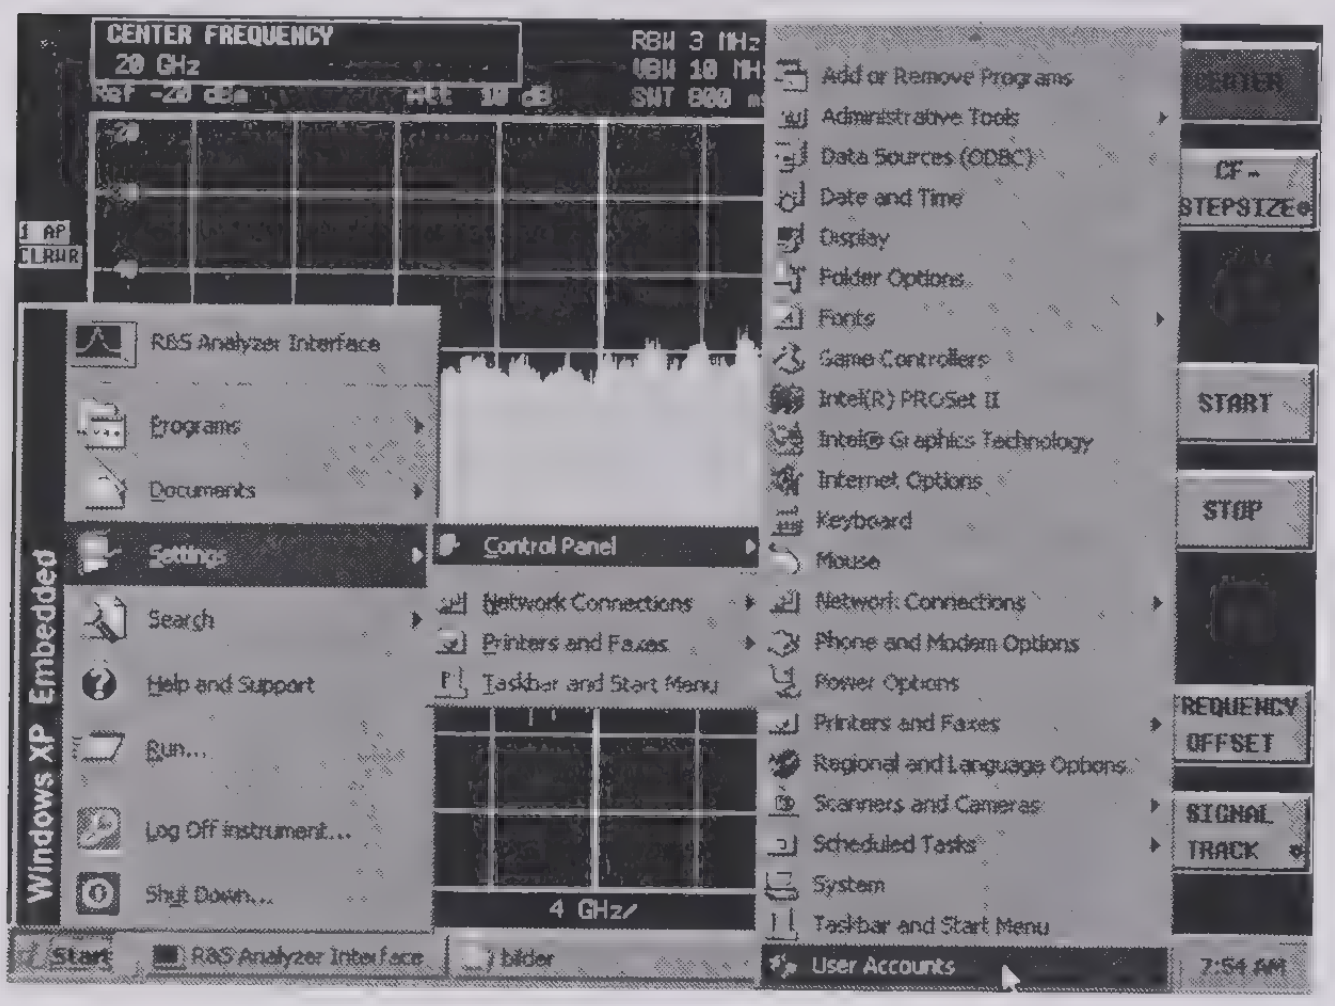

- ➢ Call up the Windows XP start menu using the Windows key or the key combination <CTRL> <ESC>.
- ➢ Then click "Settings", "Control Panel" and "User Accounts" one after the other.

The User Accounts wizard with the *Pick a task...* dialog will be opened.

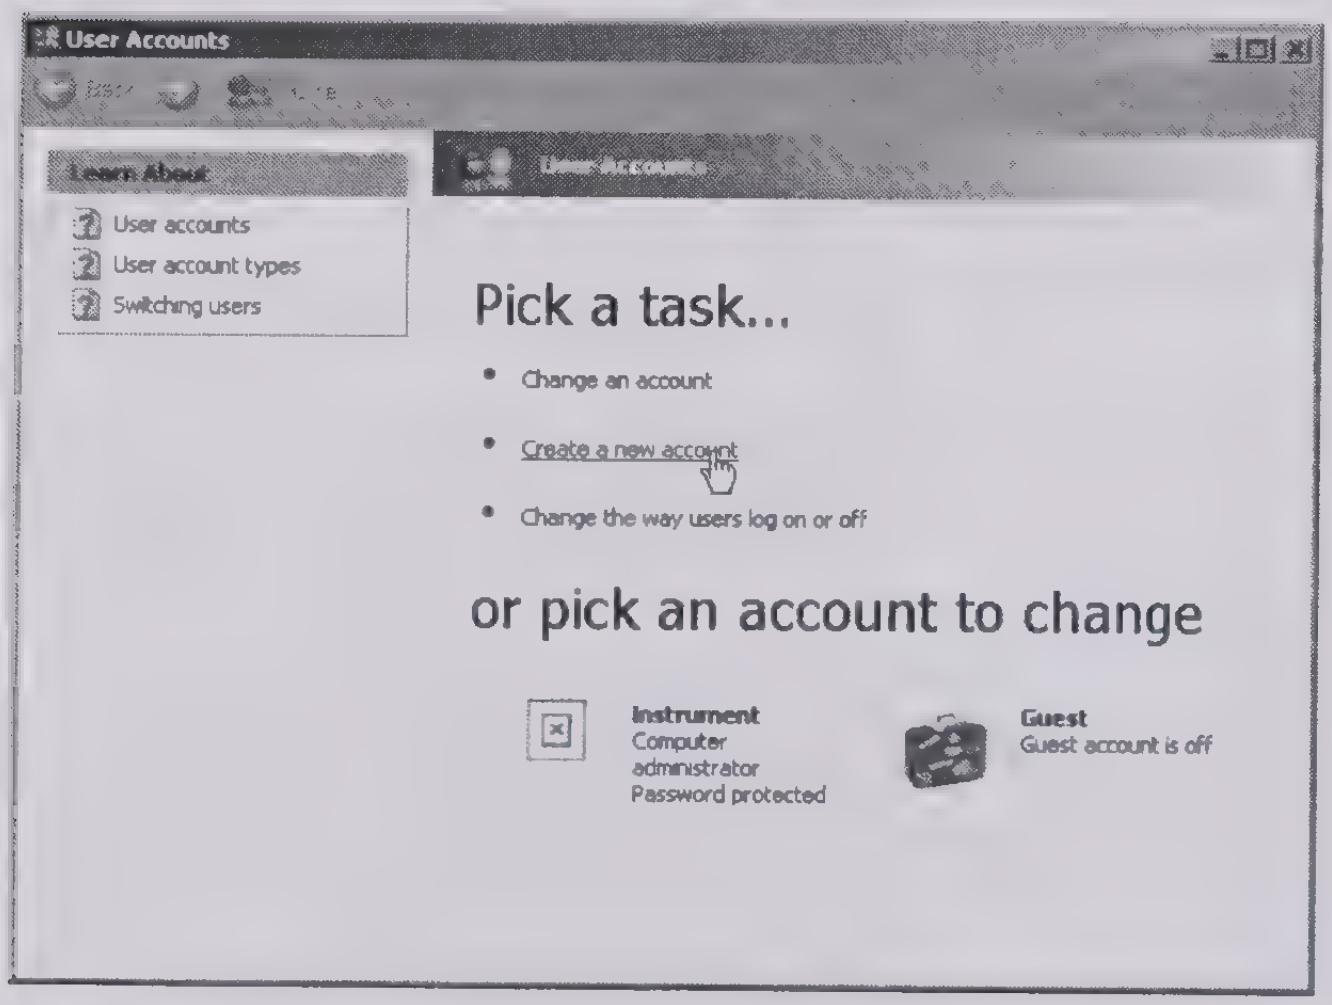

- ➢ Select "Create a new account" .

The dialog to enter a new user name will be opened.

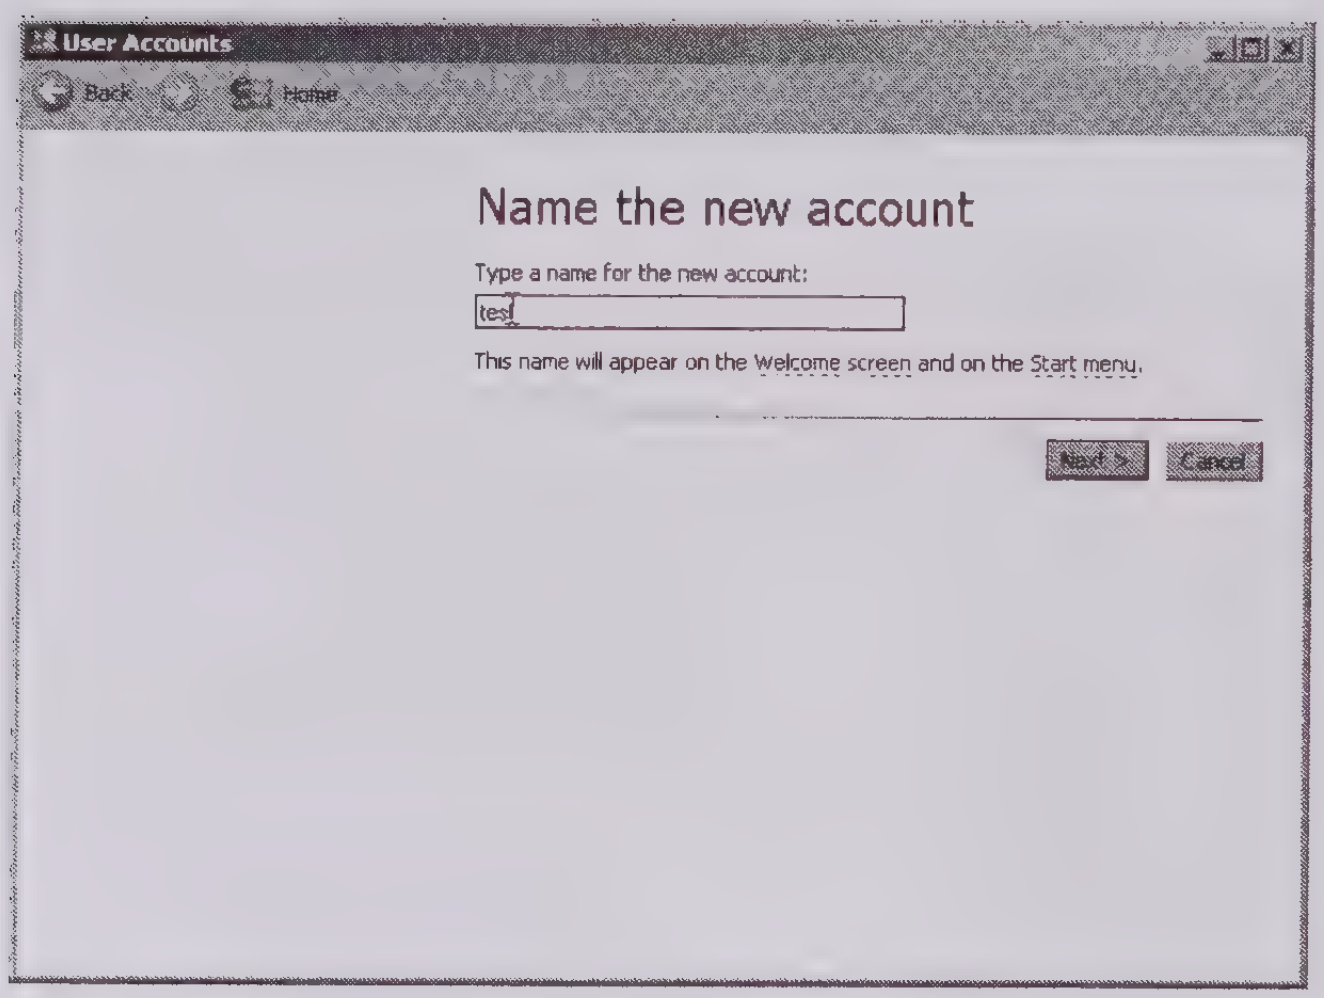

Name the new account

Type a name for the new account:

test

This name will appear on the Welcome screen and on the Start menu.

- ➢ Enter the name of the new user into the text field and terminate the entry with "Next ->".

  The *Pick an account type* dialog to select the user rights will be opened.

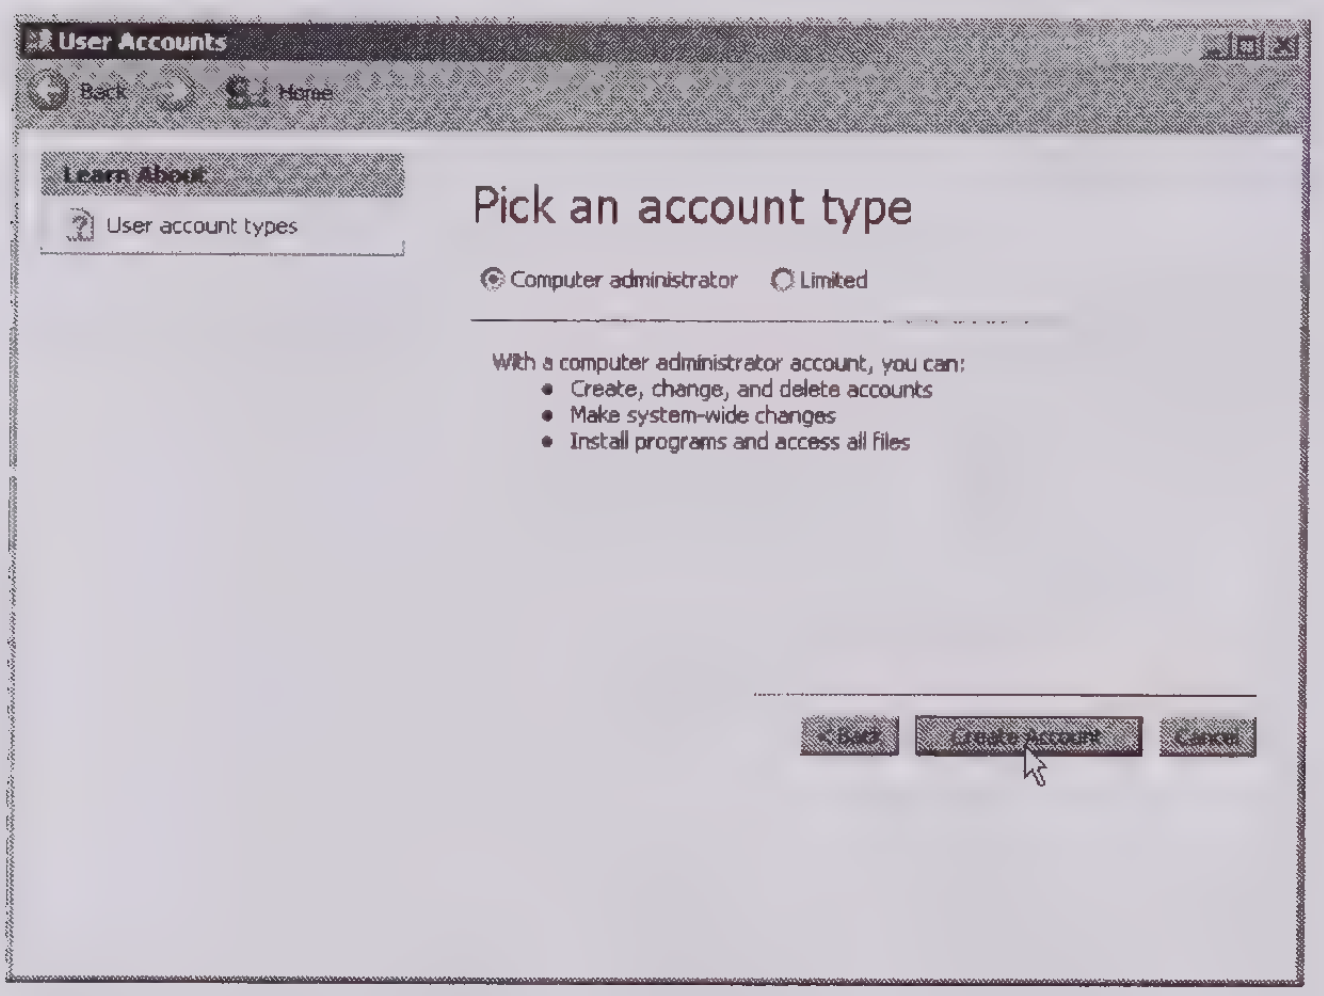

Pick an account type

● Computer administrator ○ Limited

With a computer administrator account, you can:

- Create, change, and delete accounts
- Make system-wide changes
- Install programs and access all files

- ➢ Select *Computer administrator.*

Note:
Administrator rights are required to ensure trouble-free operation of the firmware.

- ➢ Confirm the newly created user with the *Create Account* button.

  The new user is created.

Changing the User Password

After the new user has been created, the password has to be adapted to the network password. This is also done via the User Accounts wizard:

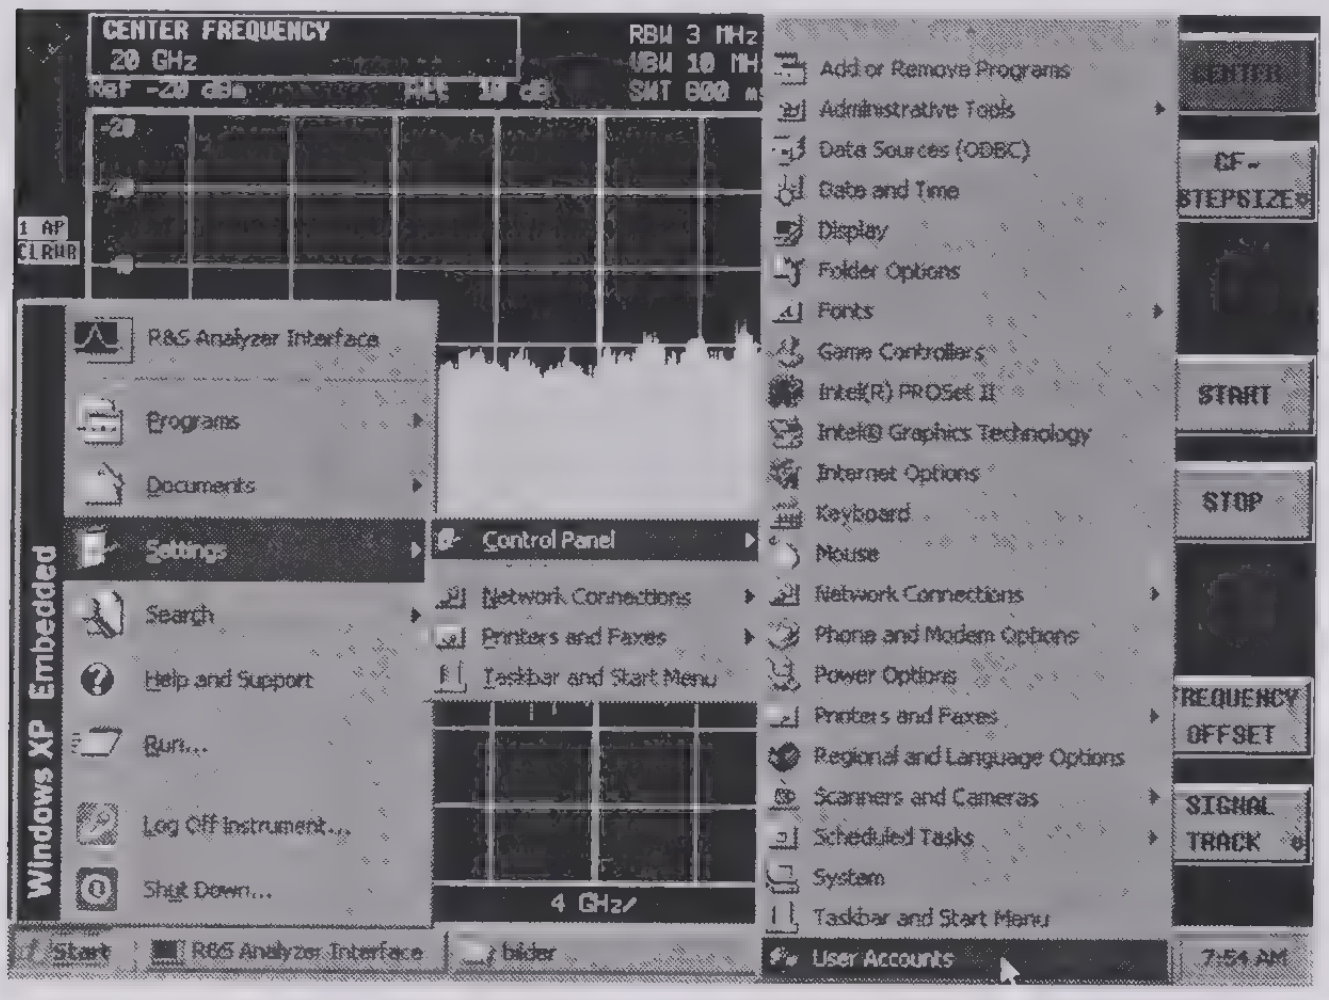

- Call up the Windows XP start menu using the Windows key or the key combination <CTRL> <ESC>.
- Then click "Settings", "Control Panel" and "User Accounts" one after the other.

The User Accounts wizard with the *Pick a task...* dialog will be opened.

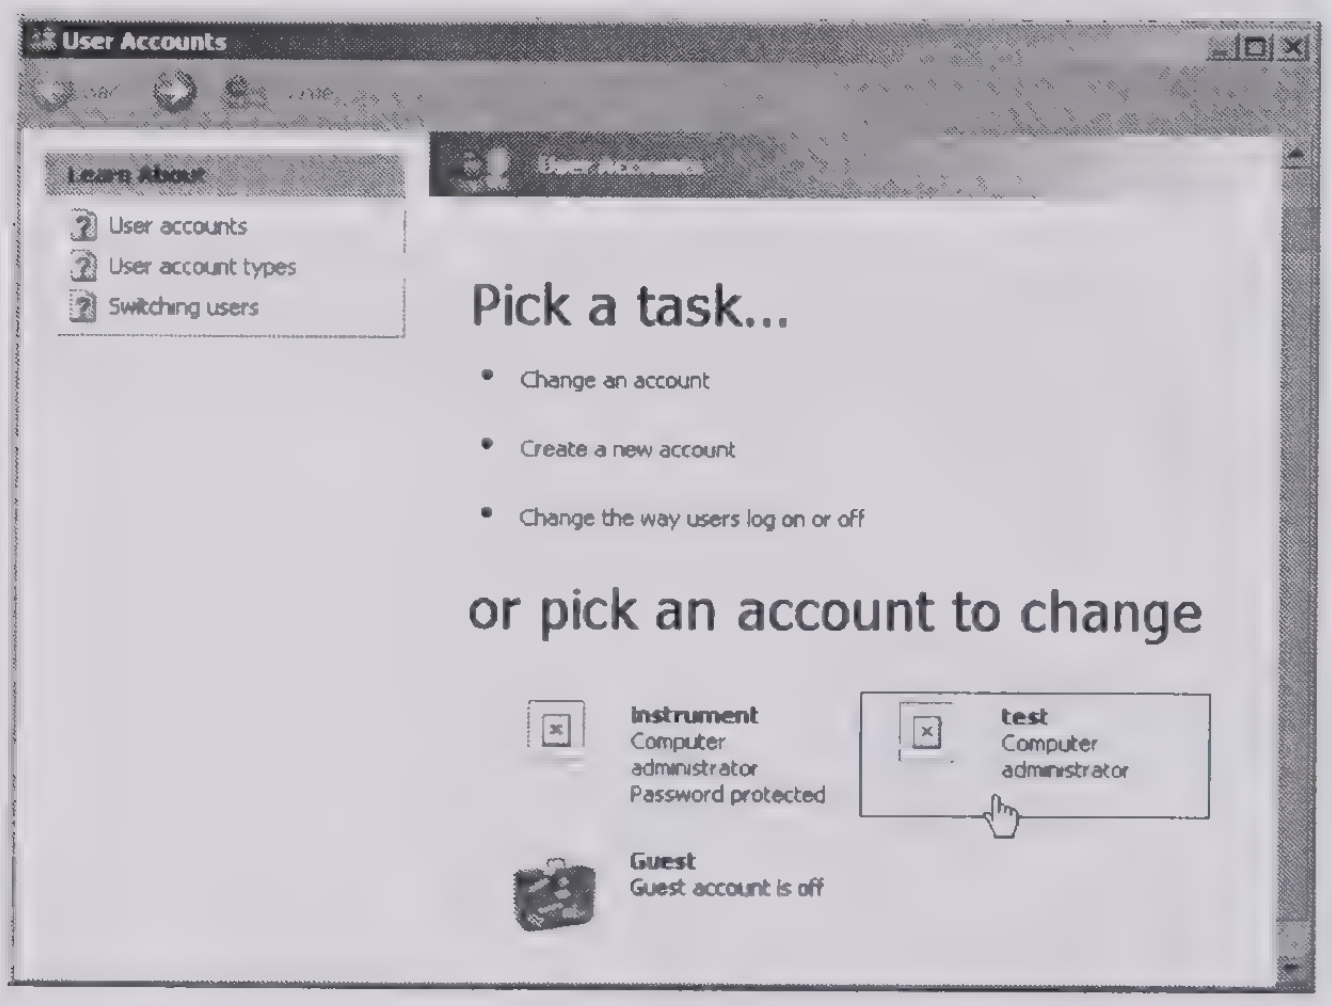

- Click the required user account (in the example: "test").
  The dialog to select the desired action will be opened.

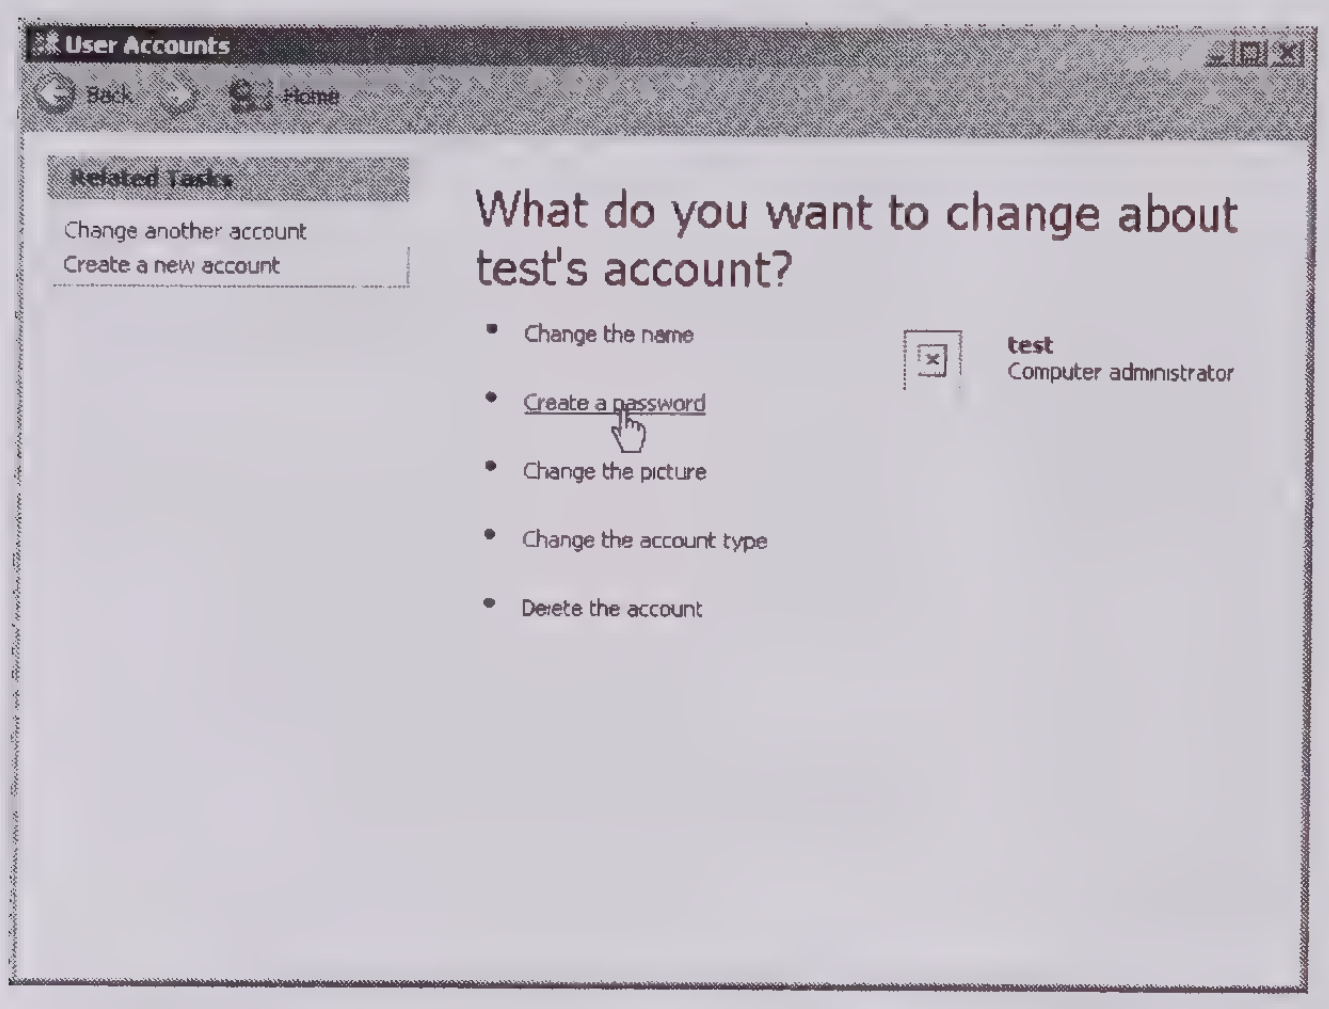

What do you want to change about test's account?

- Click *Create a password.*

  The dialog to enter a new password will be opened.

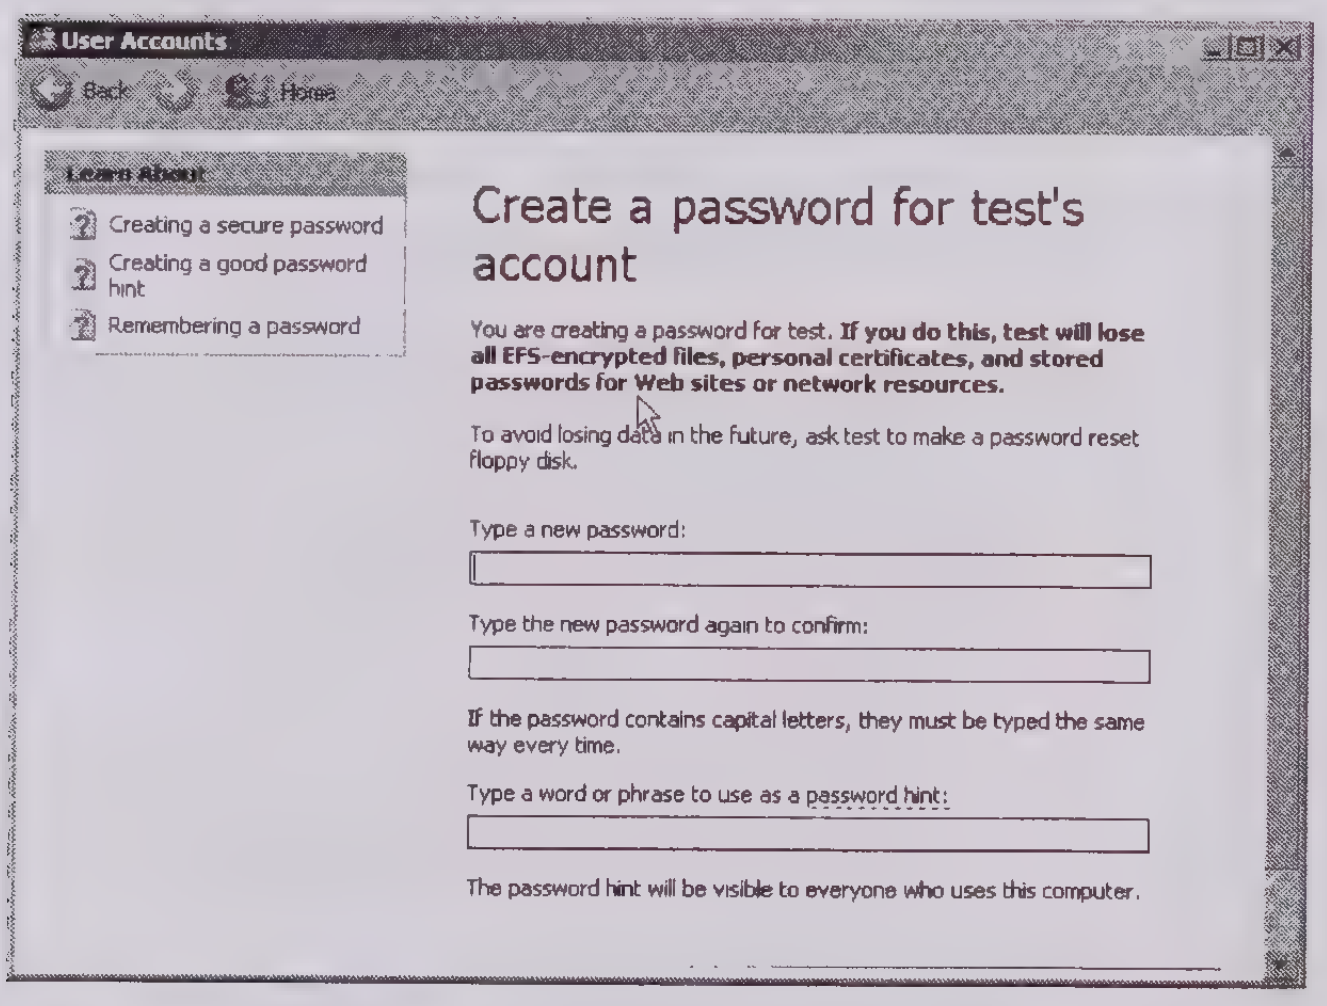

Create a password for test's account

You are creating a password for test. **If you do this, test will lose all EFS-encrypted files, personal certificates, and stored passwords for Web sites or network resources.**

To avoid losing data in the future, ask test to make a password reset floppy disk.

Type a new password:

Type the new password again to confirm:

If the password contains capital letters, they must be typed the same way every time.

Type a word or phrase to use as a password hint:

The password hint will be visible to everyone who uses this computer.

- Enter the new password in the upper text line and repeat the entry in the line below.

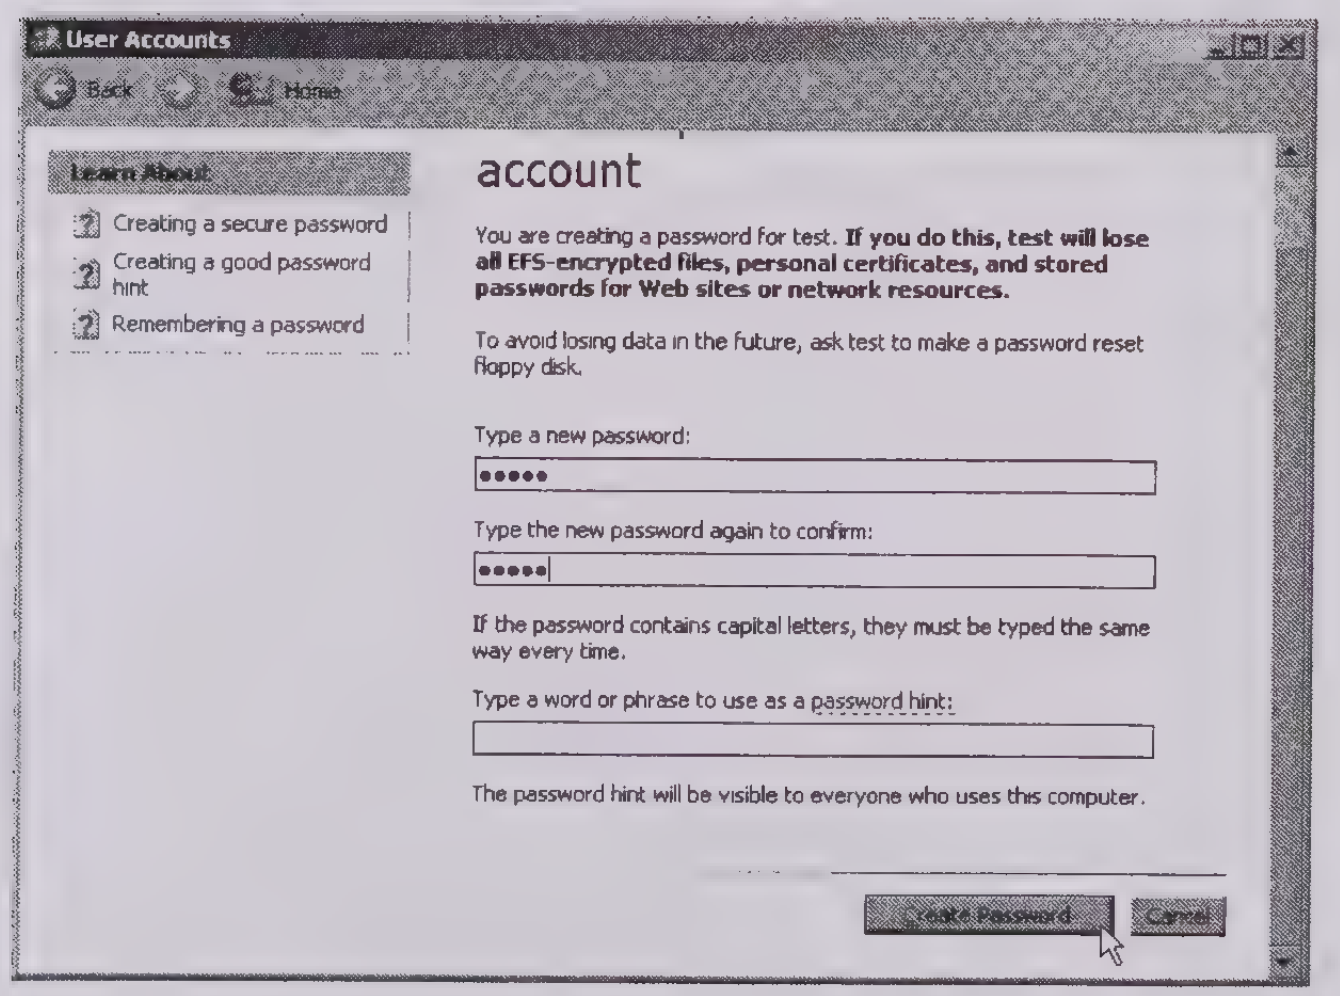

account

You are creating a password for test. **If you do this, test will lose all EFS-encrypted files, personal certificates, and stored passwords for Web sites or network resources.**

To avoid losing data in the future, ask test to make a password reset floppy disk.

Type a new password: ●●●●●

Type the new password again to confirm: ●●●●●

If the password contains capital letters, they must be typed the same way every time.

Type a word or phrase to use as a password hint:

The password hint will be visible to everyone who uses this computer.

- Scroll the picture contents downwards and terminate the entry with the *Create Password* button.

  The new password is activated.

NOVELL network only: Configure NOVELL client

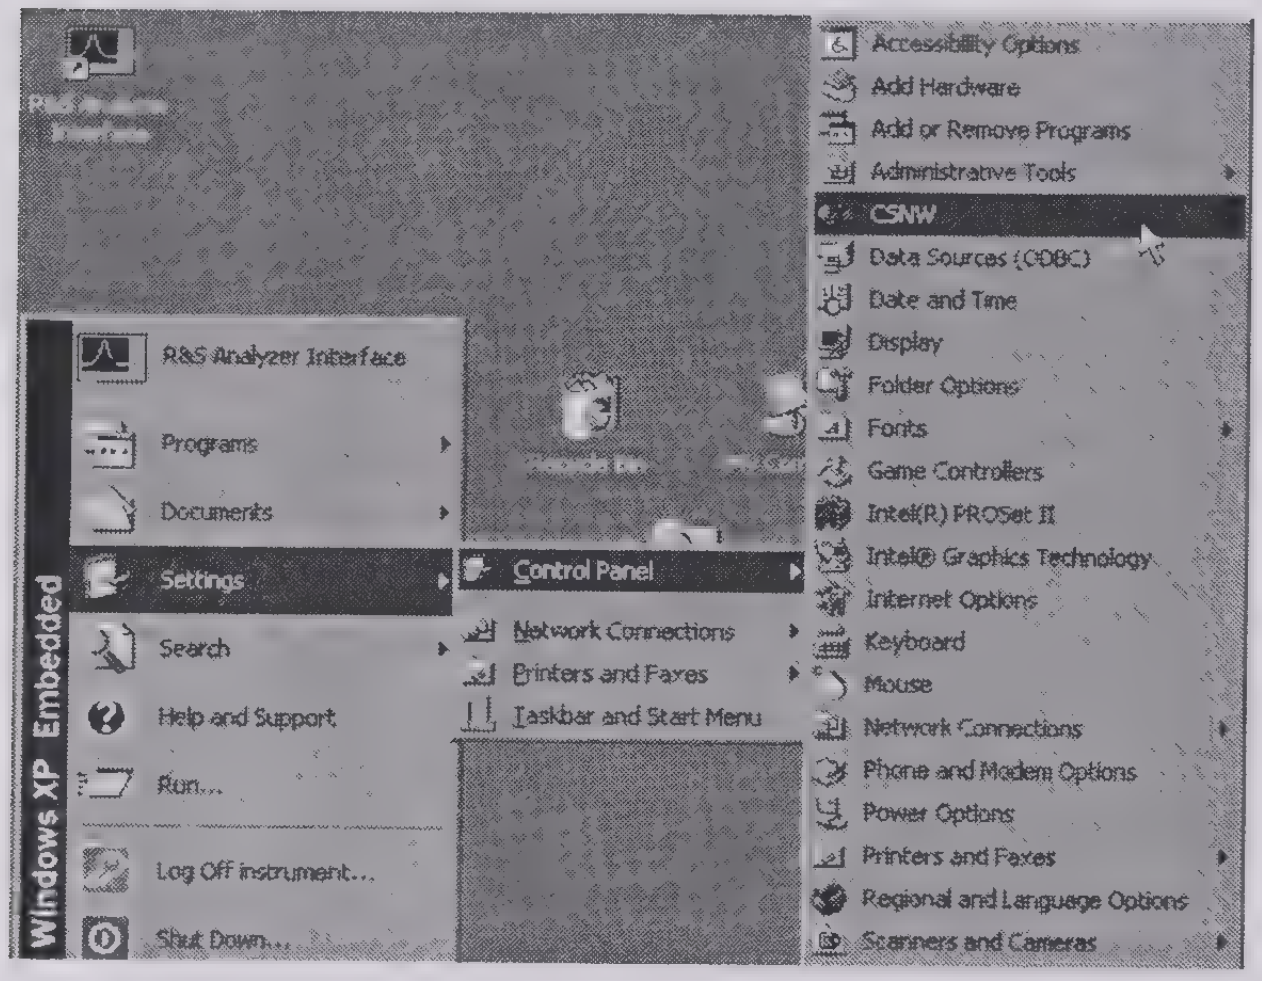

- ➢ Call up the Windows XP start menu using the Windows key or the key combination <CTRL> <ESC>.
- ➢ Then click "Settings", "Control Panel" and "CSNW" one after the other.

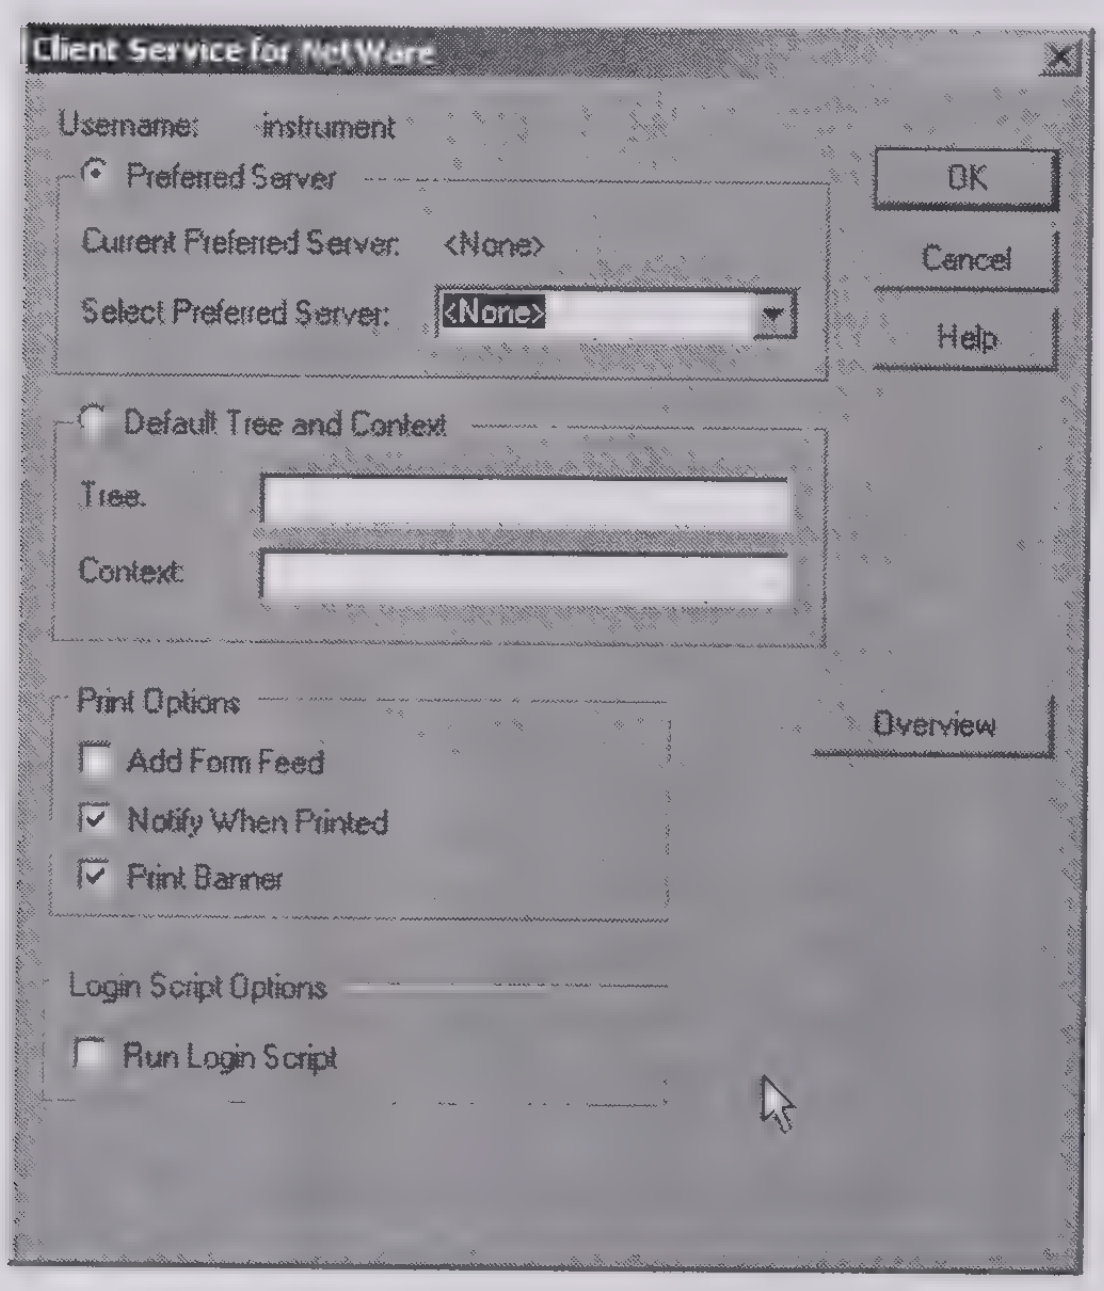

Username: instrument

● Preferred Server

Current Preferred Server: <None>

Select Preferred Server: <None>

○ Default Tree and Context

☐ Add Form Feed

☑ Notify When Printed

☑ Print Banner

☐ Run Login Script

Bindary login (NOVELL 3.x)

- ➢ Click "Preferred Server".
- ➢ Select the NOVELL server where the user is configured using "Select Preferred Server".

NDS login (more recent NOVELL versions)

- ➢ Click "Default Tree and Context".
- ➢ Enter the NDS Tree under "Tree" and the hierarchical path where the user is defined under "Context".
- ➢ If required, click the "Run Login Script" entry.

Note: *This data can be obtained from the network administrator.*

- ➢ Terminate the Login configuration with "OK".

Login in the Network

The user automatically logs into the network with the registration in the operating system. As a prerequisite, the user name and the password must be identical under Windows XP and on the network.

Disabling the Autologin Mechanism

Upon delivery, the instrument is configured for automatic login into Windows XP. This mechanism must be disabled if the instrument is operated in a network, since the default user name ("instrument") and the password normally are not identical to those of the network account.

To disable the autologin mechanism, proceed as follows:

- Open the XP start menu by means of <CTRL><ESC>.
- Select the menu item "RUN". A dialog box opens.
- Enter the command "D:\USER\NO_AUTOLOGIN.REG" in the dialog box and confirm with <ENTER>.

The autologin mechanism is disabled. When the instrument is rebooted, a prompt for user name and password will appear before the instrument firmware is started.

Reenabling the Autologin Mechanism

To enable the autologin mechanism again, proceed as follows:

- Open the XP start menu by means of <CTRL><ESC>.
- Select the menu item "RUN". A dialog box opens.
- Enter the command "D:\USER\AUTOLOGIN.REG" in the dialog box and confirm with <ENTER>.

The autologin mechanism is reenabled and is active when the instrument is rebooted the next time.

Using Network Drives

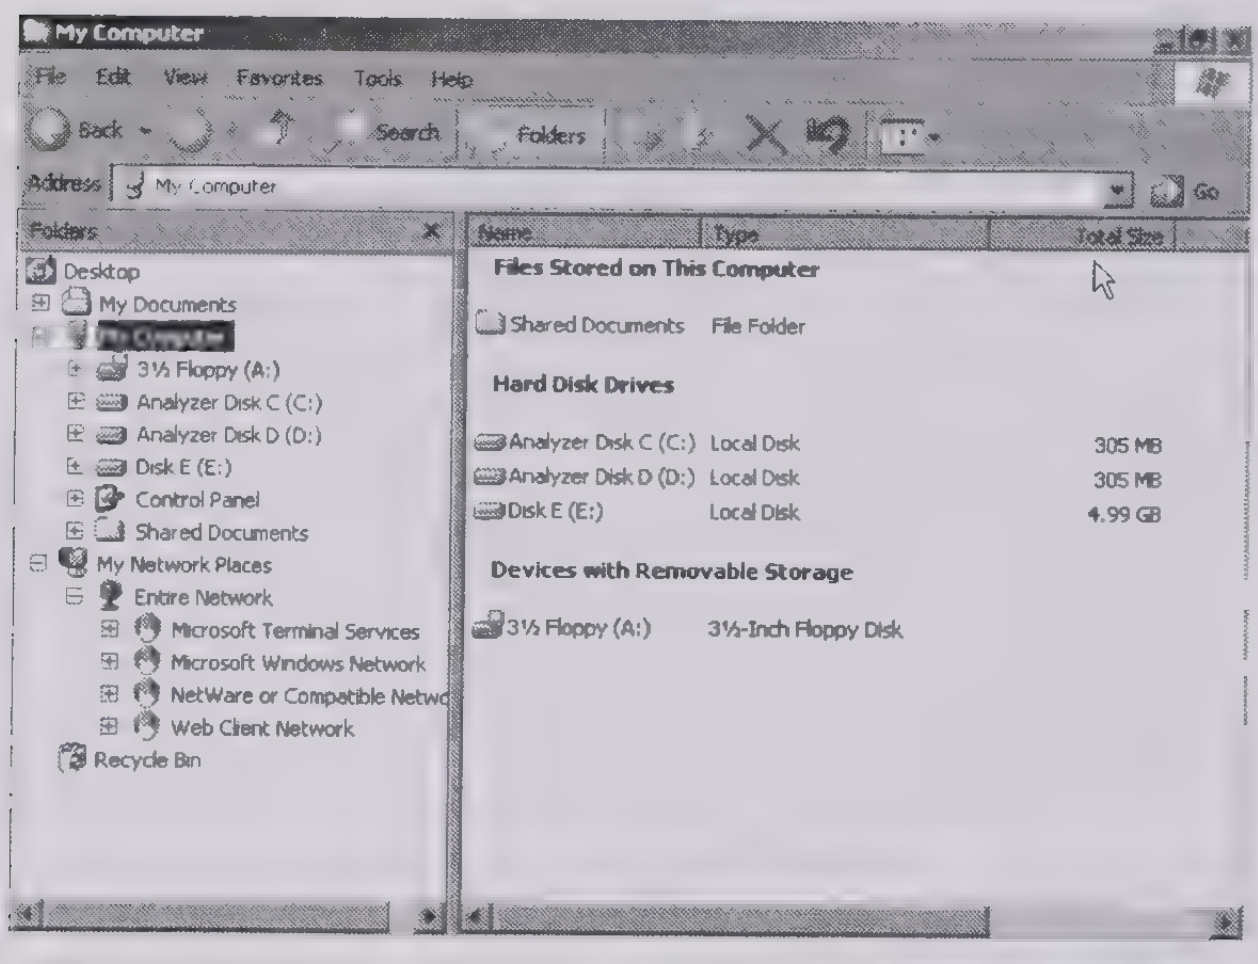
My Computer
File Edit View Favorites Tools Help
Back Search Folders
Address My Computer Go
Folders
Desktop
My Documents
My Computer
3½ Floppy (A:)
Analyzer Disk C (C:)
Analyzer Disk D (D:)
Disk E (E:)
Control Panel
Shared Documents
My Network Places
Entire Network
Microsoft Terminal Services
Microsoft Windows Network
NetWare or Compatible Netwo
Web Client Network
Recycle Bin
Name Type Total Size
Files Stored on This Computer
Shared Documents File Folder
Hard Disk Drives
Analyzer Disk C (C:) Local Disk 305 MB
Analyzer Disk D (D:) Local Disk 305 MB
Disk E (E:) Local Disk 4.99 GB
Devices with Removable Storage
3½ Floppy (A:) 3½-Inch Floppy Disk

Mapping a network drive:

- ➢ Use the Windows key or the key combination <CTRL> <ESC> to call the Windows XP start menu.
- ➢ Click "Programs", "Accessories", "Windows Explorer" one after the other.
- ➢ Click the line "My Network Places" in the overview "Desktop".

  An overview of the available network drives is displayed.

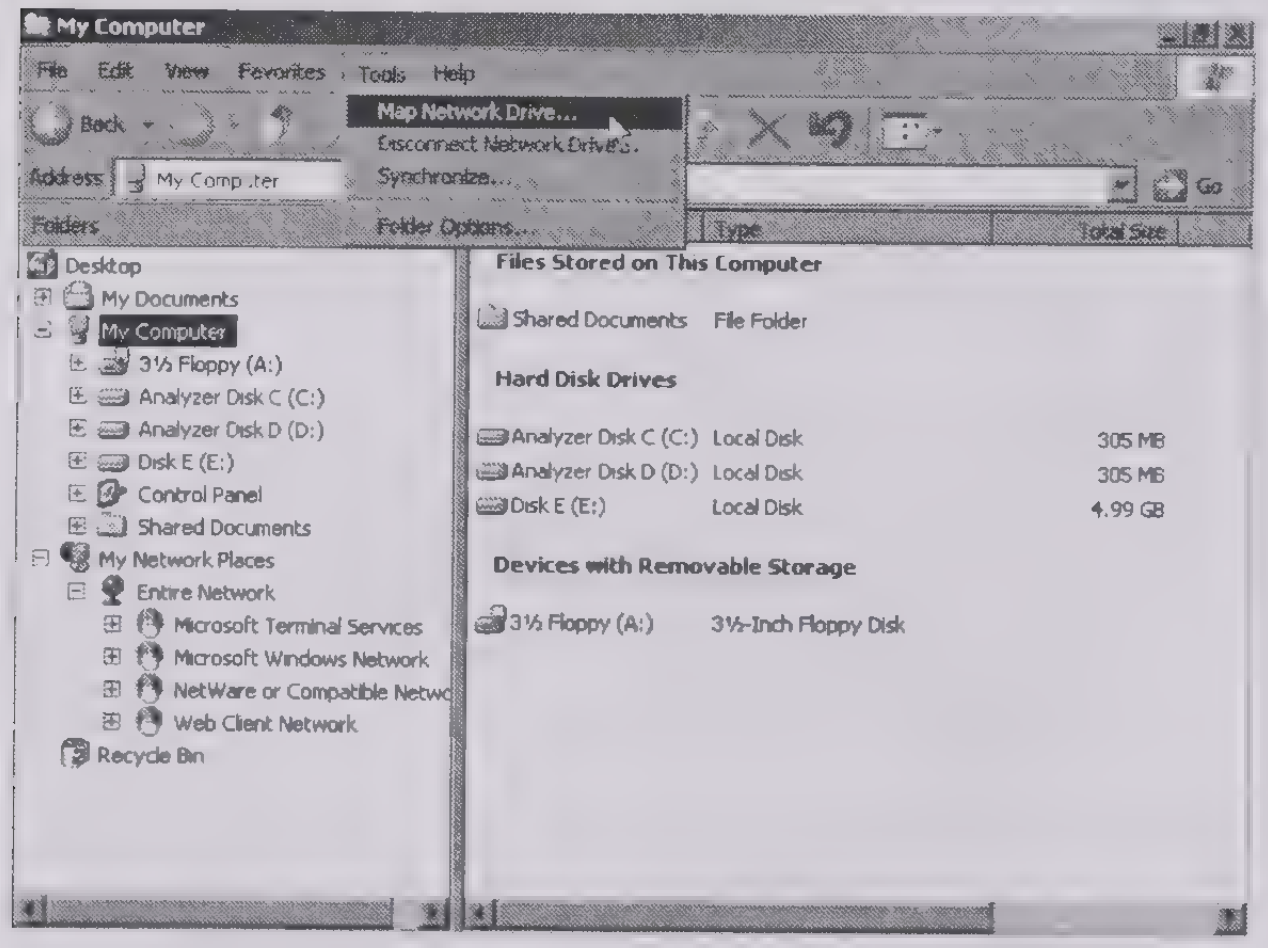
My Computer
File Edit View Favorites Tools Help
Map Network Drive...
Disconnect Network Drives...
Synchronize...
Folder Options...
Back
Address My Computer Go
Folders
Desktop
My Documents
My Computer
3½ Floppy (A:)
Analyzer Disk C (C:)
Analyzer Disk D (D:)
Disk E (E:)
Control Panel
Shared Documents
My Network Places
Entire Network
Microsoft Terminal Services
Microsoft Windows Network
NetWare or Compatible Netwo
Web Client Network
Recycle Bin
Type Total Size
Files Stored on This Computer
Shared Documents File Folder
Hard Disk Drives
Analyzer Disk C (C:) Local Disk 305 MB
Analyzer Disk D (D:) Local Disk 305 MB
Disk E (E:) Local Disk 4.99 GB
Devices with Removable Storage
3½ Floppy (A:) 3½-Inch Floppy Disk

- ➢ Click "Tools" and then "Map Network Drive".

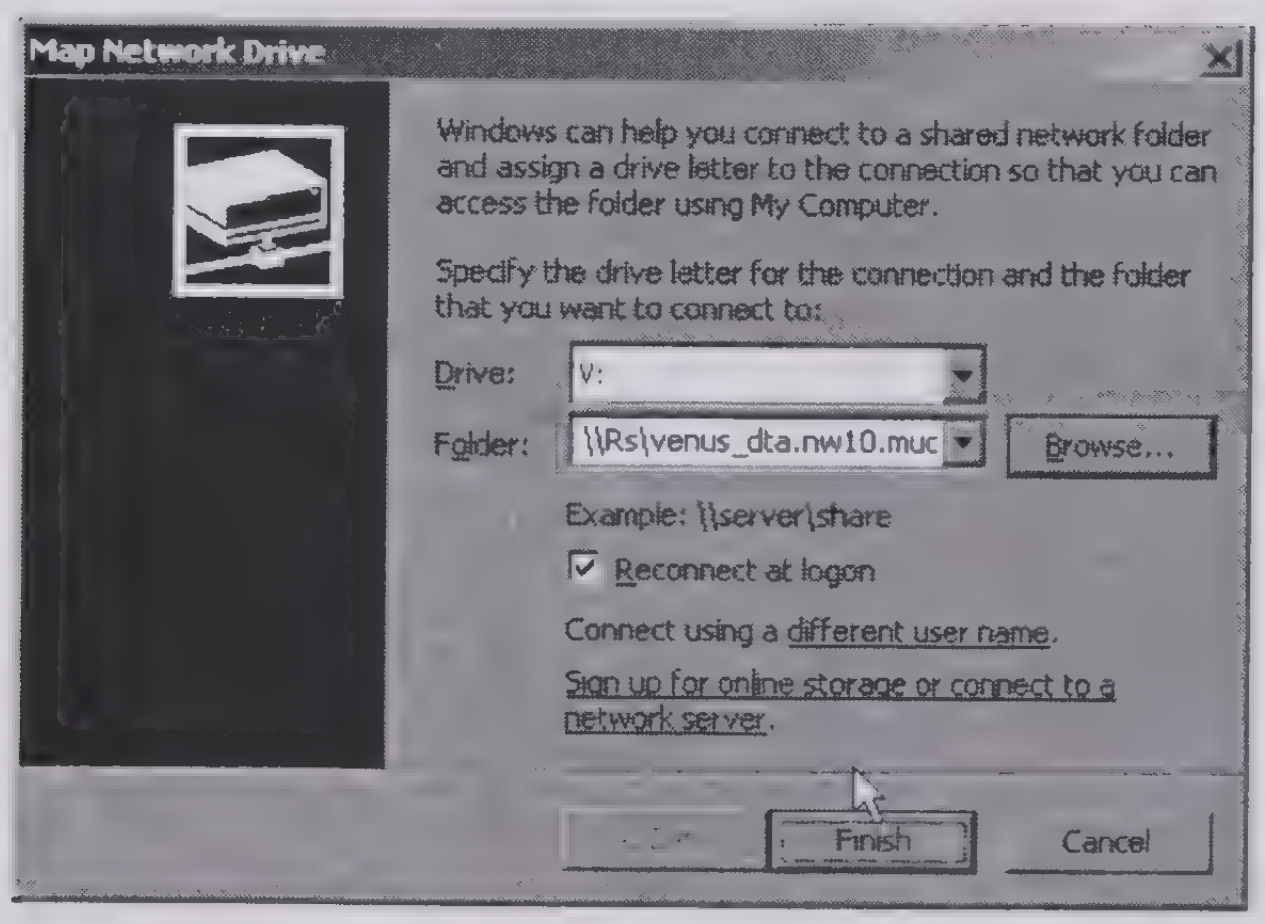

Windows can help you connect to a shared network folder and assign a drive letter to the connection so that you can access the folder using My Computer.

Specify the drive letter for the connection and the folder that you want to connect to:

Drive: V:

Folder: \\Rs\venus_dta.nw10.muc

Example: \\server\share

☑ Reconnect at logon

Connect using a different user name.

Sign up for online storage or connect to a network server.

- ➢ Select the appropriate drive under "Drive:".
- ➢ With "Browse", open the list of available network paths in the network.
- ➢ Activate "Reconnect at Logon:" if the connection is to be set up automatically each time the instrument is started.
- ➢ Use "Finish" to connect the network path with the selected drive.

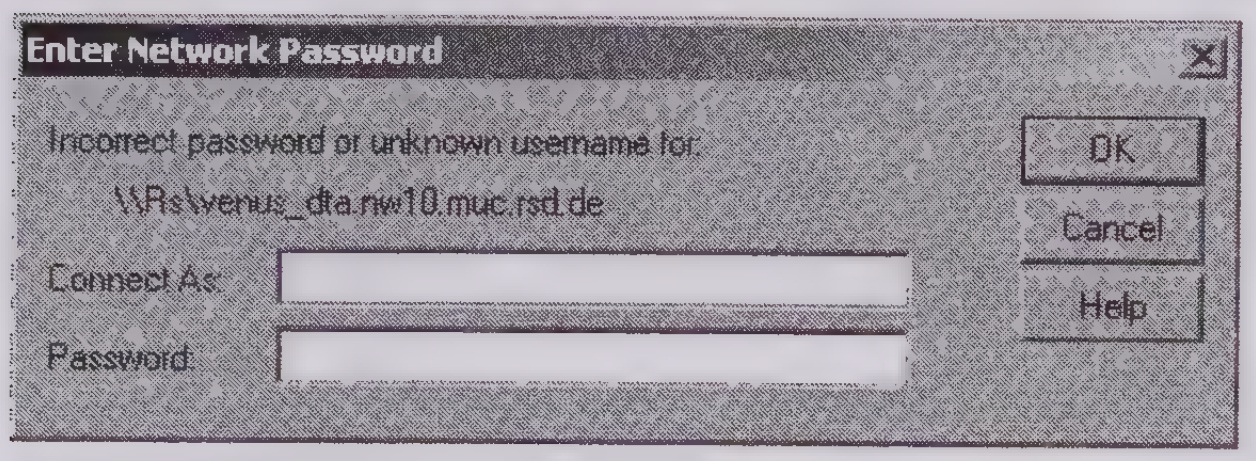

Incorrect password or unknown username for:
\\Rs\venus_dta.nw10.muc.rsd.de

Connect As:
Password:

The user name and the password are queried. Then the drive will appear in the "All Directories" overview of the explorer.

Note: *Only those drives in the network for which the user has the appropriate access right can be connected.*

Disconnecting a network drive:

- ➢ Click "Tools" in the Explorer and then "Disconnect Network Drive".
- ➢ Select the drive to be disconnected under "Network Drive:".
- ➢ Disconnect the drive using "OK". The security prompt must be answered with "Yes".

Printing on a Network Printer

Note:
The following dialogs may be operated both via the front panel and via a mouse and PC keyboard (for further information see the sections "Connection of a Mouse" and "Connection of a Keyboard"). The mouse and the PC keyboard are indispensable for the configuration of network printers.

A new printer is installed via the *INSTALL PRINTER* softkey in the *HCOPY* menu.

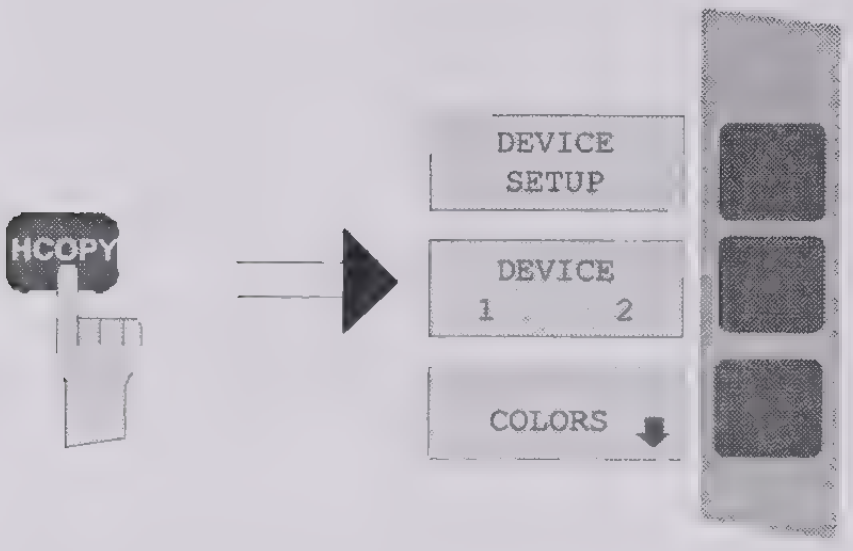

- ➢ Press the *HCOPY* key.

  The *HCOPY* menu will be opened.

- ➢ Call up the lateral menu via the *NEXT* key.

- ➢ Open the *Printers and Faxes* dialog with *INSTALL PRINTER*.

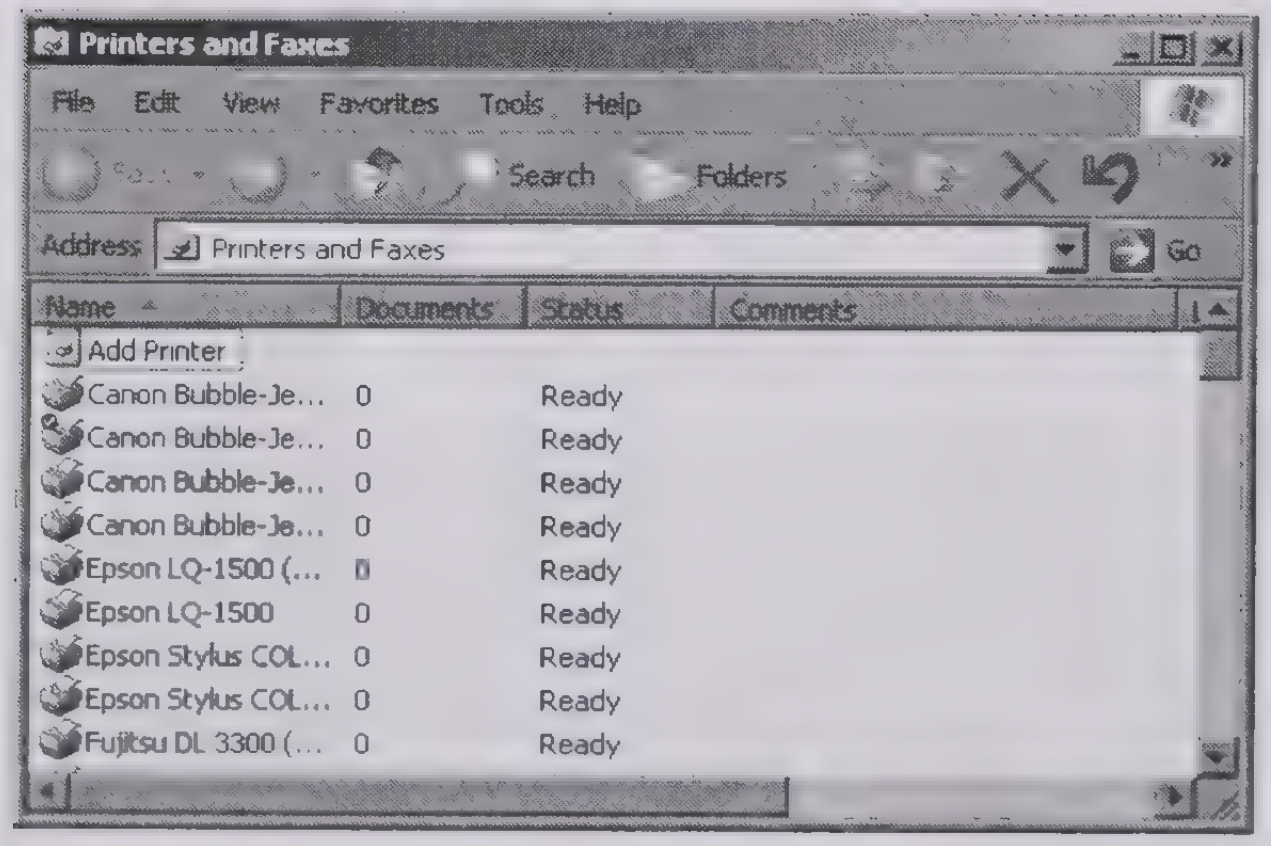

Name	Documents	Status	Comments
Add Printer			
Canon Bubble-Je...	0	Ready	
Canon Bubble-Je...	0	Ready	
Canon Bubble-Je...	0	Ready	
Canon Bubble-Je...	0	Ready	
Epson LQ-1500 (...	0	Ready	
Epson LQ-1500	0	Ready	
Epson Stylus COL...	0	Ready	
Epson Stylus COL...	0	Ready	
Fujitsu DL 3300 (...	0	Ready	

- ➢ Select the entry *Add Printer* in the selection list using the spinwheel.
- ➢ Highlight the entry with *CURSOR RIGHT* and confirm the selection by pressing *ENTER* or the spinwheel.

  The *Add Printer Wizard* will be displayed.

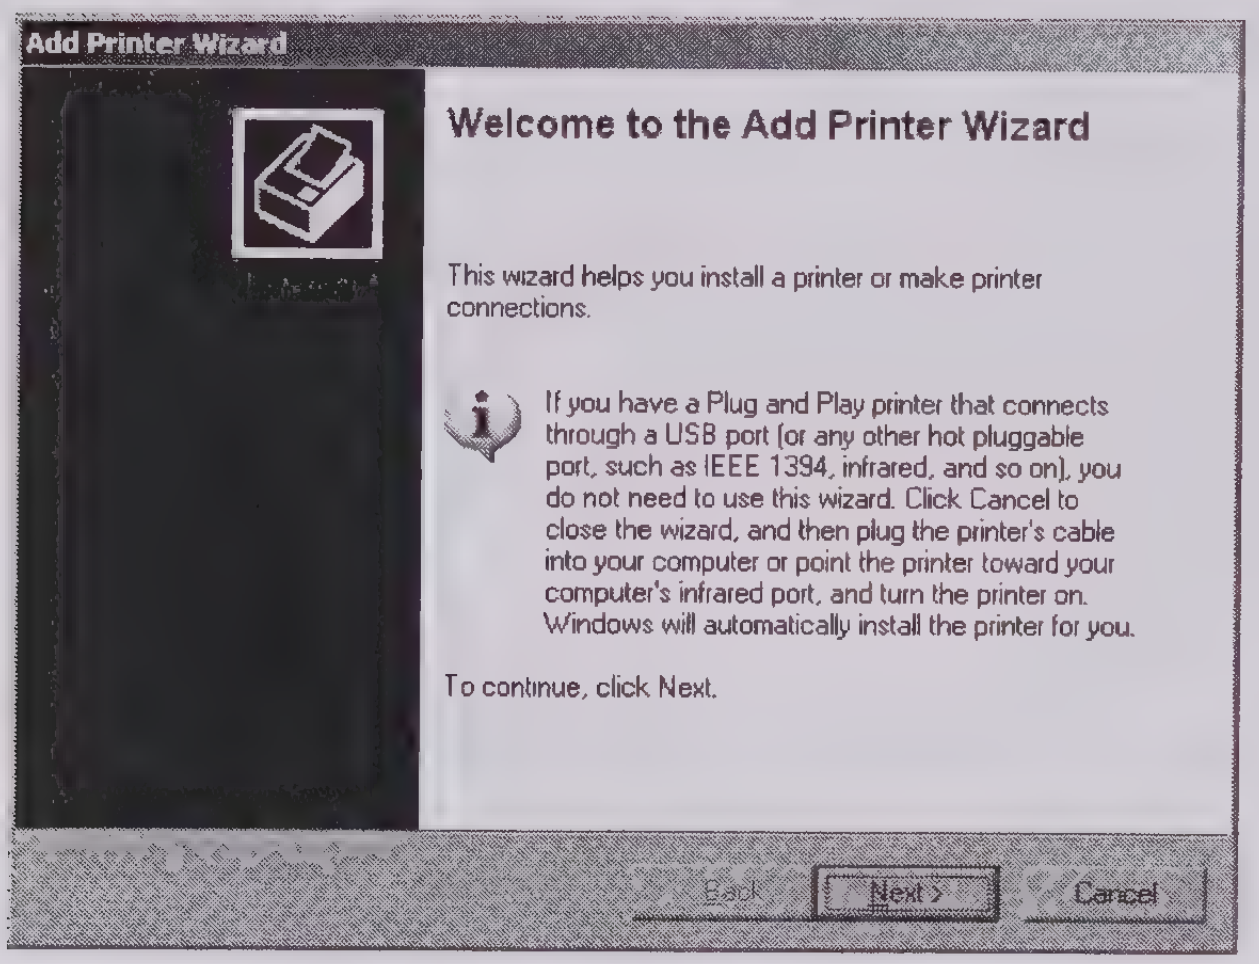

Add Printer Wizard

Welcome to the Add Printer Wizard

This wizard helps you install a printer or make printer connections.

If you have a Plug and Play printer that connects through a USB port (or any other hot pluggable port, such as IEEE 1394, infrared, and so on), you do not need to use this wizard. Click Cancel to close the wizard, and then plug the printer's cable into your computer or point the printer toward your computer's infrared port, and turn the printer on. Windows will automatically install the printer for you.

To continue, click Next.

- ➢ Select *NEXT* with the spinwheel and confirm by pressing the spinwheel.

  The selection *Local or Network Printer* will be displayed.

In the following example, an HP Laserjet 5 printer will be installed as the network printer. The Add Printer Wizard has already been opened according to the information described in the section "Starting the Add Printer Wizard".

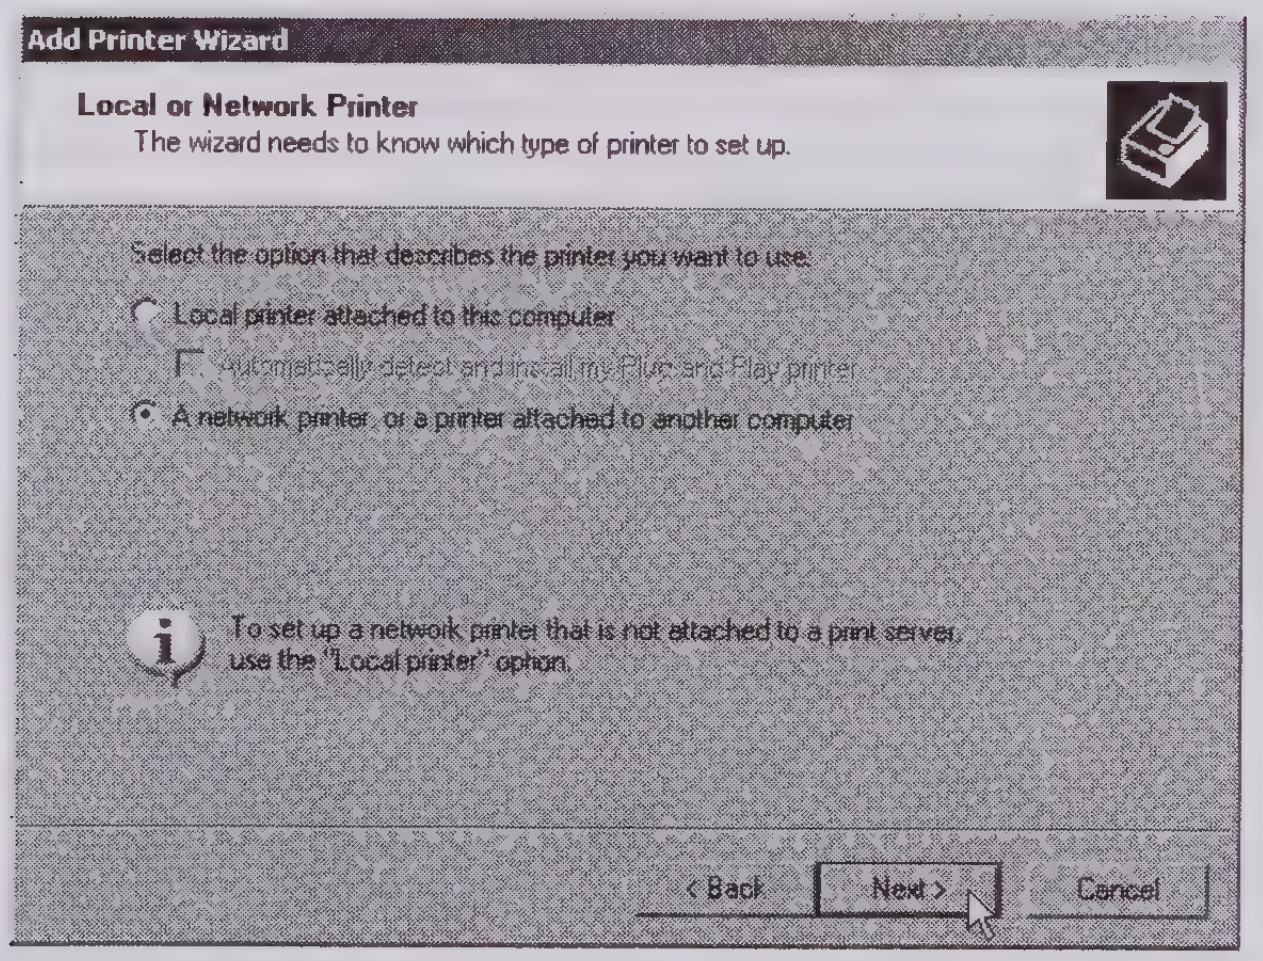

Add Printer Wizard

Local or Network Printer

The wizard needs to know which type of printer to set up.

Select the option that describes the printer you want to use:

○ Local printer attached to this computer

  ☐ Automatically detect and install my Plug and Play printer

● A network printer, or a printer attached to another computer

To set up a network printer that is not attached to a print server, use the "Local printer" option.

- ➢ To select a network printer, click the line "A network printer or a printer attached to another computer".

Then continue with "Next" .

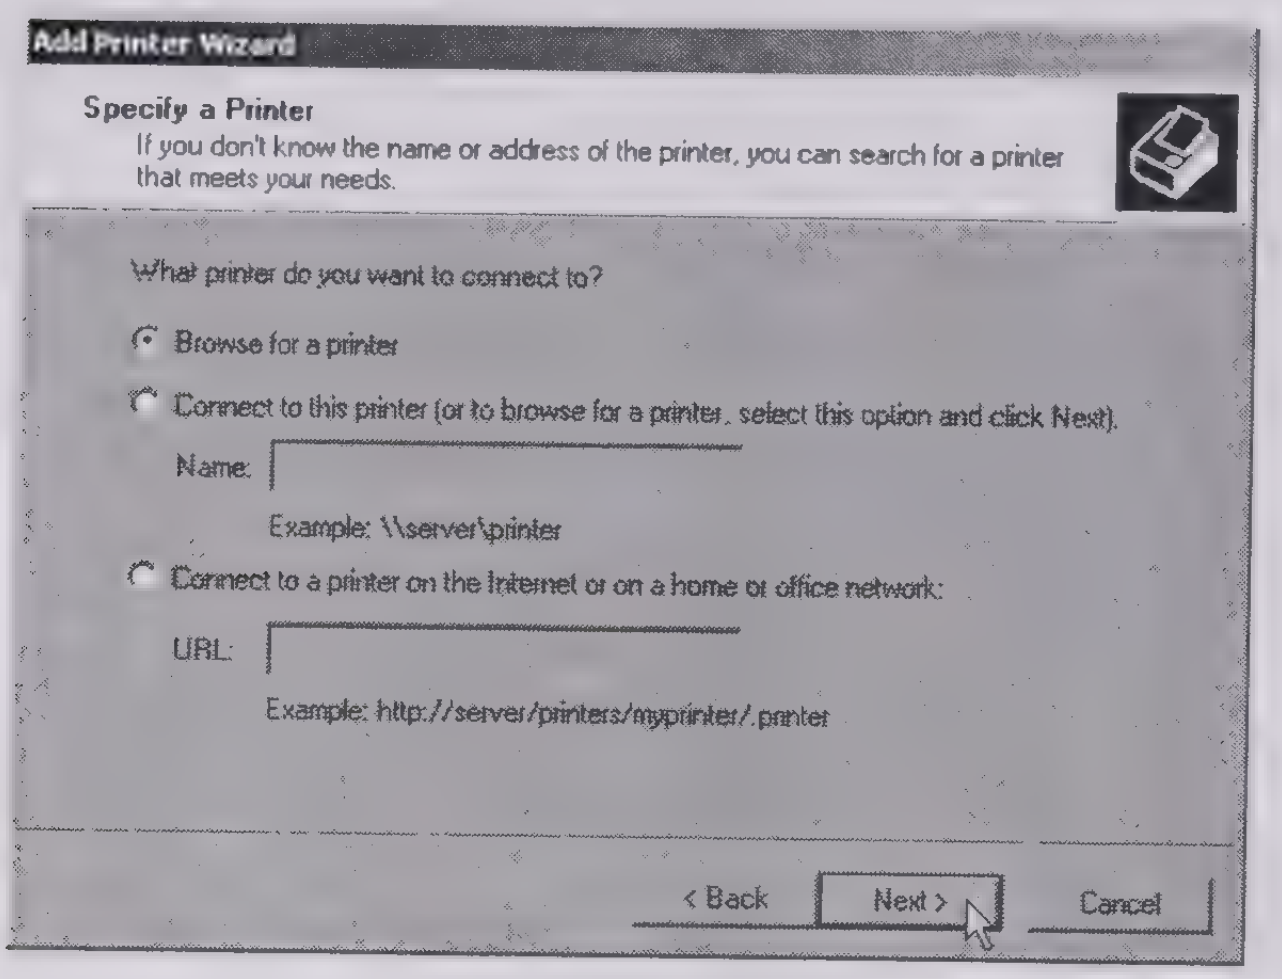

Specify a Printer
If you don't know the name or address of the printer, you can search for a printer that meets your needs.

What printer do you want to connect to?

● Browse for a printer

○ Connect to this printer (or to browse for a printer, select this option and click Next).

Name:

Example: \\server\printer

○ Connect to a printer on the Internet or on a home or office network:

URL:

Example: http://server/printers/myprinter/.printer

- First click "Browse for a printer" and then "Next" .

The selection of shared printers will appear.

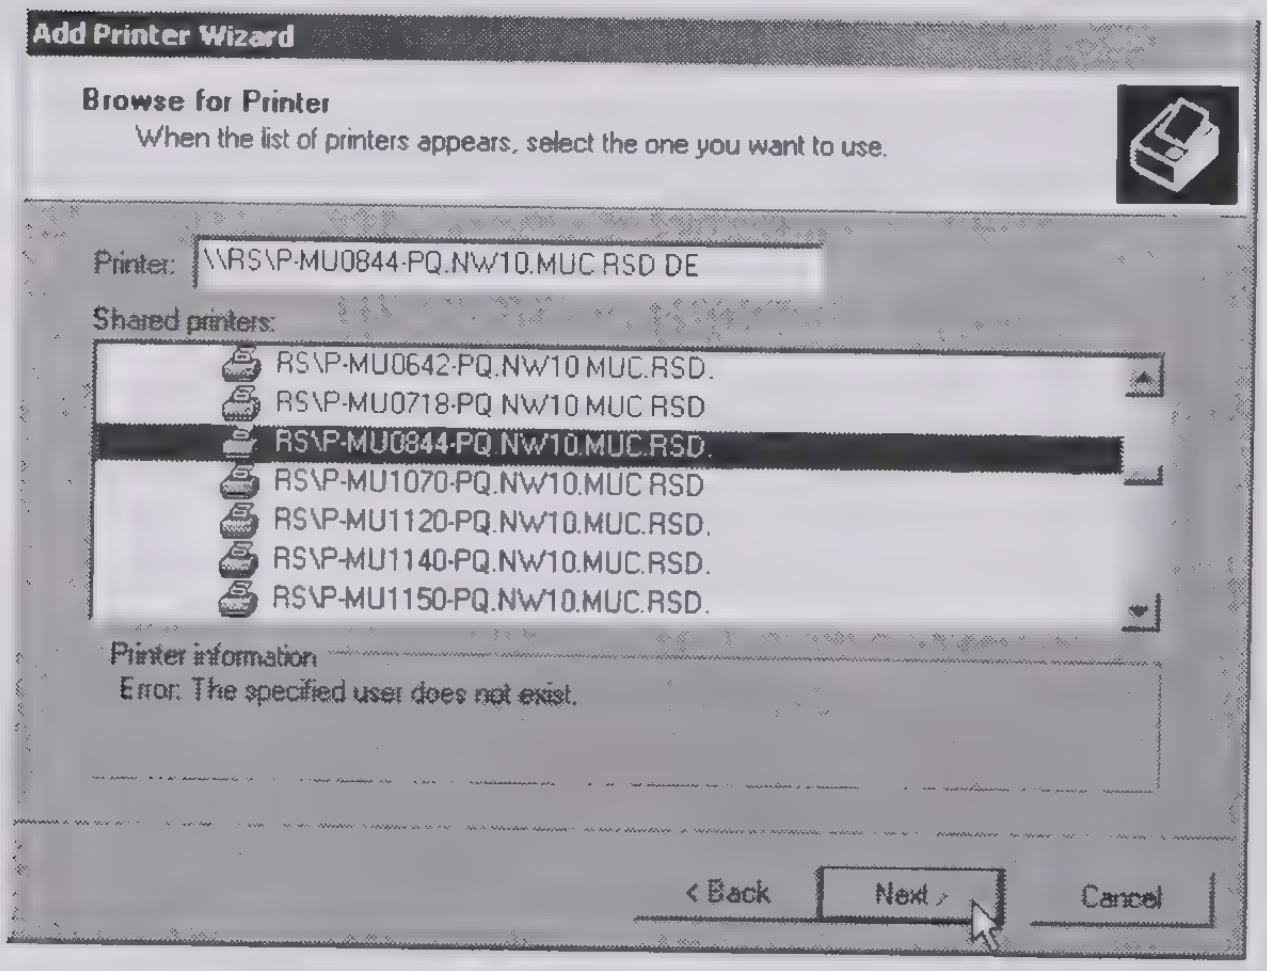

Browse for Printer
When the list of printers appears, select the one you want to use.

Printer: \\RS\P-MU0844-PQ.NW10.MUC.RSD.DE

Shared printers:

RS\P-MU0642-PQ.NW10.MUC.RSD.
RS\P-MU0718-PQ.NW10.MUC.RSD
RS\P-MU0844-PQ.NW10.MUC.RSD.
RS\P-MU1070-PQ.NW10.MUC.RSD
RS\P-MU1120-PQ.NW10.MUC.RSD.
RS\P-MU1140-PQ.NW10.MUC.RSD.
RS\P-MU1150-PQ.NW10.MUC.RSD.

Printer information
Error: The specified user does not exist.

- Highlight printer and select with "OK".

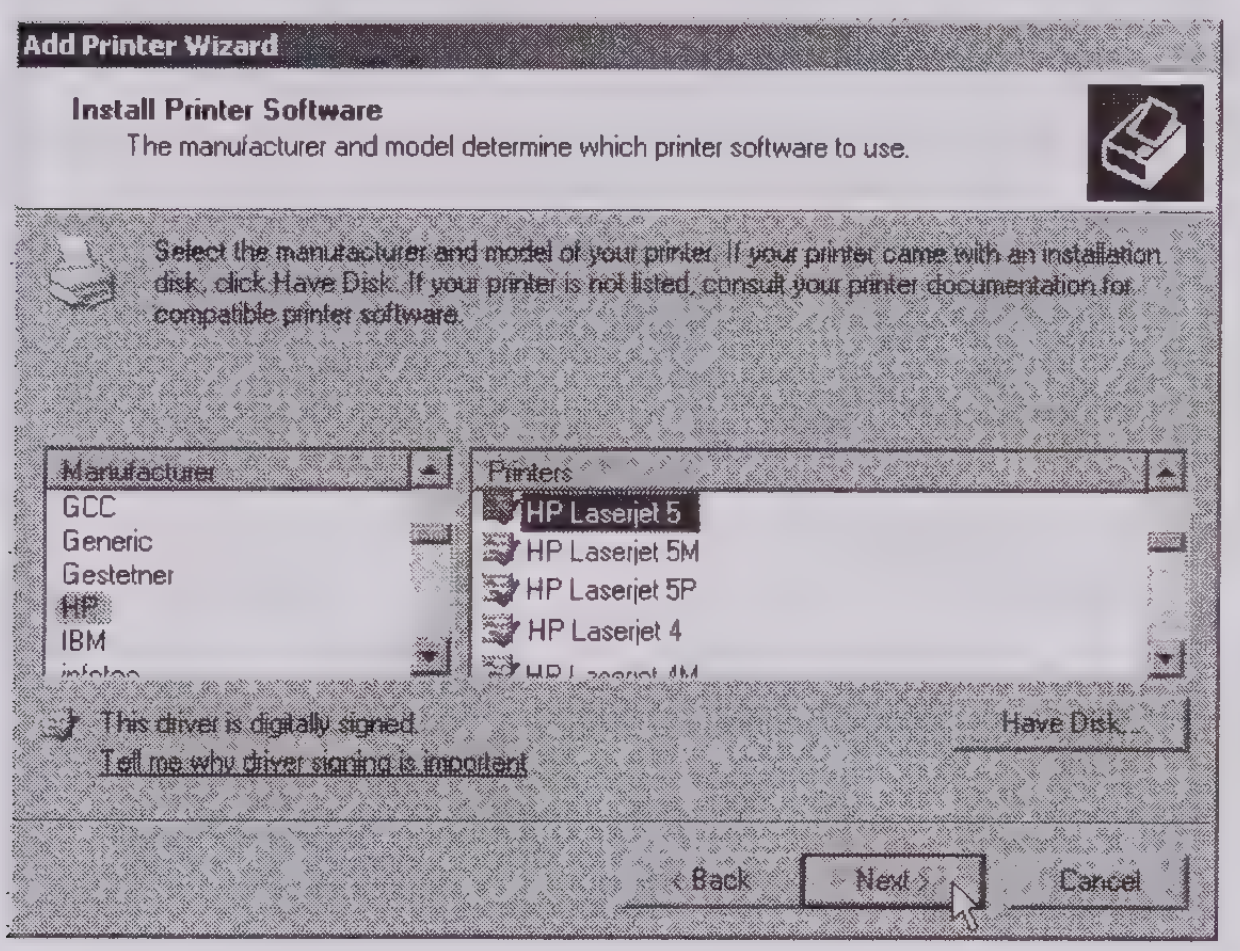

Install Printer Software
The manufacturer and model determine which printer software to use.

Select the manufacturer and model of your printer. If your printer came with an installation disk, click Have Disk. If your printer is not listed, consult your printer documentation for compatible printer software.

This driver is digitally signed.
Tell me why driver signing is important

- ➢ Confirm the following request to install a suitable printer driver using "OK".

The selection of printer drivers will be displayed.
The manufacturers are displayed in the left-hand table and the available printer drivers in the right-hand table.

- ➢ First highlight the manufacturer in the selection list "Manufacturers" and then the printer driver in the selection list "Printers" .

Note:
If the desired printer type does not appear in this list, the driver has not yet been installed in the instrument. In this case, click the "HAVE DISK" button. A request to insert a disk with the corresponding printer driver will appear. Then click "OK" and select the desired printer driver.

- ➢ Click "Next".

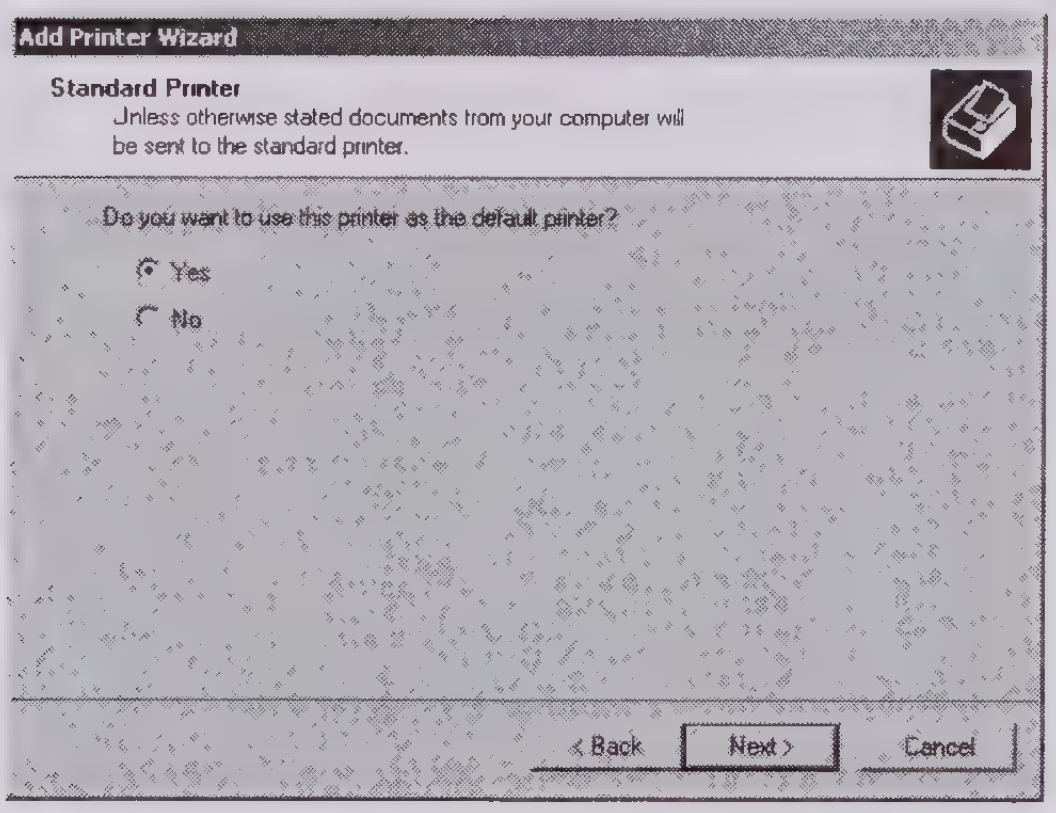

Standard Printer
Unless otherwise stated documents from your computer will be sent to the standard printer.

Do you want to use this printer as the default printer?
● Yes
○ No

If one or several printers have already been installed, the query of whether the printer installed so far is to be selected as the default printer for the Windows XP applications will be displayed. "No" is preset.

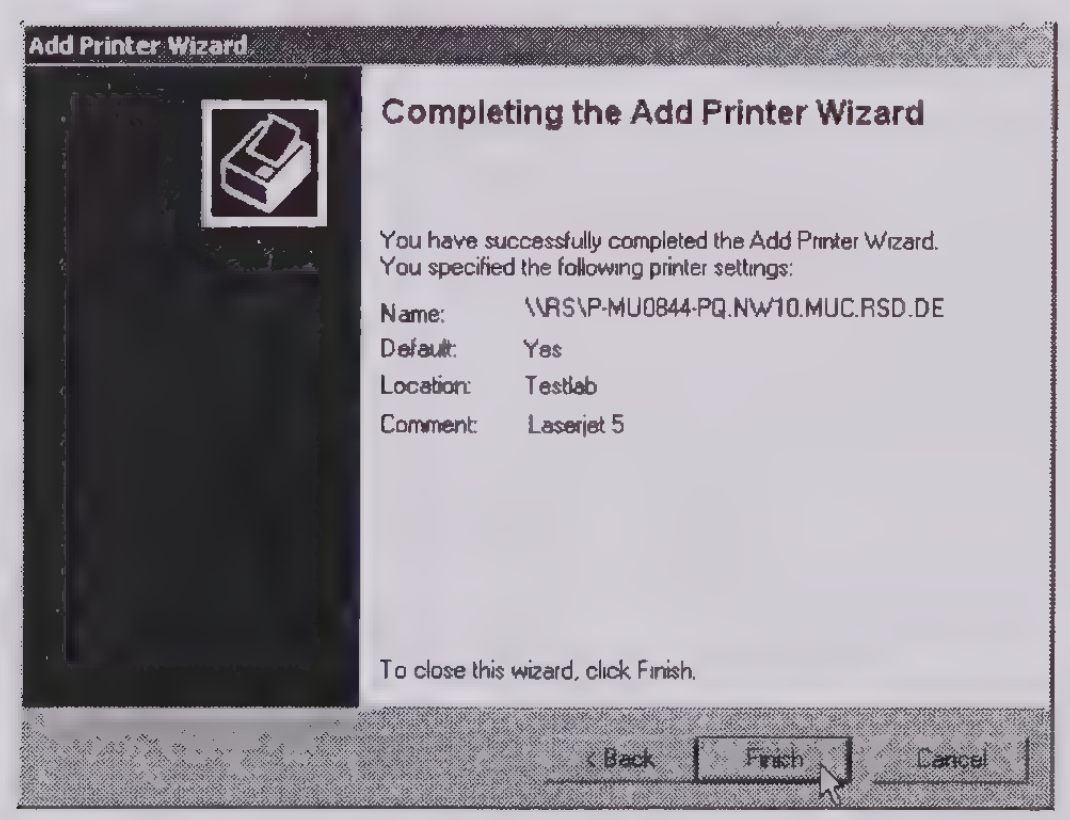

Completing the Add Printer Wizard

You have successfully completed the Add Printer Wizard.
You specified the following printer settings:
Name: \\RS\P-MU0844-PQ.NW10.MUC.RSD.DE
Default: Yes
Location: Testlab
Comment: Laserjet 5

To close this wizard, click Finish.

- ➢ Start the installation of the printer driver with "Finish".

Finally, the instrument still has to be configured for printout via this printer with the softkeys DEVICE SETUP and DEVICE 1/2 in the main hardcopy menu (see section "Selecting a Printer").

Sharing Directories (only for Microsoft Networks)

Data on the instrument can be made available for other computers if directories are shared. Sharing directories is only possible in the MICROSOFT network.

Sharing is a property of a file or directory. To allow sharing, proceed as follows:

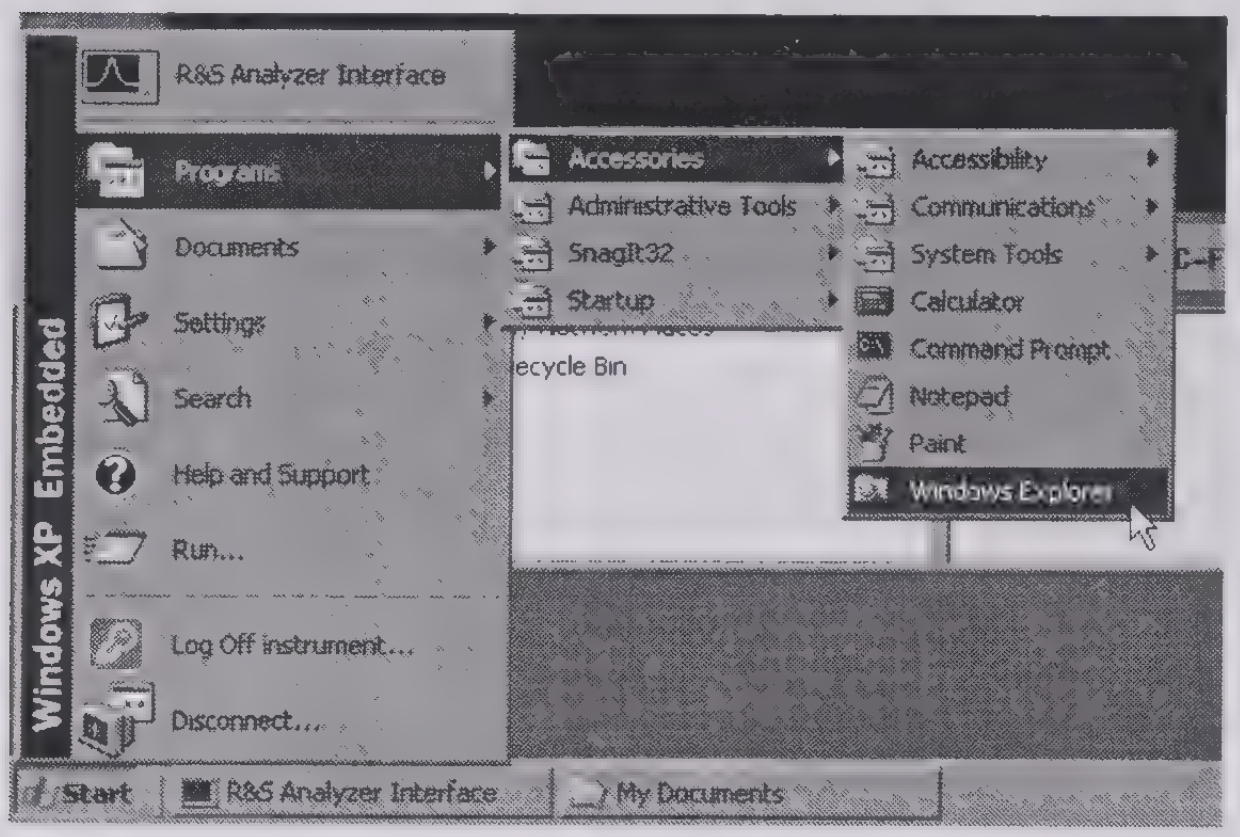

- ➢ Open the Windows start menu using the Windows key or <CTRL><ESC>.
- ➢ Open the Windows Explorer by clicking Programs - Accessories - Windows Explorer.

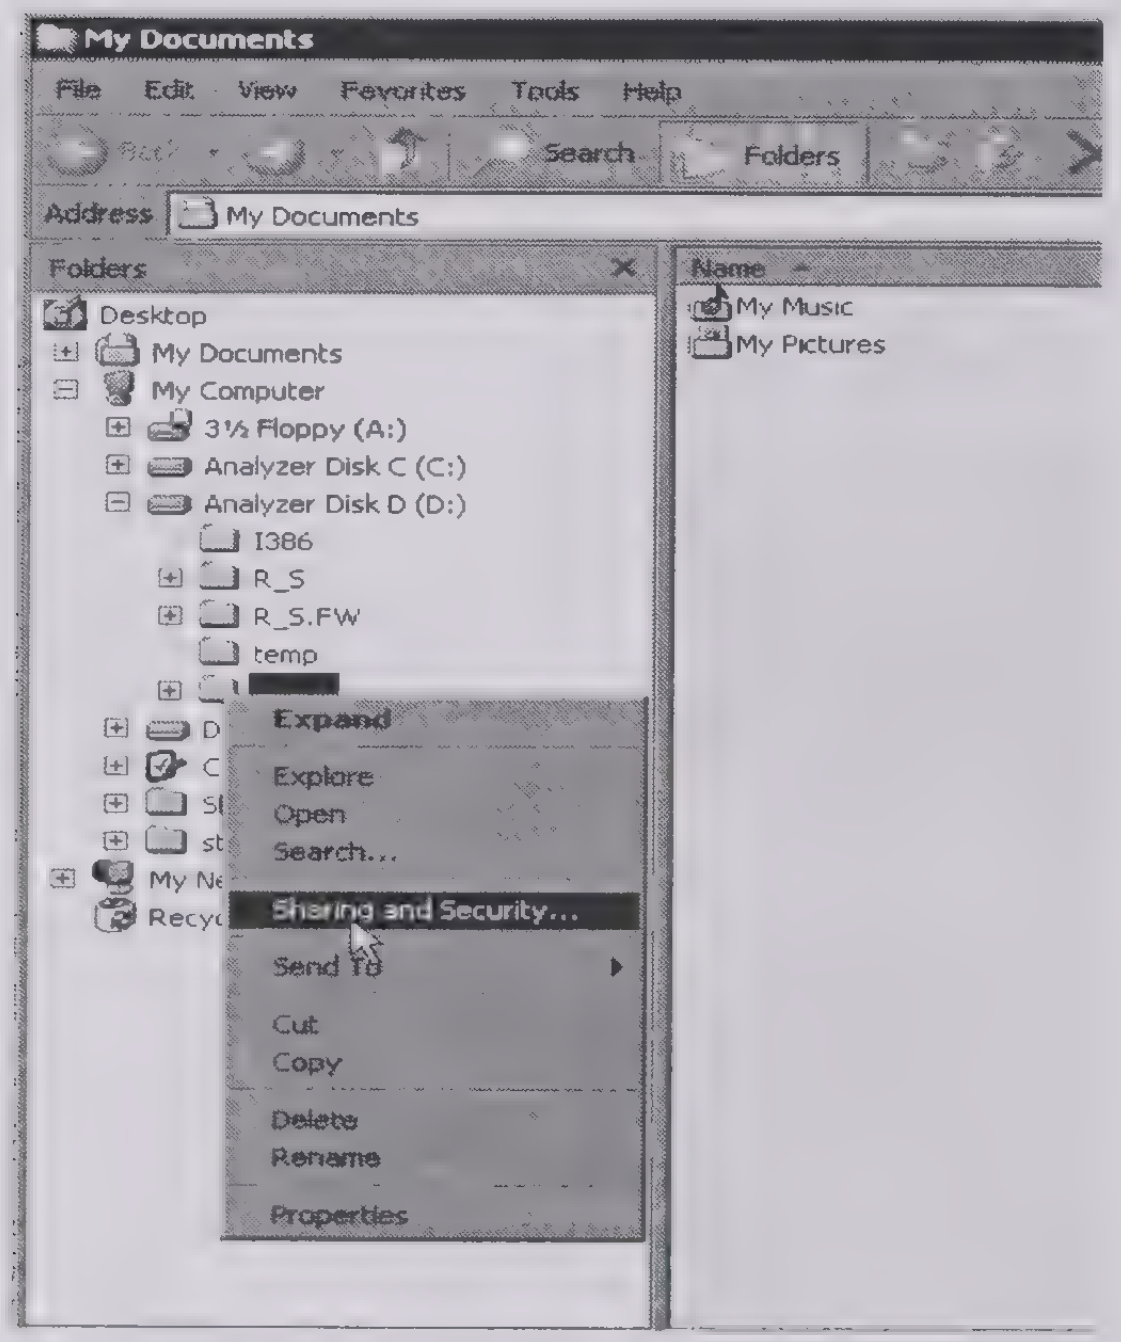

- ➢ Click the desired folder with the right mouse key.
- ➢ Click Sharing and Security.

  The dialog to share the directories will be opened.

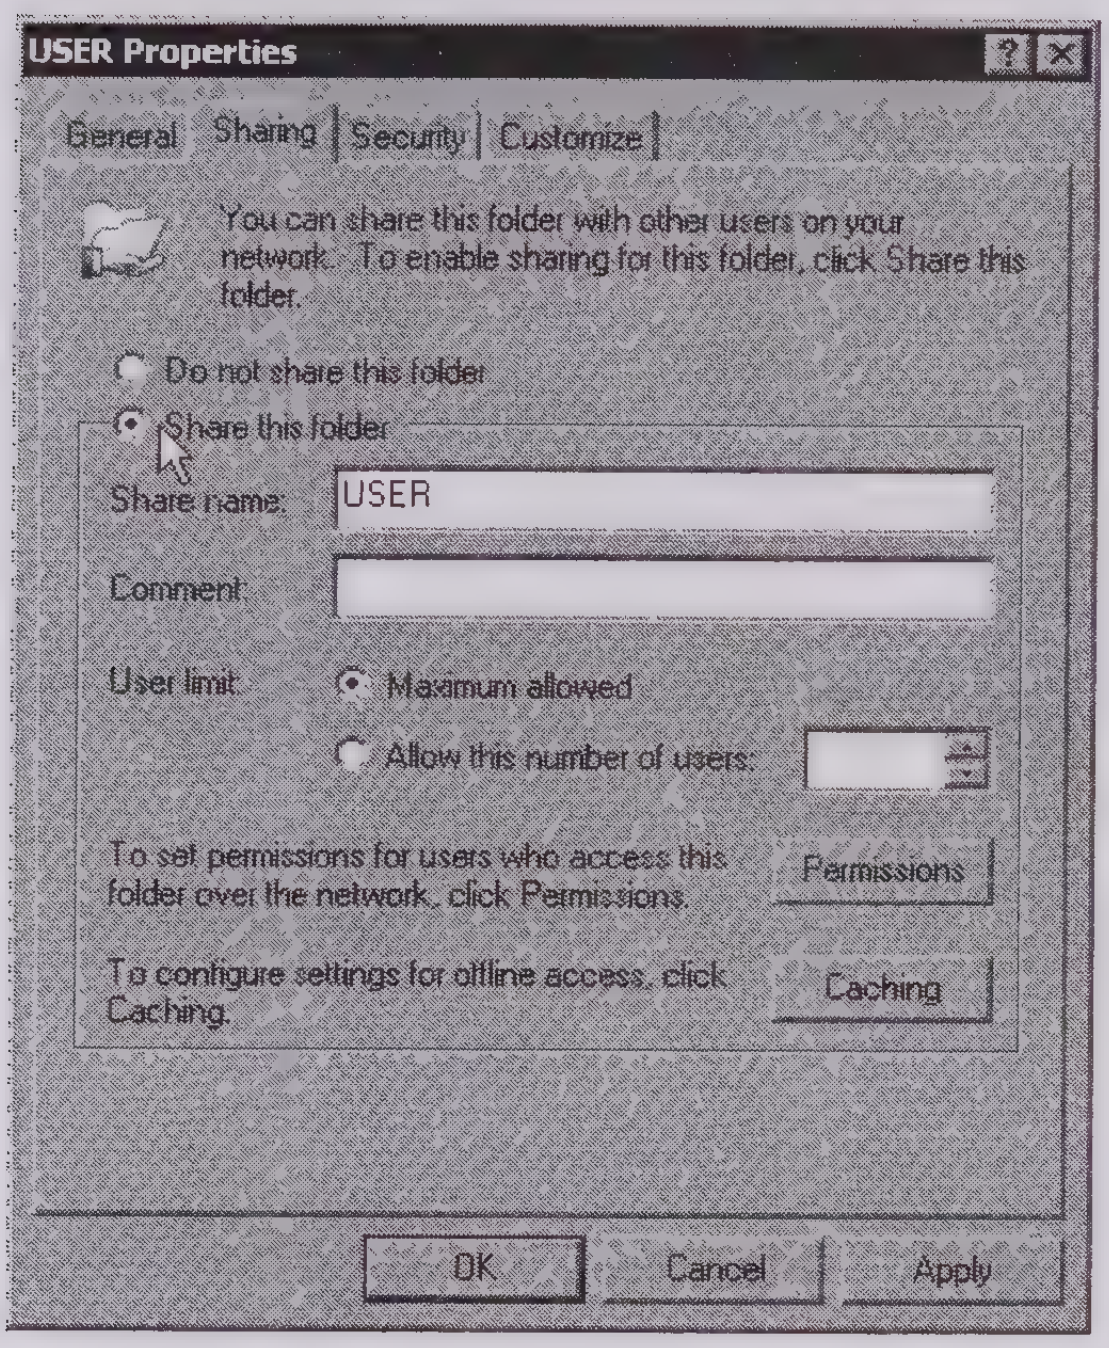

You can share this folder with other users on your network. To enable sharing for this folder, click Share this folder.

○ Do not share this folder

● Share this folder

Share name: USER

Comment:

User limit: ● Maximum allowed

○ Allow this number of users:

To set permissions for users who access this folder over the network, click Permissions.

To configure settings for offline access, click Caching.

➢ Click *Share this folder.*

➢ The following settings can optionally be changed:

Share name:
the name under which the directory appears in the Explorer

Comment:
a comment regarding the shared directory

User Limit:
the number of users that may access the directory at the same time

Permissions:
the rights of the users (read only, read and write, all)

Caching:
local buffering of directory contents for fast access

➢ Confirm settings with *OK.*

The drive is shared and this is shown in the Explorer by a hand under the directory symbol:

Remote Monitoring of R&S R&S FSMR via XP Remote Desktop

Introduction

In production test and measurements, the question of how to centrally monitor measuring instruments that are used for remote servicing/diagnostics is often arises. With the remote desktop of Windows XP, the new Spectrum Analyzer Family R&S R&S FSMR offers ideal preconditions for use in production:

- Access to operating functions via virtual front panel (*soft front panel*)
- Printout of measurement results directly from the controller
- Storing measurement data to the hard disk of the controller

The analyzer is connected via LAN. XP also supports the connection via data transmission (via modem). This section describes the configuration of R&S R&S FSMR and the remote desktop client of the control PC. For details on setting up the data transmission link, see relevant XP literature.

Configuration of R&S R&S FSMR for Using Remote Desktop

The following steps are required to allow an external PC access to the desktop of the R&S FSP.

1. Determine the IP configuration of the network link:

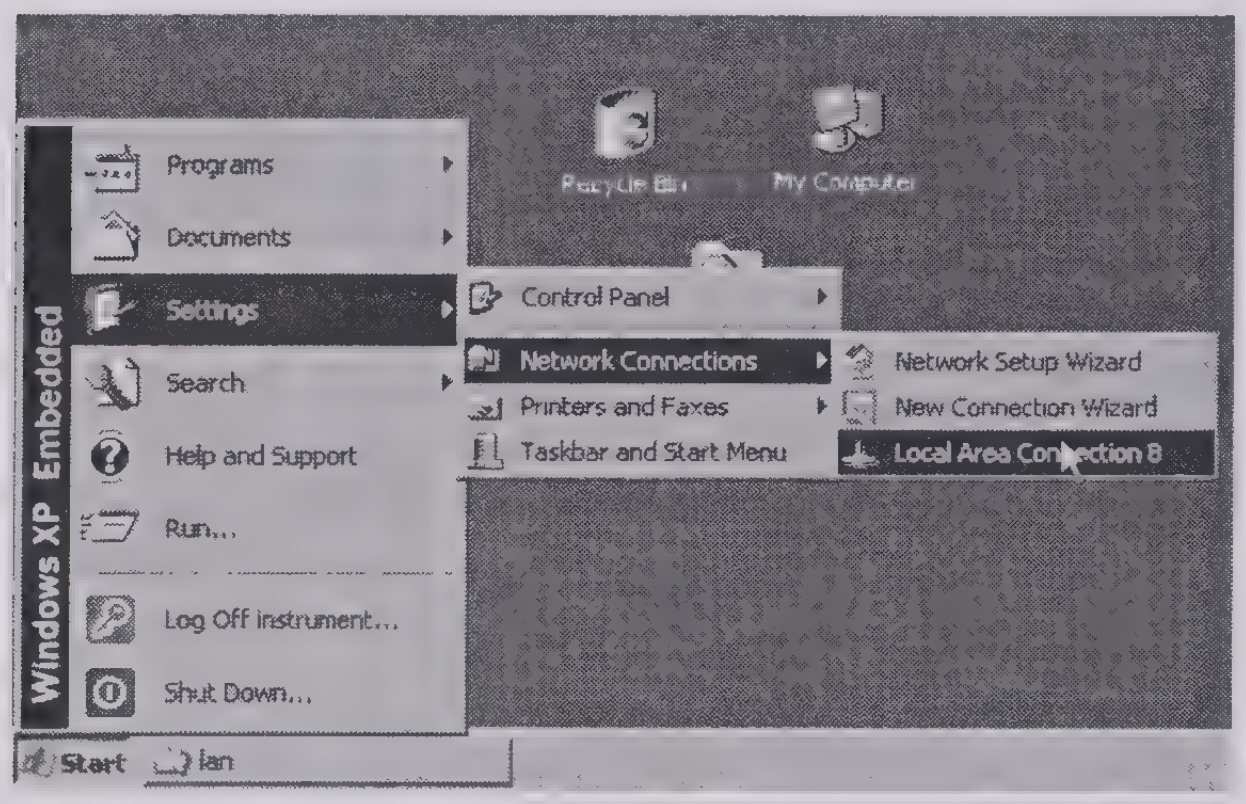

- ➢ Open the Windows XP start menu using the Windows key or *CTRL-ESC*.
- ➢ Click *Settings - Network Connections - Local Area Connection.*

  The *Local Area Connection Status* dialog will be opened.

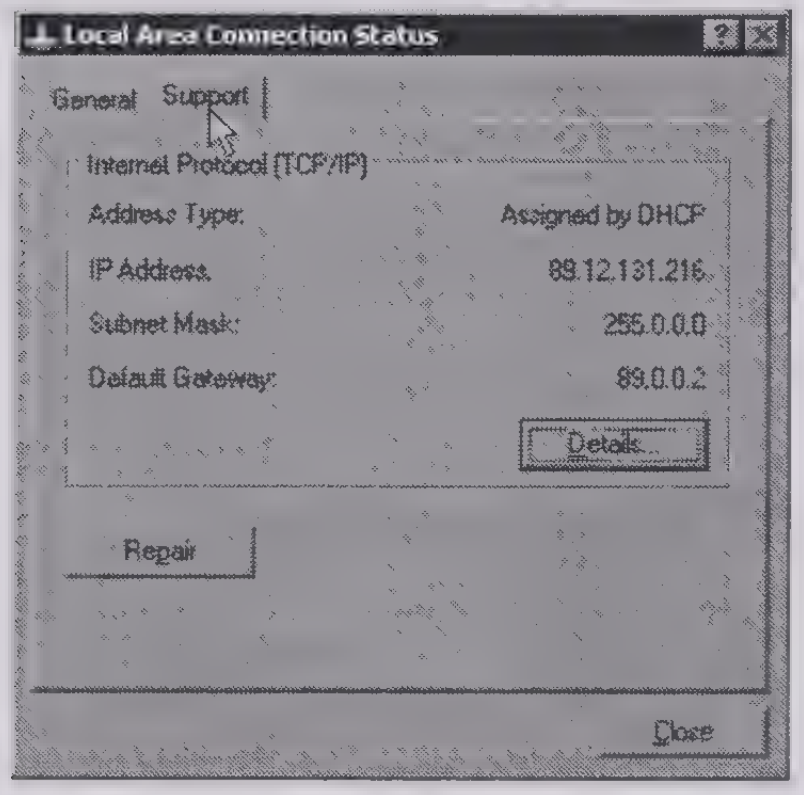

Internet Protocol (TCP/IP)
Address Type: Assigned by DHCP
IP Address: 89.12.131.216
Subnet Mask: 255.0.0.0
Default Gateway: 89.0.0.2

- ➢ Click the *Support* tab.

  The current TCP/IP configuration will be displayed.

  If the entry "Assigned by DHCP" is displayed in the *Address Type* field, continue with step 2 (Installing a fixed IP address...)

  It would otherwise be sufficient to note the IP address and to continue with step 3 (Enabling the R&S FSP...)

2. Install a fixed IP address for the TCP/IP protocol as described in the Section "Configuration of Available Network Protocols (TCP/IP Protocol)".
   Note:
   Operation with a fixed IP address is strongly recommended.
   When a DHCP server is used, a new IP address (which has to be determined first) will be assigned any time the instrument is restarted. For this reason, a DHCP server would not be suitable for use for detached operation of the R&S FSP.
3. Enable the R&S R&S FSMR for operation with the remote desktop.

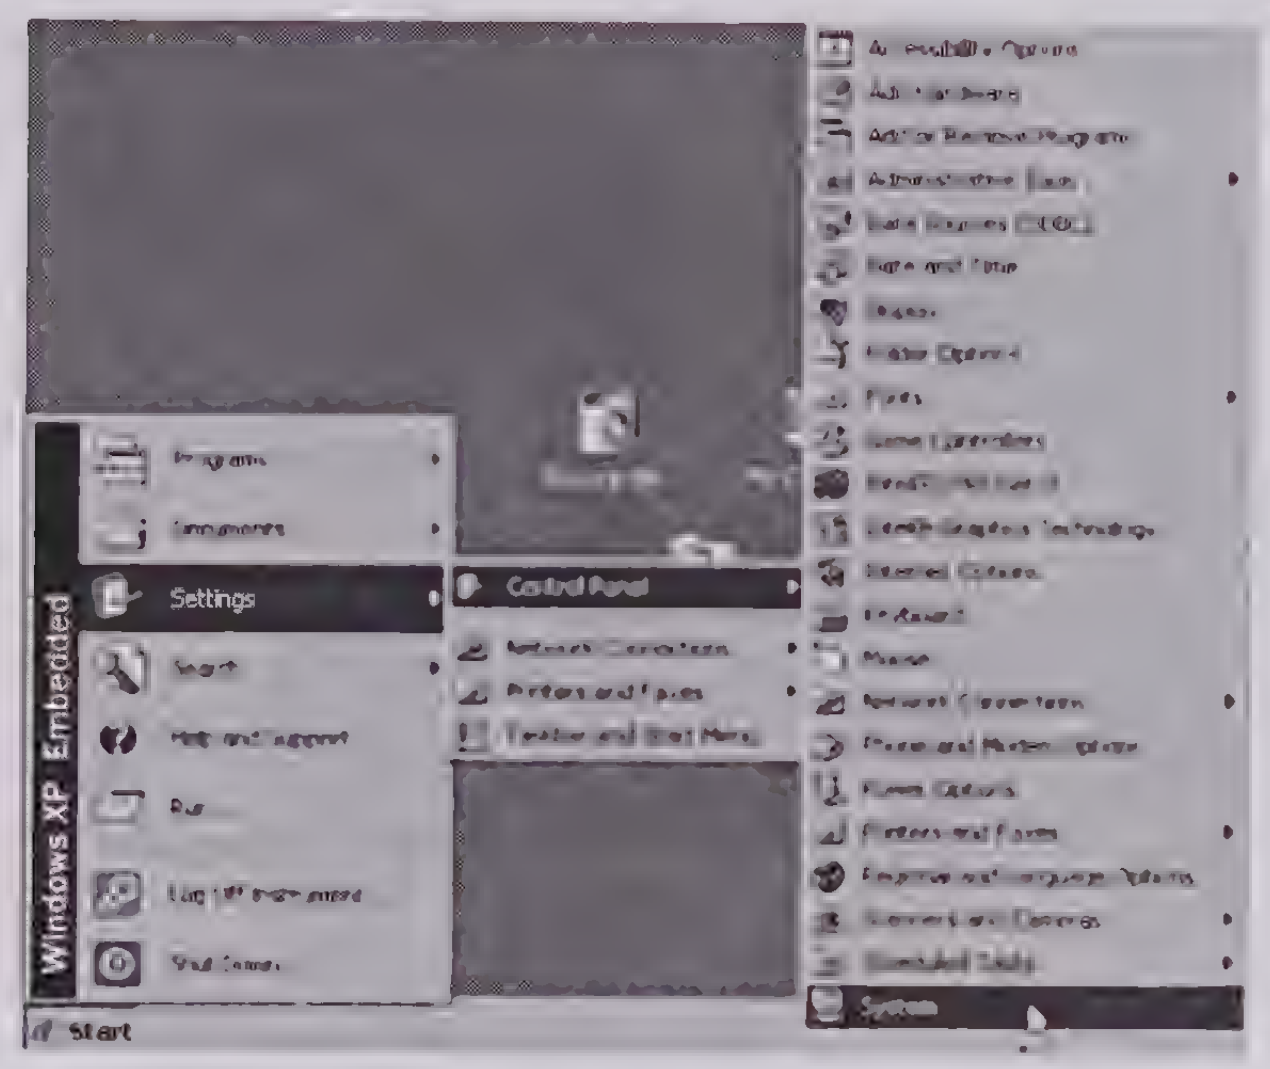

- ➢ Press the Windows key or <CTRL><ESC>.

  The Windows start menu will be opened.

- ➢ Select Settings - Control Panel - System.

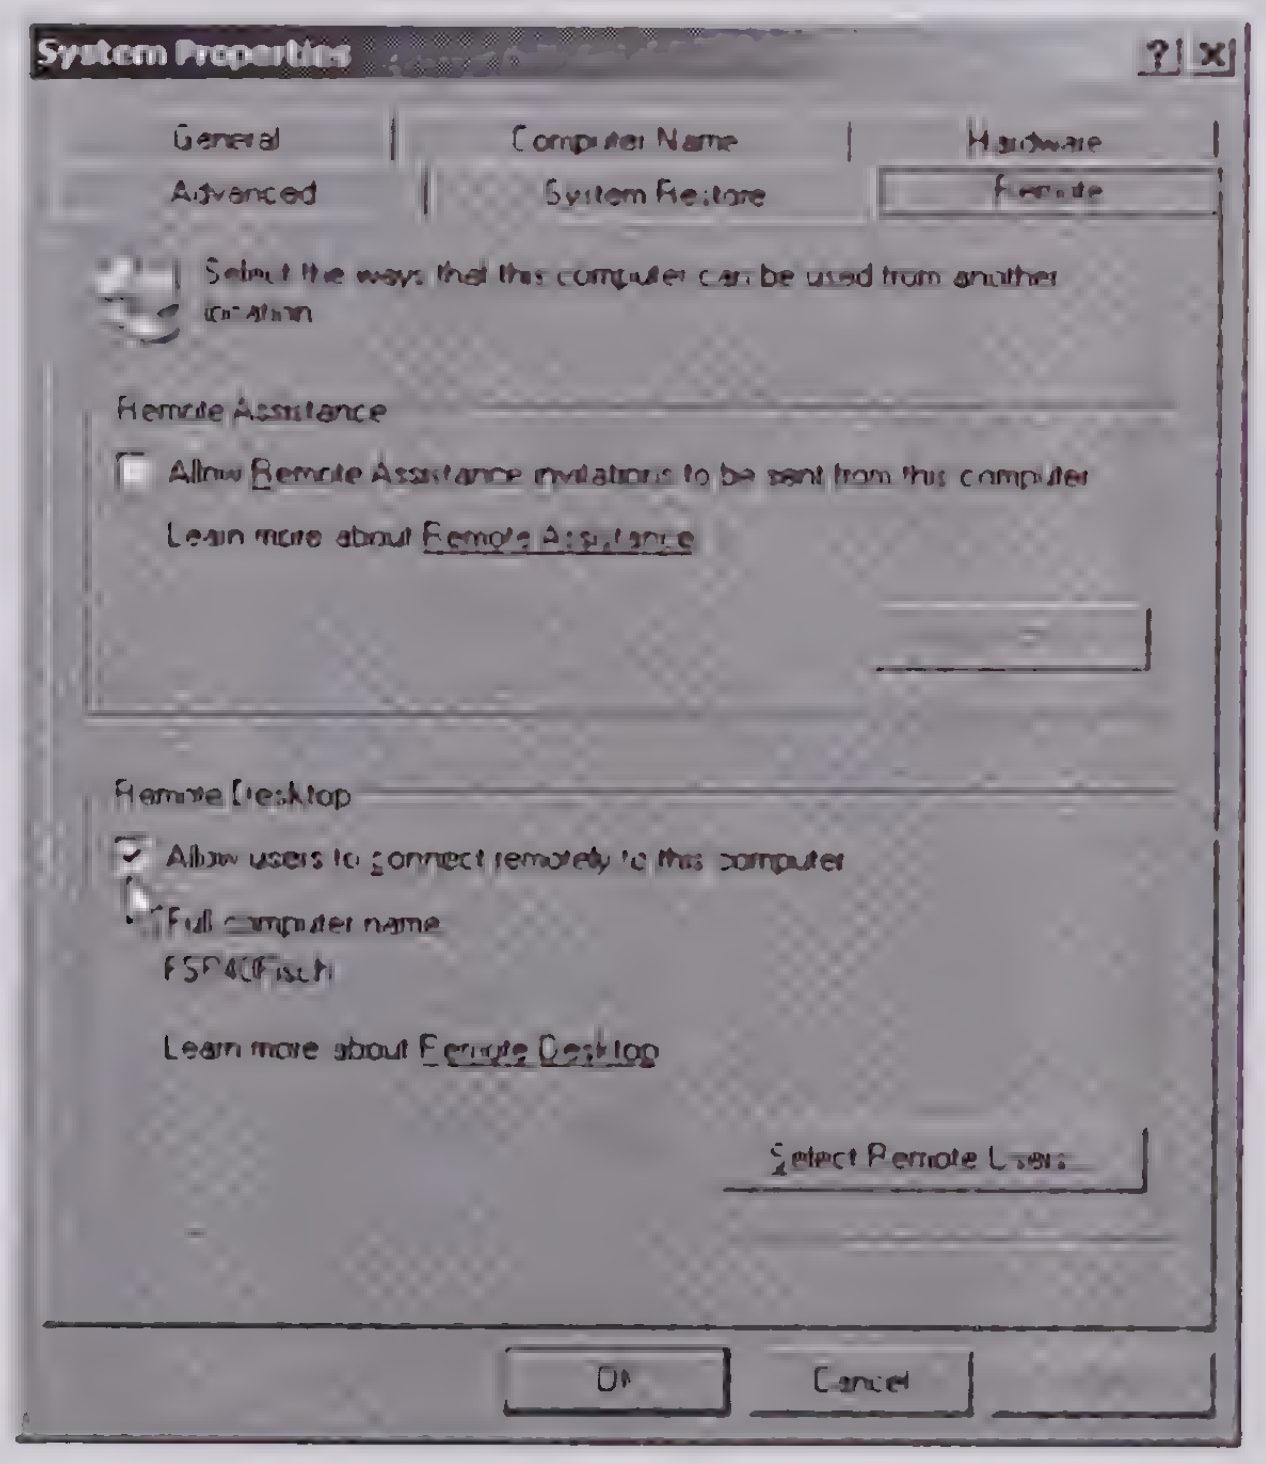
System Properties

Select the ways that this computer can be used from another location.

Remote Assistance

☐ Allow Remote Assistance invitations to be sent from this computer

Learn more about Remote Assistance

Remote Desktop

☑ Allow users to connect remotely to this computer

Full computer name
FSP4CFisch

Learn more about Remote Desktop

- ➢ Select the *Remote* tab.
- ➢ In the *Remote Desktop* field, tick the box in front of *Allow users to connect remotely to this computer.*
- ➢ If required, select the users installed on the R&S FSP who are to also have access to the R&S FSP via remote desktop in the *Select Remote Users...* dialog.

  Note:
  The user account under which the configuration is to be performed is automatically enabled for remote desktop.

- ➢ Confirm setting with *OK* .

The R&S R&S FSMR is therefore ready for setting up the connection with the remote desktop of the controller.

Configuration of Controller

A precondition for the operation of the remote desktop is the availability of the TCP/IP protocol on the controller and the installation of the remote desktop client.

Note:
For Windows XP, the remote desktop client is part of the operating system and available under Start - Programs - Accessories - - Communications - Remote Desktop Connection.
For other Windows versions, Microsoft offers the remote client as a separate program package for subsequent installation.

The settings on the remote desktop client of the controller must be made prior to setting up the connection with the R&S FSP. The following steps are required:

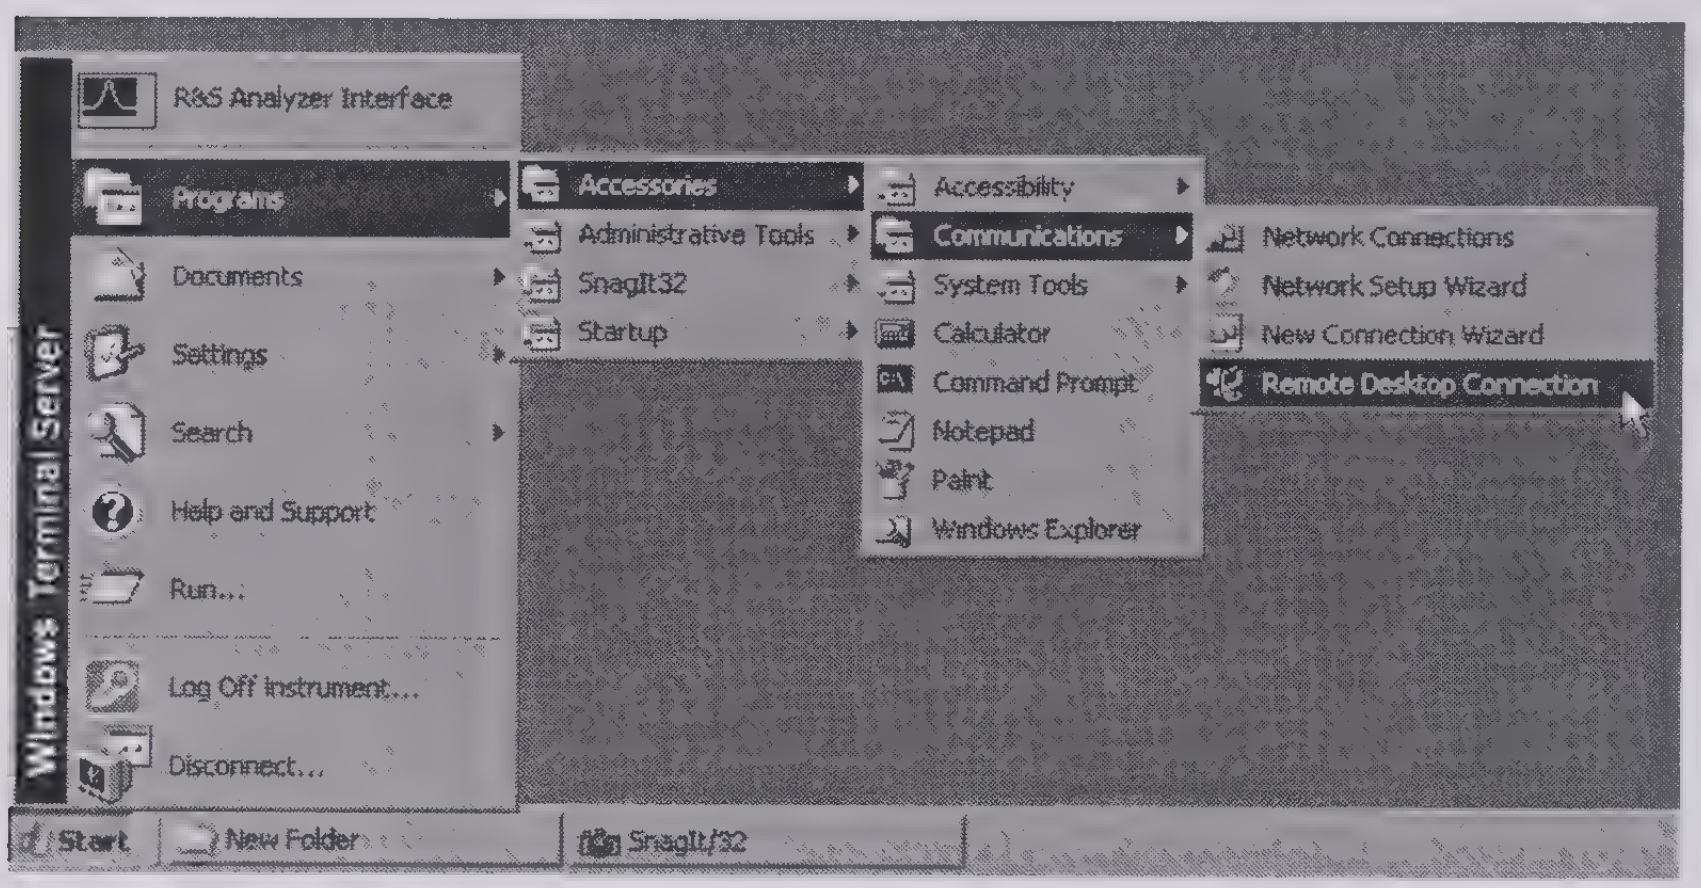

- ➢ Press the Windows key or <CTRL><ESC>.
- ➢ Select Programs - Accessories - Communications - Remote Desktop Connection.

The Remote Desktop Connection screen will be opened.

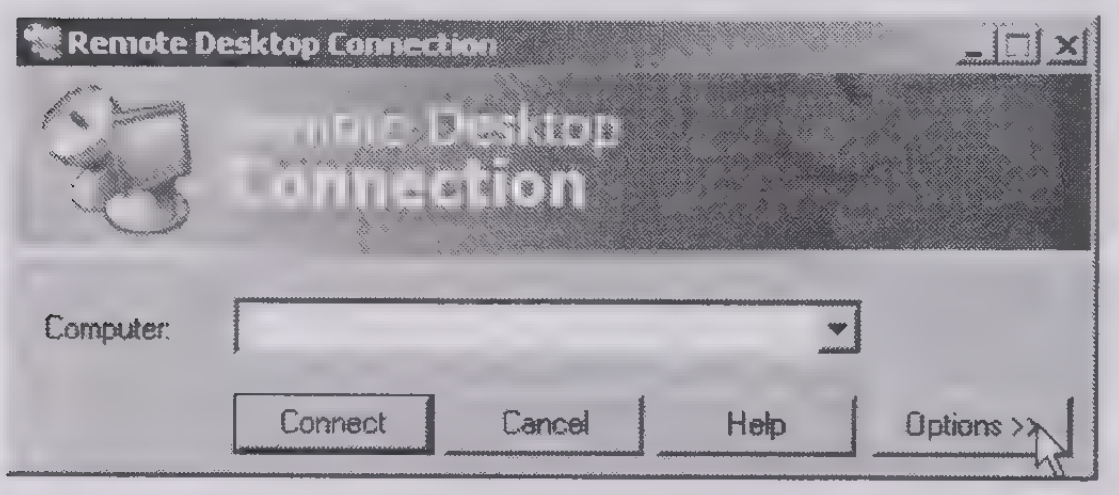

- ➢ Click the *Options* >> button.

The tabs with the configuration data will be opened.

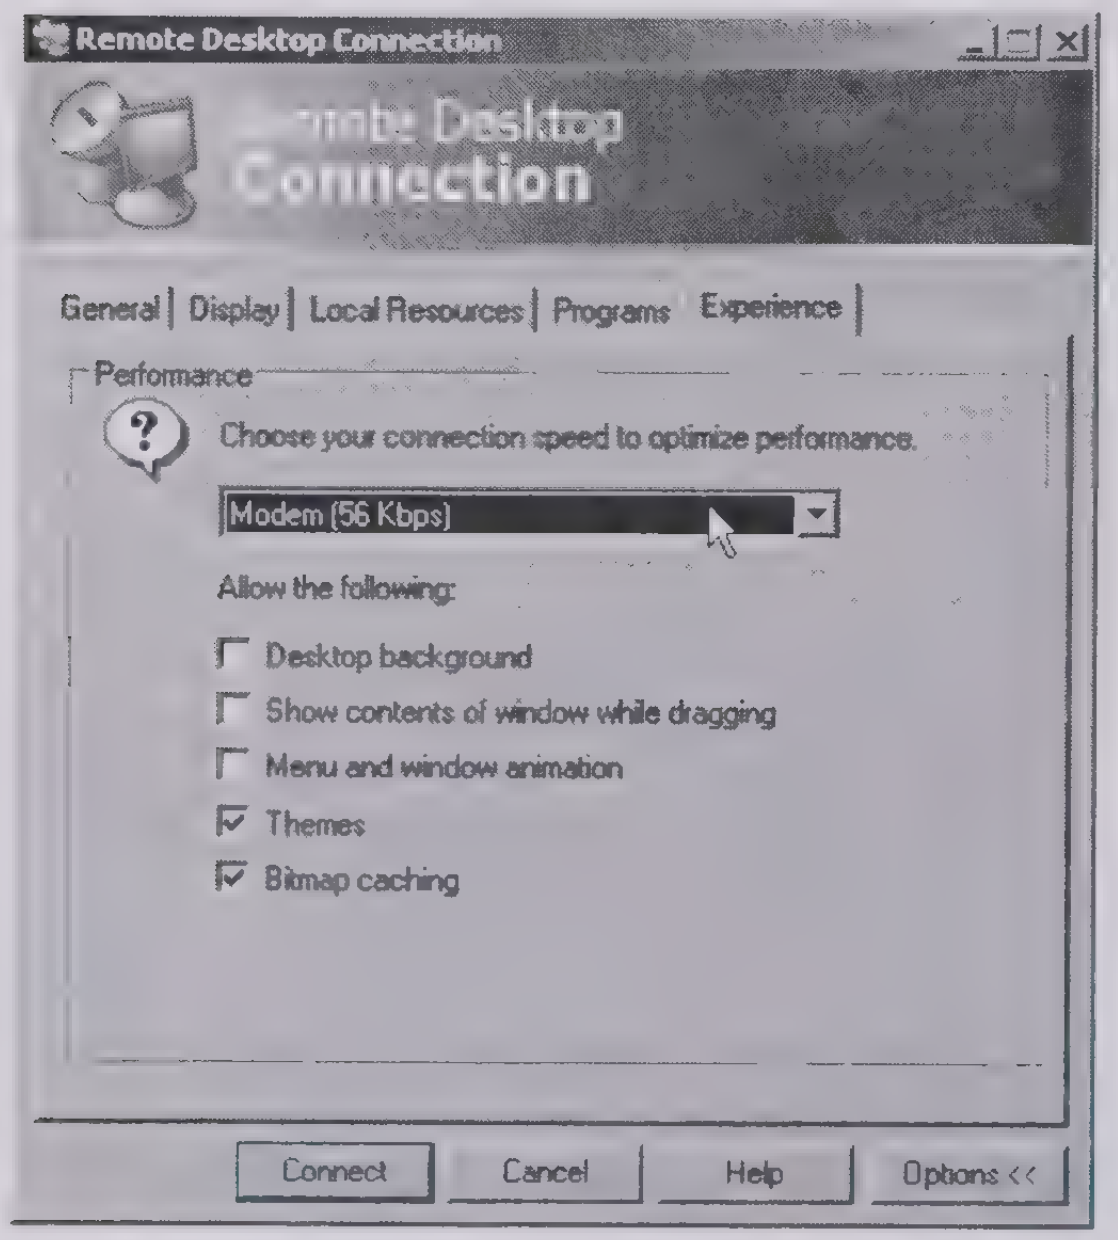

Choose your connection speed to optimize performance.

Modem (56 Kbps)

Allow the following:

☐ Desktop background
☐ Show contents of window while dragging
☐ Menu and window animation
☑ Themes
☑ Bitmap caching

- ➢ Select the *Experience* tab.
The speed of setting up the connection will be selected and optimized.
- ➢ Click the selection list under *Choose your connection speed to optimize performance.*

The list of available configurations will be opened.

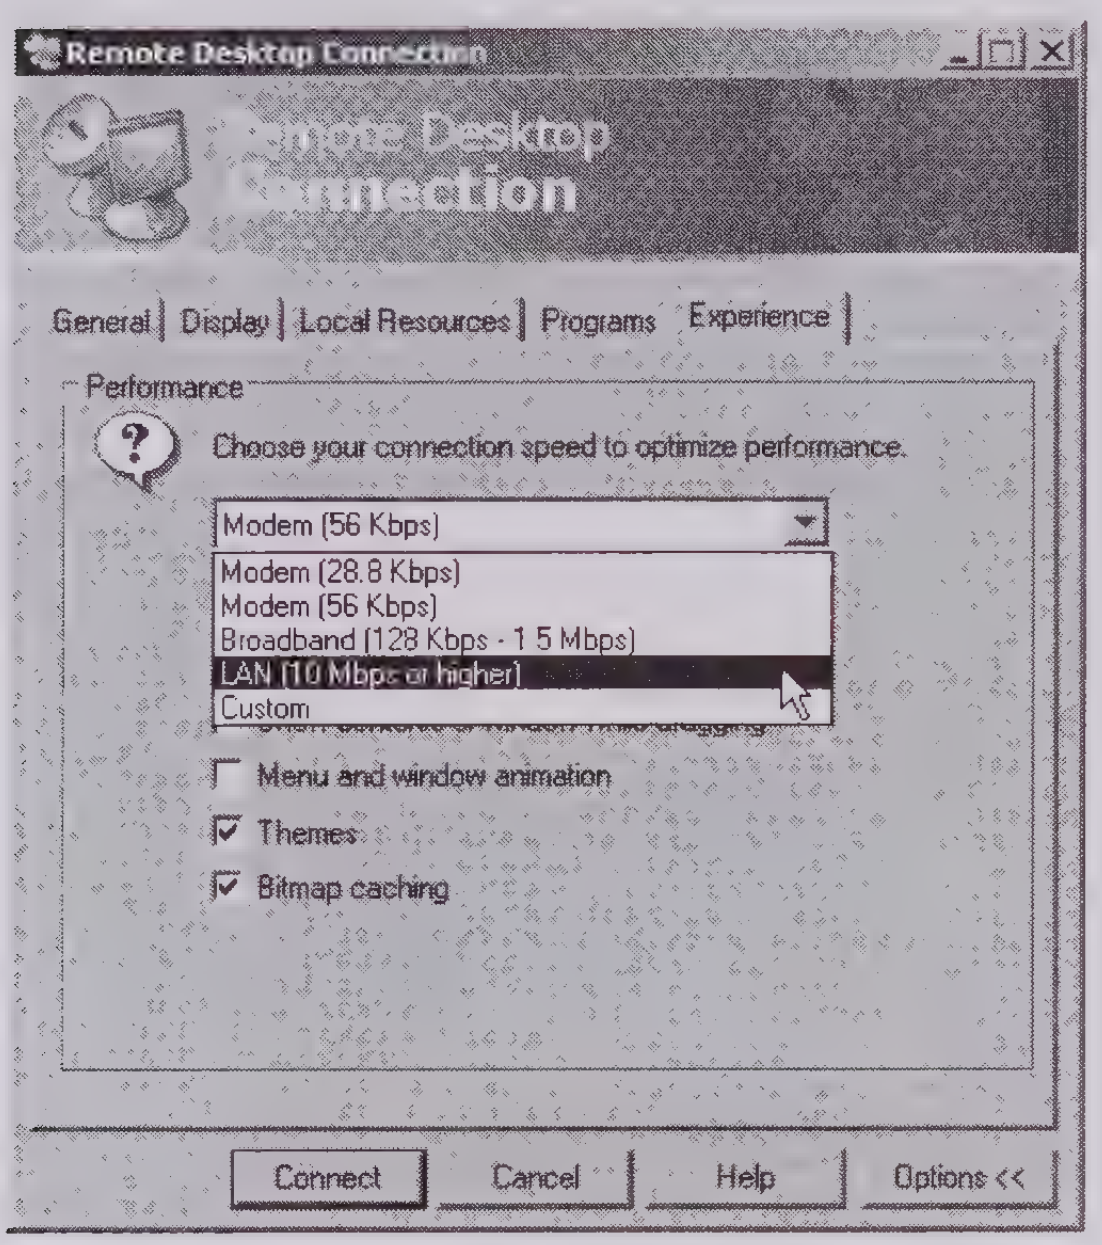

- ➢ Select the suitable connection (in the example LAN (10 Mbps or higher)).

  Different boxes in the list below are activated depending on the selection and depending on the performance of the connection.
- ➢ To improve the performance, the entries "Desktop background", "Show Contents of Window while dragging" and "Menu and Window animation" can be switched off.
- ➢ Click the *Local Resources* tab.
  The tab to share printers, local drives and serial interfaces will be opened.

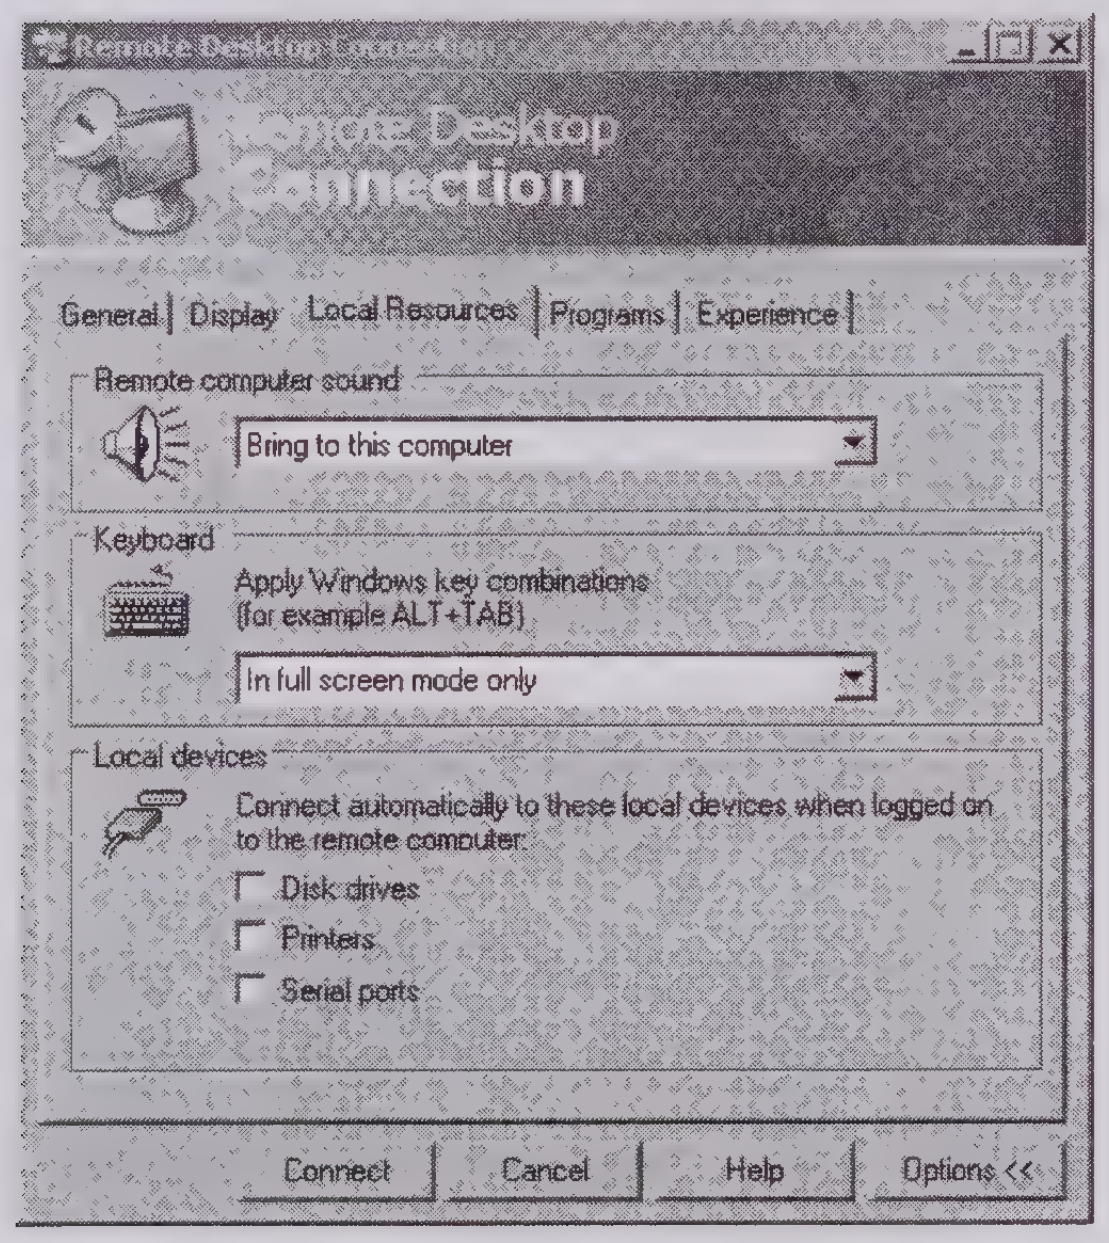

- ➢ Click the box in front of *Disk drives* if drives of the controller are to be accessed from the R&S FSP (e.g. to save settings or to copy files from the controller to the R&S FSP).
  Windows XP will then map the drives of the controller like network drives on the R&S R&S FSMR.
- ➢ Click the box in front of *Printers* if printers connected to the controller are to be used from the R&S R&S FSMR.
- ➢ Do not change the other settings.
- ➢ Click the *Display* tab.
  The configuration of the representation of the R&S R&S FSMR screen on the controller will be opened.

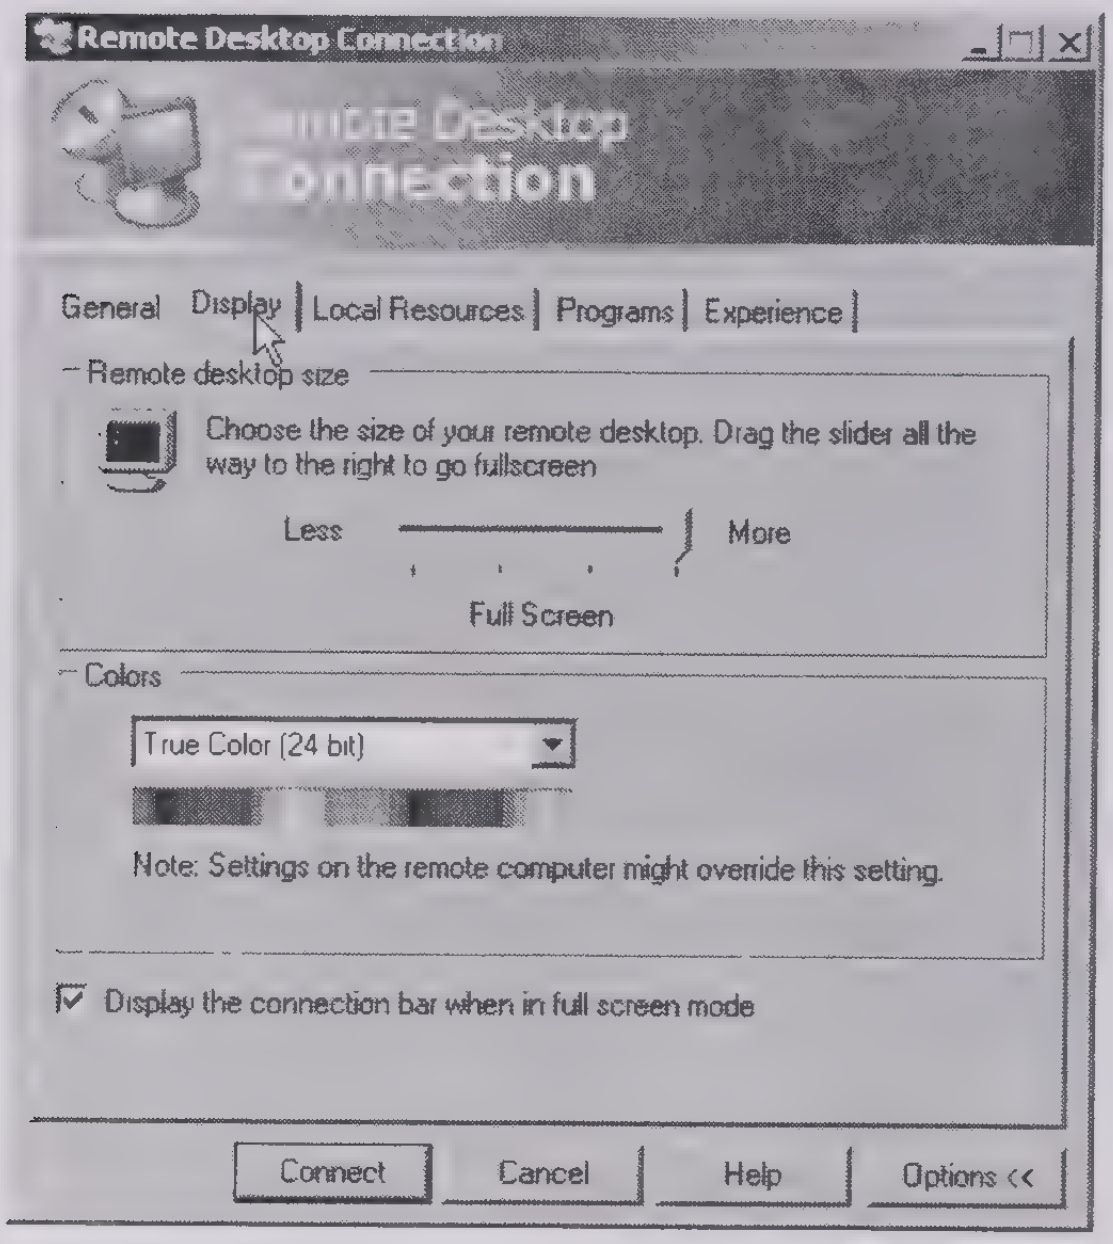

Remote desktop size

Choose the size of your remote desktop. Drag the slider all the way to the right to go fullscreen

Full Screen

Colors

True Color (24 bit)

Note: Settings on the remote computer might override this setting.

☑ Display the connection bar when in full screen mode

- The size of the R&S FSP window on the desktop of the controller can be changed by means of the slider. The default setup is full screen.
- Do not change the colour depth.
- *Display the connection bar when in full screen mode*:

  If this box is checked, a bar will appear at the top screen margin. This bar displays the network address of the R&S R&S FSMR and can be used to reduce, minimize or to close the window.

  If the box is not checked, a return from the R&S R&S FSMR screen to the controller desktop in the full-screen mode is possible only if "Disconnect" is selected in the start menu:

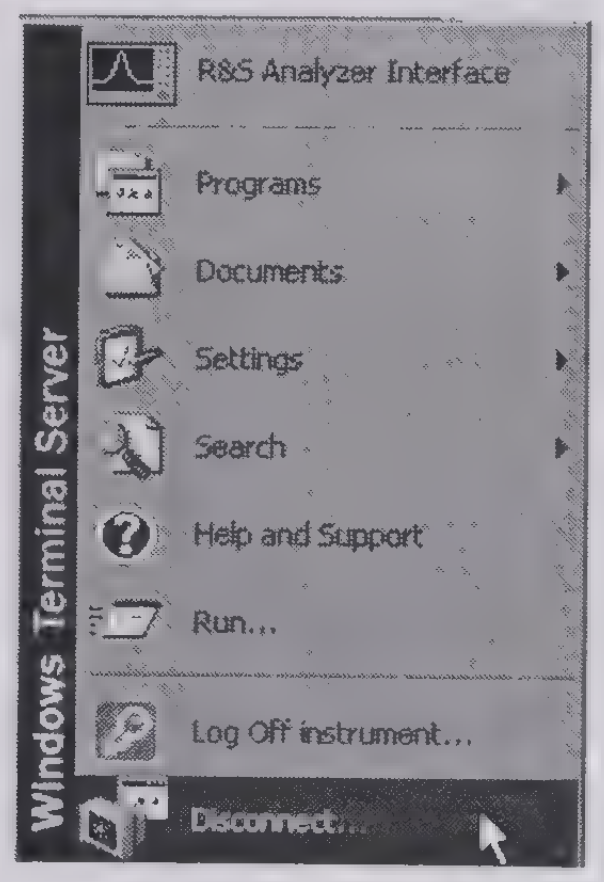

Setting up the Connection with the R&S R&S FSMR

After configuration of the remote desktop client, the connection with the R&S R&S FSMR has to be set up.

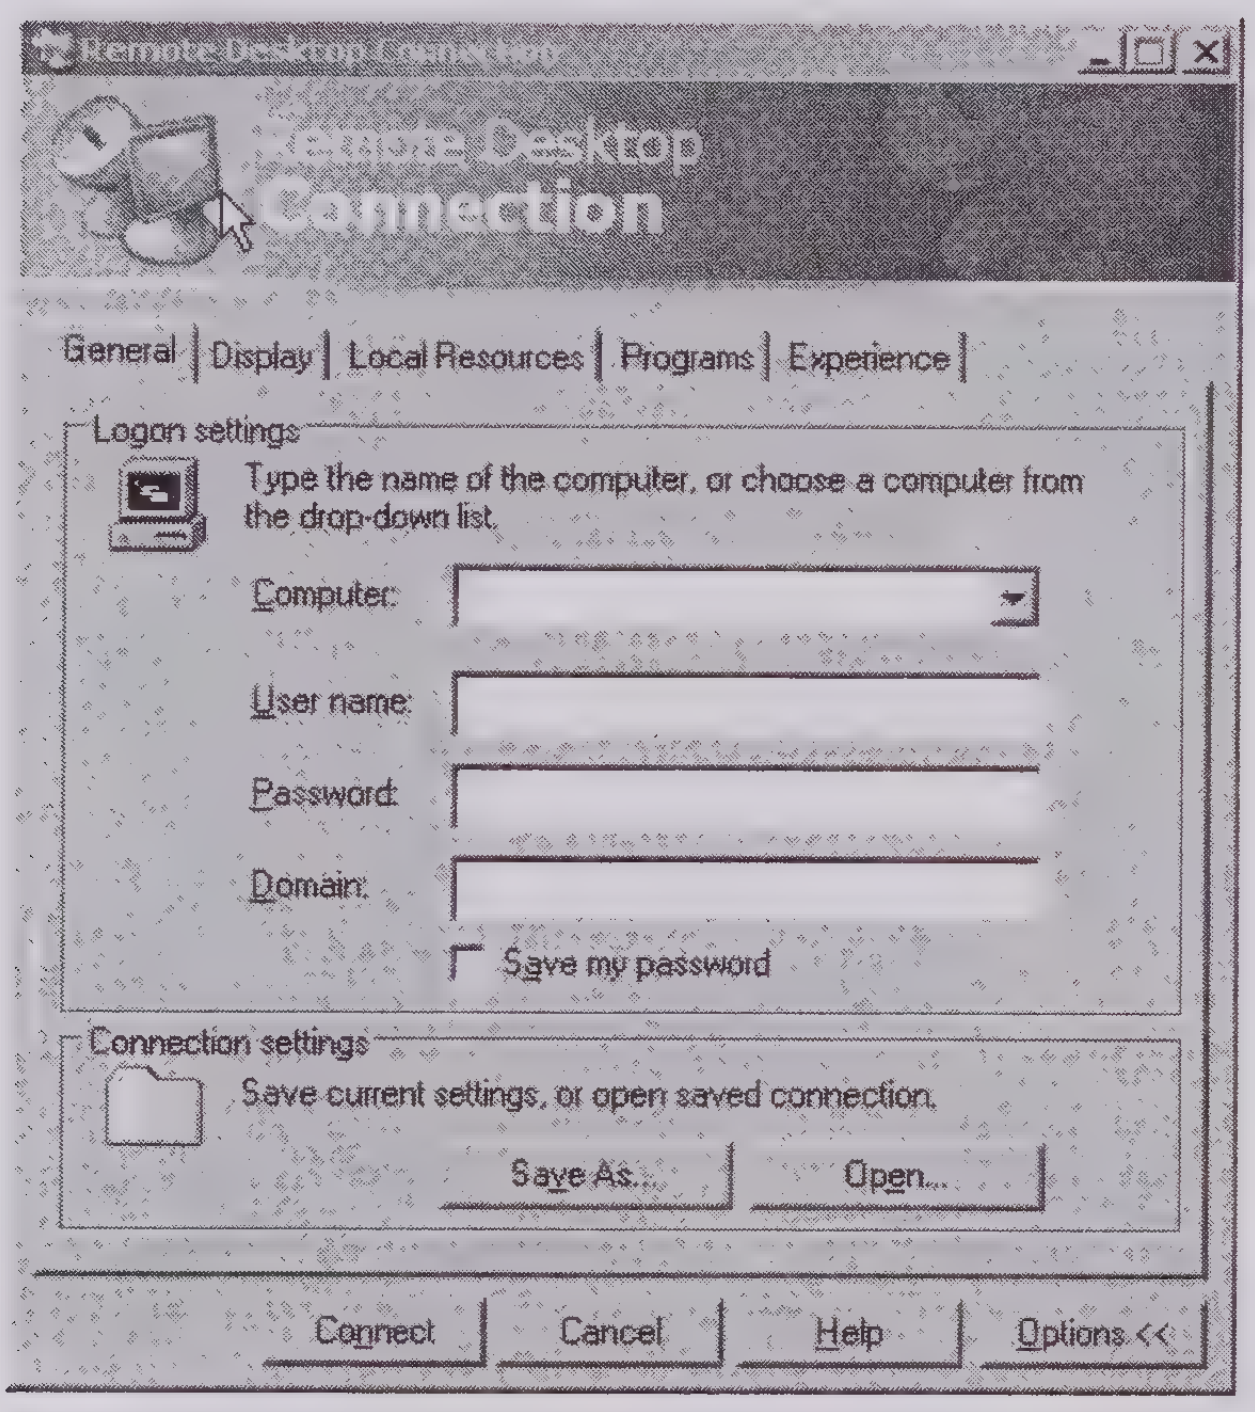

Type the name of the computer, or choose a computer from the drop-down list.

Save current settings, or open saved connection.

- ➢ Click the *General* tab. The connection information will be entered.
- ➢ Enter the IP address of the R&S R&S FSMR in the *Computer* field.
- ➢ The information can be stored via the *Save As...* button for the next time. With the *Open...* button, it is possible to load an existing configuration again.
- ➢ Press the *Connect* button. The connection will be set up.

  Note:

  If the entry *Disk Drives* is active in the *Local Resources* tab, a warning is issued that the drives will be shared for access from the R&S R&S FSMR:

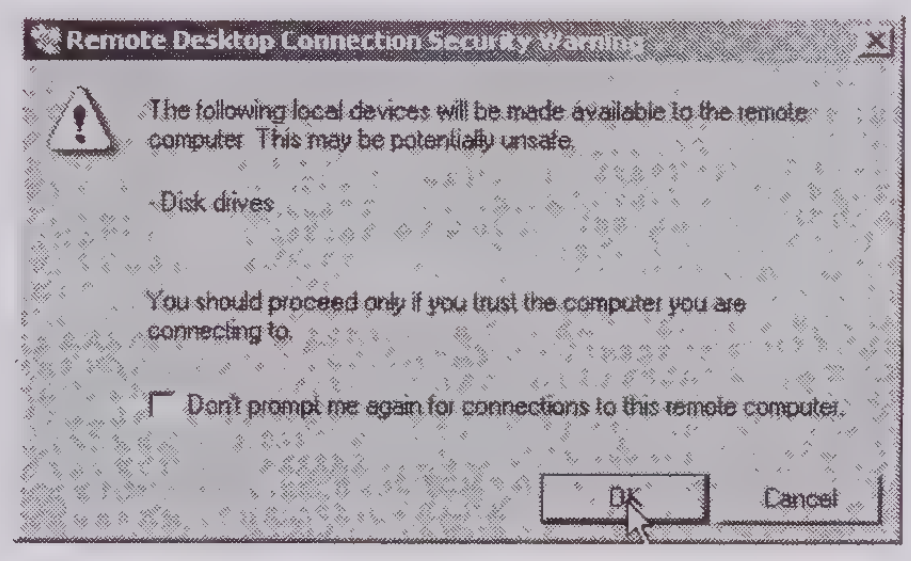

The following local devices will be made available to the remote computer. This may be potentially unsafe.

-Disk drives

You should proceed only if you trust the computer you are connecting to.

☐ Don't prompt me again for connections to this remote computer.

Confirm the warning with OK. The setup will be continued.

The R&S FSP screen will appear on the controller screen with the request to log in. To allow remote control of the R&S R&S FSMR, the following steps have to be carried out:

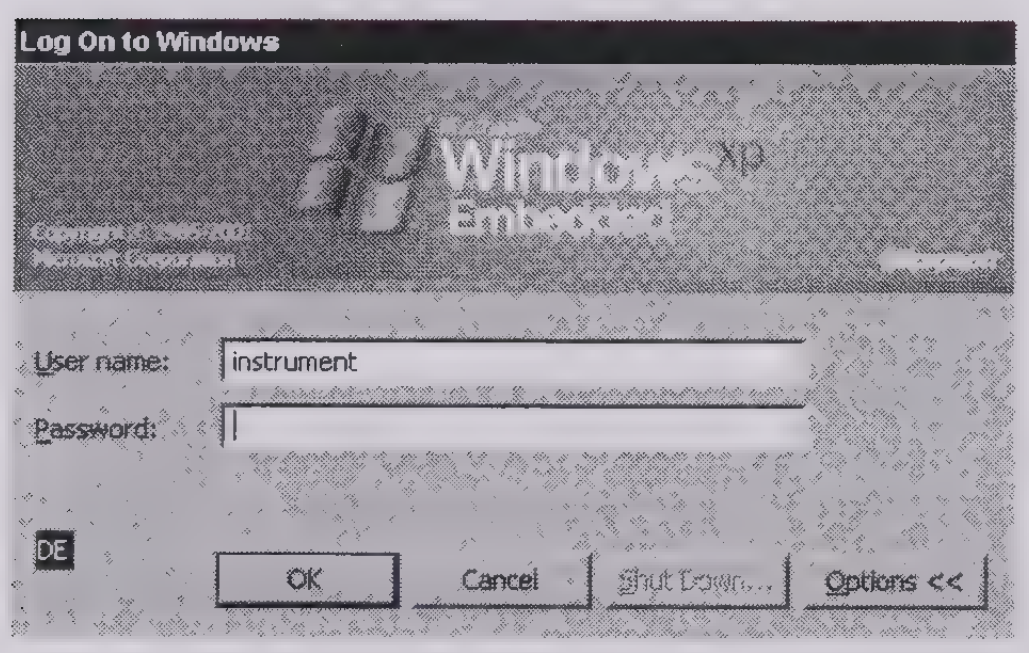

User name: instrument

Password:

- ➢ Enter user name "instrument" and password "instrument".

  The R&S R&S FSMR screen will be opened in a few moments.

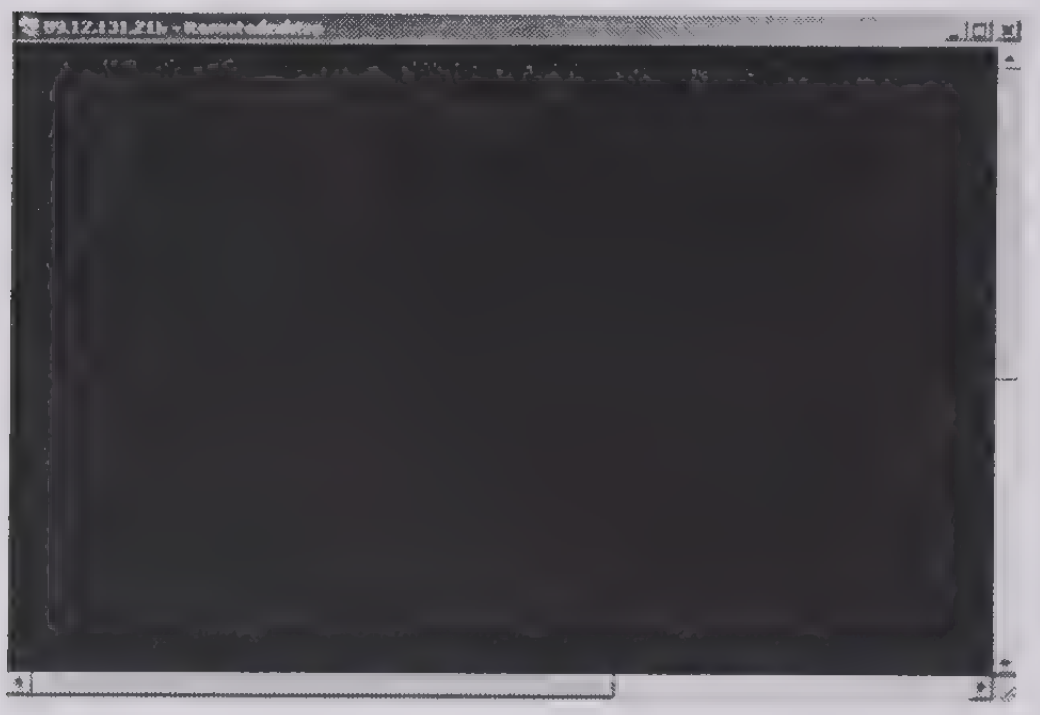

If the screen is dark or if a dark rectangle appears in the upper left corner, the R&S R&S FSMR firmware must be restarted in order to recognize the modified screen resolution.
In this case:

- Press <ALT><F4>.
  The R&S FSP firmware will be shut down. This may last for several seconds.

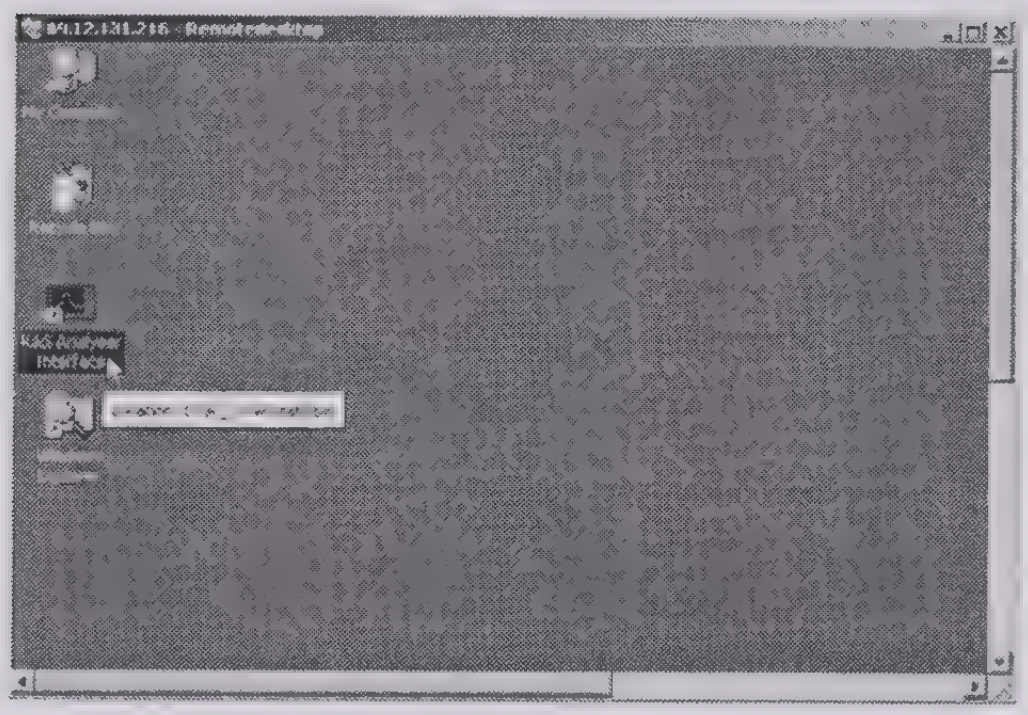

- Double-click the entry *R&S Analyzer Interface*.

The firmware will restart and will automatically open the *Soft Frontpanel*, i.e. the user interface in which all front panel buttons and the spinwheel are shown.

- If the R&S FSP application is directly displayed after setup, shutdown and restart can be omitted.

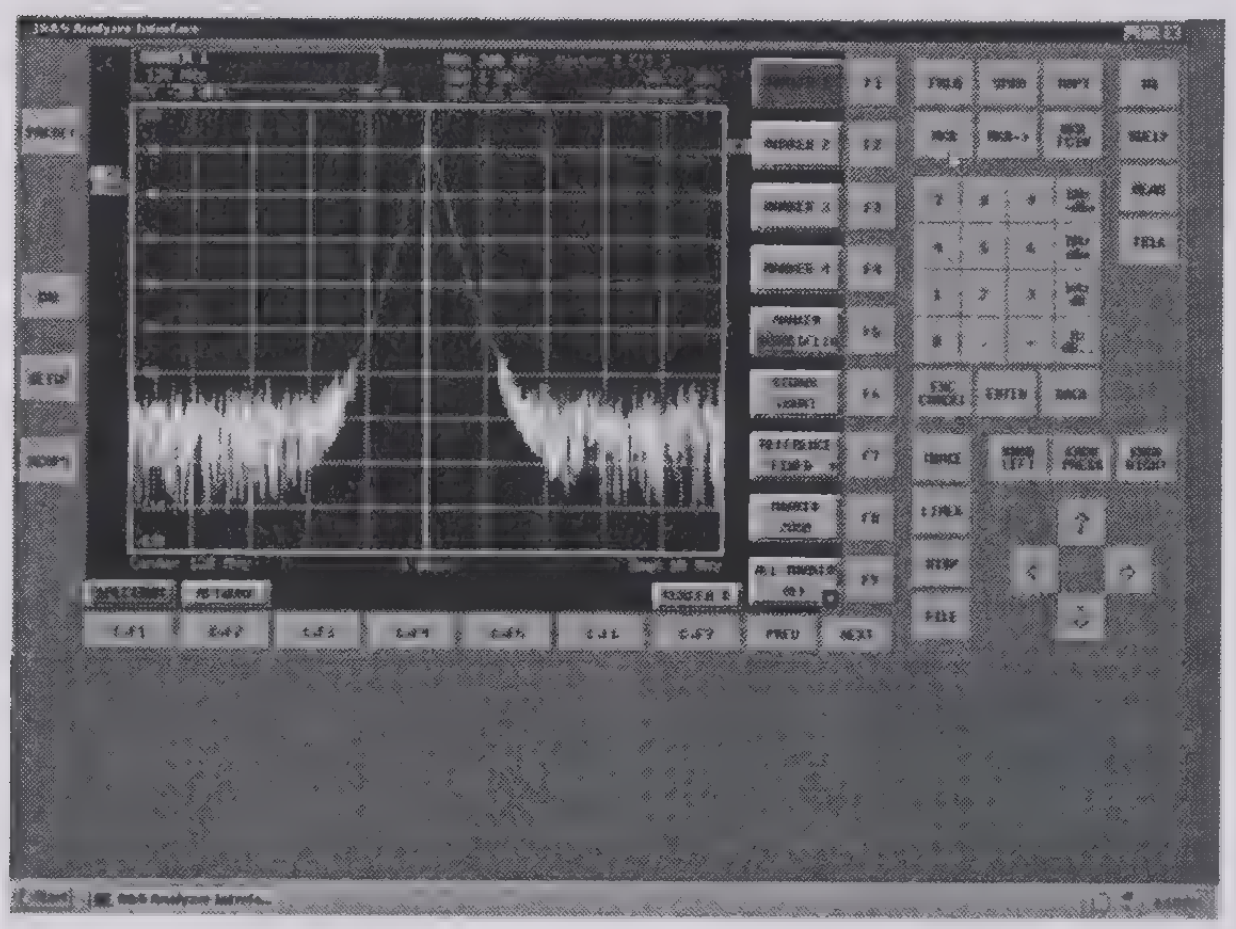

- All hardkeys, softkeys and hotkeys can be operated with the mouse.
- The spinwheel is implemented by *KNOB LEFT, KNOB RIGHT* and *KNOB PRESS.*
- The XP start menu is available if the remote desktop window is enlarged to full size.

Interruption and Re-setup of Remote Desktop Connection with the R&S R&S FSMR

The connection to the R&S R&S FSMR can be interrupted any time if the remote desktop window is connected to the controller.

To reestablish the connection, the setup with the R&S R&S FSMR only has to be performed again as described in the section "Setting up the Connection with the R&S R&S FSMR". The R&S R&S FSMR will then maintain its state in case of an interruption with a subsequent re-setup.

When the connection is set up with the controller, the login entry will be displayed on the R&S R&S FSMR screen. If the login procedure is carried out successfully, the message that a different user has assumed control of the instrument and that the connection was therefore cleared will be displayed on the screen of the controller.

Switching off the R&S R&S FSMR from the Controller

The R&S R&S FSMR can be switched off per remote control. For this purpose, proceed as follows:

1. Click the R&S R&S FSMR soft front panel and close the application with <ALT><F4> .
2. Click the desktop and press <ALT><F4>.
   A confirmation query with the warning that the instrument cannot be switched on again via remote control is displayed with the query to continue the shutdown process.
3. Answer the confirmation query with YES.
   The connection to the controller will then be cleared and the R&S R&S FSMR will be switched off.

Remote Data Transfer with TCP/IP Services

The protocol TCP/IP allows the transfer of files between different computer systems. This requires a program running on the two computers that controls this data transfer. It is not necessary that the same operating or file system is used by both computers. For example, a file transfer between DOS/WINDOWS and UNIX is possible. One of the two partners must be configured as Host and the other one as Client. However, they may change their roles. Usually, the system which is able to perform several processes at the same time will play the host role. The file transfer program usually used under TCP/IP is FTP (File Transfer Protocol). An FTP host is installed as standard on the majority of UNIX systems.

If the TCP/IP services are installed, a terminal connection is possible using "Start" - "Programs" - "Accessories" - "Telnet" or a data transfer via FTP by means of "Start" - "Run" "ftp" - "OK". Thus all computer systems supporting these universal protocols can be addressed (UNIX, VMS, etc).

For further information, refer to the corresponding XP literature.

File Transfer via FTP

The total scope of functions and commands is described in the FTP literature. The following table therefore only contains the major functions:

Setting up the connection

Click "Start" and then "Run" in the task bar.

The DOS command
```
FTP
```
starts the program.

The command
```
OPEN <xx.xx.xx.xx>
```
sets up the connection.

xx.xx.xx.xx = IP address e.g. 89.0.0.13

Data transfer

The command
```
PUT <dateiname>
```
transfers the data to the target system.

The command
```
GET <dateiname>
```
transfers the data from the target system.

The command
```
TYPE B
```
transfers the data in BINARY format; no conversion takes place.

The command
```
TYPE A
```

transfers the data in ASCII format, converting control characters so that text files can also be read on the target system.

Examples:

```
PUT C:\AUTOEXEC.BAT
```

sends the file `AUTOEXEC.BAT` to the target system.

```
LCD DATA
```

changes the current directory on the local machine to subdirectory `DATA`

```
CD SETTING
```

changes to the subdirectory `SETTING` on the target system

dateiname= File name e.g. DATA.TXT

Changing the directories

The command

```
LCD <path>
```

changes the directory on the local machine as with `DOS`.

The command

```
LDIR
```

shows the directory contents on the local machine.

These commands refer to the file system of the R&S FSMR. If the `L` is omitted ahead of the commands, they apply to the target system.

RSIB Protocol

The instrument is equipped with an RSIB protocol as standard, which allows the instrument to be controlled by means of Visual C++ and Visual Basic programs, but also by means of the Windows applications WinWord and Excel as well as National Instruments LabView, LabWindows/CVI and Agilent VEE. The control applications run on an external computer in the network.

A UNIX operating system can be installed on an external computer in addition to a Windows operating system. In this case, the control applications are created either in C or C++. The supported UNIX operating systems include:

- Sun Solaris 2.6 Sparc Station
- Sun Solaris 2.6 Intel Platform
- Red Hat Linux 6.2 x86 Processors

Remote Control via RSIB Protocol

Windows Environment

To access the measuring instruments via the RSIB protocol, the file `RSIB32.DLL` must be copied to the Windows `system32` directory or to the directory of the control applications. For 16-bit applications, the file `RSIB.DLL` must be additionally copied to the directories mentioned. The files RSIB.DLL and RSIB32.DLL are included on the instrument in directory D:\R_S\Instr\RSIB.

For the different programming languages, there are files available that contain the declarations of the DLL functions and the definition of the error codes.

Visual Basic (16 bit):	`'RSIB.BAS'`	`(D:\R_S\Instr\RSIB)`
Visual Basic (32 bit):	`'RSIB32.BAS'`	`(D:\R_S\Instr\RSIB)`
C:/C++:	`'RSIB.H'`	`(D:\R_S\Instr\RSIB)`

For C/C++: programs, import libraries are additionally available.

Import library for RSIB.DLL:	`RSIB.LIB'`	`(D:\R_S\Instr\RSIB)`
Import library for RSIB32.DLL:	`RSIB32.LIB'`	`(D:\R_S\Instr\RSIB)`

The control is performed using the Visual C++ or Visual Basic programs WinWord, Excel, LabView, LabWindows/CVI or Agilent VEE. Every application that can load a DLL is able to use the RSIB protocol. The programs use the IP address of the instrument or its *host name* to set up the connection.

.

Via VisualBasic: ud = RSDLLibfind ("82.1.1.200", ibsta, iberr, ibcntl)

Return to manual operation is possible via the front panel (*LOCAL* key) or via the RSIB protocol:

Via RSIB: ud = RSDLLibloc (ud, ibsta, iberr, ibcntl);
or
ud = RSDLLibonl (ud, 0, ibsta, iberr, ibcntl);

UNIX Environment

To access the measuring equipment via the RSIB interface, copy the `librsib.so.X.Y` file to a directory for which the control application has read rights. `X.Y` in the file name indicates the version number of the library, for example `1.0`.

The `librsib.so.X.Y` library is created as a *shared library*. The applications using the library need not consider its version. They simply link the library with the `lrsib` option. The following instructions have to be observed so that linking can be successfully performed and the library can be found during program execution:

File link:

- Use the operating system command *ln* to create a file with the link name `librsib.so` and pointing to `librsib.so.X.Y` in a directory for which the control application has read rights. Example:

```
$ ln -s /usr/lib/librsib.so.1.0 /usr/lib/librsib.so
```

Linker options for creating applications:

- `-lrsib` : import library
- `-Lxxx` : path information where the import library can be found. This is where the above file link has been created. Example: `-L/usr/lib`.

Additional linker options for creating applications (only under Solaris):

- `-Rxxx`: path information where the library is searched for during the program run: `-R/usr/lib`.

Run-time environment:

- Set environment variable `LD_RUN_PATH` to the directory in which the file link has been created. This is necessary only if `librsib.so` cannot be found in the default search path of the operating system and the `-R` linker option (only Solaris) was not specified.

For C/C++ programming, the declarations of the library functions and the definition of error codes are contained in:

C/C++: `'RSIB.H'` `(D:\R_S\Instr\RSIB)`

RSIB Interface Functions

This chapter lists all functions of the DLL `"RSIB.DLL" or "RSIB32.DLL"` or `"librsib.so"`, which allow control applications to be produced.

Overview of Interface Functions

The library functions are adapted to the interface functions of National Instruments for GPIB programming. The functions supported by the libraries are listed in the following table.

Function	**Description**
RSDLLibfind()	Provides a handle for access to a device.
RSDLLibwrt()	Sends a zero-terminated string to a device.
RSDLLilwrt()	Sends a certain number of bytes to a device.
RSDLLibwrtf()	Sends the contents of a file to a device.
RSDLLibrd()	Reads data from a device into a string.
RSDLLilrd()	Reads a certain number of bytes from a device.
RSDLLibrdf()	Reads data from a device into a file.
RSDLLibtmo()	Sets timeout for RSIB functions.
RSDLLibsre()	Switches a device to the local or remote state.
RSDLLibloc()	Temporarily switches a device to the local state.
RSDLLibeot()	Enables/disables the END message for write operations.
RSDLLibrsp()	Performs a serial poll and provides the status byte.
RSDLLibonl()	Sets the device online/offline.
RSDLLTestSrq()	Checks whether a device has generated an SRQ.
RSDLLWaitSrq()	Waits until a device generates an SRQ.
RSDLLSwapBytes	Swaps the byte sequence for binary numeric display (only required for non-Intel platforms).

Variables ibsta, iberr, ibcntl

As with the National Instrument interface, the successful execution of a command can be checked by means of the variables `ibsta`, `iberr` and `ibcntl`. For this purpose, all RSIB functions are assigned references to these three variables.

Status word - ibsta
The status word ibsta provides information on the status of the RSIB interface. The following bits are defined:

Bit designation	Bit	Hex code	Description
`ERR`	15	8000	Is set when an error has occurred on calling a function. If this bit is set, `iberr` contains an error code that specifies the error in greater detail.
`TIMO`	14	4000	Is set when a timeout has occurred on calling a function.
`CMPL`	8	0100	Is set if the response of the GPIB parser has been read out completely. If a parser response is read out with the function `RSDLLilrd()` and the length of the buffer is insufficient for the answer, the bit will be cleared.

Error variable - iberr
If the ERR bit (8000h) is set in the status word, `iberr` contains an error code which allows the error to be specified in greater detail. Extra error codes are defined for the RSIB protocol, independent of the National Instruments interface.

Error	Error code	Description
`IBERR_CONNECT`	2	Setup of the connection to the measuring instrument has failed.
`IBERR_NO_DEVICE`	3	A function of the interface has been called with an illegal device handle.
`IBERR_MEM`	4	No empty memory available.
`IBERR_TIMEOUT`	5	Timeout has occurred.
`IBERR_BUSY`	6	The RSIB protocol is blocked by a function that is still running.
`IBERR_FILE`	7	Error when reading or writing to a file.
`IBERR_SEMA`	8	Error upon creating or assigning a semaphore (only under UNIX).

Count variable - ibcntl
The variable `ibcntl` is updated with the number of transferred bytes each time a read or write function is called.

Description of Interface Functions

RSDLLibfind()

The function provides a handle for access to the device with the name `udName`.

VB format: `Function RSDLLibfind (ByVal udName$, ibsta%, iberr%, ibcntl&) As Integer`

C format: `short WINAPI RSDLLibfind( char far *udName, short far *ibsta, short far *iberr, unsigned long far *ibcntl)`

C format (UNIX): `short RSDLLibfind( char *udName, short *ibsta, short *iberr, unsigned long *ibcntl)`

Parameters:		
	`udName`	IP address of device

Example: `ud = RSDLLibfind ("89.10.38.97", ibsta, iberr, ibcntl)`

The function must be called prior to all other functions of the interface.

As return value, the function provides a handle that must be indicated in all functions for access to the device. If the device with the name `udName` is not found, the handle has a negative value.

RSDLLibwrt

This function sends data to the device with the handle `ud`.

VB format: `Function RSDLLibwrt (ByVal ud%, ByVal Wrt$, ibsta%, iberr%, ibcntl&) As Integer`

C format: `short WINAPI RSDLLibwrt( short ud, char far *Wrt, short far *ibsta, short far *iberr, unsigned long far *ibcntl )`

C format (UNIX): `short RSDLLibwrt( short ud, char *Wrt, short *ibsta, short *iberr, unsigned long *ibcntl )`

Parameters:		
	`ud`	Device handle
	`Wrt`	String sent to the device.

Example: `RSDLLibwrt(ud, "SENS:FREQ:STAR?", ibsta, iberr, ibcntl)`

This function allows setting and query commands to be sent to the measuring instruments. Whether the data is interpreted as a complete command can be set using the function `RSDLLibeot()`.

RSDLLilwrt

This function sends `Cnt` bytes to a device with the handle `ud`.

VB format: `Function RSDLLilwrt (ByVal ud%, ByVal Wrt$, ByVal Cnt&, ibsta%, iberr%, ibcntl&) As Integer`

C format: `short WINAPI RSDLLilwrt( short ud, char far *Wrt, unsigned long Cnt, short far *ibsta, short far *iberr, unsigned long far *ibcntl)`

C format (UNIX): `short RSDLLilwrt( short ud, char *Wrt, unsigned long Cnt, short *ibsta, short *iberr, unsigned long *ibcntl)`

Parameters:		
	`ud`	Device handle
	`Wrt`	String sent to the GPIB parser.
	`Cnt`	Number of bytes sent to the device.

Example: `RSDLLilwrt (ud, '......', 100, ibsta, iberr, ibcntl)`

Like `RSDLLibwrt()` this function sends data to a device. The only difference is that binary data can be sent as well. The length of the data is not determined by a zero-terminated string, but by the indication of `Cnt` bytes. If the data is to be terminated with EOS (0Ah), the EOS byte must be appended to the string.

RSDLLibwrtf

This function sends the contents of a file `file$` to the device with the handle `ud`.

VB format: `Function RSDLLibwrtf (ByVal ud%, ByVal file$, ibsta%, iberr%, ibcntl&) As Integer`

C format: `short WINAPI RSDLLibwrt( short ud, char far *Wrt, short far *ibsta, short far *iberr, unsigned long far *ibcntl )`

C format (UNIX): `short RSDLLibwrt( short ud, char *Wrt, short *ibsta, short *iberr, unsigned long *ibcntl )`

Parameters:

`ud`	Device handle
`file`	File whose contents is sent to the device.

Example: `RSDLLibwrtf(ud, "C:\db.sav", ibsta, iberr, ibcntl)`

This function allows setting and query commands to be sent to the measuring instruments. Whether the data is interpreted as a complete command can be set using the function `RSDLLibeot()`.

RSDLLibrd()

The function reads data from the device with the handle `ud` into the string `Rd`.

VB format: `Function RSDLLibrd (ByVal ud%, ByVal Rd$, ibsta%, iberr%, ibcntl&) As Integer`

C format: `short WINAPI RSDLLibrd( short ud, char far *Rd, short far *ibsta, short far *iberr, unsigned long far *ibcntl )`

C format (UNIX): `short RSDLLibrd( short ud, char *Rd, short *ibsta, short *iberr, unsigned long *ibcntl )`

Parameters:

`ud`	Device handle
`Rd`	String to which the read data is copied.

Example: `RSDLLibrd (ud, Rd, ibsta, iberr, ibcntl)`

This function fetches the responses of the GPIB parser to a query.

In the case of Visual Basic programming, a string of sufficient length must be generated beforehand. This can be done during the definition of the string or using the command `Space$()`.

Generation of a string of the length 100:

- `Dim Rd as String * 100`
- `Dim Rd as String`
  `Rd = Space$(100)`

RSDLLilrd

This function reads `Cnt` bytes from the device with the handle `ud`.

VB format: `Function RSDLLilrd (ByVal ud%, ByVal Rd$, ByVal Cnt&, ibsta%, iberr%, ibcntl&) As Integer`

C format: `short WINAPI RSDLLilrd( short ud, char far *Rd, unsigned long Cnt, short far *ibsta, short far *iberr, unsigned long far *ibcntl )`

C format (UNIX): `short RSDLLilrd( short ud, char *Rd, unsigned long Cnt, short *ibsta, short *iberr, unsigned long *ibcntl )`

Parameters:

`ud`	Device handle
`cnt`	Maximum number of bytes copied from the DLL into the target string `Rd`.

Example: `RSDLLilrd (ud, RD, 100, ibsta, iberr, ibcntl)`

Like the function `RSDLLibrd()`, this function reads data from a device. The only difference is that in this case the maximum number of bytes to be copied to the target string `Rd` can be indicated by means of `Cnt`. This function prevents writing beyond the end of the string.

RSDLLibrdf()

Reads data from the device with the handle `ud` into the file `file`.

VB format: `Function RSDLLibrdf (ByVal ud%, ByVal file$, ibsta%, iberr%, ibcntl&) As Integer`

C format: `short WINAPI RSDLLibrd( short ud, char far *file, short far *ibsta, short far *iberr, unsigned long far *ibcntl )`

C format (UNIX): `short RSDLLibrd( short ud, char *file, short *ibsta, short *iberr, unsigned long *ibcntl )`

Parameters:	`ud`	Device handle
	`file`	File to which the read data is written.

Example: `RSDLLibrdf (ud, "c:\db.sav", ibsta, iberr, ibcntl)`

The file name may as well include a drive or path specification.

RSDLLibtmo

This function defines the timeout for a device. The default value for the timeout is set to 5 seconds.

VB format: `Function RSDLLibtmo (ByVal ud%, ByVal tmo%, ibsta%, iberr%, ibcntl&) As Integer`

C format: `void WINAPI RSDLLibtmo( short ud, short tmo, short far *ibsta, short far *iberr, unsigned long far *ibcntl )`

C format (UNIX): `short RSDLLibtmo( short ud, short tmo, short *ibsta, short *iberr, unsigned long *ibcntl )`

Parameters:	`ud`	Device handle
	`tmo`	Timeout in seconds

Example: `RSDLLibtmo (ud, 10, ibsta, iberr, ibcntl)`

RSDLLibsre

This function sets the device to the 'LOCAL' or 'REMOTE' state.

VB format: `Function RSDLLibsre (ByVal ud%, ByVal v%, ibsta%, iberr%, ibcntl&) As Integer`

C format: `void WINAPI RSDLLibsre( short ud, short v, short far *ibsta, short far *iberr, unsigned long far *ibcntl)`

C format (UNIX): `short RSDLLibsre( short ud, short v, short *ibsta, short *iberr, unsigned long *ibcntl)`

Parameters:	`ud`	Device handle
	`v`	State of device 0 - local 1 - remote

Example: `RSDLLibsre (ud, 0, ibsta, iberr, ibcntl)`

RSDLLibloc

This function temporarily switches the device to the 'LOCAL' state.

VB format: `Function RSDLLibloc (ByVal ud%, ibsta%, iberr%, ibcntl&) As Integer`

C format: `void WINAPI RSDLLibloc( short ud, short far *ibsta, short far *iberr, unsigned long far *ibcntl)`

C format (UNIX): `short RSDLLibloc( short ud, short *ibsta, short *iberr, unsigned long *ibcntl)`

Parameter: `ud` Device handle

Example: `RSDLLibloc (ud, ibsta, iberr, ibcntl)`

After switchover to LOCAL state, the instrument can be manually operated via the front panel. On the next access to the instrument by means of one of the functions of the library, the instrument is switched again to the REMOTE state.

RSDLLibeot

This function enables or disables the END message after write operations.

VB format: `Function RSDLLibeot (ByVal ud%, ByVal v%, ibsta%, iberr%, ibcntl&) As Integer`

C format: `void WINAPI RSDLLibsre( short ud, short v, short far *ibsta, short far *iberr, unsigned long far *ibcntl)`

C format (UNIX): `short RSDLLibsre( short ud, short v, short *ibsta, short *iberr, unsigned long *ibcntl)`

Parameters:		
	`ud`	Device handle
	`v`	0 - no END message 1 – send END message

Example: `RSDLLibeot (ud, 1, ibsta, iberr, ibcntl)`

If the END message is disabled, the data of a command can be sent with several successive calls of write functions. The END message must be enabled again before sending the last data block.

RSDLLibrsp

This function performs a serial poll and provides the status byte of the device.

VB format: `Function RSDLLibrsp(ByVal ud%, spr%, ibsta%, iberr%, ibcntl&) As Integer`

C format: `void WINAPI RSDLLibrsp( short ud, char far* spr, short far *ibsta, short far *iberr, unsigned long far *ibcntl)`

C format (UNIX): `short RSDLLibrsp( short ud, char *spr, short *ibsta, short *iberr, unsigned long *ibcntl)`

Parameters:		
	`ud`	Device handle
	`spr`	Pointer to status byte

Example: `RSDLLibrsp(ud, spr, ibsta, iberr, ibcntl)`

RSDLLibonl

This function switches the device to 'online' or 'offline' mode. When it is switched to ‘offline’ mode, the interface is released and the device handle becomes invalid. By calling RSDLLibfind again, the communication is set up again.

VB format: `Function RSDLLibonl (ByVal ud%, ByVal v%, ibsta%, iberr%, ibcntl&) As Integer`

C format: `void WINAPI RSDLLibonl( short ud, short v, short far *ibsta, short far *iberr, unsigned long far *ibcntl)`

C format: `short RSDLLibonl( short ud, short v, short *ibsta, short *iberr, unsigned long *ibcntl)`

Parameters:

`ud`	Device handle
`v`	Device state 0 - local 1 - remote

Example: `RSDLLibonl(ud, 0, ibsta, iberr, ibcntl)`

RSDLLTestSRQ

This function checks the status of the SRQ bit.

VB format: `Function RSDLLTestSrq (ByVal ud%, Result%, ibsta%, iberr%, ibcntl&) As Integer`

C format: `void WINAPI RSDLLTestSrq( short ud, short far *result, short far *ibsta, short far *iberr, unsigned long far *ibcntl)`

C format (UNIX): `short RSDLLTestSrq( short ud, short *result, short *ibsta, short *iberr, unsigned long *ibcntl)`

Parameters:

`ud`	Device handle
`result`	Reference to an integer value in which the library returns the status of the SRQ bit 0 - no SRQ 1 - SRQ active, device requests service

Example: `RSDLLTestSrq (ud, result%, ibsta, iberr, ibcntl)`

This function corresponds to the function `RSDLLWaitSrq`. The only difference is that `RSDLLTestSRQ` immediately returns the current status of the SRQ bit, whereas `RSDLLWaitSrq` waits for an SRQ to occur.

RSDLLWaitSrq

This function waits until the device triggers an SRQ with the handle `ud`.

VB format: `Function RSDLLWaitSrq (ByVal ud%, Result%, ibsta%, iberr%, ibcntl&) As Integer`

C format: `void WINAPI RSDLLWaitSrq( short ud, short far *result, short far *ibsta, short far *iberr, unsigned long far *ibcntl)`

C format (UNIX): `short RSDLLWaitSrq( short ud, short *result, short *ibsta, short *iberr, unsigned long *ibcntl)`

Parameters:

`ud`	Device handle
`result`	Reference to an integer value in which the library returns the status of the SRQ bit 0 - No SRQ occurred during the timeout 1 - SRQ occurred during the timeout

Example: `RSDLLWaitSrq( ud, result, ibsta, iberr, ibcntl );`

The function waits until one of the following two events occurs.

- The measuring instrument triggers an SRQ.
- No SRQ occurs during the timeout defined with `RSDLLibtmo()`.

RSDLLSwapBytes

This function changes the display of binary numbers on non-Intel platforms.

VB format: Not provided at present since it is required only on non-Intel platforms.

C format: `void WINAPI RSDLLSwapBytes( void far *pArray, const long size, const long count)`

C format (UNIX): `void RSDLLSwapBytes( void *pArray, const long size, const long count)`

Parameters:

`pArray`	Array in which modifications are made
`size`	Size of a single element in `pArray`
`count`	Number of elements in `pArray`

Example: `RSDLLSwapBytes( Buffer, sizeof(float), ibcntl/sizeof(float))`

This function swaps the display of various elements from *Big Endian* to *Little Endian* and vice versa. It is expected that a coherent storage area of elements of the same file type (`size` byte) is transferred to `pArray`. This function has no effect on Intel platforms.

Different types of processor architecture store data in different byte sequences. For example, Intel processors store data in the reverse order of Motorola processors. Comparison of byte sequences:

Byte sequence	**Use in**	**Display in memory**	**Description**
Big Endian	Motorola processors, network standard	Most significant byte at least significant address	The *most significant* byte is at the left end of the word.
Little Endian	Intel processors	Least significant byte at least significant address	The *most significant* byte is at the right end of the word.

Programming via the RSIB Protocol

Visual Basic

Programming tips:

- Access to the functions of the RSIB.DLL

  To create Visual Basic control applications, the file RSIB.BAS must be added to a project for 16-bit Basic programs and the file RSIB32.BAS for 32-bit Basic programs (D:\R_S\INSTR\RSIB) so that the functions of the RSIB.DLL or RSIB32.DLL can be accessed.

- Generating a response buffer

  Prior to calling the functions `RSDLLibrd()` and `RSDLLilrd()`, a string of sufficient length must be generated. This is possible either by defining the string or using the command `Space$()`.

  Generating a string of the length 100:

  ```
  - Dim Response as String * 100
  - Dim Response as String
    Response = Space$(100)
  ```

  If a response is to be output as a string from the measuring instrument, the appended blanks can be removed using the Visual Basic Function RTrim().

  Example:

  ```
  Response = Space$(100)
  Call RSDLLibrd(ud, Response, ibsta, iberr, ibcntl)
  Response = RTrim(Response)
  ' Output of Response
  ```

- Reading out trace data in real format

  Using the function declarations in the file RSIB.BAS or RSIB32.BAS the responses of the device can be assigned to one string only. If the data are to be read into an array with float values, the header and the useful data must be read out with separate function calls.

  Example of a header

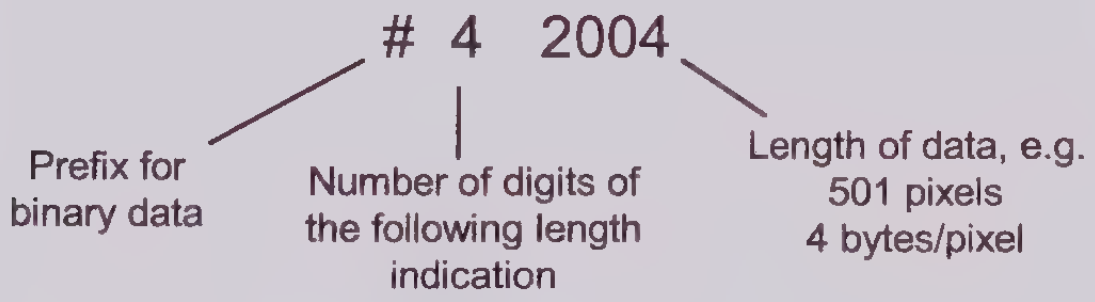

# 4 2004
Prefix for binary data
Number of digits of the following length indication
Length of data, e.g. 501 pixels 4 bytes/pixel

  In order to enable the trace data to be directly read into a float array, a special function declaration must be created.

  ```
  Declare Function RSDLLilrdTraceReal Lib "rsib32.dll" Alias "RSDLLilrd"
  (ByVal ud%, Rd As Single, ByVal Cnt&, ibsta%, iberr%, ibcntl&) As Integer
  ```

Example:

```
Dim ibsta As Integer                ' Status variable
Dim iberr As Integer                ' Error variable
Dim ibcntl As Long                  ' Count variable
Dim ud As Integer                   ' Handle for measuring instrument
Dim Result As String                ' Buffer for simple results
Dim Digits As Byte                  ' Number of digits of length indication
Dim TraceBytes As Long              ' Length of trace data in bytes
Dim TraceData(501) As Single        ' Buffer for floating point
                                    ' Binary data

' Set up connection to instrument
ud = RSDLLibfind("89.10.38.97", ibsta, iberr, ibcntl)

' Query trace data in real format
Call RSDLLibwrt(ud, "FORM:DATA REAL,32", ibsta, iberr, ibcntl)
Call RSDLLibwrt(ud, "TRACE? TRACE1", ibsta, iberr, ibcntl)

'Read number of digits of length indication
Result = Space$(20)
Call RSDLLilrd(ud, Result, 2, ibsta, iberr, ibcntl)
Digits = Val(Mid$(Result, 2, 1))

'Read length indication
Result = Space$(20)
Call RSDLLilrd(ud, Result, Digits, ibsta, iberr, ibcntl)
TraceBytes = Val(Left$(Result, Digits))    'and store

' Read out trace data
Call RSDLLilrdTraceReal(ud, TraceData(0), TraceBytes, ibsta, iberr,ibcntl)
```

Programming examples:

- In this example, the start frequency of the instrument is queried.

```
Dim ibsta As Integer     ' Status variable
Dim iberr As Integer     ' Error variable
Dim ibcntl As Long       ' Count variable
Dim ud As Integer        ' Handle for measuring instrument
Dim Response As String   ' Response string

' Set up connection to measuring instrument
ud = RSDLLibfind("89.10.38.97", ibsta, iberr, ibcntl)
If (ud < 0) Then
   ' Error treatment
End If

' Send query command
Call RSDLLibwrt(ud, "FREQ:START?", ibsta, iberr, ibcntl)

' Provide space for response
Response = Space$(100)

' Read response from measuring instrument
Call RSDLLibrd(ud, Response, ibsta, iberr, ibcntl)
```

- In this example, a Save/Recall of the instrument setups is performed.

```
      Dim ibsta As Integer      ' Status variable
      Dim iberr As Integer      ' Error variable
      Dim ibcntl As Long        ' Count variable
      Dim ud As Integer         ' Handle for measuring instrument
      Dim Cmd As String         ' Command string

      ' Set up connection to measuring instrument
      ud = RSDLLibfind("89.10.38.97", ibsta, iberr, ibcntl)
      If (ud < 0) Then
         ' Error treatment
      End If

      ' Request instrument settings
      Cmd = "SYST:SET?"
      Call RSDLLibwrt(ud, Cmd, ibsta, iberr, ibcntl)

  ' Store instrument response in file
      Call RSDLLibrdf(ud, "C:\db.sav", ibsta, iberr, ibcntl)

      ' Reset instrument
      Call RSDLLibwrt(ud, "*RST", ibsta, iberr, ibcntl)

      ' and restore the previous settings
      ' to this end disable the END message
      Call RSDLLibeot(ud, 0, ibsta, iberr, ibcntl)
      ' first send off command
      Call RSDLLibwrt(ud, "SYST:SET ", ibsta, iberr, ibcntl)
      ' enable the END message again
      Call RSDLLibeot(ud, 1, ibsta, iberr, ibcntl)
      ' and send the data
      Call RSDLLibwrtf(ud, "C:\db.sav", ibsta, iberr, ibcntl)
```

Visual Basic for Applications (Winword and Excel)

Programming tips:

The programming language Visual Basic for Applications (VBA) is supported as a macro language by various manufacturers. The programs Winword and Excel use this language for the versions Winword 97 or Excel 5.0 and higher.
For macros created with Visual Basic for Applications, the same tips are valid as for Visual Basic Applications.

Programming example:

- Using the macro `QueryMaxPeak`, a single sweep with subsequent query of the maximum peak is performed. The result is entered in a Winword or Excel document.

```
Sub QueryMaxPeak()

    Dim ibsta As Integer     ' Status variable
    Dim iberr As Integer     ' Error variable
    Dim ibcntl As Long       ' transferred characters
    Dim ud As Integer        ' Unit Descriptor (handle)for instrument
    Dim Response As String   ' Response string

    ' Set up connection to measuring instrument
    ud = RSDLLibfind("89.10.38.97", ibsta, iberr, ibcntl)
    If (ud < 0) Then
      Call MsgBox("Device with address 89.10.38.97 could" & _
                  "not be found", vbExclamation)
      End
    End If

    ' Determine maximum peak in the range 1-2MHZ
    Call RSDLLibwrt(ud, "*RST", ibsta, iberr, ibcntl)
    Call RSDLLibwrt(ud, "INIT:CONT OFF", ibsta, iberr, ibcntl)
    Call RSDLLibwrt(ud, "FREQ:START 1MHZ", ibsta, iberr, ibcntl)
    Call RSDLLibwrt(ud, "FREQ:STOP 2MHZ", ibsta, iberr, ibcntl)
    Call RSDLLibwrt(ud, "INIT:IMM;*WAI", ibsta, iberr, ibcntl)
    Call RSDLLibwrt(ud, "CALC:MARK:MAX;Y?", ibsta, iberr, ibcntl)
    Response = Space$(100)
    Call RSDLLibrd(ud, Response, ibsta, iberr, ibcntl)
    Response = RTrim(Response) ' Cut off space

    ' Insert value in current document (Winword)
    Selection.InsertBefore (Response)
    Selection.Collapse (wdCollapseEnd)

    ' Terminate connection to measuring instrument
    Call RSDLLibonl(ud, 0, ibsta, iberr, ibcntl)

End Sub
```

The entry of the peak value in the Winword document can be replaced as follows for Excel:

```
    ' Insert value in current document (Excel)
    ActiveCell.FormulaR1C1 = Response
```

C / C++

Programming tips:

- Access to the functions of the RSIB32.DLL (Windows platforms)

  The functions of the `RSIB32.DLL` are declared in the header file `RSIB.H`. The DLL functions can be linked to a C/C++ program in different ways.

  1. Enter one of the supplied import libraries (`RSIB.LIB or RSIB32.LIB`) into the linker options.
  2. Load the library using the function `LoadLibrary()` during runtime and determine the function pointers of the DLL functions using `GetProcAddress()`. Before the end of the program, the `RSIB.DLL` must be unloaded again using the function `FreeLibrary()`.

  When import libraries are used, the DLL is automatically loaded immediately before the application is started. At the end of the program, the DLL is unloaded again unless it is still used by other applications.

- Access to librsib.so functions (UNIX platforms)

  The functions of `librsib.so` are declared in the header file `RSIB.H`. Uppercase/lowercase characters for file names are typically observed under UNIX. The library functions are linked to a C/C++ program by entering the `-lrsib` linker option.

  The *shared library* `librsib.so` is automatically loaded on starting the application. The accessibility (for example via standard path) of the library must be ensured. Refer to the beginning of this main chapter under "UNIX Environment".

- Query of strings

  If instrument responses are to be further processed as strings, a zero termination must be appended.

  Example:

  ```
      char buffer[100];
      ...
      RSDLLibrd( ud, buffer, &ibsta, &iberr, &ibcntl );
      buffer[ibcntl] = 0;
  ```

Programming example:

In the following C program example, a single sweep is started on the device with the IP address 89.10.38.97 and subsequently a marker is set to maximum level. Prior to the search for maximum, a synchronization to the end of the sweep is performed. For this purpose the command `"*OPC"` (Operation complete) is used to create a service request at the end of the sweep, for which the control program waits with the function `RSDLLWaitSrq()`. Then the maximum is determined (`"CALC:MARK:MAX"`) and the level read out (`"Y?"`).

```
#define MAX_RESP_LEN 100

short           ibsta, iberr;
unsigned long   ibcntl;
short           ud;
short           srq;
char            MaxPegel[MAX_RESP_LEN];
char            spr;

// Determine handle for instrument
ud = RSDLLibfind( "89.10.38.97", &ibsta, &iberr, &ibcntl );

// if instrument exists
if ( ud >= 0 )
{
  // Set timeout for RSDLLWaitSrq() to 10 seconds
  RSDLLibtmo( ud, 10, &ibsta, &iberr, &ibcntl );

  // Activate SRQ generation via event status register (ESR)
  // and enable ESB bit in SRE register
  RSDLLibwrt( ud, "*ESE 1;*SRE 32", &ibsta, &iberr, &ibcntl );

  // Set single sweep, trigger sweep and use "*OPC" to cause
  // the generation of a service request at the end of the sweep
  RSDLLibwrt( ud, "INIT:CONT off;INIT;*OPC", &ibsta, &iberr, &ibcntl );

  // Wait for SRQ (end of sweep)
  RSDLLWaitSrq( ud, &srq, &ibsta, &iberr, &ibcntl );

  // Clear RQS/MSS bit
  RSDLLibrsp( ud, &spr, &ibsta, &iberr, &ibcntl );

  // if sweep is terminated
  if (srq)
  {
    // then set marker to first maximum and query the level
    RSDLLibwrt( ud, "CALC:MARK:MAX;Y?", &ibsta, &iberr, &ibcntl );
    RSDLLilrd( ud, MaxPegel, MAX_RESP_LEN, &ibsta, &iberr, &ibcntl );
    MaxPegel[ibcntl] = 0;
  }
  // End connection to instrument
  RSDLLibonl (ud, 0, &ibsta, &iberr, &ibcntl ) ;
}
else
{
  ; // Error Instrument not found
}
```

10 Index

Note: *All softkeys are listed alphabetically under keyword "Softkey" with their names. The page numbers 4.xxx refer to the detailed description of the softkeys in chapter 4. Generally, the number of the page in chapter 6 containing the equivalent remote control command is given in addition.*
A list of softkeys and equivalent remote control commands or command sequences is given in chapter 6, section "Table of Softkeys with IEC/IEEE-Bus Command Assignment". Chapter 6 also contains an alphabetical list of all remote control commands.

******

* (enhancement label) ... 3.7
* (enhancement lable) ... 4.11-4

0

0 to 9 (key) ... 3.12

1

1 - 2 (trace info) ... 4.11-14
1 - 3 (trace info) ... 4.11-14

2

20.4 MHz Out ... 8.12

7

75 Ω (enhancement lable) ... 3.7

A

Abort
  recording of correction data ... 4.12-2
AC supply connection ... 1.18
ACP measurement ... 4.16-7
Addressed command ... 8.5
Adjacent-channel power
  number of channels ... 4.16-14
Administrator function ... 1.21
AF demodulation ... 4.14-9
AF OUTPUT ... 8.2
AM demodulation ... 4.14-10
AM modulation ... 4.22-17
AM modulation depth ... 4.16-34
Amplitude ... 4.7-1
Amplitude probability distribution function ... 4.16-28
Amplitude statistics ... 4.16-26
Analyzer mode ... 4.5.1
Annotation ... 4.18-4
Anschlusskalibrierung ... 6.1-113
AP (trace info) ... 3.6
APD function ... 4.16-28
Ascii # ... 5.14
Attenuation ... 4.7-3
Autopeak detector ... 4.11-11
AUX CONTROL
  interface ... 8.13
AUX CONTROL connector ... 8.13
AV (trace info) ... 3.6
Average detector ... 4.11-10, 4.11-13
Averaging ... 4.11-3, 4.16-5
  continuous sweep ... 4.11-3
  lin/log ... 4.11-5
  single sweep ... 4.11-3
  sweep count ... 4.11-3
AVG (trace info) ... 3.6

B

BACK (key) ... 3.12
Bandwidth
  occupied ... 4.16-23
Baud rate ... 4.19-12
Befehl
  Zuordnung Softkey ... 6.4-1
Block data ... 5.14
Boolean parameter ... 5.13
Brightness ... 4.18-6
Brightness, Screen ... 4.21-8

C

Calibration
  functioning ... 4.22-13, 4.23-10
  reflection measurement ... 4.23-9
  reflexion measurement ... 4.22-12
  transmission measurement ... 4.22-5, 4.23-3
Calibration results ... 4.12-3
CANCEL (key) ... 3.12
CCDF function ... 4.16-28
CCIR 473-4 ... 4.10-8
CCVS signal ... 4.10-8
Center frequency ... 4.5-2
  Step size ... 4.5-2
Channel
  power ... 4.16-17
  bandwidth ... 4.16-15, 4.16-23, 4.16-33
  number ... 4.16-14
  spacing ... 4.16-16
Channel power measurement ... 4.16-9
Characters, special ... 6.1-2
Clear/Write mode ... 4.11-2
CLWR (trace info) ... 3.6
Colon ... 5.14
Color ... 4.18-6, 4.21-6
Color printout ... 4.21-6
COM interface ... 4.19-12, 8.7
Comma ... 5.14

- *Command*
  - *#* 5.14
  - *addressed* 8.5
  - *colon* 5.14
  - *comma* 5.14
  - *description* 6.1-1
  - *header* 5.10
  - *line* 5.12
  - *long form* 5.11
  - *overlapping execution* 5.17
  - *programming examples* 7.1
  - *query* 5.12
  - *question mark* 5.12, 5.14
  - *quotation mark* 5.14
  - *recognition* 5.16
  - *sequence* 5.17
  - *short form* 5.11
  - *structure* 5.9
  - *suffix* 5.11
  - *syntax elements* 5.14
  - *univeral* 8.5
  - *white space* 5.14
- *Common commands* 6.1-4
- *CONDition register part* 5.19
- *Configuration* 4.19-1
  - *save* 4.20-1
- *Continue single sweep* 4.9-2
- *Continuous sweep* 4.9-1
- *Control*
  - *output level* 4.22-3
- *Control characters* 8.9
- *Copy*
  - *file* 4.20-15
  - *limit line* 4.17-5
  - *trace* 4.11-8
- *Correction*
  - *inherent noise* 4.16-11
- *Correction data* 4.12-1
- *Correction of entry* 3.18
- *Correction values*
  - *normalization* 4.22-1, 4.23-1
- *Counter resolution* 4.13-4
- *Coupling*
  - *frequency of diagrams* 4.18-3
  - *reference level of diagramms* 4.18-3
- *Create directory* 4.20-14
- *Cumulative distribution function* 4.16-28

D

- *Date* 4.18-4
  - *input* 4.19-15
- *DCL* 5.16
- *Decimal point* 3.12
- *Default*
  - *display settings* 4.18-4
  - *scalings of x- and y-axis* 4.16-30
- *Delay, gate signal* 4.10-6
- *Delete*
  - *file* 4.20-15
  - *limit line* 4.17-5
- *Demodulation* 4.14-9
- *Detector*
  - *autopeak* 4.11-9
  - *average* 4.11-10
  - *max peak* 4.11-9
  - *min peak* 4.11-9
  - *quasipeak* 4.11-10
  - *RMS* 4.11-10
  - *sample* 4.11-9
- *Diskette, format* 4.20-17
- *Display*
  - *brightness* 4.18-6
  - *color* 4.18-6
  - *date* 4.18-4
  - *deactivation during single sweep* 4.9-3
  - *power-save mode* 1.20, 4.18-5
  - *saturation* 4.18-6
  - *time* 4.18-4
  - *tint* 4.18-6
  - *title* 4.18-4
- *Display line* 4.17-11
- *Display mode*
  - *full screen* 3.9, 4.18-2
  - *split screen* 3.9, 4.18-2
- *Display range*
  - *frequency* 4.5-2
  - *level* 4.7-1
  - *span* 4.6-1
- *Distribution function* 4.16-28
- *Double dagger* 5.14

E

- *Editing*
  - *limit line* 4.17-6
  - *parameter* 3.17
  - *table* 3.24
- *Electrostatic discharge* 1.16
- *ENABle register part* 5.19
- *Enabling the front panel keys* 4.3-1
- *Enhancement labels* 3.7
- *ENTER (key)* 3.12
- *Entry*
  - *abort* 3.12
  - *activate* 3.15, 3.26
  - *correct* 3.18
  - *terminate* 3.12
- *Error messages* 4.19-23, 9.1
- *Error variable - iberr* 4.24-38
- *Error-queue query* 5.33
- *ESC (key)* 3.12
- *ESE (event status enable register)* 5.22
- *ESR (event status register)* 5.22
- *EVENt register part* 5.19
- *Event status enable register (ESE)* 5.22
- *Event status register (ESR)* 5.22
- *EXT (enhancement lable)* 3.7
- *EXT TRIGGER/GATE input* 4.10-2, 8.11
- *External generator* 4.23-1
- *External noise source* 4.19-2

F

- *Fast power measurement* 4.16-12
- *Field, first or second* 4.10-8
- *File*
  - *copy* 4.20-15
  - *delete* 4.20-15
  - *rename* 4.20-15
  - *sort* 4.20-16
- *Firmware update* 4.19-27
- *Firmware version* 4.19-22
- *FM demodulation* 4.14-10
- *FM modulation* 4.22-17
- *Free-run sweep* 4.10-1
- *Frequency* 4.5.1
  - *axis labelling* 3.4
  - *center* 4.5-2

- counter ... 4.13-4
- coupling of diagrams ... 4.18-3
- display window ... 4.5.1, 4.6-1
- Line ... 4.17-12
- offset ... 4.5-5
- Offset (ext. generator) ... 4.23-11
- offset (tracking generator) ... 4.22-14
- span ... 4.6-1
- start ... 4.5-4
- stop ... 4.5-4
- switching off display ... 4.18-4

Frequency-converting measurements ... 4.22-14, 4.23-11
FRQ (enhancement lable) ... 3.7
Full screen ... 3.9, 4.18-2
Full span ... 4.6-1

G

GAT (enhancement lable) ... 3.7
Gate
- delay ... 4.10-6
- external/internal ... 4.10-4
- length ... 4.10-6

GET (Group Execute Trigger) ... 5.16
Getting Started with the Instrument ... 1.16
GHz/-dBm (key) ... 3.12

H

Hardcopy
- screen ... 4.21-2

Hardware Adjustment ... 4.19-27
Hardware settings, indication ... 3.3
Header ... 5.10
Help line editor ... 3.21
Horizontal sync signal ... 4.10-8
Hotkey
- AUDIO ... 4.2-1
- DEMOD ... 4.2-1
- MRECEIVER ... 4.2-2
- NETWORK ... 4.2-2
- NETWORK ... 4.22-1
- PWR METER ... 4.2-1
- PWR METER ... 6.1-173
- RF LEVEL ... 4.2-1
- SCREEN A/B ... 4.2-2, 6.1-100
- SPECTRUM ... 4.2-1, 4.5.1, 6.1-117

Hue, Screen ... 4.21-8
Hz/dB. (key) ... 3.12

I

I/Q modulation ... 4.22-18
IEC Bus
- Interface ... 8.12

IEC/IEEE bus
- address ... 4.19-10
- command description ... 6.1-1
- interface ... 8.3
- interface functions ... 8.4
- programming examples ... 7.1

IFOVL ... 3.5
Impedance of input ... 4.7-4
Indication
- hardware settings ... 3.3
- instrument settings ... 3.7
- marker information ... 3.4

Inherent noise, Correction ... 4.16-11
Input
- EXT TRIGGER/GATE ... 4.10-2, 8.11
- REF IN ... 8.11

Input impedance ... 4.7-4
Interface functions
- IEC/IEEE bus ... 8.4

Interfaces ... 8.2
Intermodulation product ... 4.16-35
Interrupt ... 5.32
IST flag ... 5.22

K

Key
- 0 to 9 ... 3.12
- AMPT ... 4.7-1
- BACK ... 3.12
- CAL ... 4.12-1
- CANCEL ... 3.12
- DISP ... 4.18-1
- ENTER ... 3.12
- ESC ... 3.12, 6.1-20
- FILE ... 4.20-1
- FREQ ... 4.5.1
- GHz/-dBm ... 3.12
- Hz/dB ... 3.12
- kHz/dB ... 3.12
- LINES ... 4.17-2, 4.17-11
- MEAS ... 4.16-1
- MHz/dBm ... 3.12
- MKR ... 4.13-1
- MKR FCTN ... 4.14-1
- MKR to ... 4.15-1
- PRESET ... 6.1-7, 6.2-213
- SETUP ... 4.19-1
- SPAN ... 4.6-1
- spinwheel ... 3.13
- SWEEP ... 4.9-1
- TRACE ... 4.11-1
- TRIG ... 4.10-1

keyboard
- connect ... 1.22

Keyboard
- connector ... 8.2

kHz/dB (key) ... 3.12

L

LAN Interface ... 4.24-1
LAN-Interface ... 4.24-1
Level ... 4.7-1
- display range ... 4.7-1
- offset (phase noise) ... 4.14-5
- offset (tracking generator) ... 4.22-3
- range ... 4.7-1
- reference ... 4.7-1

Limit
- ACP measurement ... 4.16-19
- evaluation range ... 4.16-4
- probability range ... 4.16-30

Limit check ... 4.17-4
- ACP measurement ... 4.16-19

Limit Check ... 4.17-4
Limit line
- copy ... 4.17-5
- delete ... 4.17-5
- domain ... 4.17-7
- edit ... 4.17-6

  - limit check 4.17-4
  - offset 4.17-5
  - save 4.17-10
  - scaling 4.17-8
  - select 4.17-3
  - shift 4.17-10
  - unit 4.17-8
  - value 4.17-10
- Line
  - Frequency (Frequency Line 1, 2) 4.17-12
  - limit 4.17-3
  - reference (tracking generator) 4.22-8, 4.23-6
  - threshold 4.15-4
  - Time (Time Line 1, 2) 4.17-12
- Line system 4.10-8
- Lines 4.17-12
- LO exclude 4.15-8
- Login/out (XP controller) 1.21
- Logo 4.18-4
- Lower case 6.1-2
- LPT interface 8.6

M

- Maintenance 8.1
- Manual operation
  - return to 5.4, 5.6
  - switch to 4.3-1
- Marker 4.13-1
  - center frequency to 4.15-2
  - CF stepsize to 4.15-5
  - indication 3.4
  - N dB Down 4.14-6
  - normal 4.13-1
  - peak 4.14-2, 4.15-2
  - reference level to 4.15-2
  - search limit 4.15-3
  - signal track 4.5-5
  - to trace 4.13-3, 4.14-10
  - zoom 4.13-7
- Max hold 4.11-2
- Max peak detector 4.11-12
- MAXH (trace info) 3.6
- Maximum peak value 4.16-5
- Maximum search 4.15-2
- Maximum value 4.16-3
- Mean power (GSM burst) 4.16-4
- Mean value 4.16-4
- Measurement
  - frequency-converting 4.22-14, 4.23-11
  - reflection 4.23-9
  - reflexion 4.22-11
  - transmission 4.22-4, 4.23-3
- Measurement example
  - ACP with user-specific channel configuration 4.16-21
  - adjacent-channel power for a specific standard 4.16-20
  - CCDF of a IS95 BTS signal 4.16-31
  - occupied bandwidth of a PDC signal 4.16-25
  - signal/noise power density (C/No) of an IS95 CDMA signal 4.16-22
- Measurement of Carrier/Noise Ratio C/N and C/N_o 4.16-32
- Measurement, save 4.20-1
- Menu
  - call 3.11
  - change keys 3.11
- Messages 4.19-23
  - acknowledgement 3.8
- MHz/dBm (key) 3.12
- MI (trace info) 3.6
- Min hold 4.11-5
- Min peak detector 4.11-12
- MINH (trace info) 3.6
- Minimum search 4.15-5
- Mobile radio standard 4.16-10
- Mode
  - analyzer 4.5.1
- Modulation
  - external (tracking generator) 4.22-16
- Modulation depth 4.16-34
- Monitor
  - connection 1.24
  - connector 8.10
- Mouse 8.11
  - connector 8.11
- Mouse connection 8.11
- Mouse connector 8.2

N

- Network 4.22-1
- Noise
  - source, external 4.19-2
- Noise measurement 4.14-2
- NOISE SOURCE 8.10
- Noise, Correction 4.16-11
- Normalization 4.22-7, 4.23-5
- NTRansition register part 5.19
- Numerical values (command) 5.13

O

- Occupied bandwidth 4.16-23
- Offset
  - frequency 4.5-5
  - frequency (ext. generator) 4.23-11
  - gate signal 4.10-6
  - level (tracking generator) 4.22-3
  - limit line 4.17-5
  - phase noise 4.14-5
  - reference level 4.7-4
  - trigger 4.10-2
- Operating mode
  - analyzer 4.5.1
- Operating time 4.19-22
- Option
  - FSU-B9 – Tracking Generator 4.22-1
- Order number 4.19-21
- Output
  - AF OUTPUT 8.2
  - IF 20.4 MHz Out 8.12
  - noise source control 8.10
  - REF OUT 8.11
- Output level
  - control 4.22-3
- OVEN 3.5
- Overwrite mode 4.11-2
- OVLD 3.5, 4.22-13, 4.23-10

P

- Packing 8.1
- Parallel poll 5.33
- Parallel poll enable register (PPE) 5.22
- Parameter
  - block data 5.14
  - boolean 5.13
  - editing 3.17

- numerical values 5.13
- selection 3.14
- string 5.14
- text 5.14

Password
- service functions 4.19-25
- Windows XP 1.21

Path 4.20-14
Peak search 4.14-2, 4.15-2
Phase noise measurement 4.14-4
PK (trace info) 3.6
Plotter
- connection 4.21-3

Polarity
- external trigger/gate 4.10-5
- trigger edge 4.10-2
- video 4.10-8

Power bandwidth percentage 4.16-23
Power cables 8.1
Power measurement 4.16-1
- CP/ACP 4.16-7
- Fast 4.16-12
- occupied bandwidth 4.16-23
- signal amplitude statistics 4.16-26
- Time domain 4.16-2
- trace 4.16-19

Power, mean 4.16-4
Power-save mode
- display 1.20
- hard disk 1.20

PPE (parallel poll enable register) 5.22
Preamplifier 4.19-3
Preparing the Instrument for Operation 1.16
Pretrigger 4.10-2
Print
- start 4.21-2

PRINT SCREEN (Gate Signal) 4.10-6
printer
- connect 1.25

Printer
- configuration 4.21-1
- connection 4.21-3, 8.6
- interface 8.6

PRN (enhancement lable) 3.7
Probe Power connector 8.2
PTRansition register part 5.19
Putting into operation
- AC supply connection 1.18

Q

QP (trace info) 3.6
Quasipeak detector 4.11-10
Query 5.12, 5.33
Question mark 5.12, 5.14
Quotation mark 5.14

R

Rackmounting 1.17
Recording the correction data 4.12-1
Reference
- dataset (tracking generator) 4.22-13
- external 4.19-2
- fixed 4.13-5
- frequency 4.13-5
- level to marker level 4.15-2
- line (tracking generator) 4.22-8, 4.23-6
- position for normalization 4.23-6

Reference level 4.7-1
- channel power 4.16-12
- coupling of diagrams 4.18-3
- offset 4.7-4
- position 4.7-4
- to marker level 4.15-2

Reference point
- frequency 4.13-5
- frequency (phase noise) 4.14-6
- level 4.13-5
  - offset 4.13-5
- level (phase noise) 4.14-5
  - offset 4.14-5
- time 4.13-6
- x axis 4.13-6

Reference value
- channel power 4.16-11
- time domain power 4.16-5

Referenz
- Datensatz (Mitlaufgenerator) 4.23-10

Reflection measurement 4.22-11, 4.23-9
Remote control
- basics 5.1
- IEC/IEEE bus 5.4
- RS-232-C 5.5
- switch over 5.3

Remote Control
- RSIB 4.24-35

Rename
- directory 4.20-15
- file 4.20-15

Reset
- status reporting system 5.34

Resolution counter 4.13-4
RF ATTEN MANUAL 4.7-5
RF attenuation 4.7-3
RM (trace info) 3.6
RMS detector 4.11-10, 4.11-12
RMS value 4.16-3
RS-232-C
- configuration 4.19-12
- interface 8.7
- transmission parameters 8.8

S

SA (trace info) 3.6
Sample detector 4.11-12
Sample number 4.16-29
Saturation 4.18-6
Saturation, Screen 4.21-8
Save
- configuration 4.20-1
- limit line 4.17-10
- measurement 4.20-1

Scalar reflection measurement 4.22-11, 4.23-9
Scaling 4.7-2
- level axis 4.7-4
- limit line 4.17-8
- x- and y-axis (signal statistic) 4.16-29

SCPI
- conformity information 6.1-1
- introduction 5.9
- version 5.1

Screen 3.1
- brightness 4.21-8
- full screen 4.18-2
- hue 4.21-8
- Saturation 4.21-8
- split screen 3.9, 4.18-2

  - *subdivision* 3.2
- *Search*
  - *bandwidth* 4.5-5
  - *minimum* 4.15-5
  - *peak* 4.14-2, 4.15-2
  - *PEAK EXCURSION* 4.14-8, 4.15-6
  - *range* 4.15-3
- *Selftest* 4.19-26
- *Sensitivity*
  - *APD measurement* 4.16-30
  - *CCDF measurement* 4.16-30
- *Serial interface* 8.7
  - *configuration* 4.19-12
- *Serial number* 4.19-21
- *Serial poll* 5.32
- *Service functions* 4.19-24
- *Service Pack* 1.21
- *Service request (SRQ)* 5.21, 5.32
- *Service request enable register (SRE)* 5.21
- *Setting Up the Instrument* 1.16
- *Settings, indication* 3.7
- *Setup* 4.19-1
  - *general* 4.19-10
- *SGL (enhancement lable)* 3.7
- *Sign (key)* 3.12
- *Signal amplitude statistics* 4.16-26
- *Signal count* 4.13-4
- *Signal tracking* 4.5-5
  - *search bandwidth* 4.5-5
- *Single sweep* 4.9-1
- *Soft key*
  - ACLR 6.1-93
  - BAND CLASS 6.1-93
  - CCDF 6.1-93
  - *CHAN TABLE HEADER* 6.1-93
  - *CHAN TABLE VALUES* 6.1-93
  - CODE CHAN AUTOSEARCH 6.1-93
  - CODE CHAN PREDEFINED 6.1-93
  - CODE DOM ANALYZER 6.1-93
  - COPY CHAN CONF TABLE 6.1-93
  - DEL CHAN CONF TABLE 6.1-93
  - *EDIT CHAN CONF TABLE* 6.1-93
  - *NEW CHAN CONF TABLE* 6.1-93
  - OCCUPIED BANDWIDTH 6.1-93
  - POWER 6.1-93
  - SPECTRUM EM MASK 6.1-93
- *Softkey*
  - *% POWER BANDWIDTH* 4.16-23, 6.1-179
  - *= CENTER* 4.5-3, 4.5-4
  - *= MARKER* 4.5-3, 4.5-4
  - *0.1 * RBW* 4.5-3, 6.1-160, 6.1-161
  - *0.1 * SPAN* 4.5-2, 6.1-160, 6.1-161
  - *0.5 * RBW* 4.5-3, 6.1-160, 6.1-161
  - *0.5 * SPAN* 4.5-2, 6.1-160, 6.1-161
  - *10 dB MIN ON/OFF* 6.1-114
  - *ABSOLUTE PEAK/MIN* 6.1-12, 6.1-13
  - *ACP LIMIT CHECK* 4.16-19, 6.1-22
  - *ACP REF SETTINGS* 4.16-16
  - *ACP REF SETTINGS* 6.1-178
  - *ADJ CHAN BANDWIDTH* 4.16-15, 6.1-177
  - *ADJ CHAN SPACING* 4.16-16, 6.1-176
  - *ADJUST REF LVL* 4.16-12, 4.16-24, 6.1-179
  - *ADJUST SETTINGS* 4.16-30, 4.16-33, 6.1-86, 6.1-179
  - *ADJUST SETTINGS (occupied bandwidth)* 4.16-24
  - *ADJUST SETTINGS (power measurements)* 4.16-18
  - *ALL MARKER OFF* 4.13-7, 6.1-10, 6.1-40
  - *AM* 4.14-10, 6.1-52, 6.2-223
  - *AMPERE* 4.7-2, 6.1-91, 6.2-226
  - *ANALOG I/Q* 6.1-115
  - *ANNOTATION ON/OFF* 4.18-4, 6.1-98
  - *APD ON/OFF* 4.16-28, 6.1-85, 6.1-88
  - *area* 3.10
  - *ASCII FILE EXPORT* 4.11-6, 4.20-17, 6.1-105, 6.1-126
  - *AUTO SELECT* 4.11-11, 6.1-157
  - *AVERAGE* 4.11-3, 6.1-104, 6.1-145
  - *AVERAGE ON/OFF* 4.16-5, 6.1-75, 6.1-76, 6.1-78, 6.1-79, 6.1-80
  - *AVG MODE LOG/LIN* 4.11-5, 6.1-84, 6.1-146
  - *BLANK* 4.11-4, 6.1-104
  - *BRIGHTNESS* 4.18-6, 4.21-8, 6.1-99, 6.1-107
  - *C/N* 4.16-32, 4.16-33
  - *C/No* 4.16-33
  - *CAL ABORT* 4.12-2, 6.1-92
  - *CAL CORR ON/OFF* 4.12-2, 6.1-93
  - *CAL GEN 128 MHZ* 4.19-25, 6.1-94
  - *CAL GEN COMB* 4.19-25, 6.1-94, 6.1-95
  - *CAL REFL OPEN* 4.22-12, 4.23-9, 6.1-153
  - *CAL REFL SHORT* 4.22-12, 4.23-9, 6.1-153
  - *CAL RESULTS* 4.12-3, 6.1-93
  - *CAL TOTAL* 4.12-1, 6.1-92
  - *CAL TRANS* 4.22-6, 4.23-4, 6.1-153
  - *CCDF ON/OFF* 4.16-28, 6.1-85, 6.1-88
  - *CCVS INT / EXT* 4.10-8, 6.2-185
  - *CENTER* 4.5-2, 6.1-160
  - *CENTER = MKR FREQ* 4.15-2, 6.1-56
  - *CENTER A = MARKER B* 4.18-3, 6.1-117
  - *CENTER B = MARKER A* 4.18-3, 6.1-117
  - *CF STEPSIZE* 6.1-160
  - *CHAN POWER ACP* 6.1-65
  - *CHAN PWR / HZ* 4.16-17, 6.1-69
  - *CHAN PWR ACP* 4.16-9
  - *CHANNEL BANDWIDTH* 4.16-23, 4.16-33, 6.1-177
  - *CHANNEL SPACING* 6.1-176
  - *CLEAR ALL MESSAGES* 4.19-23, 6.2-210, 6.2-211
  - *CLEAR/WRITE* 4.11-2, 6.1-104
  - *CNT RESOL* 6.1-42
  - *CNT RESOL* 4.13-4
  - *CODE DOM ANALYZER* 6.1-93
  - *COLOR ON/ OFF* 6.1-108
  - *COLOR ON/OFF* 4.21-6
  - *COLORS* 4.21-3, 4.21-6
  - *COM INTERFACE* 4.19-12, 6.2-207
  - *COMMENT SCREEN A/B* 6.1-110
  - *CONFIGURE NETWORK* 4.19-16
  - *CONT DEMOD* 4.14-10, 6.1-53
  - *CONT MEAS* 4.16-31, 6.1-111, 6.1-112
  - *CONTINUE SGL SWEEP* 4.9-2, 6.1-111, 6.1-112
  - *CONTINUOUS SWEEP* 4.9-1, 6.1-111, 6.1-112
  - *COPY* 4.20-15, 4.20-16, 6.1-121
  - *COPY LIMIT LINE* 4.17-5, 6.1-20
  - *COPY TRACE* 4.11-8
  - *COUPLING DEFAULT* 6.1-148, 6.1-182
  - *COUPLING RATIO* 6.1-148
  - *CP/ACP ABS/REL* 4.16-17, 6.1-178
  - *CP/ACP CONFIG* 4.16-14, 6.1-22, 6.1-176
  - *CP/ACP ON/OFF* 4.16-9, 6.1-65, 6.1-66, 6.1-70
  - *CP/ACP STANDARD* 4.16-10, 6.1-70
  - *DATA SET CLEAR* 4.20-11, 6.1-126
  - *DATA SET CLEAR ALL* 4.20-11, 6.1-126
  - *DATA SET LIST* 4.20-11
  - *DATAENTRY OPAQUE* 4.18-4
  - *dBm* 4.7-2, 6.1-91, 6.2-226
  - *dBmV* 4.7-2, 6.1-91, 6.2-226
  - *dBpW* 4.7-2, 6.1-91, 6.2-226
  - *dBμA* 4.7-2, 6.1-91, 6.2-226
  - *dBμV* 4.7-2, 6.1-91, 6.2-226
  - *DECIM SEP* 4.11-8, 4.20-17, 6.1-105
  - *DEFAULT COLORS* 4.18-4, 6.1-98, 6.1-106
  - *DEFAULT CONFIG* 4.20-10, 6.1-128
  - *DEFAULT SETTINGS* 4.16-30, 6.1-87
  - *DELETE* 4.19-5, 4.20-15, 6.1-122, 6.1-125, 6.1-155
  - *DELETE LIMIT LINE* 4.17-5, 6.1-21
  - *DELETE LINE* 4.19-9

DELETE VALUE 4.17-10
DETECTOR 4.11-11, 6.1-157
DETECTOR AUTOPEAK 4.11-11, 6.1-157
DETECTOR AVERAGE 4.11-13, 6.1-157
DETECTOR MAX PEAK 4.11-12, 6.1-157
DETECTOR MIN PEAK 4.11-12, 6.1-157
DETECTOR QPK 4.11-13, 6.1-157
DETECTOR RMS 4.11-12, 6.1-157
DETECTOR SAMPLE 4.11-12, 6.1-157
DEVICE 1/2 4.21-2, 6.1-108, 6.1-109, 6.1-110, 6.1-125, 6.2-209
DISPLAY LINE 1 4.17-12
DISPLAY PWR SAVE 4.18-5, 6.1-98
DITHER ON OFF 6.1-162
EDIT 4.19-5, 4.19-6, 6.1-154
EDIT ACP LIMITS 4.16-19, 6.1-22, 6.1-23, 6.1-24, 6.1-25,6.1-26, 6.1-27, 6.1-28, 6.1-29
EDIT COMMENT 4.20-8, 6.1-128
EDIT LIMIT LINE 4.17-7, 6.1-19, 6.1-31, 6.1-32, 6.1-34, 6.1-35, 6.1-36, 6.1-37, 6.1-38
EDIT PATH 4.20-8, 4.20-14, 6.1-120, 6.1-125
ENABLE ALL ITEMS 4.20-10, 6.1-127
ENTER PASSWORD 4.19-25, 6.2-213
EXCLUDE LO 4.15-8, 6.1-43
EXT AM 4.22-17
EXT FM 4.22-17
EXT I/Q 4.22-18
EXT SOURCE 4.23-12
EXT SRC ON/OFF 4.23-12, 6.2-190
EXTERN 4.10-2, 6.1-185, 6.2-223
FAST ACP ON/OFF 4.16-12, 6.1-180
FILE MANAGER 4.20-13, 6.1-120
FILTER NORM/FFT 6.1-148
FILTER ON OFF 6.1-162
FILTER TYPE 6.1-149
FIRMWARE UPDATE 4.19-27, 6.2-211
FM 4.14-10, 6.1-52, 6.2-223
FORMAT DISK 4.20-17, 6.1-122
FREE RUN 4.10-1, 6.2-223
FREQUENCY LINE 1/2 4.17-12
FREQUENCY OFFSET 4.5-5, 4.22-15, 4.23-11, 6.1-162
FREQUENCY SWEEP 4.23-15, 6.2-191, 6.2-192
FULL SCREEN 4.18-2, 6.1-98
FULL SIZE DIAGRAM 4.16-12
FULL SPAN 4.6-1, 6.1-161
GATE DELAY 4.10-6, 6.1-184
GATE LENGTH 4.10-6, 6.1-184
GATE MODE LEVEL/EDGE 4.10-5, 6.1-184
GATE SETTINGS 4.10-5, 6.1-183
GATED TRIGGER 4.10-4, 6.1-183, 6.1-185
GEN REF INT/EXT 4.23-16
GENERAL SETUP 4.19-10
GPIB 4.19-10
GPIB ADDRESS 4.19-10, 6.2-204
GPIB LANGUAGE 4.19-11
GRID ABS/REL 4.7-4, 6.1-102
GRID MIN LEVEL 6.1-103
HARDCOPY ABORT 6.1-106
HARDWARE INFO 4.19-21, 6.1-6, 6.1-96
HOR SYNC 4.10-8, 6.2-225
ID STRING FACTORY 4.19-10
ID STRING USER 4.19-10
IF POWER 4.10-2, 6.1-185, 6.2-223, 6.2-224
INPUT CAL 4.19-24, 4.19-25, 6.1-94, 6.1-95
INPUT RF 4.19-24, 4.19-25, 6.1-94
INSERT VALUE 4.17-10
INSTALL OPTION 4.19-18
ITEMS TO SAVE/RECALL 4.20-9, 6.1-126
LAST SPAN 4.6-2
LEFT LIMIT 4.14-8, 4.15-3, 6.1-40, 6.1-41
LIMIT ON/OFF 4.16-4, 6.1-40
LINES 625 / 525 4.10-8, 6.2-225
LOCAL 4.3-1, 5.6
LOGO ON/OFF 4.18-4, 6.1-98
MAKE DIRECTORY 4.20-14, 6.1-124
MANUAL 4.5-3
MARKER 1 to 4 4.13-2, 6.1-10, 6.1-11, 6.1-39, 6.1-40, 6.1-43
MARKER DEMOD 4.14-9, 6.1-52
MARKER NORM/DELTA 4.13-2, 6.1-9
MARKER ZOOM 4.13-7, 6.1-51
MAX HOLD 4.11-2, 6.1-104
MAX HOLD ON/OFF 4.16-5, 6.1-75, 6.1-77, 6.1-78, 6.1-80
MEAN 4.16-4, 6.1-77
MIN 4.15-5, 6.1-12, 6.1-45
MIN HOLD 4.11-5, 6.1-104
MIXER LOW NOISE 4.7-3
MKR -> CF STEPSIZE 4.15-5, 6.1-56
MKR -> TRACE 4.13-3, 4.14-10, 4.15-4, 6.1-10, 6.1-40
MKR DEMOD ON/OFF 4.14-9, 6.1-53
MKR STOP TIME 4.14-10, 6.1-53
MODULATION 4.22-16
MODULATION DEPTH 4.16-34, 6.1-54
MODULATION OFF 4.22-18
MULT CARR ACP 4.16-9
N dB DOWN 4.14-6, 6.1-49, 6.1-50, 6.1-51
NAME 4.17-7, 6.1-19, 6.1-20, 6.1-21, 6.1-31, 6.1-32, 6.1-35, 6.1-37
NETWORK 4.23-1
NETWORK 4.23-2
NETWORK LOGIN 4.19-17
NEW 4.19-5, 4.19-6
NEW LIMIT LINE 4.17-7, 6.1-19, 6.1-20, 6.1-21, 6.1-31, 6.1-32, 6.1-34, 6.1-36
NEXT MIN 4.15-5, 6.1-13, 6.1-45, 6.1-46
NEXT MIN LEFT 4.15-5
NEXT MIN RIGHT 4.15-5
NEXT PEAK 4.15-2, 6.1-12, 6.1-13, 6.1-44
NEXT PEAK LEFT 4.15-3
NEXT PEAK RIGHT 4.15-3
NO OF SAMPLES 4.16-29, 6.1-86
NO. OF ADJ CHAN 4.16-14, 6.1-177
NO. OF TX CHAN 4.16-14, 6.1-176
NOISE CORR ON/OFF 4.16-11, 6.1-180
NOISE MEAS 4.14-2, 6.1-52
NOISE SRC ON/OFF 4.19-2, 6.1-95
NORMALIZE 4.22-7, 4.23-5, 6.1-153
NUMBER OF SWEEPS 4.16-6, 6.1-183
OCCUP BW ON/OFF 4.16-23, 6.1-65, 6.1-66, 6.1-70
OCCUPIED BANDWIDTH 4.16-23, 6.1-65
OPTIMIZED COLORS 4.21-7
OPTIONS 4.19-18
PEAK 4.14-2, 4.15-2, 4.16-3, 6.1-11, 6.1-44, 6.1-74
PEAK EXCURSION 4.14-8, 4.15-6, 6.1-46
PEAK LIST 4.14-7, 6.1-47
PEAK LIST OFF 4.14-8, 6.1-47
PEAK SEARCH 4.14-6, 4.14-8
PERCENT MARKER 4.16-28, 6.1-43
PH NOISE ON/OFF 4.14-5, 6.1-15
PHASE NOISE 4.14-4, 6.1-15
POLARITY POS/NEG 4.10-2, 4.10-5, 6.1-184, 6.2-225
POWER ABS/REL 4.16-5, 6.1-81
POWER ON/OFF 4.16-3, 6.1-74, 6.1-76, 6.1-77, 6.1-79, 6.1-81
PREAMP 4.19-3, 6.1-115
PREDEFINED COLORS 4.18-6, 4.21-8, 6.1-100, 6.1-107
PRINT SCREEN 4.10-6, 4.21-2, 6.1-109, 6.1-125
PRINT TABLE 4.21-2, 6.1-109, 6.1-110, 6.1-125
PRINT TRACE 4.21-2, 6.1-109, 6.1-110, 6.1-125
PWR OFFSET 4.22-3, 4.23-2
RANGE LIN % dB 6.1-103

RANGE LINEAR 4.7-2, 6.1-103
RANGE LINEAR % 4.7-2
RANGE LINEAR dB 4.7-2
RANGE LOG 100 dB 4.7-1, 6.1-103
RANGE LOG MANUAL 4.7-2, 6.1-103
RBW / VBW MANUAL 6.1-150
RBW / VBW NOISE [10] 6.1-150
RBW / VBW PULSE [.1] 6.1-150
RBW / VBW SINE [1/3] 6.1-150
RECALL 4.20-7, 4.23-8, 6.1-123, 6.1-154
REF FXD ON/OFF 4.13-5, 6.1-13
REF LEVEL 4.7-1, 6.1-102
REF LEVEL = MKR LVL 4.15-2, 6.1-56
REF LEVEL COUPLED 4.18-3, 6.1-117
REF LEVEL OFFSET 4.7-4, 6.1-102
REF LEVEL POSITION 4.7-4, 6.1-103
REF POINT FREQUENCY 4.13-5, 4.14-6, 6.1-15
REF POINT LEVEL 4.13-5, 4.14-5, 6.1-14
REF POINT LVL OFFSET 4.13-5, 4.14-5, 6.1-14
REF POINT TIME 4.13-6, 6.1-15
REF POINT x-LEVEL 4.13-6, 6.1-15
REF VALUE 4.22-9, 4.23-7, 6.1-102
REF VALUE POSITION 4.22-8, 4.23-6, 6.1-103
REFERENCE FIXED 4.13-5, 6.1-13
REFERENCE INT/EXT 4.19-2, 6.1-181
REMOVE OPTION 4.19-18
RENAME 4.20-15, 6.1-124
RES BW 4.16-29, 6.1-147
RES BW AUTO 6.1-148
RES BW MANUAL 6.1-147, 6.1-148
RESTORE FIRMWARE 4.19-27
RF ATTEN AUTO 4.7-3, 6.1-114
RF ATTEN MANUAL 4.7-3, 4.7-5, 6.1-113
RF INPUT 50 Ω / 75 Ω 4.7–4, 6.1-115
RF INPUT AC/DC 4.7-3
RF POWER 4.10-8, 6.2-223, 6.2-224
RIGHT LIMIT 4.14-8, 4.15-3, 6.1-40, 6.1-41
RMS 4.16-3, 6.1-76
SATURATION 4.18-6, 4.21-8, 6.1-99, 6.1-107
SAVE 4.20-6, 6.1-125
SAVE LIMIT LINE 4.17-10
SAVE TRD FACTOR 4.19-9
SCALING 4.16-29, 6.1-86
SCREEN COLORS 4.21-7
SCREEN TITLE 4.18-4, 6.1-101
SEARCH LIMIT OFF 4.15-4, 6.1-40
SEARCH LIMITS 4.15-3, 6.1-40
SEARCH NEXT LEFT 6.1-12, 6.1-13, 6.1-46
SEARCH NEXT RIGHT ... 6.1-12, 6.1-13, 6.1-44, 6.1-46
SELECT GENERATOR 4.23-13, 6.2-205, 6.2-206
SELECT ITEMS 4.20-10, 6.1-126, 6.1-127
SELECT LIMIT LINE 4.17-3, 6.1-19, 6.1-20, 6.1-34, 6.1-37
SELECT MARKER 4.14-2, 4.15-1, 4.16-37, 6.1-39
SELECT OBJECT 4.18-5, 4.21-7
SELECT TRACE 4.5-5, 4.11-2, 4.16-19, 6.1-72, 6.1-180
SELFTEST 4.19-26, 6.1-7
SELFTEST RESULTS 4.19-26, 6.1-96
SERVICE 4.19-24, 6.1-94
SET CP REFERENCE 4.16-11, 6.1-178
SET REFERENCE 4.16-5, 6.1-81
SET TO DEFAULT 4.21-8
SGL SWEEP DISP OFF 4.9-3, 6.1-112
SHIFT X LIMIT LINE 4.17-10, 6.1-32
SHIFT Y LIMIT LINE 4.17-10, 6.1-38
SIGNAL COUNT 4.13-4, 6.1-42
SIGNAL STATISTIC 4.16-28
SIGNAL TRACK 4.5-5, 6.1-71
SINGLE MEAS 4.16-31, 6.1-111, 6.1-112
SINGLE SWEEP 4.9-1, 6.1-111, 6.1-112
SOFT FRONTPANEL 4.19-19
SORT MODE 4.20-16
SORT MODE FREQ/LEVEL 4.14-8
SOURCE CAL 4.22-5, 4.23-3
SOURCE ON/OFF 4.22-2
SOURCE POWER 4.22-3, 4.23-2, 6.2-189, 6.2-192
SPAN MANUAL 4.6-1, 6.1-161
SPAN/RBW AUTO [50] 6.1-148
SPAN/RBW MANUAL 6.1-148
SPLIT SCREEN 4.18-2, 6.1-98
STANDARD DEVIATION 4.16-4, 6.1-79
START 4.5-4, 6.1-161
START LIMIT 4.16-4, 4.16-5, 6.1-41
STARTUP RECALL 4.20-12, 6.1-124
STATISTICS 4.19-22, 6.1-5
STEPSIZE MANUAL 4.5-4
STOP 4.5-4, 6.1-162
STOP LIMIT 4.16-4, 4.16-5, 6.1-41
SWEEP COUNT 4.9-2, 4.11-4, 6.1-183
SWEEP POINTS 4.9-3, 6.1-185
SWEEPTIME AUTO 4.9-2, 6.1-182
SWEEPTIME MANUAL 4.6-1, 4.9-2, 6.1-182
SYSTEM INFO 4.19-20
SYSTEM MESSAGES 4.19-23, 6.2-210, 6.2-211
T1-T2 .... 4.11-14, 6.1-83
T1-T3 .... 4.11-14, 6.1-83
THRESHOLD 4.14-8, 4.15-4, 6.1-89, 6.1-90
TIME DOM POWER 4.16-2, 6.1-74, 6.1-76, 6.1-77, 6.1-79
TIME LINE 1/2 .... 4.17-12
TIME+DATE 4.19-15, 6.2-210, 6.2-214
TIME+DATE ON/OFF 4.18-4, 6.1-101
TINT 4.18-6, 4.21-8, 6.1-99, 6.1-107
TOI 4.16-36, 6.1-55
TRACE MATH 4.11-14, 6.1-83
TRACE MATH OFF 4.11-14, 6.1-84
TRACE POSITION 4.11-14, 6.1-83
TRACK BW 4.5-5, 6.1-71
TRACK ON/OFF 4.5-5, 6.1-71
TRACK THRESHOLD 4.5-5, 6.1-72
TRACKING 4.22-2
TRANSDUCER 4.19-4, 6.1-154
TRANSDUCER FACTOR 4.19-4, 6.1-154, 6.1-155
TRIGGER OFFSET 4.10-2, 6.2-224
TV TRIG SETTINGS 4.10-8
TV TRIGGER ON/OFF 4.10-8, 6.2-185
UNIT 4.7-2, 6.1-91, 6.2-226
USER DEFINED 4.21-7
VALUES 4.17-10, 6.1-31, 6.1-33, 6.1-36
VBW LIN LOG 6.1-150
VERT SYNC 4.10-8, 6.2-225
VERT SYNC EVEN FIELD 4.10-8, 6.2-225
VERT SYNC ODD FIELD 4.10-8, 6.2-225
VIDEO 4.10-1, 6.2-223, 6.2-224
VIDEO BW AUTO 6.1-149
VIDEO BW MANUAL 6.1-149
VIDEO POL POS / NEG 4.10-8, 6.2-225
VIEW 4.11-4, 6.1-104
VOLT 4.7-2, 6.1-91, 6.2-226
WATT 4.7-2, 6.1-91, 6.2-226
X * RBW 4.5-3, 6.1-160, 6.1-161
X * SPAN 4.5-2, 6.1-160, 6.1-161
X OFFSET 4.17-5, 6.1-32
X-AXIS RANGE 4.16-30, 6.1-87
X-AXIS REF LEVEL 4.16-29, 6.1-86
Y OFFSET 4.17-5, 6.1-34, 6.1-37
Y-AXIS MAX VALUE 4.16-30, 6.1-87
Y-AXIS MIN VALUE 4.16-30, 6.1-87
YIG CORR ON/OFF 4.12-2
ZERO SPAN 4.6-1, 6.1-161
ZOOM x-AXIS 4.10-6

- Softkey
  - ACLR 6.1-93
  - CCDF 6.1-93
  - CHAN TABLE VALUES 6.1-93
  - OCCUPIED BANDWIDTH 6.1-93
  - POWER 6.1-93
  - RESTORE STD TABLES 6.1-93
  - SPECTRUM EM MASK 6.1-93
- SoftkeyGRID MIN LEVEL 6.1-103
- Span 4.6-1
- Special characters 6.1-2
- Spectrum analyzer mode 4.5.1
- Spinwheel 3.13
- Split screen 3.9, 4.18-2
- Squelch 4.14-9
- SRE (service request enable register) 5.21
- SRQ (service request) 5.21, 5.32
- Standard deviation 4.16-4
- Standard, mobile radio 4.16-10
- Start frequency 4.5-4
- Statistics 4.16-26
- Status byte (STB) 5.21
- Status information 3.5
  - IFOVL 3.5
  - OVEN 3.5
  - OVLD 3.5
  - UNCAL 3.5
- STATus OPERation register 5.24
- STATus QUEStionable register 5.25
  - ACPLimit register 5.26
  - FREQuency register 5.27
  - LIMit register 5.28
  - LMARgin register 5.29
  - POWer register 5.30
  - SYNC 5.31
- Status register
  - CONDition part 5.19
  - ENABle part 5.19
  - ESE 5.22
  - ESR 5.22
  - EVENt part 5.19
  - NTRansition part 5.19
  - overview 5.20
  - PPE 5.22
  - PTRansition part 5.19
  - SRE 5.21
  - STATus OPERation 5.24
  - STATus QUEStionable ACPLimit 5.26
  - STATus QUEStionable FREQuency 5.27
  - STATus QUEStionable LIMit 5.28
  - STATus QUEStionable LMARgin 5.29
  - STATus QUEStionable POWer 5.30
  - STATus QUEStionable SYNC 5.31
  - STB 5.21
  - structure 5.18
  - sum bit 5.19
- Status reporting system 5.18
  - resetting values 5.34
- STB (status byte) 5.21
- Stepsize 4.5-4
  - center frequency 4.5-2
  - coupling 4.5-4
- Stop frequency 4.5-4
- Store
  - trace 4.20-17
- Storing 8.1
- String 5.14
- Suffix 5.11
- Sum bit 5.19
- Supply voltage, external noise source 4.19-2
- Sweep
  - continue single sweep 4.9-2
  - continuous 4.9-1
  - count 4.9-2
  - free run 4.10-1
  - gated 4.10-3, 4.10-4
  - settings 4.9-1
  - single 4.9-1
  - time 4.6-1, 4.9-2
- Switching cycles 4.19-22
- Switching on/off 1.18
- Sync signal 4.10-8
- Syntax elements of commands 5.14
- System messages 4.19-23

T

- T1-T2 (trace info) 3.6
- T1-T3 (trace info) 3.6
- Table
  - operation 3.24
  - scrolling 3.26
- Test
  - functional 1.20
  - selftest 4.19-26
- Text parameter 5.14
- Third Order Intercept 4.16-35
- Threshold
  - line 4.15-4
  - signal tracking 4.5-5
- Time 4.18-4
  - input 4.19-15
  - Line 4.17-12
- Time axis 4.6-1
- Tint 4.18-6
- Title for the active diagram 4.18-4
- TOI 4.16-35
- Trace 4.11-1, 4.11-2
  - average 4.11-3
  - averaging 4.11-5
  - blank 4.11-4
  - Clear/Write 4.11-2
  - copy 4.11-8
  - freeze 4.11-4
  - math 4.11-14
  - max hold 4.11-2
  - min hold 4.11-5
  - position for 0 difference 4.11-14
  - power measurement 4.16-19
  - select 4.11-1
  - signal tracking 4.5-5
- Trace info 3.6
- Tracking generator 4.22-1
- Transducer
  - Activating 4.19-3
  - Entry 4.19-6
- Transmission measurement 4.22-4, 4.23-3
- Transmission parameters RS-232-C/COM 8.8
- TRG (enhancement lable) 3.7
- Trigger
  - external 4.10-2
  - external gate 4.10-4
  - free run 4.10-1
  - gated sweep 4.10-5
  - IF power 4.10-2
  - offset 4.10-2
  - RF power 4.10-8
  - slope 4.10-2
  - sweep 4.10-1
  - video 4.10-1
- TV trigger 4.10-8

U

UNCAL...3.5
Unit
    level axis...4.7-2
    limit line...4.17-8
Unit (key)...3.12
Universal command...8.5
Upper case...6.1-2
USB connection...8.11
User Interface...8.10

V

Vertical sync signal...4.10-8
Video polarity...4.10-8
Video triggering...4.10-1
VIEW (trace info)...3.6
View trace...4.11-4

W

White space...5.14
Windows XP...1.21
    administrator...1.21
    login...1.21
    password...1.21
Windows-XP Servicepacks...1.21

X

XP computer...1.21

Z

Zero span...4.6-1
Zoom...4.13-7
    amplitude...4.11-4
    x-AXIS (gate signal)...4.10-6

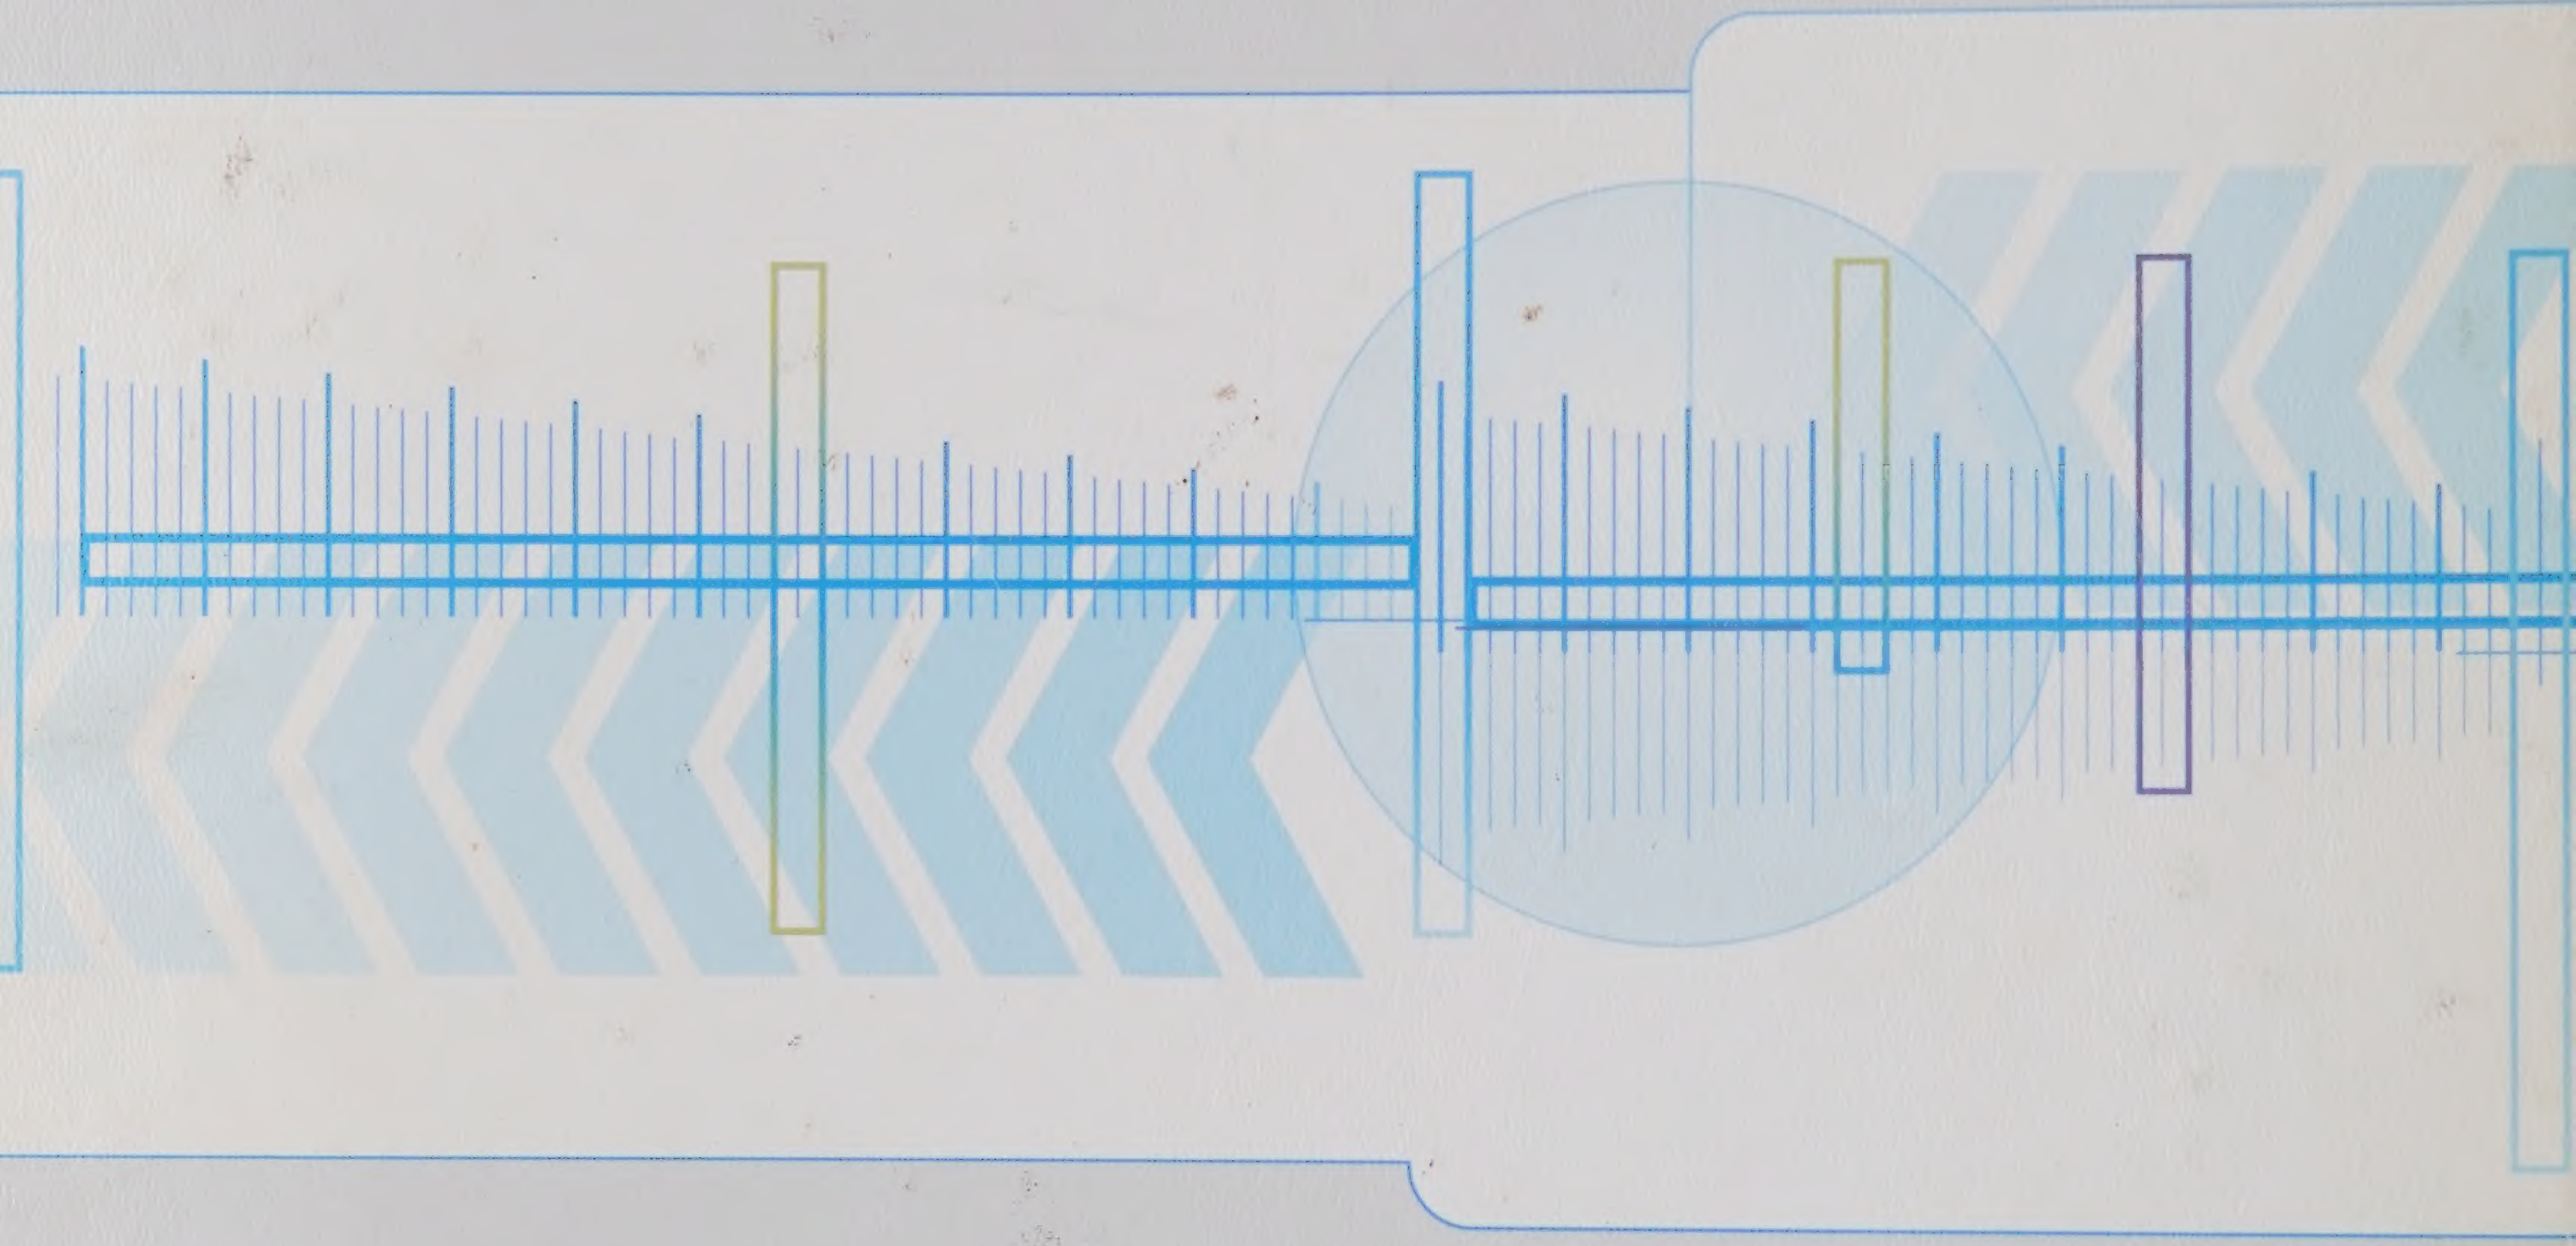

MP MASTER
MA34434

ROHDE&SCHWARZ